

CHECK OUT OUR NEW ANTI-COUNTERFEIT PROGRAMME

With these 5 features on all new engine parts packaging Federal-Mogul enables you to check reliably that the parts inside are Original Quality.

CHECK THE UNIQUE CODE ONLINE AT WWW.FMECAT.EU

Each Federal-Mogul part has a unique code which is displayed on the labels in an alphanumeric and Data Matrix format. A Data Matrix code is a 2-dimensional (2-D) matrix barcode. The Unique Code can be verified in 3 different ways:

- Typing in the Unique Code
- Reading the 2-D code with a 2-D scanner
- Using a mobile phone (Nokia Nseries, Eseries)

For further details please check www.fmecat.eu

1 LOOK FOR THE HOLOSPOT®
The Holospot® label features a 4-digit alphanumeric code. Please check it to make sure that:

- The 4-digit code appears in rainbow colours using the light of the magnifier and is different on each pack
- The Federal-Mogul logo also appears in the Holospot®. The last 4 digits of the alphanumeric code have to be the same as the ones in the Holospot®

2 CHECK THE UNIQUE CODE ONLINE AT WWW.FMECAT.EU
Each Federal-Mogul part has a unique code which is displayed on the labels in an alphanumeric and Data Matrix format. The Unique Code can be verified in 3 different ways:

- Typing in the Unique Code
- Reading the 2-D code with a 2-D scanner
- Using a mobile phone (Nokia Nseries, Eseries)

3 PROTECTION
Special label design means any attempt to remove or swap the label will result in tearing

4 PERMANENT SELF-ADHESIVE LABEL
Seals the box with label detail on the front

5 CRASH LOCK BOX BOTTOM
Prevents any attempt to remove or exchange items as it is impossible to reseal once opened

Check the Unique Code online at www.fmecat.eu



2010-2011

CATAE902

FEDERAL MOGUL

2010 2011

CATAE902



Belts and Timing Belt Kits
Riemen und Steuerriemensätzen
Cinghie e Kit Cinghie di Distribuzione
Courroies et Kits
Correas y Kits de Distribución
Paski i Komplety Pasków Rozrządu
Ремни и Комплекты ГРМ
سيور واطقم سيور كتيه

FEDERAL MOGUL



GLYCO



Nival

Payen

www.fmecat.eu

FEDERAL MOGUL

tti technical training institute



CATAE902

www.fmecat.eu

FEDERAL MOGUL



GLYCO



Nival

Payen

www.fmecat.eu



TOP ENGINE EXPERT



- Belts, Timing Belt Kits, Valvetrain and Camtrain by AE
- Widest range of top engine applications
- OE supplier technology you can count on



www.fmecat.eu



**Federal-Mogul Corporation
Central Distribution Centre**
Prins Boudewijnlaan 7 • B-2550 Kontich • Belgium
Phone +32 (0) 3450 8310 • Fax +32 (0) 3450 8338



**Federal-Mogul Italy Srl
Aftermarket Division**
Via Enrico Fermi 8 • 37135 Verona • Italy
Phone +39 045 828 13 11 • Fax +39 045 828 14 00



**Federal-Mogul Friction Products GmbH
Federal-Mogul Aftermarket**
Klosterstraße 16 • D-51709 Marienheide • Germany
Phone +49 (0) 2264 89 0 • Fax +49 (0) 2264 89 266



Federal-Mogul Aftermarket UK Limited
Greyhound Drive • Bradford • BD7 1NQ • England
Phone +44 (0) 1274 723481 • Fax +44 (0) 1274 848282



Federal-Mogul Ibérica S.L.
Avda.1ª del Parc Logístic, no 5 - 7 • Políg. Zona Franca • 08040 Barcelona • Spain
Phone +34 902 33 76 36 • Fax +34 902 21 31 23



Federal-Mogul Aftermarket España S.A.
Mario Roso de Luna, 41. Nave 6 • Polígono Fin de Semana • 28022 Madrid • Spain
Phone +34 91 746 1900 • Fax +34 91 746 1890



Federal-Mogul Aftermarket France
60-62, rue Danjou • 92517 Boulogne-Billancourt Cedex • France
Phone +33 (0) 1 46 94 27 00 • Fax +33 (0) 1 46 94 27 01
Service Commande de stock :
Phone +33 (0) 810 000 029 • Fax +32 34 50 80 26
Service Commande express :
Phone +33 (0) 810 000 029 • Fax +33 (0) 1 46 94 27 01



**Federal-Mogul Aftermarket
Southern Africa (PTY) Ltd**
33 Western Boulevard • City West • Johannesburg • South Africa
Phone +27 11 630 3000 • Fax +27 11 630 3040



Federal-Mogul Aftermarket Turkey
Meclisi, Mebusan Caddesi, No: 133 • Findikli - Istanbul 80040 • Turkey
Phone +90 212 292 6313 • Fax +90 212 292 6260



www.fmecat.eu

	Symbols	Symbole	Simboli	Symboles	Símbolos	Symbole	Символы	الرموز
	ABS pump	ABS-Pumpe	Pompa ABS	Pompe ABS	Bomba ABS	Pompa ABS	Насос системы ABS	مضخة ABS
	Additional information	Zusatz-information	Ulteriori informazioni	Complément d'information	Información adicional	Dodatkowe informacje	Дополнительная информация	معلومات إضافية
	Air compressor	Luftkompressor	Compressore aria	Compresseur d'air	Compresor de aire	Sprężarka powietrza	Воздушный компрессор	ضامط الهواء
	Aircon compressor	Klimakompressor	Compressore aria condizionata	Compresseur de climatisation	Compresor de aire acondicionado	Sprężarka klimatyzacji	Компрессор климатической установки	ضامط مكيف الهواء
	Air pump	Luftpumpe	Pompa aria	Pompe pneumatique	Bomba de aire	Pompa powietrza	Воздушный насос	مضخة هواء
	Alternator	Generator	Alternatore	Alternateur	Alternador	Alternator	Генератор	بنيل
	Alternator 1	1. Generator	1° Alternatore	1er alternateur	Alternador 1	Alternator 1	1-й генератор	بنيل 1
	Alternator 2	2. Generator	2° Alternatore	2ème alternateur	Alternador 2	Alternator 2	2-й генератор	بنيل 2
	Balancer shaft	Ausgleichswelle	Contalbero di bilanciamento	Arbre d'équilibrage	Eje compensador	Walek wyrównawczający	Упорная шайба	عمود التوازن
	Camshaft	Nockenwelle	Albero a camme	Arbre à cames	Árbol de levas	Walek rozrządu	Распр. вал	عمود الترك
	Dimensions	Abmessungen	Dimensione	Cotes dimensionnelles	Dimensiones	Wymiary	Габаритные размеры	أبعاد
	Driven unit	Angetriebenes Aggregat	Rinvio	Organe entraîné	Conjunto conductor	Elementy napędzane	Блок привода	وحدةدارة
	Fan	Lüfter	Ventola	Ventilateur	Ventilador	Wentylator	Вентилятор	مروحة
	Hydraulic pump	Hydraulikpumpe	Pompa idraulica	Pompe hydraulique	Bomba hidráulica	Pompa płynu	Гидравлический насос	مضخة هيدروليكية
	Ignition Distributor	Zündverteiler	Distributore accensione	Distributeur d'allumage	Distribuidor de encendido	Kopułka dystrybutora	Распределитель системы зажигания	موزع الإشعال
	Injection pump	Einspritzpumpe	Pompa iniezione	Pompe d'injection	Bomba de inyección	Pompa wtryskowa	Впрыскивающий насос	مضخة الحقن
	Jockey pulley	Spannrolle	Puleggia tendi cinghia	Poulie de tension	Polea intermedia	Naręcznik	Направляющий шкив	بكرة شدادة
	Engine	Motor	Motore	Moteur	Motor	Silnik	Двигатель	المحرك
	Model Year	Modelljahr	Anno Modello	Année modèle	Año de fabricación	Model Roczniak	Год модели	عام تصنيع الطراز
	Multi V-ribbed belt (MVB)	Kettrippriemen (Mehrrippriemen)	Cinghia Poli-V (MVB)	Courroie trapézoïdale multiple	Correa estriada (MVB)	Pasek wielo V-rowkowy (MVB)	Поликлиновый ремень (MVB)	حزام متعدد التضلع على شكل V (MVB)
	Power-steering pump	Servolenkungs-pumpe	Pompa servosterzo	Pompe de direction assistée	Bomba de la dirección asistida	Pompa wspomagania kierowniczego	Насос усилителя рулевого управления	منظمة مضخة توجيه العجلة
	Regulator	Regler	Regolatore	Régulateur	Regulador	Regulator	Регулятор	المضخة
	Single V-ribbed belt (SVB)	Kettrippriemen (Einrippriemen)	Cinghia dentata trapezoidale (SVB)	Courroie trapézoïdale simple	Correa trapezoidal (SVB)	Pojedynczy pasek klinowy (SVB)	Одноклиновый ремень (SVB)	حزام مفرد التضلع على شكل V (SVB)
	Timing belt (TB)	Steuerriemen	Cinghia di distribuzione	Courroie de distribution	Correa de distribución (TB)	Pasek rozrządu (TB)	Ремень привода газораспределительного механизма (ГРМ)	حزام التوقيت (TB)
	Timing belt kit (TBK)	Steuerriemensatz	Kit cinghia di distribuzione	Kit de courroie de distribution	Kit de distribución (TBK)	Zestaw paska rozrządu (TBK)	Комплект ремня ГРМ	عدة حزام التوقيت (TBK)
	Vacuum pump	Unterdruckpumpe	Pompa a vuoto	Pompe à vide	Bomba de vacío	Pompa podciśnienia	Вакуумный насос	مضخة تفريغ
	Vehicle types	Fahrzeugtypen	Tipi di veicolo	Types de véhicules	Tipo de vehículo	Typ pojazdu	Типы автомобилей	أنواع المركبات
	Waterpump	Wasserpumpe	Pompa acqua	Pompe à eau	Bomba de agua	Pompa wody	Водный насос	مضخة مياه
	For vehicles with aircon	Für Fahrzeuge mit Klimaanlage	Per veicoli con aria condizionata	Pour véhicules avec système de climatisation	Para vehículos con aire acondicionado	Do samochodów z klimatyzacją	Для автомобилей с кондиционером	لمركبات مزود بمكيف الهواء
	For vehicles without aircon	Für Fahrzeuge ohne Klimaanlage	Per veicoli senza aria condizionata	Pour véhicules sans système de climatisation	Para vehículos sin aire acondicionado	Do samochodów bez klimatyzacji	Для автомобилей без кондиционера	المركبات بدون مكيف الهواء
	Vibration damper included	Schwingungsdämpfer inklusive	Antivibranti inclusi	Amortisseur de vibrations inclus	Incluye amortiguador de vibraciones	Zawiera tłumik drgań	Демпфер колебаний в комплекте	مضائل الاهتزاز مرفق
	For vehicles with ride height adjust	Für Fahrzeuge mit Niveauregulierung	Per veicoli con impianto correzione altezza sospensioni	Pour véhicules avec correcteur d'assiette	Para vehículos con regulación de nivel	Do samochodów z regulacją wysokości zawieszenia	Для автомобилей с системой регулировки дорожного просвета	المركبات التي بها إمكانية ضبط ارتفاع التركوب
	For vehicles without ride height adjust	Für Fahrzeuge ohne Niveauregulierung	Per veicoli senza impianto correzione altezza sospensioni	Pour véhicules sans correcteur d'assiette	Para vehículos sin regulación de nivel	Do samochodów bez regulacji wysokości zawieszenia	Для автомобилей без системы регулировки дорожного просвета	المركبات التي ليس بها إمكانية ضبط ارتفاع التركوب
	For vehicles with catalyst	Für Fahrzeuge mit Katalysator	Per veicoli con catalizzatore	Pour véhicules catalysés	Para vehículos con catalizador	Do samochodów z katalizatorem	Для автомобилей с катализатором	المركبات التي بها عامل مساعد
	For vehicles without catalyst	Für Fahrzeuge ohne Katalysator	Per veicoli senza catalizzatore	Pour véhicules non catalysés	Para vehículos sin catalizador	Do samochodów bez katalizatora	Для автомобилей без катализатора	المركبات التي ليس بها عامل مساعد
	Kilowatt	Kilowatt	KW	Kilowatt	Kilowatts	Kilowatt	Мощность (kW)	كيلوواط
	Manual steering	Manuelle Lenkung	Sterzo manuale	Direction manuelle	Dirección manual	Układ kierowniczy bez wspomagania	Рулевое управление без усилителя	التقادة اليدوية
	Power-steering	Servolenkung	Servosterzo	Direction assistée	Dirección asistida	Układ kierowniczy ze wspomaganiam	Рулевое управление с усилителем	توجيه العجلة
	Left hand drive	Linkslenkung	Guida a sinistra	Conduite à gauche	Dirección de izquierda	Kierownica po lewej stronie	Автомобиль с левосторонним управлением	التقادة يمين اليمين
	Right hand drive	Rechtslenkung	Guida a destra	Conduite à droite	Dirección de derecha	Kierownica po prawej stronie	Автомобиль с правосторонним управлением	التقادة يمين اليسرى

COMPLETE ENGINE EXPERTISE

VALVES

AE

TOP ENGINE EXPERT

FEDERAL MOGUL

BMW Mercedes Renault Peugeot

This advertisement features a blue background with the word 'VALVES' in large, light blue letters at the top. Below it is the 'AE' logo, which consists of a stylized 'A' and 'E' inside a square. Underneath the logo is the text 'TOP ENGINE EXPERT'. The central image is a single, polished metal valve. At the bottom, there is a white banner with the 'FEDERAL MOGUL' logo and logos for BMW, Mercedes, Renault, and Peugeot.

BEARINGS

GLYCO

EVERY BEARING YOU NEED

FEDERAL MOGUL

BMW Mercedes Renault Peugeot

This advertisement has a red-to-orange gradient background with the word 'BEARINGS' in large, light orange letters at the top. Below it is the 'GLYCO' logo, which includes a gear icon. Underneath is the text 'EVERY BEARING YOU NEED'. The central image shows a set of three curved bearings. At the bottom, there is a white banner with the 'FEDERAL MOGUL' logo and logos for BMW, Mercedes, Renault, and Peugeot.

PISTON RINGS

GOETZE

THE BEST YOU CAN GET

FEDERAL MOGUL

BMW Mercedes Renault Peugeot

This advertisement features a yellow background with the words 'PISTON RINGS' in large, light yellow letters at the top. Below it is the 'GOETZE' logo, which includes a stylized 'G' icon. Underneath is the text 'THE BEST YOU CAN GET'. The central image shows three black piston rings. At the bottom, there is a white banner with the 'FEDERAL MOGUL' logo and logos for BMW, Mercedes, Renault, and Peugeot.

PISTONS

Niral

GIVES YOU MORE

FITTED WITH
GOETZE
RINGS

FEDERAL MOGUL

BMW Mercedes Renault Peugeot

This advertisement has an orange-to-yellow gradient background with the word 'PISTONS' in large, light orange letters at the top. Below it is the 'Niral' logo in a script font. Underneath is the text 'GIVES YOU MORE'. A circular badge on the left side of the piston says 'FITTED WITH GOETZE RINGS'. The central image is a single piston. At the bottom, there is a white banner with the 'FEDERAL MOGUL' logo and logos for BMW, Mercedes, Renault, and Peugeot.

**Certificate according to BER 1400/2002,
Art. 1 (t), (u)**

We hereby certify that the Federal-Mogul products sold in the European Aftermarket under the brands AE[®], ABEX[®], BERAL[®], CHAMPION[®], DURON[®], FERODO[®], FP DIESEL[®], GLYCO[®], GOETZE[®], MOOG[®], NECTO[®], NÜRAL[®], PAYEN[®], fulfil the quality requirements applicable to the use of spare parts for repair or maintenance of motor vehicles by authorised repairers, as defined in Art. 1. (1) (t), (u) of the Block Exemption Regulation (EC) 1400/2002.

Date: 27/01/2009



Martin Hendricks
Vice President EMEA
Global Aftermarket
Federal-Mogul Corporation



IMPORTANT



Reproduction of this catalogue or parts thereof is only allowed with our explicit permission in writing. Pictorial representations and design are copyrighted. Claims for damages, of any form whatsoever, resulting from details made in this catalogue or from incorrect use, application, storage or handling, are explicitly excluded. Contractual rights and any resulting or related claims based thereon, irrespective of form, initially come into being on the basis of a separate written agreement, in particular on the basis of our general terms of sale and delivery.

All former statements lose their validity with the publication of this catalogue.

The catalogue is not an operating manual for the use and installation of belts and timing belt kits. It does not contain any advice in a legal sense. The catalogue neither replaces the constantly applicable technical regulations – particularly for tolerances – nor the installation and maintenance stipulations of the individual engine manufacturer.

Also, it is not possible to forego the expertise of those carrying out the installation and application. The individual references made in this catalogue for the installation and the application of belts and timing belt kits are instructions solely for the technically qualified specialist and are to be checked and verified by them for their suitability in each case. Federal-Mogul accepts no responsibility for application decisions.

The contents of the catalogue are not intended to create or substitute any contractual agreement which has to be reserved exclusively to a separate agreement between 2 identified parties, whereby seller can be only one of our Federal-Mogul entities as mentioned on the inside back cover.

The right is retained to correct errors and alterations, particularly with regard to amendments in the engine manufacturers' details and stipulations.

ZUR BEACHTUNG



Die Reproduktion dieses Katalogs ist nur mit unserer ausdrücklichen Genehmigung gestattet. Bildliche Darstellungen und der Entwurf sind urheberrechtlich geschützt. Schadenersatzansprüche in jedweder Form unter Berufung auf die Angaben in diesem Katalog oder infolge unsachgemäßen Gebrauchs, unsachgemäßer Anwendung, Lagerung oder Handhabung sind ausdrücklich ausgeschlossen. Vertragliche Rechte und etwaige hieraus folgende oder abgeleitete Ansprüche jedweder Art werden erst durch getrennte schriftliche Vereinbarung, im Besonderen auf der Grundlage unserer allgemeinen Verkaufs- und Lieferbedingungen, begründet.

Mit Erscheinen dieses Katalogs verlieren alle früheren Angaben ihre Gültigkeit.

Der Katalog stellt keine Anleitung für den Gebrauch und den Einbau von Riemen und Steuerriemensätzen dar. Es werden keine Ratschläge im rechtlichen Sinne abgegeben. Der Katalog ersetzt weder die jeweils geltenden technischen Maßgaben – insbesondere für Toleranzen – noch die Einbau- und Wartungsvorschriften des jeweiligen Motorenherstellers.

Auch ist die Sachkenntnis derer, die den Einbau und die Anwendung vornehmen, eine wesentliche Größe. Die Aussagen in diesem Katalog zum Einbau und Einsatz von Riemen und Steuerriemensätzen richten sich ausschließlich an den technisch versierten Fachmann und sind von diesem von Fall zu Fall auf Eignung und Gültigkeit zu überprüfen. Federal-Mogul übernimmt keine Verantwortung für Anwendungsentscheidungen.

Der Inhalt des Katalogs begründet oder ersetzt keine vertragliche Vereinbarung, welche ausschließlich einer getrennten Vereinbarung zwischen zwei bestimmten Parteien vorbehalten sein muss, in der die Verkäuferpartei eine unserer innen im Rückdeckel genannten Federal-Mogul Gesellschaften ist.

Das Recht auf Berichtigung von Irrtümern und Abänderungen, insbesondere hinsichtlich geänderter Angaben und Bestimmungen der Motorenhersteller, bleibt vorbehalten.

IMPORTANTE



La riproduzione di questo catalogo, anche parziale, è permessa soltanto in seguito ad una autorizzazione scritta. I grafici ed i disegni sono depositati e coperti da copyright. Reclami per difetti, di qualsiasi natura essi siano, relativi al contenuto di questo catalogo, o all'uso improprio, verranno respinti. Le pretese avanzate o i reclami dovranno essere in conformità con le nostre condizioni generali di vendita.

Il presente catalogo annulla e sostituisce tutte le edizioni precedenti.

Il catalogo non è un manuale per l'utilizzo ed il montaggio di cinghie e kit cinghie di distribuzione. Non contiene indicazioni in questo senso. Esso non sostituisce le descrizioni tecniche, sempre prioritarie, in particolare per le tolleranze, né le istruzioni relative al montaggio ed alla manutenzione date dai costruttori dei rispettivi motori. Non può in nessun caso essere paragonato alla conoscenza professionale necessaria per il montaggio e l'utilizzo. Le considerazioni sul montaggio di cinghie e kit cinghie di distribuzione, fatte su questo catalogo, sono destinate esclusivamente a professionisti con formazione tecnica i quali verificheranno l'esattezza della informazioni, in ogni caso. Le responsabilità derivanti dall'utilizzo improprio dello stesso non potranno essere addebitate alla Federal-Mogul.

I contenuti del catalogo non sostituiscono in alcun modo gli accordi contrattuali che sono riservati esclusivamente a due contraenti definiti; come venditore si intende una delle società Federal-Mogul menzionate sul retro del catalogo.

Ci riserviamo di apportare correzioni e modifiche, relative in particolare, a dati o istruzioni ricevute dal costruttore del motore.



IMPORTANT



La reproduction de ce catalogue, même partielle, n'est autorisée qu'avec notre accord préalable et par écrit. Les illustrations graphiques et la présentation font l'objet d'un copyright. Nous excluons toutes réclamations ayant pour objet ce catalogue ou pouvant résulter de son incompréhension, portant sur de mauvaises utilisations, manipulations, manutentions ou mauvais stockage. Des droits contractuels et des droits dérivés, de quelque nature qu'ils soient, ne peuvent résulter que d'un accord écrit, sur la base de nos conditions générales de ventes et de livraisons.

Ce catalogue annule et remplace toute édition antérieure.

Le catalogue n'est pas une notice d'utilisation et de montage des courroies et kits. Il ne contient pas de directives en tant que telles. Le catalogue ne remplace ni les prescriptions techniques, toujours prioritaires, particulièrement pour les tolérances, ni les prescriptions de montage et d'entretien des fabricants des moteurs figurant dans ce catalogue. Il ne peut en aucun cas remplacer les connaissances professionnelles nécessaires pour le montage et l'utilisation des produits. Les remarques données pour le montage et l'utilisation des courroies et kits sont exclusivement destinées au professionnel averti et de formation technique, à qui il appartiendra de vérifier la conformité des indications pour chaque cas. La responsabilité quant aux décisions d'utilisation ne peut être prise en charge par Federal-Mogul.

Le contenu de ce catalogue ne peut constituer ou remplacer un contrat qui doit faire l'objet d'un document séparé établi entre 2 parties, dont l'une doit être une entité légale de Federal-Mogul (dont la liste figure sur la couverture arrière).

Nous nous réservons le droit d'apporter toutes corrections d'erreurs et modifications, suite notamment à de nouvelles données fournies par les constructeurs.

IMPORTANTE



Queda totalmente prohibida la reproducción, total o parcial, del contenido de este catálogo, salvo previa autorización nuestra, realizada por escrito. Están, asimismo, reservados todos los derechos sobre el diseño y presentación del catálogo. No se aceptará ningún tipo de reclamación que esté basada en la interpretación de los datos contenidos en este catálogo, así como en el incorrecto uso, manipulación o almacenaje de nuestras piezas. Únicamente se aceptarán reclamaciones que estén basadas en derechos contractuales o en los motivos arriba indicados, siempre que exista un acuerdo especial y por escrito basado en nuestras condiciones generales de venta y suministro.

Con la edición de este catálogo queda anulada toda la información contenida en catálogos anteriores.

El catálogo no es un manual para el uso e instalación de las correas y kits de distribución, y no representa una asesoría técnica en el sentido legal. Los datos del catálogo no sustituyen, en ningún caso, a las especificaciones técnicas, tanto en lo que se refiere a tolerancias como a las instrucciones de instalación y mantenimiento, indicadas por los fabricantes de los motores, especificaciones que serán siempre prioritarias. Se entiende que el uso y montaje de estas piezas está encomendado a personal debidamente cualificado. Las indicaciones sobre uso y montaje de las correas y kits de distribución, contenidas en este catálogo, están exclusivamente dirigidas a profesionales con la debida capacitación y formación técnica, que deben decidir en cada caso sobre la exactitud de las mismas. La responsabilidad de estas decisiones no puede ser, en ningún caso atribuidas a Federal-Mogul.

La información facilitada en el catálogo no representa o sustituye ningún tipo de acuerdo, quedando a tal efecto, el acuerdo por separado entre dos partes donde sólo entidades de Federal-Mogul, pueden ser identificadas como la parte vendedora como se menciona en la contraportada.

Los datos e instrucciones contenidos en este catálogo podrán ser corregidos o modificados sin previo aviso.

WAŻNE



Reprodukcja tego katalogu lub jego części jest możliwa tylko za wyraźną zgodą na piśmie. Ilustracje i grafika są chronione prawem autorskim. Roszczenia dotyczące szkód, niezależnie od formy, wynikających z przedstawionych w tym katalogu treści lub z nieprawidłowego użycia, zastosowania, przechowywania lub obsługi są w sposób wyraźny wyłączone. Prawa umowne i inne wynikające lub związane z roszczeniami na nimi opartymi, niezależnie od formy, są tworzone na podstawie oddzielnej umowy pisemnej, w szczególności na podstawie naszych ogólnych warunków sprzedaży i dostawy.

Wszystkie wcześniejsze oświadczenia tracą ważność wraz z opublikowaniem tego katalogu.

Katalog nie jest instrukcją obsługi i instalacji pasków i kompletów pasków rozrządu. Nie zawiera porad w sensie prawnym. Katalog nie zastępuje obowiązujących uregulowań technicznych – zwłaszcza w zakresie tolerancji – ani opisów montażu i konserwacji poszczególnych producentów silników.

Nie jest również możliwe pominięcie doświadczenia osób dokonujących doboru i przeprowadzających montaż części. Poszczególne odniesienia zawarte w tym katalogu, a dotyczące doboru, montażu i stosowania i pasków i kompletów pasków rozrządu są instrukcjami wyłącznie dla wykwalifikowanego technicznie specjalisty, który w każdym przypadku musi je sprawdzić i zweryfikować ich przydatność. Federal-Mogul nie przyjmuje odpowiedzialności za decyzje dotyczące zastosowania.

Zawartość tego katalogu nie stanowi ani nie zastępuje umowy, która może być zawarta jedynie jako oddzielny dokument podpisany przez dwie strony, przy czym sprzedawcą może być tylko jedna z jednostek concernu Federal-Mogul, zgodnie z opisem na wewnętrznej stronie tylnej okładki.

Zachowane zostaje prawo korygowania błędów i wprowadzania zmian, zwłaszcza odnośnie zmian dotyczących parametrów i warunków pracy określonych przez producentów silników.

Воспроизводство данного каталога или ее частей позволено только с нашим явным разрешением в письменной форме. Иллюстрации и дизайн защищены авторским правом. Требования о возмещении ущерба, любой формы, исходя из содержания каталога или от неправильного использования, хранения или обращения, явно исключены. Договорные права и любые связанные требования базировались вслед за тем, независимо от формы, отдельного первоначально письменного соглашения, в особенности на основе наших общих условий продаж и поставок.

Все прежние утверждения теряют свою юридическую силу с публикацией данного каталога.

Каталог не операционное руководство для использования и установки ремней и комплектов ГРМ. Оно не содержит совета в юридическом смысле. Каталог не заменяет постоянно применимые технические инструкции – особенно при допусках – соглашения установки и обслуживания отдельного автопроизводителя. Кроме того, не возможно предсказать профессионализм тех, кто выполняют установку и ремонт.

Отдельные ссылки в этом каталоге для установки и замены ремней и комплектов ГРМ являются инструкциями исключительно для технически компетентного специалиста и должны быть проверены ими для их пригодности в каждом случае. Federal-Mogul не несет ответственность за ремонтные работы.

Содержание каталога не предназначено, чтобы создавать или заменять любые договорные соглашения, которое должны быть сохранены исключительно к отдельному соглашению между 2мя сторонами, посредством чего продавец может быть только одним из юридических лиц Federal-Mogul как упомянуто на странице обратной стороны.

Сохраняется право, исправлять ошибки и изменения, особенно относительно к поправкам по деталям изготовителей двигателя и их условиям.



لا يُسمح بنسخ هذا الدليل أو أي جزء منه إلا بتصريح كتابي صريح. جميع التمثيلات التصويرية والتصميمات محفوظة بموجب حقوق الطبع والنشر، ولا تتحمل الشركة صراحة أي مطالبات بخسائر، أيًا كانت صورتها، تنشأ عن التفاصيل الواردة في هذا الدليل أو نتيجة لسوء الاستخدام أو التطبيق أو التخزين أو النقل. أي حقوق تعاقدية أو أي مطالبات لها علاقة بتلك الحقوق أو تنشأ تأسيسًا عليها، بغض النظر عن صورتها، تنشأ تأسيسًا على اتفاق كتابي منفصل، وبخاصة تأسيسًا على شروط البيع والتسليم الخاصة بنا.

تفقد كل البيانات السابقة صلاحيتها بمجرد نشر هذا الدليل.

هذا الدليل ليس دليلًا للتشغيل لتوضيح استخدام وتركيب سيور واطقم سيور كتينيه. كما لا يحتوي على أي نصيحة بالمعنى القانوني، ولا يحل هذا الدليل محل القواعد الفنية المطبقة باستمرار خاصة فيما يتعلق بالتحمل، كما لا يحل محل شروط التركيب والصيانة الخاصة بمصنعي المحركات الفردية. كذلك لا يمكن الاستغناء عن خبرة الفنيين الذين يقومون بالتركيب أو التطبيق. وجميع الإشارات الواردة في هذا الدليل والتي تتعلق بتركيب وتطبيق سيور واطقم سيور كتينيه هي إرشادات للمتخصصين الفنيين المؤهلين فحسب ويتم مراجعتها والتأكد من ملاءمتها في كل حالة على حده. ولا تتحمل شركة Federal-Mogul أي مسؤولية تتعلق بقرارات التطبيق.

ليس المقصود بمحتوى هذا الدليل أن يخلق أو يستبدل أي اتفاقات تعاقدية يتم الاحتفاظ بها حصريًا في اتفاقية منفصلة بين طرفين محددين، والتي يمكن أن يكون بموجبها أحد الكيانات التابعة لشركة Federal-Mogul هو الطرف البائع كما هو موضح في الوجه الداخلي للغلاف الخارجي. وتحفظ الشركة بحقها في تصحيح أي أخطاء وإجراء أي تعديلات وبخاصة فيما يتعلق بتعديل تفاصيل مصنع المحرك والأحكام المنصوص عليها.





NEW CATALOGUE



- Excellent coverage: 34,800 LV and 1,050 CV references covering 4,400 engines
- 160 new parts, matching OE quality
- Clear layout with complete engine details

You can obtain the AE catalogue through your Federal-Mogul sales representative or through your local distributor





NEW CATALOGUE



- Widest coverage: 2,476 part numbers covering about 5,000 engines (LV, LCV, CV)
- Clear, visual layout with many new features
- New section emphasizing the Federal-Mogul innovation and technology

You can obtain the Glyco catalogue through your Federal-Mogul sales representative or through your local distributor





GOETZE®



Payen®

NEW CATALOGUE




- Broad coverage: 10,000 LV and LCV applications with 850 Federal-Mogul seals
- New part numbers are highlighted in numerical parts list, i.e. 48 Goetze & Payen new part numbers
- Two methods of selection, i.e. by internal diameter or by application

You can obtain the Goetze / Payen catalogue through your Federal-Mogul sales representative or through your local distributor



Nüral®

NEW CATALOGUE

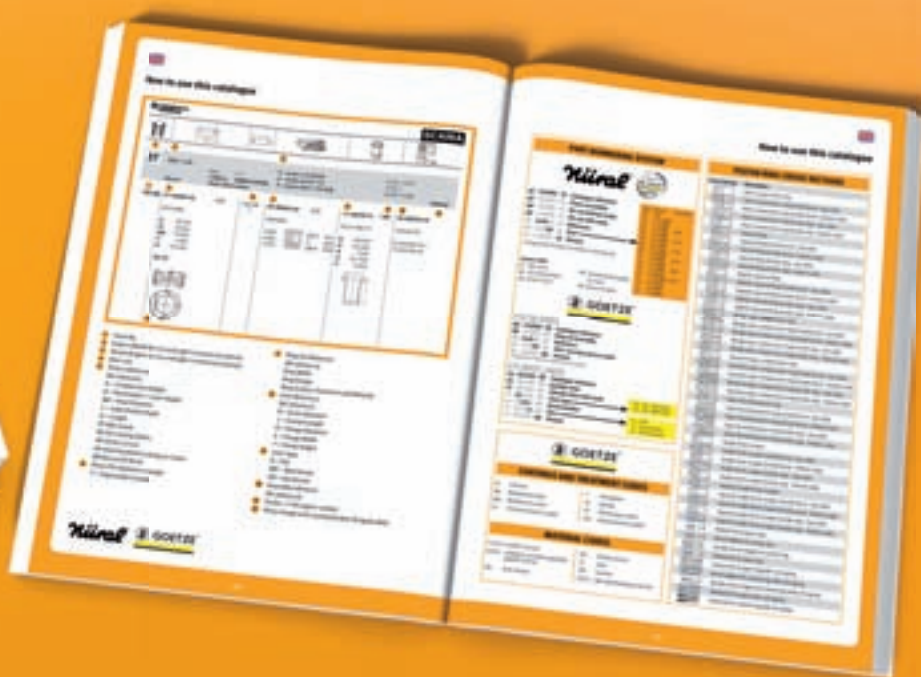

- The only cylinder components catalogue linking to TecDoc engines (LV & CV)
- Huge increase in range coverage – approx 3,000 part numbers with over 30,000 part-to-engine links and 160 new references
- Simplified Brands – one per product line

You can obtain the Nüral catalogue through your Federal-Mogul sales representative or through your local distributor



Payen[®]

NEW CATALOGUE



- Wide coverage: 10,000 LV and LCV applications with 600 Payen seals
- 71 new parts highlighted in colour including 30 timing oil seal kits
- Two methods of selection, i.e. by internal diameter or by application

You can obtain the Payen catalogue through your Federal-Mogul sales representative or through your local distributor



ENGINE PART NUMBERING SYSTEM



SETS

	PART NUMBER	MATERIAL	BEARING FAMILY	PROGRESSIVE NUMBER	NR	SIZE
Big end (Con rod) bearings	01-3040/4 STD	0	1	3040	4 pairs	STD
Main bearings	H992/6 STD		H	992	6 pairs	STD
Camshaft bushes	N110/5 SEMI		N	110	5 pieces	SEMI
Thrust washers	A123/4 0.25MM		A	123	4 pieces	0.25mm
Small-end (Piston pin) bush	55-3719 SEMI	5	5	3719		SEMI
Various bushes	17-3720 SEMI	1	7	3720		SEMI

COMPONENT/PAIR

PART NUMBER	MATERIAL	BEARING FAMILY	PROGRESSIVE NUMBER	
72-2350 H	7	2	2350	H (Flanged)
03-2861	0	3	2861	
54-3544	5	4	3544	



ENGINE VALVE	PREFIX	NUMBER	SUFFIX	FULL PART NUMBER EXAMPLE
	V	94168	None	V94168

VALVE GUIDE	PREFIX	NUMBER	SUFFIX	FULL PART NUMBER EXAMPLE
	VAG	96215	None or B	VAG96215

"B" indicates BRONZE valve guide.

VALVE SPRING	PREFIX	NUMBER	SUFFIX	FULL PART NUMBER EXAMPLE
	VSP	601	S or P	VSP601P

"S" indicates SINGLE spring.
"P" indicates a PAIR - inner & outer spring (per valve)

VALVE SEAT INSERT	PREFIX	NUMBER	SUFFIX	FULL PART NUMBER EXAMPLE
	VS	6344	none	VS6344

CAMSHAFT	PREFIX	NUMBER	SUFFIX	FULL PART NUMBER EXAMPLE
	CAM	376	none	CAM376

CAMSHAFT KIT	PREFIX	NUMBER	SUFFIX	FULL PART NUMBER EXAMPLE
	CKS	2373	none	CKS2373

CAM FOLLOWER	PREFIX	NUMBER	SUFFIX	FULL PART NUMBER EXAMPLE
	FOL	101	none	FOL101

PRE COMBUSTION CHAMBER	PREFIX	NUMBER	SIZE	FULL PART NUMBER EXAMPLE
	PCC	111	STD	PCC111 STD
	PCC	92	0.5 MM	PCC92 0.50MM




Niral

- 87 - 114900 - 25 Catalogue reference
- 87 - 114900 - 00 Piston assembly
- 88 - 114900 - 00 Kit-set without seals
- 89 - 114900 - 00 Kit-set with seals
- 1149 - 00 Reference
- 1149 - 00 Size*
- 114900 - 25 Version

* If imperial in the past, it continues to be imperial

Size	Metric	Imperial
00	STD	
03	0.125MM	
04	0.20MM	
05	0.25MM	.010
06	0.40MM	
07	0.50MM	.020
08	0.60MM	
09	0.75MM	.030
10	0.80MM	
11	1.00MM	.040
13	1.25MM	
14	1.50MM	.060
16	2.00MM	
17	2.286MM	.090
20	0.70MM	
21	0.65MM	
22	0.30MM	



PISTON RINGS

- 08 - 114900 - 00 Catalogue reference
- 08 - 114900 - 00 Ring set assembly
- 1149 - 00 Reference
- 1149 - 00 Size* (See Niral pistons table)
- 114900 - 00 Version

* If imperial in the past, it continues to be imperial

CYLINDER LINERS

- 14 - 451160 - 00 Catalogue reference
- 14 - 451160 - 00 Cylinder liner
- 15 - 451160 - 00 Cylinder liner with seals
- 14 - 451160 - 00 Liner type
- 14 - 451160 - 00 Serial number
- 14 - 451160 - 00 Size
- 14 - 451160 - 00 Version

01 - 19 = Dry liner
20 - 99 = Wet liner

0 = STD
1 = 1st oversize
2 = 2nd oversize

CONTENTS



Contents	XII - XIII
How to use this catalogue	XIV - XV
New parts list	XVI - XXVI
Applications by manufacturer	1 - 1048
Numerical parts list	1049 - 1118
Timing belt (TB) kit composition	1119
Timing belt (TB) kit images	1124
OE interchange	1135
Competitor interchange	1191



Contenido	XII - XIII
Cómo usar este catálogo	XIV - XV
Lista de nuevas referencias	XVI - XXVI
Aplicaciones por fabricante	1 - 1048
Lista de referencias	1049 - 1118
Composición del kit de distribución	1119
Imágenes del kit de distribución	1124
Intercambio de referencias de equipo original	1135
Intercambio de la competencia	1191



Inhalt	XII - XIII
Hinweise zur Benutzung des Katalogs	XIV - XV
Liste der Neuaufnahmen	XVI - XXVI
Anwendung nach Hersteller	1 - 1048
Numerische Teilenummernliste	1049 - 1118
Steuerriemensatz – Bestandteile	1119
Steuerriemensatz – Bilder	1124
OE-Vergleichsliste	1135
Wettbewerb-Vergleichsliste	1191



Spis treści	XII - XIII
Jak używać tego katalogu	XIV - XV
Lista nowych części	XVI - XXVI
Zastosowania według producenta	1 - 1048
Lista numeryczna części	1049 - 1118
Zawartość zestawu paska rozrządu	1119
Zdjęcia zestawu paska rozrządu	1124
Odpowiednik OE	1135
Odpowiednik innego producenta	1191



Indice	XII - XIII
Come consultare questo catalogo	XIV - XV
Elenco nuovi riferimenti	XVI - XXVI
Elenco applicazioni per costruttore	1 - 1048
Elenco riferimenti	1049 - 1118
Contenuto kit cinghie di distribuzione	1119
Immagini kit cinghie di distribuzione	1124
Intercambio con OE	1135
Intercambio con concorrenti	1191



Содержание	XII - XIII
Как пользоваться каталогом	XIV - XV
Список новой продукции	XVI - XXVI
Модели автомобилей, сортировка по производителю	1 - 1048
Список номеров деталей	1049 - 1118
Состав комплекта ремня ГРМ	1119
Изображения комплекта ремня ГРМ	1124
Взаимозаменяемость с оригинальными деталями	1135
Взаимозаменяемость с деталями конкурентов	1191



Contenu	XII - XIII
Comment utiliser ce catalogue	XIV - XV
Liste des nouvelles références	XVI - XXVI
Applications par constructeur	1 - 1048
Liste des références produits	1049 - 1118
Composition des kits de courroie de distribution	1119
Images des kits de courroie de distribution	1124
Références croisées 1ère Monte	1135
Références croisées concurrents	1191



XIII - XII	المحتويات
XV - XIV	كيفية استخدام هذا الكتلوج
XXVI - XVI	قائمة الأجزاء الجديدة
1048 - 1	الاستخدامات حسب المصنع
1118 - 1049	قائمة الأجزاء الرقمية
1119	تركيب عدة حزام التوقيت
1124	صور اطقم سيور كتيبه
1135	تبادل المعدة الأصلية
1191	تبادل المنافس

CONTENTS

ALFA ROMEO	1	MASERATI	394
ARO	19	MAZDA	394
AUDI	20	MERCEDES-BENZ	423
AUSTIN	85	METROCAB	471
AUTOBIANCHI	87	MG	471
BEDFORD	88	MINI	475
BMW	89	MITSUBISHI	476
CARBODIES	112	MOSKVICH	501
CHEVROLET	112	NISSAN	501
CHRYSLER	115	OPEL	526
CITROEN	121	PEUGEOT	589
DACIA	174	PIAGGIO	654
DAEWOO	175	PORSCHE	654
DAIHATSU	180	PROTON	662
DODGE	186	RENAULT	664
FIAT	187	ROVER	724
FORD	241	SAAB	741
FORD USA	306	SEAT	752
FSO	307	SKODA	776
GAZ	308	SMART	790
HONDA	308	SUBARU	792
HYUNDAI	325	SUZUKI	801
ISUZU	344	TALBOT	810
IVECO	346	TATA (TELCO)	812
JAGUAR	351	TOYOTA	813
JEEP	355	UAZ	851
KIA	359	VAUXHALL	851
LADA	366	VOLVO	899
LANCIA	370	VW	944
LAND ROVER	388	WARTBURG	1047
LDV	392	ZASTAVA	1048
LEXUS	393	ZAZ	1048



HOW TO USE THIS CATALOGUE

FEDERAL MOGUL								
ALFA ROMEO								
145 (930)								
1.4 i.e.	AR 33501	66	07/94 → 12/96	⊗ ⊖ ⊕ ⊗ ⊕		SVB13950 MVB865R5 TB338 TBK287 SVB10825	13x950 5PK365 100x17 10x825	ALFA ROMEO
1.4 i.e. 16V T.S.	AR 33503, AR 38501	76	12/96 → 01/01	⊖ ⊖ ⊖ ⊗ ⊕ ⊗ ⊕	AC(+), Eng Nr 1391188 → Eng. AR33503, AC(-) Eng. AR33503, AC(+), → Eng Nr 1391187	MVB1855R6 MVB1045R6 MVB1842R6 TB528 TBK207	6PK1855 6PK1045 6PK1842 163x24	
1.6 i.e.	AR 33201	76	10/94 → 12/96	⊗ ⊖ ⊕ ⊗ ⊕	Eng. AR33503	SVB13950 MVB865R5 TB338 TBK287 SVB10825	13x950 5PK365 100x17 10x825	
1.6 i.e. 16V T.S.	AR 38201, AR 67601	88	12/96 → 01/01	⊖ ⊖ ⊖ ⊗ ⊕ ⊗ ⊕	AC(-) AC(+)	MVB1045R6 MVB1855R6 TB559 TBK345	6PK1045 6PK1855 166x24	
1.7 i.e. 16V	AR 33401	95	10/94 → 12/96	⊗ ⊖ ⊕ ⊗ ⊕		SVB13950 MVB865R5 TB274 SVB10825	13x950 5PK365 121x20 10x825	

1

2

3

4

5

6

7

8

9



- 1 Application: Make – Model – Type
- 2 Engine
- 3 Kilowatt
- 4 Model Year
- 5 Belt Type
- 6 Driven Unit
- 7 Remarks – additional information
- 8 AE part number
- 9 Size



- 1 Applicazione: Marca – Modello – Tipo
- 2 Motore
- 3 Kilowatt
- 4 Anno modello
- 5 Tipo di cinghia
- 6 Rinvio
- 7 Note – ulteriori informazioni
- 8 Codice AE
- 9 Dimensione







- 1 Anwendung: Marke – Modell – Typ
- 2 Motor
- 3 Kilowatt
- 4 Modelljahr
- 5 Riemenart
- 6 Angetriebenes Aggregat
- 7 Bemerkungen – Zusatzinformation
- 8 AE-Teilenummer
- 9 Abmessungen







- 1 Application : Marque – Modèle – Type
- 2 Moteur
- 3 Kilowatt
- 4 Année modèle
- 5 Type de courroie
- 6 Organe entraîné
- 7 Remarques – complément d'information
- 8 Référence de pièce AE
- 9 Dimension





NEW PARTS LIST

Liste der Neuaufnahmen • Elenco nuovi riferimenti
Liste des nouvelles références

			
MVB580R4 VOLVO	440 K (445), 460 L (464)	MVB960R3 CHRYSLER HONDA	VOYAGER II (GS) JAZZ (AA)
MVB660R3 HYUNDAI SUBARU	ELANTRA (XD), ELANTRA Saloon (XD), MATRIX (FC) JUSTY I (KAD)	MVB1020R4 CITROËN HONDA JAGUAR PEUGEOT SUZUKI	AX (ZA-) ACCORD VII (CG), CRX III (EH, EG), PRELUDE IV (BB), PRELUDE V (BB) XJ (X300) 205 II (20A/C) GRAND VITARA (FT, GT), VITARA (ET, TA)
MVB683R3 AUTOBIANCHI CHEVROLET FIAT FORD	Y10 MATIZ ELBA (146_), FIORINO Box (146 Uno), FIORINO Pick up (146) COUGAR (EC_), MAVERICK, MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), MONDEO III (B5Y), MONDEO III Estate (BWY), MONDEO III Saloon (B4Y)	MVB1035R7 BMW NISSAN RENAULT	7 (E38), 8 (E31) MICRA (K12), MICRA C+C (K12), NOTE (E11) CLIO III (BR0/1, CR0/1), MODUS (F/JPO_), TWINGO (CN0_)
LANCIA MAZDA	Y10 (156) MPV II (LW), TRIBUTE (EP)	MVB1070R4 HONDA	ACCORD IV (CB3, CB7), ACCORD IV Aerodeck (CB8, CC), ACCORD V (CC7), ACCORD V (CE, CF) XJ (X300), XJ (XJ 40, 81), XJS Coupe, XJSC Convertible
MVB705R3 RENAULT	CLIO I (B/C57_, 5/357_), CLIO I Box (S57_)	JAGUAR LEXUS RENAULT ROVER TOYOTA	IS (GXE10), IS SportCross CLIO I (B/C57_, 5/357_), CLIO I Box (S57_) 600 (RH) 4 RUNNER (_N130), LAND CRUISER 90 (_J9_)
MVB720R3 FIAT	PALIO Weekend (178DX), PUNTO (176), PUNTO Van (176L), STRADA (178E)	MVB1073R5 ALFA ROMEO HONDA KIA MITSUBISHI	159, 159 Sportwagon, BRERA, SPIDER PRELUDE IV (BB) CLARUS (K9A), CLARUS Estate (GC) COLT V (CJ_A), GALANT VI (EA_), GALANT VI Estate (EA_), LANCER VI (CK/P_A), MIRAGE Coupe, MIRAGE Hatchback CITYROVER
MVB753R3 LAND ROVER MG RENAULT ROVER	FREELANDER (LN), FREELANDER Soft Top MG ZR, MG ZS, MG ZS Hatchback CLIO II (BB0/1/2_, CB0/1/2_), THALIA (LB0/1/2_) 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 200 (XH), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW), COUPE, STREETWISE ALTO IV (FF) CAMRY (_V1_), CAMRY (_V20), CAMRY Station Wagon (_V10)	ROVER TOYOTA	COROLLA (_E9_), COROLLA (_E10_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA FX Compact (E8B), COROLLA Liftback (_E9_), COROLLA Liftback (_E10_), COROLLA Station Wagon (_E9_), COROLLA Wagon (_E10_) TIGUAN
MVB768R5 CITROËN PEUGEOT SMART	XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) 605 (6B) CABRIO, CITY-COUCPE (MC01), FORTWO cabrio, FORTWO Coupe	VW	
MVB780R6 SEAT SKODA	CORDOBA (6L2), IBIZA IV (6L1) FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), ROOMSTER (5J) YARIS, YARIS (_CP10)	MVB1090R7 TOYOTA	HIACE IV Box (_H1_, _H2_), HIACE IV Wagon (_H1_, _H2_), HILUX Pickup, HILUX Pickup (_N_)
TOYOTA VW	POLO (6N2), POLO (9N_), POLO Saloon	MVB1103R7 BMW	1 (E81, E87), 1 Convertible (E88), 3 (E90), 3 Convertible (E93), 3 Coupe (E92), 3 Touring (E91)
MVB880R7 RENAULT	CLIO III (BR0/1, CR0/1), MODUS (F/JPO_)	OPEL	MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumphtruck (H9), MOVANO Flatbed / Chassis (U9, E9) MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD),
MVB906R5 ALFA ROMEO BMW	145 (930), 146 (930), 155 (167) 3 (E36), 3 Compact (E36), 3 Convertible (E36), 3 Coupe (E36), 3 Touring (E36), 5 (E34), 5 (E39), 5 Touring (E34), 5 Touring (E39), 7 (E38), Z3, Z3 Coupe CROMA (154), TEMPRA (159), TEMPRA S.W. (159), TIPO (160)	VAUXHALL MOVANO Van (FD)	
FIAT HYUNDAI KIA LANCIA MITSUBISHI RENAULT	XG OPIRUS DEDRA (835), DEDRA SW (835), DELTA II (836) COLT VI CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), TWINGO (C06_), TWINGO Box (S06_) COROLLA (_E10_), COROLLA Compact (_E10_), COROLLA Coupe (AE86), COROLLA Wagon (_E10_)	MVB1135R5 AUDI DACIA HYUNDAI KIA MITSUBISHI	A6 (4F2), A6 Allroad (4FH), A6 Avant (4F5), A8 (4E_) LOGAN, LOGAN MCV TERRACAN (HP) SORENTO (JC) PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), PAJERO SPORT (K90)
TOYOTA		NISSAN	ALMERA II (N16), ALMERA II Hatchback (N16), KUBISTAR (X76), MICRA (K12)
MVB935R7 MINI	MINI	RENAULT	CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), CLIO III (BR0/1, CR0/1), GRAND SCENIC (JM0/1_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LOGAN (LS_), MEGANE II (BMO/1_, CMO/1_), MEGANE II Coupé-Cabriolet (EMO/1_), MEGANE II Estate (KMO/1_), MEGANE II Saloon (LMO/1_), MODUS (F/JPO_), SCENIC II (JM0/1_), THALIA (LB0/1/2_)
MVB955R6 AUDI HONDA HYUNDAI KIA NISSAN SEAT SKODA VW	A3 (8P1), A3 Sportback (8PA), TT (8J3), TT Roadster (8J9) ACCORD VII (CG), ACCORD VII Hatchback (CH) i30, i30 CW Estate CEE'D Estate, CEE'D Hatchback, PRO CEE'D MICRA (K11) ALTEA (5P1), ALTEA XL (5P5), LEON (1P1), TOLEDO III (5P2) OCTAVIA (1Z3), OCTAVIA Combi (1Z5) GOLF V (1K1)	TOYOTA	AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_), CARINA E (_T19_), CARINA E Saloon (_T19_), CARINA E Sportswagon (_T19_)
		MVB1148R5 FIAT	500, BRAVO, DOBLO (119), DOBLO Cargo (223), GRANDE PUNTO (199), IDEA, LINEA, PANDA (169), PANDA Van (141_), PUNTO (188), STILO (192), STILO Multi Wagon (192)

			
LANCIA MAZDA MG MITSUBISHI PROTON ROVER TOYOTA	MUSA, YPSILON 626 IV (GE), 626 IV Hatchback (GE) MG ZR, MG ZS, MG ZS Hatchback SPACE RUNNER (N1_W, N2_W), SPACE WAGON (N3_W, N4_W) PERSONA 300 (C9_M), PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S), WIRA 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW), COUPE, STREETWISE AVENSIS VERSO (AC_), PREVIA (ACR3_)	MVB1370R5 DODGE MITSUBISHI OPEL VAUXHALL	STRATUS GALANT VI (EA_), GALANT VI Estate (EA_) COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W5L), MERIVA, TIGRA TwinTop COMBO, CORSA Mk II, CORSA Mk III, MERIVA, TIGRA TwinTop
MVB1173R6 AUDI CITROËN HONDA NISSAN PEUGEOT RENAULT TOYOTA VOLVO	A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4) ZX (N2), ZX Break (N2) ACCORD VII Coupe (CG) 350 Z (Z33), 350 Z Roadster, PATHFINDER (R50) 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 405 I (15B), 405 II (4B), 405 II Break (4E) 9 (L42_), 11 (B/C37_), 11 Box (S37_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_) YARIS VERSO (NC/LP2_) 440 K (445), 460 L (464)	MVB1370R6 MINI SUZUKI	MINI, MINI Convertible LIANA (ER), LIANA Estate (ER)
MVB1173R8 MAZDA	5 (CR19), 6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY)	MVB1428R6 CHRYSLER DODGE FORD RENAULT VOLVO	STRATUS (JA), STRATUS Convertible (JX) STRATUS GALAXY (WGR), TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_) LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_) 850 (LS), 850 Estate (LW), S70 (P80_), S80 (TS, XY), V70 I Estate (P80_), V70 II Estate (P80_)
MVB1215R6D SEAT VW	ALHAMBRA (7V8, 7V9) CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), MULTIVAN V (7HM, 7HF), SHARAN (7M8, 7M9, 7M6), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HI), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)	MVB1432R5 AUDI SKODA VW	A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A6 (4B, C5), A6 Avant (4B, C5) SUPERB (3U4) BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)
MVB1225R6 CITROËN PEUGEOT	NEMO (AA_) 206 Hatchback (2A/C), 206 SW (2E/K), BIPPER (AA_)	MVB1520R6 FORD SKODA VW	FOCUS C-MAX, FOCUS II (DA_), FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_) OCTAVIA (1U2) LUPO (6X1, 6E1)
MVB1230R8 MAZDA	3 (BK14), 3 Saloon (BK12), 5 (CR19), 6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY), MPV II (LW)	MVB1540R4 RENAULT	CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), THALIA (LB0/1/2_)
MVB1240R7 ALFA ROMEO FIAT LANCIA	164 (164) CROMA (154) THEMA (834), THEMA SW (834)	MVB1580R6 ALFA ROMEO CITROËN DAIHATSU FIAT KIA LANCIA PEUGEOT RENAULT	159, 159 Sportwagon, BRERA, SPIDER C5 (DC_), C5 (RC_), C5 Break (DE_), C5 Break (RE_), C8 (EA_, EB_) MATERIA (M4_) ULYSSE (179AX) CARNIVAL (UP), CARNIVAL II PHEDRA (179) 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 607 (9D, 9U), 807 (E) AVANTIME (DEO_), CLIO II (BB0/1/2_, CB0/1/2_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_)
MVB1306R6 FIAT FORD LANCIA MAZDA NISSAN OPEL VAUXHALL VOLVO	500, DOBLO (119), DOBLO Cargo (223), IDEA, PANDA (169), PANDA Van (141_), PUNTO (188), PUNTO Van (188AX), STRADA (178E) C-MAX, FOCUS C-MAX, FOCUS II (DA_), FOCUS II Convertible, FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_) MUSA, YPSILON 3 (BK14), 3 Saloon (BK12), 5 (CR19) PRAIRIE PRO (M11) ASTRA H, ASTRA H Estate, ASTRA H GTC ASTRA MK V Estate, ASTRA MK V Hatchback C30, S40 II (MS), V50 (MW)	MVB1580R7 LAND ROVER	DEFENDER (LD), DEFENDER Station Wagon (LD), DISCOVERY II (LJ, LT)
MVB1318R6 FIAT OPEL SUZUKI VAUXHALL	FIORINO Box, GRANDE PUNTO (199), LINEA AGILA, AGILA (H00), COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W5L), CORSA D, MERIVA, TIGRA TwinTop IGNIS II, SPLASH, SWIFT III (SG), WAGON R+ (MM) AGILA, COMBO, CORSA Mk II, CORSA Mk III, CORSAVAN MK II, MERIVA, TIGRA TwinTop	MVB1635R7 BMW LAND ROVER	5 (E39), 5 Touring (E39), 7 (E38), 8 (E31), X5 (E53) RANGE ROVER III (LM)
MVB1330R5 MITSUBISHI RENAULT	CARISMA (DA_), CARISMA Saloon (DA_), COLT IV (CA_A), COLT V (CJ_A), GALANT VI (EA_), GALANT VI Estate (EA_), PAJERO PININ (H6_W, H7_W) 25 (B29_)	MVB1642R6 ARO BMW FORD JAGUAR MITSUBISHI RENAULT	10 1 (E81, E87), 3 (E46), 3 Compact (E46), 3 Convertible (E46), 3 Coupe (E46), 3 Touring (E46), Z4 (E85) MONDEO III (B5Y), MONDEO III Estate (BWY), MONDEO III Saloon (B4Y), TRANSIT Box (FA_), TRANSIT Bus (FD_, FB_, FS_, FZ_, FC_), TRANSIT Flatbed / Chassis (FM_, FN_) X-TYPE (CF1), X-TYPE Estate CARISMA (DA_), CARISMA Saloon (DA_) ESPACE III (JE0_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), SCENIC (JA0/1_) OUTBACK (BE, BH)
MVB1360R6 FIAT	BRAVO, STILO (192), STILO Multi Wagon (192)	SUBARU VOLVO VW	960 (964), 960 II (964), 960 II Estate (965), 960 Kombi (965), S40 I (VS), S90, V40 Estate (VW), V90 Estate LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE)











 	 
MVB1933R7 TOYOTA AVENSIS (T25), AVENSIS Estate (T25), AVENSIS Saloon (T25), CAMRY (V30), LAND CRUISER (J12), LAND CRUISER 90 (J9_), RAV 4 II (XA2)	MVB2135R6 KIA CERATO Saloon MERCEDES-BENZ C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C208), CLK Convertible (A208), COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), E-CLASS Estate (S210), G-CLASS (W463), KOMBI Estate (S124), Saloon (W124), S-CLASS (W140), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Flatbed / Chassis (904)
MVB2000R7 OPEL VIVARO Box (F7), VIVARO Combi (J7), VIVARO Flatbed / Chassis (E7) TOYOTA AVENSIS (T25), AVENSIS Estate (T25), AVENSIS Saloon (T25), COROLLA Verso (ZER_, ZZE_) VAUXHALL VIVARO Box, VIVARO Combi, VIVARO Flatbed / Chassis	MVB2153R6 DAEWOO KORANDO (KJ), KORANDO Cabrio (KJ), MUSSO (FJ) MERCEDES-BENZ C-CLASS (W202), C-CLASS Estate (S202), CLK (C208), CLK Convertible (A208), E-CLASS (W124), E-CLASS (W210), E-CLASS Estate (S124), E-CLASS Estate (S210), G-CLASS (W461), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), M-CLASS (W163), Saloon (W124), SLK (R170) VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE)
MVB2013R6 KIA SEPHIA (FA), SEPHIA Saloon (FA) MAZDA 3 (BK14), 3 Saloon (BK12) SAAB 900 II, 900 II Convertible, 900 II Coupe	MVB2190R6 FORD KA (RB_), STREET KA JEEP CHEROKEE (KJ), CHEROKEE (XJ) MERCEDES-BENZ C CLASS (W204), C CLASS T-Model (S204), C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), E-CLASS (W211), E-CLASS T-Model (S211), GL-CLASS (X164), R-CLASS (W251), SPRINTER 3, 5 Flatbed / Chassis (906), SPRINTER 3,5-t Box (906), SPRINTER 3-t Box (906), SPRINTER 3-t Flatbed / Chassis (906), SPRINTER 5-t Box (906), SPRINTER 5-t Flatbed / Chassis (906), VIANO (W639), VITO Box (W639), VITO Bus (W639)
MVB2020R6 MERCEDES-BENZ C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Flatbed / Chassis (904), T1 Box (601), T1 Box (602), T1 Bus (601), T1 Bus (602), T1 Flatbed / Chassis (601), T1 Flatbed / Chassis (602), V-CLASS (638/2), VITO Box (638), VITO Bus (638) OPEL CALIBRA A (85_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), SINTRA, VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) SAAB 9-5 (YS3E), 9-5 Estate (YS3E) VAUXHALL CALIBRA, OMEGA, OMEGA Estate, SINTRA, VECTRA, VECTRA Estate, VECTRA Hatchback	MVB2196R6 FORD GALAXY, MONDEO IV, MONDEO IV Saloon, MONDEO IV Turnier, S-MAX
MVB2035R7 JEEP COMMANDER, GRAND CHEROKEE III MERCEDES-BENZ C CLASS (W204), C CLASS T-Model (S204), C-CLASS (W203), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), CLS (C219), E-CLASS (W211), E-CLASS T-Model (S211), GL-CLASS (X164), R-CLASS (W251), SPRINTER 3, 5 Flatbed / Chassis (906), SPRINTER 3,5-t Box (906), SPRINTER 3-t Box (906), SPRINTER 3-t Flatbed / Chassis (906), SPRINTER 5-t Box (906), SPRINTER 5-t Flatbed / Chassis (906), VIANO (W639), VITO Box (W639), VITO Bus (W639)	MVB2215R6 CHEVROLET BLAZER '94, S10 Pick Up FORD FIESTA V (JH_, JD_) JEEP GRAND CHEROKEE II (WJ, WG), GRAND CHEROKEE III 6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY) MAZDA SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904) MERCEDES-BENZ V70 III Estate VOLVO LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)
MVB2040R6 DAEWOO KORANDO (KJ), KORANDO Cabrio (KJ), MUSSO (FJ) DODGE CALIBER FORD SCORPIO II (GFR, GGR), SCORPIO II Estate (GNR, GGR) ISUZU TROOPER, TROOPER Open Off-Road Vehicle JEEP COMPASS, PATRIOT MERCEDES-BENZ C-CLASS (W202), C-CLASS Estate (S202), CLK (C208), CLK Convertible (A208), COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), E-CLASS Estate (S210), KOMBI Estate (S124), Saloon (W124) OPEL FRONTERA B (6B_), MONTEREY B VAUXHALL FRONTERA Mk II	MVB2265R7 HONDA ACCORD VIII (CL_, CM_), ACCORD VIII Tourer (CM_), CR-V II (RD_), CR-V III, FR-V JEEP GRAND CHEROKEE I (Z) KIA SORENTO (JC) LAND ROVER DISCOVERY I, DISCOVERY II (LJ, LT), RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN)
MVB2040R8 MERCEDES-BENZ G-CLASS (W463), GL-CLASS (X164), M-CLASS (W164), R-CLASS (W251), S-CLASS (W221)	MVB2271R6 FORD MAVERICK FORD USA TAURUS (P5_) JEEP CHEROKEE (XJ)
MVB2090R6 BMW 3 (E46), 3 Compact (E46), 3 Touring (E46)	



NEW PARTS LIST





Liste der Neuaufnahmen • Elenco nuovi riferimenti
Liste des nouvelles références





  <p>MERCEDES-BENZ C-CLASS (W202), C-CLASS Estate (S202), E-CLASS (W210), E-CLASS Estate (S210), M-CLASS (W163), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904), VIANO (W639), VITO Box (W639), VITO Bus (W639) OPEL OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), SENATOR B (29_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) VAUXHALL CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, SENATOR Mk II</p>	  <p>MERCEDES-BENZ C CLASS (W204), C CLASS T-Model (S204), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), CLS (C219), E-CLASS (W211), E-CLASS T-Model (S211), GL-CLASS (X164), M-CLASS (W164), R-CLASS (W251), S-CLASS (W221), S-CLASS Coupe (C216), SL (R230), SLK (R171), SPRINTER 3,5 Flatbed / Chassis (906), SPRINTER 3,5-t Box (906), SPRINTER 3,5-t Bus (906), SPRINTER 3-t Box (906), SPRINTER 3-t Bus (906), SPRINTER 3-t Flatbed / Chassis (906) OPEL SKODA VAUXHALL VW ANTARA SUPERB (3U4) ANTARA PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)</p>
<p>MVB2271R7 HYUNDAI JEEP KIA LAND ROVER MERCEDES-BENZ</p> <p>H-1 Box, H-1 Bus (KMF) GRAND CHEROKEE I (Z) SORENTO (JC) RANGE ROVER III (LM) E-CLASS (W211), G-CLASS (W463), G-CLASS Cabrio (W463), M-CLASS (W163), S-CLASS (W220)</p>	<p>MVB2418R7 MERCEDES-BENZ</p> <p>C CLASS (W204), C CLASS T-Model (S204), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), E-CLASS (W211), E-CLASS T-Model (S211), SLK (R171) MITSUBISHI PAJERO III (V60, V70)</p>
<p>MVB2275R8 CHRYSLER JEEP</p> <p>VOYAGER II (GS) CHEROKEE (XJ), GRAND CHEROKEE I (Z)</p>	<p>MVB2460R8 MERCEDES-BENZ</p> <p>E-CLASS (W124), Saloon (W124), S-CLASS (W140), S-CLASS Coupe (C140)</p>
<p>MVB2315R6 JEEP MAZDA MERCEDES-BENZ</p> <p>CHEROKEE (XJ), WRANGLER II (TI) 3 (BK14), 6 (GG), CX-7 C-CLASS (W203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), E-CLASS (W210), E-CLASS Estate (S210), G-CLASS (W463), G-CLASS Cabrio (W463), M-CLASS (W163), VIANO (W639)</p>	<p>MVB2553R6 DODGE JEEP SAAB</p> <p>CALIBER COMPASS, PATRIOT 9000, 9000 Hatchback</p>
<p>MVB2315R7 LAND ROVER MERCEDES-BENZ</p> <p>RANGE ROVER II (LP) C CLASS (W204), C CLASS T-Model (S204), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), E-CLASS (W211), E-CLASS T-Model (S211), SLK (R171)</p>	<p>MVB2585R6 HYUNDAI KIA MERCEDES-BENZ VW</p> <p>SONATA V CARENS III, MAGENTIS S-CLASS (W140), SL (R129) CRAFTER 30-35 Bus (2E), CRAFTER 30-50 Box (2E), CRAFTER 30-50 Flatbed / Chassis (2E)</p>
<p>MVB2337R7 JAGUAR LAND ROVER MERCEDES-BENZ</p> <p>XJ (NAW, NBW), XK 8 Convertible (QDV), XK 8 Coupe (QEV) RANGE ROVER II (LP) S-CLASS (W220), S-CLASS Coupe (C215), S-CLASS Coupe (C216), SL (R230)</p>	<p>MVB2680R6 AUDI</p> <p>A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8)</p> <p>MVB2710R7 FORD</p> <p>TRANSIT Box, TRANSIT Box (FA_), TRANSIT Bus, TRANSIT Bus (FD_, FB_, FS_, FZ_, FC_), TRANSIT Flatbed / Chassis, TRANSIT Flatbed / Chassis (FM_, FN_) LAND ROVER DISCOVERY II (LI, LJ)</p>
<p>MVB2365R7 MERCEDES-BENZ VW</p> <p>S-CLASS (W221), S-CLASS Coupe (C216) TOUAREG (7LA, 7L6, 7L7)</p>	<p>SVB11790 FORD SEAT</p> <p>GALAXY (WGR) ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L) CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV (1J1), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), VENTO (1H2)</p>
<p>MVB2373R6 MERCEDES-BENZ</p> <p>CLK (C209), CLK Convertible (A209), E-CLASS (W211), E-CLASS T-Model (S211), M-CLASS (W163), M-CLASS (W164), R-CLASS (W251), S-CLASS (W220), VIANO (W639), VITO Box (W639), VITO Bus (W639) VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)</p>	<p>SVB13890 ISUZU LDV</p> <p>TROOPER Open Off-Road Vehicle (UBS) 400 Box, 400 Bus, 400 Flatbed / Chassis</p>
<p>MVB2380R6 CHEVROLET MERCEDES-BENZ</p> <p>S10 Pick Up C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), CLS (C219), COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS (W211), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), E-CLASS T-Model (S211), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), M-CLASS (W164), R-CLASS (W251), Saloon (W124), S-CLASS (W220), S-CLASS Coupe (C215), SL (R230), SLK (R171)</p>	<p>SVB171045 NISSAN</p> <p>VANETTE Box (C22), VANETTE Bus (C22)</p>
<p>MVB2403R6 AUDI</p> <p>A4 (8D2, B5), A4 (8E2, B6), A4 (8EC), A4 (8K2), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Avant (8K5), A4 Convertible (8H7, 8HE), A5, A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH) CHEVROLET CAPTIVA JEEP WRANGLER I (YJ, SJ_), WRANGLER II (TI)</p>	<p>TB780 OPEL</p> <p>ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA G Estate (F35_), CORSA B (73_, 78_, 79_, F35_), TIGRA (95_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) VAUXHALL ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CORSA, TIGRA, VECTRA, VECTRA Estate, VECTRA Hatchback</p>

 		 				
TB783	CHEVROLET	EPICA (KL1_), EVANDA, LACETTI, NUBIRA Estate, NUBIRA Saloon, REZZO	TB800	CHEVROLET	CAPTIVA, EPICA (KL1_), LACETTI, NUBIRA Estate	
	DAEWOO	EVANDA (KLAL), LACETTI Hatchback (KLAN), LEGANZA (KLAV), NUBIRA (KLAJ), NUBIRA Saloon (KLAJ), NUBIRA Saloon (KLAN), NUBIRA Wagon (KLAJ), NUBIRA Wagon (KLAN), REZZO (KLAU)		OPEL	ANTARA	
	OPEL	ASTRA F (56_, 57_), ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_)		VAUXHALL	ANTARA	
	VAUXHALL	ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, OMEGA, OMEGA Estate, VECTRA, VECTRA Estate, VECTRA Hatchback	TB801	MITSUBISHI	GALANT VI (EA_), GALANT VI Estate (EA_)	
TB785	AUDI	100 (44, 44Q, C3), 100 Avant (44, 44Q, C3), A6 (4A, C4), A6 Avant (4A, C4)	TB802	MAZDA	3 (BK14), 3 Saloon (BK12), 5 (CR19), 6 (GG), 6 (GH), 6 Estate (GH), 6 Hatchback (GG), 6 Hatchback (GH), 6 Station Wagon (GY)	
	VOLVO	850 (LS), 850 Estate (LW), S70 (P80_), S80 (TS, XY), V70 I Estate (P80_), V70 II Estate (P80_)		TB804	HONDA	CIVIC V Aerodeck (MC), CIVIC V Fastback (MB), INTEGRA (DC2)
	VW	LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)		TB805	HONDA	ACCORD VII Coupe (CG)
TB786	CHEVROLET	AVEO Saloon, KALOS, MATIZ	TB810	CITROËN	C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C6 (TD_), C-CROSSER (EP_) ULYSSE (179AX)	
	DAEWOO	KALOS (KLAS), MATIZ (KLYA)		FIAT	GALAXY, MONDEO IV, MONDEO IV Saloon, S-MAX	
	MITSUBISHI	CARISMA Saloon (DA_), COLT V (CJ_A), LANCER Estate (CS_W), LANCER Saloon (CS_A), SPACE STAR (DGO)		PEUGEOT	407 (6D_), 407 SW (6E_), 607 (9D, 9U), 807 (E), 4007 (GP_)	
	PROTON	IMPIAN	TB811	LAND ROVER	FREELANDER (LN)	
TB787	FIAT	500, DOBLO (119), DOBLO Cargo (223), GRANDE PUNTO (199), IDEA, LINEA, PANDA (169), PANDA Van (141_), PUNTO (188), PUNTO Van (188AX)		MG	MG ZS, MG ZS Hatchback, MG ZT, MG ZT-T	
	LANCIA	MUSA, YPSILON		ROVER	45 (RT), 45 Saloon (RT), 75 (RI), 75 Tourer (RI), 800 (XS), 800 Coupe, 800 Hatchback (XS)	
TB788	MITSUBISHI	GALANT VI (EA_), GALANT VI Estate (EA_), SPACE RUNNER (N50), SPACE WAGON (N5_W)	TB812	LAND ROVER	FREELANDER (LN)	
TB790	ALFA ROMEO	156 Sportwagon (932), 159, 159 Sportwagon, 166 (936), BRERA, SPIDER		MG	MG ZS, MG ZS Hatchback, MG ZT, MG ZT-T	
	FIAT	BRAVO, CROMA (194), STILO (192), STILO Multi Wagon (192)		ROVER	45 (RT), 45 Saloon (RT), 75 (RI), 75 Tourer (RI), 800 (XS), 800 Coupe, 800 Hatchback (XS)	
	LANCIA	THESIS (841AX)	TB813	CITROËN	C2 (JM_), C3 (FC_), C4 (LC_), C4 Coupe (LA_) 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 307 SW (3H), 1007 (KM_)	
	OPEL	ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA 9-3 (YS3F), 9-3 Convertible (YS3F), 9-3 Estate, 9-5 (YS3E), 9-5 Estate (YS3E)		PEUGEOT	C5 (RD_), C5 Break (TD_), C6 (TD_) S-TYPE (CCX), XJ	
	SAAB	9-3 (YS3F), 9-3 Convertible (YS3F), 9-3 Estate, 9-5 (YS3E), 9-5 Estate (YS3E)		LAND ROVER	DISCOVERY III (TAA), RANGE ROVER SPORT	
	VAUXHALL	ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II		PEUGEOT	407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U)	
TB792	HYUNDAI	H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup	TB815	CITROËN	C6 (TD_) S-TYPE (CCX), XJ	
TB793	NISSAN	MAXIMA (J30), PATHFINDER (R50)		JAGUAR	DISCOVERY III (TAA), RANGE ROVER SPORT	
TB794	FIAT	PANDA (169)		LAND ROVER	DISCOVERY III (TAA), RANGE ROVER SPORT	
TB795	FSO	POLONEZ III, POLONEZ III Saloon		PEUGEOT	407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U)	
TB796	RENAULT	MEGANE Cabriolet (EA0/1_), MEGANE Coach (DA0/1_)	TBK207	ALFA ROMEO	145 (930), 146 (930), 147 (937), 156 (932), 156 Sportwagon (932)	
TB797	VW	CRAFTER 30-35 Bus (2E), CRAFTER 30-50 Box (2E), CRAFTER 30-50 Flatbed / Chassis (2E)	TBK225	AUDI	A2 (8Z0), A3 (8L1), A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A6 (4B, C5), A6 Avant (4B, C5)	
TB798	FIAT	PALIO (178BX), SIENA (178_)		FORD	GALAXY (WGR)	
				SEAT	ALHAMBRA (7V8, 7V9), AROSA (6H), LEON (1M1), TOLEDO II (1M2)	
				SKODA	FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA Combi (1U5), SUPERB (3U4)	
				VW	BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), LUPO (6X1, 6E1), NEW BEETLE (9C1, 1C1), PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6), POLO (6N2), POLO (9N_), POLO Saloon, SHARAN (7M8, 7M9, 7M6)	
			TBK230	CITROËN	C1 (PM_, PN_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), NEMO (AA_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO)	
				FORD	FIESTA V (JH_, JD_), FIESTA Van, FUSION (JU_) 2 (B2W)	
				MAZDA	107, 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 1007 (KM_), BIPPER (AA_)	
				PEUGEOT	AYGO	
				TOYOTA		

NEW PARTS LIST

Liste der Neuaufnahmen • Elenco nuovi riferimenti
Liste des nouvelles références





  <p>TBK240 CHEVROLET OPEL SAAB VAUXHALL</p> <p>NUBIRA Estate, NUBIRA Saloon ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), MERIVA, SIGNUM, TIGRA TwinTop, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA, ZAFIRA (F75_) 9-3 (YS3F), 9-3 Estate ASTRA Mk IV, ASTRA Mk IV Convertible, ASTRA Mk IV Coupe, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRA Mk V Estate, ASTRA Mk V Hatchback, ASTRA Mk V Sport Hatch, CORSA Mk II, MERIVA, SIGNUM, TIGRA TwinTop, VECTRA Estate, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA</p>	  <p>TBK267 DACIA RENAULT</p> <p>LOGAN, LOGAN MCV CLIO II (BBO/1/2_, CBO/1/2_), CLIO III (BRO/1, CRO/1), GRAND SCENIC (JMO/1_), KANGOO (KCO/1_), KANGOO Express (FCO/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BGO/1_), LAGUNA II Grandtour (KGO/1_), MEGANE Cabriolet (EAO/1_), MEGANE Classic (LAO/1_), MEGANE Coach (DAO/1_), MEGANE Grandtour (KAO/1_), MEGANE I (BAO/1_), MEGANE II (BMO/1_, CMO/1_), MEGANE II Estate (KMO/1_), MEGANE II Saloon (LMO/1_), MODUS (F/PO_), SCENIC (JAO/1_), SCENIC II (JMO/1_), THALIA (LBO/1/2_)</p>
<p>TBK246 AUDI SEAT SKODA VW</p> <p>A2 (8Z0) AROSA (6H), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), IBIZA IV (6L1), IBIZA V (6J5), IBIZA V SPORTCOUPE (6J1), INCA (6K9), LEON (1M1), LEON (1P1), TOLEDO II (1M2) FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA (1Z3), OCTAVIA Combi (1U5), OCTAVIA Combi (1Z5), PRAKTIK, ROOMSTER (5J) BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), GOLF IV (1J1), GOLF IV Variant (1J5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, LUPO (6X1, 6E1), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), POLO (6N1), POLO (6N2), POLO (9N_), POLO CLASSIC (6KV2), POLO Saloon, POLO Variant (6KV5)</p>	<p>TBK269 AUDI FORD SEAT SKODA VW</p> <p>A2 (8Z0), A3 (8L1), A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A6 (4B, C5), A6 Avant (4B, C5) GALAXY (WGR) ALHAMBRA (7V8, 7V9), AROSA (6H), LEON (1M1), TOLEDO II (1M2) FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA Combi (1U5), SUPERB (3U4) BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), LUPO (6X1, 6E1), NEW BEETLE (9C1, 1C1), PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6), POLO (6N2), POLO (9N_), POLO Saloon, SHARAN (7M8, 7M9, 7M6)</p>
<p>TBK260 OPEL VAUXHALL</p> <p>ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA G Estate (F35_), CORSA B (73_, 78_, 79_, F35_), TIGRA (95_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CORSA, TIGRA, VECTRA, VECTRA Estate, VECTRA Hatchback</p>	<p>TBK270 AUDI FORD SEAT SKODA VW</p> <p>A2 (8Z0), A3 (8L1), A3 (8P1), A3 Sportback (8PA), A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5) GALAXY (WGR) ALHAMBRA (7V8, 7V9), ALTEA (5P1), ALTEA XL (5P5), AROSA (6H), CORDOBA (6L2), IBIZA IV (6L1), IBIZA V (6J5), IBIZA V SPORTCOUPE (6J1), LEON (1M1), LEON (1P1), TOLEDO II (1M2), TOLEDO III (5P2) FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA (1Z3), OCTAVIA Combi (1U5), OCTAVIA Combi (1Z5), PRAKTIK, ROOMSTER (5J), SUPERB (3U4) BORA (1J2), BORA Estate (1J6), CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), EOS, FOX (5Z1), GOLF IV (1J1), GOLF IV Variant (1J5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), LUPO (6X1, 6E1), MULTIVAN V (7HM, 7HF), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), PASSAT (3B3), PASSAT (3C2), PASSAT Variant (3B6), PASSAT Variant (3C5), POLO (6N2), POLO (9N_), POLO Saloon, SHARAN (7M8, 7M9, 7M6), TOURAN (1T1, 1T2), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HJ), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)</p>
<p>TBK261 CHEVROLET DAEWOO OPEL VAUXHALL</p> <p>EPICA (K11_), EVANDA, LACETTI, NUBIRA Estate, NUBIRA Saloon, REZZO EVANDA (KLAL), LACETTI Hatchback (KLAN), LEGANZA (KLAV), NUBIRA (KLAJ), NUBIRA Saloon (KLAJ), NUBIRA Saloon (KLAN), NUBIRA Wagon (KLAJ), NUBIRA Wagon (KLAN), REZZO (KLAU) ASTRA F (56_, 57_), ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, OMEGA, OMEGA Estate, VECTRA, VECTRA Estate, VECTRA Hatchback</p>	<p>TBK272 AUDI SEAT SKODA VW</p> <p>A3 (8L1) CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), INCA (6K9), LEON (1M1), TOLEDO II (1M2) OCTAVIA (1U2), OCTAVIA Combi (1U5) BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5)</p>
<p>TBK262 AUDI SEAT SKODA VW</p> <p>A3 (8P1), A3 Sportback (8PA), A4 (8EC), A4 Avant (8ED), A6 (4F2), A6 Avant (4F5) ALTEA (5P1), ALTEA XL (5P5), TOLEDO III (5P2) OCTAVIA (1Z3), OCTAVIA Combi (1Z5) GOLF V (1K1), GOLF V PLUS (5M1), JETTA III (1K2), PASSAT (3C2), PASSAT Variant (3C5), TOURAN (1T1, 1T2)</p>	<p>TBK273 NISSAN RENAULT</p> <p>ALMERA II (N16), ALMERA II Hatchback (N16), MICRA (K12) CLIO II (BBO/1/2_, CBO/1/2_), CLIO II Box (SBO/1/2_), KANGOO (KCO/1_), KANGOO Express (FCO/1_), MEGANE II (BMO/1_, CMO/1_), SCENIC II (JMO/1_), THALIA (LBO/1/2_)</p>
<p>TBK263 SEAT VW</p> <p>LEON (1M1), TOLEDO II (1M2) BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), LUPO (6X1, 6E1), POLO (6N1)</p>	





 	 
<p>TBK274 CITROËN</p> <p>BERLINGO (MF), BERLINGO Box (M_), C5 (DC_), C5 Break (DE_), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), XSARA PICASSO (N68) SCUDO Box (220L), SCUDO Combinato (220P) ZETA (220)</p> <p>FIAT LANCIA PEUGEOT</p> <p>206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 307 Break (3E), 307 SW (3H), 406 (8B), 406 Break (8E/F), 607 (9D, 9U), 806 (221), EXPERT Box (222), EXPERT Flatbed / Chassis, PARTNER Box (5), PARTNER Combi (5F)</p>	<p>TBK281 CITROËN PEUGEOT RENAULT</p> <p>CX II, CX II Break 505 (551A) 18 (134_), 18 Variable (135_), 21 (B48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE I (J11_), MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_)</p>
<p>TBK275 MITSUBISHI NISSAN</p> <p>CARISMA (DA_), CARISMA Saloon (DA_), SPACE STAR (DGO) INTERSTAR Box (X70), INTERSTAR Bus (X70), PRIMASTAR Box (X83), PRIMASTAR Bus (X83)</p> <p>OPEL MOVANO Box (F9), MOVANO Combi (J9), VIVARO Box (F7), VIVARO Combi (J7)</p> <p>RENAULT ESPACE IV (JK0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MASTER II Box (FD), MASTER II Bus (JD/ND), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL)</p> <p>VAUXHALL MOVANO Combi (JD), MOVANO Van (FD), VIVARO Box, VIVARO Combi</p> <p>VOLVO S40 I (VS), V40 Estate (VW)</p>	<p>TBK282 CITROËN PEUGEOT RENAULT</p> <p>CX II, CX II Break 505 (551A), 505 Break (551D) 18 (134_), 21 (B48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE I (J11_)</p>
<p>TBK276 FORD</p> <p>FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), FIESTA V (JH_, JD_), FOCUS (DAW, DBW), FOCUS C-MAX, FOCUS Estate (DNW), FOCUS II (DA_), FOCUS II Turnier (DAW_), FOCUS Saloon (DFW), FUSION (JU_), PUMA (EC_)</p> <p>MAZDA 2 (B2W), 121 III (JASM, JBSM)</p>	<p>TBK283 ALFA ROMEO</p> <p>145 (930), 146 (930), 147 (937), 156 (932), 156 Sportwagon (932)</p> <p>FIAT BRAVA (182), BRAVO, BRAVO (182), DOBLO (119), DOBLO Cargo (223), GRANDE PUNTO (199), IDEA, MAREA (185), MAREA Weekend (185), MULTIPLA (186), PUNTO (188), PUNTO Van (188AX), STILO (192), STILO Multi Wagon (192), STRADA (178E)</p> <p>LANCIA LYBRA (839AX), LYBRA SW (839BX), MUSA</p>
<p>TBK277 FIAT</p> <p>DOBLO (119), DOBLO Cargo (223), PALIO (178BX), PALIO Weekend (178DX), PANDA (169), PANDA Van (141_), PUNTO (176), PUNTO (188), PUNTO Convertible (176C), PUNTO Van (188AX), SIENA (178_), STRADA (178E)</p> <p>LANCIA Y (840A), YPSILON</p>	<p>TBK284 LADA</p> <p>SAMARA (2108, 2109), SAMARA FORMA (21099)</p> <p>TBK285 AUDI</p> <p>80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4), COUPE (81, 85), COUPE (89, 8B)</p>
<p>TBK278 FORD</p> <p>FIESTA Box (J5_, J3_), FIESTA Box (JV_), FIESTA IV (JA_, JB_), FOCUS (DAW, DBW), FOCUS C-MAX, FOCUS Estate (DNW), FOCUS II (DA_), FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), FOCUS Saloon (DFW), GALAXY, MONDEO IV, MONDEO IV Turnier, S-MAX, TOURNEO CONNECT, TRANSIT CONNECT (P65_, P70_, P80_)</p>	<p>TBK286 MAZDA</p> <p>121 I (DA), 323 II (BD), 323 II Hatchback (BD), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW)</p>
<p>TBK279 CITROËN</p> <p>C4 (LC_), C4 Coupe (LA_), C5 (DC_), C5 (RC_), C5 Break (DE_), C5 Break (RE_), C8 (EA_, EB_), EVASION (22, U6), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), XSARA PICASSO (N68) SCUDO Box (220L), SCUDO Combinato (220P), ULYSSE (179AX), ULYSSE (220)</p> <p>FIAT LANCIA PEUGEOT</p> <p>PHEDRA (179), ZETA (220) 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U), 806 (221), 807 (E), EXPERT (224), EXPERT Box (222)</p>	<p>TBK287 ALFA ROMEO</p> <p>33 (905), 33 (907A), 33 Sport Wagon (907B), 33 Sportwagon (905A), 145 (930), 146 (930), ALFASUD Coupe (902.A)</p>
<p>TBK280 DACIA RENAULT</p> <p>SOLENZIA CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO, KANGOO (KC0/1_), KANGOO Express (FC0/1_), RAPID Box (F40_, G40_), THALIA (LB0/1/2_)</p>	<p>TBK288 FORD</p> <p>ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT '91 Express (AVL), ESCORT III (GAA), ESCORT III Convertible (ALD), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), FIESTA Box (FVD), FIESTA II (FBD), FIESTA III (GF), ORION I (AFD), ORION II (AFF), ORION III (GAL), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)</p>
	<p>TBK289 HONDA</p> <p>CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED), CIVIC IV (EG, EH), CIVIC IV Coupe (EJ), CIVIC IV Fastback (MA, MB), CIVIC IV Hatchback (EG), CONCERTO (HW), CONCERTO Saloon (HWW)</p>
	<p>TBK290 HONDA</p> <p>ACCORD IV (CB3, CB7), ACCORD IV Aerodeck (CB8, CC), ACCORD V (CC7), ACCORD V Aerodeck (CE), ACCORD V Coupe (CD7, CD9), ACCORD VI (CE, CF), PRELUDE IV (BB), PRELUDE V (BB), SHUTTLE (RA)</p> <p>ROVER 600 (RH)</p>
	<p>TBK291 HYUNDAI</p> <p>LANTRA I (J-1), PONY (X-2), PONY/EXCEL Saloon (X-2), S COUPE (SLC)</p> <p>MITSUBISHI COLT II (C1_A), LANCER III (C1_A, C6_A), MIRAGE Hatchback</p>
	<p>TBK292 HYUNDAI</p> <p>H-1 Box, H-1 Bus (KMF), H100 Bus (P), SONATA I (Y-2), STAREX (H1)</p> <p>MITSUBISHI GALANT III (E1_A), L 300 Bus (P0_W, P1_W, P2_W), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), SAPPORO III (E16A)</p>



NEW PARTS LIST

Liste der Neuaufnahmen • Elenco nuovi riferimenti
Liste des nouvelles références





 	 
TBK293 KIA MAZDA CLARUS (K9A), CLARUS Estate (GC), SPORTAGE (K00) 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV)	TBK303 CITROËN FIAT LANCIA PEUGEOT C5 (DC_), C5 Break (DE_), C8 (EA_, EB_) ULYSSE (179AX) PHEDRA (179) 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 607 (9D, 9U), 807 (E)
TBK294 SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), GRAND VITARA (FT, GT), SWIFT II (AH, AJ), VITARA (ET, TA), VITARA Cabrio (ET, TA), X-90 (EL)	TBK304 CITROËN PEUGEOT C4 (LC_), C4 Coupe (LA_) 206 Hatchback (2A/C), 307 (3A/C), 307 Break (3E), 307 CC (3B), EXPERT Tepee (VF3V_)
TBK295 FORD USA MAZDA PROBE II (ECP) 323 F VI (BJ), 323 S VI (BJ), 626 IV (GE), 626 IV Hatchback (GE), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), MPV II (LW), MX-6 (GE6), PREMACY (CP)	TBK305 FORD SEAT VW GALAXY (WGR) ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9) CADDY II Box (9K9A), CADDY II Estate (9K9B), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6)
TBK296 HONDA CIVIC IV (EG, EH), CIVIC IV Fastback (MA, MB), CIVIC IV Hatchback (EG), CIVIC V (EJ9, EK3/4), CIVIC V Aerodeck (MC), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK1/3/4), CIVIC VI Hatchback (EU_, EP_)	TBK306 ALFA ROMEO FIAT OPEL SAAB VAUXHALL 156 Sportwagon (932), 159, 159 Sportwagon BRAVO, CROMA (194), STILO (192), STILO Multi Wagon (192) ASTRA H, ASTRA H Estate, ASTRA H GTC, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA 9-3 (YS3F), 9-3 Convertible (YS3F), 9-3 Estate, 9-5 (YS3E), 9-5 Estate (YS3E) ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II
TBK297 HONDA ACCORD VII (CG), CIVIC IV (EG, EH), CIVIC IV Coupe (EJ), CIVIC IV Hatchback (EG), CIVIC V (EJ9, EK3/4), CIVIC V Aerodeck (MC), CIVIC V Coupe (EJ6, EJ8), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK1/3/4), CRX III (EH, EG), HR-V (GH) ROVER 400 (RT)	TBK307 HYUNDAI ACCENT (X-3), ACCENT Saloon (X-3), LANTRA II (J-2), LANTRA II Wagon (J2)
TBK298 CHEVROLET DAEWOO AVEO Saloon, KALOS, KALOS Saloon, LACETTI, LOVA, NUBIRA Estate, NUBIRA Saloon, REZZO ESPERO (KLEJ), KALOS, KALOS (KLAS), LACETTI Hatchback (KLAN), LANOS (KLAT), LANOS Saloon (KLAT), NEXIA (KLETN), NEXIA Saloon (KLETN), NUBIRA (KLAJ), NUBIRA Saloon (KLAJ), NUBIRA Saloon (KLAN), NUBIRA Wagon (KLAJ), NUBIRA Wagon (KLAN), REZZO (KLAU)	TBK308 CITROËN PEUGEOT SAXO (S0, S1) 106 II (1)
TBK299 MAZDA 323 CV (BA), 323 FV (BA), 323 PV (BA), 323 S V (BA)	TBK309 AUDI VW A4 (8D2, B5), A4 Avant (8D5, B5) PASSAT (3B2), PASSAT Variant (3B5)
TBK300 FIAT LANCIA BRAVA (182), BRAVO (182), MAREA (185), MAREA Weekend (185) Y (840A)	TBK310 FORD MAZDA FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_) 121 III (JASM, JBSM)
TBK301 DACIA NISSAN RENAULT LOGAN, LOGAN MCV ALMERA II (N16), ALMERA II Hatchback (N16), KUBISTAR (X76), MICRA (K12) CLIO Grandtour (KR0/1_), CLIO II (BBO/1/2_, CBO/1/2_), CLIO II Box (SB0/1/2_), CLIO III (BR0/1, CR0/1), GRAND SCENIC (JMO/1_), KANGOO (KCO/1_), KANGOO Express (FC0/1_), LOGAN (LS_), MEGANE II (BMO/1_, CMO/1_), MEGANE II Coupé-Cabriolet (EMO/1_), MEGANE II Estate (KMO/1_), MEGANE II Saloon (LMO/1_), MODUS (F/JPO_), SCENIC II (JMO/1_), THALIA (LBO/1/2_), TWINGO (CNO_)	TBK311 HYUNDAI KIA MITSUBISHI GALLOPER I, GALLOPER II (JK-01), H-1 Box, H-1 Bus (KMF), H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup K2500 (SD), PREGIO Box (TB) GALLOPER (JK-01), L 200 (K_T), L 300 Box (PO_W, P1_W), L 300 Bus (PO_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), L 300 Flatbed / Chassis (P1_T), PAJERO CLASSIC (V2_W), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), PAJERO III (V60, V70), PAJERO SPORT (K90), SPACE GEAR (PA/B/D_V/W)
TBK302 CITROËN FORD MAZDA PEUGEOT VOLVO BERLINGO Box, BERLINGO Box (M_), C2 (JM_), C3 (FC_), C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), JUMPY, JUMPY Box, XSARA PICASSO (N68) C-MAX, FIESTA V (JH_, JD_), FOCUS C-MAX, FOCUS II (DA_), FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), FUSION (JU_) 3 (BK14), 3 Saloon (BK12) 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 207 CC (WD_), 207 SW (WK_), 307 (3A/C), 307 Break (3E), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 407 (6D_), 407 SW (6E_), 1007 (KM_), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_), PARTNER Box, PARTNER Box (5), PARTNER Combispac (5F), PARTNER Tepee S40 II (MS), V50 (MW)	TBK312 CITROËN PEUGEOT BERLINGO (MF), BERLINGO Box (M_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), NEMO (AA_), SAXO (S0, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0) 106 II (1), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 207 SW (WK_), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 1007 (KM_), BIPPER (AA_), PARTNER Box (5), PARTNER Combispac (5F)
	TBK313 FIAT LANCIA 500, BRAVA (182), BRAVO, BRAVO (182), GRANDE PUNTO (199), IDEA, LINEA, MAREA (185), MAREA Weekend (185), PANDA (169), PUNTO (176), PUNTO (188), PUNTO Convertible (176C), SIENA (178_), STILO (192), STILO Multi Wagon (192) MUSA, Y (840A), YPSILON
	TBK314 FIAT LANCIA CINQUECENTO (170), PANDA (141A_), PANDA (169), PANDA Van (141_), PUNTO (176), PUNTO Van (176L), SEICENTO (187), SEICENTO Van (187), UNO (146A/E) Y (840A)

			
TBK315 RENAULT	CLIO II (BBO/1/2_, CBO/1/2_), CLIO III (BRO/1, CRO/1), KANGOO (KCO/1_), KANGOO Express (FCO/1_), MODUS (F/PO_), THALIA (LBO/1/2_), TWINGO (CO6_), TWINGO (CNO_)	TBK329 ALFA ROMEO FIAT	147 (937) MULTIPLA (186), PUNTO (188), STILO (192), STILO Multi Wagon (192) LYBRA (839AX), LYBRA SW (839BX) ASTRA H, ASTRA H Estate, ASTRA H GTC, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA 9-3 (YS3F), 9-3 Estate ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II
TBK316 CITROËN PEUGEOT	BERLINGO (MF), BERLINGO Box (M_), C2 (JM_), C3 (FC_), SAXO (S0, S1) 106 II (1), 206 Hatchback (2A/C), 206 SW (2E/K), PARTNER Box (5), PARTNER Combispace (5F)	LANCIA OPEL SAAB VAUXHALL	
TBK317 CHEVROLET DAEWOO	MATIZ MATIZ (KLYA), TICO (KLY3)	TBK330 AUDI VW	A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), CABRIOLET (8G7, B4) PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5)
TBK318 CITROËN PEUGEOT	BERLINGO (MF), BERLINGO Box, BERLINGO Box (M_), C3 (FC_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0) 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), PARTNER Combispace (5F)	TBK331 AUDI VW	A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), CABRIOLET (8G7, B4) PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5)
TBK319 CITROËN PEUGEOT	BERLINGO, BERLINGO (MF), BERLINGO Box, BERLINGO Box (M_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), C4 (LC_), C4 Coupe (LA_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68) 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 1007 (KM_), PARTNER Box, PARTNER Combispace (5F), PARTNER Tepee	TBK332 AUDI TBK333 AUDI TBK334 FORD LDV	A4 (8D2, B5), A4 Avant (8D5, B5) A4 (8D2, B5), A4 Avant (8D5, B5) TRANSIT Box (E_), TRANSIT Bus (E_), TRANSIT Flatbed / Chassis (E_) CONVOY Box, CONVOY Flatbed / Chassis
TBK320 SEAT VW	AROSA (6H), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), INCA (6K9) CADDY II Box (9K9A), CADDY II Estate (9K9B), FOX (5Z1), LUPO (6X1, 6E1), POLO (6N2), POLO CLASSIC (6KV2), POLO Variant (6KV5)	TBK335 AUDI VW TBK336 CITROËN PEUGEOT	A4 (8D2, B5), A4 Avant (8D5, B5) PASSAT (3B2), PASSAT Variant (3B5) C2 (JM_), C3 (FC_), C4 (LC_), C4 Coupe (LA_) 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 307 SW (3H), 1007 (KM_)
TBK321 LADA	110, 111, 112, KALINA Estate (1117), KALINA Hatchback (1119), KALINA Saloon (1118), SAMARA (2108, 2109), SAMARA FORMA (21099)	TBK337 BMW TBK338 CITROËN FIAT FORD LANCIA PEUGEOT VOLVO	3 (E21), 3 (E30), 3 Convertible (E30), 5 (E28), 5 (E34) C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C8 (EA_, EB_), JUMPY, JUMPY Box SCUDO, SCUDO Box, SCUDO Flatbed / Chassis, ULYSSE (179AX) C-MAX, FOCUS C-MAX, FOCUS II (DA_), FOCUS II Convertible, FOCUS II Saloon (DA_), FOCUS II Turnier (DA_), GALAXY, KUGA, MONDEO IV, MONDEO IV Saloon, MONDEO IV Turnier, S-MAX PHEDRA (179) 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U), 807 (E), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_) C30, C70 Convertible, S40 II (MS), V50 (MW), V70 III Estate
TBK322 NISSAN RENAULT SUZUKI	PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P12) GRAND SCENIC (JMO/1_), LAGUNA II (BGO/1_), LAGUNA II Grandtour (KGO/1_), MEGANE II (BMO/1_, CMO/1_), MEGANE II Coupé-Cabriolet (EMO/1_), MEGANE II Estate (KMO/1_), MEGANE II Saloon (LMO/1_), SCENIC II (JMO/1_) GRAND VITARA	TBK339 HYUNDAI TBK340 MAZDA TBK341 AUDI SKODA VW	ACCENT (LC), ACCENT (MC), ACCENT (X-3), ACCENT Saloon (LC), ACCENT Saloon (MC), ACCENT Saloon (X-3), COUPE (GK), COUPE (RD), ELANTRA (XD), ELANTRA Saloon (XD), GETZ (TB), MATRIX (FC) CERATO, CERATO Saloon, RIO II, RIO II Saloon 323 CV (BA), 323 F V (BA), 323 F VI (B), 323 P V (BA), 323 S V (BA), 323 S VI (B) A4 (8D2, B5), A4 (8E2, B6), A4 (8EC), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5) SUPERB (3U4) PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)
TBK323 RENAULT	ESPACE III (JEO_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SCENIC (JAO/1_)		
TBK325 HYUNDAI KIA	ACCENT (LC), ACCENT (MC), ACCENT (X-3), ACCENT Saloon (LC), ACCENT Saloon (MC), ACCENT Saloon (X-3), COUPE (GK), COUPE (RD), ELANTRA (XD), ELANTRA Saloon (XD), GETZ (TB), MATRIX (FC) CERATO, CERATO Saloon, RIO II, RIO II Saloon		
TBK326 FORD	COUGAR (EC_), FOCUS (DAW, DBW), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP)		
TBK327 FORD	COUGAR (EC_), FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), TOURNEO CONNECT, TRANSIT CONNECT (P65_, P70_, P80_)		
TBK328 HYUNDAI KIA	ATOS (MX), ATOS PRIME (MX), GETZ (TB) PICANTO (BA)		



NEW PARTS LIST

Liste der Neuaufnahmen • Elenco nuovi riferimenti
Liste des nouvelles références

 	 
TBK342 MAZDA 323 CIV (BG), 323 CV (BA), 323 F IV (BG), 323 FV (BA), 323 III (BF), 323 III Hatchback (BF), 323 S IV (BG), 323 S V (BA), MX-3 (EC), MX-5 I (NA), MX-5 II (NB), XEDOS 6 (CA)	TBK357 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH) SKODA VW SUPERB (3U4) PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)
TBK343 MAZDA 323 F VI (BJ), 323 S VI (BJ), 626 IV (GE), 626 IV Hatchback (GE), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), PREMACY (CP)	TBK358 AUDI A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8) VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)
TBK344 CITROËN JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z), JUMPER Flatbed / Chassis (230) FIAT DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z), DUCATO Flatbed / Chassis (230) PEUGEOT BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z), BOXER Flatbed / Chassis (ZCT_)	TBK359 TOYOTA COROLLA (_E8_), COROLLA (_E9_), COROLLA (_E10_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA FX Compact (E8B), COROLLA Liftback (_E8_), COROLLA Liftback (_E9_), COROLLA Liftback (_E10_), COROLLA Station Wagon (_E9_), COROLLA Wagon (_E10_), STARLET (_P7_), STARLET (_P8_)
TBK345 ALFA ROMEO FIAT 145 (930), 146 (930), 155 (167), 156 (932), GT BARCETTA (183), PUNTO (188), STILO (192), STILO Multi Wagon (192)	TBK360 TOYOTA AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_), CAMRY (_V1_), CAMRY (_V2_), CAMRY (_V20), CAMRY Station Wagon (_V2_), CAMRY Station Wagon (_V10), CARINA E (_T19_), CARINA E Saloon (_T19_), CARINA E Sportswagon (_T19_), CARINA II (_T17_), CARINA II Saloon (_T17_), CARINA II Station Wagon (_T17_), PICNIC (_XM10), RAV 4 I (SXA1_), RAV 4 I Cabrio (SXA1_)
TBK346 HONDA ACCORD VI (CE, CF), ACCORD VII (CG), ACCORD VII Coupe (CG), ACCORD VII Hatchback (CH)	TBK347 LAND ROVER MG FREELANDER (LN), FREELANDER Soft Top MG TF, MG ZR, MG ZS, MG ZS Hatchback, MG ZT, MG ZT-T, MGF (RD) ROVER 25 (RF), 45 (RT), 45 Saloon (RT), 75 (RI), 75 Tourer (RI), 200 (RF), 400 (RT), 400 Hatchback (RT), 400 Tourer (XW), STREETWISE
TBK348 AUDI A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH) SKODA VW SUPERB (3U4) PASSAT (3B3), PASSAT Variant (3B6)	TBK350 ALFA ROMEO FIAT 147 (937), 156 (932), 156 Sportwagon (932), GT STILO (192), STILO Multi Wagon (192)
TBK352 FIAT BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185), PALIO Weekend (178DX), STRADA (178E) LANCIA KAPPA (838A), KAPPA SW (838B)	TBK353 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH) SKODA VW SUPERB (3U4) PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)
TBK350 ALFA ROMEO FIAT 147 (937), 156 (932), 156 Sportwagon (932), GT STILO (192), STILO Multi Wagon (192)	TBK354 AUDI A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH) SKODA VW SUPERB (3U4) PASSAT (3B3), PASSAT Variant (3B6)
TBK352 FIAT BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185), PALIO Weekend (178DX), STRADA (178E) LANCIA KAPPA (838A), KAPPA SW (838B)	TBK355 CITROËN FIAT LANCIA PEUGEOT C5 (DC_), C5 (RC_), C5 Break (DE_), C5 Break (RE_), C8 (EA_, EB_) ULYSSE (179AX) PHEDRA (179) 406 (8B), 406 Break (8E/F), 607 (9D, 9U), 807 (E)
TBK353 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH) SKODA VW SUPERB (3U4) PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)	TBK354 AUDI A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH) SKODA VW SUPERB (3U4) PASSAT (3B3), PASSAT Variant (3B6)
TBK354 AUDI A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH) SKODA VW SUPERB (3U4) PASSAT (3B3), PASSAT Variant (3B6)	TBK356 ALFA ROMEO FIAT LANCIA 145 (930), 146 (930), 147 (937), 155 (167), 156 (932), 156 Sportwagon (932), 166 (936), GTV (916C_), SPIDER (916S_) BARCETTA (183), COUPE (FA/175) DEDRA (835), DEDRA SW (835), DELTA II (836)



kW



ALFA ROMEO

33 (905)

1.2 (905.A)	AR 30585	50	06/83 → 12/89	⊗	Alt. 55A, 05/87→ Not Alt. 55A, 05/87→ 05/87→	SVB10865	10x865
				⊗		SVB10875	10x875
						TB106	98x17
1.3		58	05/83 → 12/89	⊗	Alt. 55A, Downdraft Carb Two-stage Carb	SVB10865	10x865
				⊗		SVB10850	10x85063
						TB106	98x17
1.3 (905.A1A, 905.A1C, 905.A1D, 905.A1F, 905.A1H)	AR 30168, AR 30587	63	10/84 → 12/89	⊗	Alt. 55A, Downdraft Carb Two-stage Carb	SVB10865	10x865
				⊗		SVB10850	10x850
						TB106	98x17
1.3 (905.A1B, 905.A1C, 905.A1G)	AR 30502, AR 30586	55	06/83 → 12/89	⊗	Alt. 55A, Downdraft Carb Two-stage Carb	SVB10865	10x865
				⊗		SVB10850	10x850
						TB106	98x17
1.3 i.e.		66	05/83 → 12/89	⊗	Alt. 55A, Downdraft Carb Not Alt. 55A, Downdraft Carb	SVB10865	10x865
				⊗		SVB10875	10x875
						TB106	98x17
1.5	AR 30182	70	05/83 → 12/93	⊗	Alt. 55A, Downdraft Carb →12/90 01/91→ 01/91→	SVB10865	10x865
						TB106	98x17
						TB338	100x17
1.5 (905.A2)	AR 30588	75	07/86 → 12/89		Alt. 55A, Downdraft Carb Two-stage Carb	SVB10825	10x825
				⊗		SVB10865	10x865
						SVB10850	10x850
1.5 (905.A2A)	AR 30143, AR 30504	62	06/83 → 12/85	⊗	Alt. 55A, Downdraft Carb	TB106	98x17
						SVB10865	10x865
						SVB10825	10x825
1.5 (905.A2G)	AR 30520	66	06/83 → 12/86	⊗	Alt. 55A, Downdraft Carb	SVB10865	10x865
						TB106	98x17
						SVB10825	10x825
1.5 4x4 (905.A2)	AR 30504	62	11/83 → 12/84	⊗		SVB10850	10x850
				⊗		SVB10875	10x875
						TB106	98x17
1.5 4x4 (905.A2)	AR 30588	75	07/86 → 12/89	⊗		SVB10825	10x825
				⊗		SVB10850	10x850
						SVB10875	10x875
1.5 4x4 (905.A2A)	AR 30514	70	01/84 → 12/89	⊗		TB106	98x17
				⊗		SVB10865	10x865
						SVB10875	10x875
1.5 4x4 (905.A2F)	AR 30520	66	01/85 → 09/86	⊗		SVB10825	10x825
				⊗		SVB10865	10x865
						SVB10875	10x875
1.5 4x4 (905.A2M, 905.A2T)	AR 30146, AR 30588	77	09/86 → 12/89	⊗		SVB10825	10x825
				⊗		SVB10850	10x850
						SVB10875	10x875
1.5 QV (905.A2N, 905.A2V)	AR 30146, AR 30508, AR 30588	77	06/84 → 12/89	⊗	Alt. 55A, Downdraft Carb	TB106	98x17
				⊗		SVB10865	10x865
						SVB10825	10x825



kw



ALFA ROMEO

...ALFA ROMEO

...33 (905)

1.7		95	01/86 → 12/89	 		SVB13950 13x950 SVB10850 10x850 TB106 98x17 TB338 100x17 TBK287 SVB10825 10x825
	AR 30550	87	01/86 → 12/89	 	→12/88 01/89→ 01/89→	SVB13950 13x950 SVB10850 10x850 TB106 98x17 TB338 100x17 TBK287 SVB10825 10x825
1.7 i.e. (905.A3D)	AR 30558	77	09/88 → 12/89	 	→12/88 01/89→ 01/89→	SVB13950 13x950 SVB10850 10x850 TB106 98x17 TB338 100x17 TBK287 SVB10825 10x825
1.7 QV (905.A3)	AR 30550	84	03/88 → 12/89	 	→12/88 01/89→ 01/89→	SVB13950 13x950 SVB10850 10x850 TB106 98x17 TB338 100x17 TBK287 SVB10825 10x825
1.8 TD	VM 82 A	54	01/86 → 06/90		06/86→	SVB101150 10x1150

33 (907A)

1.4		58	06/91 → 09/94	 	Alt. 55A, Downdraft Carb Two-stage Carb	SVB10865 10x865 SVB10850 10x850 TB338 100x17 TBK287 SVB10825 10x825
1.4 4x4		66	07/90 → 12/92	 	→12/90 01/91→ 01/91→	TB106 98x17 TB338 100x17 TBK287 SVB10825 10x825
1.4 i.e. (907.A3A, 907.A3B)	AR 30753, AR 30755	65	06/91 → 09/94	 	Alt. 55A, Downdraft Carb Not Alt. 55A, Downdraft Carb Two-stage Carb	SVB10865 10x865 SVB10875 10x875 SVB10850 10x850 TB338 100x17 TBK287 SVB10825 10x825
		66	06/91 → 09/94	 	→09/92 Alt. 55A, Downdraft Carb	SVB13950 13x950 SVB10850 10x850 SVB10865 10x865 TB338 100x17 TBK287 SVB10825 10x825
1.5		77	01/90 → 04/93	 	Alt. 55A, Downdraft Carb →12/90 01/91→ 01/91→	SVB10865 10x865 TB106 98x17 TB338 100x17 TBK287 SVB10825 10x825
1.5 i.e.	AR 30751	71	01/90 → 09/94	 	Alt. 55A, Downdraft Carb →12/90 01/91→ 01/91→	SVB10865 10x865 TB106 98x17 TB338 100x17 TBK287 SVB10825 10x825



kW



...ALFA ROMEO

...33 (907A)

1.5 i.e. (907A2A)	AR 30750	74	07/90 → 08/91	⊗	Alt. 55A, Downdraft Carb	SVB10865	10x865		
				⊗	Two-stage Carb	SVB10850	10x850		
					→12/90	TB106	98x17		
					01/91→	TB338	100x17		
				KIT	01/91→	TBK287			
				⊗		SVB10825	10x825		
1.7 16V (907.A1B)	AR 30746	101	01/90 → 03/92	⊗	07/90→	SVB13950	13x950		
				⊗	07/90→	SVB10850	10x850		
					07/90→	TB274	121x20		
				⊗	07/90→	SVB10825	10x825		
1.7 16V (907.A1C)	AR 30747	95	01/90 → 09/94	⊗	07/90→	SVB13950	13x950		
				⊗	07/90→	SVB10850	10x850		
					07/90→	TB274	121x20		
				97	01/90 → 03/92	⊗	07/90→	SVB10825	10x825
						⊗	07/90→	SVB13950	13x950
				⊗	07/90→	SVB10850	10x850		
					07/90→	TB274	121x20		
				⊗	07/90→	SVB10825	10x825		
1.7 16V 4x4 (907.A1G)	AR 30747	95	01/90 → 09/94	⊗	07/90→	SVB13950	13x950		
				⊗	07/90→	SVB10850	10x850		
					07/90→	TB274	121x20		
				97	01/90 → 09/94	⊗	07/90→	SVB10825	10x825
						⊗	07/90→	SVB13950	13x950
				⊗	07/90→	SVB10850	10x850		
					07/90→	TB274	121x20		
				⊗	07/90→	SVB10825	10x825		
1.7 16V 4x4 (907A1F)	AR 30746	101	01/90 → 09/94	⊗	07/90→	SVB13950	13x950		
				⊗	07/90→	SVB10850	10x850		
					07/90→	TB274	121x20		
				⊗	07/90→	SVB10825	10x825		
1.7 i.e. (907.A1A)	AR 30736, AR 30737	79	01/90 → 03/92	⊗		SVB13950	13x950		
				⊗		SVB10850	10x850		
						TB338	100x17		
				KIT		TBK287			
				⊗		SVB10825	10x825		
	AR 30737 A	77	04/92 → 09/94	⊗		SVB13950	13x950		
				⊗		SVB10850	10x850		
						TB338	100x17		
				KIT		TBK287			
				⊗		SVB10825	10x825		
1.7 i.e. 4x4	AR 30736, AR 30737	79	01/90 → 03/92	⊗		SVB13950	13x950		
				⊗		SVB10850	10x850		
						TB338	100x17		
				KIT		TBK287			
				⊗		SVB10825	10x825		
1.8 TD (907A5)	VM 96 A	62	07/90 → 09/94	⊗	→12/92	SVB101150	10x1150		

33 Sport Wagon (907B)

1.4 i.e.	AR 30755	65	06/91 → 09/94	⊗	Alt. 55A, Downdraft Carb	SVB10865	10x865
				⊗	Not Alt. 55A, Downdraft Carb	SVB10875	10x875
				⊗	Two-stage Carb	SVB10850	10x850
						TB338	100x17
				KIT		TBK287	
				⊗		SVB10825	10x825
		66	06/91 → 09/94	⊗	→09/92	SVB13950	13x950
				⊗		SVB10850	10x850
				⊗	Alt. 55A, Downdraft Carb	SVB10865	10x865
						TB338	100x17
				KIT		TBK287	
				⊗		SVB10825	10x825



kw



ALFA ROMEO

...ALFA ROMEO

...33 Sport Wagon (907B)

1.4 i.e. 4x4	AR 30587, AR 30755	66	06/91 → 09/94			SVB10875	10x875
						TB338	100x17
						TBK287	
						SVB10825	10x825
1.5 i.e	AR 30751	71	01/90 → 09/94		Alt. 55A, Downdraft Carb	SVB10865	10x865
					→12/90	TB106	98x17
					01/91 →	TB338	100x17
					01/91 →	TBK287	
						SVB10825	10x825
1.7 16V	AR 30746	101	01/90 → 03/92		07/90 →	SVB13950	13x950
					07/90 →	SVB10850	10x850
					07/90 →	TB274	121x20
					07/90 →	SVB10825	10x825
1.7 16V (907.B1G)	AR 30747	97	01/90 → 09/94		07/90 →	SVB13950	13x950
					07/90 →	SVB10850	10x850
					07/90 →	TB274	121x20
					07/90 →	SVB10825	10x825
		95	01/90 → 09/94		07/90 →	SVB13950	13x950
					07/90 →	SVB10850	10x850
					07/90 →	TB274	121x20
					07/90 →	SVB10825	10x825
1.7 16V 4x4 (907.B1H)	AR 30747	97	01/90 → 03/92		07/90 →	SVB13950	13x950
					07/90 →	SVB10850	10x850
					07/90 →	TB274	121x20
					07/90 →	SVB10825	10x825
		95	01/90 → 09/94		07/90 →	SVB13950	13x950
					07/90 →	SVB10850	10x850
					07/90 →	TB274	121x20
					07/90 →	SVB10825	10x825
1.7 i.e. (907.B1A)	AR 30736, AR 30737	79	01/90 → 03/92			SVB13950	13x950
						SVB10850	10x850
						TB338	100x17
						TBK287	
						SVB10825	10x825
	AR 30737	77	04/92 → 09/94			SVB13950	13x950
						SVB10850	10x850
						TB338	100x17
						TBK287	
						SVB10825	10x825
1.7 i.e. 4x4 (907.B1E)	AR 30736, AR 30737	79	01/90 → 03/92			SVB13950	13x950
						SVB10850	10x850
						TB338	100x17
						TBK287	
						SVB10825	10x825

33 Sportwagon (905A)

1.4		66	01/84 → 12/88		Alt. 55A, Downdraft Carb	SVB10865	10x865
					Two-stage Carb	SVB10850	10x850
						TB106	98x17
						SVB10825	10x825
1.5	AR 30520	66	09/84 → 12/86		Alt. 55A, Downdraft Carb	SVB10865	10x865
						TB106	98x17
						SVB10825	10x825
		75	12/86 → 12/89		Alt. 55A, Downdraft Carb	SVB10865	10x865
						TB106	98x17
						SVB10825	10x825
	AR 30146, AR 30508, AR 30588	77	12/86 → 12/89		Alt. 55A, Downdraft Carb	SVB10865	10x865
						TB106	98x17
						SVB10825	10x825
		70	09/84 → 12/87		Alt. 55A, Downdraft Carb	SVB10865	10x865
						TB106	98x17
						SVB10825	10x825





kW



...ALFA ROMEO

...33 Sportwagon (905A)

1.5 4x4	AR 30588	75	12/86 → 12/89			SVB10875	10x875
						TB106	98x17
						SVB10825	10x825
	AR 30182	70	09/84 → 12/87			SVB10875	10x875
						TB106	98x17
						SVB10825	10x825
1.5 4x4 (905.A2B, 905.A2C)	AR 30520	66	09/84 → 12/86			SVB10875	10x875
						TB106	98x17
						SVB10825	10x825
1.5 4x4 (905.A2U)	AR 30146, AR 30508, AR 30588	77	12/86 → 03/89			SVB10875	10x875
						TB106	98x17
						SVB10825	10x825
1.7	AR 30550	87	03/88 → 12/89			SVB13950	13x950
						SVB10850	10x850
					→12/88	TB106	98x17
					01/89→	TB338	100x17
					01/89→	TBK287	
						SVB10825	10x825
1.7 i.e.	AR 30558	77	09/88 → 12/89			SVB13950	13x950
						SVB10850	10x850
					→12/88	TB106	98x17
					01/89→	TB338	100x17
					01/89→	TBK287	
						SVB10825	10x825
1.7 i.e. 4x4	AR 30558	77	09/88 → 12/89			SVB13950	13x950
						SVB10850	10x850
					→12/88	TB106	98x17
					01/89→	TB338	100x17
					01/89→	TBK287	
						SVB10825	10x825
1.8 TD		62	01/86 → 12/89			SVB101150	10x1150

75 (162B)

1.6		76	05/85 → 09/89			SVB13850	13x850
						SVB10825	10x825
						SVB131100	13x1100
1.6 (162.B2B, 162.B2C)	AR 06100	81	05/85 → 09/89			SVB13850	13x850
						SVB10825	10x825
						SVB131100	13x1100
1.6 (162.B2B, 162.B2C) CAT	AR 61101	81	05/89 → 02/92			SVB13850	13x850
						SVB10825	10x825
						SVB131100	13x1100
1.8 (162.B1A, 162.B1B)	AR 06202	85	09/85 → 06/89			SVB13850	13x850
						SVB10825	10x825
						SVB131100	13x1100
1.8 (162.B1H)	AR 61201	90	08/89 → 02/92			SVB13850	13x850
						SVB10825	10x825
						SVB131100	13x1100
		95	08/89 → 02/92			SVB13850	13x850
						SVB10825	10x825
						SVB131100	13x1100
1.8 (162.B1L, 162.B1F)	AR 06168, AR 61102	88	09/88 → 02/92			SVB13850	13x850
						SVB10825	10x825
						SVB131100	13x1100
1.8 Turbo (162.B1C, 162.B1D, 162.B1G)	AR 06134	110	09/86 → 02/92			SVB13850	13x850
						SVB10825	10x825
						SVB131100	13x1100
1.8 Turbo i.e. (162.B1E)	AR 06158	114	02/86 → 01/90			SVB13850	13x850
						SVB10825	10x825
						SVB131100	13x1100
2.0 T.S (162.B4A) CAT	AR 06224	109	05/85 → 02/92		01/87→	SVB13850	13x850
					01/87→	SVB10825	10x825
					01/87→	SVB131100	13x1100



kW



ALFA ROMEO

...ALFA ROMEO

...75 (162B)

2.0 T.S. (162.4CB, 162.B4, 162.B4A)	AR 06166, AR 06224	107	01/87 → 02/92	 	SVB13850 SVB10825 SVB131100	13x850 10x825 13x1100
2.0 T.S. (162.B4A)	AR 06224	109	01/87 → 12/88	 	SVB13850 SVB10825 SVB131100	13x850 10x825 13x1100
2.0 TD (162.BD, 162.BG)	VM 80 A	70	05/85 → 09/92	 	→10/90 →10/90 →10/90 SVB13710 SVB101100 SVB10650	13x710 10x1100 10x650
2.4 TD	VM 81 A	82	01/89 → 02/92	 	05/89→ 05/89→ 05/89→ SVB13710 SVB101100 SVB10650	13x710 10x1100 10x650
2.5 V6 (162.B3)	AR 01646, AR 01911	115	05/85 → 08/86	 	SVB13925 SVB10840 TB134 SVB10990	13x925 10x840 134x25.4 10x990
2.5 V6 CAT	AR 01648	113	09/86 → 04/89	 	SVB13925 SVB10840 TB134 SVB10990	13x925 10x840 134x25.4 10x990
3.0 V6 (162.B6A)	AR 06120	136	01/87 → 12/90	 	SVB13925 SVB10840 TB134 SVB10990	13x925 10x840 134x25.4 10x990
3.0 V6 (162.B6A) CAT	AR 06124	136	01/87 → 02/92	 	SVB13925 SVB10840 TB134 SVB10990	13x925 10x840 134x25.4 10x990
3.0 V6 (162.B6C)	AR 61503	141	02/90 → 02/92	 	SVB13925 SVB10840 TB134 SVB10990	13x925 10x840 134x25.4 10x990

90 (162)

1.8		89	10/84 → 07/87	 	SVB13850 SVB10825 SVB131125	13x850 10x825 13x1125
1.8 (162.A1A)	AR 06202	85	10/84 → 07/87	 	SVB13850 SVB10825 SVB131125	13x850 10x825 13x1125
2.0 i.e.	AR 06210	97	10/84 → 07/87	 	SVB13925 SVB10840 TB134 SVB10990	13x925 10x840 134x25.4 10x990
2.0 i.e. (162.A2A, 162.A2E)	AR 01713, AR 06212	94	10/84 → 07/87	 	SVB13850 SVB10825 SVB131125	13x850 10x825 13x1125
2.4 TD (162.B5)	VM 81 A	81	10/84 → 07/87	 	SVB101100 SVB10650	10x1100 10x650
2.5 i.e. V6	AR 01646, AR 01911	114	10/84 → 07/87	 	SVB13925 SVB10840 TB134 SVB10990	13x925 10x840 134x25.4 10x990
2.5 i.e. V6 (162.A, 162.AA)	AR 01646, AR 01911	110	10/84 → 07/87	 	SVB13925 SVB10840 TB134 SVB10990	13x925 10x840 134x25.4 10x990



kW


...ALFA ROMEO
145 (930)

1.4 i.e.	AR 33501	66	07/94 → 12/96			SVB13950 13x950 MVB865R5 5PK865 TB338 100x17 TBK287 SVB10825 10x825
1.4 i.e. 16V T.S.	AR 33503, AR 38501	76	12/96 → 01/01		A/C(+), Eng Nr 1391188 → Eng. AR33503, A/C(-) Eng. AR33503, A/C(+), → Eng Nr 1391187 Eng. AR33503	MVB1855R6 6PK1855 MVB1045R6 6PK1045 MVB1842R6 6PK1842 TB528 163x24 TBK207
1.6 i.e.	AR 33201	76	10/94 → 12/96			SVB13950 13x950 MVB865R5 5PK865 TB338 100x17 TBK287 SVB10825 10x825
1.6 i.e. 16V T.S.	AR 38201, AR 67601	88	12/96 → 01/01		A/C(-) A/C(+)	MVB1045R6 6PK1045 MVB1855R6 6PK1855 TB559 166x24 TBK345
1.7 i.e. 16V	AR 33401	95	10/94 → 12/96			SVB13950 13x950 MVB865R5 5PK865 TB274 121x20 SVB10825 10x825
1.8 i.e. 16V	AR 32201	106	03/98 → 01/01		A/C(-) A/C(+) A/C(+)	MVB1045R6 6PK1045 MVB1842R6 6PK1842 MVB1855R6 6PK1855 TB468 168x24 TBK356
1.8 i.e. 16V T.S.	AR 38401, AR 67106	103	12/96 → 12/98		A/C(-) A/C(+) A/C(+)	MVB1045R6 6PK1045 MVB1842R6 6PK1842 MVB1855R6 6PK1855 TB468 168x24 TBK356
1.9 JTD	AR 32302	77	02/99 → 01/01		A/C(-) A/C(+), → Eng Nr 1370829 A/C(+), Eng Nr 1370830 →	MVB1035R6 6PK1035 MVB1775R6 6PK1775 MVB1795R6 6PK1795 TB639 190x24 TBK283
1.9 TD	AR 33601, AR 67501	66	10/94 → 02/99		A/C(-), → Eng Nr 1723043 A/C(-), Eng Nr 1723044 → A/C(+), → Eng Nr 1723043 A/C(+), Eng Nr 1723044 →	MVB938R5 5PK938 MVB906R5 5PK906 MVB915R5 5PK915 MVB970R5 5PK970 MVB985R5 5PK985 TB307 173x22 TBK065 SVB10725 10x725
2.0 16V Quadrifoglio	AR 32301	114	03/98 → 01/01		A/C(-), → Eng Nr 1385143 A/C(-), Eng Nr 1385144 → A/C(+), → Eng Nr 1385143 A/C(+), Eng Nr 1385144 →	MVB1083R7 7PK1083 MVB1080R6 6PK1080 MVB1969R7 7PK1969 MVB1980R6 6PK1980 TB468 168x24 TBK356
2.0 16V T.S.	AR 67204	110	10/95 → 01/01		A/C(-), 10/96 → 02/99 A/C(+), 10/96 → 02/99 10/96 → 02/99 10/96 → 02/99 → Eng. No. 0117877	MVB1083R7 7PK1083 MVB1952R7 7PK1952 TB468 168x24 TBK356 TB607 126x15



kw



ALFA ROMEO

...ALFA ROMEO

146 (930)

1.4 i.e.	AR 33501	66	12/94 → 12/96	 	05/95 → 05/95 → 05/95 → 05/95 → 05/95 →	SVB13950 MVB865R5 TB338 TBK287 SVB10825	13x950 5PK865 100x17 10x825
1.4 i.e. 16V T.S.	AR 33503, AR 38501	76	11/96 → 01/01	 	A/C(+), Eng Nr 1391188 → Eng. AR33503, A/C(-) Eng. AR33503, A/C(+), → Eng Nr 1391187 Eng. AR33503	MVB1855R6 MVB1045R6 MVB1842R6 TB528 TBK207	6PK1855 6PK1045 6PK1842 163x24
1.6 i.e.	AR 33201	76	12/94 → 12/96	 	05/95 → 05/95 → 05/95 → 05/95 → 05/95 →	SVB13950 MVB865R5 TB338 TBK287 SVB10825	13x950 5PK865 100x17 10x825
1.6 i.e. 16V T.S.	AR 38201, AR 67601	88	11/96 → 01/01	 	A/C(-) A/C(+) Eng. AR67601, A/C(+), → Ch. 165088	MVB1045R6 MVB1855R6 MVB1842R6 TB559 TBK345	6PK1045 6PK1855 6PK1842 166x24
1.7 i.e. 16V	AR 33401	95	12/94 → 12/96	 	05/95 → 05/95 → 05/95 → 05/95 →	SVB13950 MVB865R5 TB274 SVB10825	13x950 5PK865 121x20 10x825
1.8 i.e. 16V T.S.	AR 38401, AR 67106	103	11/96 → 01/01	 	Eng. AR67106, A/C(-), →02/99 Eng. AR67106, A/C(+), →02/99 →02/99 Eng. AR67106, →02/99	MVB1045R6 MVB1842R6 TB468 TBK356	6PK1045 6PK1842 168x24 168x24
	AR 32201	106	03/98 → 01/01	 	A/C(-) A/C(+) 	MVB1045R6 MVB1855R6 TB468 TBK356	6PK1045 6PK1855 168x24
1.9 JTD	AR 32302	77	02/99 → 01/01	 	A/C(-) A/C(+), → Eng Nr 1370829 A/C(+), Eng Nr 1370830 →	MVB1035R6 MVB1775R6 MVB1795R6 TB639 TBK283	6PK1035 6PK1775 6PK1795 190x24
1.9 TD	AR 33601, AR 67501	66	12/94 → 02/99	 	05/95 →09/96 A/C(-), 05/95 →09/96, → Eng Nr 1723043 A/C(-), 05/95 →09/96, Eng Nr 1723044 → A/C(+), 05/95 →09/96, → Eng Nr 1723043 A/C(+), 05/95 →09/96, Eng Nr 1723044 →	MVB938R5 MVB906R5 MVB915R5 MVB970R5 MVB985R5 TB307 TBK065 SVB10725	5PK938 5PK906 5PK915 5PK970 5PK985 173x22 10x725
2.0 16V Quadrifoglio	AR 32301	114	03/98 → 01/01	 	A/C(-), 03/99 → A/C(+), 03/99 → 03/99 → 03/99 →	MVB1080R6 MVB1980R6 TB468 TBK356	6PK1080 6PK1980 168x24
2.0 16V T.S.	AR 67204	110	10/95 → 01/01	 	A/C(-), →09/99 A/C(+), →09/99 →09/99 →09/99 → Eng. No. 0117877	MVB1083R7 MVB1952R7 TB468 TBK356 TB607	7PK1083 7PK1952 168x24 126x15



kW



...ALFA ROMEO

147 (937)

1.6 16V T.SPARK (937AXB1A)	AR 32104	88	01/01 →		A/C(-), → Eng Nr 2835764	MVB1045R6	6PK1045
					A/C(-), Eng Nr 2835765 →	MVB1025R6	6PK1025
					A/C(+), → Eng Nr 2835764	MVB1855R6	6PK1855
					A/C(+), Eng Nr 2835765 →	MVB1842R6	6PK1842
						TB528	163x24
						TBK207	
1.6 16V T.SPARK ECO (937AXA1A)	AR 37203	77	01/01 →		A/C(-), → Eng Nr 2835764	MVB1045R6	6PK1045
					A/C(-), Eng Nr 2835765 →	MVB1025R6	6PK1025
					A/C(+), → Eng Nr 2835764	MVB1855R6	6PK1855
					A/C(+), Eng Nr 2835765 →	MVB1842R6	6PK1842
						TB528	163x24
						TBK207	
1.9 JTD	182 B9.000	74	06/03 →		A/C(-), →09/06	MVB1035R6	6PK1035
					A/C(+), →09/06	MVB1833R6	6PK1833
					→09/06	TB639	190x24
					→09/06, → Eng Nr 4109227	TBK283	
					→09/06, Eng Nr 4109228 →	TBK329	
1.9 JTD (937AXD1A)	937 A2.000	85	04/01 →		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
						TBK283	
					→08/05, Eng Nr 4109227 →	TBK329	
1.9 JTD 16V	192 A5.000	103	11/02 →			MVB1833R6	6PK1833
						TB725	198x24
						TBK350	
		93	09/03 → 09/04			MVB1833R6	6PK1833
						TB725	198x24
						TBK350	
	192 B1.000	100	10/04 →			MVB1833R6	6PK1833
						TB725	198x24
						TBK350	
1.9 JTDM 16V	937 A5.000	110	07/05 →			MVB1833R6	6PK1833
						TB725	198x24
						TBK350	
		85	10/04 →		A/C(-), 06/05 →	MVB1035R6	6PK1035
					A/C(+), 06/05 →	MVB1833R6	6PK1833
					06/05 →	TB639	190x24
					06/05 →	TBK283	
1.9 JTDM 8V	937 A3.000	88	07/05 →		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
						TBK283	
2.0 16V T.SPARK (937AXC1_)	AR 32310	110	01/01 →		A/C(-), → Eng Nr 2835764	MVB1080R6	6PK1080
					A/C(-), Eng Nr 2835765 →	MVB1065R6	6PK1065
					A/C(+), → Eng Nr 2835764	MVB1980R6	6PK1980
					A/C(+), Eng Nr 2835765 →	MVB1960R6	6PK1960
						TB468	168x24
						TBK356	
						TB732	130x15
3.2 GTA	932 A.000	184	02/03 →		→09/06	MVB1995R6	6PK1995
					→09/06	TB532	185x28
155 (167)							
1.6 16V T.S.	AR 67601	88	05/96 → 12/97		A/C(-)	MVB1045R6	6PK1045
					A/C(+)	MVB1842R6	6PK1842
						TB559	166x24
						TBK345	
1.7 T.S.	AR 67103	83	04/93 → 04/96		A/C(-)	MVB800R5	5PK800
					A/C(+)	MVB1285R5	5PK1285
						MVB960R4	4PK960



kW



ALFA ROMEO

...ALFA ROMEO

...155 (167)

1.7 T.S. (167.A4D, 167.A4H)	AR 67105	85	04/93 → 04/96	⊗	A/C(-)	MVB800R5	5PK800
				⊗	A/C(+)	MVB1285R5	5PK1285
				⊗		MVB960R4	4PK960
1.7 T.S. 16V	AR 67106	103	05/96 → 12/97	⊗	A/C(-)	MVB1045R6	6PK1045
				⊗	A/C(+)	MVB1842R6	6PK1842
				⊗		TB468	168x24
				⊗		TBK356	
1.8 T.S.	AR 67402	77	02/92 → 12/97	⊗	A/C(-), →12/96	MVB800R5	5PK800
				⊗	A/C(+), →12/96	MVB1285R5	5PK1285
				⊗	→12/96	MVB960R4	4PK960
	AR 67101	95	02/92 → 06/93	⊗	A/C(-)	MVB800R5	5PK800
				⊗	A/C(+)	MVB1285R5	5PK1285
				⊗		MVB960R4	4PK960
1.8 T.S. Sport (167.A4A, 167.A4C, 167.A4E)	AR 67101, AR 67102	93	01/92 → 12/96	⊗	A/C(-)	MVB800R5	5PK800
				⊗	A/C(+)	MVB1285R5	5PK1285
				⊗		MVB960R4	4PK960
1.9 TD (167.A3)	AR 67501	66	04/93 → 12/97	⊗		MVB938R5	5PK938
				⊗	A/C(-)	MVB915R5	5PK915
				⊗	A/C(-), → Eng Nr 1723043	MVB906R5	5PK906
				⊗	A/C(+)	MVB985R5	5PK985
				⊗	A/C(+), → Eng Nr 1723043	MVB970R5	5PK970
				⊗		TB307	173x22
				⊗		TBK065	
				⊗		SVB10725	10x725
2.0 16V Turbo Q4	AR 67203	140	01/92 → 12/97	⊗		SVB13850	13x850
				⊗	A/C(-)	MVB1035R5	5PK1035
				⊗	A/C(+)	MVB1050R5	5PK1050
				⊗		TB474	173x18
				⊗		TB579	97x15
				⊗	A/C(-)	SVB13875	13x875
				⊗	A/C(+)	SVB13750	13x750
2.0 16V Turbo Q4 (167.A2B, 167.A2C, 167.A2E)	AR 67203	137	01/92 → 12/97	⊗		SVB13850	13x850
				⊗	A/C(-)	MVB1035R5	5PK1035
				⊗	A/C(+)	MVB1050R5	5PK1050
				⊗		TB474	173x18
				⊗		TB579	97x15
				⊗	A/C(-)	SVB13875	13x875
				⊗	A/C(+)	SVB13750	13x750
2.0 T.S. (167.A2)	AR 67201	106	02/92 → 04/93	⊗	A/C(-)	MVB800R5	5PK800
				⊗	A/C(+)	MVB1285R5	5PK1285
				⊗		MVB960R4	4PK960
2.0 T.S. (167.A2A)	AR 67202	104	02/92 → 02/95	⊗	A/C(-)	MVB800R5	5PK800
				⊗	A/C(+)	MVB1285R5	5PK1285
				⊗		MVB960R4	4PK960
2.0 T.S. 16V (167.A2G)	AR 67204	110	03/95 → 12/97	⊗	A/C(-)	MVB1083R7	7PK1083
				⊗	A/C(+)	MVB1952R7	7PK1952
				⊗		TB468	168x24
				⊗		TBK356	
2.5 TD (167.A1A)	VM 07 B, VM 31 B	92	04/93 → 12/97	⊗		TB607	126x15
				⊗		MVB1715R7	7PK1715
2.5 V6 (167.A1)	AR 67301	121	02/92 → 09/96	⊗	→12/93	MVB975R6	6PK975
				⊗	→12/93	MVB1015R5	5PK1015
				⊗	→12/93	TB383	134x25.4
				⊗	A/C(+), →12/93	MVB648R4	4PK648
				⊗		MVB962R6	6PK962
2.5 V6 (167.A1C, 167.A1E)	AR 67302, AR 67303	120	10/92 → 12/97	⊗	→06/96	MVB975R6	6PK975
				⊗	06/96→	MVB1015R5	5PK1015
				⊗		TB383	134x25.4
				⊗		MVB885R4	4PK885
				⊗	A/C(-)	MVB648R4	4PK648
				⊗	A/C(+)		
				⊗			



kW



...ALFA ROMEO

156 (932)

1.6 16V T.SPARK (932A4)	AR 32102, AR 32103, AR 32104, AR 67601	88	09/97 → 09/05	⊗	A/C(-), → Eng Nr 2835764	MVB1045R6	6PK1045
				⊗	A/C(-), 05/00→,	MVB1025R6	6PK1025
					Eng Nr 2835765→		
				⊗	A/C(+), → Eng Nr 2835764	MVB1855R6	6PK1855
				⊗	A/C(+), 05/00→,	MVB1842R6	6PK1842
	Eng Nr 2835765→						
				⊗	→04/00	TB559	166x24
				⊗	05/00→	TB528	163x24
				⊗	→04/00	TBK345	
				⊗	05/00→	TBK207	
1.8 16V T.SPARK (932A3)	AR 32201	106	09/97 → 10/00	⊗	A/C(-)	MVB1045R6	6PK1045
				⊗	A/C(+)	MVB1855R6	6PK1855
						TB468	168x24
						TBK356	
1.8 16V T.SPARK (932A31__)	AR 32205	103	10/00 → 09/05	⊗	A/C(-), → Eng Nr 2835764	MVB1045R6	6PK1045
				⊗	A/C(-), Eng Nr 2835765→	MVB1025R6	6PK1025
				⊗	A/C(+), → Eng Nr 2835764	MVB1855R6	6PK1855
				⊗	A/C(+), Eng Nr 2835765→	MVB1842R6	6PK1842
						TB559	166x24
1.9 JTD (932A2B, 932A2C)	937 A2.000	85	05/01 → 09/05	⊗	A/C(-)	MVB1035R6	6PK1035
				⊗	A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
				⊗		TBK283	
1.9 JTD (932A2B__)	AR 37101	81	10/00 → 05/01	⊗	A/C(-)	MVB1035R6	6PK1035
				⊗	A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
				⊗		TBK283	
1.9 JTD (932B2)	AR 32302	77	09/97 → 10/00	⊗	A/C(-), →06/00	MVB1035R6	6PK1035
				⊗	A/C(+), 05/98→06/00	MVB1833R6	6PK1833
					→06/00	TB639	190x24
					→06/00	TBK283	
1.9 JTD 16V	192 A5.000	103	11/02 → 09/05	⊗	→11/04	MVB1833R6	6PK1833
					→11/04	TB725	198x24
					05/03→11/04, Eng Nr 3646772→	TBK350	
2.0 16V T.SPARK (932A2)	AR 32301	114	09/97 → 10/00	⊗	A/C(-), →04/00,	MVB1083R7	7PK1083
					→ Eng Nr 1385143		
				⊗	A/C(-), →04/00,	MVB1080R6	6PK1080
					Eng Nr 1385144→		
				⊗	A/C(+), →04/00,	MVB1969R7	7PK1969
					→ Eng Nr 1385143		
				⊗	A/C(+), →04/00,	MVB1980R6	6PK1980
					Eng Nr 1385144→		
				⊗	→04/00	TB468	168x24
				⊗	→04/00	TBK356	
2.0 16V T.SPARK (932A21__)	AR 32310	110	10/00 → 03/02	⊗	A/C(-), → Eng Nr 2835764	MVB1080R6	6PK1080
				⊗	A/C(-), Eng Nr 2835765→	MVB1065R6	6PK1065
				⊗	A/C(+), → Eng Nr 2835764	MVB1980R6	6PK1980
				⊗	A/C(+), Eng Nr 2835765→	MVB1960R6	6PK1960
						TB468	168x24
						TBK356	
				⊗		TB732	130x15
2.0 JTS (932AXA)	937 A1.000	122	03/02 → 09/05	⊗		MVB1960R6	6PK1960
						TB468	168x24
2.4 JTD	841 G.000	129	10/03 → 09/05	⊗		MVB1760R6	6PK1760
						TB725	198x24
2.4 JTD (932A1B__)	839 A6.000	103	10/00 → 09/05	⊗	A/C(-), →06/02	MVB1105R6	6PK1105
				⊗	A/C(+), →06/02,	MVB1760R6	6PK1760
					Eng Nr 1904013→		
				⊗	→06/02	TB639	190x24
				⊗	→06/02	TBK104	



kW



ALFA ROMEO

...ALFA ROMEO

...156 (932)

2.4 JTD (932AXC)	841 C000	110	03/02 → 09/05		→05/03	MVB1760R6	6PK1760
					→05/03	TB639	190x24
					→05/03	TBK104	
2.4 JTD (932B1)	AR 32501	100	09/97 → 10/00		A/C(-)	MVB1105R6	6PK1105
					A/C(+), →03/00, → Eng Nr 1904012	MVB1755R6	6PK1755
					A/C(+), 04/00→, Eng Nr 1904013→	MVB1760R6	6PK1760
						TB639	190x24
						TBK104	
2.5 V6 24V (932A1)	AR 32401	140	09/97 → 10/00			MVB1995R6	6PK1995
						TB532	185x28
2.5 V6 24V (932A11_)	AR 32405	141	10/00 → 09/05		→05/04	MVB1995R6	6PK1995
					→05/04	TB532	185x28
3.2 GTA (932AXB)	932 A.000	184	03/02 → 09/05			MVB1995R6	6PK1995
						TB532	185x28

156 Sportwagon (932)

1.6 16V T.SPARK. (932A4)	AR 32102, AR 32103, AR 32104, AR 67601	88	05/00 → 05/06		Eng. AR32104, A/C(-), → Eng Nr 2835764	MVB1045R6	6PK1045
					Eng. AR32104, A/C(-), Eng Nr 2835765→	MVB1025R6	6PK1025
					Eng. AR32104, A/C(+), → Eng Nr 2835764	MVB1855R6	6PK1855
					Eng. AR32104, A/C(+), Eng Nr 2835765→	MVB1842R6	6PK1842
						TB528	163x24
					Eng. AR32104	TBK207	
1.8 16V T.SPARK (932A3)	AR 32201	106	05/00 → 10/00		A/C(-)	MVB1045R6	6PK1045
					A/C(+)	MVB1855R6	6PK1855
						TB468	168x24
						TBK356	
1.8 16V T.SPARK (932B31_)	AR 32205	103	10/00 → 05/06		A/C(-), → Eng Nr 2835764	MVB1045R6	6PK1045
					A/C(-), Eng Nr 2835765→	MVB1025R6	6PK1025
					A/C(+), → Eng Nr 2835764	MVB1855R6	6PK1855
					A/C(+), Eng Nr 2835765→	MVB1842R6	6PK1842
						TB559	166x24
1.9 JTD (932B2)	AR 32302	77	05/00 → 10/00		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
						TBK283	
1.9 JTD (932B2B, 932B2C)	937 A2.000	85	05/01 → 05/06		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
						TBK283	
1.9 JTD (932B2B_)	AR 37101	81	10/00 → 05/01		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
						TBK283	
1.9 JTD 16V	192 A5.000	103	11/02 → 05/06		→11/04	MVB1833R6	6PK1833
					→11/04	TB725	198x24
					05/03→11/04, Eng Nr 3646772→	TBK350	
1.9 JTD 16V Q4	937 A5.000	110	07/04 → 05/06			MVB1833R6	6PK1833
					For OE 46791189	TB725	198x24
					For OE 55183528	TB790	199x24
						TBK306	
					→ Ch. 46791189	TBK350	
2.0 16V T.SPARK (932A2)	AR 32301	114	05/00 → 10/00		A/C(-), → Eng Nr 2835764	MVB1080R6	6PK1080
					A/C(-), Eng Nr 2835765→	MVB1065R6	6PK1065
					A/C(+), → Eng Nr 2835764	MVB1980R6	6PK1980
					A/C(+), Eng Nr 2835765→	MVB1960R6	6PK1960
						TB468	168x24
						TBK356	



kW



ALFA ROMEO

...ALFA ROMEO

...156 Sportwagon (932)

2.0 16V T.SPARK (932B21__)	AR 32310	110	10/00 → 03/02		A/C(-), → Eng Nr 2835764	MVB1080R6	6PK1080
					A/C(-), Eng Nr 2835765 →	MVB1065R6	6PK1065
					A/C(+), → Eng Nr 2835764	MVB1980R6	6PK1980
					A/C(+), Eng Nr 2835765 →	MVB1960R6	6PK1960
						TB468	168x24
						TBK356	
						TB732	130x15
2.0 JTS (932BXA)	937 A1.000	122	03/02 → 05/06			MVB1960R6	6PK1960
						TB468	168x24
2.4 JTD	841 G.000	129	10/03 → 05/06			MVB1760R6	6PK1760
						TB725	198x24
2.4 JTD (932B1)	AR 32501	100	05/00 → 10/00		A/C(-)	MVB1105R6	6PK1105
					A/C(+)	MVB1760R6	6PK1760
						TB639	190x24
						TBK104	
2.4 JTD (932B1B__)	839 A6.000	103	10/00 → 05/06		A/C(-)	MVB1105R6	6PK1105
					A/C(+)	MVB1760R6	6PK1760
						TB639	190x24
						TBK104	
2.4 JTD (932BXC)	841 C000	110	03/02 → 05/06		→05/03	MVB1760R6	6PK1760
					→05/03	TB639	190x24
					→05/03	TBK104	
2.5 V6 24V (932A1)	AR 32401	140	05/00 → 10/00			MVB1995R6	6PK1995
						TB532	185x28
2.5 V6 24V (932B11__)	AR 32405	141	10/00 → 05/06		→05/04	MVB1995R6	6PK1995
					→05/04	TB532	185x28
3.2 GTA (932BXB)	932 A.000	184	03/02 → 05/06			MVB1995R6	6PK1995
						TB532	185x28

159

1.8 MPI	939A4.000	103	03/07 →		→ Ch. 7067138	MVB1590R5	5PK1590
					Ch. 7067139 →	MVB1550R5	5PK1550
						TB741	146x24
1.9 JTDM 16V	939A2.000	110	09/05 →			MVB1740R6	6PK1740
						TB790	199x24
						TBK306	
	937 A8.000, 939A8.000	100	09/05 →			MVB1740R6	6PK1740
						TB790	199x24
						TBK306	
1.9 JTDM 8V	939A1.000	88	09/05 →			MVB1740R6	6PK1740
						TB639	190x24
	937A7.000, 939A7.000	85	09/05 →			MVB1740R6	6PK1740
						TB639	190x24
						TBK306	
1.9 JTS	939A6.000	118	09/05 →			MVB1073R5	5PK1073
2.2 JTS	939A5.000	136	09/05 →			MVB1073R5	5PK1073
2.4 JTDM	939A3.000	147	09/05 →			TB790	199x24
						MVB1580R6	6PK1580
	939 A.9000	154	05/07 →			TB790	199x24
						MVB1580R6	6PK1580
2.4 JTDM Q4	939 A.9000	154	05/07 →			TB790	199x24
						MVB1580R6	6PK1580
3.2 JTS Q4	939A.000	191	12/05 →			MVB2145R6	6PK2145

159 Sportwagon

1.8 MPI	939A4.000	103	03/07 →		→ Ch. 7067138	MVB1590R5	5PK1590
					Ch. 7067139 →	MVB1550R5	5PK1550
						TB741	146x24
1.9 JTDM 16V	939A2.000	110	03/06 →			MVB1740R6	6PK1740
						TB790	199x24
						TBK306	
	937 A8.000	100	03/06 →			MVB1740R6	6PK1740
						TB790	199x24
						TBK306	



kW



ALFA ROMEO

...ALFA ROMEO

...159 Sportwagon

1.9 JTDM 8V	939A1.000	88	03/06 →			MVB1740R6	6PK1740
						TB639	190x24
	937A7.000	85	03/06 →			MVB1740R6	6PK1740
						TB639	190x24
1.9 JTS	939A6.000	118	03/06 →			MVB1073R5	5PK1073
2.2 JTS	939A5.000	136	03/06 →			MVB1073R5	5PK1073
2.4 JTDM	939A3.000	147	03/06 →			TB790	199x24
						MVB1580R6	6PK1580
	939 A.9000	154	05/07 →			TB790	199x24
						MVB1580R6	6PK1580
2.4 JTDM Q4	939 A.9000	154	05/07 →			TB790	199x24
						MVB1580R6	6PK1580
3.2 JTS Q4	939A.000	191	03/06 →			MVB2145R6	6PK2145

164 (164)

2.0		102	06/87 → 09/98		A/C(-), →11/88	SVB13800	13x800
					A/C(-), 12/88→10/92	MVB825R5	5PK825
					A/C(+), →11/88	SVB13975	13x975
					A/C(+), 12/88→10/92	MVB985R5	5PK985
					→10/92	MVB1100R5	5PK1100
2.0 T.S. (164.A2C, 164.A2L)	AR 06416	105	06/87 → 09/92		A/C(-), →11/88	SVB13800	13x800
					A/C(-), 12/88→	MVB825R5	5PK825
					A/C(+), →11/88	SVB13975	13x975
					A/C(+), 12/88→	MVB985R5	5PK985
						MVB1100R5	5PK1100
2.0 T.S. (164.A2H)	AR 06420	109	06/87 → 12/90		A/C(-), →11/88	SVB13800	13x800
					A/C(-), 12/88→	MVB825R5	5PK825
					A/C(+), →11/88	SVB13975	13x975
					A/C(+), 12/88→	MVB985R5	5PK985
						MVB1100R5	5PK1100
2.0 T.S. (164.H3)	AR 64103	106	09/92 → 09/98		→10/97	MVB1285R5	5PK1285
					A/C(-), →10/97	MVB800R5	5PK800
					→10/97	MVB960R4	4PK960
2.0 Turbo	AR 06476	128	10/87 → 09/98		02/88→10/92,	SVB10840	10x840
					→ Eng Nr 1103901		
					02/88→10/92, Eng Nr 1103902→	SVB13875	13x875
					02/88→04/90,	SVB101090	10x1090
					→ Eng Nr 1103901		
					05/90→10/92, Eng Nr 1103902→	MVB1100R4	4PK1100
					02/88→10/92	TB303	142x18
					A/C(-), 02/88→02/90	SVB10913	10x913
					A/C(-), 02/88→10/92,	SVB13850	13x850
					Eng Nr 1103902→		
					A/C(-), 03/90→10/92,	SVB10825	10x825
					→ Eng Nr 1103901		
					A/C(+), 02/88→10/92,	SVB10775	10x775
					→ Eng Nr 1103901		
					A/C(+), 02/88→10/92,	SVB13750	13x750
					Eng Nr 1103902→		
2.0 V6 Turbo (164.A2G, 164.A2F)	AR 64101	150	03/91 → 09/92			SVB131050	13x1050
					A/C(-)	SVB13975	13x975
					A/C(+)	SVB10750	10x750
						TB134	134x25.4
					→ Eng Nr 81721	SVB10790	10x790
					Eng Nr 81722→	SVB10775	10x775
2.0 V6 Turbo (164.K3)	AR 64102	148	09/92 → 09/98		A/C(-), →10/97	MVB1180R7	7PK1180
					A/C(+), →10/97	MVB1240R7	7PK1240
					→10/97	TB383	134x25.4
					→10/97	MVB763R4	4PK763
2.5 TD (164.A1A)	VM 84 A	84	06/87 → 09/92		02/88→	SVB131025	13x1025
					02/88→, → Eng Nr 3061	MVB1100R5	5PK1100
					02/88→, Eng Nr 3062→	MVB1115R7	7PK1115
					02/88→	SVB10625	10x625



kW



...ALFA ROMEO

...164 (164)

2.5 TD (164.K2A, 164.K2B)	VM 08 B, VM 32 B	92	09/92 → 09/98		A/C(-), →10/97	MVB1715R7	7PK1715
					A/C(+), →10/97	MVB2050R7	7PK2050
3.0 24V (164.K1)	AR 66301, AR 66302	155	09/92 → 09/98		→10/95	SVB131050	13x1050
					→10/97	MVB1969R7	7PK1969
					Eng. AR64301, A/C(-), →10/95	SVB13975	13x975
					Eng. AR64301, A/C(+), →10/95	SVB10750	10x750
					→10/97	TB531	174x28
					Eng. AR64301, →10/95,	SVB10790	10x790
					→ Eng Nr 4444		
					Eng. AR64301, →10/95,	SVB10775	10x775
					Eng Nr 4445→		
3.0 24V Q4 (164.K1M, 164.K1C)	AR 64307, AR 64308	170	02/94 → 09/98		→10/97	MVB1969R7	7PK1969
					→10/97	TB531	174x28
3.0 24V QV (164.H1)	AR 64304	171	09/92 → 09/98		→10/97	MVB1969R7	7PK1969
					→10/97	TB531	174x28
3.0 i.e. QV (164.AG)	AR 06430, AR 64301	147	09/90 → 09/92			SVB131050	13x1050
					Eng. AR64301, A/C(-)	SVB13975	13x975
					Eng. AR64301, A/C(+)	SVB10750	10x750
						TB134	134x25.4
					Eng. AR64301, → Eng Nr 4444	SVB10790	10x790
					Eng. AR64301, Eng Nr 4445→	SVB10775	10x775
3.0 V6 (164.A)	AR 06410	141	06/87 → 09/92		LHD, 11/87→	SVB131050	13x1050
					A/C(-), 11/87→	SVB13975	13x975
					A/C(+), LHD, 11/87→	SVB10750	10x750
					11/87→	TB134	134x25.4
					11/87→, → Eng Nr 83011	SVB10790	10x790
					11/87→, Eng Nr 83012→	SVB10775	10x775
3.0 V6 (164.AD, 164.AH, 164.AB)	AR 06412	135	06/87 → 09/92		LHD, 11/87→	SVB131050	13x1050
					A/C(-), 11/87→	SVB13975	13x975
					A/C(+), LHD, 11/87→	SVB10750	10x750
					11/87→	TB134	134x25.4
					11/87→, → Eng Nr 83011	SVB10790	10x790
					11/87→, Eng Nr 83012→	SVB10775	10x775
3.0 V6 (164.H1A, 164.H1B, 164.K1P)	AR 64305, AR 66303	132	09/92 → 09/98		→10/97	MVB1240R7	7PK1240
					Eng. AR66303, →10/97	MVB1180R7	7PK1180
					→10/97	TB383	134x25.4
					Eng. AR66303, →10/97	MVB763R4	4PK763

166 (936)

2.0 T.Spark (936A3A__)	AR 34103	114	09/98 → 10/00		→06/00, → Eng Nr 1385143	MVB1969R7	7PK1969
					→06/00, Eng Nr 1385144→	MVB1980R6	6PK1980
					→06/00	TB468	168x24
					→06/00	TBK356	
2.0 T.Spark (936A3B__)	AR 36301	110	10/00 →		→09/07, → Eng Nr 2835764	MVB1980R6	6PK1980
					→09/07, Eng Nr 2835765→	MVB1960R6	6PK1960
					→09/07	TB468	168x24
					→09/07	TBK356	
2.0 V6 (936A3__)	AR 34102	151	09/98 →		→10/03	MVB1995R6	6PK1995
					→10/03	TB703	127x25.4
2.4 JTD	841 C000	110	04/02 →		→06/08	MVB1740R6	6PK1740
					→06/08	TB639	190x24
					→06/08	TBK104	
	841 G.000, 841 H.000	129	10/03 →		→06/08	MVB1740R6	6PK1740
					→06/08	TB725	198x24
	841 M.000	132	07/06 →		→06/08	MVB1740R6	6PK1740
					→06/08	TB725	198x24
	841 M.000, 936 B.000	136	07/05 →		→06/08	MVB1740R6	6PK1740
					→06/08	TB790	199x24
2.4 JTD (936A2A__)	AR 34202	100	09/98 → 10/00			MVB1740R6	6PK1740
						TB639	190x24
						TBK104	



kW



ALFA ROMEO

...ALFA ROMEO

...166 (936)

2.4 JTD (936A2B__)	839 A6.000	103	10/00 →		→06/03	MVB1740R6	6PK1740
					→06/03	TB639	190x24
					→06/03	TBK104	
2.5 V6 24V (936A2__)	AR 34201	140	09/98 → 10/00			MVB1995R6	6PK1995
						TB532	185x28
2.5 V6 24V (936A21__)	AR 36201	138	10/00 →		→09/07	MVB1995R6	6PK1995
					→09/07	TB532	185x28
3.0 V6 24V (936A1__)	AR 34301	166	09/98 → 10/00			MVB1995R6	6PK1995
						TB532	185x28
3.0 V6 24V (936A11__)	AR 36101	162	10/00 →		→09/07	MVB1995R6	6PK1995
					→09/07	TB532	185x28
3.2 V6 24V	936 A.000	176	10/03 →		→09/07	MVB1995R6	6PK1995
					→09/07	TB532	185x28

ALFASUD Coupe (902.A)

1.3 (902.A0)	AR 30184	55	09/76 → 12/81			SVB10888	10x888
					2 belts needed	SVB10875	10x875
						TB106	98x17
1.4	AR 30164	55	05/78 → 02/80			SVB10888	10x888
					2 belts needed	SVB10875	10x875
						TB106	98x17
	AR 30168	63	07/79 → 12/89		→02/87	SVB10888	10x888
					→02/87, 2 belts needed	SVB10875	10x875
					→02/87	TB106	98x17
1.5	AR 30146	77	01/83 → 12/87			SVB10850	10x850
						TB106	98x17
1.5 (902.A1)	AR 30124	61	05/78 → 12/81			SVB10850	10x850
						TB106	98x17
1.5 (902.A5)	AR 30128	70	07/79 → 01/87			SVB10850	10x850
						TB106	98x17
1.5 Veloce		75	01/83 → 12/87			SVB10850	10x850
						TB106	98x17
1.7	AR 30550	87	03/87 → 12/89			SVB13950	13x950
					→12/88	SVB10850	10x850
					01/89→	TB106	98x17
					01/89→	TB338	100x17
					01/89→	TBK287	
						SVB10825	10x825
1.7 i.e.	AR 30558	77	10/87 → 12/89			SVB13950	13x950
					→12/88	SVB10850	10x850
					01/89→	TB106	98x17
					01/89→	TB338	100x17
					01/89→	TBK287	
						SVB10825	10x825

BRERA

2.2 JTS	939A5.000	136	01/06 →			MVB1073R5	5PK1073
2.4 JTDM 20V	939A3.000	147	01/06 →		PS	MVB1580R6	6PK1580
						TB790	199x24
	939 A.9000	154	05/07 →		PS	MVB1580R6	6PK1580
						TB790	199x24
3.2 JTS		191	03/08 →			MVB2145R6	6PK2145
3.2 JTS Q4	939A.000	191	01/06 →			MVB2145R6	6PK2145

GIULIETTA (116)

1.3 (116.44A)	AR 01644	66	10/77 → 06/83			SVB131250	13x1250
						SVB10825	10x825
1.6 (116.50B)	AR 01600	79	10/77 → 04/85			SVB131250	13x1250
						SVB10825	10x825
1.8 (116.AA, 116.AB)	AR 01678	90	04/79 → 04/85			SVB131250	13x1250
						SVB10825	10x825
1.8 Turbo	AR 01354	110	01/84 → 12/85			SVB131250	13x1250
						SVB10825	10x825





kW



...ALFA ROMEO

...GIULIETTA (116)

2.0 (116.A1A)	AR 01655, AR 11671	96	06/80 → 04/85	☼ ⊗		SVB131250 SVB10825	13x1250 10x825
2.0 TD	VM 4 HT	61	01/83 → 12/85	⊗	→07/85	SVB101025	10x1025
2.0 Turbo	AR 01699	125	07/83 → 06/84	☼ ⊗		SVB131250 SVB10825	13x1250 10x825

GT

1.8 TS	AR 32205	103	11/03 →	⊗ ⊗ ⊗ ⊗ ⊗ ^{KIT}	A/C(-), 03/04 → 03/07 A/C(+), 03/04 → 03/07 03/04 → 03/07 03/04 → 03/07	MVB1025R6 MVB1842R6 TB559 TBK345	6PK1025 6PK1842 166x24
1.9 JTD	937 A5.000	110	11/03 →	⊗ ⊗ ⊗ ^{KIT}		MVB1833R6 TB725 TBK350	6PK1833 198x24
2.0 JTS	932 A2.000, 937 A1.000	121	11/03 →	⊗ ⊗ ⊗	Eng. 937A1000, A/C(-), →03/07 Eng. 937A1000, A/C(+), →03/07 →03/07	MVB1065R6 MVB1960R6 TB468	6PK1065 6PK1960 168x24
3.2 GTA	936 A.000	176	11/03 →	⊗ ⊗	→03/07 →03/07	MVB1995R6 TB532	6PK1995 185x28

GTV (116)

2.0	AR 01655, AR 06212	96	07/78 → 01/86	☼ ⊗		SVB131250 SVB10825	13x1250 10x825
2.0 (116.36 E)	AR 06212	94	01/85 → 12/85	☼ ⊗		SVB131250 SVB10825	13x1250 10x825
2.0 Turbodelta		111	01/78 → 12/80	☼ ⊗		SVB131250 SVB10825	13x1250 10x825
6 2.5 (116.CA)	AR 01646	116	11/80 → 02/87	⊗ ⊗	05/81 → 05/81 →	SVB10850 TB134	10x850 134x25.4

GTV (916C_)

1.8 16V (916C3)	AR 32201	106	05/98 →	⊗ ⊗ ⊗ ⊗ ^{KIT}	A/C(-), →03/03 A/C(+), →03/03 →03/03 →03/03	MVB1045R6 MVB1855R6 TB468 TBK356	6PK1045 6PK1855 168x24
2.0 JTS	937 A1.000	121	04/03 →	⊗ ⊗	→10/04 →10/04	MVB1960R6 TB468	6PK1960 168x24
2.0 T.SPARK 16V (916.C2_, 916C2C00)	AR 16201, AR 32310	110	06/95 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ^{KIT} ⊗ ^{KIT} ⊗ ^{KIT} ⊗ ^{KIT}	Eng. AR16201, A/C(-), →08/97 Eng. AR16201, A/C(+), →08/97 Eng. AR32310, A/C(-), 09/00 → 10/04, → Eng Nr 2835764 Eng. AR32310, A/C(-), 09/00 → 10/04, Eng Nr 2835765 → Eng. AR32310, A/C(+), 09/00 → 10/04, → Eng Nr 2835764 Eng. AR32310, A/C(+), 09/00 → 10/04, Eng Nr 2835765 → → 10/04 Eng. AR 32310 Eng. AR32310, →10/04 → Eng. No. 0134318	MVB1083R7 MVB1952R7 MVB1080R6 MVB1065R6 MVB1980R6 MVB1960R6 TB468 TB732 TBK356 TB607	7PK1083 7PK1952 6PK1080 6PK1065 6PK1980 6PK1960 168x24 130x15 126x15
2.0 T.SPARK 16V (916C2C)	AR 32301	114	05/98 → 08/00	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ^{KIT} ⊗ ^{KIT} ⊗ ^{KIT}	A/C(-), → Eng Nr 1385143 A/C(-), Eng Nr 1385144 → A/C(+), → Eng Nr 1385143 A/C(+), Eng Nr 1385144 → → Eng. No. 0134318	MVB1083R7 MVB1080R6 MVB1969R7 MVB1980R6 TB468 TBK356 TB607	7PK1083 6PK1080 7PK1969 6PK1980 168x24 126x15



kW



ALFA ROMEO

...ALFA ROMEO

...GTV (916C_)

2.0 V6 Turbo (916.C2A)	AR 16202	148	06/95 →	☼ ☼ ⊖ ☼ ☼	→08/02, → Eng Nr 0004304 →08/02, Eng Nr 0004305→ →08/02 →08/02 →08/02	MVB962R6 MVB975R6 MVB1000R5 TB383 MVB648R4	6PK962 6PK975 5PK1000 134x25.4 4PK648
3.0 V6 24V (916.C1)	AR 16102	162	10/96 → 10/00	⊖ ☼		MVB1995R6 TB532	6PK1995 185x28
3.0 V6 24V (916.C1B_)	AR 16105	160	10/00 →	⊖ ☼	→03/03 →03/03	MVB1995R6 TB532	6PK1995 185x28
3.2 V6 24V	936 A6.000	176	04/03 →	⊖ ☼	→10/04 →10/04	MVB1995R6 TB532	6PK1995 185x28

RZ

3.0 V6 Zagato	AR 61501	152	01/92 → 12/94	⊖ ☼ ☼		SVB10840 TB134 SVB10990	10x840 134x25.4 10x990
---------------	----------	-----	---------------	-------------	--	-------------------------------	------------------------------

SPIDER

2.2 JTS	939A5.000	136	09/06 →	⊖		MVB1073R5	5PK1073
2.4 JTDM		147	04/07 →	☼ ☼	→08/07 →08/07	TB790 MVB1580R6	199x24 6PK1580
3.2 JTS Q4	939A.000	191	09/06 →	⊖		MVB2145R6	6PK2145

SPIDER (115)

1600	AR 00526	76	03/76 → 12/90	⊖	→12/89	SVB10825	10x825
	AR 00536	80	03/71 → 12/79	⊖	01/74→	SVB10825	10x825
	AR 01563	79	01/90 → 12/93	⊖ ☼		SVB10825 MVB938R5	10x825 5PK938
2000	AR 01544	85	08/86 → 12/90	⊖ ☼		SVB10825 MVB938R5	10x825 5PK938
	AR 00515	92	08/86 → 12/90	⊖ ☼		SVB10825 MVB938R5	10x825 5PK938
	AR 01588	88	01/90 → 12/93	⊖ ☼		SVB10825 MVB938R5	10x825 5PK938
2000 Veloce	AR 00515, AR 01590	93	01/77 → 12/93	⊖ ☼		SVB10825 MVB938R5	10x825 5PK938

SPIDER (916S_)

1.8 16V (916S3)	AR 32201	106	05/98 → 04/05	⊖	A/C(-), →03/03	MVB1045R6	6PK1045
				⊖	A/C(+), →03/03	MVB1855R6	6PK1855
				☼ ☼ ☼KIT	→03/03 →03/03	TB468 TBK356	168x24
2.0 JTS	937 A1.000	121	04/03 → 04/05	⊖	→10/04	MVB1960R6	6PK1960
				☼	→10/04	TB468	168x24
2.0 T.SPARK 16V (916S2B)	AR 32301	114	05/98 → 08/00	⊖	A/C(-), → Eng Nr 1385143	MVB1083R7	7PK1083
				⊖	A/C(-), Eng Nr 1385144→	MVB1080R6	6PK1080
				⊖	A/C(+), → Eng Nr 1385143	MVB1969R7	7PK1969
				⊖	A/C(+), Eng Nr 1385144→	MVB1980R6	6PK1980
				☼ ☼KIT		TB468 TBK356	168x24



kW



...ALFA ROMEO

...SPIDER (916S_)

2.0 T.SPARK 16V (916S2C00)	AR 16201, AR 32310	110	06/95 → 04/05	⊗	A/C(-), → Eng Nr 1385143	MVB1083R7	7PK1083
				⊗	A/C(+), →08/97	MVB1952R7	7PK1952
				⊗	A/C(+), 09/00→,	MVB1969R7	7PK1969
					→ Eng Nr 1385143		
				⊗	Eng. AR32310, A/C(-), 09/00→,	MVB1080R6	6PK1080
					Eng Nr 1385144→2835764		
				⊗	Eng. AR32310, A/C(-), 09/00→,	MVB1065R6	6PK1065
					Eng Nr 2835765→		
				⊗	Eng. AR32310, A/C(+), 09/00→,	MVB1980R6	6PK1980
				⊗	Eng Nr 1385144→2835764		
				⊗	Eng. AR32310, A/C(+), 09/00→,	MVB1960R6	6PK1960
					Eng Nr 2835765→		
				⊗		TB468	168x24
				⊗	Eng. AR 32310	TB732	130x15
				⊗	Eng. AR32310	TBK356	
				⊗	→ Eng. No. 0134318	TB607	126x15
2.0 V6 Turbo (916S2A)	AR 16202	148	05/98 → 04/05	⊗	→10/01	MVB975R6	6PK975
				⊗	→10/01	MVB1000R5	5PK1000
				⊗	→10/01	TB383	134x25.4
				⊗	→10/01	MVB648R4	4PK648
3.0 V6 (916S1)	AR 16101	141	06/95 → 04/05	⊗	→06/96	MVB962R6	6PK962
				⊗	06/96→08/01	MVB975R6	6PK975
				⊗	→08/01	MVB1000R5	5PK1000
				⊗	→08/01	TB383	134x25.4
				⊗	A/C(-), →08/01	MVB875R5	5PK875
				⊗	A/C(+), →08/01	MVB648R4	4PK648
3.0 V6 (916S1B00)	AR 16105	160	10/00 → 04/05	⊗	→03/03	MVB1995R6	6PK1995
				⊗	→03/03	TB532	185x28
3.0 V6 24V	AR 16102	162	01/99 → 10/00	⊗	09/00→	MVB1995R6	6PK1995
				⊗	09/00→	TB532	185x28
3.2 V6 24V	936 A6.000	176	04/03 → 04/05	⊗		MVB1995R6	6PK1995
				⊗		TB532	185x28

SZ

3.0 V6 Zagato	AR 61501	152	09/88 → 08/94	⊗	09/89→02/92	SVB10840	10x840
				⊗	09/89→02/92	TB134	134x25.4
				⊗	09/89→02/92	SVB10990	10x990

ARO

10

1,3		40	06/80 → 11/86	⊗		SVB101225	10x1225
1,4	IAP 810-R-99	46	06/84 →	⊗	→07/93	SVB101225	10x1225
1.9 D		48	09/92 →	⊗	A/C(-), 08/93→	MVB1137R6	6PK1137
				⊗	A/C(+), 08/93→	MVB1642R6	6PK1642
				⊗	08/93→09/96	TB258	153x25.4
				⊗	09/96→	TB545	153x25.4
1.9 TD		69	06/97 →	⊗	A/C(-)	MVB1137R6	6PK1137
				⊗	A/C(+)	MVB1642R6	6PK1642
				⊗		TB545	153x25.4

240-244

2.5		59	04/78 →	⊗	→07/92	SVB131138	13x1138
				*	→07/92	SVB131150	13x1150
	Aro L25	60	01/80 →	⊗	→07/92	SVB131138	13x1138
				*	→07/92	SVB131150	13x1150
2.5 D	XD3P	52	01/83 →	⊗	→07/92	SVB13750	13x750
				*	→07/92	SVB131225	13x1225
				⊗	→07/92	SVB13850	13x850



kW



ARO

...ARO

...240-244

2.5 TD	XD3TP	70	01/92 →	⊗	→02/95	SVB13750	13x750
				*	→02/95	SVB131225	13x1225
				⊗	→02/95	SVB13850	13x850
	VM-425HLT	74	01/92 →	⊗	→02/95	SVB13750	13x750
				*	→02/95	SVB131225	13x1225
				⊗	→02/95	SVB13850	13x850
2.7 D	Aro L-27D	60	01/83 →	⊗	04/85 →08/88	SVB13750	13x750
				*	04/85 →08/88	SVB131225	13x1225
				⊗	04/85 →08/88	SVB13850	13x850
3.1 D	Aro D-127	47	01/80 → 12/83	⊗	→08/83	SVB101113	10x1113
				⊗	→08/83	SVB10635	10x635

SPARTANA

1.2	C3G 702	40	01/99 →	⊗		MVB900R5	5PK900
				⊗	A/C(-)	SVB101150	10x1150
				⊗	A/C(+)	MVB1165R4	4PK1165

AUDI

80 (81, 85, B2)

1.3	FY	40	09/78 → 07/81	⊗	→ Ch. 8192300000	SVB10700	10x700
				⊗	Ch. 8192300001→	SVB10690	10x690
				⊗		TB107	108x19
	EP	44	09/78 → 07/86	⊗	08/81→	SVB13825	13x825
				⊗	08/81→	SVB10940	10x940
				⊗	08/81→	TB108	121x18
				⊗	08/81→	TBK016	
				⊗	08/81→, → Ch. 81G160000	SVB10760	10x760
	FZ	44	09/78 → 07/81	⊗	08/81→, Ch. 81G160001→	SVB10850	10x850
				⊗	→ Ch. 8192300000	SVB10700	10x700
				⊗	Ch. 8192300001→	SVB10690	10x690
	1.6	SA	54	02/86 → 07/86	⊗		TB107
⊗						SVB13825	13x825
⊗						SVB10940	10x940
DT		55	08/78 → 07/86	⊗		TB108	121x18
				⊗		TBK016	
				⊗		SVB13825	13x825
YP		63	08/78 → 02/83	⊗		SVB10940	10x940
				⊗		TB108	121x18
				⊗		TBK016	
YT, YY		51	08/78 → 07/81	⊗		SVB13825	13x825
				⊗		SVB10950	10x950
				⊗		TB108	121x18
WV, YN	55	08/78 → 07/86	⊗		TBK016		
			⊗		SVB10760	10x760	
			⊗		SVB10850	10x850	
			⊗	→05/84	SVB13825	13x825	
			⊗	→05/84	SVB10950	10x950	
			⊗	→05/84	TB108	121x18	
				⊗	→05/84	TBK016	
				⊗	→05/84	SVB10760	10x760
				⊗	→05/84, → Ch. 81-G-160000	SVB10850	10x850
				⊗	→05/84, Ch. 81-G-160001→	SVB10760	10x760
				⊗	→05/84, Ch. 81-G-160001→	SVB10850	10x850



kW



...AUDI

...80 (81, 85, B2)

1.6 D	CR, JK	40	08/80 → 08/86	⊗		SVB13825	13x825
				⊗	01/84 → 05/84	SVB10760	10x760
				⊗	A/C(-)	SVB10735	10x735
				⊗		TB225	135x25.4
				⊗		TBK018	
				⊗		SVB10800	10x800
1.6 GLE	YZ	81	01/79 → 12/86	⊗	→ 05/84	SVB13825	13x825
				⊗	→ 05/84	SVB10950	10x950
				⊗	→ 05/84	TB108	121x18
				⊗	→ 05/84	TBK016	
				⊗	→ 05/84, → Ch. 81-G-160000	SVB10760	10x760
				⊗	→ 05/84, Ch. 81-G-160001 →	SVB10850	10x850
1.6 TD	CY	51	08/81 → 05/86	⊗		SVB13825	13x825
				⊗	01/84 → 05/84	SVB10600	10x600
				⊗	01/84 → 05/84	SVB10760	10x760
				⊗	A/C(+)	SVB10735	10x735
				⊗	A/C(+)	SVB10775	10x775
				⊗		TB225	135x25.4
1.8	SF	65	02/86 → 07/86	⊗		SVB13825	13x825
				⊗		SVB10940	10x940
				⊗		TB108	121x18
				⊗		TBK016	
				⊗	→ Ch. 81G160000	SVB10760	10x760
				⊗	Ch. 81G160001 →	SVB10850	10x850
	DS	66	01/83 → 08/86	⊗		SVB13825	13x825
				⊗		SVB10940	10x940
				⊗		TB108	121x18
				⊗		TBK016	
				⊗	→ Ch. 81G160000	SVB10760	10x760
				⊗	Ch. 81G160001 →	SVB10850	10x850
JN	68	08/83 → 08/86	⊗		SVB13825	13x825	
			⊗		SVB10940	10x940	
			⊗		TB108	121x18	
			⊗		TBK016		
			⊗	→ Ch. 81G160000	SVB10760	10x760	
			⊗	Ch. 81G160001 →	SVB10850	10x850	
1.8 CC quattro (85Q)	NE	66	08/84 → 08/86	⊗		SVB13825	13x825
				⊗		SVB10940	10x940
				⊗		TB108	121x18
				⊗		TBK016	
				⊗	→ Ch. 81G160000	SVB10760	10x760
				⊗	Ch. 81G160001 →	SVB10850	10x850
JN	68	08/85 → 08/86	⊗		SVB13825	13x825	
			⊗		SVB10940	10x940	
			⊗		TB108	121x18	
			⊗		TBK016		
			⊗	→ Ch. 81G160000	SVB10760	10x760	
			⊗	Ch. 81G160001 →	SVB10850	10x850	



kw



AUDI

...AUDI

...80 (81, 85, B2)

1.8 GTE	DZ	82	10/84 → 08/86	 	→ Ch. 81G160000 Ch. 81G160001→	SVB13825 SVB10940 TB108 TBK016 SVB10760 SVB10850	13x825 10x940 121x18 10x760 10x850
	PV	81	08/85 → 07/86	 	→ Ch. 81G160000 Ch. 81G160001→	SVB13825 SVB10940 TB108 TBK016 SVB10760 SVB10850	13x825 10x940 121x18 10x760 10x850
1.8 GTE quattro (85Q)	DZ	82	08/84 → 08/86	 	→ Ch. 81G160000 Ch. 81G160001→	SVB13825 SVB10940 TB108 TBK016 SVB10760 SVB10850	13x825 10x940 121x18 10x760 10x850
	PV	81	03/85 → 08/86	 	→ Ch. 81G160000 Ch. 81G160001→	SVB13825 SVB10940 TB108 TBK016 SVB10760 SVB10850	13x825 10x940 121x18 10x760 10x850
1.9 CD-5S	WN	85	09/81 → 07/83	 		SVB131000 SVB10800 TB602	13x1000 10x800 113x19
2.0	HP, JS	85	10/83 → 09/84	 	→05/84 →05/84 →05/84 →05/84	SVB131000 SVB10800 TB207 TBK048	13x1000 10x800 120x18 120x18
				 		SVB131000 SVB10800 TB207 TBK048	13x1000 10x800 120x18 120x18
2.0 quattro (85Q)	JS	85	10/83 → 09/84	 		SVB131000 SVB10800 TB207 TBK048	13x1000 10x800 120x18 120x18
2.2	WE	85	10/80 → 07/83	 	08/81→ 08/81→ 08/81→	SVB131000 SVB10800 TB602	13x1000 10x800 113x19
				 	→ Ch. 85-D-250000 Ch. 85-D-250001→ Ch. 85-D-250001→	SVB131000 SVB10800 TB602 TB207 TBK048	13x1000 10x800 113x19 120x18 120x18

80 (89, 89Q, 8A, B3)

1.6	RN	55	09/86 → 08/91	 		SVB13800 SVB10950 TB108 TBK016 SVB10850	13x800 10x950 121x18 10x850
	PP	51	08/87 → 09/91	 		SVB13800 SVB10950 TB108 TBK016 SVB10850	13x800 10x950 121x18 10x850
ABB		75	08/90 → 10/91	 		SVB13800 MVB855R4 TB108 TBK016 SVB10913	13x800 4PK855 121x18 10x913
				 		SVB13800 MVB855R4 TB108 TBK016 SVB10913	13x800 4PK855 121x18 10x913



kW



...AUDI

...80 (89, 89Q, 8A, B3)

1.6 D	JK	40	09/86 → 08/91	⊗		SVB13800	13x800
				⊗		SVB13875	13x875
				⊗	A/C(-)	SVB10740	10x740
				⊗	A/C(+)	SVB10710	10x710
						TB225	135x25.4
						TBK018	
				⊗		SVB10790	10x790
					→ Ch. 8A-M-040000	SVB10610	10x610
					Ch. 8A-M-040001→	SVB10635	10x635
				1.6 TD	RA, SB	59	09/86 → 08/91
⊗	Eng. SB	SVB13875	13x875				
⊗	A/C(-)	SVB10740	10x740				
⊗	A/C(+)	SVB10710	10x710				
		TB225	135x25.4				
		TBK018					
⊗		SVB10790	10x790				
	→ Ch. 8A-M-040000	SVB10610	10x610				
	Ch. 8A-M-040001→	SVB10635	10x635				
1.8	RU	55	10/86 → 01/90				
				⊗		SVB10950	10x950
						TB108	121x18
						TBK016	
				⊗		SVB10850	10x850
	SD	83	09/86 → 07/88	⊗		SVB13800	13x800
				⊗		SVB10950	10x950
						TB108	121x18
						TBK016	
				⊗		SVB10850	10x850
1.8 quattro	SD	83	09/86 → 08/90	⊗	→07/88	SVB13800	13x800
				⊗	→07/88	SVB10950	10x950
					→07/88	TB108	121x18
					→07/88	TBK016	
				⊗	→07/88	SVB10850	10x850
1.8 E	DZ	82	06/86 → 08/91	⊗		SVB13800	13x800
				⊗		SVB10950	10x950
						TB108	121x18
						TBK016	
				⊗		SVB10850	10x850
1.8 E quattro	DZ	82	09/86 → 08/91	⊗		SVB13800	13x800
				⊗		SVB10950	10x950
						TB108	121x18
						TBK016	
				⊗		SVB10850	10x850
1.8 S	SF	65	09/86 → 12/90	⊗		SVB13800	13x800
				⊗		SVB10950	10x950
						TB108	121x18
						TBK016	
				⊗		SVB10850	10x850
	JN, NE, PM	66	09/86 → 10/91	⊗		SVB13800	13x800
				⊗		SVB10950	10x950
						TB108	121x18
						TBK016	
				⊗		SVB10850	10x850



kW



AUDI

...AUDI

...80 (89, 89Q, 8A, B3)

1.8 S quattro	SF	65	09/86 → 07/90	 		SVB13800 13x800 SVB10950 10x950 TB108 121x18 TBK016 SVB10850 10x850
	JN, NE, PM	66	09/86 → 09/91	 		SVB13800 13x800 SVB10950 10x950 TB108 121x18 TBK016 SVB10850 10x850
1.9 D	1Y	50	08/89 → 08/91			SVB13875 13x875
					A/C(-)	SVB10740 10x740
					A/C(+)	SVB10710 10x710
						TB384 137x25.4
						TBK024
						SVB10775 10x775
2.0	AAD	82	10/90 → 08/91			SVB13800 13x800
						SVB10950 10x950
2.0 quattro	AAD	85	10/90 → 08/91			TB506 124x18
						TBK109
						SVB10850 10x850
						SVB13800 13x800
						SVB10950 10x950
						TB506 124x18
2.0 E	3A	83	08/88 → 10/90			TBK109
						SVB10850 10x850
						SVB13800 13x800
						SVB10950 10x950
						TB108 121x18
						TBK016
2.0 E 16V	6A	101	03/90 → 09/91			SVB10850 10x850
						SVB13800 13x800
						TB505 147x25.4
						TBK066
					MS	SVB10900 10x900
					PS	SVB10888 10x888
2.0 E 16V quattro	6A	101	03/90 → 08/91			SVB13800 13x800
						TB505 147x25.4
						TBK066
					MS	SVB10900 10x900
					PS	SVB10888 10x888
						SVB13800 13x800
2.0 E quattro	3A	83	08/88 → 09/90			TB505 147x25.4
						SVB10900 10x900
						SVB10888 10x888
						SVB13800 13x800
						SVB10950 10x950
						TB108 121x18
2.3 quattro		98	10/87 → 07/89			TBK016
						SVB10850 10x850
						SVB13800 13x800
						SVB10950 10x950
						TB108 121x18
						TBK016
80 (8C, B4)	1.6	ABM	09/91 → 12/94			SVB13925 13x925
						SVB12865 12x865
					→ Ch. 8BN015000	SVB10875 10x875
					Ch. 8BN015001→	TB504 147x19
						TBK285
						SVB131000 13x1000

80 (8C, B4)

1.6	ABM	52	09/91 → 12/94			SVB13800 13x800
						MVB855R4 4PK855
						TB108 121x18
						TBK016
						SVB10913 10x913



kW



...AUDI

...80 (8C, B4)

1.6 E	ADA	74	06/93 → 12/94	 		SVB13800 13x800 MVB855R4 4PK855 TB108 121x18 TBK016 SVB10913 10x913
1.9 TD	AAZ	55	09/91 → 12/94	 	A/C(-) A/C(+) →07/94, → Eng Nr 552765 07/94→, Eng Nr 552766→	MVB890R6 6PK890 MVB1180R6 6PK1180 TB384 137x25.4 TBK024 TBK025 SVB10900 10x900
1.9 TDI	1Z	66	09/91 → 12/94	 	A/C(-) A/C(+) →07/94, → Eng Nr 1Z289575 07/94→, Eng Nr 1Z289576→	MVB890R6 6PK890 MVB1180R6 6PK1180 TB384 137x25.4 TBK119 TBK026 SVB10900 10x900
2.0	ABT	66	09/91 → 12/94	 		SVB13800 13x800 MVB855R4 4PK855 TB506 124x18 TBK109 SVB10913 10x913
2.0 E	ABK	85	09/91 → 12/94	 		SVB13800 13x800 MVB855R4 4PK855 TB506 124x18 TBK109 SVB10913 10x913
2.0 E 16V	ACE	103	08/92 → 12/94	 		SVB13800 13x800 MVB887R4 4PK887 TB505 147x25.4 TBK066 SVB10888 10x888
2.0 E 16V quattro	ACE	103	04/92 → 12/94	 		SVB13800 13x800 MVB887R4 4PK887 TB505 147x25.4 TBK066 SVB10888 10x888 SVB10900 10x900
2.0 E quattro	ABK	85	09/91 → 12/94	 	MS, →07/92	SVB13800 13x800 MVB855R4 4PK855 TB506 124x18 TBK109 SVB10913 10x913
2.3 E	NG	98	09/91 → 12/94	 	→ Ch. 8BN015000 Ch. 8BN015001→	SVB13925 13x925 SVB12865 12x865 SVB10875 10x875 TB504 147x19 TBK285 SVB131000 13x1000
2.3 E quattro	NG	98	09/91 → 12/94	 	→07/94 →07/94, → Ch. 8BN015000 →07/94, Ch. 8BN015001→ →07/94 →07/94 →07/94	SVB13925 13x925 SVB12865 12x865 SVB10875 10x875 TB504 147x19 TBK285 SVB131000 13x1000
2.6	ABC	110	07/92 → 12/94	 	A/C(-) A/C(-), 10/94→ A/C(+), →10/93 A/C(+), 10/93→ A/C(+), 10/94→	MVB1675R6 6PK1675 MVB1635R6 6PK1635 MVB2265R6 6PK2265 MVB1904R6 6PK1904 MVB1865R6 6PK1865 TB373 239x25.4

AUDI



kw



...AUDI

...80 (8C, B4)

2.6 quattro	ABC	110	06/92 → 12/94	 	A/C(-) A/C(-), 10/94→ A/C(+), →10/93 A/C(+), 10/93→ A/C(+), 10/94→	MVB1675R6 MVB1635R6 MVB2265R6 MVB1904R6 MVB1865R6 TB373	6PK1675 6PK1635 6PK2265 6PK1904 6PK1865 239x25.4
2.8	AAH	128	09/91 → 12/94	 	A/C(-) A/C(-), 10/94→ A/C(+), →10/93 A/C(+), 10/93→ A/C(+), 10/94→	MVB1675R6 MVB1635R6 MVB2265R6 MVB1904R6 MVB1865R6 TB373	6PK1675 6PK1635 6PK2265 6PK1904 6PK1865 239x25.4
2.8 quattro	AAH	128	09/91 → 12/94	 	A/C(-) A/C(-), 10/94→ A/C(+), →10/93 A/C(+), 10/93→ A/C(+), 10/94→	MVB1675R6 MVB1635R6 MVB2265R6 MVB1904R6 MVB1865R6 TB373	6PK1675 6PK1635 6PK2265 6PK1904 6PK1865 239x25.4
S2 quattro	ABY	169	02/93 → 12/94	 	08/93→ 08/93→ 08/93→ 08/93→	SVB13925 MVB887R4 TB333 SVB131025	13x925 4PK887 151x19 13x1025

80 Avant (8C, B4)

1.6 E	ADA	74	06/93 → 01/96	 		SVB13800 MVB855R4 TB108 TBK016 SVB10913	13x800 4PK855 121x18 10x913
1.9 TD	AAZ	55	09/91 → 12/94	 	A/C(-) A/C(+) →07/94, → Eng Nr 552765 07/94→, Eng Nr 552766→	MVB890R6 MVB1180R6 TB384 TBK024 TBK025 SVB10900	6PK890 6PK1180 137x25.4 10x900
1.9 TDI	1Z	66	07/92 → 01/96	 	A/C(-) A/C(+) →07/94, → Eng Nr 1Z289575 07/94→, Eng Nr 1Z289576→	MVB890R6 MVB1180R6 TB384 TBK119 TBK026 SVB10900	6PK890 6PK1180 137x25.4 10x900
2.0	ABT	66	07/92 → 01/96	 	→12/94	SVB13800 MVB855R4 TB506 TBK109 SVB10913	13x800 4PK855 124x18 10x913
2.0 E	ABK	85	07/92 → 01/96	 	→12/94	SVB13800 MVB855R4 TB506 TBK109 SVB10913	13x800 4PK855 124x18 10x913
2.0 E 16V	ACE	103	02/93 → 01/96	 	→12/94	SVB13800 MVB887R4 TB505 TBK066 SVB10888	13x800 4PK887 147x25.4 10x888
2.0 E 16V quattro	ACE	103	12/92 → 07/95	 	→12/94	SVB13800 MVB887R4 TB505 TBK066 SVB10888	13x800 4PK887 147x25.4 10x888



kW



AUDI

...AUDI

...80 Avant (8C, B4)

2.3 E	NG	98	07/92 → 01/96	 	→12/94 →12/94, → Ch. 8BN015000 →12/94, Ch. 8BN015001→ →12/94 →12/94 →12/94	SVB13925 SVB12865 SVB10875 TB504 TBK285 SVB131000	13x925 12x865 10x875 147x19 13x1000
2.3 E quattro	NG	98	09/91 → 11/94	 	→07/94 →07/94, → Ch. 8BN015000 →07/94, Ch. 8BN015001→ →07/94 →07/94 →07/94	SVB13925 SVB12865 SVB10875 TB504 TBK285 SVB131000	13x925 12x865 10x875 147x19 13x1000
2.6	ABC	110	07/92 → 01/96	 	A/C(-), →10/94 A/C(-), 10/94→ A/C(+), →10/93 A/C(+), 10/93→10/94 A/C(+), 10/94→	MVB1675R6 MVB1635R6 MVB2265R6 MVB1904R6 MVB1865R6 TB373	6PK1675 6PK1635 6PK2265 6PK1904 6PK1865 239x25.4
2.6 quattro	ABC	110	07/92 → 07/95	 	A/C(-), →10/94 A/C(-), 10/94→ A/C(+), →10/93 A/C(+), 10/93→10/94 A/C(+), 10/94→	MVB1675R6 MVB1635R6 MVB2265R6 MVB1904R6 MVB1865R6 TB373	6PK1675 6PK1635 6PK2265 6PK1904 6PK1865 239x25.4
2.8	AAH	128	09/91 → 01/96	 	A/C(-), →10/94 A/C(-), 10/94→ A/C(+), →10/93 A/C(+), 10/93→10/94 A/C(+), 10/94→	MVB1675R6 MVB1635R6 MVB2265R6 MVB1904R6 MVB1865R6 TB373	6PK1675 6PK1635 6PK2265 6PK1904 6PK1865 239x25.4
2.8 quattro	AAH	128	08/92 → 07/95	 	A/C(-), →10/94 A/C(-), 10/94→ A/C(+), →10/93 A/C(+), 10/93→10/94 A/C(+), 10/94→	MVB1675R6 MVB1635R6 MVB2265R6 MVB1904R6 MVB1865R6 TB373	6PK1675 6PK1635 6PK2265 6PK1904 6PK1865 239x25.4
RS2 quattro (P1)	ADU	232	03/94 → 05/95	 		SVB13925 MVB887R4 SVB131025	13x925 4PK887 13x1025
S2 quattro	ABY	169	02/93 → 07/95	 		SVB13925 MVB887R4 TB333 SVB131025	13x925 4PK887 151x19 13x1025

90 (81, 85, B2)

1.6 TD	CY	51	10/85 → 01/87	 	A/C(-) A/C(+) → Ch. 8A-M-040000 Ch. 8A-M-040001→	SVB13800 SVB13875 SVB10740 SVB10710 TB225 TBK018 SVB10790 SVB10610 SVB10635	13x800 13x875 10x740 10x710 135x25.4 10x790 10x610 10x635
--------	----	----	---------------	--------------------------	---	--	--



kw



AUDI

...AUDI

...90 (81, 85, B2)

2.0	HP, JS	85	10/84 → 03/87	⊗		SVB131000	13x1000
				→ Ch. 81F090000	SVB10800	10x800	
				⊗	Ch. 81F090001 →	SVB10825	10x825
						TB207	120x18
						TBK048	
	SK	83	03/86 → 03/87	⊗		SVB131000	13x1000
				→ Ch. 81F090000	SVB10800	10x800	
				⊗	Ch. 81F090001 →	SVB10825	10x825
						TB207	120x18
						TBK048	
2.0 quattro		85	08/84 → 08/86	⊗		SVB131000	13x1000
				⊗	→ Ch. 81F090000	SVB10800	10x800
				⊗	Ch. 81F090001 →	SVB10825	10x825
						TB207	120x18
						TBK048	
2.2	KX	85	01/85 → 03/87	⊗		SVB131000	13x1000
				⊗	A/C(-), → Ch. 85F090000	SVB10800	10x800
				⊗	A/C(-), Ch. 85F090001 →	SVB10825	10x825
				⊗	A/C(+)	SVB10850	10x850
					→ Ch. 85D250000	TB602	113x19
					Ch. 85E000001 →	TB207	120x18
					Ch. 85E000001 →	TBK048	
	HY, KV	100	10/84 → 03/87	⊗		SVB131000	13x1000
				→ Ch. 81F090000	SVB10800	10x800	
				⊗	Ch. 81F090000 →	SVB10825	10x825
						TB207	120x18
						TBK048	
2.2 E quattro	KV	100	11/84 → 03/87	⊗		SVB13925	13x925
				⊗		SVB12865	12x865
				⊗	→ Ch. 81F090000	SVB10800	10x800
				⊗	Ch. 81F090000 →	SVB10825	10x825
						TB207	120x18
						TB318	142x19
						TBK048	
				⊗		SVB131000	13x1000
	JT	88	08/85 → 03/87	⊗		SVB131000	13x1000
				→ Ch. 81F090000	SVB10800	10x800	
				⊗	Ch. 81F090000 →	SVB10825	10x825
						TB207	120x18
						TBK048	

90 (89, 89Q, 8A, B3)

1.6 TD	RA, SB	59	04/87 → 09/91	⊗		SVB13800	13x800
				⊗	Eng. SB	SVB13875	13x875
				⊗	A/C(-)	SVB10740	10x740
				⊗	A/C(+)	SVB10710	10x710
						TB225	135x25.4
						TBK018	
				⊗		SVB10790	10x790
				⊗	→ Ch. 8A-M-040000	SVB10610	10x610
				⊗	Ch. 8A-M-040001 →	SVB10635	10x635
2.0	PS	85	07/88 → 09/91	⊗		SVB13925	13x925
				⊗		SVB12865	12x865
						TB318	142x19
				⊗		SVB131000	13x1000
2.0 20 V	NM	118	08/89 → 07/91	⊗		SVB13925	13x925
				⊗		SVB12865	12x865
						TB504	147x19
				⊗		SVB131000	13x1000
2.0 20 V quattro	NM	118	08/88 → 09/91	⊗		SVB13925	13x925
				⊗		SVB12865	12x865
						TB504	147x19
				⊗		SVB131000	13x1000



kW



...AUDI

...90 (89, 89Q, 8A, B3)

Model	Engine	kW	Year Range	Accessories	Part Numbers	Dimensions	
2.2 E	KV	100	04/87 → 07/91	⊗	SVB13925	13x925	
				⊗	SVB12865	12x865	
				⊗	TB207	120x18	
				⊗	TB318	142x19	
				⊗	TBK048		
2.2 E quattro	KV	100	04/87 → 09/91	⊗	SVB131000	13x1000	
				⊗	SVB13925	13x925	
				⊗	SVB12865	12x865	
				⊗	SVB10800	10x800	
				⊗	SVB10825	10x825	
2.3 E	NG	100	04/87 → 07/91	⊗	SVB13925	13x925	
				⊗	SVB12865	12x865	
				⊗	TB207	120x18	
				⊗	TB318	142x19	
				⊗	TBK048		
	98	04/87 → 09/91	98	04/87 → 09/91	⊗	SVB131000	13x1000
					⊗	SVB13925	13x925
					⊗	SVB12865	12x865
					⊗	TB207	120x18
					⊗	TB318	142x19
2.3 E 20V	7A	123	04/90 → 07/91	⊗	SVB13925	13x925	
				⊗	SVB12865	12x865	
		125	08/88 → 07/91	⊗	TB504	147x19	
				⊗	SVB131000	13x1000	
				⊗	SVB13925	13x925	
2.3 E 20V quattro	7A	125	06/88 → 09/91	⊗	SVB12865	12x865	
				⊗	TB504	147x19	
		123	04/90 → 09/91	⊗	SVB131000	13x1000	
				⊗	SVB13925	13x925	
				⊗	SVB12865	12x865	
2.3 E quattro	NG	100	04/87 → 07/91	⊗	SVB13925	13x925	
				⊗	SVB12865	12x865	
				⊗	TB207	120x18	
				⊗	TB318	142x19	
				⊗	TBK048		
	98	04/87 → 09/91	98	04/87 → 09/91	⊗	SVB131000	13x1000
					⊗	SVB13925	13x925
					⊗	SVB12865	12x865
					⊗	TB207	120x18
					⊗	TB318	142x19

AUDI



kw



...AUDI

100 (43, C2)

1.6	YV	63	08/76 → 07/82	⊗	→ Eng Nr 000500	SVB10950	10x950
				⊗		TB108	121x18
1.9	WH	74	08/80 → 07/82	⊗	Eng Nr 000501 → 001589	SVB10800	10x800
				⊗		TB602	113x19
				⊗		SVB10975	10x975
				⊗		SVB10960	10x960
				⊗		SVB131000	13x1000
2.0	WA	85	06/76 → 08/78	⊗	A/C(-)	TB108	121x18
				⊗		TBK016	
				⊗		SVB10800	10x800
				⊗		SVB10900	10x900
				⊗			
2.0 D	CN	51	08/78 → 07/82	⊗	→ Ch. 43B025665	SVB13900	13x900
				⊗		SVB10813	10x813
				⊗		TB131	119x25.4
				⊗		TBK044	
				⊗		TB136	75x20
				⊗		SVB131050	13x1050
				⊗		SVB101025	10x1025
				⊗		SVB131025	13x1025
				⊗		SVB10600	10x600
				⊗			
2.1	WB, WE	85	10/77 → 07/82	⊗	→ 12/79	SVB13900	13x900
				⊗		SVB10800	10x800
				⊗		TB602	113x19
				⊗		SVB131025	13x1025
				⊗		SVB10960	10x960
				⊗		SVB131000	13x1000
				⊗		SVB10975	10x975
				⊗			
				⊗			
				⊗			
WC, WG		100	03/77 → 07/82	⊗	Eng. WG	SVB13900	13x900
				⊗		SVB10800	10x800
				⊗		TB602	113x19
				⊗		SVB131025	13x1025
				⊗		SVB10960	10x960
				⊗		SVB131000	13x1000
				⊗		SVB10975	10x975
				⊗			
				⊗			
				⊗			

100 (44, 44Q, C3)

1.8	SH	65	02/86 → 07/88	⊗		SVB13800	13x800
				⊗		SVB10950	10x950
				⊗		TB108	121x18
				⊗		TBK016	
				⊗		SVB10735	10x735
DR, RS		55	08/82 → 12/87	⊗	Eng. RS	SVB13800	13x800
				⊗		SVB10950	10x950
				⊗		TB108	121x18
				⊗		TBK016	
				⊗		SVB10735	10x735
DS, JW, NP		66	08/83 → 07/89	⊗	Eng. RS	SVB13800	13x800
				⊗		SVB10950	10x950
				⊗		TB108	121x18
				⊗		TBK016	
				⊗		SVB10735	10x735
1.8 CAT	4B, PH	66	03/85 → 11/90	⊗		SVB13800	13x800
				⊗		SVB10950	10x950
				⊗		TB108	121x18
				⊗		TBK016	
				⊗		SVB10735	10x735



kW



AUDI

...AUDI

...100 (44, 44Q, C3)

1.8 quattro	SH	65	08/86 → 07/90	⊗		SVB13800	13x800
				⊗		SVB10950	10x950
				⊗		TB108	121x18
				⊗		TBK016	
				⊗		SVB10735	10x735
	JW, NP	66	10/84 → 07/88	⊗		SVB13800	13x800
				⊗	SVB10950	10x950	
				⊗		TB108	121x18
				⊗		TBK016	
				⊗		SVB10735	10x735
1.8 quattro CAT	4B, PH	66	08/85 → 11/90	⊗		SVB13800	13x800
				⊗	SVB10950	10x950	
				⊗		TB108	121x18
				⊗		TBK016	
				⊗		SVB10735	10x735
1.9	WH	74	08/82 → 07/84	⊗		SVB13925	13x925
				⊗	Cat(-)	SVB10800	10x800
				⊗	Cat(+)	SVB12825	12x825
				⊗	→07/83	TB602	113x19
				⊗	08/83→	TB207	120x18
				⊗	08/83→	TBK048	
				⊗	A/C(-)	SVB13950	13x950
				⊗	A/C(+)	SVB131000	13x1000
2.0	SL	83	08/86 → 11/87	⊗		SVB13925	13x925
				⊗	Cat(+)	SVB12825	12x825
				⊗		TB207	120x18
				⊗		TBK048	
				⊗	A/C(-)	SVB13950	13x950
				⊗	A/C(+)	SVB131000	13x1000
	KP	85	08/84 → 12/87	⊗		SVB13925	13x925
	⊗			Cat(-)	SVB12825	12x825	
	⊗			Cat(-), →12/85	SVB10800	10x800	
	⊗				TB207	120x18	
	⊗				TBK048		
	⊗			A/C(-)	SVB13950	13x950	
				⊗	A/C(+)	SVB131000	13x1000
2.0 CAT	RT	85	01/88 → 11/90	⊗		SVB13925	13x925
				⊗	Cat(+)	SVB12825	12x825
				⊗	→05/88	TB207	120x18
				⊗	05/88→	TB318	142x19
				⊗	→05/88	TBK048	
				⊗	A/C(-)	SVB13950	13x950
				⊗	A/C(+)	SVB131000	13x1000
2.0 D	CN	51	08/82 → 07/88	⊗		SVB13925	13x925
				⊗		SVB10813	10x813
				⊗		TB131	119x25.4
				⊗		TBK044	
				⊗		TB136	75x20
				⊗		SVB131000	13x1000
2.0 D Turbo	DE	64	08/82 → 02/88	⊗		SVB13925	13x925
				⊗		SVB10800	10x800
				⊗		TB131	119x25.4
				⊗		TBK044	
				⊗		TB136	75x20
				⊗		SVB131000	13x1000
	NC	74	03/88 → 11/90	⊗	→07/89	SVB13925	13x925
	⊗			08/89→	SVB13950	13x950	
	⊗				SVB10800	10x800	
	⊗				TB131	119x25.4	
	⊗				TBK044		
	⊗				TB136	75x20	
				⊗		SVB131000	13x1000



kw



AUDI

...AUDI

...100 (44, 44Q, C3)

2.1	WC	100	08/82 → 07/84	⊗		SVB13900	13x900	
				⊖		SVB10800	10x800	
				⊗		TB602	113x19	
				⊗	→ Eng Nr 110584	SVB131000	13x1000	
				⊗	Eng Nr 111502 → 113650	SVB10960	10x960	
				⊗	Eng Nr 136269 → 138200	SVB10975	10x975	
2.2	KZ	85	10/84 → 09/86	⊗		SVB13925	13x925	
				⊖	Cat(-)	SVB12825	12x825	
				⊖	Cat(-), →12/85	SVB10800	10x800	
				⊗		TB207	120x18	
				⊗		TBK048		
				⊗	A/C(-)	SVB13950	13x950	
				⊗	A/C(+)	SVB131000	13x1000	
		KU	101	08/84 → 12/88	⊗		SVB13925	13x925
					⊖	Cat(-)	SVB12825	12x825
					⊖	Cat(-), →12/85	SVB10800	10x800
				⊗	→05/88	TB207	120x18	
				⊗	05/88 →	TB318	142x19	
				⊗	→05/88	TBK048		
				⊗	A/C(-)	SVB13950	13x950	
				⊗	A/C(+)	SVB131000	13x1000	
	WU	79	08/82 → 07/84	⊖		SVB10800	10x800	
				⊗	→ Ch. 44-D-200000	TB602	113x19	
				⊗	Ch. 44-E-000001 →	TB207	120x18	
	KF	96	08/82 → 07/84	⊖		SVB10800	10x800	
				⊗	→ Ch. 44-D-200000	TB602	113x19	
				⊗	Ch. 44-E-000001 →	TB207	120x18	
2.2 CAT	KU	101	06/89 → 11/90	⊗		SVB13925	13x925	
				⊖	Cat(+)	SVB12825	12x825	
				⊗		TB318	142x19	
				⊗	A/C(-)	SVB13950	13x950	
				⊗	A/C(+)	SVB131000	13x1000	
2.2 quattro	KU	101	08/84 → 12/88	⊗		SVB13925	13x925	
				⊖	Cat(-)	SVB12825	12x825	
				⊖	Cat(-), →12/85	SVB10800	10x800	
				⊗	→05/88	TB207	120x18	
				⊗	05/88 →	TB318	142x19	
				⊗	→05/88	TBK048		
				⊗	A/C(-)	SVB13950	13x950	
			⊗	A/C(+)	SVB131000	13x1000		
2.2 quattro CAT	KU	101	06/89 → 11/90	⊗		SVB13925	13x925	
				⊖	Cat(+)	SVB12825	12x825	
				⊗		TB318	142x19	
				⊗	A/C(-)	SVB13950	13x950	
				⊗	A/C(+)	SVB131000	13x1000	
2.2 E quattro	PX	88	08/85 → 07/86	⊗		SVB13925	13x925	
				⊖	Cat(-)	SVB12825	12x825	
				⊖	Cat(-), →12/85	SVB10800	10x800	
				⊗		TB207	120x18	
				⊗		TBK048		
				⊗	A/C(-)	SVB13950	13x950	
							⊗	A/C(+)
2.2 E Turbo quattro	MC	121	08/86 → 11/90	⊗		SVB13925	13x925	
				⊖	Cat(+)	SVB12825	12x825	
				⊗	→05/88	TB207	120x18	
				⊗	05/88 →	TB318	142x19	
				⊗	→05/88	TBK048		
				⊗	A/C(-)	SVB13950	13x950	
							⊗	A/C(+)



kW



...AUDI

...100 (44, 44Q, C3)

2.2 Turbo	MC	121	08/86 → 11/90	⚙️		SVB13925	13x925				
				⚙️	Cat(+)	SVB12825	12x825				
				⚙️	→05/88	TB207	120x18				
				⚙️	05/88→	TB318	142x19				
				⚙️	→05/88	TBK048					
				⚙️	A/C(-)	SVB13950	13x950				
2.3 quattro	AAR	98	01/90 → 11/90	⚙️		SVB13925	13x925				
				⚙️	Cat(+)	SVB12825	12x825				
				⚙️	A/C(-)	SVB13950	13x950				
				⚙️	A/C(+)	SVB131000	13x1000				
				2.3 E	NF	100	10/86 → 11/90	⚙️		SVB13925	13x925
								⚙️	Cat(+)	SVB12825	12x825
⚙️	→05/88	TB207	120x18								
⚙️	05/88→	TB318	142x19								
⚙️	→05/88	TBK048									
⚙️	A/C(-)	SVB13950	13x950								
		98	01/90 → 11/90	⚙️		SVB13925	13x925				
				⚙️	Cat(+)	SVB12825	12x825				
				⚙️	A/C(-)	SVB13950	13x950				
				⚙️	A/C(+)	SVB131000	13x1000				
				2.3 E quattro	NF	100	08/86 → 11/90	⚙️		SVB13925	13x925
								⚙️	Cat(+)	SVB12825	12x825
⚙️	→05/88	TB207	120x18								
⚙️	05/88→	TB318	142x19								
⚙️	→05/88	TBK048									
⚙️	A/C(-)	SVB13950	13x950								
2.4 D	3D	60	08/89 → 07/91	⚙️		SVB13950	13x950				
				⚙️		SVB10840	10x840				
				⚙️		TB785	122x26.5				
				⚙️		TB293	77x21				
				⚙️		SVB131025	13x1025				
				2.5 TDI	1T	88	01/90 → 11/90	⚙️		SVB13950	13x950
⚙️		SVB10840	10x840								
⚙️		TB785	122x26.5								
⚙️		TB374	80x21								
⚙️		SVB131025	13x1025								

100 (4A, C4)

2.0	AAE	74	12/90 → 06/94	⚙️	08/91 →	SVB13800	13x800				
				⚙️	08/91 →, → Ch. 4AM100000	SVB10950	10x950				
				⚙️	08/91 →, Ch. 4AN000001 →	MVB855R4	4PK855				
				⚙️	08/91 →	TB506	124x18				
				⚙️	08/91 →	TBK109					
				⚙️	08/91 →, → Ch. 4AM100000	SVB10850	10x850				
				⚙️	08/91 →, → Ch. 4AM100000	SVB12825	12x825				
				⚙️	08/91 →, Ch. 4AN000001 →	SVB10913	10x913				
				2.0 E	AAD, ABK	85	12/90 → 06/94	⚙️	08/91 →	SVB13800	13x800
								⚙️	08/91 →, → Ch. 4AM100000	SVB10950	10x950
⚙️	08/91 →, Ch. 4AN000001 →	MVB855R4	4PK855								
⚙️	08/91 →	TB506	124x18								
⚙️	08/91 →	TBK109									
⚙️	08/91 →, → Ch. 4AM100000	SVB10850	10x850								
⚙️	08/91 →, → Ch. 4AM100000	SVB12825	12x825								
⚙️	08/91 →, Ch. 4AN000001 →	SVB10913	10x913								



kw



AUDI

...AUDI

...100 (4A, C4)

2.0 E 16V	ACE	103	01/92 → 06/94	☼	08/92 →	SVB13800	13x800
				⊗	08/92 →	MVB887R4	4PK887
				⌘	08/92 →	TB505	147x25.4
				⌘KTT	08/92 →	TBK066	
				⊗	08/92 →	SVB10913	10x913
2.0 E 16V quattro	ACE	103	07/92 → 06/94	☼		SVB13800	13x800
				⊗		MVB887R4	4PK887
				⌘		TB505	147x25.4
				⌘KTT		TBK066	
				⊗		SVB10913	10x913
2.0 E quattro	AAD	85	12/90 → 07/92	☼	08/91 →	SVB13800	13x800
				⊗	08/91 →, → Ch. 4AM100000	SVB10950	10x950
				⊗	08/91 →, Ch. 4AN000001 →	MVB855R4	4PK855
				⌘	08/91 →	TB506	124x18
				⌘KTT	08/91 →	TBK109	
				⊗	08/91 →, → Ch. 4AM100000	SVB10850	10x850
				⊗	08/91 →, → Ch. 4AM100000	SVB12825	12x825
				⊗	08/91 →, Ch. 4AN000001 →	SVB10913	10x913
2.3 E	AAR	98	12/90 → 06/94	⊗	A/C(-), 08/91 → 07/93	MVB1290R6	6PK1290
				⊗	A/C(+), 08/91 → 07/93	MVB1690R6	6PK1690
				⌘	08/91 → 07/93	TB504	147x19
				⌘KTT	08/91 → 07/93	TBK285	
2.3 E quattro	AAR	98	12/90 → 06/94	⊗	A/C(-), 08/91 →	MVB1290R6	6PK1290
				⊗	A/C(+), 08/91 →	MVB1690R6	6PK1690
				⌘	08/91 →	TB504	147x19
				⌘KTT	08/91 →	TBK285	
2.4 D	AAS	60	12/90 → 06/94	⊗	A/C(-), 08/91 →	MVB1325R6	6PK1325
				⊗	A/C(+), 08/91 →	MVB1708R6	6PK1708
				⌘	08/91 →	TB375	124x26.5
				⌘	08/91 →	TB293	77x21
2.5 TDI	AAT, ABP	85	12/90 → 06/94	⊗	A/C(-), 08/91 →	MVB1325R6	6PK1325
				⊗	A/C(+), 08/91 →	MVB1708R6	6PK1708
				⌘	08/91 →	TB375	124x26.5
				⌘	08/91 →	TB374	80x21
2.6	ABC	110	03/92 → 06/94	⊗	A/C(-), 08/92 →	MVB1675R6	6PK1675
				⊗	A/C(+), 08/92 →, → Ch. 4A-R-029517	MVB2265R6	6PK2265
				⊗	A/C(+), 08/92 →, Ch. 4A-R-029518 →	MVB1904R6	6PK1904
				⌘	08/92 →	TB373	239x25.4
				⊗	08/92 →	MVB1675R6	6PK1675
2.6 quattro	ABC	110	04/92 → 06/94	⊗	A/C(-), 11/93 →	MVB2265R6	6PK2265
				⊗	A/C(+), 11/93 →	MVB2265R6	6PK2265
				⌘	11/93 →	TB373	239x25.4
2.6 quattro	ABC	110	04/92 → 06/94	⊗	A/C(-), 08/92 →	MVB1675R6	6PK1675
				⊗	A/C(+), 08/92 →, → Ch. 4A-R-040000	MVB2265R6	6PK2265
				⊗	A/C(+), 08/92 →, Ch. 4A-R-040001 →	MVB1904R6	6PK1904
				⌘	08/92 →	TB373	239x25.4
				⊗	08/92 →	MVB1685R6	6PK1685
2.8 E	AAH	128	12/90 → 06/94	⊗	A/C(-), 08/91 → 07/93, → Ch. 4A-M-100000	MVB1675R6	6PK1675
				⊗	A/C(-), 08/91 → 07/93, Ch. 4A-N-000001 →	MVB2280R6	6PK2280
				⊗	A/C(+), 08/91 → 07/93, → Ch. 4A-M-100000	MVB2265R6	6PK2265
				⊗	A/C(+), 08/91 → 07/93, Ch. 4A-N-000001 → 4A-R-040000	MVB2265R6	6PK2265
				⊗	A/C(+), 08/91 → 07/93, Ch. 4A-R-040001 →	MVB1904R6	6PK1904
				⌘	08/91 → 07/93	TB373	239x25.4
				⌘	08/91 → 07/93	TB373	239x25.4



kW



...AUDI

...100 (4A, C4)

2.8 E quattro	AAH	128	12/90 → 06/94		A/C(-), 08/91 →, → Ch. 4A-M-100000	MVB1685R6	6PK1685
					A/C(-), 08/91 →, Ch. 4A-N-000001 →	MVB1675R6	6PK1675
					A/C(+), 08/91 →, → Ch. 4A-M-100000	MVB2280R6	6PK2280
					A/C(+), 08/91 →, Ch. 4A-N-000001 → 4A-R-040000	MVB2265R6	6PK2265
					A/C(+), 08/91 →, Ch. 4A-R-040001 →	MVB1904R6	6PK1904
					08/91 →	TB373	239x25.4
S4 Turbo quattro	AAN	169	08/91 → 06/94		A/C(-)	MVB1290R6	6PK1290
					A/C(+)	MVB1690R6	6PK1690
						TB333	151x19
S4 V8 quattro	AEC	213	03/94 → 06/94			MVB2613R6	6PK2613
						TB604	299x30
	ABH	206	10/92 → 06/94			MVB2613R6	6PK2613
						TB604	299x30

100 Avant (43, C2)

1.6	YV	63	07/77 → 02/83		→07/82	SVB10950	10x950
					→07/82	TB108	121x18
					→07/82	TBK016	
1.9	WH	74	08/80 → 07/82			SVB10800	10x800
						TB602	113x19
					→ Eng Nr 000500	SVB10975	10x975
					Eng Nr 000501 → 001589	SVB10960	10x960
					Eng Nr 001590 →	SVB131000	13x1000
2.0	WA	85	08/77 → 07/80		→07/79	TB108	121x18
					→07/79	TBK016	
					A/C(-), →07/79	SVB10800	10x800
					A/C(+), →07/79	SVB10900	10x900
2.0 D	CN	51	08/78 → 02/83		→07/82	SVB13900	13x900
					→07/82	SVB10813	10x813
					→07/82	TB131	119x25.4
					→07/82	TBK044	
					→07/82	TB136	75x20
					→07/82, → Ch. 43B025665	SVB131050	13x1050
					→12/81, Ch. 43B025666 →	SVB101025	10x1025
					01/82 → 07/82	SVB131025	13x1025
					→07/82	SVB10600	10x600
2.1	WB, WE	85	07/77 → 02/83			SVB13900	13x900
						SVB10800	10x800
						TB602	113x19
					→12/79	SVB131025	13x1025
					01/80 →, → Eng Nr 110584	SVB131000	13x1000
					01/80 →, Eng Nr 111502 → 113650	SVB10960	10x960
					Inj, 01/80 →, Eng Nr 136269 → 138200	SVB10975	10x975
	WC, WG	100	07/77 → 02/83			SVB13900	13x900
					Eng. WG	SVB10800	10x800
						TB602	113x19
					→12/79	SVB131025	13x1025
					01/80 →, → Eng Nr 110584	SVB131000	13x1000
					01/80 →, Eng Nr 111502 → 113650	SVB10960	10x960
					01/80 →, Eng Nr 136269 → 138200	SVB10975	10x975



kW



...AUDI

100 Avant (44, 44Q, C3)

1.8	DR, RS	55	08/82 → 12/87	⊗	Eng. RS	SVB13800	13x800
				⊖		SVB10950	10x950
				⊕		TB108	121x18
				⊖	Eng. RS	TBK016	
				⊕		SVB10735	10x735
	SH	65	02/86 → 07/90	⊗		SVB13800	13x800
				⊖		SVB10950	10x950
				⊕		TB108	121x18
				⊖		TBK016	
				⊕		SVB10735	10x735
	JW, NP	66	08/83 → 07/89	⊗		SVB13800	13x800
				⊖		SVB10950	10x950
				⊕		TB108	121x18
				⊖		TBK016	
				⊕		SVB10735	10x735
1.8 CAT	4B, PH	66	03/85 → 11/90	⊗		SVB13800	13x800
				⊖		SVB10950	10x950
				⊕		TB108	121x18
				⊖		TBK016	
				⊕		SVB10735	10x735
1.8 quattro	SH	65	08/86 → 07/90	⊗		SVB13800	13x800
				⊖		SVB10950	10x950
				⊕		TB108	121x18
				⊖		TBK016	
				⊕		SVB10735	10x735
	JW, NP	66	10/84 → 07/88	⊗		SVB13800	13x800
				⊖		SVB10950	10x950
				⊕		TB108	121x18
				⊖		TBK016	
				⊕		SVB10735	10x735
1.8 quattro CAT	4B, PH	66	08/85 → 10/90	⊗		SVB13800	13x800
				⊖		SVB10950	10x950
				⊕		TB108	121x18
				⊖		TBK016	
				⊕		SVB10735	10x735
1.9	WH	74	02/83 → 07/84	⊗		SVB13925	13x925
				⊖	Cat(-)	SVB10800	10x800
				⊕	Cat(+)	SVB12825	12x825
				⊖	→07/83	TB602	113x19
				⊕	08/83→	TB207	120x18
				⊖	08/83→	TBK048	
				⊕	A/C(-)	SVB13950	13x950
				⊖	A/C(+)	SVB131000	13x1000
2.0	SL	83	09/86 → 11/87	⊗		SVB13925	13x925
				⊖	Cat(+)	SVB12825	12x825
				⊕		TB207	120x18
				⊖		TBK048	
				⊕	A/C(-)	SVB13950	13x950
				⊖	A/C(+)	SVB131000	13x1000
2.0 D	CN	51	03/83 → 11/90	⊗	→07/89	SVB13925	13x925
				⊖	→07/89	SVB10813	10x813
				⊕	→07/89	TB131	119x25.4
				⊖	→07/89	TBK044	
				⊕	→07/89	TB136	75x20
				⊖	→07/89	SVB131000	13x1000



kW



...AUDI

...100 Avant (44, 44Q, C3)

2.0 E	KP	85	01/85 → 12/87	⊗		SVB13925	13x925
				⊗	Cat(-)	SVB12825	12x825
				⊗	Cat(-), →12/85	SVB10800	10x800
				⊗		TB207	120x18
				⊗		TBK048	
2.0 E CAT	RT	85	01/88 → 11/90	⊗		SVB13925	13x925
				⊗	Cat(+)	SVB12825	12x825
				⊗	→05/88	TB207	120x18
				⊗	05/88 →	TB318	142x19
				⊗	→05/88	TBK048	
2.0 TD	DE	64	03/83 → 10/87	⊗		SVB13925	13x925
				⊗		SVB10800	10x800
				⊗		TB131	119x25.4
				⊗		TBK044	
				⊗		TB136	75x20
	NC	74	03/88 → 11/90	⊗		SVB13925	13x925
				⊗	→07/89	SVB13950	13x950
				⊗	08/89 →	SVB10800	10x800
				⊗		TB131	119x25.4
				⊗		TBK044	
2.1	WC	100	08/82 → 07/84	⊗		SVB13900	13x900
				⊗		SVB10800	10x800
				⊗		TB602	113x19
				⊗	→ Eng Nr 110584	SVB131000	13x1000
				⊗	Eng Nr 111502 → 113650	SVB10960	10x960
	KF	96	08/82 → 07/84	⊗		SVB10975	10x975
				⊗		SVB10800	10x800
				⊗	→ Ch. 44-D-200000	TB602	113x19
				⊗	Ch. 44-E-000001 →	TB207	120x18
				⊗		SVB13925	13x925
2.2	KZ	85	10/84 → 09/86	⊗		SVB12825	12x825
				⊗	Cat(-)	SVB10800	10x800
				⊗	Cat(-), →12/85	TB207	120x18
				⊗		TBK048	
				⊗		SVB13950	13x950
	KU	101	08/84 → 12/88	⊗		SVB131000	13x1000
				⊗		SVB13925	13x925
				⊗	Cat(-)	SVB12825	12x825
				⊗	Cat(-), →12/85	SVB10800	10x800
				⊗	→05/88	TB207	120x18
2.2 CAT	KU	101	06/89 → 11/90	⊗		TB318	142x19
				⊗		SVB13950	13x950
				⊗		SVB131000	13x1000
				⊗	A/C(-)	SVB13925	13x925
				⊗	A/C(+)	SVB13950	13x950



kW



AUDI

...AUDI

...100 Avant (44, 44Q, C3)

2.2 quattro	KU	101	08/84 → 12/88	 	Cat(-) Cat(-), →12/85 →05/88 05/88→ →05/88 A/C(-) A/C(+)	SVB13925 SVB12825 SVB10800 TB207 TB318 TBK048 SVB13950 SVB131000	13x925 12x825 10x800 120x18 142x19 13x950 13x1000
2.2 quattro CAT	KU	101	06/89 → 11/90	 	A/C(-) A/C(+)	SVB13925 TB318 SVB13950 SVB131000	13x925 142x19 13x950 13x1000
2.2 E quattro	PX	88	08/85 → 07/86	 	Cat(-) Cat(-), →12/85 A/C(-) A/C(+)	SVB13925 SVB12825 SVB10800 TB207 TBK048 SVB13950 SVB131000	13x925 12x825 10x800 120x18 13x950 13x1000
2.2 Turbo	MC	121	08/86 → 11/90	 	Cat(+) →05/88 05/88→ →05/88 A/C(-) A/C(+)	SVB13925 SVB12825 TB207 TB318 TBK048 SVB13950 SVB131000	13x925 12x825 120x18 142x19 13x950 13x1000
2.2 Turbo quattro	MC	121	08/86 → 11/90	 	Cat(+) →05/88 05/88→ →05/88 A/C(-) A/C(+)	SVB13925 SVB12825 TB207 TB318 TBK048 SVB13950 SVB131000	13x925 12x825 120x18 142x19 13x950 13x1000
2.3	NF	100	08/86 → 11/90	 	Cat(+) →05/88 05/88→ →05/88 A/C(-) A/C(+)	SVB13925 SVB12825 TB207 TB318 TBK048 SVB13950 SVB131000	13x925 12x825 120x18 142x19 13x950 13x1000
	AAR	98	03/90 → 11/90	 	Cat(+) A/C(-) A/C(+)	SVB13925 SVB12825 TB318 SVB13950 SVB131000	13x925 12x825 142x19 13x950 13x1000
2.3 quattro	AAR	98	01/90 → 11/90	 	Cat(+) A/C(-) A/C(+)	SVB13925 SVB12825 TB318 SVB13950 SVB131000	13x925 12x825 142x19 13x950 13x1000
2.3 E quattro	NF	100	08/86 → 11/90	 	Cat(+) →05/88 05/88→ →05/88 A/C(-) A/C(+)	SVB13925 SVB12825 TB207 TB318 TBK048 SVB13950 SVB131000	13x925 12x825 120x18 142x19 13x950 13x1000
2.4 D	3D	60	08/89 → 11/90	 	A/C(-) A/C(+)	SVB13950 SVB10840 TB785 TB293 SVB131025	13x950 10x840 122x26.5 77x21 13x1025



kW



...AUDI

...100 Avant (44, 44Q, C3)

2.5 TDI	1T	88	01/90 → 11/90	 	SVB13950 13x950 SVB10840 10x840 TB785 122x26.5 TB374 80x21 SVB131025 13x1025
---------	----	----	---------------	------------------	---

100 Avant (4A, C4)

2.0 E	AAE	74	09/91 → 06/94	 → Ch. 4AM100000 Ch. 4AN000001→ KIT	SVB13800 13x800 SVB10950 10x950 MVB855R4 4PK855 TB506 124x18 TBK109
	AAD, ABK	85	09/91 → 06/94	 → Ch. 4AM100000 Ch. 4AN000001→ KIT	SVB10850 10x850 SVB12825 12x825 SVB10913 10x913
2.0 E 16V	ACE	103	07/92 → 06/94	 → Ch. 4AM100000 Ch. 4AN000001→ KIT	SVB13800 13x800 SVB10950 10x950 MVB855R4 4PK855 TB506 124x18 TBK109
2.0 E 16V	ACE	103	07/92 → 06/94	 → Ch. 4AM100000 Ch. 4AN000001→ KIT	SVB10850 10x850 SVB12825 12x825 SVB10913 10x913
2.0 E 16V quattro	ACE	103	07/92 → 06/94	 → Ch. 4AM100000 Ch. 4AN000001→ KIT	SVB13800 13x800 MVB887R4 4PK887 TB505 147x25.4 TBK066
2.0 E quattro	AAD	85	12/90 → 07/92	 08/91→ 08/91→, → Ch. 4AM100000 08/91→, Ch. 4AN000001→ 08/91→ 08/91→ 08/91→, → Ch. 4AM100000 08/91→, → Ch. 4AM100000 08/91→, Ch. 4AN000001→	SVB13800 13x800 SVB10950 10x950 MVB855R4 4PK855 TB506 124x18 TBK109
2.3 E	AAR	98	09/91 → 06/94	 A/C(-), →07/93 A/C(+), →07/93 →07/93 →07/93	SVB10850 10x850 SVB12825 12x825 SVB10913 10x913
2.3 E quattro	AAR	98	09/91 → 06/94	 A/C(-) A/C(+) KIT	MVB1290R6 6PK1290 MVB1690R6 6PK1690 TB504 147x19 TBK285
2.4 D	AAS	60	12/90 → 06/94	 A/C(-), 08/91→ A/C(+), 08/91→ 08/91→ 08/91→	SVB10850 10x850 SVB12825 12x825 SVB10913 10x913
2.5 TDI	AAT, ABP	85	12/90 → 06/94	 A/C(-), 08/91→ A/C(+), 08/91→ 08/91→ 08/91→	MVB1290R6 6PK1290 MVB1690R6 6PK1690 TB504 147x19 TBK285
				08/91→ 08/91→	MVB1325R6 6PK1325 MVB1708R6 6PK1708 TB375 124x26.5 TB293 77x21
				A/C(-), 08/91→ A/C(+), 08/91→ 08/91→ 08/91→	MVB1325R6 6PK1325 MVB1708R6 6PK1708 TB375 124x26.5 TB374 80x21



kw



AUDI

...AUDI

...100 Avant (4A, C4)

2.6	ABC	110	03/92 → 06/94	⊗	A/C(-), 08/92→	MVB1675R6	6PK1675
				⊗	A/C(+), 08/92→, → Ch. 4A-R-029517	MVB2265R6	6PK2265
	ACZ	102	07/93 → 06/94	⊗	A/C(+), 08/92→, Ch. 4A-R-029518→	MVB1904R6	6PK1904
				⊗	08/92→	TB373	239x25.4
				⊗	A/C(-), 11/93→	MVB1675R6	6PK1675
2.6 quattro	ABC	110	07/92 → 06/94	⊗	A/C(+), 11/93→	MVB2265R6	6PK2265
				⊗	11/93→	TB373	239x25.4
				⊗	A/C(-)	MVB1675R6	6PK1675
2.8 E	AAH	128	09/91 → 06/94	⊗	A/C(+), → Ch. 4A-R-040000	MVB2265R6	6PK2265
				⊗	A/C(+), Ch. 4A-R-040001→	MVB1904R6	6PK1904
				⊗	A/C(+), Ch. 4A-R-040001→	TB373	239x25.4
2.8 E quattro	AAH	128	09/91 → 06/94	⊗	A/C(-), →07/93, → Ch. 4A-M-100000	MVB1685R6	6PK1685
				⊗	A/C(-), →07/93, Ch. 4A-N-000001→	MVB1675R6	6PK1675
				⊗	A/C(+), →07/93, → Ch. 4A-M-100000	MVB2280R6	6PK2280
				⊗	A/C(+), →07/93, Ch. 4A-N-000001→4A-R-040000	MVB2265R6	6PK2265
				⊗	A/C(+), →07/93, Ch. 4A-R-040001→	MVB1904R6	6PK1904
				⊗	→07/93	TB373	239x25.4
S4 Turbo quattro	AAN	169	09/91 → 06/94	⊗	A/C(-), → Ch. 4A-M-100000	MVB1685R6	6PK1685
				⊗	A/C(-), Ch. 4A-N-000001→	MVB1675R6	6PK1675
				⊗	A/C(+), → Ch. 4A-M-100000	MVB2280R6	6PK2280
				⊗	A/C(+), Ch. 4A-N-000001→4A-R-040000	MVB2265R6	6PK2265
S4 V8 quattro	AEC	213	03/94 → 06/94	⊗	A/C(+), Ch. 4A-R-040001→	MVB1904R6	6PK1904
				⊗		TB373	239x25.4
S4 V8 quattro	ABH	206	10/92 → 06/94	⊗	A/C(-)	MVB1290R6	6PK1290
				⊗	A/C(+)	MVB1690R6	6PK1690
				⊗		TB333	151x19
				⊗		MVB2613R6	6PK2613
				⊗		TB604	299x30
				⊗		MVB2613R6	6PK2613
				⊗		TB604	299x30

200 (43)

2.1 5 E	WC	100	10/79 → 09/82	⊗		SVB13900	13x900
				⊗		SVB10800	10x800
				⊗		TB602	113x19
				⊗	Ch. 44E012001→	TB207	120x18
				⊗	Ch. 44E012001→	TBK048	
				⊗	→ Ch. 43B025665	SVB131000	13x1000
2.1 5 T	WJ	125	10/79 → 08/82	⊗		SVB131025	13x1025
				⊗		SVB13900	13x900
				⊗		SVB10800	10x800
				⊗	Ch. 44E012001→	TB602	113x19
				⊗	Ch. 44E012001→	TB207	120x18
				⊗	→ Ch. 43B025665	TBK048	
				⊗		SVB131000	13x1000
				⊗		SVB131025	13x1025

200 (44, 44Q)

2.1 5 E	WC	100	08/83 → 07/84	⊗		SVB13900	13x900
				⊗		SVB10800	10x800
				⊗		TB602	113x19
				⊗	Ch. 44E012001→	TB207	120x18
				⊗	Ch. 44E012001→	TBK048	
				⊗	→ Ch. 43B025665	SVB131000	13x1000
				⊗		SVB131025	13x1025



kW



...AUDI

...200 (44, 44Q)

2.1 Turbo	KG	134	08/83 → 01/88	⚙️		SVB13925	13x925
				⚙️	→12/84	SVB10790	10x790
				⚙️	01/85→	SVB12825	12x825
				⚙️	→07/87	TB602	113x19
				⚙️	07/87→	TB207	120x18
				⚙️KIT	07/87→	TBK048	
2.1 Turbo quattro	KG	134	08/83 → 09/86	⚙️	10/84→	SVB13925	13x925
				⚙️	01/85→	SVB12825	12x825
				⚙️	10/84→12/84	SVB10790	10x790
				⚙️	10/84→	TB207	120x18
				⚙️KIT	10/84→	TBK048	
				⚙️	A/C(-), 10/84→	SVB13950	13x950
2.2	KU	101	08/84 → 07/85	⚙️		SVB13925	13x925
				⚙️		SVB10800	10x800
				⚙️	→ Ch. 44E012000	TB602	113x19
				⚙️	Ch. 44E012001→	TB207	120x18
				⚙️KIT	Ch. 44E012001→	TBK048	
				⚙️	A/C(-)	SVB13950	13x950
2.2 20V Turbo quattro	3B	162	03/89 → 12/90	⚙️		SVB13925	13x925
				⚙️		SVB12825	12x825
				⚙️		TB504	147x19
				⚙️	A/C(-)	SVB13950	13x950
				⚙️	A/C(+)	SVB131000	13x1000
				⚙️			
2.2 Turbo	MC	121	08/85 → 09/91	⚙️	→12/90	SVB13925	13x925
				⚙️	→12/90	SVB12825	12x825
				⚙️	→07/87	TB602	113x19
				⚙️	05/88→12/90	TB318	142x19
				⚙️	07/87→05/88	TB207	120x18
				⚙️KIT	07/87→05/88	TBK048	
	2B	140	02/88 → 12/90	⚙️		SVB13925	13x925
				⚙️		SVB12825	12x825
				⚙️		TB504	147x19
				⚙️	A/C(-)	SVB13950	13x950
				⚙️	A/C(+)	SVB131000	13x1000
				⚙️			
1B	147	02/88 → 12/90	⚙️		SVB13925	13x925	
			⚙️		SVB12825	12x825	
			⚙️		TB504	147x19	
			⚙️	A/C(-)	SVB13950	13x950	
			⚙️	A/C(+)	SVB131000	13x1000	
			⚙️				
2.2 Turbo quattro	MC	121	01/85 → 12/91	⚙️	→11/90	SVB13925	13x925
				⚙️	→11/90	SVB12825	12x825
				⚙️	→05/88	TB207	120x18
				⚙️	05/88→11/90	TB318	142x19
				⚙️KIT	→05/88	TBK048	
				⚙️	A/C(-), →11/90	SVB13950	13x950
1B	147	02/88 → 11/90	⚙️	A/C(+), →11/90	SVB131000	13x1000	
			⚙️		SVB13925	13x925	
			⚙️		SVB12825	12x825	
			⚙️		TB504	147x19	
			⚙️	A/C(-)	SVB13950	13x950	
			⚙️	A/C(+)	SVB131000	13x1000	

AUDI



kW



AUDI

...AUDI

200 Avant (44, 44Q)

2.1 Turbo quattro	KG	134	09/83 → 01/88	☼	10/84 → 09/87	SVB13925	13x925				
				⊖	01/85 → 09/87	SVB12825	12x825				
				⊖	10/84 → 12/84	SVB10790	10x790				
				☼	10/84 → 09/87	TB207	120x18				
				☼KIT	10/84 → 09/87	TBK048					
				⊕	A/C(-), 10/84 → 09/87	SVB13950	13x950				
				⊕	A/C(+), 10/84 → 09/87	SVB131000	13x1000				
				<hr/>							
				2.2 20V Turbo quattro	3B	162	07/89 → 12/90	☼		SVB13925	13x925
								⊖		SVB12825	12x825
☼		TB504	147x19								
⊕	A/C(-)	SVB13950	13x950								
⊕	A/C(+)	SVB131000	13x1000								
<hr/>											
2.2 Turbo	MC	121	08/85 → 09/91	☼	→ 12/90	SVB13925	13x925				
				⊖	→ 12/90	SVB12825	12x825				
				☼	→ 07/87	TB602	113x19				
				☼	05/88 → 12/90	TB318	142x19				
				☼	07/87 → 05/88	TB207	120x18				
				☼KIT	07/87 → 05/88	TBK048					
				⊕	A/C(-), → 12/90	SVB13950	13x950				
				⊕	A/C(+), → 12/90	SVB131000	13x1000				
<hr/>											
2.2 Turbo quattro	MC	121	09/83 → 12/90	☼	11/84 →	SVB13925	13x925				
				⊖	01/85 →	SVB12825	12x825				
				⊖	11/84 → 12/84	SVB10790	10x790				
				☼	05/88 →	TB318	142x19				
				☼	11/84 → 05/88	TB207	120x18				
				☼KIT	11/84 → 05/88	TBK048					
				⊕	A/C(-), 11/84 →	SVB13950	13x950				
				⊕	A/C(+), 11/84 →	SVB131000	13x1000				
				<hr/>							
				1B		147	02/88 → 12/91	☼	→ 11/90	SVB13925	13x925
⊖	→ 11/90	SVB12825	12x825								
☼	→ 11/90	TB504	147x19								
⊕	A/C(-), → 11/90	SVB13950	13x950								
⊕	A/C(+), → 11/90	SVB131000	13x1000								

A2 (8Z0)

1.2 TDI	ANY	45	03/01 → 08/05	⊖	A/C(-)	MVB860R6	6PK860
				⊖	A/C(+)	MVB1000R6	6PK1000
				☼		TB726	117x30
<hr/>							
1.4	AUA, BBY	55	02/00 → 08/05	⊖	Eng. BBY, A/C(-)	MVB750R6	6PK750
				⊖	Eng. BBY, A/C(+)	MVB1088R6	6PK1088
				☼	Eng. AUA, → 04/02 + Eng. BBY, 05/02 →	TB634	58x17
				☼	Eng. AUA, → 04/02 + Eng. BBY, 05/02 →, Front	TB658	130x20
				☼KIT		TBK246	



kW



...AUDI

...A2 (8Z0)

1.4 TDI	AMF, BHC	55	02/00 → 08/05	 	A/C(-) A/C(+)	MVB860R6 MVB1000R6 TB680 TBK225	6PK860 6PK1000 120x30
				Eng. AMF, →08/03, → Ch. 8Z-2-017000 Eng. AMF, →08/03, → Ch. 8Z-2-017000, VD(+) Eng. AMF, →08/03, Ch. 8Z-2-017001→ / Eng. BHC, 08/03→	TBK269 TBK270		
	ATL	66	11/03 → 08/05	 	A/C(-) A/C(+)	MVB860R6 MVB1000R6 TB680 TBK270	6PK860 6PK1000 120x30
1.6 FSI	BAD	81	05/02 → 08/05	 	A/C(-) A/C(+)	MVB736R6 MVB1080R6 TB634 TB658 TBK246	6PK736 6PK1080 58x17 130x20

A3 (8L1)

1.6	AEH, AKL, APF	74	09/96 → 08/00	 	A/C(-) A/C(+)	MVB1125R6 MVB1200R6D TB552 TBK100	6PK1125 6DPK1200 138x23
	AVU, BFQ			75	08/00 →	 	Eng. BFQ, A/C(-), →05/03 Eng. BFQ, A/C(+), →05/03 →05/03 →05/03
1.8	AGN, APG	92	09/96 →	 	A/C(-), →05/03 A/C(+), →05/03 →05/03	MVB1125R6 MVB1200R6D TB554 TBK101	6PK1125 6DPK1200 150x23
				 	→05/03, → Ch. 8L-Y-125000 →05/03, Ch. 8L-Y-125001→	TBK115	
1.8 quattro	AGN	92	08/98 →	 	A/C(-), →05/03 A/C(+), →05/03 →05/03	MVB1125R6 MVB1200R6D TB554 TBK101	6PK1125 6DPK1200 150x23
				 	→05/03, → Ch. 8L-Y-125000 →05/03, Ch. 8L-Y-125001→	TBK115	
1.8 T	AGU, AQA, ARZ, AUM	110	12/96 →	 	A/C(-), →05/03 A/C(+), →05/03 →05/03	MVB1125R6 MVB1200R6D TB554 TBK101	6PK1125 6DPK1200 150x23
	 			→05/03, → Ch. 8L-Y-125000 →05/03, Ch. 8L-Y-125001→	TBK115		
	AJQ, APP, ARY, AUQ	132	12/98 →	 	A/C(-), →05/03 A/C(+), →05/03 →05/03	MVB1125R6 MVB1200R6D TB554 TBK101	6PK1125 6DPK1200 150x23
	 			→05/03, → Ch. 8L-Y-125000 →05/03, Ch. 8L-Y-125001→	TBK115		
1.8 T quattro	AJQ, ARY	132	10/98 →	 	A/C(-), →05/03 A/C(+), →05/03 →05/03	MVB1125R6 MVB1200R6D TB554 TBK101	6PK1125 6DPK1200 150x23
				 	→05/03, → Ch. 8L-Y-125000 →05/03, Ch. 8L-Y-125001→	TBK115	
	AGU, AQA, ARX	110	12/96 →	 	A/C(-), 08/98→05/03 A/C(+), 08/98→05/03 08/98→05/03	MVB1125R6 MVB1200R6D TB554 TBK101	6PK1125 6DPK1200 150x23
	 			08/98→05/03, → Ch. 8L-Y-125000 08/98→05/03, Ch. 8L-Y-125001→	TBK115		



kW



AUDI

...AUDI

...A3 (8L1)

1.9 TDI	AGR, ALH	66	09/96 → 07/01	⊗	Eng. ALH, A/C(-)	MVB906R6	6PK906
				⊗	Eng. ALH, A/C(+)	MVB1660R6	6PK1660
					Eng. ALH, → Eng Nr 500000	TB533	141x25
					Eng. ALH, Eng Nr 500001→	TB659	141x26
					→ Eng Nr 500000	TBK107	
	AHF, ASV	81	08/97 → 07/01	⊗	Eng. ASV, A/C(-)	MVB906R6	6PK906
				⊗	Eng. ASV, A/C(+)	MVB1660R6	6PK1660
					Eng. ASV, → Eng Nr 150000	TB533	141x25
					Eng. ASV, Eng Nr 150001→	TB659	141x26
					→ Eng Nr 006065	TBK116	
	ASZ	96	08/00 →	⊗	A/C(-), →05/03	MVB1125R6	6PK1125
				⊗	A/C(+), →05/03	MVB1200R6D	6DPK1200
					→05/03	TB680	120x30
					→05/03, → Eng Nr 115000	TBK225	
					→05/03, → Eng Nr 115000, VD(+)	TBK269	
ATD, AXR	74	10/00 →		→05/03, Eng Nr 115001→	TBK270		
			⊗	Eng. AXR, A/C(-), →05/03	MVB1125R6	6PK1125	
			⊗	Eng. AXR, A/C(+), →05/03	MVB1200R6D	6DPK1200	
				→05/03	TB680	120x30	
				→05/03	TBK270		
1.9 TDI quattro	ASZ	96	08/00 →	⊗	Eng. ATD, →05/03, → Eng Nr 165000	TBK225	
				⊗	Eng. ATD, →05/03, → Eng Nr 165000, VD(+)	TBK269	
					A/C(-), →05/03	MVB1125R6	6PK1125
					A/C(+), →05/03	MVB1200R6D	6DPK1200
					→05/03	TB680	120x30
S3 quattro	AMK, APY, AUL	154	03/99 →		→05/03, → Eng Nr 115000	TBK225	
					→05/03, → Eng Nr 115000, VD(+)	TBK269	
					→05/03, Eng Nr 115001→	TBK270	
				⊗	Eng. AMK, A/C(-), →04/02	MVB1125R6	6PK1125
				⊗	Eng. AMK, A/C(+), →04/02	MVB1200R6D	6DPK1200
BAM	165	10/01 →		→04/02	TB554	150x23	
				→04/02	TBK115		
				→08/00, → Ch. 8L-Y-125000	TBK101		
			⊗	A/C(-), →06/03	MVB1125R6	6PK1125	
			⊗	A/C(+), →06/03	MVB1200R6D	6DPK1200	
1.6 FSI	BAG, BLF, BLP	85	08/03 →		→06/03	TB554	150x23
					→06/03	TBK115	
					→06/03	TBK115	

A3 (8P1)

1.4 TFSI	CAXC	92	09/07 →	⊗	A/C(-)	MVB1088R6	6PK1088
				⊗	A/C(+)	MVB1740R6	6PK1740
1.6	BGU, BSE, BSF	75	05/03 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
						TBK100	
1.6 FSI	BAG, BLF, BLP	85	08/03 →	⊗	A/C(-), →09/07	MVB1088R6	6PK1088
				⊗	A/C(+), →10/05	MVB1740R6	6PK1740
				⊗	A/C(+), 06/04→09/07	MVB1740R6	6PK1740
1.8 TFSI	BYT, BZB	118	11/06 →	⊗		MVB1115R6	6PK1115
1.9 TDI	BKC	77	05/03 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	



kW



AUDI

...AUDI

...A3 (8P1)

2.0 FSI	AXW, BLR, BLX, BLY, BMB, BVY, BVZ	110	05/03 →	⊗	A/C(-)	MVB900R6	6PK900	
				⊗	A/C(+)	MVB1045R6	6PK1045	
				⊗	→05/05	TB745	145x23	
				⊗	06/04→10/05	TB753	148x23	
2.0 TDI	AZV	100	05/03 →	⊗	A/C(-)	MVB946R6	6PK946	
				⊗	A/C(+)	MVB1050R6	6PK1050	
				⊗		TB743	141x30	
				⊗		TBK262		
	BMN	125	03/06 →		⊗	A/C(-)	MVB946R6	6PK946
					⊗	A/C(+)	MVB1050R6	6PK1050
					⊗		TB743	141x30
					⊗		TBK262	
	BMM	103	06/05 →		⊗	A/C(-)	MVB946R6	6PK946
					⊗	A/C(+)	MVB1050R6	6PK1050
					⊗		TB680	120x30
					⊗		TBK270	
2.0 TDI quattro	BMM	103	01/06 →	⊗	A/C(-), 06/07→	MVB946R6	6PK946	
				⊗	A/C(+), 06/07→	MVB1050R6	6PK1050	
				⊗	06/07→	TB680	120x30	
				⊗	06/07→	TBK270		
2.0 TDI 16V	BKD	103	05/03 →	⊗	A/C(-)	MVB946R6	6PK946	
				⊗	A/C(+)	MVB1050R6	6PK1050	
				⊗		TB743	141x30	
				⊗		TBK262		
2.0 TDI 16V quattro	BKD	103	08/04 →	⊗	A/C(-)	MVB946R6	6PK946	
				⊗	A/C(+)	MVB1050R6	6PK1050	
				⊗		TB743	141x30	
				⊗		TBK262		
2.0 TDI quattro	AZV	100	05/03 →	⊗	A/C(-), 08/04→	MVB946R6	6PK946	
				⊗	A/C(+), 08/04→	MVB1050R6	6PK1050	
				⊗	08/04→	TB743	141x30	
				⊗	08/04→	TBK262		
	BMN	125	03/06 →		⊗	A/C(-)	MVB946R6	6PK946
					⊗	A/C(+)	MVB1050R6	6PK1050
					⊗		TB743	141x30
					⊗		TBK262	
2.0 TFSI	AXX, BWA, CAWB	147	09/04 →	⊗	02/08→	MVB1115R6	6PK1115	
				⊗	Eng. AXX, A/C(-), →10/05	MVB955R6	6PK955	
				⊗	Eng. AXX, A/C(+), →10/05	MVB1050R6	6PK1050	
				⊗	→10/05	TB753	148x23	
2.0 TFSI quattro	AXX, BWA	147	09/04 →	⊗	Eng. BWA, A/C(-)	MVB955R6	6PK955	
				⊗	Eng. BWA, A/C(+)	MVB1050R6	6PK1050	
				⊗		TB753	148x23	
3.2 V6 quattro	BDB, BMJ, BUB	184	07/03 →	⊗	A/C(-), → Ch. 8P-7-085000	MVB1238R6	6PK1238	
				⊗	A/C(+), → Ch. 8P-7-085000	MVB1625R6	6PK1625	
S3 quattro	BHZ	195	11/06 →	⊗		MVB1050R6	6PK1050	
	BZC	188	02/07 →	⊗		TB753	148x23	

A3 Sportback (8PA)

1.4 TFSI	CAXC	92	09/07 →	⊗	A/C(-)	MVB1088R6	6PK1088
				⊗	A/C(+)	MVB1740R6	6PK1740
1.6	BGU, BSE, BSF	75	09/04 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
				⊗		TB552	138x23
				⊗		TBK100	
1.6 FSI	BLF, BLP	85	09/04 →	⊗	A/C(-), →09/07	MVB1088R6	6PK1088
				⊗	A/C(+), →09/07	MVB1740R6	6PK1740
1.8 TFSI	BYT, BZB	118	11/06 →	⊗		MVB1115R6	6PK1115
1.9 TDI	BKC	77	09/04 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
				⊗		TB680	120x30
				⊗		TBK270	



kW



AUDI

...AUDI

...A3 Sportback (8PA)

2.0 FSI	BLR, BLX, BLY, BMB, BVY, BVZ	110	09/04 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
				⊗	→10/05	TB753	148x23
2.0 TDI	AZV	100	09/04 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
				⊗		TB743	141x30
	BMN	125	03/06 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
				⊗		TB743	141x30
BMM	103	06/05 →	⊗	A/C(-)	MVB946R6	6PK946	
			⊗	A/C(+)	MVB1050R6	6PK1050	
			⊗		TB680	120x30	
2.0 TDI quattro	BMM	103	01/06 →	⊗	A/C(-), 06/07→	MVB946R6	6PK946
				⊗	A/C(+), 06/07→	MVB1050R6	6PK1050
				⊗	06/07→	TB680	120x30
				⊗	06/07→	TBK270	
2.0 TDI 16V	BKD	103	09/04 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
				⊗		TB743	141x30
				⊗		TBK262	
2.0 TDI 16V quattro	BKD	103	11/05 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
				⊗		TB743	141x30
				⊗		TBK262	
2.0 TDI quattro	BMN	125	03/06 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
				⊗		TB743	141x30
2.0 TFSI	AXX, BPY, BWA, CAWB	147	09/04 →	⊗	02/08→	MVB1115R6	6PK1115
				⊗	Eng. AXX, A/C(-), →10/05	MVB955R6	6PK955
				⊗	Eng. AXX, A/C(+), →10/05	MVB1050R6	6PK1050
				⊗	→10/05	TB753	148x23
2.0 TFSI quattro	AXX, BWA	147	09/04 →	⊗	Eng. BWA, A/C(-)	MVB955R6	6PK955
				⊗	Eng. BWA, A/C(+)	MVB1050R6	6PK1050
				⊗		TB753	148x23
3.2 V6 quattro	BMJ, BUB	184	09/04 →	⊗	A/C(-), → Ch. 8P-7-085000	MVB1238R6	6PK1238
				⊗	A/C(+), → Ch. 8P-7-085000	MVB1625R6	6PK1625
S3 quattro	BHZ	195	06/08 →	⊗		MVB1050R6	6PK1050
				⊗		TB753	148x23

A4 (8D2, B5)

1.6	ADP, AHL, ANA, ARM	74	01/95 → 07/00	⊗		MVB855R4	4PK855
				⊗		MVB1300R5	5PK1300
				⊗		TB552	138x23
				⊗	Eng. ADP	TB463	121x18
				⊗		TBK100	
				⊗	Eng. ADP	TBK309	
				⊗		SVB12528	12x528
	ALZ	75	07/00 → 11/00	⊗	→ Ch. 8D-1-200000	MVB855R4	4PK855
				⊗	→ Ch. 8D-1-200000	MVB1300R5	5PK1300
				⊗		TB552	138x23
				⊗		TBK100	



kW



...AUDI

...A4 (8D2, B5)

AUDI

1.8	ADR, APT, ARG, AVV	92	01/95 → 11/00	⊗		MVB855R4	4PK855
				⊗		MVB1300R5	5PK1300
				Hydr		TB555	153x25
				Thermo		TB464	152x25.4
				⊗KIT		TBK330	
				⊗KIT	→07/99, → Ch. 8D-T-155000	TBK332	
				⊗KIT	>07/99, → Ch. 8D-T-155000, VD(+)	TBK333	
				⊗KIT	VD(+)	TBK331	
				⊗		SVB12528	12x528
				95			01/95 → 11/00
⊗	→07/99	MVB1300R5	5PK1300				
Hydr, →07/99		TB555	153x25				
Thermo, →07/99		TB464	152x25.4				
⊗KIT	→07/99, → Ch. 8D-T-155000	TBK332					
⊗KIT	→07/99, → Ch. 8D-T-155000, VD(+)	TBK333					
⊗KIT	→07/99, Ch. 8D-T-155001→	TBK330					
⊗KIT	→07/99, Ch. 8D-T-155001→, VD(+)	TBK331					
⊗	→07/99	SVB12528	12x528				
AFY		85	04/95 → 11/00				
				⊗		MVB1300R5	5PK1300
				Hydr		TB555	153x25
				Thermo		TB464	152x25.4
				⊗KIT	→ Ch. 8D-T-155000	TBK332	
				⊗KIT	→ Ch. 8D-T-155000, VD(+)	TBK333	
				⊗KIT	Ch. 8D-T-155001→	TBK330	
				⊗KIT	Ch. 8D-T-155001→, VD(+)	TBK331	
				⊗		SVB12528	12x528
				1.8 quattro	ADR, APT, ARG	92	01/95 → 11/00
⊗		MVB1300R5	5PK1300				
Hydr		TB555	153x25				
Thermo		TB464	152x25.4				
⊗KIT		TBK330					
⊗KIT	→07/99, → Ch. 8D-T-155000	TBK332					
⊗KIT	→07/99, → Ch. 8D-T-155000, VD(+)	TBK333					
⊗KIT	VD(+)	TBK331					
⊗		SVB12528	12x528				
AFY		85	07/95 → 11/00				
				⊗	08/97→	MVB1300R5	5PK1300
				Hydr, 08/97→		TB555	153x25
				Thermo, 08/97→		TB464	152x25.4
				⊗KIT	08/97→	TBK330	
				⊗KIT	08/97→, VD(+)	TBK331	
				⊗	08/97→	SVB12528	12x528



kW



AUDI

...AUDI

...A4 (8D2, B5)

1.8 T	AEB, ANB, APU, ARK, AWT	110	01/95 → 11/00	☼	Eng. AWT	MVB855R4	4PK855			
				⊖	Eng. AWT	MVB1300R5	5PK1300			
				☼	06/00→	TB554	150x23			
				☼	Hydr	TB555	153x25			
				☼	Thermo	TB464	152x25.4			
				☼KIT		TBK330				
				☼KIT	→07/99, → Ch. 8D-T-155000	TBK332				
				☼KIT	→07/99, → Ch. 8D-T-155000,	TBK333				
				☼KIT	VD(+)	TBK115				
				☼KIT	Eng. AWT, 06/00→, → Ch. 8D-1-042384	TBK341				
AJL	132	12/97 → 11/00	☼		MVB855R4	4PK855				
			⊖		MVB1300R5	5PK1300				
			☼	Hydr	TB555	153x25				
			☼	Thermo	TB464	152x25.4				
			☼KIT		TBK330					
			☼KIT	VD(+)	TBK331					
			☼		SVB12528	12x528				
			1.8 T quattro	AEB, ANB, APU, ARK, AWT	110	01/95 → 11/00	☼		MVB855R4	4PK855
							⊖		MVB1300R5	5PK1300
							☼	Hydr	TB555	153x25
☼	Thermo	TB464					152x25.4			
☼KIT		TBK330								
☼KIT	→07/99, → Ch. 8D-T-155000	TBK332								
☼KIT	→07/99, → Ch. 8D-T-155000,	TBK333								
☼KIT	VD(+)	TBK331								
☼		SVB12528					12x528			
AJL	132	12/97 → 11/00					☼		MVB855R4	4PK855
			⊖		MVB1300R5	5PK1300				
			☼	Hydr	TB555	153x25				
			☼	Thermo	TB464	152x25.4				
			☼KIT		TBK330					
			☼KIT	VD(+)	TBK331					
			☼		SVB12528	12x528				
			1.9 TDI	1Z, AHH, AHU	66	01/95 → 11/00	☼	Eng. AHH	MVB855R4	4PK855
							⊖	Eng. AHH	MVB1590R5	5PK1590
							☼		TB384	137x25.4
☼KIT		TBK026								
☼KIT	04/97→, → Ch. 8D-1-200000	TBK335								
AFN, AVG	81	10/95 → 11/00					☼		MVB855R4	4PK855
							⊖		MVB1590R5	5PK1590
							☼KIT		TB384	137x25.4
AJM	85	03/00 → 11/00					☼		MVB855R4	4PK855
							⊖		MVB1432R5	5PK1432
			☼KIT		TB680	120x30				
AFF	55	12/95 → 11/00	☼		TBK225					
			⊖	VD(+)	TBK269					
			☼		MVB855R4	4PK855				
			⊖		MVB1590R5	5PK1590				
			☼		TB384	137x25.4				
			☼KIT		TBK026					



kW



...AUDI

...A4 (8D2, B5)

1.9 TDI quattro	AFN, AVG	81	09/96 → 11/00	 KIT		MVB855R4 4PK855 MVB1590R5 5PK1590 TB384 137x25.4 TBK026
	AJM, ATJ	85	03/00 → 11/00	 KIT	Eng. ATJ Eng. ATJ Eng. ATJ Eng. ATJ, VD(+)	MVB855R4 4PK855 MVB1432R5 5PK1432 TB680 120x30 TBK225 TBK269
2.4	AGA, ALF, AML, APS, ARJ	121	03/97 → 11/00	 KIT	A/C(-), 08/97→ A/C(+), 08/97→ 08/97→ 08/97→ 08/97→, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
	AJG, AMM, APZ	120	08/97 → 11/00	 KIT	A/C(-) A/C(+) VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
2.4 quattro	AGA, ALF, AML, APS, ARJ	121	03/97 → 11/00	 KIT	A/C(-), 08/97→ A/C(+), 08/97→ 08/97→ 08/97→ 08/97→, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
	APZ	120	08/97 → 11/00	 KIT	A/C(-) A/C(+) VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
2.5 TDI	AFB, AKN	110	09/97 → 11/00	 KIT		MVB1238R4 4PK1238 MVB2403R6 6PK2403 TB642 207x32 TBK358 TB641 87x25
2.5 TDI quattro	AFB, AKN	110	09/97 → 11/00	 KIT		MVB1238R4 4PK1238 MVB2403R6 6PK2403 TB642 207x32 TBK358 TB641 87x25
2.6	ABC	110	01/95 → 11/00	 	A/C(-), →02/99 A/C(+), →02/96, → Ch. 8D-T-185641	MVB1760R6 6PK1760 MVB1875R6 6PK1875
				 	A/C(+), 02/96→02/99, Ch. 8D-T-185642→ →02/99	MVB1875R6 6PK1875 TB373 239x25.4
2.6 quattro	ABC	110	01/95 → 11/00	 	A/C(-), →02/99 A/C(+), →02/96, → Ch. 8D-T-080000	MVB1760R6 6PK1760 MVB1875R6 6PK1875
				 	A/C(+), 02/96→02/99, Ch. 8D-T-080001→ →02/99	MVB1875R6 6PK1875 TB373 239x25.4



kw



AUDI

...AUDI

...A4 (8D2, B5)

2.8	AAH	128	09/95 → 07/97	②	A/C(-)	MVB1760R6	6PK1760
				②	A/C(+), →02/96, → Ch. 8D-T-185641	MVB1875R6	6PK1875
				②	A/C(+), 02/96→, Ch. 8D-T-185642→	MVB1875R6	6PK1875
						TB373	239x25.4
	ACK, ALG, AMX, APR, AQD	142	10/96 → 11/00	②	A/C(-), 08/97→	MVB1760R6	6PK1760
				②	A/C(+), 08/97→	MVB1875R6	6PK1875
					08/97→	TB556	253x30
					08/97→	TBK357	
					08/97→, Ch. 8D-V-205001→, VD(+)	TBK353	
2.8 quattro	AAH	128	01/95 → 07/97	②	A/C(-)	MVB1760R6	6PK1760
				②	A/C(+), →02/96, → Ch. 8D-T-080000	MVB1875R6	6PK1875
				②	A/C(+), 02/96→, Ch. 8D-T-080001→	MVB1875R6	6PK1875
						TB373	239x25.4
	ACK, ALG, AMX, APR, AQD	142	10/96 → 11/00	②	A/C(-)	MVB1760R6	6PK1760
				②	A/C(+)	MVB1875R6	6PK1875
						TB556	253x30
						TBK357	
					Ch. 8D-V-205001→, VD(+)	TBK353	
S4 quattro	AGB, AZB	195	09/97 → 11/00	②	A/C(-)	MVB1740R6	6PK1740
				②	A/C(+), →12/98, → Ch. 8D-X-199999	MVB1865R6	6PK1865
				②	A/C(+), 01/99→	MVB1855R6	6PK1855
						TB556	253x30
					Eng. AZB	TBK357	
					Eng. AZB, VD(+)	TBK353	

A4 (8E2, B6)

1.6	ALZ	75	11/00 → 12/04	⚙	→09/01, → Ch. 8D-1-200000	MVB855R4	4PK855
				②	→09/01, → Ch. 8D-1-200000	MVB1300R5	5PK1300
				②	A/C(-), 10/01→, Ch. 8E-1-000001→	MVB1080R6	6PK1080
				②	A/C(+), 01/04→, Ch. 8E-4-191001→	MVB1570R6	6PK1570
				②	A/C(+), 10/01→01/04, Ch. 8E-1-1000001→8E-4-191000	MVB1588R6	6PK1588
						TB552	138x23
						TBK100	
1.8 T	AVJ	110	11/00 → 07/02	②	A/C(-)	MVB1080R6	6PK1080
				②	A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
				②	A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
						TB554	150x23
						TBK341	
	BFB, BKB	120	07/02 → 12/04	②	A/C(-)	MVB1080R6	6PK1080
				②	A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
				②	A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
						TB554	150x23
						TBK341	
	BEX	140	11/02 → 12/04	②	A/C(-)	MVB1080R6	6PK1080
				②	A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
				②	A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
						TB554	150x23
						TBK341	



kW



...AUDI

...A4 (8E2, B6)

1.8 T quattro	AVJ	110	11/00 → 07/02	 KIT	→ Ch. 8E-4-191000 Ch. 8E-4-191001→	MVB1588R6 MVB1570R6 TB554 TBK341	6PK1588 6PK1570 150x23
	BFB	120	07/02 → 12/04	 KIT	→ Ch. 8E-4-191000 Ch. 8E-4-191001→	MVB1588R6 MVB1570R6 TB554 TBK341	6PK1588 6PK1570 150x23
	BEX	140	11/02 → 12/04	 KIT	→ Ch. 8E-4-191000 Ch. 8E-4-191001→	MVB1588R6 MVB1570R6 TB554 TBK341	6PK1588 6PK1570 150x23
1.9 TDI	AVF, AWX	96	11/00 → 12/04		Eng. AVF, → Ch. 8E-3-500000	MVB855R4	4PK855
					Eng. AVF, → Ch. 8E-3-500000	MVB1432R5	5PK1432
					Eng. AVF, A/C(-), 04/01→, Ch. 8E-4-000001→	MVB1125R6	6PK1125
					Eng. AVF, A/C(+), 04/01→, Ch. 8E-4-000001→	MVB1613R6	6PK1613
				 KIT	Ch. 8E-2-297101→ Eng. AVF, → Ch. 8E-2-297100 Eng. AVF, → Ch. 8E-2-297100, VD(+)	TB680 TBK270 TBK225 TBK269	120x30
AVB	74	05/01 → 12/04		→05/04, → Ch. 8E-3-500000	MVB855R4	4PK855	
				→05/04, → Ch. 8E-3-500000	MVB1432R5	5PK1432	
				A/C(-), →05/04, Ch. 8E-4-000001→	MVB1125R6	6PK1125	
				A/C(+), →05/04, Ch. 8E-4-000001→	MVB1613R6	6PK1613	
			 KIT	→05/04 →05/04, → Ch. 8E-2-297100 →05/04, → Ch. 8E-2-297100, VD(+) →05/04, Ch. 8E-2-297101→	TB680 TBK225 TBK269 TBK270	120x30	
BKE	85	06/04 → 12/04		A/C(-)	MVB1125R6	6PK1125	
				A/C(+)	MVB1613R6	6PK1613	
				→ Ch. 8E-2-297100	TB680	120x30	
			 KIT	→ Ch. 8E-2-297100, VD(+) Ch. 8E-2-297101→	TBK225 TBK269 TBK270		
1.9 TDI quattro	AVF	96	11/01 → 12/04		→ Ch. 8E-3-500000	MVB855R4	4PK855
					→ Ch. 8E-3-500000	MVB1432R5	5PK1432
					A/C(-), Ch. 8E-4-000001→	MVB1125R6	6PK1125
					A/C(+), Ch. 8E-4-000001→	MVB1613R6	6PK1613
				 KIT	→ Ch. 8E-2-297100 → Ch. 8E-2-297100, VD(+) Ch. 8E-2-297101→	TB680 TBK225 TBK269 TBK270	120x30
2.0	ALT	96	11/00 → 12/04		A/C(-)	MVB1080R6	6PK1080
					A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
					A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
				 KIT		TB554 TBK341	150x23
2.0 FSI	AWA	110	07/02 → 12/04		A/C(-)	MVB1080R6	6PK1080
					A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
					A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
				 KIT	→ Ch. 8E-4-400000 Ch. 8E-5-000001→	TB745 TB753	145x23 148x23

AUDI



kW



AUDI

...AUDI

...A4 (8E2, B6)

2.4	BDV	125	09/01 → 12/04	 	VD(+)	MVB1855R6	6PK1855
						TB556	253x30
	AMM	120	09/01 → 12/04	 	VD(+)	MVB1855R6	6PK1855
						TB556	253x30
2.5 TDI	AYM	114	08/01 → 07/02	 	VD(+)	MVB1215R4	4PK1215
						MVB2403R6	6PK2403
	BCZ, BDG, BFC	120	07/02 → 12/04	 	VD(+)	TB738	207x30
						TBK348	
2.5 TDI quattro	AYM	114	08/01 → 07/02	 	VD(+)	TBK354	
						TB641	87x25
	BCZ, BDG, BFC	120	07/02 → 12/04	 	VD(+)	MVB1215R4	4PK1215
						MVB2403R6	6PK2403
2.5 TDI quattro	AYM	114	08/01 → 07/02	 	VD(+)	TB738	207x30
						TBK348	
	AKE, BAU, BDH	132	11/00 → 12/04	 	VD(+)	TBK354	
						TB641	87x25
3.0	ASN, AVK	162	11/00 → 12/04	 	VD(+)	MVB1215R4	4PK1215
						MVB2403R6	6PK2403
	BBJ	160	04/01 → 12/04	 	VD(+)	TB738	207x30
						TBK348	
3.0 quattro	ASN, AVK	162	11/00 → 12/04	 	VD(+)	TBK354	
						TB641	87x25
	BBJ	160	04/01 → 12/04	 	VD(+)	MVB1215R4	4PK1215
						MVB2403R6	6PK2403
S4 quattro	BBK	253	03/03 → 12/04		VD(+)	TB738	207x30
						TBK348	

A4 (8EC)

1.6	ALZ	75	11/04 →		→03/08, Ch. 8E-5-400001→	MVB1570R6	6PK1570
					→03/08	TB552	138x23
1.8 T	BFB	120	11/04 →		→03/08	TBK100	
					→03/08	MVB1570R6	6PK1570
1.8 T quattro	BFB	120	11/04 →		→03/08, → Ch. 8E-6-400000	TB554	150x23
					→03/08	TBK341	
1.9 TDI	BKE, BRB	85	11/04 →		→03/08	MVB1570R6	6PK1570
					→03/08	TB554	150x23
2.0	ALT	96	11/04 →		→03/08	TBK341	
					→03/08	MVB1613R6	6PK1613
					→03/08	TB680	120x30
					→03/08	TBK270	
					→03/08, → Ch. 8E-6-400000	MVB1570R6	6PK1570
					→03/08	TB554	150x23
					→03/08, → Ch. 8E-6-400000	TBK341	



kW



...AUDI

...A4 (8EC)

2.0 TDI	BNA, BRF	100	11/04 →	 KIT	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
	BRD	125	06/06 →	 KIT	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
	BPW	103	11/04 →	 KIT	→03/08 →03/08 →03/08	MVB1613R6 TB680 TBK270	6PK1613 120x30
	BVG	89	09/05 →	 KIT	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
	BVA	120	06/06 →	 KIT	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
2.0 TDI 16V	BLB, BRE	103	11/04 →	 KIT	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
2.0 TDI quattro	BPW	103	01/06 →	 KIT	06/06 →06/08 06/06 →06/08 06/06 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
	BRD	125	06/06 →	 KIT	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
	BVA	120	06/06 →	 KIT	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
2.0 TFSI	BGB, BPG, BWE, BWT	147	11/04 →	 	→06/08 →06/08	MVB1570R6 TB753	6PK1570 148x23
	BUL	162	06/05 →	 	→06/08 →06/08	MVB1570R6 TB753	6PK1570 148x23
	BPJ, BYK	125	10/06 →	 	→06/08 →06/08	MVB1570R6 TB753	6PK1570 148x23
2.0 TFSI quattro	BGB, BPG, BWE, BWT	147	11/04 →	 	→03/08 →03/08	MVB1570R6 TB753	6PK1570 148x23
	BUL	162	06/05 →	 	→03/08 →03/08	MVB1570R6 TB753	6PK1570 148x23
2.5 TDI	BCZ, BDG	120	11/04 →		→05/05	MVB1215R4	4PK1215
					→05/05	MVB2403R6	6PK2403
				 	→05/05	TB738	207x30
				 KIT	→05/05	TBK348	
				 KIT	→05/05, VD(+)	TBK354	
2.7 TDI	BPP	132	01/06 →		→03/08, → Ch. 8E-6-252204	MVB2490R6	6PK2490
					→03/08, Ch. 8E-6-252205 →	MVB2460R6	6PK2460
					→03/08	TB760	83x24
	BSG	120	11/05 →		→03/08, → Ch. 8E-6-252204	MVB2490R6	6PK2490
					→03/08, Ch. 8E-6-252205 →	MVB2460R6	6PK2460
					→03/08	TB760	83x24
3.0 quattro	BBJ	160	11/04 → 07/06	 		MVB1885R6 TB754	6PK1885 281x30
3.0 TDI quattro	BKN	150	11/04 →	 	→03/08 →03/08	MVB2460R6 TB760	6PK2460 83x24
	ASB	171	01/06 →		→03/08	MVB2460R6	6PK2460
3.2 FSI	AUK	188	01/05 →		→03/08	MVB2415R6	6PK2415
3.2 FSI quattro	AUK, BKH	188	01/05 →		→03/08	MVB2415R6	6PK2415
RS4 quattro	BNS	309	09/05 →		→08/08	MVB1165R5	5PK1165
S4 quattro	BBK, BHF	253	11/04 →			MVB1110R5	5PK1110

A4 (8K2)

1.8 TFSI	CABB	118	11/07 →		→05/08	MVB1588R6	6PK1588
	CABA	88	01/08 →		→05/08	MVB1588R6	6PK1588
3.0 TDI quattro	CAPA, CCWA	176	11/07 →		→05/08	MVB2460R6	6PK2460
3.2 FSI quattro	CALA	195	11/07 →			MVB2403R6	6PK2403



kW



...AUDI

A4 Avant (8D5, B5)

1.6	ADP, AHL, ANA, ARM	74	03/96 → 07/00			MVB855R4	4PK855
					→07/97	MVB1300R5	5PK1300
					10/96→	TB463	121x18
					→07/97	TB552	138x23
					10/96→	TBK309	
						TBK100	
						SVB12528	12x528
					→ Ch. 8D-1-200000	MVB855R4	4PK855
					→ Ch. 8D-1-200000	MVB1300R5	5PK1300
						TB552	138x23
		TBK100					
1.8	ADR, APT, ARG, AVV	92	02/96 → 09/01		→09/00	MVB855R4	4PK855
					→09/00	MVB1300R5	5PK1300
					Hydr, →09/00	TB555	153x25
					Thermo, →09/00	TB464	152x25.4
					→07/99, → Ch. 8D-T-155000	TBK332	
					→07/99, → Ch. 8D-T-155000,	TBK333	
					VD(+)		
					→09/00	TBK330	
					→09/00, VD(+)	TBK331	
					→09/00	SVB12528	12x528
1.8 quattro	ADR, APT, ARG	92	01/96 → 09/01		→09/00	MVB855R4	4PK855
					→09/00	MVB1300R5	5PK1300
					Hydr, →09/00	TB555	153x25
					Thermo, →09/00	TB464	152x25.4
					→07/99, → Ch. 8D-T-155000	TBK332	
					→07/99, → Ch. 8D-T-155000,	TBK333	
					VD(+)		
					→09/00	TBK330	
					→09/00, VD(+)	TBK331	
					→09/00	SVB12528	12x528
AFY	85	07/95 → 09/01		→09/00	MVB855R4	4PK855	
				→09/00	MVB1300R5	5PK1300	
				Hydr, →09/00	TB555	153x25	
				Thermo, →09/00	TB464	152x25.4	
				→09/00, → Ch. 8D-T-155000	TBK332		
				→09/00, → Ch. 8D-T-155000,	TBK333		
				VD(+)			
				→09/00, Ch. 8D-T-155001→	TBK330		
				→09/00, Ch. 8D-T-155001→,	TBK331		
				VD(+)			
	→09/00	SVB12528	12x528				
AFY	85	07/95 → 09/01		08/97→09/00	MVB855R4	4PK855	
				08/97→09/00	MVB1300R5	5PK1300	
				Hydr, 08/97→09/00	TB555	153x25	
				Thermo, 08/97→09/00	TB464	152x25.4	
				08/97→09/00	TBK330		
				08/97→09/00, VD(+)	TBK331		
				08/97→09/00	SVB12528	12x528	



kW



...AUDI

...A4 Avant (8D5, B5)

AUDI

Engine	Accessories	kW	Year	Icons	Notes	Part Numbers	Dimensions						
1.8 T	AEB, ANB, APU, ARK, AWT	110	03/96 → 09/01	⚙️	Eng. AWT, →09/00	MVB855R4	4PK855						
				⚙️	Eng. AWT, →09/00	MVB1300R5	5PK1300						
				🌀	06/00→09/00	TB554	150x23						
				🌀	Hydr, →09/00	TB555	153x25						
				🌀	Thermo, →09/00	TB464	152x25.4						
				🌀KIT	→07/99, → Ch. 8D-T-155000	TBK332							
				🌀KIT	→07/99, → Ch. 8D-T-155000,	TBK333							
					VD(+)								
				🌀KIT	→09/00	TBK330							
				🌀KIT	→09/00, VD(+)	TBK331							
				🌀KIT	Eng. AWT, 06/00→09/00,	TBK115							
					→ Ch. 8D-1-042384								
🌀KIT	Eng. AWT, 06/00→09/00,	TBK341											
	Ch. 8D-1-042385→												
	→09/00	SVB12528	12x528										
AJL	132	12/97 → 09/01	⚙️	→09/00	MVB855R4	4PK855							
			⚙️	→09/00	MVB1300R5	5PK1300							
			🌀	Hydr, →09/00	TB555	153x25							
			🌀	Thermo, →09/00	TB464	152x25.4							
			🌀KIT	→09/00	TBK330								
			🌀KIT	→09/00, VD(+)	TBK331								
			🌀	→09/00	SVB12528	12x528							
			1.8 T quattro	AEB, ANB, APU, ARK, AWT	110	01/96 → 09/01	⚙️	→09/00	MVB855R4	4PK855			
							⚙️	→09/00	MVB1300R5	5PK1300			
							🌀	Hydr, →09/00	TB555	153x25			
							🌀	Thermo, →09/00	TB464	152x25.4			
							🌀KIT	→07/99, → Ch. 8D-T-155000	TBK332				
🌀KIT	→07/99, → Ch. 8D-T-155000,	TBK333											
	VD(+)												
🌀KIT	→09/00	TBK330											
🌀KIT	→09/00, VD(+)	TBK331											
🌀	→09/00	SVB12528					12x528						
AJL	132	12/97 → 09/01					⚙️	→09/00	MVB855R4	4PK855			
							⚙️	→09/00	MVB1300R5	5PK1300			
			🌀	Hydr, →09/00	TB555	153x25							
			🌀	Thermo, →09/00	TB464	152x25.4							
			🌀KIT	→09/00	TBK330								
			🌀KIT	→09/00, VD(+)	TBK331								
			🌀	→09/00	SVB12528	12x528							
			1.9 DUO	66	03/98 → 09/01	⚙️	03/99→09/00	MVB855R4	4PK855				
						⚙️	03/99→09/00	MVB1590R5	5PK1590				
						🌀	03/99→09/00	TB384	137x25.4				
						🌀KIT	03/99→09/00	TBK026					
						1.9 TDI	1Z, AHH, AHU	66	02/96 → 09/01	⚙️	Eng. AHH, →09/00	MVB855R4	4PK855
⚙️	Eng. AHH, →09/00	MVB1590R5								5PK1590			
🌀	→09/00	TB384								137x25.4			
🌀KIT	→09/00	TBK026											
🌀KIT	04/97→09/00,	TBK335											
	→ Ch. 8D-1-200000												
AFN, AVG	81	02/96 → 09/01								⚙️	→09/00	MVB855R4	4PK855
										⚙️	→09/00	MVB1590R5	5PK1590
			🌀	→09/00	TB384					137x25.4			
			🌀KIT	→09/00	TBK026								
			AJM	85	03/00 → 09/01					⚙️	→09/00	MVB855R4	4PK855
										⚙️	→09/00	MVB1432R5	5PK1432
						🌀	→09/00	TB680	120x30				
						🌀KIT	→09/00	TBK225					
						🌀KIT	→09/00, VD(+)	TBK269					
						AFF	55	03/96 → 09/01	⚙️	→09/00	MVB855R4	4PK855	
									⚙️	→09/00	MVB1590R5	5PK1590	
									🌀	→09/00	TB384	137x25.4	
🌀KIT	→09/00	TBK026											



kW



...AUDI

AUDI

...A4 Avant (8D5, B5)

1.9 TDI quattro	AFN, AVG	81	09/96 → 09/01		→09/00	MVB855R4	4PK855
	AJM, ATJ	85	03/00 → 09/01		Eng. ATJ Eng. ATJ Eng. ATJ Eng. ATJ, VD(+)	MVB1590R5 TB384 TBK026 MVB855R4 MVB1432R5 TB680 TBK225 TBK269	5PK1590 137x25.4 4PK855 5PK1432 120x30
2.4	AGA, ALF, AML, APS, ARJ	121	03/97 → 09/01		A/C(-), 08/97→ A/C(+), 08/97→ 08/97→ 08/97→ 08/97→, VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30
	AJG, AMM, APZ	120	08/97 → 09/01		A/C(-) A/C(+) VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30
2.4 quattro	AGA, ALF, AML, APS, ARJ	121	03/97 → 09/01		A/C(-), 08/97→09/00 A/C(+), 08/97→09/00 08/97→09/00 08/97→09/00 08/97→09/00, VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30
	APZ	120	08/97 → 09/01		A/C(-), →09/00 A/C(+), →09/00 →09/00 →09/00 →09/00, VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30
2.5 TDI	AFB, AKN	110	09/97 → 09/01		→09/00 →09/00 →09/00 →09/00 →09/00	MVB1238R4 MVB2403R6 TB642 TBK358 TB641	4PK1238 6PK2403 207x32
	AFB, AKN	110	09/97 → 09/01		→09/00 →09/00 →09/00 →09/00 →09/00	MVB1238R4 MVB2403R6 TB642 TBK358 TB641	4PK1238 6PK2403 207x32 87x25
2.6	ABC	110	02/96 → 09/01		A/C(-), →02/99 A/C(+), →02/99, Ch. 8D-T-185642→ →02/99	MVB1760R6 MVB1875R6 TB373	6PK1760 6PK1875 239x25.4
	ABC	110	01/96 → 09/01		A/C(-), →02/99 A/C(+), →02/96, → Ch. 8D-T-080000 A/C(+), →02/99, Ch. 8D-T-080001→ →02/99	MVB1760R6 MVB1875R6 MVB1875R6 TB373	6PK1760 6PK1875 6PK1875 239x25.4
2.8	AAH	128	03/96 → 09/96		A/C(-) A/C(+), Ch. 8D-T-185642→	MVB1760R6 MVB1875R6 TB373	6PK1760 6PK1875 239x25.4
	ACK, ALG, AMX, APR, AQQ	142	10/96 → 09/01		A/C(-), →09/00 A/C(+), →09/00 →09/00 →09/00 →09/00, Ch. 8D-V-205001→, VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30





kW



...AUDI

...A4 Avant (8D5, B5)

2.8 quattro	AAH	128	01/96 → 09/96	⊗	A/C(-)	MVB1760R6	6PK1760
				⊗	A/C(+), →02/96, → Ch. 8D-T-080000	MVB1875R6	6PK1875
ACK, ALG, AMX, APR, AOD		142	10/96 → 09/01	⊗	A/C(+), Ch. 8D-T-080001→	MVB1875R6	6PK1875
				⊗		TB373	239x25.4
				⊗	A/C(-), →09/00	MVB1760R6	6PK1760
				⊗	A/C(+), →09/00 →09/00	MVB1875R6	6PK1875
ASJ, AZR		280	05/00 → 09/01	⊗	→09/00	TB556	253x30
				⊗	→09/00	TBK357	
				⊗	→09/00, Ch. 8D-V-205001→, VD(+)	TBK353	
				⊗	Eng. ASJ, A/C(-)	MVB1740R6	6PK1740
ASJ, AZR		280	05/00 → 09/01	⊗	Eng. ASJ, A/C(+)	MVB1855R6	6PK1855
				⊗		TB556	253x30
				⊗	Eng. ASJ	TBK357	
				⊗	Eng. ASJ, VD(+)	TBK353	
AGB, AZB		195	09/97 → 09/01	⊗	A/C(-), →09/00	MVB1740R6	6PK1740
				⊗	A/C(+), →12/98, → Ch. 8D-X-199999	MVB1865R6	6PK1865
				⊗	A/C(+), 01/99→09/00, Ch. 8D-X-200001→	MVB1855R6	6PK1855
				⊗	→09/00	TB556	253x30
AGB, AZB		195	09/97 → 09/01	⊗	Eng. AGB, →09/00	TBK357	
				⊗	Eng. AGB, →09/00, VD(+)	TBK353	

A4 Avant (8E5, B6)

1.6	ALZ	75	09/01 → 12/04	⊗	A/C(-), Ch. 8E-1-000001→	MVB1080R6	6PK1080
				⊗	A/C(+), →01/04, Ch. 8E-1-1000001→8E-4-191000	MVB1588R6	6PK1588
				⊗	A/C(+), 01/04→, Ch. 8E-4-191001→	MVB1570R6	6PK1570
				⊗		TB552	138x23
1.8 T	AVJ	110	09/01 → 07/02	⊗	A/C(-)	MVB1080R6	6PK1080
				⊗	A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
				⊗	A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
				⊗		TB554	150x23
1.8 T	BFB	120	07/02 → 12/04	⊗		TBK341	
				⊗	A/C(-)	MVB1080R6	6PK1080
				⊗	A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
				⊗	A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
1.8 T	BEX	140	11/02 → 12/04	⊗		TB554	150x23
				⊗	A/C(-)	MVB1080R6	6PK1080
				⊗	A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
				⊗	A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
1.8 T quattro	AVJ	110	09/01 → 07/02	⊗		TB554	150x23
				⊗	→ Ch. 8E-4-191000	MVB1588R6	6PK1588
				⊗	Ch. 8E-4-191001→	MVB1570R6	6PK1570
				⊗		TB554	150x23
1.8 T quattro	BFB	120	07/02 → 12/04	⊗		TBK341	
				⊗	→ Ch. 8E-4-191000	MVB1588R6	6PK1588
				⊗	Ch. 8E-4-191001→	MVB1570R6	6PK1570
				⊗		TB554	150x23
1.8 T quattro	BEX	140	11/02 → 12/04	⊗		TBK341	
				⊗	→ Ch. 8E-4-191000	MVB1588R6	6PK1588
				⊗	Ch. 8E-4-191001→	MVB1570R6	6PK1570
				⊗		TB554	150x23
1.8 T quattro	BEX	140	11/02 → 12/04	⊗		TBK341	
				⊗	→ Ch. 8E-4-191000	MVB1588R6	6PK1588
				⊗	Ch. 8E-4-191001→	MVB1570R6	6PK1570
				⊗		TB554	150x23



kw



...AUDI

...A4 Avant (8E5, B6)

AUDI

1.9 TDI	AVF, AWX	96	09/01 → 12/04	⚙️	Eng. AWX	MVB855R4	4PK855
				⚙️	Eng. AVF, A/C(-), Ch. 8E-4-000001→	MVB1125R6	6PK1125
				⚙️	Eng. AVF, A/C(+), Ch. 8E-4-000001→	MVB1613R6	6PK1613
				⚙️	Eng. AWX	MVB1432R5	5PK1432
				🔧	Ch. 8E-2-297101→	TB680	120x30
				🔧	Eng. AWX, → Ch. 8E-2-297100	TBK270	
				🔧	Eng. AWX, → Ch. 8E-2-297100, VD(+)	TBK225	
				🔧		TBK269	
				🔧			
				🔧			
AVB	74	11/01 → 12/04	⚙️	→05/04, → Ch. 8E-3-500000	MVB855R4	4PK855	
			⚙️	→05/04, → Ch. 8E-3-500000	MVB1432R5	5PK1432	
			⚙️	A/C(-), →05/04, Ch. 8E-4-000001→	MVB1125R6	6PK1125	
			⚙️	A/C(+), →05/04, Ch. 8E-4-000001→	MVB1613R6	6PK1613	
			🔧	→05/04	TB680	120x30	
			🔧	→05/04, → Ch. 8E-2-297100	TBK225		
			🔧	→05/04, → Ch. 8E-2-297100, VD(+)	TBK269		
			🔧	→05/04, Ch. 8E-2-297101→	TBK270		
			🔧				
			🔧				
BKE	85	06/04 → 12/04	⚙️	A/C(-)	MVB1125R6	6PK1125	
			⚙️	A/C(+)	MVB1613R6	6PK1613	
			🔧	→ Ch. 8E-2-297100	TB680	120x30	
			🔧	→ Ch. 8E-2-297100, VD(+)	TBK225		
			🔧	Ch. 8E-2-297101→	TBK269		
1.9 TDI quattro	AVF	96	11/01 → 12/04	⚙️	→ Ch. 8E-3-500000	MVB855R4	4PK855
				⚙️	→ Ch. 8E-3-500000	MVB1432R5	5PK1432
				⚙️	A/C(-), Ch. 8E-4-000001→	MVB1125R6	6PK1125
				⚙️	A/C(+), Ch. 8E-4-000001→	MVB1613R6	6PK1613
				🔧		TB680	120x30
				🔧	→ Ch. 8E-2-297100	TBK225	
				🔧	→ Ch. 8E-2-297100, VD(+)	TBK269	
				🔧	Ch. 8E-2-297101→	TBK270	
				🔧			
				🔧			
2.0	ALT	96	09/01 → 12/04	⚙️	A/C(-)	MVB1080R6	6PK1080
				⚙️	A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
				⚙️	A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
				🔧		TB554	150x23
				🔧		TBK341	
2.0 FSI	AWA	110	07/02 → 12/04	⚙️	A/C(-)	MVB1080R6	6PK1080
				⚙️	A/C(+), → Ch. 8E-4-191000	MVB1588R6	6PK1588
				⚙️	A/C(+), Ch. 8E-4-191001→	MVB1570R6	6PK1570
				🔧	→ Ch. 8E-4-400000	TB745	145x23
				🔧	Ch. 8E-5-000001→	TB753	148x23
2.4	BDV	125	09/01 → 12/04	⚙️		MVB1855R6	6PK1855
				🔧		TB556	253x30
				🔧		TBK357	
				🔧	VD(+)	TBK353	
				🔧			
AMM	120	09/01 → 12/04	⚙️		MVB1855R6	6PK1855	
			🔧		TB556	253x30	
			🔧		TBK357		
			🔧	VD(+)	TBK353		



kW



...AUDI

...A4 Avant (8E5, B6)

2.5 TDI	AYM	114	09/01 → 07/02	 	VD(+)	MVB1215R4 MVB2403R6 TB738 TBK348 TBK354 TB641	4PK1215 6PK2403 207x30 87x25
	BCZ, BDG, BFC	120	07/02 → 12/04	 	VD(+)	MVB1215R4 MVB2403R6 TB738 TBK348 TBK354 TB641	4PK1215 6PK2403 207x30 87x25
2.5 TDI quattro	AKE, BAU, BDH	132	09/01 → 12/04	 	VD(+)	MVB1215R4 MVB2403R6 TB738 TBK348 TBK354 TB641	4PK1215 6PK2403 207x30 87x25
3.0	ASN	162	09/01 → 12/04	 		MVB1875R6 TB754	6PK1875 281x30
	BBJ	160	04/01 → 12/04	 		MVB1875R6 TB754	6PK1875 281x30
3.0 quattro	ASN, AVK	162	09/01 → 12/04	 		MVB1875R6 TB754	6PK1875 281x30
	BBJ	160	04/01 → 12/04	 		MVB1875R6 TB754	6PK1875 281x30
S4 quattro	BBK	253	03/03 → 12/04			MVB1110R5	5PK1110

A4 Avant (8ED)

1.6	ALZ	75	11/04 →	 	→03/08, Ch. 8E-5-400001→ →03/08 →03/08	MVB1570R6 TB552 TBK100	6PK1570 138x23
1.8 T	BFB	120	11/04 →	 	→03/08 →03/08 →03/08, → Ch. 8E-6-400000	MVB1570R6 TB554 TBK341	6PK1570 150x23
1.8 T quattro	BFB	120	11/04 →	 	→03/08 →03/08 →03/08	MVB1570R6 TB554 TBK341	6PK1570 150x23
1.9 TDI	BKE, BRB	85	11/04 →	 	→03/08 →03/08 →03/08	MVB1613R6 TB680 TBK270	6PK1613 120x30
2.0	ALT	96	11/04 →	 	→03/08 →03/08 →03/08, → Ch. 8E-6-400000	MVB1570R6 TB554 TBK341	6PK1570 150x23
2.0 TDI	BRD	125	06/06 →	 	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
	BNA, BRF	100	11/04 →	 	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
	BPW	103	11/04 →	 	→03/08 →03/08 →03/08	MVB1613R6 TB680 TBK270	6PK1613 120x30
	BVG	89	09/05 →	 	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
	BVA	120	06/06 →	 	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30
2.0 TDI 16V	BLB, BRE	103	11/04 →	 	→06/08 →06/08 →06/08	MVB1613R6 TB743 TBK262	6PK1613 141x30



kw



AUDI

...AUDI

...A4 Avant (8ED)

2.0 TDI quattro	BPW	103	01/06 →		06/06 →06/08	MVB1613R6	6PK1613
					06/06 →06/08	TB743	141x30
					06/06 →06/08	TBK262	
BRD	125	06/06 →		→06/08	MVB1613R6	6PK1613	
				→06/08	TB743	141x30	
				→06/08	TBK262		
BVA	120	06/06 →		→06/08	MVB1613R6	6PK1613	
				→06/08	TB743	141x30	
				→06/08	TBK262		
2.0 TFSI	BGB, BWE	147	11/04 →		→06/08	MVB1570R6	6PK1570
					→06/08	TB753	148x23
					→06/08	MVB1570R6	6PK1570
BUL	162	06/05 →		→06/08	TB753	148x23	
					→06/08	MVB1570R6	6PK1570
					→06/08	TB753	148x23
2.0 TFSI quattro	BGB, BWE	147	11/04 →		→03/08	MVB1570R6	6PK1570
					→03/08	TB753	148x23
					→03/08	MVB1570R6	6PK1570
BUL	162	06/05 →		→03/08	TB753	148x23	
					→03/08	MVB1570R6	6PK1570
					→03/08	TB753	148x23
2.5 TDI	BCZ, BDG	120	11/04 →		→05/05	MVB1215R4	4PK1215
					→05/05	MVB2403R6	6PK2403
					→05/05	TB738	207x30
					→05/05	TBK348	
					→05/05, VD(+)	TBK354	
2.7 TDI	BPP	132	01/06 →		→03/08, → Ch. 8E-6-252204	MVB2490R6	6PK2490
					→03/08, Ch. 8E-6-252205 →	MVB2460R6	6PK2460
					→03/08	TB760	83x24
					→ Ch. 8E-6-252204	MVB2490R6	6PK2490
					Ch. 8E-6-252205 →	MVB2460R6	6PK2460
3.0	BBJ	160	11/04 → 02/06			MVB1885R6	6PK1885
						TB754	281x30
						MVB1885R6	6PK1885
						TB754	281x30
						MVB2460R6	6PK2460
3.0 quattro	BBJ	160	11/04 → 07/06			TB760	83x24
						MVB2460R6	6PK2460
3.0 TDI quattro	BKN	150	11/04 →		→03/08	MVB2460R6	6PK2460
					→03/08	TB760	83x24
3.2 FSI	AUK	188	01/05 →		→03/08	MVB2460R6	6PK2460
					→03/08	MVB2415R6	6PK2415
3.2 FSI quattro	AUK	188	01/05 →		→03/08	MVB2415R6	6PK2415
RS4 quattro	BNS	309	09/05 →		→08/08	MVB1165R5	5PK1165
S4 quattro	BBK	253	11/04 →			MVB1110R5	5PK1110

A4 Avant (8K5)

3.2 FSI quattro	CALA	195	04/08 →			MVB2403R6	6PK2403
-----------------	------	-----	---------	--	--	------------------	---------

A4 Convertible (8H7, 8HE)

1.8 T	BFB	120	07/02 →		→10/05, → Ch. 8H-4-018000	MVB1570R6	6PK1570
						MVB1588R6	6PK1588
					→ Ch. 8E-6-400000	TB554	150x23
1.8 T quattro	BFB	120	05/03 →		→10/05, → Ch. 8E-4-191000	TBK341	
					→10/05, Ch. 8E-4-191001 →	MVB1588R6	6PK1588
					→10/05	MVB1570R6	6PK1570
2.0	ALT	96	09/04 →		→10/05	TB554	150x23
					→10/05	TBK341	
					→10/05	MVB1588R6	6PK1588
2.0 TDI	BPW	103	10/05 →		→10/05, → Ch. 8H-4-018000	MVB1570R6	6PK1570
					→10/05, Ch. 8H-4-018001 →	MVB1588R6	6PK1588
					→10/05	TB554	150x23
2.0 TDI	BPW	103	10/05 →		→10/05	TBK341	
						MVB1613R6	6PK1613
						TB680	120x30
						TBK270	



kW



...AUDI

...A4 Convertible (8H7, 8HE)

2.0 TFSI 16V	BWE	147	01/06 →			MVB1570R6 TB753	6PK1570 148x23
2.4	BDV	125	04/02 →		→10/05	MVB1855R6	6PK1855
					→10/05	TB556	253x30
				KIT	→10/05	TBK357	
				KIT	→10/05, VD(+)	TBK353	
AMM	120	04/02 →		→10/05	MVB1855R6	6PK1855	
				→10/05	TB556	253x30	
			KIT	→10/05	TBK357		
			KIT	→10/05, VD(+)	TBK353		
2.5 TDI	BCZ, BDG, BFC	120	08/02 →		→10/05	MVB1215R4	4PK1215
					→10/05	MVB2403R6	6PK2403
					→10/05	TB738	207x30
				KIT	→10/05	TBK348	
				KIT	→10/05, VD(+)	TBK354	
2.7 TDI	BPP	132	06/06 →		→ Ch. 8E-6-252204	MVB2490R6	6PK2490
					Ch. 8E-6-252205 →	MVB2460R6	6PK2460
						TB760	83x24
3.0	ASN	162	04/02 →		→10/05	MVB1875R6	6PK1875
3.0 quattro	ASN	162	05/03 →		→10/05	TB754	281x30
					→10/05	MVB1875R6	6PK1875
3.0 TDI quattro	ASB	171	10/05 →		→10/05	TB754	281x30
						MVB2460R6	6PK2460
BKN	150	01/06 →			TB760	83x24	
					MVB2460R6	6PK2460	
3.2 FSI	AUK	188	10/05 →			TB760	83x24
3.2 FSI quattro	AUK	188	10/05 →			MVB2415R6	6PK2415
RS4 quattro	BNS	309	06/06 →			MVB2415R6	6PK2415
S4 quattro	BBK	253	03/04 →		→10/05	MVB1165R5	5PK1165
						MVB1110R5	5PK1110

A5

1.8 TFSI	CABD	125	10/07 →			MVB1588R6	6PK1588
2.7 TDI	CAMA	140	06/07 →		→ Ch. 8T-8-006300	MVB2490R6	6PK2490
3.0 TDI quattro	CAPA	176	06/07 →			MVB2460R6	6PK2460
3.2 FSI	CALA	195	06/07 →			MVB2403R6	6PK2403
3.2 FSI quattro	CALA	195	06/07 →			MVB2403R6	6PK2403
S5 quattro	CAUA	260	06/07 →			MVB1120R5	5PK1120

A6 (4A, C4)

1.8	ADR	92	12/95 → 10/97			MVB855R4	4PK855
						MVB1300R5	5PK1300
					Hydr	TB555	153x25
					Thermo	TB464	152x25.4
				KIT	VD(+)	TBK330	
1.8 quattro	ADR	92	12/95 → 10/97			TBK331	
						SVB12528	12x528
					08/96 → 04/97	MVB855R4	4PK855
					08/96 → 04/97	MVB1300R5	5PK1300
					Hydr, 08/96 → 04/97	TB555	153x25
1.9 TDI	1Z, AHU	66	06/94 → 10/97		08/96 → 04/97	TB464	152x25.4
					Thermo, 08/96 → 04/97	TBK330	
				KIT	08/96 → 04/97	TBK330	
				KIT	08/96 → 04/97, VD(+)	TBK331	
					08/96 → 04/97	SVB12528	12x528
1.9 TDI	1Z, AHU	66	06/94 → 10/97		A/C(-)	MVB890R6	6PK890
					A/C(+)	MVB1173R6	6PK1173
						TB384	137x25.4
				KIT		TBK026	
						SVB10900	10x900



kW



AUDI

...AUDI

...A6 (4A, C4)

2.0	AAE	74	06/94 → 10/97	☼	→07/96	SVB13800	13x800
				⊗	→07/96	MVB855R4	4PK855
				☼	→07/96	TB506	124x18
				☼	→12/94	TBK109	
2.0	ABK	85	06/94 → 10/97	☼	→07/96	SVB13800	13x800
				⊗	→07/96	MVB855R4	4PK855
				☼	→07/96	TB506	124x18
				☼	→12/94	TBK109	
2.0 16V	ACE	103	06/94 → 10/97	☼	→07/96	SVB13800	13x800
				⊗	→07/96	MVB887R4	4PK887
				☼	→07/96	TB505	147x25.4
				☼	→07/96	TBK066	
2.0 16V quattro	ACE	103	06/94 → 10/97	☼	→07/96	SVB13800	13x800
				⊗	→07/96	MVB887R4	4PK887
				☼	→07/96	TB505	147x25.4
				☼	→07/96	TBK066	
2.3	AAR	98	06/94 → 12/95	⊗	A/C(-)	MVB1290R6	6PK1290
				⊗	A/C(+)	MVB1690R6	6PK1690
				☼		TB504	147x19
				☼		TBK285	
2.3 quattro	AAR	98	06/94 → 12/95	⊗	A/C(-), →07/95	MVB1290R6	6PK1290
				⊗	A/C(+), →07/95	MVB1690R6	6PK1690
				☼	→07/95	TB504	147x19
				☼	→07/95	TBK285	
2.5 TDI	AEL	103	08/94 → 10/97	⊗	A/C(-)	MVB1335R6	6PK1335
				⊗	A/C(+)	MVB1725R6	6PK1725
				☼		TB785	122x26.5
				☼		TB374	80x21
2.5 TDI	AAT	85	06/94 → 10/97	⊗	A/C(-)	MVB1335R6	6PK1335
				⊗	A/C(+)	MVB1725R6	6PK1725
				☼		TB785	122x26.5
				☼		TB374	80x21
2.5 TDI	AEL	84	01/95 → 10/97	⊗	A/C(-)	MVB1335R6	6PK1335
				⊗	A/C(+)	MVB1725R6	6PK1725
				☼		TB785	122x26.5
				☼		TB374	80x21
2.5 TDI quattro	AEL	103	10/95 → 10/97	⊗	A/C(-), →04/97	MVB1335R6	6PK1335
				⊗	A/C(+), →04/97	MVB1725R6	6PK1725
				☼	→04/97	TB785	122x26.5
				☼	→04/97	TB374	80x21



kW



...AUDI

...A6 (4A, C4)

2.6	ABC	110	06/94 → 10/97	⊗	A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
				⊗	A/C(-), Ch. 4A-S-020001→	MVB1635R6	6PK1635
				⊗	A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
				⊗	A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
				⊗	A/C(+), 12/95→, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
	ACZ	102	06/94 → 10/97	⊗	A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
				⊗	A/C(-), Ch. 4A-S-020001→	MVB1635R6	6PK1635
				⊗	A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
				⊗	A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
				⊗	A/C(+), 12/95→, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
2.6 quattro	ABC	110	06/94 → 10/97	⊗	A/C(-), →04/97, Ch. 4A-S-020001→	MVB1635R6	6PK1635
				⊗	A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
				⊗	A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
				⊗	A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
				⊗	A/C(+), 12/95→04/97, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
2.8	AAH, AEJ	128	06/94 → 10/97	⊗	A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
				⊗	A/C(-), Ch. 4A-S-020001→	MVB1635R6	6PK1635
				⊗	A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
				⊗	A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
				⊗	A/C(+), 12/95→, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
	ACK	142	12/95 → 10/97	⊗	A/C(-)	MVB1635R6	6PK1635
				⊗	A/C(+), Ch. 4A-T-050001→	MVB1875R6	6PK1875
						TB556	253x30
						TBK357	
2.8 quattro	AAH, AEJ	128	06/94 → 10/97	⊗	A/C(-), →04/97, Ch. 4A-S-020001→	MVB1635R6	6PK1635
				⊗	A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
				⊗	A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
				⊗	A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
				⊗	A/C(+), 12/95→04/97, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
	ACK	142	12/95 → 10/97	⊗	A/C(-), →04/97	MVB1760R6	6PK1760
				⊗	A/C(+), →04/97, Ch. 4A-T-050001→	MVB1875R6	6PK1875
						TB556	253x30
						TBK357	



kw



...AUDI

...A6 (4A, C4)

S6 4.2 quattro	AEC	213	06/94 → 10/97			MVB2613R6	6PK2613
						TB604	299x30
S6 Plus quattro	AHK	240	04/96 → 10/97			MVB2613R6	6PK2613
						TB604	299x30
S6 Turbo quattro	AAN	169	06/94 → 10/97		A/C(-)	MVB1290R6	6PK1290
					A/C(+)	MVB1690R6	6PK1690
						TB333	151x19

A6 (4B, C5)

1.8	AJP, ANQ, AQE, ARH	92	07/97 → 01/05		12/97 → 05/01	MVB855R4	4PK855				
					12/97 → 05/01	MVB1300R5	5PK1300				
					12/97 → 05/01	TB554	150x23				
					12/97 → 05/01	TBK101					
					12/97 → 05/01	SVB12528	12x528				
	AFY	85	05/97 → 01/05		→ 05/00	MVB855R4	4PK855				
					→ 05/00	MVB1300R5	5PK1300				
					Hydr, → 05/00	TB555	153x25				
					Thermo, → 05/00	TB464	152x25.4				
					→ 05/00	TBK330					
					→ 05/00, VD(+)	TBK331					
					→ 05/00	SVB12528	12x528				
				1.8 T	AEB, ANB, APU, ARK, AWL, AWT	110	01/97 → 01/05		Eng. AWT, 05/97 → 07/04	MVB855R4	4PK855
									Eng. AWT, 05/97 → 07/04	MVB1300R5	5PK1300
									06/00 → 07/04	TB554	150x23
	Hydr, 05/97 → 05/01	TB555	153x25								
	Thermo, 05/97 → 05/01	TB464	152x25.4								
					05/97 → 05/01	TBK330					
					05/97 → 05/01, VD(+)	TBK331					
					06/00 → 10/01	TBK115					
					Eng. AWT, 10/01 → 07/04	TBK341					
					05/97 → 05/01	SVB12528	12x528				
	AJL	132	12/97 → 01/05		→ 05/01	MVB855R4	4PK855				
					→ 05/01	MVB1300R5	5PK1300				
					Hydr, → 05/01	TB555	153x25				
					Thermo, → 05/01	TB464	152x25.4				
					→ 05/01	TBK330					
					→ 05/01, VD(+)	TBK331					
					→ 05/01	SVB12528	12x528				
				1.8 T quattro	AEB, ANB, APU, ARK, AWT	110	02/97 → 01/05		Eng. AWT, → 07/04	MVB855R4	4PK855
									Eng. AWT, → 07/04	MVB1300R5	5PK1300
									05/00 → 10/01	TB554	150x23
	Hydr, → 05/01	TB555	153x25								
	Thermo, > 05/01	TB464	152x25.4								
					→ 05/01	TBK330					
					→ 05/01, VD(+)	TBK331					
					05/00 → 10/01	TBK115					
					Eng. AWT, 10/01 → 07/04	TBK341					
					→ 05/01	SVB12528	12x528				
	AJL	132	12/97 → 01/05		→ 05/01	MVB855R4	4PK855				
					→ 05/01	MVB1300R5	5PK1300				
					Hydr, → 05/01	TB555	153x25				
					Thermo, → 05/01	TB464	152x25.4				
					→ 05/01	TBK330					
					→ 05/01, VD(+)	TBK331					
					→ 05/01	SVB12528	12x528				



kW



...AUDI

...A6 (4B, C5)

1.9 TDI	AFN, AVG	81	04/97 → 10/00	 		MVB855R4 4PK855 MVB1590R5 5PK1590 TB384 137x25.4 TBK026
	AJM	85	07/00 → 01/05	 	11/00 → 05/01 11/00 → 05/01 11/00 → 05/01	MVB855R4 4PK855 MVB1432R5 5PK1432 TB680 120x30
	AVF, AWX	96	08/01 → 01/05	 	→ 07/04 → 07/04 → 07/04 → 07/04, → Ch. 4B-2-120000 → 07/04, → Ch. 4B-2-120000, VD(+) → 07/04, Ch. 4B-2-120001 →	MVB855R4 4PK855 MVB1432R5 5PK1432 TB680 120x30 TBK225 TBK269 TBK270
2.0	ALT	96	08/01 → 01/05	 	→ 07/04 → 07/04 → 07/04	MVB1588R6 6PK1588 TB554 150x23 TBK341
	AGA, ALF, AML, APS, ARJ	121	02/97 → 01/05	 	A/C(-), → 07/04 A/C(+), → 07/04 → 07/04 → 07/04 → 07/04, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
	ALW, ARN, ASM	100	07/98 → 01/05	 	A/C(-), → 07/04 A/C(+), → 07/04 → 07/04 → 07/04 → 07/04, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
2.4	APC	115	02/97 → 01/05	 	A/C(-), → 07/04 A/C(+), → 07/04 → 07/04 → 07/04 → 07/04, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
	BDV	125	08/01 → 01/05	 	A/C(-), → 07/04 A/C(+), → 07/04 → 07/04 → 07/04 → 07/04, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
	AJG, AMM, APZ	120	02/97 → 01/05	 	A/C(-), → 07/04 A/C(+), → 07/04 → 07/04 → 07/04 → 07/04, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
2.4 quattro	AGA, ALF, AML, APS, ARJ	121	02/97 → 01/05	 	A/C(-), → 07/04 A/C(+), → 07/04 → 07/04 → 07/04 → 07/04, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
	BDV	125	08/01 → 01/05	 	A/C(-), → 07/04 A/C(+), → 07/04 → 07/04 → 07/04 → 07/04, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
	AJG, APZ	120	02/97 → 01/05	 	A/C(-), → 07/04 A/C(+), → 07/04 → 07/04 → 07/04 → 07/04, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353
2.4 quattro	APC	115	08/98 → 07/99	 	A/C(-) A/C(+) → 07/04 → 07/04, VD(+)	MVB1760R6 6PK1760 MVB1875R6 6PK1875 TB556 253x30 TBK357 TBK353



kw



AUDI

...AUDI

...A6 (4B, C5)

2.5 TDI	AFB, AKN	110	07/97 → 01/05	☼	→05/01	MVB1238R4	4PK1238
				⊖	→05/01	MVB2403R6	6PK2403
				☼	→05/01	TB642	207x32
				☼	→05/01	TBK358	
				☼	→05/01	TB641	87x25
				☼	→05/01	TBK354	
	AKE, BAU, BDH, BND	132	02/00 → 01/05	☼	→07/04	MVB1215R4	4PK1215
				⊖	→07/04	MVB2403R6	6PK2403
				☼	→07/04, → Ch. 4B-Y-050000	TB642	207x32
				☼	→07/04, Ch. 4B-Y-050001→	TB738	207x30
				☼	→07/04, → Ch. 4B-Y-050000	TBK358	
				☼	→07/04, Ch. 4B-Y-050001→	TBK348	
AYM	114	08/01 → 01/05	☼	→07/04	MVB1215R4	4PK1215	
			⊖	→07/04	MVB2403R6	6PK2403	
			☼	→07/04, → Ch. 4B-Y-050000	TB642	207x32	
			☼	→07/04, Ch. 4B-Y-050001→	TB738	207x30	
			☼	→07/04, → Ch. 4B-Y-050000	TBK358		
			☼	→07/04, Ch. 4B-Y-050001→	TBK348		
BCZ, BDG, BFC	120	07/02 → 01/05	☼	→07/04	MVB1215R4	4PK1215	
			⊖	→07/04	MVB2403R6	6PK2403	
			☼	→07/04	TB738	207x30	
			☼	→07/04	TBK348		
			☼	→07/04, VD(+)	TBK354		
			☼	→07/04	TB641	87x25	
2.5 TDI quattro	AFB, AKN	110	07/97 → 01/05	☼	→05/01	MVB1238R4	4PK1238
				⊖	→05/01	MVB2403R6	6PK2403
				☼	→05/01	TB642	207x32
				☼	→05/01	TBK358	
				☼	→05/01	TB641	87x25
				☼	→05/01	TBK354	
	AKE, BAU, BDH	132	02/00 → 01/05	☼	Eng. AKE, →07/04	MVB1238R4	4PK1238
				⊖	Eng. AKE, →07/04	MVB2403R6	6PK2403
				☼	→07/04, → Ch. 4B-Y-050000	TB642	207x32
				☼	→07/04, Ch. 4B-Y-050001→	TB738	207x30
				☼	Eng. AKE, →07/04, → Ch. 4B-Y-050000	TBK358	
				☼	Eng. AKE, →07/04, Ch. 4B-Y-050001→	TBK348	
ARE, BES	184	08/01 → 01/05	☼	Eng. AKE, →07/04, Ch. 4B-Y-050001→, VD(+)	TBK354		
			☼	→07/04	TB641	87x25	
			⊖	A/C(-), →08/00	MVB1740R6	6PK1740	
			⊖	A/C(+), →08/00	MVB1855R6	6PK1855	
			☼	→08/00	TB556	253x30	
			☼	→08/00	TBK357		
2.7 T	AJK	169	02/99 → 01/05	☼	→08/00, VD(+)	TBK353	
				☼	→08/00, VD(+)	TBK353	
				☼	→08/00, VD(+)	TBK353	
				☼	→08/00, VD(+)	TBK353	
				☼	→08/00, VD(+)	TBK353	
				☼	→08/00, VD(+)	TBK353	
	AJK	169	12/97 → 01/05	⊖	A/C(-), →06/02	MVB1740R6	6PK1740
				⊖	A/C(+), →06/02	MVB1855R6	6PK1855
				☼	→06/02	TB556	253x30
				☼	→06/02	TBK357	
				☼	→06/02, VD(+)	TBK353	
				☼	→06/02, VD(+)	TBK353	
AJK	169	12/97 → 01/05	⊖	Eng. BES, A/C(-), →07/04	MVB1740R6	6PK1740	
			⊖	Eng. BES, A/C(+), →07/04	MVB1855R6	6PK1855	
			☼	→07/04	TB556	253x30	
			☼	→07/04	TBK357		
			☼	Eng. BES, →07/04	TBK357		
			☼	Eng. BES, →07/04, VD(+)	TBK353		



kW



...AUDI

...A6 (4B, C5)

2.8	ACK, ALG, AMX, APR, AOD	142	02/97 → 01/05	⊗	Eng. AMX, A/C(-), →05/01	MVB1760R6	6PK1760
				⊗	Eng. AMX, A/C(+), →05/01	MVB1875R6	6PK1875
				⊗	→05/01	TB556	253x30
				⊗	→05/01, VD(+)	TBK353	
AGE		132	10/97 → 07/98	⊗	A/C(-)	MVB1760R6	6PK1760
				⊗	A/C(+)	MVB1875R6	6PK1875
				⊗		TB556	253x30
				⊗		TBK357	
ATX, BBG		140	07/99 → 01/05	⊗	VD(+)	TBK353	
				⊗	A/C(-), →05/01	MVB1760R6	6PK1760
				⊗	A/C(+), →05/01	MVB1875R6	6PK1875
				⊗	→05/01	TB556	253x30
2.8 quattro	ACK, ALG, AMX, APR, AOD	142	02/97 → 01/05	⊗	→05/01	TBK357	
				⊗	→05/01, VD(+)	TBK353	
				⊗	A/C(-), →05/01	MVB1760R6	6PK1760
				⊗	A/C(+), →05/01	MVB1875R6	6PK1875
3.0	ASN	162	08/01 → 01/05	⊗	→07/04	MVB1875R6	6PK1875
				⊗	→07/04	TB754	281x30
				⊗	→07/04	MVB1875R6	6PK1875
				⊗	→07/04	TB754	281x30
4.2 quattro	ARS, ASG, AWN	220	11/98 → 01/05	⊗	04/99 → 07/04	TB556	253x30
				⊗		MVB2680R6	6PK2680
RS6	BCY	331	07/02 → 01/05	⊗		TB556	253x30
				⊗		MVB2680R6	6PK2680
S6 quattro	ANK, AQJ	250	09/99 → 01/05	⊗	→07/04	MVB2680R6	6PK2680
				⊗	→07/04	TB556	253x30

A6 (4F2)

2.0 TDI	BLB, BRE	103	07/04 →	⊗		MVB1613R6	6PK1613
				⊗		TB743	141x30
				⊗		TBK262	
BNA, BRF		100	06/05 →	⊗		MVB1613R6	6PK1613
				⊗		TB743	141x30
				⊗		TBK262	
BVG		89	09/05 →	⊗		MVB1613R6	6PK1613
				⊗		TB743	141x30
				⊗		TBK262	
2.0 TFSI	BPJ, BYK	125	06/05 →	⊗		MVB1570R6	6PK1570
				⊗		TB753	148x23
2.4	BDW	130	05/04 →	⊗		MVB2415R6	6PK2415
				⊗		MVB2415R6	6PK2415
2.4 quattro	BDW	130	01/05 →	⊗		MVB2415R6	6PK2415
				⊗		MVB2415R6	6PK2415
2.7 TDI	BPP	132	11/04 →	⊗		MVB2460R6	6PK2460
				⊗		TB760	83x24
BSG		120	11/04 →	⊗		MVB2460R6	6PK2460
				⊗		TB760	83x24
2.7 TDI quattro	BPP	132	11/04 →	⊗	→ Ch. 4F-5-140000	MVB2460R6	6PK2460
				⊗	Ch. 4F-5-140001→	MVB2490R6	6PK2490
BSG		120	06/05 →	⊗		TB760	83x24
				⊗	→ Ch. 4F-5-140000	MVB2460R6	6PK2460
2.8 FSI	BDX	154	11/06 →	⊗		MVB2490R6	6PK2490
				⊗	Ch. 4F-5-140001→	MVB2490R6	6PK2490
2.8 FSI quattro	BDX	154	06/07 →	⊗		TB760	83x24
				⊗		MVB2415R6	6PK2415
3.0 quattro	BBJ	160	05/04 → 05/06	⊗		MVB1920R6	6PK1920
				⊗	→07/04	MVB1875R6	6PK1875
3.0 TDi	ASB	171	06/06 →	⊗		TB754	281x30
				⊗	AUTO,	MVB2490R6	6PK2490
				⊗	Ch. 4F-6-172454→4F-7-029698	MVB2460R6	6PK2460
				⊗	Ch. 4F-7-029699→	TB760	83x24



kW



...AUDI

...A6 (4F2)

3.0 TDI quattro	BMK	165	05/04 →			Ch. 4F-6-100001→4F-6-172453	MVB2490R6	6PK2490
						Ch. 4F-7-029699→	MVB2460R6	6PK2460
							TB760	83x24
BNG	155	05/04 →			AUTO,	MVB2490R6	6PK2490	
					Ch. 4F-6-172454→4F-7-029698	MVB2460R6	6PK2460	
					MAN, Ch. 4F-6-172454→4F-7-029698			
ASB	171	06/06 →			Ch. 4F-6-100001→4F-6-172453	MVB2490R6	6PK2490	
					Ch. 4F-7-029699→	MVB2460R6	6PK2460	
						TB760	83x24	
3.2 FSI	AUK, BKH	188	05/04 →				MVB2415R6	6PK2415
3.2 FSI quattro	AUK, BKH	188	05/04 →				MVB2415R6	6PK2415
	BYU	183	09/06 →				MVB2415R6	6PK2415
4.2 quattro	BAT	246	05/04 →			→05/06	MVB1100R5	5PK1100
4.2 FSI quattro	BVJ	257	06/06 →				MVB1135R5	5PK1135
S6 quattro	BXA	320	03/06 →				MVB1135R5	5PK1135

A6 Allroad (4FH)

2.7 TDI quattro	BPP	132	05/06 →			→ Ch. 4E-7-029698	MVB2490R6	6PK2490
						Ch. 4E-7-029699→	MVB2460R6	6PK2460
							TB760	83x24
BSG	120	05/06 →			→ Ch. 4E-7-029698	MVB2490R6	6PK2490	
					Ch. 4E-7-029699→	MVB2460R6	6PK2460	
						TB760	83x24	
3.0 TDI quattro	ASB	171	05/06 →			→ Ch. 4E-7-029698	MVB2490R6	6PK2490
						Ch. 4E-7-029699→	MVB2460R6	6PK2460
							TB760	83x24
BNG	155	05/06 →			→ Ch. 4E-7-029698	MVB2490R6	6PK2490	
					Ch. 4E-7-029699→	MVB2460R6	6PK2460	
						TB760	83x24	
3.2 FSI quattro	AUK	188	05/06 →				MVB2415R6	6PK2415
4.2 FSI quattro	BVJ	257	05/06 →				MVB1135R5	5PK1135

A6 Avant (4A, C4)

1.8	ADR	92	12/95 → 12/97			Hydr	MVB855R4	4PK855	
								MVB1300R5	5PK1300
								TB555	153x25
								TB464	152x25.4
								TBK330	
								TBK331	
1.8 quattro	ADR	92	12/95 → 12/97			Thermo	MVB855R4	4PK855	
								MVB1300R5	5PK1300
								TB555	153x25
								TB464	152x25.4
								TBK330	
								TBK331	
1.9 TDI	1Z, AHU	66	06/94 → 12/97			VD(+)	SVB12528	12x528	
								MVB855R4	4PK855
								MVB1300R5	5PK1300
								TB555	153x25
								TB464	152x25.4
								TBK330	
1.9 TDI	1Z, AHU	66	06/94 → 12/97			A/C(-)	MVB890R6	6PK890	
								MVB1173R6	6PK1173
								TB384	137x25.4
								TBK026	
								SVB10900	10x900
1.9 TDI	1Z, AHU	66	06/94 → 12/97			A/C(+)	MVB890R6	6PK890	
								MVB1173R6	6PK1173
								TB384	137x25.4
								TBK026	
								SVB10900	10x900



kW



...AUDI

...A6 Avant (4A, C4)

2.0	AAE	74	06/94 → 12/97	⊗	→07/96	SVB13800	13x800				
				⊗	→07/96	MVB855R4	4PK855				
					→07/96	TB506	124x18				
				KIT	→12/94	TBK109					
				⊗	→07/96	SVB10913	10x913				
				ABK	85	06/94 → 12/97	⊗	→07/96	SVB13800	13x800	
⊗	→07/96	MVB855R4	4PK855								
					→07/96	TB506	124x18				
				KIT		TBK109					
				⊗	→07/96	SVB10913	10x913				
				2.0 16V	ACE	103	06/94 → 12/97	⊗		SVB13800	13x800
⊗		MVB887R4	4PK887								
						TB505	147x25.4				
				KIT		TBK066					
				⊗		SVB10913	10x913				
				2.0 16V quattro	ACE	103	06/94 → 12/97	⊗	→07/96	SVB13800	13x800
⊗	→07/96	MVB887R4	4PK887								
					→07/96	TB505	147x25.4				
				KIT	→07/96	TBK066					
				⊗	→07/96	SVB10913	10x913				
				2.3	AAR	98	06/94 → 12/95	⊗	A/C(-)	MVB1290R6	6PK1290
⊗	A/C(+)	MVB1690R6	6PK1690								
						TB504	147x19				
				KIT		TBK285					
				2.3 quattro	AAR	98	06/94 → 12/95	⊗	A/C(-), →07/95	MVB1290R6	6PK1290
								⊗	A/C(+), →07/95	MVB1690R6	6PK1690
					→07/95	TB504	147x19				
				KIT	→07/95	TBK285					
				2.5 TDI	AEL	103	08/94 → 12/97	⊗	A/C(-)	MVB1335R6	6PK1335
								⊗	A/C(+)	MVB1725R6	6PK1725
						TB785	122x26.5				
						TB374	80x21				
				AAT	84	01/95 → 12/97	⊗	A/C(-)	MVB1335R6	6PK1335	
							⊗	A/C(+)	MVB1725R6	6PK1725	
						TB785	122x26.5				
						TB374	80x21				
				85	06/94 → 12/97	⊗	A/C(-)	MVB1335R6	6PK1335		
						⊗	A/C(+)	MVB1725R6	6PK1725		
						TB785	122x26.5				
						TB374	80x21				
				2.5 TDI quattro	AEL	103	07/95 → 12/97	⊗	A/C(-), →04/97	MVB1335R6	6PK1335
								⊗	A/C(+), →04/97	MVB1725R6	6PK1725
					→04/97	TB785	122x26.5				
					→04/97	TB374	80x21				



kw



...AUDI
...A6 Avant (4A, C4)

AUDI

2.6	ABC	110	06/94 → 12/97		A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
					A/C(-), Ch. 4A-S-020001→	MVB1635R6	6PK1635
					A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
					A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
					A/C(+), 12/95→, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
	ACZ	102	06/94 → 02/97		A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
					A/C(-), Ch. 4A-S-020001→	MVB1635R6	6PK1635
					A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
					A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
					A/C(+), 12/95→, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
2.6 quattro	ABC	110	06/94 → 12/97		A/C(-), →04/97, Ch. 4A-S-020001→	MVB1635R6	6PK1635
					A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
					A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
					A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
					A/C(+), 12/95→04/97, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
2.8	AAH, AEJ	128	06/94 → 12/97		A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
					A/C(-), Ch. 4A-S-020001→	MVB1635R6	6PK1635
					A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
					A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
					A/C(+), 12/95→, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
	ACK	142	12/95 → 12/97		A/C(-)	MVB1635R6	6PK1635
					A/C(+), Ch. 4A-T-050001→	MVB1875R6	6PK1875
						TB556	253x30
						TBK357	
					10/97→, VD(+)	TBK353	
2.8 quattro	AAH, AEJ	128	06/94 → 12/97		A/C(-), →04/97, Ch. 4A-S-020001→	MVB1635R6	6PK1635
					A/C(-), →07/94, → Ch. 4A-S-020000	MVB1675R6	6PK1675
					A/C(+), →07/94, → Ch. 4A-S-020000	MVB1904R6	6PK1904
					A/C(+), →12/95, Ch. 4A-S-020001→4A-T-046054	MVB1865R6	6PK1865
					A/C(+), 12/95→04/97, Ch. 4A-T-046055→	MVB1875R6	6PK1875
						TB373	239x25.4
	ACK	142	12/95 → 12/97		A/C(-), →04/97	MVB1760R6	6PK1760
					A/C(+), →04/97, Ch. 4A-T-050001→	MVB1875R6	6PK1875
						TB556	253x30
						TBK357	
					→04/97		



kW



...AUDI

...A6 Avant (4A, C4)

S6 4.2 quattro	AEC	213	06/94 → 12/97	 		MVB2613R6 TB604	6PK2613 299x30
S6 Plus quattro	AHK	240	04/96 → 12/97	 		MVB2613R6 TB604	6PK2613 299x30
S6 Turbo quattro	AAN	169	06/94 → 12/97	 	A/C(-)	MVB1290R6	6PK1290
					A/C(+)	MVB1690R6	6PK1690
						TB333	151x19

A6 Avant (4B, C5)

1.8	AJP, AQE, ARH	92	12/97 → 01/05		→05/01	MVB855R4	4PK855			
					→05/01	MVB1300R5	5PK1300			
					→05/01	TB554	150x23			
				KIT	→05/01	TBK101				
					→05/01	SVB12528	12x528			
AFY	85	02/98 → 01/05		→05/00	MVB855R4	4PK855				
				→05/00	MVB1300R5	5PK1300				
				Hydr, →05/00	TB555	153x25				
				Thermo, →05/00	TB464	152x25.4				
			KIT	→05/00	TBK330					
			KIT	→05/00, VD(+)	TBK331					
				→05/00	SVB12528	12x528				
1.8 T	AEB, ANB, APU, ARK, AWT	110	12/97 → 01/05		Eng. AWT, →07/04	MVB855R4	4PK855			
					Eng. AWT, →07/04	MVB1300R5	5PK1300			
					06/00→07/04	TB554	150x23			
					Hydr, →05/01	TB555	153x25			
					Thermo, →05/01	TB464	152x25.4			
				KIT	→05/01	TBK330				
				KIT	→05/01, VD(+)	TBK331				
				KIT	06/00→10/01	TBK115				
				KIT	Eng. AWT, 10/01→07/04	TBK341				
					→05/01	SVB12528	12x528			
				AJL	132	04/99 → 01/05		→05/01	MVB855R4	4PK855
								→05/01	MVB1300R5	5PK1300
								Hydr, →05/01	TB555	153x25
	Thermo, →05/01	TB464	152x25.4							
KIT	→05/01	TBK330								
1.8 T quattro	AEB, ANB, APU, ARK, AWT	110	12/97 → 01/05	KIT	→05/01, VD(+)	TBK331				
					→05/01	SVB12528	12x528			
					Eng. AWT, →07/04	MVB855R4	4PK855			
					Eng. AWT, →07/04	MVB1300R5	5PK1300			
					05/00→10/01	TB554	150x23			
					Hydr, →05/01	TB555	153x25			
					Thermo, →05/01	TB464	152x25.4			
				KIT	→05/01	TBK330				
AJL	132	12/97 → 01/05	KIT	→05/01, VD(+)	TBK331					
			KIT	05/00→10/01	TBK115					
			KIT	Eng. AWT, 10/01→07/04	TBK341					
				→05/01	SVB12528	12x528				
				→05/01	MVB855R4	4PK855				
AJL	132	12/97 → 01/05		→05/01	MVB1300R5	5PK1300				
				Hydr, →05/01	TB555	153x25				
				Thermo, →05/01	TB464	152x25.4				
			KIT	→05/01	TBK330					
			KIT	→05/01, VD(+)	TBK331					
				→05/01	SVB12528	12x528				
				→05/01	MVB855R4	4PK855				



kw



...AUDI

...A6 Avant (4B, C5)

AUDI

1.9 TDI	AFN	81	02/98 → 04/01	☼	→10/00	MVB855R4	4PK855
				⊖	→10/00	MVB1590R5	5PK1590
				☼	→10/00	TB384	137x25.4
				☼	→10/00	TBK026	
	AJM	85	07/00 → 01/05	☼	11/00 → 05/01	MVB855R4	4PK855
				⊖	11/00 → 05/01	MVB1432R5	5PK1432
				☼	11/00 → 05/01	TB680	120x30
	AVF, AWX	96	08/01 → 01/05	☼	→07/04	MVB855R4	4PK855
				⊖	→07/04	MVB1432R5	5PK1432
				☼	→07/04	TB680	120x30
				☼	→07/04, → Ch. 4B-2-120000	TBK225	
				☼	→07/04, → Ch. 4B-2-120000, VD(+)	TBK269	
☼				→07/04, Ch. 4B-2-120001 →	TBK270		
2.0	ALT	96	08/01 → 01/05	⊖	→07/04	MVB1588R6	6PK1588
				☼	→07/04	TB554	150x23
				☼	→07/04	TBK341	
2.4	AGA, ALF, AML, APS, ARJ	121	12/97 → 01/05	⊖	A/C(-), →07/04	MVB1760R6	6PK1760
				⊖	A/C(+), →07/04	MVB1875R6	6PK1875
				☼	→07/04	TB556	253x30
				☼	→07/04	TBK357	
				☼	→07/04, VD(+)	TBK353	
				☼			
	ALW, ARN, ASM	100	07/98 → 01/05	⊖	A/C(-), →07/04	MVB1760R6	6PK1760
				⊖	A/C(+), →07/04	MVB1875R6	6PK1875
				☼	→07/04	TB556	253x30
				☼	→07/04	TBK357	
				☼	→07/04, VD(+)	TBK353	
				☼			
	APC	115	12/97 → 01/05	⊖	A/C(-), →07/04	MVB1760R6	6PK1760
				⊖	A/C(+), →07/04	MVB1875R6	6PK1875
				☼	→07/04	TB556	253x30
				☼	→07/04	TBK357	
				☼	→07/04, VD(+)	TBK353	
				☼			
	BDV	125	08/01 → 01/05	⊖	A/C(-), →07/04	MVB1760R6	6PK1760
				⊖	A/C(+), →07/04	MVB1875R6	6PK1875
				☼	→07/04	TB556	253x30
				☼	→07/04	TBK357	
				☼	→07/04, VD(+)	TBK353	
				☼			
AJG, AMM, APZ	120	12/97 → 01/05	⊖	A/C(-), →07/04	MVB1760R6	6PK1760	
			⊖	A/C(+), →07/04	MVB1875R6	6PK1875	
			☼	→07/04	TB556	253x30	
			☼	→07/04	TBK357		
			☼	→07/04, VD(+)	TBK353		
			☼				
2.4 quattro	AGA, ALF, AML, APS, ARJ	121	12/97 → 01/05	⊖	A/C(-), →07/04	MVB1760R6	6PK1760
				⊖	A/C(+), →07/04	MVB1875R6	6PK1875
				☼	→07/04	TB556	253x30
				☼	→07/04	TBK357	
				☼	→07/04, VD(+)	TBK353	
				☼			
	BDV	125	08/01 → 01/05	⊖	A/C(-), →07/04	MVB1760R6	6PK1760
				⊖	A/C(+), →07/04	MVB1875R6	6PK1875
				☼	→07/04	TB556	253x30
				☼	→07/04	TBK357	
				☼	→07/04, VD(+)	TBK353	
				☼			
AJG, APZ	120	12/97 → 01/05	⊖	A/C(-), →07/04	MVB1760R6	6PK1760	
			⊖	A/C(+), →07/04	MVB1875R6	6PK1875	
			☼	→07/04	TB556	253x30	
			☼	→07/04	TBK357		
			☼	→07/04, VD(+)	TBK353		
			☼				
APC	115	08/98 → 05/01	⊖	A/C(-)	MVB1760R6	6PK1760	
			⊖	A/C(+)	MVB1875R6	6PK1875	
			☼		TB556	253x30	
			☼		TBK357		
			☼		TBK353		
			☼	VD(+)	TBK353		



kW



...AUDI

...A6 Avant (4B, C5)

Engine	Code	kW	Period	Accessories	Part Numbers	Dimensions		
2.5 TDI	AFB, AKN	110	12/97 → 01/05	⚙️	→05/01	MVB1238R4	4PK1238	
				⚙️	→05/01	MVB2403R6	6PK2403	
				🌀	→05/01	TB642	207x32	
				🌀KIT	→05/01	TBK358		
				🌀	→05/01	TB641	87x25	
				🌀	→05/01			
	AKE, BAU, BDH	132	02/00 → 01/05	⚙️	→07/04	MVB1215R4	4PK1215	
				⚙️	→07/04	MVB2403R6	6PK2403	
				🌀	→07/04, → Ch. 4B-Y-050000	TB642	207x32	
				🌀	→07/04, Ch. 4B-Y-050001→	TB738	207x30	
				🌀KIT	→07/04, → Ch. 4B-Y-050000	TBK358		
				🌀KIT	→07/04, Ch. 4B-Y-050001→	TBK348		
2.5 TDI quattro	AFB, AKN	110	12/97 → 01/05	⚙️	→05/01	MVB1238R4	4PK1238	
				⚙️	→05/01	MVB2403R6	6PK2403	
				🌀	→05/01	TB642	207x32	
				🌀KIT	→05/01	TBK358		
				🌀	→05/01	TB641	87x25	
				🌀	→05/01			
	AKE, BAU, BDH	132	02/00 → 01/05	⚙️	Eng. AKE, →07/04	MVB1238R4	4PK1238	
				⚙️	Eng. AKE, →07/04	MVB2403R6	6PK2403	
				🌀	→07/04, → Ch. 4B-Y-050000	TB642	207x32	
				🌀	→07/04, Ch. 4B-Y-050001→	TB738	207x30	
				🌀KIT	Eng. AKE, →07/04, → Ch. 4B-Y-050000	TBK358		
				🌀KIT	Eng. AKE, →07/04, Ch. 4B-Y-050001→	TBK348		
2.7 T	AJK	169	02/99 → 01/05	⚙️	A/C(-), →08/00	MVB1740R6	6PK1740	
				⚙️	A/C(+), →08/00	MVB1855R6	6PK1855	
				🌀	→08/00	TB556	253x30	
				🌀KIT	→08/00	TBK357		
				🌀	→08/00, VD(+)	TBK353		
				🌀	→08/00			
	2.7 T quattro	AJK, AZA	169	12/97 → 01/05	⚙️	Eng. AZA, A/C(-), →06/02	MVB1740R6	6PK1740
					⚙️	Eng. AZA, A/C(+), →06/02	MVB1855R6	6PK1855
					🌀	→06/02	TB556	253x30
		ARE, BES	184	08/01 → 01/05	🌀KIT	Eng. AZA, →06/02	TBK357	
					🌀KIT	Eng. AZA, →06/02, VD(+)	TBK353	
					⚙️	Eng. BES, A/C(-), →07/04	MVB1740R6	6PK1740
2.7 T quattro	AJK, AZA	169	12/97 → 01/05	⚙️	Eng. BES, A/C(+), →07/04	MVB1855R6	6PK1855	
				🌀	→07/04	TB556	253x30	
				🌀KIT	Eng. BES, →07/04	TBK357		
	ARE, BES	184	08/01 → 01/05	🌀KIT	Eng. BES, →07/04, VD(+)	TBK353		
				🌀				
				🌀				



kW



AUDI

...AUDI

...A6 Avant (4B, C5)

2.8	ACK, ALG, AMX, APR, AOD	142	12/97 → 01/05	⊗	Eng. ACK, A/C(-), →12/98	MVB1635R6	6PK1635			
				⊗	Eng. ACK, A/C(+), →12/98, Ch. 4A-T-050001→	MVB1875R6	6PK1875			
				⊗	Eng. AMX, A/C(-), →05/01	MVB1760R6	6PK1760			
				⊗	Eng. AMX, A/C(+), →05/01	MVB1875R6	6PK1875			
				⊗	→05/01	TB556	253x30			
				⊗	→05/01, VD(+)	TBK353				
				⊗	Eng. AMX, →05/01	TBK357				
				AGE	132	12/97 → 07/98	⊗	A/C(-)	MVB1760R6	6PK1760
				⊗	A/C(+)	MVB1875R6	6PK1875			
				⊗		TB556	253x30			
				⊗		TBK357				
				⊗		TBK353				
				ATX	140	07/99 → 01/05	⊗	A/C(-), →05/01	MVB1760R6	6PK1760
				⊗	A/C(+), →05/01	MVB1875R6	6PK1875			
				⊗	→05/01	TB556	253x30			
⊗	→05/01	TBK357								
⊗	→05/01, VD(+)	TBK353								
2.8 quattro	ACK, ALG, AMX, APR, AOD	142	12/97 → 01/05	⊗	A/C(-), →05/01	MVB1760R6	6PK1760			
				⊗	A/C(+), →05/01	MVB1875R6	6PK1875			
				⊗	→05/01	TB556	253x30			
3.0	ASN	162	08/01 → 01/05	⊗	→07/04	MVB1875R6	6PK1875			
				⊗	08/04→	MVB1920R6	6PK1920			
				⊗		TB754	281x30			
3.0 quattro	ASN	162	08/01 → 01/05	⊗	→07/04	MVB1875R6	6PK1875			
				⊗	→07/04	TB754	281x30			
4.2 quattro	ARS, ASG, AWN	220	11/98 → 01/05	⊗	04/99→07/04	TB556	253x30			
RS6	BCY	331	07/02 → 01/05	⊗		MVB2680R6	6PK2680			
				⊗		TB556	253x30			
RS6 plus	BRV	353	04/04 → 01/05	⊗		MVB2680R6	6PK2680			
				⊗		TB556	253x30			
S6 quattro	ANK, AQJ	250	09/99 → 01/05	⊗	→07/04	MVB2680R6	6PK2680			
				⊗	→07/04	TB556	253x30			

A6 Avant (4F5)

2.0 TDI	BLB, BRE	103	06/05 →	⊗		MVB1613R6	6PK1613
				⊗		TB743	141x30
				⊗		TBK262	
	BNA, BRF	100	06/05 →	⊗		MVB1613R6	6PK1613
				⊗		TB743	141x30
				⊗		TBK262	
	BVG	89	09/05 →	⊗		MVB1613R6	6PK1613
				⊗		TB743	141x30
				⊗		TBK262	
2.0 TFSI	BPJ	125	06/05 →	⊗		MVB1570R6	6PK1570
				⊗		TB753	148x23
2.4	BDW	130	03/05 →	⊗		MVB2415R6	6PK2415
2.4 quattro	BDW	130	03/05 →	⊗		MVB2415R6	6PK2415
2.7 TDI	BSG	120	03/05 →	⊗		MVB2460R6	6PK2460
				⊗		TB760	83x24
				⊗		MVB2460R6	6PK2460
2.7 TDI quattro	BPP	132	03/05 →	⊗		TB760	83x24
				⊗	→ Ch. 4F-5-140000	MVB2460R6	6PK2460
				⊗	Ch. 4F-5-140001→	MVB2490R6	6PK2490
	BSG	120	06/05 →	⊗	→ Ch. 4F-5-140000	MVB2460R6	6PK2460
				⊗	Ch. 4F-5-140001→	MVB2490R6	6PK2490
				⊗		TB760	83x24
2.8 FSI	BDX	154	11/06 →	⊗		MVB2415R6	6PK2415
2.8 FSI quattro	BDX	154	06/07 →	⊗		MVB2415R6	6PK2415





kW



AUDI

...AUDI

...A6 Avant (4F5)

3.0 quattro	BBJ	160	03/05 → 05/06			MVB1920R6 TB754	6PK1920 281x30
3.0 TDi	ASB	171	06/06 →		AUTO, Ch. 4F-6-172454→4F-7-029698	MVB2490R6	6PK2490
					MAN, Ch. 4F-6-172454→4F-7-029698	MVB2460R6	6PK2460
3.0 TDi quattro	BMK	165	03/05 →		→ Ch. 4F-6-100000	MVB2460R6	6PK2460
					AUTO, Ch. 4F-6-172454→4F-7-029698	MVB2490R6	6PK2490
	BNG	155	03/05 →		→ Ch. 4F-6-100000	MVB2460R6	6PK2460
					AUTO, Ch. 4F-6-172454→4F-7-029698	MVB2490R6	6PK2490
ASB	171	06/06 →		→ Ch. 4F-6-100000	MVB2460R6	6PK2460	
				AUTO, Ch. 4F-6-172454→4F-7-029698	MVB2490R6	6PK2490	
3.2 FSI	AUK	188	03/05 →			MVB2415R6	6PK2415
3.2 FSI quattro	AUK	188	03/05 →			MVB2415R6	6PK2415
4.2 quattro	BAT	246	03/05 →		→05/06	MVB1100R5	5PK1100
4.2 FSI quattro	BVJ	257	06/06 →			MVB1135R5	5PK1135
S6 quattro	BXA	320	03/06 →			MVB1135R5	5PK1135

A8 (4D2, 4D8)

2.5 TDi	AFB, AKN	110	01/97 → 04/00		06/97 →	MVB1238R4	4PK1238	
						06/97 →	MVB2403R6	6PK2403
						06/97 →	TB642	207x32
						06/97 →	TBK358	
						06/97 →	TB641	87x25
AKE	132	09/00 → 09/02			MVB1238R4	4PK1238		
						MVB2403R6	6PK2403	
						TB738	207x30	
						TBK348		
					VD(+)	TBK354		
2.5 TDi quattro	AFB, AKN	110	07/97 → 04/00		11/97 →	MVB1238R4	4PK1238	
						11/97 →	MVB2403R6	6PK2403
						11/97 →	TB642	207x32
						11/97 →	TBK358	
						11/97 →	TB641	87x25
AKE	132	09/00 → 09/02			MVB1238R4	4PK1238		
						MVB2403R6	6PK2403	
						TB738	207x30	
						TBK348		
					VD(+)	TBK354		
					TB641	87x25		



kw



AUDI

...AUDI

...A8 (4D2, 4D8)

2.8	AAH	128	03/94 → 03/96	①	A/C(-), →09/94, → Ch. 4D-S-000496	MVB1675R6	6PK1675
				②	A/C(-), 01/95→, Ch. 4D-S-004301→	MVB1760R6	6PK1760
				③	A/C(-), 09/94→01/95, Ch. 4D-S-000496→4D-S-004300	MVB1635R6	6PK1635
				④	A/C(+), →09/94, → Ch. 4D-S-000495	MVB1904R6	6PK1904
				⑤	A/C(+), 01/95→, Ch. 4D-S-004301→	MVB1875R6	6PK1875
				⑥	A/C(+), 09/94→01/95, Ch. 4D-S-000496→4D-S-004300	MVB1865R6	6PK1865
						TB373	239x25.4
ACK, ALG, AMX, APR, AQD		142	04/96 → 09/02	①	A/C(-)	MVB1760R6	6PK1760
				②	A/C(+)	MVB1875R6	6PK1875
						TB556	253x30
				KIT		TBK357	
				KIT	VD(+)	TBK353	
AEJ		120	07/95 → 03/96	①	A/C(-), Ch. 4D-S-004301→	MVB1760R6	6PK1760
				②	A/C(+), Ch. 4D-S-004301→	MVB1875R6	6PK1875
						TB373	239x25.4
2.8 quattro	AAH	128	03/94 → 03/96	①	A/C(-), 01/95→, Ch. 4D-S-004301→	MVB1760R6	6PK1760
				②	A/C(-), 09/94→01/95, Ch. 4D-S-000496→4D-S-004300	MVB1635R6	6PK1635
				③	A/C(-), 09/94→09/94, → Ch. 4D-S-000496	MVB1675R6	6PK1675
				④	A/C(+), 01/95→, Ch. 4D-S-004301→	MVB1875R6	6PK1875
				⑤	A/C(+), 09/94→01/95, Ch. 4D-S-000496→4D-S-004300	MVB1865R6	6PK1865
				⑥	A/C(+), 09/94→09/94, → Ch. 4D-S-000495	MVB1904R6	6PK1904
					09/94→	TB373	239x25.4
				⑦	A/C(-)	MVB1760R6	6PK1760
				⑧	A/C(+)	MVB1875R6	6PK1875
						TB556	253x30
				KIT		TBK357	
				KIT	VD(+)	TBK353	
AEJ		120	07/95 → 03/96	①	A/C(-), Ch. 4D-S-004301→	MVB1760R6	6PK1760
				②	A/C(+), Ch. 4D-S-004301→	MVB1875R6	6PK1875
						TB373	239x25.4
3.3 TDI quattro	AKF	165	06/00 → 09/02	①		MVB2613R6	6PK2613
3.7	AEW	169	07/95 → 12/98	①		MVB2680R6	6PK2680
						TB604	299x30
	AKC, AQG	191	11/98 → 09/02			TB556	253x30
3.7 quattro	AEW, AKJ	169	07/95 → 11/98	①		MVB2680R6	6PK2680
						TB604	299x30
	AKC, AQG	191	11/98 → 09/02			TB556	253x30
4.2 quattro	ABZ, AKG	220	03/94 → 11/98	①		MVB2680R6	6PK2680
						TB604	299x30
				②		MVB2680R6	6PK2680
	AEM	180	03/94 → 07/96			TB604	299x30
	AQF, AUW, AUX	228	11/98 → 09/02			TB556	253x30
	ARU	175	02/99 → 04/00			TB556	253x30
S 8 quattro	AHC, AKH	250	07/96 → 06/99	①		MVB2680R6	6PK2680
						TB604	299x30
				②		MVB2680R6	6PK2680
	AQH, AVP	265	06/99 → 09/02			TB556	253x30



kW



...AUDI

A8 (4E_)

2.8 FSI	BDX	154	08/07 →			MVB2460R6	6PK2460
3.0	ASN	162	08/03 →		→07/05	MVB1930R6	6PK1930
					→07/05	TB754	281x30
	BBJ	160	07/03 →		→07/05	MVB1930R6	6PK1930
					→07/05	TB754	281x30
3.0 TDI quattro	ASB	171	08/03 →		02/04 →, Ch. 4E-6-020001 → 4E-7-003342	MVB2490R6	6PK2490
					02/04 →, Ch. 4E-7-003343 →	MVB2460R6	6PK2460
					02/04 →	TB760	83x24
	BNG	155	11/03 →		Ch. 4E-6-020001 → 4E-7-003342	MVB2490R6	6PK2490
					Ch. 4E-7-003343 →	MVB2460R6	6PK2460
						TB760	83x24
3.2 FSI	BPK	191	06/05 →			MVB2460R6	6PK2460
3.2 FSI quattro	BPK	191	06/05 →			MVB2460R6	6PK2460
3.7 quattro	BFL	206	10/02 →		→05/06	TB556	253x30
4.0 TDI quattro	ASE	202	03/03 →		→07/05	MVB1625R6	6PK1625
					→07/05	TB759	83x30
4.2 quattro	BFM	246	10/02 →		→05/06	TB556	253x30
4.2 FSI quattro	BVJ	257	06/06 →			MVB1135R5	5PK1135
						TB556	253x30
4.2 TDI quattro	BVN	240	07/05 →			TB759	83x30
S8 quattro	BSM	331	06/06 →			MVB1135R5	5PK1135

ALLROAD (4BH)

2.5 TDI quattro	AKE, BAU	132	05/00 → 08/05			MVB1238R4	4PK1238
						MVB2403R6	6PK2403
						TB738	207x30
						TBK348	
					VD(+)	TBK354	
						TB641	87x25
	BCZ	120	05/03 → 08/05			MVB1238R4	4PK1238
						MVB2403R6	6PK2403
						TB738	207x30
						TBK348	
					VD(+)	TBK354	
						TB641	87x25
2.7 T quattro	ARE, BES	184	05/00 → 08/05		A/C(-)	MVB1740R6	6PK1740
					A/C(+)	MVB1855R6	6PK1855
						TB556	253x30
						TBK357	
					VD(+)	TBK353	
4.2 V8 quattro	BAS	220	07/02 → 08/05		04/03 →	MVB1110R5	5PK1110

CABRIOLET (8G7, B4)

1.8	ADR	92	01/97 → 08/00			MVB855R4	4PK855
						MVB1300R5	5PK1300
					Hydr	TB555	153x25
					Thermo	TB464	152x25.4
						TBK330	
					VD(+)	TBK331	
						SVB12528	12x528
1.9 TDI	1Z, AHU	66	06/95 → 08/00		A/C(-)	MVB890R6	6PK890
					A/C(+)	MVB1173R6	6PK1173
						TB384	137x25.4
						TBK026	
						SVB10900	10x900
2.0 16V	ACE	103	06/95 → 07/96			SVB13800	13x800
						MVB887R4	4PK887
						TB505	147x25.4
						SVB10875	10x875

AUDI



kw



AUDI

...AUDI

...CABRIOLET (8G7, B4)

2.0 E	ABK	85	01/93 → 07/98	 	→12/94	SVB13800 13x800 MVB855R4 4PK855 TB506 124x18 TBK109 SVB10913 10x913
2.3 E	NG	98	05/91 → 07/94	 	→ Ch. 8BN015000 Ch. 8BN015001→	SVB13925 13x925 SVB12865 12x865 SVB10875 10x875 TB504 147x19 TBK285 SVB131000 13x1000
2.6	ABC	110	06/93 → 08/00	 	A/C(-), →09/94, → Ch. 8G-S-003000 A/C(-), 10/94→, Ch. 8G-S-003001→ A/C(+), →10/93, → Ch. 8G-R-003280 A/C(+), 10/93→09/94, Ch. 8G-R-003281→8G-S-003000 A/C(+), 10/94→, Ch. 8G-S-003001→	MVB1675R6 6PK1675 MVB1635R6 6PK1635 MVB2265R6 6PK2265 MVB1904R6 6PK1904 MVB1865R6 6PK1865
2.8	AAH	128	11/92 → 08/00	 	A/C(-), →09/94, → Ch. 8G-S-003000 A/C(-), 10/94→, Ch. 8G-S-003001→ A/C(+), →10/93, → Ch. 8G-R-003280 A/C(+), 10/93→09/94, Ch. 8G-R-003281→8G-S-003000 A/C(+), 10/94→, Ch. 8G-S-003001→	MVB1675R6 6PK1675 MVB1635R6 6PK1635 MVB2265R6 6PK2265 MVB1904R6 6PK1904 MVB1865R6 6PK1865

COUPE (81, 85)

1.6	YN	55	07/80 → 08/81	 		SVB10940 10x940 TB108 121x18 TBK016
1.8	DD	55	08/81 → 07/83	 	→07/82 →07/82 →07/82	SVB10940 10x940 TB108 121x18 TBK016
1.8 GT	SF	65	04/86 → 10/88	 	→ Ch. 85-E-220000 Ch. 85-F-000001→	SVB10940 10x940 SVB10950 10x950 TB108 121x18 TBK016 SVB10800 10x800 SVB10760 10x760
	DS, JV	66	09/82 → 10/88	 	→ Ch. 85-E-220000 Ch. 85-F-000001→	SVB10940 10x940 SVB10950 10x950 TB108 121x18 TBK016 SVB10800 10x800 SVB10760 10x760
	PV	79	08/86 → 10/87	 	→ Ch. 85-E-220000 Ch. 85-F-000001→	SVB10940 10x940 SVB10950 10x950 TB108 121x18 TBK016 SVB10800 10x800 SVB10760 10x760



kW



...AUDI

...COUPE (81, 85)

AUDI

Model	Engine Code	Power (kW)	Year Range	Timing Belt	Notes	Part Numbers	Dimensions
...1.8 GT	DZ	82	08/86 → 10/88	⑦	→ Ch. 85-E-220000	SVB10940	10x940
				⑦	Ch. 85-F-000001→	SVB10950	10x950
	JN	68	01/85 → 07/88	⑦	→ Ch. 85-E-220000	SVB10940	10x940
				⑦	Ch. 85-F-000001→	SVB10950	10x950
1.8 GT quattro	DS, JN, NE	66	09/85 → 10/88	⑦	→ Ch. 85-E-170000	SVB10800	10x800
				⑦	Ch. 85-E-170001→	SVB10760	10x760
	DZ	82	12/84 → 10/88	⑦	→ Ch. 85-E-220000	SVB10940	10x940
				⑦	Ch. 85-F-000001→	SVB10950	10x950
1.9	WN	85	08/80 → 07/83	⊛	A/C(-), → Ch. 85F090000	SVB131000	13x1000
				⑦	A/C(-), Ch. 85F090001→	SVB10800	10x800
				⑦	A/C(+)	SVB10825	10x825
				⑦	→ Ch. 85D250000	SVB10850	10x850
2.0	HP, JS	85	09/83 → 07/86	⑦	→ Ch. 85E000001→	TB602	113x19
				⑦	Ch. 85E000001→	TB207	120x18
				⑦	Ch. 85E000001→	TBK048	
				⊛	Eng. HP	SVB131000	13x1000
2.0	SK	83	03/86 → 04/88	⑦	A/C(-), → Ch. 85F090000	SVB10800	10x800
				⑦	A/C(-), Ch. 85F090001→	SVB10825	10x825
				⑦	A/C(+)	SVB10850	10x850
				⑦	→ Ch. 85D250000	TB602	113x19
2.1 GT	KE, KL	96	09/82 → 08/84	⑦	→ Ch. 85E000001→	TB207	120x18
				⑦	Ch. 85E000001→	TBK048	
				⊛	Eng. HP	SVB131000	13x1000
				⑦	A/C(-), → Ch. 85F090000	SVB10800	10x800
2.1 GT	WE	79	01/81 → 07/83	⑦	A/C(-), Ch. 85F090001→	SVB10825	10x825
				⑦	A/C(+)	SVB10850	10x850
				⑦	→ Ch. 85D250000	TB602	113x19
				⑦	Ch. 85E000001→	TB207	120x18
2.1 GT	WE	79	01/81 → 07/83	⑦	Ch. 85E000001→	TBK048	
				⊛	Eng. HP	SVB131000	13x1000
				⑦	A/C(-), → Ch. 85F090000	SVB10800	10x800
				⑦	A/C(-), Ch. 85F090001→	SVB10825	10x825
2.1 GT	WE	79	01/81 → 07/83	⑦	A/C(+)	SVB10850	10x850
				⑦	→ Ch. 85D250000	TB602	113x19
				⑦	Ch. 85E000001→	TB207	120x18
				⑦	Ch. 85E000001→	TBK048	



kw



...AUDI

...COUPE (81, 85)

AUDI

2.2 quattro	KV	100	10/84 → 10/88	⊗	08/86→	SVB131000	13x1000			
				⊗	A/C(-), 08/86→, → Ch. 85F090000	SVB10800	10x800			
				⊗	A/C(-), 08/86→, Ch. 85F090001→	SVB10825	10x825			
				⊗	A/C(+), 08/86→	SVB10850	10x850			
					08/86→, → Ch. 85D250000	TB602	113x19			
					08/86→, Ch. 85E000001→	TB207	120x18			
					08/86→, Ch. 85E000001→	TBK048				
				JT	88	08/85 → 10/88	⊗	08/86→	SVB131000	13x1000
				⊗	A/C(-), 08/86→, → Ch. 85F090000	SVB10800	10x800			
				⊗	A/C(-), 08/86→, Ch. 85F090001→	SVB10825	10x825			
⊗	A/C(+), 08/86→	SVB10850	10x850							
	08/86→	TB207	120x18							
	08/86→	TBK048								
2.2 GT	KX	85	07/81 → 10/87	⊗	08/84→	SVB131000	13x1000			
				⊗	A/C(-), 08/84→, → Ch. 85F090000	SVB10800	10x800			
				⊗	A/C(-), 08/84→, Ch. 85F090001→	SVB10825	10x825			
				⊗	A/C(+), 08/84→	SVB10850	10x850			
					08/84→, → Ch. 85D250000	TB602	113x19			
					08/84→, Ch. 85E000001→	TB207	120x18			
					08/84→, Ch. 85E000001→	TBK048				
				KV	100	09/84 → 10/88	⊗	08/88→	SVB13925	13x925
				⊗	08/88→, → Ch. 8BN015000	SVB12865	12x865			
				⊗	08/88→, Ch. 8BN015001→	SVB10875	10x875			
⊗	A/C(-), → Ch. 85F090000	SVB10800	10x800							
⊗	A/C(-), Ch. 85F090001→	SVB10825	10x825							
⊗	A/C(+)	SVB10850	10x850							
	→ Ch. 85D250000	TB602	113x19							
	08/88→, → Ch. 8BM033000	TB318	142x19							
	08/88→, Ch. 8BM033001→	TB504	147x19							
	Ch. 85E000001→	TB207	120x18							
	08/88→, Ch. 8BM033001→	TBK285								
	Ch. 85E000001→	TBK048								
		SVB131000	13x1000							
2.3	NG	100	01/87 → 10/88	⊗		SVB13925	13x925			
				⊗	→ Ch. 8BN015000	SVB12865	12x865			
				⊗	Ch. 8BN015001→	SVB10875	10x875			
					→ Ch. 8BM033000	TB318	142x19			
					Ch. 8BM033001→	TB504	147x19			
					Ch. 8BM033001→	TBK285				
						SVB131000	13x1000			
				2.3 quattro	NG	100	01/87 → 10/88	⊗		SVB13925
⊗	→ Ch. 8BN015000	SVB12865	12x865							
⊗	Ch. 8BN015001→	SVB10875	10x875							
	→ Ch. 8BM033000	TB318	142x19							
	Ch. 8BM033001→	TB504	147x19							
	Ch. 8BM033001→	TBK285								
		SVB131000	13x1000							
1.8	DZ	82	08/89 → 07/91					⊗		SVB13800
				⊗		SVB10950	10x950			
						TB108	121x18			
						TBK016				
						SVB10850	10x850			

COUPE (89, 8B)

1.8	DZ	82	08/89 → 07/91	⊗		SVB13800	13x800
				⊗		SVB10950	10x950
						TB108	121x18
						TBK016	
						SVB10850	10x850



kW



...AUDI

...COUPE (89, 8B)

2.0	AAD, ABK	85	05/89 → 12/96	⊗	→06/96	SVB13800	13x800				
				⊗	08/91 → 06/96	MVB855R4	4PK855				
				⊗	Eng. AAD, →07/91	SVB10950	10x950				
				⊗	→07/91	TB108	121x18				
				⊗	08/90 → 06/96	TB506	124x18				
				⊗ KIT	→07/91	TBK016					
				⊗ KIT	08/90 → 06/96	TBK109					
				⊗	08/91 → 06/96	SVB10913	10x913				
				⊗	Eng. AAD, →07/91	SVB10850	10x850				
				3A		82	03/90 → 07/90	⊗		SVB13800	13x800
⊗		SVB10950	10x950								
⊗		TB108	121x18								
⊗ KIT		TBK016									
⊗		SVB10850	10x850								
83	05/89 → 03/90	⊗						SVB13800	13x800		
		⊗						SVB10950	10x950		
		⊗						TB108	121x18		
		⊗ KIT						TBK016			
		⊗						SVB10850	10x850		
		⊗		SVB13800	13x800						
2.0 16 V	ACE	103	08/92 → 12/96	⊗	→06/96	SVB13800	13x800				
				⊗	→06/96	MVB887R4	4PK887				
				⊗	→06/96	TB505	147x25.4				
				⊗ KIT	→06/96	TBK066					
				⊗	→06/96	SVB10875	10x875				
				6A	101	01/92 → 07/92	⊗		SVB13800	13x800	
							⊗		MVB887R4	4PK887	
							⊗		TB505	147x25.4	
							⊗ KIT	→ Eng Nr 017139	TBK066		
							⊗		SVB10875	10x875	
2.0 20 V	NM	118	08/89 → 07/91	⊗	08/90 →	SVB13925	13x925				
				⊗	08/90 →	SVB12865	12x865				
				⊗	08/90 →	TB504	147x19				
				⊗	08/90 →	SVB131000	13x1000				
2.0 20 V quattro	NM	118	08/89 → 07/91	⊗		SVB13925	13x925				
				⊗		SVB12865	12x865				
				⊗		TB504	147x19				
				⊗		SVB131000	13x1000				
2.2 quattro	KV	100	11/88 → 07/91	⊗		SVB13925	13x925				
				⊗	→ Ch. 8BN015000	SVB12865	12x865				
				⊗	Ch. 8BN015001 →	SVB10875	10x875				
				⊗	→ Ch. 8BM033000	TB318	142x19				
				⊗	Ch. 8BM033001 →	TB504	147x19				
				⊗ KIT	Ch. 8BM033001 →	TBK285					
				⊗		SVB131000	13x1000				
				2.3	NG	100	10/88 → 07/94	⊗		SVB13925	13x925
								⊗	→ Ch. 8BN015000	SVB12865	12x865
								⊗	Ch. 8BN015001 →	SVB10875	10x875
⊗	→ Ch. 8BM033000	TB318	142x19								
⊗	Ch. 8BM033001 →	TB504	147x19								
⊗ KIT	Ch. 8BM033001 →	TBK285									
⊗		SVB131000	13x1000								
98	03/90 → 12/96	⊗	→07/94					SVB13925	13x925		
		⊗	→07/94, → Ch. 8BN015000					SVB12865	12x865		
		⊗	→07/94, Ch. 8BN015001 →					SVB10875	10x875		
		⊗	→07/94, → Ch. 8BM033000	TB318	142x19						
		⊗	→07/94, Ch. 8BM033001 →	TB504	147x19						
		⊗ KIT	→07/94, Ch. 8BM033001 →	TBK285							
		⊗	→07/94	SVB131000	13x1000						



kw



AUDI

...AUDI

...COUPE (89, 8B)

2.3 quattro	NG	100	11/88 → 12/92	☼		SVB13925	13x925	
				⊖	→ Ch. 8BN015000	SVB12865	12x865	
				⊖	Ch. 8BN015001→	SVB10875	10x875	
				⊖	→ Ch. 8BM033000	TB318	142x19	
				⊖	Ch. 8BM033001→	TB504	147x19	
	98	05/90 → 12/96	⊖	☼	→07/94	SVB131000	13x1000	
					→07/94, → Ch. 8BN015000	SVB13925	13x925	
					→07/94, Ch. 8BN015001→	SVB12865	12x865	
					→07/94, → Ch. 8BM033000	SVB10875	10x875	
					→07/94, Ch. 8BM033001→	TB318	142x19	
	2.3 20V	7A	123	08/90 → 07/91	⊖	→07/94, Ch. 8BM033001→	TB504	147x19
					⊖	→07/94, Ch. 8BM033001→	TBK285	
					⊖	→07/94	SVB131000	13x1000
					⊖	→07/94	SVB13925	13x925
					⊖	→07/94, → Ch. 8BN015000	SVB12865	12x865
2.3 20V quattro	7A	125	08/89 → 07/91	⊖	→07/94, Ch. 8BM033001→	SVB10875	10x875	
				⊖	→07/94, Ch. 8BM033001→	TB318	142x19	
				⊖	→07/94, Ch. 8BM033001→	TB504	147x19	
				⊖	→07/94, Ch. 8BM033001→	TBK285		
				⊖	→07/94	SVB131000	13x1000	
2.3 20V quattro	7A	125	11/88 → 07/91	☼		SVB13925	13x925	
				⊖		SVB12865	12x865	
				⊖		TB504	147x19	
				⊖		SVB131000	13x1000	
				⊖		SVB13925	13x925	
2.6	ABC	110	08/92 → 12/96	⊖	A/C(-), →05/96	MVB1675R6	6PK1675	
				⊖	A/C(+), →04/93,	MVB2265R6	6PK2265	
				⊖	→ Ch. 8B-R-001635			
				⊖	A/C(+), 03/95→05/96,	MVB1865R6	6PK1865	
				⊖	Ch. 8B-S-002001→			
2.6 quattro	ABC	110	08/92 → 12/96	⊖	A/C(+), 04/93→03/95,	MVB1904R6	6PK1904	
				⊖	Ch. 8B-R-001636→8B-S-002000			
				⊖	→05/96	TB373	239x25.4	
				⊖	A/C(-), →04/95	MVB1675R6	6PK1675	
				⊖	A/C(+), →04/93,	MVB2265R6	6PK2265	
2.8	AAH	128	09/91 → 12/96	⊖	→ Ch. 8B-R-001635			
				⊖	A/C(+), 03/95→05/96,	MVB1865R6	6PK1865	
				⊖	Ch. 8B-S-002001→			
				⊖	A/C(+), 04/93→03/95,	MVB1904R6	6PK1904	
				⊖	Ch. 8B-R-001636→8B-S-002000			
2.8 quattro	AAH	128	08/91 → 12/96	⊖	→04/95	TB373	239x25.4	
				⊖	A/C(-), →05/96	MVB1675R6	6PK1675	
				⊖	A/C(+), →04/93,	MVB2265R6	6PK2265	
				⊖	→ Ch. 8B-R-001635			
				⊖	A/C(+), 03/95→05/96,	MVB1865R6	6PK1865	
2.8 quattro	AAH	128	08/91 → 12/96	⊖	Ch. 8B-S-002001→			
				⊖	A/C(+), 04/93→03/95,	MVB1904R6	6PK1904	
				⊖	Ch. 8B-R-001636→8B-S-002000			
				⊖	→05/96	TB373	239x25.4	
				⊖	A/C(-)	MVB1675R6	6PK1675	
2.8 quattro	AAH	128	08/91 → 12/96	⊖	A/C(+), →04/93,	MVB2265R6	6PK2265	
				⊖	→ Ch. 8B-R-001635			
				⊖	A/C(+), 03/95→,	MVB1865R6	6PK1865	
				⊖	Ch. 8B-S-002001→			
				⊖	A/C(+), 04/93→03/95,	MVB1904R6	6PK1904	
				⊖	Ch. 8B-R-001636→8B-S-002000			
				⊖		TB373	239x25.4	



kW



...AUDI

...COUPE (89, 8B)

S2 quattro	3B	162	09/90 → 09/92	 	SVB13925 13x925 SVB12865 12x865 TB504 147x19 SVB131000 13x1000
	ABY	169	10/92 → 12/96	 	SVB13925 13x925 MVB887R4 4PK887 TB333 151x19 SVB131025 13x1025

Q7

3.0 TDI	BUG	171	03/06 →	 	MVB2490R6 6PK2490 TB760 83x24
	BUN	155	03/06 →	 	MVB2490R6 6PK2490 TB760 83x24
	CASA	176	11/07 →		MVB2490R6 6PK2490
4.2 FSI	BAR	257	03/06 →		MVB1110R5 5PK1110

QUATTRO (85)

2.1 20V Turbo	KW	225	05/84 → 07/87	 	SVB13950 13x950 TB504 147x19 SVB131000 13x1000
		147	07/80 → 07/87	 	SVB13950 13x950 TB504 147x19 SVB131000 13x1000
2.2 quattro		89	12/84 → 07/87	 	SVB131000 13x1000 SVB10800 10x800 SVB10825 10x825 SVB10850 10x850 TB207 120x18 TBK048
		100	12/84 → 07/87	 	SVB131000 13x1000 SVB10800 10x800 SVB10825 10x825 SVB10850 10x850 TB602 113x19 TB207 120x18 TBK048
2.2 20V	RR	162	08/89 → 07/91	 	SVB13950 13x950 SVB131000 13x1000 TB504 147x19
2.2 Turbo	1B, MB	147	08/87 → 07/89		SVB13950 13x950 SVB12825 12x825 TB318 142x19 SVB131000 13x1000
				 	Eng. MB Eng. MB

TT (8J3)

2.0 TFSI	BWA	147	10/06 →		A/C(-)	MVB955R6 6PK955
				 	A/C(+)	MVB1050R6 6PK1050 TB753 148x23
3.2 V6 quattro	BUB	184	10/06 →			MVB1625R6 6PK1625



kw



...AUDI

TT (8N3)

1.8 T	AJQ, APP, ARY, ATC, AUQ, AWP	132	10/98 →		A/C(-), →01/07	MVB1125R6	6PK1125
					A/C(+), →01/07	MVB1200R6D	6DPK1200
					→01/07	TB554	150x23
					→01/07, → Ch. 8N-Y-095000	TBK101	
AUM		110	09/02 →		A/C(-), →01/07	MVB1125R6	6PK1125
					A/C(+), →01/07	MVB1200R6D	6DPK1200
					→01/07	TB554	150x23
					→01/07, → Ch. 8N-Y-095000	TBK101	
BVP		120	09/05 →		A/C(-), →01/07	MVB1125R6	6PK1125
					A/C(+), →01/07	MVB1200R6D	6DPK1200
					→01/07	TB554	150x23
					→01/07, Ch. 8N-Y-095001→	TBK101	
BVR		140	09/05 →		A/C(-), →01/07	MVB1125R6	6PK1125
					A/C(+), →01/07	MVB1200R6D	6DPK1200
					→01/07	TB554	150x23
					→01/07	TBK101	
1.8 T quattro	AJQ, ARY, ATC, AWP	132	10/98 →		A/C(-), →01/07	MVB1125R6	6PK1125
					A/C(+), →01/07	MVB1200R6D	6DPK1200
					→01/07	TB554	150x23
					→01/07, → Ch. 8N-Y-095000	TBK101	
AMU, APX, BAM		165	10/98 →		A/C(-), →01/07	MVB1125R6	6PK1125
					A/C(+), →01/07	MVB1200R6D	6DPK1200
					→01/07	TB554	150x23
					→01/07, → Ch. 8N-Y-095000	TBK101	
BFV		176	03/05 →		A/C(-), →01/07	MVB1125R6	6PK1125
					A/C(+), →01/07	MVB1200R6D	6DPK1200
					→01/07	TB554	150x23
					→01/07, Ch. 8N-Y-095001→	TBK101	
BVR		140	09/05 →		A/C(-), →01/07	MVB1125R6	6PK1125
					A/C(+), →01/07	MVB1200R6D	6DPK1200
					→01/07	TB554	150x23
					→01/07	TBK101	
3.2 VR6 quattro	BHE, BPF	184	07/03 →		→01/07	MVB1325R6D	6DPK1325
TT Roadster (8J9)							
2.0 TFSI	BWA	147	02/07 →		A/C(-)	MVB955R6	6PK955
					A/C(+)	MVB1050R6	6PK1050
						TB753	148x23
3.2 V6 quattro	BUB	184	02/07 →			MVB1625R6	6PK1625



kW



...AUDI

TT Roadster (8N9)

1.8 T	AJQ, APP, ATC, AUQ, AWP	132	10/99 →	⊗	A/C(-), →01/07	MVB1125R6	6PK1125
				⊗	A/C(+), →01/07	MVB1200R6D	6DPK1200
				⊗	→01/07	TB554	150x23
				⊗	→01/07, → Ch. 8N-Y-095000	TBK101	
AUM		110	01/01 →	⊗	A/C(-), →01/07	MVB1125R6	6PK1125
				⊗	A/C(+), →01/07	MVB1200R6D	6DPK1200
				⊗	→01/07	TB554	150x23
				⊗	→01/07, → Ch. 8N-Y-095000	TBK101	
BVR		140	09/05 →	⊗	A/C(-), →01/07	MVB1125R6	6PK1125
				⊗	A/C(+), →01/07	MVB1200R6D	6DPK1200
				⊗	→01/07	TB554	150x23
				⊗	→01/07	TBK115	
BVP		120	09/05 →	⊗	A/C(-), →01/07	MVB1125R6	6PK1125
				⊗	A/C(+), →01/07	MVB1200R6D	6DPK1200
				⊗	→01/07	TB554	150x23
				⊗	→01/07	TBK115	
1.8 T quattro	AJQ, ARY, ATC, AWP	132	02/00 →	⊗	A/C(-), →01/07	MVB1125R6	6PK1125
				⊗	A/C(+), →01/07	MVB1200R6D	6DPK1200
				⊗	→01/07	TB554	150x23
				⊗	→01/07, → Ch. 8N-Y-095000	TBK101	
AMU, APX, BAM		165	10/99 →	⊗	A/C(-), →01/07	MVB1125R6	6PK1125
				⊗	A/C(+), →01/07	MVB1200R6D	6DPK1200
				⊗	→01/07	TB554	150x23
				⊗	→01/07, → Ch. 8N-Y-095000	TBK101	
BVR		140	09/05 →	⊗	A/C(-), →01/07	MVB1125R6	6PK1125
				⊗	A/C(+), →01/07	MVB1200R6D	6DPK1200
				⊗	→01/07	TB554	150x23
				⊗	→01/07	TBK115	
3.2 VR6 quattro	BHE, BPF	184	07/03 →	⊗	→01/07	MVB1325R6D	6DPK1325

V8 (44_, 4C_)

3.6 quattro	PT	180	04/93 → 02/94	⊗	Ch. 4C-N-000001 →	MVB2475R6	6PK2475	
			184	10/88 → 02/94	⊗	08/91 →, Ch. 4C-N-000001 →	TB604	299x30
					⊗	AUTO, →07/91, → Ch. 4C-M-020000	MVB2475R6	6PK2475
4.2 quattro	ABH	206	10/91 → 02/94	⊗		MVB2460R6	6PK2460	
				⊗		TB604	299x30	
				⊗		MVB2475R6	6PK2475	
				⊗		TB604	299x30	

AUSTIN

MAESTRO (XC)

1.3	12 H, 12 H999AA, 12 HC32	46	03/83 → 08/85	⊗		SVB10775	10x775
				⊗		SVB10875	10x875
1.3 LS	12 H	49	03/83 → 08/90	⊗		SVB10775	10x775
				⊗		SVB10875	10x875
1.6	16 H956AK	59	03/83 → 10/84	⊗		SVB10940	10x940
				⊗		TB204	110x17
				⊗		TBK059	
1.6 Mayfair HLS	16 HC37	61	03/83 → 08/90	⊗		SVB10710	10x710
				⊗		MVB825R4	4PK825
				⊗		MVB960R4	4PK960
				⊗	→12/85	SVB10940	10x940
				⊗		TB204	110x17
				⊗		TBK059	
				⊗		SVB10710	10x710



kw



AUSTIN

...AUSTIN

...MAESTRO (XC)

1.6 MG	16 HA03AL	72	03/83 → 08/85	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		MVB825R4 MVB960R4 TB204 TBK059 SVB10710	4PK825 4PK960 110x17 10x710
	16 HA35AL	73	03/83 → 08/90	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		MVB825R4 MVB960R4 TB204 TBK059 SVB10710	4PK825 4PK960 110x17 10x710
2.0 EFI	20 HA50AA, 20 HC51AA, 20 HC81	83	10/84 → 08/90	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	01/86 →	MVB887R4	4PK887
					Eng. 20HC5, →12/85	SVB10950	10x950
					→12/85	TB124	104x17
					01/86 →	TB218	104x17
					01/86 →	SVB10750	10x750
			Eng. 20HC5, →12/85	SVB10700	10x700		

METRO

1.0		30	10/80 → 04/90	⊗ ⊗	→09/84 →09/84	SVB10825 SVB10840	10x825 10x840
	99 H	33	10/80 → 04/90	⊗ ⊗	→09/84 →09/84	SVB10825 SVB10840	10x825 10x840
1.0 Surf HLE	99 HA65P	35	10/80 → 04/90	⊗ ⊗		SVB10825	10x825
						SVB10840	10x840
1.3	12 HA83AA	51	10/80 → 04/90	⊗ ⊗	10/84 →	SVB10825	10x825
					10/84 →	SVB10840	10x840
	12 H996AA	52	10/80 → 12/85	⊗ ⊗	10/84 → 10/84 →	SVB10825 SVB10840	10x825 10x840
	12 HL	46	10/80 → 12/83	⊗		SVB10825	10x825
1.3 L,HLE,S	12 H	44	10/80 → 04/90	⊗ ⊗		SVB10825	10x825
						10/84 →	SVB10840
1.3 Surf (XF)	12 HC21AA	44	11/85 → 04/90	⊗ ⊗		SVB10825	10x825
						SVB10840	10x840
1.3 Turbo	12 HA85AA	66	10/83 → 04/90	⊗ ⊗	10/84 →	SVB10825	10x825
					10/84 →	SVB10840	10x840

MINI MK I

1.3		53	09/69 → 09/80	⊗ ⊗		SVB10813	10x813				
						SVB10840	10x840				
850	BMC Serie A	25	01/67 → 08/79	⊗ ⊗	AUTO	SVB10813	10x813				
					MAN	SVB10840	10x840				
1000		26	10/67 → 09/84	⊗ ⊗ ⊗ ⊗	AUTO, 09/69 →	SVB10813	10x813				
					MAN, 09/69 →	SVB10840	10x840				
					99 H	29	10/67 → 09/84	⊗ ⊗	09/69 →	SVB10813	10x813
								⊗	MAN, 09/69 →	SVB10840	10x840
1000 Mayfair	99 H997P, 99 HA53P, 99 HC20P	31	08/82 → 06/93	⊗ ⊗ ⊗	→09/84	SVB10825	10x825				
					AUTO, →07/90	SVB10813	10x813				
					MAN, →07/90	SVB10840	10x840				
1000 Mayfair Sport	99 HD81	30	09/88 → 06/93	⊗ ⊗ ⊗	AUTO, →07/90	SVB10813	10x813				
					MAN, →07/90	SVB10840	10x840				
1100 Special	10 H	33	01/76 → 08/81	⊗ ⊗	→09/80	SVB10825	10x825				
					→09/80	SVB10840	10x840				
1275 GT		39	10/69 → 08/80	⊗		SVB10813	10x813				

MONTEGO (XE)

1.3		50	10/84 → 08/88	⊗		SVB10875	10x875
1.6 LS,HL	16 HC37	61	04/84 → 08/88	⊗ ⊗ ⊗ ⊗		MVB825R4	4PK825
						TB204	110x17
						TBK059	
						SVB10710	10x710



kW



...AUSTIN

...MONTEGO (XE)

2.0	20 H, 20 HSC	74	04/84 → 08/88		→01/86	SVB10950	10x950
					01/86→	MVB887R4	4PK887
					→01/86	TB124	104x17
					01/86→	TB218	104x17
					→01/86	SVB10700	10x700
					01/86→	SVB10750	10x750
2.0 Mayfair	20 H(EFI)	83	04/84 → 08/88		→01/86	SVB10950	10x950
					01/86→	MVB887R4	4PK887
					→01/86	TB124	104x17
					01/86→	TB218	104x17
					→01/86	SVB10700	10x700
					01/86→	SVB10750	10x750
2.0 Turbo	20 HC85	110	04/84 → 08/88		→01/86	SVB10950	10x950
					01/86→	MVB887R4	4PK887
					→01/86	TB124	104x17
					01/86→	TB218	104x17
					→01/86	SVB10700	10x700
					01/86→	SVB10750	10x750

MONTEGO Estate (XE)

1.6 LS	16 HC37	61	10/84 → 08/88			MVB825R4	4PK825
						TB204	110x17
						TBK059	
						SVB10710	10x710
2.0	20 H, 20 HSC	74	10/84 → 08/91		→01/86	SVB10950	10x950
					01/86→	MVB887R4	4PK887
					07/91→	MVB887R5	5PK887
					→01/86	TB124	104x17
					01/86→	TB218	104x17
					→01/86	SVB10700	10x700
					01/86→	SVB10750	10x750
2.0 HLI	20 H	83	10/84 → 08/88		→01/86	SVB10950	10x950
					01/86→	MVB887R4	4PK887
					→01/86	TB124	104x17
					01/86→	TB218	104x17
					→01/86	SVB10700	10x700
					01/86→	SVB10750	10x750

AUTOBIANCHI

A 112

0.9	A112A 5.000	32	10/69 → 12/72		Eng Nr 017213→084490	SVB10825	10x825
					Eng Nr 084491→204358	SVB10790	10x790
					Eng Nr 204359→	SVB10813	10x813
		33	01/76 → 12/78		Eng Nr 017213→084490	SVB10825	10x825
					Eng Nr 084491→204358	SVB10790	10x790
					Eng Nr 204359→	SVB10813	10x813
0.9 E		34	01/73 → 12/77		Eng Nr 017213→084490	SVB10825	10x825
					Eng Nr 084491→204358	SVB10790	10x790
					Eng Nr 204359→	SVB10813	10x813
0.9 Junior	A112A 5.000, A112B2.000	31	07/75 → 12/85		→08/85, Eng Nr 017213→084490	SVB10825	10x825
					→08/85, Eng Nr 084491→204358	SVB10790	10x790
					→08/85, Eng Nr 204359→	SVB10813	10x813
1.0 Abarth	A112A1.000	43	09/71 → 12/75			SVB10790	10x790
						SVB10813	10x813
						SVB10825	10x825
	A112A2.000	51	01/74 → 12/84		03/75→	SVB10800	10x800
1.0 E,Elite,LX	A112B1.000	35	11/77 → 12/85		→08/85	SVB10790	10x790
					→08/85	SVB10813	10x813



kw



AUTOBIANCHI

...AUTOBIANCHI

Y10

1.0	156A2.000	33	03/85 →		→12/92	SVB10675	10x675
					→12/92	TB129	104x15
					→12/92	TBK006	
	156A.000	41	03/85 →		→09/87	SVB101000	10x1000
					→09/87	TB121	117x15
1.0 4WD	156A3.000	37	12/86 →		→12/92	SVB10675	10x675
					→12/92	TB129	104x15
					→12/92	TBK006	
1.0 CAT	156A2.246	33	10/87 →		→12/92	MVB675R3	3PK675
					→12/92	TB129	104x15
					→12/92	TBK006	
1.0 Turbo	156A1.000	63	03/85 →		→06/89	SVB101000	10x1000
					→06/89	TB248	118x15
1.1	156C.000	42	06/89 →		A/C(-), 01/92→05/96	MVB673R4	4PK673
					A/C(+), 01/92→05/96	MVB683R3	3PK683
					V-belt pulley (+), →12/92	SVB10675	10x675
					V-ribbed belt pulley (+), →12/92	MVB675R3	3PK675
					→05/96	TB129	104x15
					→05/96	TBK006	
1.1 4WD	156C.000	42	06/89 →		→09/94	MVB675R3	3PK675
					→09/94	TB129	104x15
					→09/94	TBK006	
1.1 i.e. CAT	156C.046	42	09/90 →		A/C(-), 01/92→05/96	MVB673R4	4PK673
					A/C(+), 01/92→05/96	MVB683R3	3PK683
					V-belt pulley (+), →12/92	SVB10675	10x675
					V-ribbed belt pulley (+), →12/92	MVB675R3	3PK675
					→05/96	TB129	104x15
					→05/96	TBK006	
1.3 i.e. GT	156B.000	57	06/89 →		→12/92	SVB101000	10x1000
					→12/92	TB247	120x15
	146A5.046	54	06/89 →		→12/92	SVB101000	10x1000
					→12/92	TB247	120x15

BEDFORD

MIDI Box

1.8	4ZB1	63	09/84 → 05/88			SVB10760	10x760
					→12/85	SVB13950	13x950
					01/86 →	SVB13900	13x900
						SVB13875	13x875
						TB209	111x19
						SVB131025	13x1025
2.0	20PET	62	06/88 → 08/92			SVB13900	13x900
						TB209	111x19
2.0 4WD	20PET	62	06/88 → 08/92			SVB13900	13x900
						TB209	111x19

MIDI Bus

1.8	4ZB1	63	09/84 → 05/88			SVB10760	10x760
					→12/85	SVB13950	13x950
					01/86 →	SVB13900	13x900
						SVB13875	13x875
						TB209	111x19
						SVB131025	13x1025

RASCAL Box

1.0	FA10A	34	07/86 → 06/90			SVB10750	10x750
						TB171	88x19



kW



...BEDFORD

RASCAL Bus

1.0	FA10A	34	07/86 → 06/90			SVB10750	10x750
						TB171	88x19

BMW

1 (E81, E87)

116i	N45B16A	85	09/04 →		A/C(-)	MVB1642R6	6PK1642
					A/C(+)	MVB1875R6	6PK1875
118d	M47N204D4	90	09/04 →		A/C(-), →02/07	MVB1685R6	6PK1685
					A/C(+), →02/07	MVB1833R6	6PK1833
118i	N42B20B	95	09/04 →		A/C(-), PS	MVB1795R6	6PK1795
					A/C(-), PS elec(+)	MVB1550R6	6PK1550
					A/C(+), PS	MVB1817R6D	6DPK1817
					A/C(+), PS elec(+)	MVB1698R6D	6DPK1698
120d	M47N204D4, N47D20A	120	09/04 →		Eng. M47N204D4, A/C(-), →02/07	MVB1685R6	6PK1685
					Eng. M47N204D4, A/C(+), →02/07	MVB1833R6	6PK1833
120i	N42B20A	110	09/04 →		A/C(-), PS elec(-)	MVB1795R6	6PK1795
					A/C(-), PS elec(+)	MVB1550R6	6PK1550
					A/C(+), PS elec(-)	MVB1817R6D	6DPK1817
					A/C(+), PS elec(+)	MVB1698R6D	6DPK1698
123d	N47D20B	150	10/07 →		A/C(+), RHA (-)	MVB1103R7	7PK1103
					A/C(-), PS elec(-)	MVB1817R6D	6DPK1817
130i	N52B30A	195	09/05 →		A/C(+), PS elec(+)	MVB1698R6D	6DPK1698
					03/07 →	MVB1995R6	6PK1995
						MVB1833R6	6PK1833

1 Convertible (E88)

118i	N43B20A	105	03/08 →		A/C(+)	MVB1103R7	7PK1103
120d	N47D20A	130	03/08 →		A/C(-), PS elec(-)	MVB1795R6	6PK1795
					A/C(-), PS elec(+)	MVB1550R6	6PK1550
					A/C(+), PS elec(-)	MVB1817R6D	6DPK1817
					A/C(+), PS elec(+)	MVB1698R6D	6DPK1698
120i	N43B20A	125	03/08 →		A/C(+), RHA (-)	MVB1103R7	7PK1103
135i	N54B30A	225	03/08 →			MVB1855R7	7PK1855

1 Coupe (E82)

120d	N47D20A	130	10/07 →		A/C(-), PS elec(-), 03/08 →	MVB1795R6	6PK1795
					A/C(-), PS elec(+), 03/08 →	MVB1550R6	6PK1550
					A/C(+), PS elec(-), 03/08 →	MVB1817R6D	6DPK1817
					A/C(+), PS elec(+), 03/08 →	MVB1698R6D	6DPK1698
123d	N47D20B	150	10/07 →		A/C(+), PS elec(-)	MVB1817R6D	6DPK1817
					A/C(+), PS elec(+)	MVB1698R6D	6DPK1698
135i	N54B30A	225	10/07 →			MVB1855R7	7PK1855

3 (E21)

315	M 10 B 16 (1B2)	55	03/81 → 03/84			SVB10875	10x875
316	M 10 B 16	66	08/75 → 08/80			SVB13825	13x825
					AUTO	SVB10850	10x850
					MAN	SVB10875	10x875
						SVB10825	10x825
						SVB13825	13x825
					AUTO	SVB10850	10x850
	M 10 B 18 (2B4)	66	09/80 → 08/82		MAN	SVB10875	10x875
					SVB10825	10x825	
					SVB10825	10x825	



kw



...BMW

...3 (E21)

318	M 10 B 18 (32/32 DIDTA)	72	08/75 → 08/80	☼		SVB13825	13x825
				⊗	AUTO	SVB10850	10x850
				⊗	MAN	SVB10875	10x875
				⊗		SVB10825	10x825
318 i	M 10 B 18 (K-Jetronic)	77	11/79 → 08/82	☼		SVB13825	13x825
				⊗	AUTO	SVB10950	10x950
				⊗	MAN	SVB10975	10x975
				⊗		SVB10865	10x865
320	M 10 B 20 (DIDTA 32/32)	80	08/75 → 08/77	☼		SVB13825	13x825
				⊗	AUTO	SVB10850	10x850
				⊗	MAN	SVB10875	10x875
				⊗		SVB10825	10x825
320 i	M 10 B 20 (K-Jetronic)	92	06/75 → 08/82	☼		SVB13825	13x825
				⊗	AUTO	SVB10850	10x850
				⊗	MAN	SVB10875	10x875
				⊗		SVB10825	10x825
320/6	M 20 B 20	90	09/77 → 08/82	⊗		SVB10950	10x950
					For OE No.: 1713361, 1711081	TB241	127x25.4
					For OE No.: 1717215	TB343	110x25.4
					For OE No.: 12655244, 12655253	TB567	111x25.4
					For OE No.: 12723842, 12861684	TB138	128x25.4
						TBK337	
323 i	M 20 B 23 (K-Jetronic)	105	01/78 → 08/82	⊗		SVB10825	10x825
						SVB10950	10x950
						TB138	128x25.4
						TB241	127x25.4
						TB343	110x25.4
						TB567	111x25.4
		TBK337					
		SVB10825	10x825				

3 (E30)

315	M 10 B 16 (1B2)	55	09/82 → 10/83	⊗		SVB10875	10x875
316	M 10 B 18 (2B4)	66	09/82 → 12/87	☼		SVB13800	13x800
				⊗	→06/83	SVB10940	10x940
				⊗	→09/83	SVB10950	10x950
				⊗	09/83 →	SVB10875	10x875
				⊗	→09/83	SVB10900	10x900
				⊗	09/83 →	SVB10813	10x813
316 (Ecotronic)	M 10 B 18 (2BE)	66	09/83 → 12/90	☼	→07/88	SVB13800	13x800
				⊗	→07/88	SVB10875	10x875
				⊗	→07/88	SVB10813	10x813
				⊗			
316 i	M 40 B 16 (Kat.)	73	09/87 → 06/91	⊗	05/88 → 08/90	SVB10875	10x875
					05/88 → 08/90	TB242	110x21
					05/88 → 08/90	TBK074	
	M 40 B 16	75	07/88 → 06/91	⊗	05/88 → 08/90	SVB10813	10x813
				⊗	→08/90	SVB10875	10x875
					→08/90	TB242	110x21
	→08/90	TBK074					
	→08/90	SVB10813	10x813				
316 i 1.8	M 10 B 18 (L-Jetronic, Kat.)	75	08/87 → 08/88	☼		SVB13800	13x800
				⊗		SVB10875	10x875
				⊗		SVB10813	10x813



kW



...BMW

...3 (E30)

318 i	M 10 B 18 (L-Jetronic), M 10 B 18 (L-Jetronic, Kat.)	75	12/84 → 08/88	⊗		SVB10875	10x875	
	M 10 B 18 (K-Jetronic)	77	09/82 → 08/87	⊗	→09/83	SVB10950	10x950	
				⊗	09/83→	SVB10875	10x875	
	M 40 B 18	85	09/87 → 06/91	⊗	→11/90	SVB101010	10x1010	
				⊗	→11/90	TB242	110x21	
				⊗	→11/90	TBK074		
				⊗	→09/88	SVB10813	10x813	
				⊗	09/88→11/90	SVB10800	10x800	
	M 40 B 18 (Kat.)	83	09/87 → 06/91	⊗	→11/90	SVB101010	10x1010	
				⊗	→11/90	TB242	110x21	
			⊗	→11/90	TBK074			
			⊗	→09/88	SVB10813	10x813		
			⊗	09/88→11/90	SVB10800	10x800		
318 is	M 42 B 18	100	09/89 → 08/91	⊗	→08/90	SVB13900	13x900	
				⊗	→08/90	SVB101025	10x1025	
				⊗	→08/90	SVB10800	10x800	
320 i	M 20 B 20 (L-Jetronic), M 20 B 20 (Motronic, Kat.)	95	12/85 → 06/91	⊗	→08/90	SVB13800	13x800	
				⊗	→08/90	SVB10960	10x960	
				⊗	→08/90	TB241	127x25.4	
				⊗	→08/90	TBK337		
				⊗	→08/90	SVB10825	10x825	
	M 20 B 20 (L-Jetronic)	92	09/82 → 12/85	⊗	→06/83	SVB13825	13x825	
				⊗	06/83→	SVB13800	13x800	
				⊗	→06/83	SVB10950	10x950	
				⊗	06/83→	SVB10960	10x960	
				⊗	→08/85	TB138	128x25.4	
			⊗	09/85→	TB241	127x25.4		
			⊗	09/85→	TBK337			
			⊗		SVB10825	10x825		
		110	12/85 → 06/90	⊗		SVB13800	13x800	
				⊗		SVB10960	10x960	
				⊗		TB241	127x25.4	
				⊗		TBK337		
				⊗		SVB10825	10x825	
320 is	S14204EA	141	05/88 → 12/90	⊗	→08/90	SVB13800	13x800	
				⊗	→08/90	SVB10865	10x865	
				⊗	→08/90	SVB10813	10x813	
323 i	M 20 B 23 (L-Jetronic)	102	09/82 → 08/83	⊗		SVB10950	10x950	
				⊗	06/83→	SVB10960	10x960	
				⊗		TB138	128x25.4	
				⊗		TB241	127x25.4	
				⊗		TBK337		
				⊗		SVB10825	10x825	
			110	09/83 → 08/86	⊗		SVB10960	10x960
					⊗	→12/85	TB138	128x25.4
					⊗	01/86→	TB241	127x25.4
					⊗		TBK337	
				⊗		SVB10825	10x825	
324 d	M 21 D 24 W	63	09/85 → 08/91	⊗	→12/88	SVB13800	13x800	
				⊗	01/89→08/90	SVB13825	13x825	
				⊗	→08/90	SVB101000	10x1000	
				⊗	→08/90	TB344	138x28.5	
				⊗	→08/90	TBK061		
				⊗	→08/90	SVB10865	10x865	
324 td	M 21 D 24, M 21 D 24 WA	85	09/87 → 08/91	⊗	→12/88	SVB13800	13x800	
				⊗	01/89→08/90	SVB13825	13x825	
				⊗	Eng. M21246TB, →08/90	SVB101000	10x1000	
				⊗	→08/90	TB344	138x28.5	
				⊗	→08/90	TBK061		
				⊗	Eng. M21246TB, →08/90	SVB10865	10x865	



kW



...BMW

...3 (E30)

BMW

325 e 2.7	M 20 B 27 (Kat.)	90	10/83 → 12/88	⊗	→10/87	SVB13800	13x800
				⊗	→10/87	SVB10960	10x960
				⊗	→10/87,	TB138	128x25.4
				⊗	For OE No.: 11311272424		
				⊗	→10/87,	TB241	127x25.4
				⊗	For OE No.: 11311711153		
				⊗	→10/87	TBK337	
				⊗	→10/87	SVB10825	10x825
	M 20 B 27	95	01/85 → 08/87	⊗		SVB13800	13x800
						⊗	
				⊗	For OE No.: 11311272424	TB138	128x25.4
				⊗	For OE No.: 11311711153	TB241	127x25.4
				⊗		TBK337	
				⊗		SVB10825	10x825
325 i	M 20 B 25 (Kat.)	125	12/86 → 06/91	⊗	→08/90	SVB13800	13x800
				⊗	→08/90	SVB10960	10x960
				⊗	→08/90	TB241	127x25.4
				⊗	→08/90	TBK337	
				⊗	→08/90	SVB10825	10x825
	M 20 B 25	126	09/83 → 11/89	⊗	05/85→	SVB13800	13x800
						⊗	05/85→
				⊗	05/85→	TB241	127x25.4
				⊗	05/85→	TBK337	
				⊗	05/85→	SVB10825	10x825
325 i X	M 20 B 25 (Kat.)	125	12/86 → 08/91	⊗	→08/90	SVB13800	13x800
				⊗	→08/90	SVB10960	10x960
				⊗	→08/90	TB241	127x25.4
				⊗	→08/90	TBK337	
				⊗	→08/90	SVB10825	10x825
	M 20 B 25	126	03/86 → 12/87	⊗		SVB13800	13x800
						⊗	
				⊗		TB241	127x25.4
				⊗		TBK337	
				⊗		SVB10825	10x825
M3 2.3	S 14 B 23	143	07/86 → 06/91	⊗		SVB13800	13x800
				⊗		SVB10865	10x865
		147	02/87 → 05/89	⊗		SVB10813	10x813
				⊗		SVB13800	13x800
		158	06/89 → 06/91	⊗		SVB10865	10x865
				⊗		SVB10813	10x813
				⊗		SVB13800	13x800
				⊗		SVB10865	10x865
				⊗		SVB10813	10x813
M3 EVO I 2.3	S 14 B 23 (EVO I)	162	10/88 → 10/90	⊗		SVB13800	13x800
				⊗		SVB10865	10x865
				⊗		SVB10813	10x813
M3 EVO II 2.5	S 14 B 25 (EVO II)	175	01/90 → 01/92	⊗		SVB13800	13x800
				⊗		SVB10865	10x865
				⊗		SVB10813	10x813



kW



...BMW

3 (E36)

316 i	M 40 B 16 (Kat.)	73	09/90 → 09/93	 KIT		MVB855R4 4PK855 SVB101025 10x1025 TB242 110x21 TBK108 SVB10725 10x725
	M 43 B 16	75	07/93 → 02/98	 →07/94 →07/94 →09/95 09/95→ →07/94 KIT →07/94 →07/94		MVB887R4 4PK887 MVB855R4 4PK855 SVB101025 10x1025 MVB1660R6 6PK1660 MVB1740R6 6PK1740 TB242 110x21 TBK108 SVB10725 10x725
	M 40 B 16	75	09/90 → 09/93	 KIT		MVB855R4 4PK855 SVB101025 10x1025 TB242 110x21 TBK108 SVB10725 10x725
318 i	M 40 B 18 (Kat.)	83	12/90 → 10/93	 KIT		MVB855R4 4PK855 SVB101025 10x1025 TB242 110x21 TBK108 SVB10725 10x725
	M 43 B 18	85	10/93 → 02/98	 →09/95 09/95→		MVB887R4 4PK887 MVB1660R6 6PK1660 MVB1740R6 6PK1740
318 is	M 42 B 18	103	03/93 → 09/97	→03/94 03/94→08/96 →09/93 09/93→09/95 09/95→08/96 →09/93		MVB855R4 4PK855 MVB887R4 4PK887 SVB101025 10x1025 MVB1660R6 6PK1660 MVB1740R6 6PK1740 SVB10725 10x725
	M 44 B 19	103	09/95 → 02/98	 		MVB887R4 4PK887 MVB1740R6 6PK1740
318 tds	M 41 D 18 (Inter.)	66	01/95 → 02/98	 		MVB835R4 4PK835 MVB1885R5 5PK1885
320 i	M 50 B (20 6 S1), M 50 B (20 6 S2) Vanos, M 52 B (20 6 S3) Vanos	110	09/90 → 02/98	→03/95		MVB887R5 5PK887
				Eng. M52206S3, 10/94→		MVB906R5 5PK906
				→09/91 Eng. M52206S3, 10/94→		MVB1560R6 6PK1560 MVB1550R6 6PK1550
323 i 2.5	M 52 B 25 (Vanos)	125	03/95 → 02/98			MVB906R5 5PK906
						MVB1550R6 6PK1550
325 i	M 50 B 25, M 50 B 25 (Vanos)	141	09/90 → 09/95	→07/94		MVB887R5 5PK887
				→09/91		MVB1560R6 6PK1560
				09/91→07/94		MVB1550R6 6PK1550
325 td	M 51 D 25	85	09/91 → 02/98			MVB775R4 4PK775
						MVB1815R5 5PK1815
325 tds	M 51 D 25 (Inter.)	105	05/93 → 02/98			MVB775R4 4PK775
						MVB1815R5 5PK1815
328 i	M 52 B 28	142	01/95 → 02/98			MVB906R5 5PK906
						MVB1550R6 6PK1550
M3 3.0	S 50 B 30	210	08/94 → 09/95	A/C(-)		MVB788R5 5PK788
				A/C(+)		MVB1120R5 5PK1120
						MVB1513R6 6PK1513
M3 3.2	S 50 B 32	236	09/95 → 02/98	A/C(-)		MVB788R5 5PK788
				A/C(+)		MVB1120R5 5PK1120
						MVB1513R6 6PK1513



kw



...BMW

BMW

3 (E46)

316 i	M43164E3	77	09/98 → 02/05	☀ ⌚ ⌚	03/99 → 06/01 AUTO, 03/99 → 06/01 MAN, 03/99 → 06/01	MVB950R5 MVB1708R6 MVB1740R6	5PK950 6PK1708 6PK1740
	M 43 B 16 (16 4 E3)	77	04/00 → 02/05	⌚ ⌚	06/02 → A/C(-), 06/02 → 10/03	MVB1875R6 MVB1642R6	6PK1875 6PK1642
	N 42 B 18, N46B18A	85	02/02 → 02/05	⌚ ⌚	A/C(-), → 10/03	MVB1875R6 MVB1642R6	6PK1875 6PK1642
	N45B16A	85	06/02 → 02/05	⌚	08/03 →	MVB1875R6	6PK1875
318 d	M47204D1	85	09/01 → 03/03	☀ ⌚		MVB836R5 MVB2025R5	5PK836 5PK2025
	M47N204D4	85	03/03 → 02/05	☀ ⌚	→ 09/04	MVB970R4 MVB2080R6	4PK970 6PK2080
318 i	M 43 B 19	87	02/98 → 09/01	☀ ⌚ ⌚	08/98 → 08/98 → 08/98 →, Hot climates (-)	MVB950R5 MVB1708R6 MVB1740R6	5PK950 6PK1708 6PK1740
	N 42 B 20, N46B20A	105	09/01 → 02/05	⌚ ⌚	A/C(-), → 10/03	MVB1875R6 MVB1642R6	6PK1875 6PK1642
320 d	M 47 D 20, M47204D1	100	04/98 → 09/01	☀ ⌚	Eng. M47204D1 Eng. M47204D1	MVB836R5 MVB2025R5	5PK836 5PK2025
	M47N204D4	110	09/01 → 02/05	☀ ⌚ ⌚	→ 09/04 → 09/02 09/02 →	MVB970R4 MVB2090R6 MVB2080R6	4PK970 6PK2090 6PK2080
320 i	M 52 B (20 6 S3) Vanos	110	03/98 → 09/00	☀ ⌚		MVB865R5 MVB1538R6	5PK865 6PK1538
	M54226S1	125	09/00 → 02/05	☀ ☀ ⌚	→ 09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
323 i	M 52 B 25 (Vanos)	125	03/98 → 09/00	☀ ⌚		MVB865R5 MVB1538R6	5PK865 6PK1538
325 i	M54256S5	141	09/00 → 02/05	☀ ☀ ⌚	→ 09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
325 xi	M54256S5	141	09/00 → 02/05	☀ ☀ ⌚	→ 09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
328 i	M 52 B 28	142	02/98 → 06/00	☀ ⌚		MVB865R5 MVB1538R6	5PK865 6PK1538
330 d	M 57 D 30	135	10/99 → 02/05	☀ ⌚	→ 02/03 → 02/03	MVB813R5 MVB2060R5	5PK813 5PK2060
	M57N306D2	150	03/03 → 02/05	☀ ⌚	→ 09/04	MVB885R4 MVB2080R6	4PK885 6PK2080
330 i	M54306S3	170	06/00 → 02/05	☀ ☀ ⌚	→ 09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
	M 57 D 30	135	06/00 → 02/05	☀ ⌚	→ 02/03 → 02/03	MVB813R5 MVB2060R5	5PK813 5PK2060
330 xd	M57N306D2	150	03/03 → 02/05	☀ ⌚	→ 09/04	MVB885R4 MVB2080R6	4PK885 6PK2080
	M54306S3	170	06/00 → 02/05	☀ ☀ ⌚	→ 09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538

3 (E90)

316i	N45B16A	85	02/06 →	⌚		MVB1875R6	6PK1875
318d	M47N204D4	90	09/05 →	⌚	→ 06/07	MVB1833R6	6PK1833
	N47D20A	105	09/05 →	⌚ ⌚	A/C(+), PS elec(-), 06/07 → A/C(+), PS elec(+), 06/07 →	MVB1817R6D MVB1698R6D	6DPK1817 6DPK1698
318i	N46B20B	95	09/05 →	⌚		MVB1875R6	6PK1875
	N43B20A	105	09/07 →	⌚		MVB1103R7	7PK1103
320 si	N45B20A	127	05/06 →	⌚	→ 06/07	MVB1875R6	6PK1875



kW



...BMW

...3 (E90)

320d	M47N204D4	120	01/05 →	⊗	→06/07	MVB1833R6	6PK1833
		110	09/05 →	⊗	→06/07	MVB1833R6	6PK1833
	N47D20A	130	09/07 →	⊗	A/C(+), PS elec(-)	MVB1817R6D	6DPK1817
					A/C(+), PS elec(+)	MVB1698R6D	6DPK1698
320i	N46B20A, N46B20C	110	01/05 →	⊗	→06/07	MVB1875R6	6PK1875
		125	09/07 →	⊗	RHA (-)	MVB1103R7	7PK1103
323i		130	04/06 → 06/07	⊗		MVB1995R6	6PK1995
325d	M57306D3	145	09/06 →	⊗		MVB1833R6	6PK1833
325i	N52B25A	160	01/05 →	⊗	→06/07	MVB1995R6	6PK1995
		N53B30A	160	09/07 →	RHA (-)	MVB1833R6	6PK1833
RHA (+)	MVB1995R6				6PK1995		
325xi	N52B25A	160	01/05 →	⊗	→06/07	MVB1995R6	6PK1995
		N53B30A	160	09/07 →	RHA (-)	MVB1833R6	6PK1833
RHA (+)	MVB1995R6				6PK1995		
330d	M57306D3	170	09/05 →	⊗		MVB1833R6	6PK1833
330i	N52B30A	190	01/05 →	⊗		MVB1995R6	6PK1995
		N52B30A, N53B30A	200	09/07 →	⊗	Eng. N53B30A, RHA (-)	MVB1833R6
⊗	Eng. N53B30A, RHA (+)				MVB1995R6	6PK1995	
330xd	M57306D3	170	09/05 →	⊗		MVB1833R6	6PK1833
330xi	N52B30A	190	01/05 →	⊗	→06/07	MVB1995R6	6PK1995
		N53B30A	200	09/07 →	RHA (-)	MVB1833R6	6PK1833
RHA (+)	MVB1995R6				6PK1995		
335d	M57N306D5	210	09/06 →	⊗		MVB2063R6	6PK2063
335i	N54B30A	225	09/06 →	⊗		MVB1855R7	7PK1855
335xi	N54B30A	225	09/07 →	⊗		MVB1855R7	7PK1855
M3		309	03/07 →	⊗		MVB1065R6	6PK1065
				⊗		MVB1460R6	6PK1460

3 Compact (E36)

316 g		75	12/95 → 08/00	⊗		MVB887R4	4PK887
				⊗		MVB1740R6	6PK1740
316 i	M 43 B 16	75	03/94 → 08/00	⊗		MVB887R4	4PK887
				⊗	→09/95	MVB1660R6	6PK1660
				⊗	09/95 →	MVB1740R6	6PK1740
	M43164E3	77	12/98 → 08/00	⊗		MVB887R4	4PK887
				⊗		MVB1740R6	6PK1740
318 tds	M 41 D 18 (Inter.)	66	01/95 → 08/00	⊗		MVB835R4	4PK835
				⊗		MVB1885R5	5PK1885
318 ti	M 42 B 18	103	11/94 → 08/95	⊗		MVB887R4	4PK887
				⊗		MVB1660R6	6PK1660
	M 44 B 19	103	07/95 → 08/00	⊗	→12/98	MVB887R4	4PK887
				⊗	→12/98	MVB1740R6	6PK1740
323 ti	M 52 B 25 (Vanos)	125	08/97 → 08/00	⊗		MVB906R5	5PK906
				⊗		MVB1550R6	6PK1550

3 Compact (E46)

316 ti	N 42 B 18, N46B18A	85	06/01 → 02/05	⊗	Eng. N46B18A, A/C(-)	MVB1642R6	6PK1642
				⊗	Eng. N46B18A, A/C(+)	MVB1875R6	6PK1875
318 td	M47N204D4	85	03/03 → 02/05	⊗	→09/04	MVB970R4	4PK970
				⊗		MVB2080R6	6PK2080
318 ti	N 42 B 20, N46B20A	105	09/01 → 02/05	⊗	A/C(-)	MVB1642R6	6PK1642
				⊗	A/C(+)	MVB1875R6	6PK1875
320 td	M47N204D4	110	09/01 → 02/05	⊗	→09/04	MVB970R4	4PK970
				⊗	→09/02	MVB2090R6	6PK2090
				⊗	09/02 →	MVB2080R6	6PK2080
325 ti	M54256S5	141	06/01 → 02/05	⊗	→09/02	MVB865R5	5PK865
				⊗	09/02 →	MVB860R4	4PK860
				⊗		MVB1538R6	6PK1538



kW



...BMW

BMW

3 Convertible (E30)

318 i	M 40 B 18 (Kat.)	83	09/90 → 10/93	 	SVB101010 TB242 TBK074 SVB10800	10x1010 110x21 10x800
320 i	M 20 B 20 (Motronic, Kat.)	95	04/86 → 10/93	 	SVB13800 SVB10960 TB241 TBK337 SVB10825	13x800 10x960 127x25.4 10x825
325 i	M 20 B 25 (Kat.)	125	09/87 → 10/93	 	SVB13800 SVB10960 TB241 TBK337 SVB10825	13x800 10x960 127x25.4 10x825
	M 20 B 25	126	12/85 → 12/87	 	SVB13800 SVB10960 TB241 TBK337 SVB10825	13x800 10x960 127x25.4 10x825

3 Convertible (E36)

318 i	M 43 B 18	85	01/94 → 04/99		→09/95	MVB887R4	4PK887
					09/95→	MVB1660R6	6PK1660
320 i	M 50 B (20 6 S2) Vanos, M 52 B (20 6 S3) Vanos	110	12/93 → 04/99		→02/95	MVB1740R6	6PK1740
					10/94→	MVB887R5	5PK887
323 i 2.5	M 52 B 25 (Vanos)	125	06/95 → 04/99			MVB906R5	5PK906
						MVB1550R6	6PK1550
325 i	M 50 B 25	141	03/93 → 03/95		09/93→	MVB887R5	5PK887
					09/93→	MVB1550R6	6PK1550
328 i	M 52 B 28	142	03/95 → 04/99			MVB906R5	5PK906
						MVB1550R6	6PK1550
M3 3.0	S 50 B 30	210	01/94 → 10/95		A/C(-), →03/95	MVB788R5	5PK788
					A/C(+), →03/95	MVB1120R5	5PK1120
					→03/95	MVB1513R6	6PK1513
M3 3.2	S 50 B 32	236	10/95 → 04/99		A/C(-)	MVB788R5	5PK788
					A/C(+)	MVB1120R5	5PK1120
						MVB1513R6	6PK1513

3 Convertible (E46)

318 Ci	N 42 B 20	105	09/01 →		08/03→02/07	MVB860R4	4PK860
					08/03→02/07	MVB1538R6	6PK1538
					A/C(-), →10/03	MVB1642R6	6PK1642
					A/C(+), →10/03	MVB1875R6	6PK1875
320 Cd	M47N204D4	110	02/05 →		→02/07	MVB860R4	4PK860
					→02/07	MVB1538R6	6PK1538
					→02/07	MVB865R5	5PK865
					→05/05	MVB1875R6	6PK1875
320 Ci	M 54 B 22, M54226S1	125	09/00 →		→09/02	MVB2080R6	6PK2080
					09/02→02/07	MVB865R5	5PK865
					→02/07	MVB860R4	4PK860
323 Ci	M 52 B 25 (Vanos)	125	04/00 → 09/00			MVB1538R6	6PK1538
						MVB865R5	5PK865
325 Ci	M54256S5	141	09/00 →		→09/02	MVB865R5	5PK865
					09/02→02/07	MVB860R4	4PK860
					→02/07	MVB1538R6	6PK1538
					→07/06	MVB2080R6	6PK2080
330 Cd	M57N306D2	150	08/05 →		→09/02	MVB865R5	5PK865
330 Ci	M54306S3	170	06/00 →		09/02→02/07	MVB860R4	4PK860
					→02/07	MVB1538R6	6PK1538
					→02/07	MVB830R5	5PK830
M3 3.2	S54326S4	252	04/01 →		→02/07	MVB1460R6	6PK1460



kW



...BMW

3 Convertible (E93)

320i	N46B20B	125	03/07 →	⊗	RHA (-), 07/07 →	MVB1103R7	7PK1103
325d	N57306D3	145	03/07 →	⊗	07/07 →	MVB1833R6	6PK1833
325i	N53B30A	160	03/07 →	⊗	RHA (-)	MVB1833R6	6PK1833
					RHA (+)	MVB1995R6	6PK1995
	N52B25A	160	03/07 →	⊗		MVB1995R6	6PK1995
330d	N57N306D3	170	03/07 →	⊗		MVB1833R6	6PK1833
330i	N52B30A, N53B30A	200	03/07 →	⊗	Eng. N53B30A, RHA (-)	MVB1833R6	6PK1833
					Eng. N53B30A, RHA (+)	MVB1995R6	6PK1995
335i	N54B30A, N54B30B	225	03/07 →	⊗		MVB1855R7	7PK1855

3 Coupe (E36)

316 i	M 43 B 16	75	09/93 → 04/99	⊗		MVB887R4	4PK887
					→09/95	MVB1660R6	6PK1660
318 is	M 42 B 18	103	03/92 → 10/95	⊗	09/95 →	MVB1740R6	6PK1740
					→03/94	MVB855R4	4PK855
					03/94 →	MVB887R4	4PK887
					→09/93	SVB101025	10x1025
					09/93 →	MVB1660R6	6PK1660
					09/95 →	MVB1740R6	6PK1740
					→09/93	SVB10725	10x725
	M 44 B 19	103	09/95 → 04/99	⊗		MVB887R4	4PK887
					⊗	MVB1740R6	6PK1740
320 i	M 50 B (20 6 S1), M 50 B (20 6 S2) Vanos, M 52 B (20 6 S3) Vanos	110	03/92 → 04/99	⊗		MVB887R5	5PK887
					10/94 →	MVB906R5	5PK906
					Eng. M52206S3	MVB1550R6	6PK1550
323 i 2.5	M 52 B 25 (Vanos)	125	03/95 → 04/99	⊗		MVB906R5	5PK906
					⊗	MVB1550R6	6PK1550
325 i	M 50 B 25 (Vanos)	141	03/92 → 04/99	⊗	→03/95	MVB887R5	5PK887
					→09/94	MVB1550R6	6PK1550
328 i	M 52 B 28	142	01/95 → 04/99	⊗		MVB906R5	5PK906
					⊗	MVB1550R6	6PK1550
M3 3.0	S 50 B 30	210	10/92 → 01/95	⊗	A/C(-)	MVB788R5	5PK788
					A/C(+)	MVB1120R5	5PK1120
					⊗	MVB1513R6	6PK1513
					A/C(-)	MVB788R5	5PK788
					A/C(+)	MVB1120R5	5PK1120
M3 3.2	S 50 B 32	236	10/95 → 04/99	⊗	A/C(-)	MVB788R5	5PK788
					A/C(+)	MVB1120R5	5PK1120
					⊗	MVB1513R6	6PK1513

3 Coupe (E46)

316 Ci	M 43 B 16 (16 4 E3)	77	04/00 →	⊗	A/C(-), →10/03	MVB1642R6	6PK1642
					A/C(+), →10/03	MVB1875R6	6PK1875
	N45B16A	85	06/02 →	⊗	08/03 → 07/06	MVB1875R6	6PK1875
318 Ci	M 43 B 19	87	11/99 → 09/01	⊗		MVB950R5	5PK950
					⊗	MVB1740R6	6PK1740
	N 42 B 20	105	09/01 →	⊗	→07/06	MVB1875R6	6PK1875
					A/C(-), →10/03	MVB1642R6	6PK1642
					⊗	MVB1875R6	6PK1875
320 Cd	M47N204D4	110	11/03 →	⊗	→07/06	MVB1875R6	6PK1875
					→09/04	MVB970R4	4PK970
320 Ci	M 52 B (20 6 S4)	110	08/99 → 09/00	⊗	→07/06	MVB2080R6	6PK2080
					⊗	MVB865R5	5PK865
					⊗	MVB1538R6	6PK1538
	M54226S1	125	09/00 →	⊗	→09/02	MVB865R5	5PK865
					⊗	MVB860R4	4PK860
					09/02 → 07/06	MVB1538R6	6PK1538
					⊗	MVB1538R6	6PK1538
323 Ci	M 52 B 25 (Vanos)	125	04/99 → 09/00	⊗		MVB865R5	5PK865
					⊗	MVB1538R6	6PK1538
325 Ci	M54256S5	141	09/00 →	⊗	→09/02	MVB865R5	5PK865
					⊗	MVB860R4	4PK860
					09/02 → 07/06	MVB1538R6	6PK1538



kW



...BMW

...3 Coupe (E46)

328 Ci	M 52 B 28	142	04/99 → 06/00	☼ ⊖		MVB865R5 MVB1538R6	5PK865 6PK1538
330 Cd	M57N306D2	150	03/03 →	☼ ⊖	→09/04 →07/06	MVB885R4 MVB2080R6	4PK885 6PK2080
330 xi	M54306S3	170	06/00 →	☼ ⊖	→09/02 09/02 → 07/06 →07/06	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
M3 3.2	S54326S4	252	06/00 →	☼ ⊖	→07/06 →07/06	MVB830R5 MVB1460R6	5PK830 6PK1460
M3 CSL	S54N326S4	265	06/03 →	☼ ⊖	→07/06 →07/06	MVB830R5 MVB1460R6	5PK830 6PK1460

3 Coupe (E92)

320d	N47D20A	130	03/07 →	⊖ ⊖	A/C(+), PS elec(-) A/C(+), PS elec(+)	MVB1817R6D MVB1698R6D	6DPK1817 6DPK1698
320i	N43B20A N46NB20B	125 110	03/07 → 11/06 → 06/07	⊖ ⊖	RHA (-)	MVB1103R7 MVB1875R6	7PK1103 6PK1875
325d	N57N306D3	145	03/07 →	⊖		MVB1833R6	6PK1833
325i	N52B25A, N52B25C N53B30A	160 160	09/06 → 09/07 →	⊖ ⊖	→06/07 RHA (-) RHA (+)	MVB1995R6 MVB1833R6 MVB1995R6	6PK1995 6PK1833 6PK1995
325xi	N52B25A, N52B25C N53B30A	160 160	09/06 → 09/07 →	⊖ ⊖	→06/07 RHA (-) RHA (+)	MVB1995R6 MVB1833R6 MVB1995R6	6PK1995 6PK1833 6PK1995
330d	M57306D3	170	09/06 →	⊖		MVB1833R6	6PK1833
330i	N52B30A, N53B30A	200	09/06 →	⊖ ⊖	Eng. N53B30A, RHA (-), 06/07 → Eng. N53B30A, RHA (+), 06/07 →	MVB1833R6 MVB1995R6	6PK1833 6PK1995
330xd	M57306D3	170	09/06 →	⊖		MVB1833R6	6PK1833
330xi	N52B30A	200	09/06 →	⊖ ⊖	RHA (-), 06/07 → RHA (+), 06/07 →	MVB1833R6 MVB1995R6	6PK1833 6PK1995
335d	M57N306D5	210	09/06 →	⊖		MVB2063R6	6PK2063
335i	N54B30A	225	09/06 →	⊖		MVB1855R7	7PK1855
335xi	N54B30A	225	09/06 →	⊖		MVB1855R7	7PK1855
M3	S65B40	309	03/07 →	☼ ⊖		MVB1065R6 MVB1460R6	6PK1065 6PK1460

3 Touring (E30)

316 i	M 40 B 16 (Kat.)	73	09/91 → 06/94	⊖		SVB101010	10x1010
				☼		TB242	110x21
				☼		TBK074	
M 40 B 16	75	09/91 → 06/94	⊖		SVB101010	10x1010	
			☼		TB242	110x21	
			☼		TBK074		
318 i	M 40 B 18 (Kat.)	83	04/89 → 06/94	☼		SVB13850	13x850
				⊖		SVB101010	10x1010
				☼		TB242	110x21
M 40 B 18	85	09/87 → 06/91	☼		SVB13850	13x850	
			⊖	09/88 →	SVB101010	10x1010	
			☼	09/88 →	TB242	110x21	
320 i	M 20 B 20 (Motronic, Kat.)	95	01/88 → 12/91	☼		SVB10800	10x800
				⊖	A/C(-)	SVB13825	13x825
				⊖	A/C(+)	SVB10960	10x960
M 20 B 20	95	01/88 → 12/91	☼		SVB131050	13x1050	
			☼	→12/90	TB241	127x25.4	
			☼	RHA (-)	SVB10825	10x825	
M 20 B 20	95	01/88 → 12/91	☼		SVB10850	10x850	
			☼	RHA (+)	SVB10850	10x850	



kW



...BMW

...3 Touring (E30)

324 td	M 21 D 24, M 21 D 24 WA	85	01/88 → 06/93	 	06/88 → 02/93 06/88 → 02/93 06/88 → 02/93 06/88 → 02/93 06/88 → 02/93	SVB13800 SVB101000 TB344 TBK061 SVB10865	13x800 10x1000 138x28.5 10x865
325 i	M 20 B 25 (Kat.)	125	07/87 → 03/93	 	A/C(-) A/C(+) RHA (-) RHA (+)	SVB13825 SVB10960 SVB131050 TB241 SVB10825 SVB10850	13x825 10x960 13x1050 127x25.4 10x825 10x850
325 i X	M 20 B 25 (Kat.)	125	06/88 → 10/93	 	A/C(-) A/C(+) RHA (-) RHA (+)	SVB13825 SVB10960 SVB131050 TB241 SVB10825 SVB10850	13x825 10x960 13x1050 127x25.4 10x825 10x850

3 Touring (E36)

316 i	M 43 B 16	75	01/96 → 10/99	 	05/96 → 05/96 →	MVB887R4 MVB1740R6	4PK887 6PK1740
318 i	M 43 B 18	85	07/95 → 10/99	 		MVB887R4 MVB1740R6	4PK887 6PK1740
318 tds	M 41 D 18 (Inter.)	66	01/95 → 10/99	 		MVB835R4 MVB1885R5	4PK835 5PK1885
320 i	M 52 B (20 6 S3) Vanos	110	01/95 → 10/99	 		MVB906R5 MVB1550R6	5PK906 6PK1550
323 i 2.5	M 52 B 25 (Vanos)	125	09/95 → 10/99	 		MVB906R5 MVB1550R6	5PK906 6PK1550
325 tds	M 51 D 25 (Inter.)	105	01/95 → 10/99	 		MVB775R4 MVB1815R5	4PK775 5PK1815
328 i	M 52 B 28	142	01/95 → 10/99	 		MVB906R5 MVB1550R6	5PK906 6PK1550

3 Touring (E46)

316 i	N 42 B 18, N46B18A	85	03/02 → 02/05	 	A/C(-), →10/03	MVB1875R6 MVB1642R6	6PK1875 6PK1642
318 d	M47204D1	85	03/02 → 02/05	 	→06/03 →06/03	MVB836R5 MVB2025R5	5PK836 5PK2025
	M47N204D4	85	03/03 → 02/05	 	→09/04	MVB970R4 MVB2080R6	4PK970 6PK2080
318 i	M 43 B 19	87	10/99 → 09/01	 	Hot climates (-) Hot climates (+)	MVB950R5 MVB1740R6 MVB1708R6	5PK950 6PK1740 6PK1708
	N 42 B 20, N46B20A	105	09/01 → 02/05	 	A/C(-), →10/03	MVB1875R6 MVB1642R6	6PK1875 6PK1642
320 d	M 47 D 20, M47204D1	100	03/00 → 09/01	 	Eng. M47204D1 Eng. M47204D1	MVB836R5 MVB2025R5	5PK836 5PK2025
	M47N204D4	110	09/01 → 02/05	 	→09/04 →09/02 09/02 →	MVB970R4 MVB2090R6 MVB2080R6	4PK970 6PK2090 6PK2080
320 i	M 52 B (20 6 S3) Vanos	110	10/99 → 09/00	 		MVB865R5 MVB1538R6	5PK865 6PK1538
	M54226S1	125	09/00 → 02/05	 	→09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
325 i	M54256S5	141	09/00 → 02/05	 	→09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
325 xi	M54256S5	141	09/00 → 02/05	 	→09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538



kw



...BMW

BMW

...3 Touring (E46)

328 i	M 52 B 28	142	10/99 → 06/00	☼ ⊖		MVB865R5 MVB1538R6	5PK865 6PK1538
330 d	M 57 D 30	135	10/99 → 02/05	☼ ⊖	→02/03 →02/03	MVB813R5 MVB2060R5	5PK813 5PK2060
	M57N306D2	150	03/03 → 02/05	☼ ⊖	→09/04	MVB885R4 MVB2080R6	4PK885 6PK2080
330 i	M54306S3	170	06/00 → 02/05	☼ ☼ ⊖	→09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
	M 57 D 30	135	06/00 → 02/05	☼ ⊖	→02/03 →02/03	MVB813R5 MVB2060R5	5PK813 5PK2060
330 xd	M57N306D2	150	03/03 → 02/05	☼ ⊖	→09/04	MVB885R4 MVB2080R6	4PK885 6PK2080
	M54306S3	170	06/00 → 02/05	☼ ☼ ⊖	→09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538

3 Touring (E91)

318d	M47N204D4	90	09/05 →	⊖	01/06 →06/07	MVB1833R6	6PK1833
	N47D20A	105	09/07 →	⊖	A/C(+), PS elec(-) A/C(+), PS elec(+)	MVB1817R6D MVB1698R6D	6DPK1817 6DPK1698
318i	N46B20B	95	01/06 →	⊖		MVB1875R6	6PK1875
	N43B20A	105	09/07 →	⊖		MVB1103R7	7PK1103
320d	M47N204D5, N47D20A	120	09/05 →	⊖	→06/07	MVB1833R6	6PK1833
	M47N204D4	110	09/05 →	⊖	→06/07	MVB1833R6	6PK1833
	N47D20A	130	09/07 →	⊖	A/C(+), PS elec(-) A/C(+), PS elec(+)	MVB1817R6D MVB1698R6D	6DPK1817 6DPK1698
320i	N46B20A, N46B20C	110	09/05 →	⊖		MVB1875R6	6PK1875
	N43B20A	125	09/07 →	⊖	RHA (-)	MVB1103R7	7PK1103
323i	N52NB25A	130	04/06 → 06/07	⊖		MVB1995R6	6PK1995
325d	M57306D3	145	09/06 →	⊖		MVB1833R6	6PK1833
325i	N52B25A, N52B25C	160	09/05 →	⊖	→06/07	MVB1995R6	6PK1995
	N53B30A	160	09/07 →	⊖	RHA (-) RHA (+)	MVB1833R6 MVB1995R6	6PK1833 6PK1995
325xi	N52B25C	160	09/05 →	⊖	→06/07	MVB1995R6	6PK1995
	N53B30A	160	09/07 →	⊖	RHA (-) RHA (+)	MVB1833R6 MVB1995R6	6PK1833 6PK1995
330d	M57306D3	170	09/05 →	⊖		MVB1833R6	6PK1833
330i	N52B30A	190	09/05 →	⊖		MVB1995R6	6PK1995
		200	09/07 →	⊖	RHA (-) RHA (+)	MVB1833R6 MVB1995R6	6PK1833 6PK1995
330xd	M57306D3	170	09/05 →	⊖		MVB1833R6	6PK1833
330xi	N52B30A	190	09/05 →	⊖	→06/07	MVB1995R6	6PK1995
	N53B30A	200	09/07 →	⊖	RHA (-) RHA (+)	MVB1833R6 MVB1995R6	6PK1833 6PK1995
335d	M57N306D5	210	09/06 →	⊖		MVB2063R6	6PK2063
335i	N54B30A	225	09/06 →	⊖		MVB1855R7	7PK1855
335xi	N54B30A	225	09/07 →	⊖		MVB1855R7	7PK1855

5 (E12)

518	M 10 B 18, M 10 B 18 (2B4), M 10 B 18 (32/32 DIDTA)	66	07/74 → 05/81	☼		SVB13825	13x825
				⊖		SVB10875	10x875
				⊖	AUTO, →08/79	SVB10850	10x850
				⊖		SVB10825	10x825
520	M 10 B 20 (Strombergvergaser)	85	08/72 → 08/77	⊖		SVB10875	10x875
				⊖		SVB10825	10x825





kW



...BMW

...5 (E12)

520 i	M 10 B 20,	96	08/72 → 10/75	⊗	SVB13825	13x825		
	M 10 B 20 (Schofer-Inj.)			⊗			SVB10975	10x975
				⊗	SVB10825	10x825		
520/6	M 20 B 20	90	09/77 → 05/81	⊗	SVB13825	13x825		
				⊗			SVB10875	10x875
				⊗			SVB10950	10x950
				⊗			SVB10975	10x975
				⊗			TB343	110x25.4
				⊗			TB567	111x25.4
				⊗			SVB10825	10x825
525	M 30 B 25 (32/40 INAT)	107	08/73 → 10/76	⊗	SVB13800	13x800		
				⊗			SVB131050	13x1050
				⊗			SVB10900	10x900
525	M 30 B 25 (4A1)	110	08/76 → 05/81	⊗	SVB13800	13x800		
				⊗			SVB131050	13x1050
				⊗			SVB10900	10x900
528	M 30 B 28 (32/40 INAT)	121	01/75 → 08/77	⊗	SVB13800	13x800		
				⊗			SVB131050	13x1050
				⊗			SVB10900	10x900
528	M 30 B 28 (4A1)	125	01/75 → 08/77	⊗	SVB13800	13x800		
				⊗			SVB131050	13x1050
				⊗			SVB10900	10x900
528 i	M 30 B 28 (L-Jetronic)	130	04/77 → 05/81	⊗	SVB13800	13x800		
				⊗			SVB131050	13x1050
				135			04/77 → 05/81	⊗
				⊗	SVB13800	13x800		
				⊗	SVB131050	13x1050		
				⊗	SVB10900	10x900		
M 535 i	M 30 B 35 (Motronic,9.3:1)	160	06/80 → 08/81	⊗	SVB13800	13x800		
				⊗			SVB131050	13x1050
				⊗	SVB10900	10x900		

5 (E28)

518	M 10 B 18 (2B4)	66	06/81 → 08/84	⊗	SVB13800	13x800		
				⊗			SVB10875	10x875
				⊗			SVB10825	10x825
				⊗			SVB10813	10x813
518 i	M 10 B 18 (L-Jetronic)	77	09/83 → 12/87	⊗	SVB13800	13x800		
				⊗			SVB10950	10x950
				⊗			SVB10875	10x875
				⊗			SVB10900	10x900
				⊗			SVB10813	10x813



kW



...BMW

...5 (E28)

BMW

520 i	M 20 B 20 (K-Jetronic), M 20 B 20 (L-Jetronic)	92	06/81 → 12/87	⊗	→06/83	SVB13825	13x825			
				⊗	06/83→	SVB13800	13x800			
				⊗	→05/83	SVB10950	10x950			
				⊗	05/83→	SVB10960	10x960			
				⊗	→08/85	TB138	128x25.4			
				⊗	08/85→	TB241	127x25.4			
				⊗	08/85→	TBK337				
				⊗		SVB10825	10x825			
				M 20 B 20 (Motronic, Kat.)	95	08/85 → 12/87	⊗		SVB13800	13x800
							⊗		SVB10960	10x960
⊗		TB241	127x25.4							
⊗		TBK337								
⊗		SVB10825	10x825							
110	12/86 → 06/90	⊗	01/88→				SVB13800	13x800		
		⊗	01/88→				SVB10990	10x990		
		⊗	01/88→				TB241	127x25.4		
		⊗	01/88→				TBK337			
		⊗	01/88→				SVB10825	10x825		
524 d	M 21 D 24 W	63	03/86 → 12/87	⊗		SVB13800	13x800			
				⊗		SVB101000	10x1000			
				⊗		TB344	138x28.5			
				⊗		TBK061				
				⊗		SVB10865	10x865			
524 td	M 21 D 24 WA	85	09/83 → 12/87	⊗		SVB13800	13x800			
				⊗		SVB101000	10x1000			
				⊗		TB344	138x28.5			
				⊗		TBK061				
				⊗		SVB10865	10x865			
525 e 2.7	M 20 B 27 (Kat)	90	09/81 → 12/87	⊗	→06/83	SVB13825	13x825			
				⊗	06/83→	SVB13800	13x800			
				⊗	→09/83	SVB10950	10x950			
				⊗	09/83→	SVB10960	10x960			
				⊗	→12/85	TB138	128x25.4			
				⊗	01/86→	TB241	127x25.4			
				⊗		TBK337				
				⊗		SVB10825	10x825			
				M 20 B 27	92	05/83 → 12/87	⊗		SVB13800	13x800
							⊗	→06/83	SVB13825	13x825
							⊗	→09/83	SVB10950	10x950
							⊗	09/83→	SVB10960	10x960
							⊗	→12/85	TB138	128x25.4
							⊗	01/86→	TB241	127x25.4
							⊗		TBK337	
⊗		SVB10825	10x825							
95	12/84 → 12/87	⊗					SVB13800	13x800		
		⊗					SVB10960	10x960		
		⊗	→12/85	TB138	128x25.4					
		⊗	01/86→	TB241	127x25.4					
		⊗		TBK337						
525 i	M 30 B 25 (L-Jet.)	110	06/81 → 12/87	⊗		SVB13800	13x800			
				⊗		SVB131050	13x1050			
				⊗		SVB10900	10x900			
528 i	M 30 B 28 (L-Jetronic)	135	06/81 → 12/87	⊗		SVB13800	13x800			
				⊗		SVB131050	13x1050			
				⊗		SVB10900	10x900			



kW



...BMW

...5 (E28)

535 i, M 535 i	M 30 B 35 (Motronic,8:1,Kat.)	136	01/85 → 12/87	⊗ ⊗ ⊗		SVB13800 SVB131050 SVB10888	13x800 13x1050 10x888
	M 30 B 35 (Motronic)	141	01/85 → 12/87	⊗ ⊗ ⊗		SVB13800 SVB131050 SVB10888	13x800 13x1050 10x888
	M 30 B 35 (Motronic,10:1)	160	01/85 → 12/87	⊗ ⊗ ⊗		SVB13800 SVB131050 SVB10888	13x800 13x1050 10x888
M5 3.5	S 38 B 35	211	08/85 → 12/87	⊗ ⊗ ⊗		SVB13800 SVB131050 SVB10888	13x800 13x1050 10x888

5 (E34)

518 i	M 43 B 18	85	08/89 → 09/95	⊗ ⊗	11/92 → 11/92 →	MVB887R4 MVB1660R6	4PK887 6PK1660
	M 40 B 18 (Kat.)	83	08/89 → 09/95	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→10/92 →09/91 09/91 →10/92 →10/92 →09/91 10/91 →10/92 →10/92	SVB13850 SVB101010 SVB101025 TB242 TBK074 TBK108 SVB10800	13x850 10x1010 10x1025 110x21
520 i	M 20 B 20 (Motronic,Kat.)	95	01/88 → 08/91	⊗ ⊗ ⊗ ⊗ ⊗	→10/90 →10/90 →10/90 →10/90 →10/90	SVB13800 SVB10990 TB241 TBK337 SVB10825	13x800 10x990 127x25.4 10x825
520 i 24V	M 50 B (20 6 S1), M 50 B (20 6 S2) Vanos	110	09/89 → 09/95	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→10/90 01/92 → 11/90 →01/92 →10/90 09/91 → 11/90 →09/91 →10/90 →10/90 →10/90 →10/90 →10/90	SVB13800 MVB906R5 MVB887R5 SVB10990 MVB1550R6 MVB1560R6 TB241 TBK337 SVB10825	13x800 5PK906 5PK887 10x990 6PK1550 6PK1560 127x25.4 10x825
524 td	M 21 D 24, M 21 D 24 WA	85	03/88 → 09/95	⊗ ⊗ ⊗ ⊗ ⊗	→09/91 →09/91 →09/91 →09/91 →09/91	SVB13825 SVB101000 TB344 TBK061 SVB10865	13x825 10x1000 138x28.5 10x865
525 i	M 20 B 25 (Kat.)	125	01/88 → 08/91	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→09/90 →09/90 →09/90 →09/90 →09/90 →09/90 →09/90	SVB13800 SVB13825 SVB10990 TB241 TBK337 SVB10825	13x800 13x825 10x990 127x25.4 10x825
525 i 24V	M 50 B 25, M 52 B 25 (Vanos)	141	09/89 → 09/95	⊗ ⊗ ⊗ ⊗ ⊗	01/92 → 10/90 →01/92 09/91 → 10/90 →09/91	MVB906R5 MVB887R5 MVB1550R6 MVB1560R6	5PK906 5PK887 6PK1550 6PK1560
525 i X 24V	M 52 B 25 (Vanos)	141	10/91 → 09/95	⊗ ⊗ ⊗	→01/92	MVB906R5 MVB887R5 MVB1550R6	5PK906 5PK887 6PK1550
525 td	M 51 D 25	85	04/93 → 09/95	⊗ ⊗		MVB775R4 MVB1815R5	4PK775 5PK1815
525 tds	M 51 D 25 (Inter.)	105	09/91 → 09/95	⊗ ⊗		MVB775R4 MVB1815R5	4PK775 5PK1815
530 i	M 30 B 30 (Kat.)	138	01/88 → 08/91	⊗ ⊗ ⊗		SVB13825 SVB131050 SVB10865	13x825 13x1050 10x865

BMW



kw



...BMW

BMW

...5 (E34)

530 i V8	M 60 B 30	160	09/92 → 09/95	☀ ⌚		MVB975R5 MVB1605R7	5PK975 7PK1605
535 i	M 30 B 35 (Motronic,9:1,Kat.)	155	01/88 → 09/95	☀ ⌚ ⊕		SVB13825 SVB131050 SVB10865	13x825 13x1050 10x865
540 i V8	M 60 B 40	210	09/92 → 09/95	☀ ⌚		MVB975R5 MVB1605R7	5PK975 7PK1605
M5		210	12/87 → 12/88	☀ ⌚ ⊕		SVB13975 SVB131050 SVB10825	13x975 13x1050 10x825
M5 3.6	S 38 B 36	232	10/88 → 05/92	☀ ⌚ ⊕	→12/91 →11/89 11/89→12/91	SVB13975 SVB131050 SVB131000	13x975 13x1050 13x1000
M5 3.6 CAT	S 38 B 36 (Kat)	232	10/88 → 05/92	☀ ⌚ ⊕	→12/91 →11/89 11/89→12/91	SVB13975 SVB131050 SVB131000	13x975 13x1050 13x1000
M5 3.8	S 38 B 38	250	03/92 → 09/95	☀ ⌚ ⊕	→12/91	SVB13975 SVB131000 SVB10825	13x975 13x1000 10x825

5 (E39)

520 d	M 47 D 20, M47204D1	100	02/00 → 06/03	☀ ⌚	Eng. M47204D1 Eng. M47204D1	MVB836R5 MVB2025R5	5PK836 5PK2025
520 i	M 52 B (20 6 S3) Vanos, M 52 B (20 6 S4)	110	01/96 → 09/00	☀ ☀ ☀ ⌚ ⊕	→02/96 →03/98 03/98→ →09/98 09/98→	MVB887R5 MVB906R5 MVB865R5 MVB1550R6 MVB1538R6	5PK887 5PK906 5PK865 6PK1550 6PK1538
	M 52 B (20 6 S3) Vanos	100	04/99 → 06/03	☀ ⌚	→07/00 →07/00	MVB865R5 MVB1538R6	5PK865 6PK1538
	M 54 B 22	125	09/00 → 06/03	☀ ☀ ⌚	→09/02 09/02→	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
523 i	M 52 B 25 (Vanos)	125	11/95 → 09/00	☀ ☀ ☀ ⌚ ⊕	→02/96 →03/98 03/98→ →09/98 09/98→	MVB887R5 MVB906R5 MVB865R5 MVB1550R6 MVB1538R6	5PK887 5PK906 5PK865 6PK1550 6PK1538
525 d	M57256D1	120	02/00 → 06/03	☀ ⌚		MVB813R5 MVB2060R5	5PK813 5PK2060
525 i	M54256S5	141	09/00 → 06/03	☀ ☀ ⌚	→09/02 09/02→	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
525 td	M 51 D 25	85	01/97 → 06/03	☀ ⌚ ⊕	→08/98 Alt. 140A, →08/98 Not Alt. 140A, →08/98	MVB775R4 MVB1850R5 MVB1815R5	4PK775 5PK1850 5PK1815
525 tds	M 51 D 25 (Inter.)	105	01/96 → 06/03	☀ ⌚ ⊕	→08/98 Alt. 140A, →08/98 Not Alt. 140A, →08/98	MVB775R4 MVB1850R5 MVB1815R5	4PK775 5PK1850 5PK1815
528 i	M 52 B 28	142	11/95 → 09/00	☀ ☀ ☀ ⌚ ⊕	→02/96 →03/98 03/98→ →09/98 09/98→	MVB887R5 MVB906R5 MVB865R5 MVB1550R6 MVB1538R6	5PK887 5PK906 5PK865 6PK1550 6PK1538
530 d	M 57 D 30	135	08/98 → 09/00	☀ ⌚		MVB813R5 MVB2060R5	5PK813 5PK2060
		142	09/00 → 06/03	☀ ⌚		MVB813R5 MVB2060R5	5PK813 5PK2060
530 i	M54306S3	170	09/00 → 06/03	☀ ☀ ⌚	→09/02 09/02→	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538





kW



...BMW

...5 (E39)

535 i	M 62 B (35 8 S1)	173	04/96 → 03/99	⚙️ ⚙️	→08/98 →08/98	MVB1000R5 MVB1635R7	5PK1000 7PK1635
	M 62 B (35 8 S2)	180	04/99 → 06/03	⚙️ ⚙️		MVB1000R5 MVB1635R7	5PK1000 7PK1635
540 i	M 62 B 44, M62448S2	210	04/96 → 06/03	⚙️ ⚙️	Eng. M62448S2 Eng. M62448S2	MVB1000R5	5PK1000
						MVB1635R7	7PK1635
M5	S 38 B 49, S 62 B 50	294	10/98 → 06/03	⚙️ ⚙️		MVB975R5 MVB1635R7	5PK975 7PK1635

5 (E60)

520d	M47N204D5, N47D20A	120	07/05 →	⚙️	Eng. M47N204D5, →07/07	MVB2080R6	6PK2080
	M47N204D4	110	09/05 →	⚙️	→01/07	MVB2080R6	6PK2080
	M47N204D4, N47D20A	130	09/07 →	⚙️		MVB1817R6D	6DPK1817
520i	M54226S1	125	07/03 →	⚙️	→05/05	MVB845R4	4PK845
				⚙️	→05/05	MVB1538R6	6PK1538
523i	N52B25A	130	07/05 →	⚙️	→02/07	MVB1995R6	6PK1995
		140	01/07 →	⚙️		MVB1995R6	6PK1995
525d	M57N256D4	130	06/04 →	⚙️	→09/04	MVB860R4	4PK860
				⚙️	RHA (-), →02/07	MVB2080R6	6PK2080
				⚙️	RHA (+), →02/07	MVB2160R6	6PK2160
	M57256D1	120	12/04 →	⚙️	RHA (-), →02/07	MVB2080R6	6PK2080
				⚙️	RHA (+), →02/07	MVB2160R6	6PK2160
				⚙️		MVB2080R6	6PK2080
525i	M54256S5	141	09/03 →	⚙️	→05/05	MVB845R4	4PK845
				⚙️	RHA (-), →05/05	MVB1538R6	6PK1538
	N52B25A	160	07/05 →	⚙️	RHA (+), →05/05	MVB1560R6	6PK1560
				⚙️	→02/07	MVB1995R6	6PK1995
525xd	M57306D3	145	01/07 →	⚙️		MVB1995R6	6PK1995
				⚙️		MVB2080R6	6PK2080
525xi	N52B25A	160	07/05 →	⚙️	→02/07	MVB1995R6	6PK1995
				⚙️		MVB1995R6	6PK1995
530d	M57306D2	160	07/03 →	⚙️	RHA (-), →02/07	MVB2080R6	6PK2080
				⚙️	RHA (+), →02/07	MVB2160R6	6PK2160
				⚙️		MVB2080R6	6PK2080
	M57306D3	170	07/03 →	⚙️	RHA (-), →02/07	MVB2160R6	6PK2160
				⚙️	RHA (+), →02/07	MVB2080R6	6PK2080
				⚙️	RHA (-)	MVB2080R6	6PK2080
530i	M54306S3	170	07/03 →	⚙️	RHA (+)	MVB2160R6	6PK2160
				⚙️	→05/05	MVB845R4	4PK845
				⚙️	RHA (-), →05/05	MVB1538R6	6PK1538
530xd	M57306D3	170	07/05 →	⚙️	RHA (+), →05/05	MVB1560R6	6PK1560
				⚙️	→02/07	MVB1995R6	6PK1995
				⚙️		MVB1995R6	6PK1995
530xi	N52B30A	190	07/05 →	⚙️	→02/07	MVB1995R6	6PK1995
				⚙️		MVB1995R6	6PK1995
535d	M57306D4	200	09/04 →	⚙️	RHA (-), →02/07	MVB1995R6	6PK1995
				⚙️	RHA (+), →02/07	MVB2080R6	6PK2080
				⚙️	RHA (-)	MVB2160R6	6PK2160
540i	N62B40A	225	07/05 →	⚙️	RHA (+)	MVB2080R6	6PK2080
				⚙️		MVB2160R6	6PK2160
				⚙️		MVB1550R6	6PK1550
545i	N 62 B 44	245	09/03 →	⚙️	→08/05	MVB1550R6	6PK1550
550i	N62B48B	270	07/05 →	⚙️		MVB1550R6	6PK1550
M5	S85B50A	373	09/04 →	⚙️		MVB1088R6	6PK1088



kW



...BMW

BMW

5 Touring (E34)

518 g	M 43 B 18	85	11/95 → 06/96	☀ ⌚		MVB887R4 MVB1660R6	4PK887 6PK1660
518 i	M 40 B 18 (Kat.)	83	03/93 → 09/94	☀ ⌚ ⚙️ ⚙️KIT	→09/93	MVB855R4	4PK855
					→09/93	SVB101025	10x1025
					→09/93	TB242 TBK108	110x21
	M 43 B 18	85	09/94 → 01/97	☀ ⌚		MVB887R4 MVB1660R6	4PK887 6PK1660
520 i	M 50 B (20 6 S1), M 50 B (20 6 S2) Vanos	110	11/91 → 01/97	☀ ☀ ⌚	→01/92 Eng. M50206S2 Eng. M50206S2	MVB887R5 MVB906R5 MVB1550R6	5PK887 5PK906 6PK1550
525 i	M 50 B 25	141	11/91 → 01/97	☀ ☀ ⌚	→01/92 →06/96 →06/96	MVB887R5 MVB906R5 MVB1550R6	5PK887 5PK906 6PK1550
525 i X	M 50 B 25, M 52 B 25 (Vanos)	141	02/92 → 01/97	☀ ⌚	Eng. M50B25C, →06/96 Eng. M50B25C, →06/96	MVB906R5 MVB1550R6	5PK906 6PK1550
525 td	M 51 D 25	85	03/93 → 01/97	☀ ⌚		MVB775R4 MVB1815R5	4PK775 5PK1815
525 tds	M 51 D 25 (Inter.)	105	12/91 → 01/97	☀ ⌚		MVB775R4 MVB1815R5	4PK775 5PK1815
530 i V8	M 60 B 30	160	09/92 → 01/97	☀ ⌚	→10/95 →10/95	MVB975R5 MVB1605R7	5PK975 7PK1605
540 i	M 60 B 40	210	09/93 → 01/97	☀ ⌚		MVB975R5 MVB1605R7	5PK975 7PK1605
M5 3.8	S 38 B 38	250	09/94 → 01/97	☀ ⌚ ⚙️		SVB13975 SVB131000 SVB10825	13x975 13x1000 10x825

5 Touring (E39)

520 d	M 47 D 20, M47204D1	100	02/00 → 09/03	☀ ⌚	Eng. M47204D1 Eng. M47204D1	MVB836R5 MVB2025R5	5PK836 5PK2025
520 i	M 52 B (20 6 S3) Vanos, M 52 B (20 6 S4)	110	01/97 → 09/00	☀ ☀ ⌚ ⌚	→03/98	MVB906R5	5PK906
					03/98 →	MVB865R5	5PK865
					→09/98	MVB1550R6	6PK1550
					09/98 →	MVB1538R6	6PK1538
	M 52 B (20 6 S3) Vanos	100	04/99 → 05/04	☀ ⌚	→07/00 →07/00	MVB865R5 MVB1538R6	5PK865 6PK1538
	M 54 B 22	125	09/00 → 05/04	☀ ☀ ⌚	→09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
523 i	M 52 B 25 (Vanos)	125	01/97 → 09/00	☀ ☀ ⌚ ⌚	→03/98 03/98 → →09/98 09/98 →	MVB906R5 MVB865R5 MVB1550R6 MVB1538R6	5PK906 5PK865 6PK1550 6PK1538
525 d	M57256D1	120	02/00 → 05/04	☀ ⌚		MVB813R5 MVB2060R5	5PK813 5PK2060
525 i	M54256S5	141	09/00 → 05/04	☀ ☀ ⌚	→09/02 09/02 →	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
525 tds	M 51 D 25 (Inter.)	105	03/97 → 05/04	☀ ⌚ ⌚	→08/98 Alt. 140A, →08/98 Not Alt. 140A, →08/98	MVB775R4 MVB1850R5 MVB1815R5	4PK775 5PK1850 5PK1815
528 i	M 52 B 28	142	01/97 → 09/00	☀ ☀ ⌚ ⌚	→03/98 03/98 → →09/98 09/98 →	MVB906R5 MVB865R5 MVB1550R6 MVB1538R6	5PK906 5PK865 6PK1550 6PK1538
530 d	M 57 D 30	135	08/98 → 09/00	☀ ⌚		MVB813R5 MVB2060R5	5PK813 5PK2060
		142	09/00 → 05/04	☀ ⌚		MVB813R5 MVB2060R5	5PK813 5PK2060



kW



...BMW

...5 Touring (E39)

530 i	M54306S3	170	09/00 → 05/04	⚙️ ⚙️ ⚙️	→09/02 09/02→	MVB865R5 MVB860R4 MVB1538R6	5PK865 4PK860 6PK1538
540 i	M 62 B 44, M62448S2	210	01/97 → 05/04	⚙️ ⚙️		MVB1000R5 MVB1635R7	5PK1000 7PK1635

5 Touring (E61)

520d	M47N204D5, N47D20A	120	07/05 →	⚙️	→02/07	MVB2080R6	6PK2080	
	M47N204D4	110	09/05 →	⚙️	→02/07	MVB2080R6	6PK2080	
	N47D20A	130	09/07 →	⚙️		MVB1817R6D	6DPK1817	
523i	N52B25A	130	07/05 →	⚙️	→02/07	MVB1995R6	6PK1995	
		140	01/07 →	⚙️		MVB1995R6	6PK1995	
525d	M57N256D4	130	06/04 →	⚙️	→09/04	MVB860R4	4PK860	
				⚙️	RHA (-), →02/07	MVB2080R6	6PK2080	
				⚙️	RHA (+), →02/07	MVB2160R6	6PK2160	
	120	12/04 →	⚙️	RHA (-), →02/07	MVB2080R6	6PK2080		
				⚙️	RHA (+), →02/07	MVB2160R6	6PK2160	
	N57306D3	145	01/07 →	⚙️		MVB2080R6	6PK2080	
525i	M54256S5	141	06/04 →	⚙️	→05/05	MVB845R4	4PK845	
				⚙️	RHA (-), →05/05	MVB1538R6	6PK1538	
				⚙️	RHA (+), →05/05	MVB1560R6	6PK1560	
		N52B25A	160	07/05 →	⚙️	→02/07	MVB1995R6	6PK1995
	N53B30A	160	01/07 →	⚙️		MVB1995R6	6PK1995	
525xd	N57306D3	145	01/07 →	⚙️		MVB2080R6	6PK2080	
525xi	N52B25A	160	07/05 →	⚙️	→02/07	MVB1995R6	6PK1995	
								N53B30A
530d	N57306D2	160	06/04 →	⚙️	→09/04	MVB860R4	4PK860	
				⚙️	RHA (-), →08/05	MVB2080R6	6PK2080	
				⚙️	RHA (+), →08/05	MVB2160R6	6PK2160	
		M57306D3	170	07/05 →	⚙️	RHA (-), →02/07	MVB2080R6	6PK2080
	⚙️				RHA (+), →02/07	MVB2160R6	6PK2160	
	173				01/07 →	⚙️	RHA (-)	MVB2080R6
			⚙️	RHA (+)	MVB2160R6	6PK2160		
530i	M54306S3	170	06/04 →	⚙️	→05/05	MVB845R4	4PK845	
				⚙️	RHA (-), →05/05	MVB1538R6	6PK1538	
				⚙️	RHA (+), →05/05	MVB1560R6	6PK1560	
		N52B30A	190	07/05 →	⚙️		MVB1995R6	6PK1995
	N52B30A, N53B30A	200	01/07 →	⚙️		MVB1995R6	6PK1995	
530xd	M57306D3	170	07/05 →	⚙️	RHA (-), →02/07	MVB2080R6	6PK2080	
				⚙️	RHA (+), →02/07	MVB2160R6	6PK2160	
				173	01/07 →	⚙️	RHA (-)	MVB2080R6
			⚙️	RHA (+)	MVB2160R6	6PK2160		
530xi	N52B30A	190	07/05 →	⚙️	→02/07	MVB1995R6	6PK1995	
	N53B30A	200	01/07 →	⚙️		MVB1995R6	6PK1995	
535d	M57306D4	200	09/04 →	⚙️	RHA (-), →02/07	MVB2080R6	6PK2080	
				⚙️	RHA (+), →02/07	MVB2160R6	6PK2160	
		M57N306D5	210	01/07 →	⚙️	RHA (-)	MVB2080R6	6PK2080
				⚙️	RHA (+)	MVB2160R6	6PK2160	
545i	N 62 B 44	245	06/04 →	⚙️	→08/05	MVB1550R6	6PK1550	
550i	N62B48A, N62B48B	270	07/05 →	⚙️		MVB1550R6	6PK1550	
M5	S85B50A	373	02/07 →	⚙️		MVB1088R6	6PK1088	

6 (E24)

3.5		191	03/83 → 10/89	⚙️		SVB13800	13x800
				⚙️		SVB131050	13x1050
				⚙️		SVB10888	10x888
628 CSi	M 30 B 28 (L-Jetronic)	135	09/79 → 08/87	⚙️	→07/84	SVB13800	13x800
				⚙️	→07/84	SVB131050	13x1050
				⚙️	→07/84	SVB10900	10x900



kw



...BMW

...6 (E24)

630 CS	M 30 B 30 (4A1)	136	04/76 → 08/79	☼		SVB13800	13x800
				Ⓢ		SVB131050	13x1050
		135	04/76 → 08/79	☼		SVB10900	10x900
				Ⓢ		SVB13800	13x800
				Ⓢ		SVB131050	13x1050
				Ⓢ		SVB10900	10x900
633 CSi	M 30 B 32 (L-Jetronic)	147	04/76 → 09/78	☼	09/76 →	SVB13800	13x800
				Ⓢ	09/76 →	SVB131050	13x1050
				Ⓢ	09/76 →	SVB10900	10x900
	M 30 B 32,	145	09/78 → 08/84	☼	Eng. M30B32E, →12/82	SVB13800	13x800
	M 30 B 32 (L-Jetronic, 9:1)			Ⓢ	→12/82	SVB131050	13x1050
				Ⓢ	Eng. M30B32E, →12/82	SVB10900	10x900
635 CSi	M 30 B 35 (L-Jetronic, 10:1), M 30 B 35 (Motronic, 10:1), M 30 B 35 (Motronic, 9.3:1)	160	06/78 → 08/88	☼	Eng. M30B35B, →03/82	SVB131050	13x1050
				Ⓢ	Eng. M30B35B, →03/82	SVB10900	10x900
	M 30 B 35 (Motronic, 9:1, Kat.)	155	08/87 → 05/89	☼		SVB13800	13x800
				Ⓢ		SVB131050	13x1050
	M 30 B 35 (Motronic, 8:1, Kat.)	136	01/85 → 05/89	☼		SVB13800	13x800
			Ⓢ		SVB131050	13x1050	
			Ⓢ		SVB10888	10x888	
		141	04/85 → 09/90	☼	→10/89	SVB13800	13x800
				Ⓢ	→10/89	SVB131050	13x1050
				Ⓢ	→10/89	SVB10888	10x888
M 635 CSi	S 38 B 35	211	03/84 → 05/89	☼		SVB13800	13x800
				Ⓢ		SVB131050	13x1050
				Ⓢ		SVB10888	10x888
	S 38 B 35 (Kat)	191	10/86 → 10/88	☼		SVB13800	13x800
			Ⓢ		SVB131050	13x1050	
			Ⓢ		SVB10888	10x888	

6 (E63)

630i	N52B30A	190	09/04 →	Ⓢ	→03/07	MVB1995R6	6PK1995
		200	07/07 →	Ⓢ		MVB1995R6	6PK1995
635d	N57N306D5	210	07/07 →	Ⓢ	RHA (-)	MVB2080R6	6PK2080
				Ⓢ	RHA (+)	MVB2160R6	6PK2160
645Ci	N 62 B 44, N62B44A	245	01/04 →	Ⓢ	→07/05	MVB1550R6	6PK1550
650i	N62B48B	270	07/05 →	Ⓢ		MVB1550R6	6PK1550
M6	S85B50A	373	09/05 →	☼		MVB1088R6	6PK1088

6 Convertible (E64)

630i	N52B30A	190	09/04 →	Ⓢ	→05/07	MVB1995R6	6PK1995
		200	07/07 →	Ⓢ		MVB1995R6	6PK1995
635d	M57N306D5	210	07/07 →	Ⓢ	RHA (-)	MVB2080R6	6PK2080
				Ⓢ	RHA (+)	MVB2160R6	6PK2160
645Ci	N 62 B 44, N62B44A	245	04/04 →	Ⓢ	→07/05	MVB1550R6	6PK1550
650i	N62B48B	270	07/05 →	Ⓢ		MVB1550R6	6PK1550
M6	S85B50A	373	07/06 →	☼		MVB1088R6	6PK1088

7 (E23)

2.5		110	07/77 → 06/86	☼	09/81 →	SVB13800	13x800
				Ⓢ	09/81 →	SVB131050	13x1050
				Ⓢ	09/81 →	SVB10913	10x913
3.4		160	06/82 → 06/86	☼		SVB13800	13x800
				Ⓢ		SVB131050	13x1050
				Ⓢ		SVB10913	10x913
728	M 30 B 28 (4A1)	125	05/77 → 08/79	☼		SVB13800	13x800
				Ⓢ		SVB131050	13x1050
				Ⓢ		SVB10900	10x900
728 i	M 30 B 28 (L-Jetronic)	135	07/78 → 08/86	☼		SVB13800	13x800
				Ⓢ		SVB131050	13x1050
				Ⓢ	→05/80	SVB10900	10x900
				Ⓢ	05/80 →	SVB10913	10x913



kW



...BMW

...7 (E23)

730	M 30 B 30 (4A1)	135	05/77 → 08/79	⊗ ⊗ ⊗		SVB13800 SVB131050 SVB10900	13x800 13x1050 10x900
732 i/733 i	M 30 B 32, M 30 B 32 (L-Jetronic,9:1), M 30 B 32 (Motronic,10:1)	145	05/77 → 08/86	⊗ ⊗ ⊗	→05/80 05/80→	SVB13800 SVB131050 SVB10900 SVB10913	13x800 13x1050 10x900 10x913
735 i	M 30 B 35 (Motronic,8:1,Kat.)	136	01/85 → 08/86	⊗ ⊗ ⊗		SVB13800 SVB131050 SVB10913	13x800 13x1050 10x913
	M 30 B 35 (Motronic,10:1), M 30 B 35 (Motronic,9.3:1)	160	09/79 → 08/86	⊗ ⊗ ⊗	→05/80 05/80→	SVB13800 SVB131050 SVB10900 SVB10913	13x800 13x1050 10x900 10x913
	M 30 B 35 (Motronic)	141	04/85 → 08/86	⊗ ⊗ ⊗		SVB13800 SVB131050 SVB10913	13x800 13x1050 10x913
745 i	M 30 B 32, M 30 B 32 (Turbo,7.5:1), M 30 B 32 (Turbo,8:1)	185	04/80 → 04/83	⊗ ⊗ ⊗	Eng. S30B32E, →05/82 →05/82 →05/80	SVB13800 SVB131050 SVB10900 SVB10913	13x800 13x1050 10x900 10x913
	M 30 B 35	185	05/83 → 08/86	⊗ ⊗ ⊗	Eng. S30B32E, →05/82	SVB13800 SVB131050 SVB10913	13x800 13x1050 10x913

7 (E32)

730 i,iL	M 30 B 30	145	12/86 → 09/94	⊗ ⊗ ⊗	→02/87	SVB13825 SVB13850 SVB131050 SVB10865	13x825 13x850 13x1050 10x865
	M 30 B 30 (Kat.)	138	12/86 → 09/94	⊗ ⊗ ⊗	→02/87	SVB13825 SVB13850 SVB131050 SVB10865	13x825 13x850 13x1050 10x865
730 i,iL V8	M 60 B 30	160	04/92 → 09/94	⊗ ⊗	→05/94 →05/94	MVB975R5 MVB1605R7	5PK975 7PK1605
735 i,iL	M 30 B 35 (Motronic,9:1,Kat.)	155	09/86 → 09/92	⊗ ⊗ ⊗	→02/87 02/87→	SVB13850 SVB13825 SVB131050 SVB10865	13x850 13x825 13x1050 10x865
	M 30 B 35 (Motronic,9.2:1)	162	09/86 → 12/87	⊗ ⊗ ⊗	→02/87 02/87→	SVB13850 SVB13825 SVB131050 SVB10865	13x850 13x825 13x1050 10x865
740 i,iL V8	M 60 B 40	210	04/92 → 09/94	⊗ ⊗	→05/94 →05/94	MVB975R5 MVB1605R7	5PK975 7PK1605
750 i,iL V12	M 70 B 50	220	09/87 → 09/94	⊗ ⊗	→05/94 →05/94	MVB1165R5 MVB1080R6	5PK1165 6PK1080

7 (E38)

725 tds	M 51 D 25 (Inter.)	105	04/96 → 11/01	⊗ ⊗	→05/00 Alt. 140A, →05/00	MVB775R4 MVB1850R5	4PK775 5PK1850
728 i,iL	M 52 B 28	142	08/95 → 11/01	⊗ ⊗ ⊗ ⊗	→02/96 02/96→03/98 03/98→ →09/98	MVB887R5 MVB906R5 MVB865R5 MVB1550R6	5PK887 5PK906 5PK865 6PK1550
				⊗	09/98→	MVB1538R6	6PK1538
730 d	M 57 D 30	135	08/98 → 04/00	⊗ ⊗		MVB813R5 MVB2060R5	5PK813 5PK2060
	M57306D1	142	04/00 → 11/01	⊗ ⊗		MVB813R5 MVB2060R5	5PK813 5PK2060



kW



...BMW

BMW

...7 (E38)

730 i,iL	M 60 B 30	155	10/94 → 11/01	☀	→10/95	MVB975R5	5PK975	
				⚙	→10/95	MVB1605R7	7PK1605	
		160	10/94 → 11/01	☀	→10/95	MVB975R5	5PK975	
				⚙	→10/95	MVB1605R7	7PK1605	
735 i,iL	M 62 B (35 8 S1)	173	01/96 → 11/01	☀		MVB1000R5	5PK1000	
				⚙		MVB1635R7	7PK1635	
740 d	M 67 D 39	180	05/99 → 11/01	☀		MVB1120R5	5PK1120	
740 i,iL	M 60 B 40	210	10/94 → 11/01	☀	→02/96	MVB975R5	5PK975	
					⚙	→02/96	MVB1605R7	7PK1605
	M 62 B 44, M62448S2	210	01/96 → 11/01	☀	Eng. M62448S1	MVB1000R5	5PK1000	
				⚙	Eng. M62448S1	MVB1635R7	7PK1635	
750 i,iL	M 73 B 54	240	12/94 → 11/01	☀	→09/98	MVB1200R6	6PK1200	
					⚙	09/98→	MVB1190R6	6PK1190
					⚙	→09/98	MVB1035R7	7PK1035
					⚙	09/98→	MVB1035R7	7PK1035

7 (E65, E66)

730 d	N57306D2	160	10/02 →	☀	→09/03	MVB885R4	4PK885	
					⚙	09/03→02/05	MVB860R4	4PK860
					⚙	RHA (-), →02/05	MVB2080R6	6PK2080
					⚙	RHA (+), →02/05	MVB2160R6	6PK2160
730 i,Li	M54306S3	170	03/03 →	☀	→02/05	MVB845R4	4PK845	
					⚙	RHA (-), →02/05	MVB1538R6	6PK1538
					⚙	RHA (+), →02/05	MVB1560R6	6PK1560
	N52B30A	190	03/05 →	⚙		MVB1995R6	6PK1995	
730 Ld	M57306D3, N57N306D2	170	07/05 →	☀	Eng. M57N306D3, →08/08	MVB860R4	4PK860	
					⚙	Eng. M57N306D3, RHA (-), →08/08	MVB2080R6	6PK2080
					⚙	RHA (+), →08/08	MVB2160R6	6PK2160
735 i,Li	N 62 B 36	200	11/01 →	☀	→09/03	MVB860R4	4PK860	
				⚙	→09/03	MVB1550R6	6PK1550	
				⚙	09/03→02/05	MVB1550R6	6PK1550	
740 d	N67398D1	190	10/02 →	☀	→02/05	MVB915R5	5PK915	
				⚙	→02/05	MVB1760R7	7PK1760	
740 i,Li	N62B40A	225	07/05 →	⚙	→08/08	MVB1550R6	6PK1550	
745 d	N67N448D2	242	07/05 →	⚙		MVB1760R7	7PK1760	
						MVB1760R7	7PK1760	
	N67N448D1	220	03/05 → 08/05	⚙		MVB1760R7	7PK1760	
745 i,Li	N 62 B 44, N62B44A	245	11/01 →	☀	Eng. N62B44A, →09/03	MVB860R4	4PK860	
					⚙	09/03→02/05	MVB1550R6	6PK1550
					⚙	Eng. N62B44A, →09/03	MVB1550R6	6PK1550
750 i,Li	N62B48B	270	07/05 →	⚙		MVB1550R6	6PK1550	
760 i,Li	N 73 B 60	327	01/03 →	☀		MVB845R4	4PK845	
				⚙		MVB1550R6	6PK1550	

8 (E31)

840 Ci	M 62 B 44	210	01/96 → 12/99	☀		MVB1000R5	5PK1000
					⚙		MVB1635R7
840 i	M 60 B 40	210	02/93 → 02/96	☀	→10/95	MVB975R5	5PK975
					⚙	→10/95	MVB1605R7
850 Ci	M 73 B 54	240	09/94 → 12/99	☀	11/95→	MVB1200R6	6PK1200
					⚙	11/95→	MVB1035R7
850 CSi	M 70 B 56	280	04/93 → 12/96	☀	→10/95	MVB1200R6	6PK1200
					⚙	→10/95	MVB1035R7
850 i,Ci	M 70 B 50	220	04/90 → 10/94	☀		MVB1155R5	5PK1155
				⚙		MVB1080R6	6PK1080

X3 (E83)

2.0 d	M47N204D4	110	10/04 →	⚙		MVB2080R6	6PK2080
	N47D20A	130	09/07 →	⚙		MVB1817R6D	6PK1817
2.0 i	N46B20A	110	07/05 →	⚙		MVB1875R6	6PK1875
2.5 i	M54256S5	141	01/04 →	☀	→08/06	MVB860R4	4PK860
					⚙	→08/06	MVB1538R6
2.5 si	N52B25A	160	09/06 →	⚙		MVB1995R6	6PK1995



kW



BMW

...BMW

...X3 (E83)

3.0 d	M54N306D2	150	01/04 →	☼ ⊗	→09/04 →08/05	MVB885R4 MVB2063R6	4PK885 6PK2063
	M57N2306D2	160	01/04 →	⊗	09/05 →	MVB2063R6	6PK2063
3.0 i	M54306S3	170	01/04 →	☼ ⊗	→08/06 →08/06	MVB860R4	4PK860
						MVB1538R6	6PK1538
3.0 sd	N57N306D5	210	09/06 →	⊗		MVB2063R6	6PK2063
3.0 si	N52B30A	200	09/06 →	⊗		MVB1995R6	6PK1995

X5 (E53)

3.0 d	M57306D1	135	05/01 →	☼ ⊗	→09/03 MAN, →09/03	MVB813R5	5PK813
						MVB2060R5	5PK2060
	M57N306D4	160	12/03 →	☼ ⊗	→10/06 →10/06	MVB885R4 MVB2080R6	4PK885 6PK2080
3.0 i	M54306S3	163	05/00 →	☼ ☼ ⊗	→09/02 09/02 →10/06 →10/06	MVB865R5	5PK865
						MVB860R4	4PK860
						MVB1538R6	6PK1538
		170	05/00 →	☼ ☼ ⊗	→09/02 09/02 →10/06 →10/06	MVB865R5	5PK865
						MVB860R4	4PK860
						MVB1538R6	6PK1538
4.4 i	M 62 B 44	210	05/00 →	☼ ⊗	→09/03 →09/03	MVB1030R5	5PK1030
						MVB1635R7	7PK1635
	N62B44A	235	12/03 →	☼ ⊗	→10/06 →10/06	MVB860R4 MVB1550R6	4PK860 6PK1550
4.6 is	M67468S1	255	02/02 →	☼ ⊗	→03/04 →03/04	MVB1030R5	5PK1030
						MVB1635R7	7PK1635
4.8 is	N62B48A	265	04/04 →	☼ ⊗	→10/06 →10/06	MVB860R4 MVB1550R6	4PK860 6PK1550

X5 (E70)

3.0 d	M57306D3	173	02/07 →	⊗		MVB1885R6	6PK1885
3.0 sd	M57N306D5	210	09/07 →	⊗		MVB1885R6	6PK1885

Z3

1.8	M 43 B 18	85	10/95 → 10/98	☼ ⊗		MVB887R4	4PK887
						MVB1740R6	6PK1740
1.9	M 44 B 19	103	10/95 → 03/99	☼ ⊗		MVB887R4	4PK887
						MVB1740R6	6PK1740
	M 43 B 19, M43194E1	87	07/98 → 01/03	☼ ⊗		MVB887R4	4PK887
						MVB1740R6	6PK1740
M43194E1	85	01/99 → 01/03	☼ ⊗		MVB887R4 MVB1740R6	4PK887 6PK1740	
2.0	M 52 B (20 6 S4)	110	04/99 → 01/03	☼ ⊗	→10/00 →10/00	MVB906R5	5PK906
						MVB1538R6	6PK1538
2.2	M 54 B 22, M54226S1	125	08/00 → 01/03	☼ ⊗	Eng. M54226S1 Eng. M54226S1	MVB865R5	5PK865
						MVB1538R6	6PK1538
2.8	M 52 B 28	141	04/97 → 06/00	☼ ⊗ ⊗	→09/98 09/98 →	MVB906R5	5PK906
						MVB1550R6	6PK1550
						MVB1538R6	6PK1538
3.0	M54306S3	170	06/00 → 01/03	☼ ⊗	→07/02 →07/02	MVB865R5	5PK865
						MVB1538R6	6PK1538
M 3.2	S 50 B 32	236	03/97 → 06/01	☼ ☼ ⊗	A/C(-), 07/98 → A/C(+), 07/98 → 07/98 →	MVB788R5	5PK788
						MVB1120R5	5PK1120
						MVB1513R6	6PK1513
	S 54 B 32 (32 6 S4)	239	06/01 → 01/03	☼ ⊗		MVB830R5 MVB1460R6	5PK830 6PK1460

Z3 Coupe

2.8	M 52 B 28	141	07/97 → 06/00	☼ ⊗ ⊗	07/98 → 07/98 →09/98 09/98 →	MVB906R5	5PK906
						MVB1550R6	6PK1550
						MVB1538R6	6PK1538
3.0	M54306S3	170	06/00 → 06/03	☼ ⊗	→07/02 →07/02	MVB865R5	5PK865
						MVB1538R6	6PK1538



kW



...BMW

...Z3 Coupe

M 3.2	S 50 B 32	236	02/98 → 06/01		A/C(-)	MVB788R5	5PK788
					A/C(+)	MVB1120R5	5PK1120
						MVB1513R6	6PK1513
	S54326S4	239	06/01 → 06/03		→10/02	MVB830R5	5PK830
					→10/02	MVB1460R6	6PK1460

Z4 (E85)

2.0 i	N46B20A	110	04/05 →		A/C(-)	MVB1642R6	6PK1642
					A/C(+)	MVB1875R6	6PK1875
2.2 i	M54226S1	125	10/03 →		→10/05	MVB860R4	4PK860
					→10/05	MVB1450R6	6PK1450
2.5 i	M54256S5	141	02/03 →		→10/05	MVB860R4	4PK860
					→10/05	MVB1450R6	6PK1450
	N52B25A	130	01/06 →			MVB1833R6	6PK1833
2.5 si	N52B25A	160	01/06 →			MVB1833R6	6PK1833
3.0 i	M54306S3	170	02/03 →		→10/05	MVB860R4	4PK860
					→10/05	MVB1450R6	6PK1450
3.0 si	N52B30A	195	01/06 →			MVB1833R6	6PK1833
3.2 M	S54326S4	252	03/06 →			MVB830R5	5PK830
						MVB1460R6	6PK1460

Z4 Coupe

3.0 si	N52B30A	195	03/06 →			MVB1833R6	6PK1833
3.2 M	S54326S4	252	03/06 →			MVB1460R6	6PK1460

Z8

4.9	S 38 B 49	294	06/00 → 06/03			MVB975R5	5PK975
-----	-----------	-----	---------------	--	--	-----------------	--------

CARBODIES

FL2

2.3 D	22E	44	09/72 → 09/85		→04/85	SVB101100	10x1100
					→04/85	SVB131125	13x1125
					→04/85	SVB131150	13x1150
					→04/85	SVB131225	13x1225

FX4

2.3 D	22E	44	09/72 → 08/85		→04/85	SVB101100	10x1100
					→04/85	SVB131125	13x1125
					→04/85	SVB131150	13x1150
					→04/85	SVB131225	13x1225

FX4R

2.25 D	22E	44	01/82 → 12/85		→04/85	SVB101100	10x1100
					→04/85	SVB131125	13x1125
					→04/85	SVB131150	13x1150
					→04/85	SVB131225	13x1225

CHEVROLET

ALERO

2.4 16V		104	03/99 →		→02/02	MVB1215R5	5PK1215
3.4 V6	LA1	130	03/99 →		→09/04	MVB2205R6	6PK2205

AVEO Hatchback

1.2		62	04/08 →		PS	MVB960R4	4PK960
						MVB835R4	4PK835

AVEO Saloon

1.2		53	03/06 →			MVB950R4	4PK950
						MVB663R4	4PK663
						TB786	109x25
1.4	F14D3	69	03/06 →		A/C(-), MS	MVB884R6	6PK884
					A/C(+), PS	MVB1875R6	6PK1875
						TB458	127x25.4
						TBK298	



kW



...CHEVROLET

...AVEO Saloon

1.5		62	05/05 →	 KIT	→05/08 →05/08 →05/08	MVB1875R6 TB336 TBK008	6PK1875 111x17
-----	--	----	---------	------------------------	----------------------------	---	-------------------

BLAZER '94

4.3 V6 All-wheel Drive	L35	142	01/94 →	 	A/C(-), 10/94 →05/05 A/C(+), 10/94 →05/05	MVB2215R6 MVB2415R6	6PK2215 6PK2415
------------------------	-----	-----	---------	------	--	--------------------------------------	--------------------

BLAZER S10

2.2 AWD	LN2	90	10/94 → 09/97	 	A/C(-) A/C(+) A/C(-) A/C(+)	MVB1660R6 MVB1920R6 MVB1660R6 MVB1920R6	6PK1660 6PK1920 6PK1660 6PK1920
---------	-----	----	---------------	--------------	--------------------------------------	--	--

CAPTIVA

2.0 4WD		110	06/06 →	 		MVB2063R6 TB800	6PK2063 151x22
2.0 D		110	09/07 →	 		MVB2063R6 TB800	6PK2063 151x22
2.0 D 4WD		110	10/06 →	 		MVB2063R6 TB800	6PK2063 151x22
2.4	Z 24 SED	100	06/06 →	 	A/C(+), 12/06 → 12/06 →	MVB1885R6 TB524	6PK1885 171x24
		103	12/06 →	 	A/C(+)	MVB1885R6 TB524	6PK1885 171x24
2.4 4WD	Z 24 SED	100	06/06 →	 	A/C(+), 12/06 → 12/06 →	MVB1885R6 TB524	6PK1885 171x24
		103	12/06 →	 	A/C(+)	MVB1885R6 TB524	6PK1885 171x24
3.2 4WD	10 HM	169	06/06 →		12/06 →	MVB2403R6	6PK2403

EPICA (KL1_)

2.0		105	06/06 →			MVB1833R6	6PK1833
	T20SED	98	01/05 → 12/06	 KIT		MVB1885R6 TB783 TBK261	6PK1885 169x24
		94	01/05 → 12/06	 KIT		MVB1885R6 TB783 TBK261	6PK1885 169x24
2.0 D		110	01/07 →	 		TB800	151x22
2.5		115	06/06 →			MVB1833R6	6PK1833

EVANDA

2.0	X20SED	96	03/05 →	 KIT	→12/06 →12/06 →12/06	MVB1885R6 TB783 TBK261	6PK1885 169x24
-----	--------	----	---------	------------------------	----------------------------	---	-------------------

KALOS

1.2	B12S1	53	03/05 →	 	PS	MVB663R4 MVB950R4 TB786	4PK663 4PK950 109x25
1.4	F14S3	61	03/05 →	 KIT		MVB1875R6 TB336 TBK008	6PK1875 111x17
1.4 16V	F14D3	69	03/05 →	 KIT		MVB1875R6 TB458 TBK298	6PK1875 127x25.4

KALOS Saloon

1.4 16V	F14D3	69	03/05 →	 KIT		MVB1875R6 TB458 TBK298	6PK1875 127x25.4
---------	-------	----	---------	------------------------	--	---	---------------------



kW



CHEVROLET

...CHEVROLET

LACETTI

1.4 16V	F14D3	70	03/05 →	 		MVB1875R6 TB458 TBK298	6PK1875 127x25.4
1.6	F16D3	80	03/05 →	 		MVB1875R6 TB458 TBK298	6PK1875 127x25.4
1.8	T18SED	90	03/05 →	 	A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1885R6	6PK1885
		89	08/05 →	 	A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1885R6	6PK1885
2.0 D		89	01/07 →			TBK261 TB800	169x24 151x22

LOVA

1.6		69	08/05 →	 	A/C(-), MS, 11/06 →	MVB884R6	6PK884
					A/C(+), PS	MVB1875R6	6PK1875
						TB458 TBK298	127x25.4

MATIZ

0.8	F8CV	38	03/05 →	 	MS	MVB735R4	4PK735
						MVB683R3	3PK683
						TB491	107x25.4
						TBK317	
						MVB663R4	4PK663
1.0	B10S	47	03/05 →	 	A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB663R4	4PK663
						TB786	109x25
1.0	B10S1	49	03/05 →	 	A/C(-)	MVB715R4	4PK715
						MVB663R4	4PK663
						TB786	109x25
				 	A/C(-)	MVB715R4	4PK715

NUBIRA Estate

1.6	F16D3	80	03/05 →	 		MVB1875R6	6PK1875
						TB458	127x25.4
						TBK298	
1.8	T18SED	90	03/05 →	 		MVB1875R6	6PK1875
						MVB1885R6	6PK1885
						TB638	162x20
						TB783	169x24
						TBK240	
						TBK261	
2.0 D		89	01/07 →			TB800	151x22

NUBIRA Saloon

1.4		69	01/05 →	 		MVB1875R6	6PK1875
						TB458	127x25.4
						TBK298	
1.6	F16D3	80	03/05 →	 		MVB1875R6	6PK1875
						TB458	127x25.4
						TBK298	



kW



...CHEVROLET

...NUBIRA Saloon

1.8	T18SED	90	03/05 →			MVB1875R6	6PK1875
						MVB1885R6	6PK1885
					Eng. F18D3	TB638	162x20
					Eng. T18SED	TB783	169x24
					Eng. F18D3	TBK240	
					Eng. T18SED	TBK261	

REZZO

1.6	A16DMS	77	03/05 →			MVB1875R6	6PK1875
						TB458	127x25.4
						TBK298	
		79	08/05 →			MVB1875R6	6PK1875
						TB458	127x25.4
						TBK298	
2.0	T20SED	89	03/05 →		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1885R6	6PK1885
						TB783	169x24
						TBK261	
		90	08/05 →		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1885R6	6PK1885
						TB783	169x24
						TBK261	

S10 Pick Up

2.2	LN2	90	10/94 → 09/98		A/C(+)	MVB1920R6	6PK1920
		84	10/94 → 05/05		A/C(+)	MVB1920R6	6PK1920
2.2 AWD	LN2	90	10/94 → 09/98		A/C(+)	MVB1920R6	6PK1920
2.2 D AWD		68	10/83 → 09/85			SVB101300	10x1300
						SVB10990	10x990
						TB162	87x34
					MS	SVB101140	10x1140
2.8 AWD		98	10/85 → 09/91			SVB101200	10x1200
						MVB1325R4	4PK1325
					A/C(-)	SVB101225	10x1225
					A/C(+)	SVB101215	10x1215
4.3 AWD	LB4	119	10/87 → 09/91		A/C(-), 04/88 →	MVB2380R6	6PK2380
		119	10/94 → 09/95		A/C(-)	MVB2380R6	6PK2380
		127	10/95 → 09/98		A/C(-)	MVB2215R6	6PK2215
					A/C(+)	MVB2415R6	6PK2415

TAHOE (B2W)

4.8 V8		206	12/99 →		05/00 → 09/06	MVB960R4	4PK960
					Alt. 105A, 05/00 → 09/06	MVB2350R6	6PK2350
5.3	LM7	201	05/00 → 09/02		Alt. 105A	MVB2350R6	6PK2350
5.3 V8	LM7	201	12/99 →		Alt. 105A, 05/00 → 09/02	MVB2350R6	6PK2350

TRAILBLAZER (KC_)

4.2		201	09/01 →			MVB2325R6	6PK2325
-----	--	-----	---------	--	--	------------------	---------

TRANS SPORT

3.4	LA1	137	08/96 →		Alt. 105A, → 08/01	MVB1760R6	6PK1760
-----	-----	-----	---------	--	--------------------	------------------	---------

CHRYSLER

300 C

2.7	2.7FX	142	09/04 →			MVB2125R6	6PK2125
3.5	3.5CSP	183	09/04 →			MVB2100R6	6PK2100
5.7		250	09/04 →			MVB2100R6	6PK2100
6.1 SRT8		317	06/05 →			MVB2080R6	6PK2080

300 C Touring

2.7	2.7FX	142	09/04 →			MVB2125R6	6PK2125
3.5	3.5CSP	183	09/04 →			MVB2100R6	6PK2100
3.5 AWD	3.5CSP	183	09/04 →			MVB2100R6	6PK2100
5.7		250	09/04 →			MVB2100R6	6PK2100
5.7 AWD		250	04/05 →			MVB2100R6	6PK2100
6.1 SRT8		317	06/05 →			MVB2080R6	6PK2080



kw



CHRYSLER

...CHRYSLER

300 M (LR)

2.7 V6 24V	EER	149	11/98 → 08/00	☼		MVB1065R6	6PK1065
				☼		MVB1570R6	6PK1570
		150	08/00 → 09/04	☼		MVB1600R6	6PK1600
				☼		MVB1065R6	6PK1065
3.5 V6 24V	EGG	187	07/98 → 08/00	☼		MVB1570R6	6PK1570
				☼		MVB1600R6	6PK1600
		185	08/00 → 09/04	☼		SVB101400	10x1400
				☼		MVB1335R6	6PK1335
				☼		SVB101400	10x1400
				☼		MVB1335R6	6PK1335

LE BARON

2.2 i		69	09/86 → 12/94	☼	→12/88	SVB101215	10x1215
				☼	01/89→12/89	SVB101225	10x1225
				☼	01/90→	SVB101200	10x1200
				☼	→12/88	MVB1040R4	4PK1040
				☼	01/89→	MVB975R4	4PK975
				☼	→12/88	TB561	124x25
2.2 i Turbo		130	09/86 → 01/91	☼	→12/88	SVB101215	10x1215
				☼	01/89→12/89	SVB101225	10x1225
				☼	01/90→	SVB101200	10x1200
				☼	→12/88	MVB1040R4	4PK1040
				☼	01/89→	MVB975R4	4PK975
				☼	→12/88	TB561	124x25
2.5 i	EDM	75	09/86 → 12/94	☼	→12/88	SVB101215	10x1215
				☼	01/89→12/89	SVB101225	10x1225
				☼	01/90→	SVB101200	10x1200
				☼	→12/88	MVB1040R4	4PK1040
				☼	01/89→	MVB975R4	4PK975
				☼	→12/88	TB563	126x24
2.5 i Turbo	EDT	112	01/89 → 12/94	☼	→12/88	TB272	124x24
				☼	01/89→	SVB101050	10x1050
				☼	→12/91	SVB101050	10x1050
				☼	01/92→	SVB101090	10x1090
				☼	→12/89	SVB101225	10x1225
				☼	01/90→	SVB101200	10x1200
3.0 i V6		105	01/90 → 12/94	☼		MVB975R4	4PK975
				☼		TB272	124x24
				☼	→12/91	SVB101050	10x1050
				☼	01/92→	SVB101090	10x1090
				☼	01/91→12/91	SVB10960	10x960
				☼	01/92→12/93	SVB101000	10x1000
				☼	→12/90	SVB10990	10x990
				☼	01/91→	MVB1815R5	5PK1815
				☼		MVB2080R6	6PK2080
				☼		TB401	149x25.4



kW



...CHRYSLER

LE BARON Convertible

2.2 i Turbo		109	09/86 → 12/90	⚙️	→12/88	SVB101215	10x1215		
				⚙️	01/89 → 12/89	SVB101225	10x1225		
				⚙️	01/90 →	SVB101200	10x1200		
				⚙️	→12/88	MVB1040R4	4PK1040		
				⚙️	01/89 →	MVB975R4	4PK975		
				⚙️	→12/88	TB561	124x25		
				⚙️	01/89 →	TB272	124x24		
				⚙️		SVB101050	10x1050		
				130	09/86 → 12/90	⚙️	→12/88	SVB101215	10x1215
						⚙️	01/89 → 12/89	SVB101225	10x1225
						⚙️	01/90 →	SVB101200	10x1200
						⚙️	→12/88	MVB1040R4	4PK1040
						⚙️	01/89 →	MVB975R4	4PK975
						⚙️	→12/88	TB561	124x25
⚙️	01/89 →	TB272	124x24						
2.5 i		75	09/86 → 12/93	⚙️	→12/88	SVB101215	10x1215		
				⚙️	01/89 → 12/89	SVB101225	10x1225		
				⚙️	01/90 →	SVB101200	10x1200		
				⚙️	→12/88	MVB1040R4	4PK1040		
				⚙️	01/89 →	MVB975R4	4PK975		
				⚙️	→12/88	TB563	126x24		
				⚙️	01/89 →	TB272	124x24		
				⚙️	→12/91	SVB101050	10x1050		
				⚙️	01/92 →	SVB101090	10x1090		
				2.5 i Turbo	EDT	112	01/89 → 12/93	⚙️	→12/89
⚙️	01/90 →	SVB101200	10x1200						
⚙️		MVB975R4	4PK975						
⚙️		TB272	124x24						
⚙️	→12/91	SVB101050	10x1050						
⚙️	01/92 →	SVB101090	10x1090						
3.0 i V6	6G72	105	01/90 → 12/96	⚙️	→11/95	SVB10960	10x960		
				⚙️	01/91 → 12/91	SVB101000	10x1000		
				⚙️	01/92 → 12/93	SVB10990	10x990		
				⚙️	→12/90	MVB1815R5	5PK1815		
				⚙️	01/91 → 11/95	MVB2080R6	6PK2080		
				⚙️	→11/95	TB401	149x25.4		

NEON (PL)

1.8 16V		85	09/97 → 08/99	⚙️		MVB887R4	4PK887	
				⚙️		TB565	112x29	
				⚙️	A/C(-)	SVB101050	10x1050	
2.0 16V	420H	98	05/94 → 08/99	⚙️	A/C(+)	SVB101215	10x1215	
				⚙️		MVB850R4	4PK850	
				⚙️		MVB887R4	4PK887	
				⚙️	A/C(-)	SVB101050	10x1050	
				⚙️	A/C(+)	SVB101215	10x1215	
	107	06/94 → 08/99			⚙️		MVB850R4	4PK850
					⚙️		MVB887R4	4PK887
					⚙️	A/C(-)	SVB101050	10x1050
					⚙️	A/C(+)	SVB101215	10x1215
					420T	109	04/96 → 08/99	
⚙️		MVB887R4	4PK887					
⚙️	A/C(-)	SVB101050	10x1050					
⚙️	A/C(+)	SVB101215	10x1215					
⚙️		SVB101215	10x1215					



kW



CHRYSLER

...CHRYSLER

NEON II

1.6	EJD	85	11/01 →	⊗ ⊗	A/C(-), →09/05 A/C(+), →09/05	MVB890R6 MVB1450R6	6PK890 6PK1450
2.0 16V	420H	98	08/99 →	⊗ ⊗ ⊗	→09/05 A/C(-), →09/05 A/C(+), →09/05	MVB850R4 MVB1125R4 MVB1311R4	4PK850 4PK1125 4PK1311
2.0 16V R/T		110	10/01 →	⊗ ⊗ ⊗	→09/05 A/C(-), →09/05 A/C(+), →09/05	MVB850R4 MVB1125R4 MVB1311R4	4PK850 4PK1125 4PK1311

NEW YORKER

3.5 i 24V	F01	155	04/93 → 09/98	⊗ ⊗		SVB101400 MVB1335R6	10x1400 6PK1335
-----------	-----	-----	---------------	--------	--	------------------------	--------------------

PT CRUISER (PT_)

1.6	EJD	85	11/01 →	⊗ ⊗	A/C(-), 06/02 → A/C(+), 06/02 →	MVB884R6 MVB1440R6	6PK884 6PK1440
2.0	ECC	104	06/00 →	⊗ ⊗ ⊗ ⊗ ⊗		MVB850R4 TB682 MVB1125R4 MVB1311R4	4PK850 150x29 4PK1125 4PK1311
		100	10/04 →	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB850R4 TB682 MVB1125R4 MVB1311R4	4PK850 150x29 4PK1125 4PK1311
2.2 CRD	EDJ	89	03/02 →	⊗	→05/06	MVB1600R6	6PK1600
		110	08/05 →	⊗	→05/06	MVB1600R6	6PK1600
2.4	EDZ	110	06/00 →	⊗ ⊗ ⊗ ⊗ ⊗		MVB875R4 TB705 MVB1311R4 MVB1420R4	4PK875 146x28 4PK1311 4PK1420
		105	08/05 →	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), →06/02 A/C(+), →06/02	MVB875R4 TB705 MVB1311R4 MVB1420R4	4PK875 146x28 4PK1311 4PK1420
GT 2.4	EDV	164	08/03 →	⊗ ⊗		MVB875R4 TB705	4PK875 146x28

PT CRUISER Convertible

2.4	EDZ	105	03/04 →	⊗ ⊗		MVB875R4 TB705	4PK875 146x28
2.4 GT	EDV	164	03/04 →	⊗ ⊗		MVB875R4 TB705	4PK875 146x28

SEBRING (JR)

2.0	ECC	104	04/01 →	⊗ ⊗ ⊗	→10/05 →10/05 →10/05	MVB1335R6 TB682 MVB900R4	6PK1335 150x29 4PK900
2.4	EDZ	112	04/01 →	⊗ ⊗ ⊗ ⊗	→10/05 →10/05 →10/05 →10/05	MVB1335R6 TB705 MVB900R4	6PK1335 146x28 4PK900
2.7 V6 24V	EES	149	04/01 →	⊗ ⊗	→10/05 →10/05	MVB1400R6 MVB985R4	6PK1400 4PK985

SEBRING Convertible (JR)

2.0	ECC	104	04/01 →	⊗ ⊗ ⊗	→10/05 →10/05 →10/05	MVB1335R6 TB682 MVB900R4	6PK1335 150x29 4PK900
2.4	EDZ	112	04/01 →	⊗ ⊗ ⊗ ⊗	→10/05 →10/05 →10/05 →10/05	MVB1335R6 TB705 MVB900R4	6PK1335 146x28 4PK900
2.7 V6 24V	EES	149	04/01 →	⊗ ⊗	→10/05 →10/05	MVB1400R6 MVB985R4	6PK1400 4PK985



kW



...CHRYSLER

SEBRING Coupe

2.5 LE	EEB	120	05/95 → 09/00	☼ ⊗ ☼		MVB887R4 MVB1500R5 TB673	4PK887 5PK1500 187x32
--------	-----	-----	---------------	-------------	--	--------------------------------	-----------------------------

STRATUS (JA)

2.0 16V		98	12/95 →	⊗ ⊗	→09/00 →09/00	MVB1335R6 MVB900R4	6PK1335 4PK900
2.0 LE	C00	96	12/95 → 04/01	⊗ ⊗	→09/00 →09/00	MVB1335R6 MVB900R4	6PK1335 4PK900
2.4 16 V	EDZ	103	12/95 → 04/01	⊗ ☼ ⊗	→09/00 →09/00 →09/00	MVB1369R6 TB705 MVB900R4	6PK1369 146x28 4PK900
2.4 16V	EDZ	112	12/95 →	⊗ ☼ ⊗	→09/00 →09/00 →09/00	MVB1369R6 TB705 MVB900R4	6PK1369 146x28 4PK900
2.5 LX V6	H00	120	12/95 → 04/01	⊗ ☼ ⊗	→09/00 →09/00 →09/00	MVB1428R6 TB673 MVB970R4	6PK1428 187x32 4PK970
2.5 V6		125	12/95 →	⊗ ☼ ⊗	→09/00 →09/00 →09/00	MVB1428R6 TB673 MVB970R4	6PK1428 187x32 4PK970

STRATUS Convertible (JX)

2.0 LE	420X	96	06/96 → 04/01	⊗ ⊗	→09/00 →09/00	MVB1335R6 MVB900R4	6PK1335 4PK900
2.5 LX	625H	120	04/96 → 04/01	⊗ ☼ ⊗	→09/00 →09/00 →09/00	MVB1428R6 TB673 MVB970R4	6PK1428 187x32 4PK970

VIPER

8.0		290	08/92 →	⊗ ⊗	A/C(-), →12/96 A/C(+), →12/96	MVB1855R7 MVB1969R7	7PK1855 7PK1969
		299	08/92 →	⊗ ⊗	A/C(-), →12/96 A/C(+), →12/96	MVB1855R7 MVB1969R7	7PK1855 7PK1969

VIPER Convertible

8.0		290	08/92 →	⊗ ⊗	A/C(-), →12/96 A/C(+), →12/96	MVB1855R7 MVB1969R7	7PK1855 7PK1969
		299	08/92 →	⊗ ⊗	A/C(-), →12/96 A/C(+), →12/96	MVB1855R7 MVB1969R7	7PK1855 7PK1969

VISION

3.5 TSi	F00, F01	155	09/93 →	☼ ☼ ⊗	→12/94 01/95 → 09/98 →09/98	SVB101375 SVB101400 MVB1335R6	10x1375 10x1400 6PK1335
---------	----------	-----	---------	-------------	-----------------------------------	-------------------------------------	-------------------------------

VOYAGER I (ES)

2.5 i	K00	72	08/84 → 09/95	☼ ☼ ⊗ ⊗ ☼ ☼ ⊗ ⊗	PS 10/87 → 09/90 →09/90 01/89 → →12/87 01/88 → 12/88 01/89 → 10/87 → 09/90	SVB10840 SVB101200 SVB101215 MVB1040R4 MVB975R4 TB562 TB563 TB272 SVB101090 SVB101050	10x840 10x1200 10x1215 4PK1040 4PK975 126x24 126x24 124x24 10x1090 10x1050
	K	74	08/90 → 09/95	☼ ☼ ⊗ ☼ ⊗	PS →09/98	SVB10840 SVB101200 MVB975R4 TB272 SVB101090	10x840 10x1200 4PK975 124x24 10x1090
2.5 TD	09B, M00	87	01/92 → 09/95	⊗ ⊗	Eng. ENC Eng. ENC	MVB1200R5 MVB788R5	5PK1200 5PK788



kW



CHRYSLER

...CHRYSLER

...VOYAGER I (ES)

3.0		104	10/90 → 09/95	☼	→12/91	SVB10960	10x960
				☼	01/92→12/92	SVB10990	10x990
				☼	01/93→	SVB10950	10x950
				⊗		MVB2080R6	6PK2080
				⊗	→12/90	MVB1815R5	5PK1815
				☞☞		TB401	149x25.4
		100	10/87 → 09/99	⊗	Alt. 90A, →09/90	MVB1815R5	5PK1815
		101	10/87 → 09/90	☼		SVB10960	10x960
				⊗	Alt. 90A	MVB1815R5	5PK1815
				☞☞		TB401	149x25.4
3.0 i	300, 6G72	108	08/84 → 09/95	☼	01/92→12/92	SVB10990	10x990
				☼	01/93→	SVB10950	10x950
				☼	10/87→12/91	SVB10960	10x960
				⊗	01/91→	MVB2080R6	6PK2080
				⊗	10/87→12/90	MVB1815R5	5PK1815
				☞☞	10/87→	TB401	149x25.4
3.3		112	10/89 → 09/90	⊗	A/C(-)	MVB2490R6	6PK2490
				⊗	A/C(+)	MVB2510R6	6PK2510
3.3 i	EGA	110	08/90 → 09/95	⊗	A/C(-)	MVB2490R6	6PK2490
				⊗	A/C(+)	MVB2510R6	6PK2510
		120	08/90 → 09/95	⊗	A/C(-)	MVB2490R6	6PK2490
				⊗	A/C(+)	MVB2510R6	6PK2510
3.3 i AWD	EGA	110	08/90 → 09/95	⊗	A/C(-)	MVB2490R6	6PK2490
				⊗	A/C(+)	MVB2510R6	6PK2510
	R00	120	08/90 → 09/95	⊗	A/C(-)	MVB2490R6	6PK2490
				⊗	A/C(+)	MVB2510R6	6PK2510

VOYAGER II (GS)

2.0 i	C00	98	01/95 → 03/01	⊗	A/C(-), 10/95→09/00	MVB1015R6	6PK1015
				⊗	A/C(+), 10/95→09/00	MVB1335R6	6PK1335
				☞☞	10/95→09/00	TB565	112x29
				⊗	01/98→09/00	MVB905R4	4PK905
				⊗	10/95→12/97	MVB900R4	4PK900
2.4 AWD		111	02/97 → 03/01	⊗	A/C(-), →09/00	MVB1045R6	6PK1045
				⊗	A/C(+), →09/00	MVB1420R6	6PK1420
				☞☞	→09/00	TB705	146x28
				⊗	→09/00	MVB905R4	4PK905
2.4 i	B00	111	01/95 → 03/01	⊗	A/C(-), 10/95→09/00	MVB1045R6	6PK1045
				⊗	A/C(+), 10/95→09/00	MVB1420R6	6PK1420
				☞☞	10/95→09/00	TB705	146x28
				⊗	10/95→09/00	MVB905R4	4PK905
2.5 TD	425 CLIRS/X	85	01/95 → 03/01	⊗	10/95→09/00	MVB1400R7	7PK1400
				⊗	10/95→09/00	MVB2050R6	6PK2050
				⊗	10/95→09/00	MVB2275R8	8PK2275
				☞☞	10/95→12/98	MVB960R3	3PK960
2.5 TDiC AWD	ENC	85	10/95 → 03/01	⊗	→09/00	MVB1400R7	7PK1400
				⊗	→09/00	MVB2050R6	6PK2050
				⊗	→09/00	MVB2275R8	8PK2275
				☞☞	→12/98	MVB960R3	3PK960
3.3 i	R00	116	01/95 → 03/01	⊗	A/C(-), 10/95→09/00	MVB2510R6	6PK2510
				⊗	A/C(+), 10/95→09/00	MVB2460R6	6PK2460
3.8 i AWD	L00	122	01/95 → 03/01	⊗	A/C(-), 10/95→09/00	MVB2510R6	6PK2510
				⊗	A/C(+), 10/95→09/00	MVB2460R6	6PK2460
	EGH	131	01/95 → 03/01	⊗	A/C(-), 10/95→09/00	MVB2510R6	6PK2510
				⊗	A/C(+), 10/95→09/00	MVB2460R6	6PK2460

VOYAGER III (RG)

2.4	EDZ	108	02/00 →	⊗	10/00→05/07	MVB1250R6	6PK1250
				☞☞	10/00→05/07	TB705	146x28
				⊗	10/00→05/07	MVB900R4	4PK900
				⊗	10/00→05/07	MVB905R4	4PK905





kW



...CHRYSLER

...VOYAGER III (RG)

2.5 CRD	ENC, ENJ	105	02/00 →		Eng. ENJ, 10/00 → 05/07	MVB1420R6	6PK1420
					10/00 → 05/07	TB719	220x28
		88	08/05 →		→ 05/07	MVB1420R6	6PK1420
					→ 05/07	TB719	220x28
2.8 CRD	ENR	110	06/04 →		→ 05/07	MVB1420R6	6PK1420
					→ 05/07	TB719	220x28
3.3	EGA	128	02/00 →		10/00 → 05/07	MVB2100R6	6PK2100
					10/00 → 05/07	MVB2460R6	6PK2460
3.3 AWD	EGA	128	02/00 →		10/00 → 05/07	MVB2100R6	6PK2100
					10/00 → 05/07	MVB2460R6	6PK2460
3.8	EGH	160	02/00 →		A/C(-), → 09/00	MVB2510R6	6PK2510
					A/C(+), → 09/00	MVB2460R6	6PK2460
3.8 AWD		160	02/00 →		A/C(-), → 09/00	MVB2510R6	6PK2510
					A/C(+), → 09/00	MVB2460R6	6PK2460

CITROËN

2 CV

4	A 53	12	03/63 → 02/70		09/65 →	SVB10750	10x750	
						SVB10750	10x750	
6	M28/1 (AK2)	17	01/70 → 12/75			SVB10750	10x750	
		A06/664	20	08/79 → 07/90			SVB10750	10x750
		A06/635, A06/664	21	02/70 → 10/85			SVB10750	10x750

ACADIANE

6	M28 (AM2)	23	08/78 → 10/88		→ 12/87	SVB10750	10x750
					→ 12/87	SVB10750	10x750

AX (ZA-_)

1.3 Sport	M4A	70	04/87 → 12/88		A/C(-)	SVB10710	10x710
					A/C(+), → Ch. 5283	MVB1020R4	4PK1020
						TB304	104x17
						TBK005	
1.4 GTi	KFY (TU3FJ2)	66	08/91 → 12/96		A/C(-)	SVB10710	10x710
					A/C(+), Ch. 05284 →	MVB1030R5	5PK1030
						TB259	108x17
	KFZ (TU3FJ2)	69	06/91 → 12/96		A/C(-)	SVB10710	10x710
					A/C(+), Ch. 05284 →	MVB1030R5	5PK1030
						TB376	101x17
		74	06/91 → 12/92		A/C(-)	SVB10710	10x710
					A/C(+)	MVB1030R5	5PK1030
						TB376	101x17
10	CDY (TU9M)	33	07/86 → 12/98		→ 05/95	SVB10710	10x710
					→ 05/95	TB304	104x17
					→ 05/95	TBK005	
	CDZ (TU9M)	37	02/87 → 12/98		→ 04/97	SVB10710	10x710
					→ 04/97	TB304	104x17
					→ 04/97	TBK005	
C1A	32	09/86 → 06/92			SVB10710	10x710	
					TB304	104x17	
					TBK005		
10 E	C3A	30	12/86 → 12/88			SVB10710	10x710
						TB304	104x17
						TBK005	
11	H1B	40	12/86 → 04/94			SVB10710	10x710
						TB304	104x17
	H1B, HDZ (TU1M)	44	09/86 → 12/97		→ 04/97	SVB10710	10x710
					→ 04/97	TB304	104x17
					→ 04/97	TBK005	



kW



CITROËN

...CITROËN

...AX (ZA-)

11 4x4	H1A	40	06/91 → 07/92	⊗	A/C(-)	SVB10710	10x710
						TB304	104x17
				KIT		TBK005	
11 CAT	HAZ (TU1CP)	40	09/88 → 12/89	⊗	A/C(-)	SVB10710	10x710
						TB304	104x17
				KIT		TBK005	
14	KAY (TU3CP)	44	12/86 → 12/88	⊗	A/C(-)	SVB10710	10x710
				⊗	A/C(+), → Ch. 05283	MVB1020R4	4PK1020
						TB259	108x17
	K2A, K2B	62	01/88 → 12/92	⊗	A/C(-)	SVB10710	10x710
				⊗	A/C(+), →04/91, → Ch. 05283	MVB1020R4	4PK1020
				⊗	A/C(+), 04/91→, Ch. 05284→	MVB1030R5	5PK1030
	K1F	49	06/88 → 12/89	⊗	A/C(-)	SVB10710	10x710
				⊗	A/C(+), → Ch. 05283	MVB1020R4	4PK1020
						TB259	108x17
	KDX (TU3M/Z), KDY (TU3FM), KDY (TU3M), KDZ (TU3M/Z)	55	04/87 → 04/97	⊗	A/C(-)	SVB10710	10x710
				⊗	A/C(+), →04/91, → Ch. 05283	MVB1020R4	4PK1020
				⊗	A/C(+), 04/91→	MVB1030R5	5PK1030
				08/92→05/95, TU3F	TB259	108x17	
					TB376	101x17	
KIT				08/92→05/95, TU3F	TBK007		
14 4x4	KDX (TU3M/Z), KDY (TU3FM), KDY (TU3M), KDZ (TU3M/Z)	55	08/91 → 12/96	⊗	A/C(-)	SVB10710	10x710
				⊗	A/C(+)	MVB1030R5	5PK1030
					08/92→05/95, TU3F	TB376	101x17
						TB259	108x17
				KIT	08/92→05/95, TU3F	TBK004	
14 D	K9A (TUD3)	38	09/88 → 06/92	⊗	V-belt pulley (+)	SVB10700	10x700
				⊗	V-ribbed belt pulley (+)	MVB688R5	5PK688
						TB245	143x25.4
	K9Y (TUD3Y)	37	08/91 → 12/97	⊗	V-belt pulley (+), →05/95	SVB10700	10x700
				⊗	V-ribbed belt pulley (+), →05/95	MVB688R5	5PK688
15 D	VJY (TUD5)	40	08/94 → 12/97	⊗	MS, →04/97	MVB775R5	5PK775
				⊗	PS, →04/97	MVB960R5	5PK960
					→04/97	TB457	136x25.4
	VJZ (TUD5)	43	08/94 → 12/97	⊗	MS, →04/97	TBK041	
				⊗	PS, →04/97	MVB775R5	5PK775
					→04/97	MVB960R5	5PK960
				KIT	→04/97	TB457	136x25.4
					TBK041		

AXEL

0.7	G11/631	25	10/81 → 03/91	⊗	07/84→06/87	SVB10775	10x775
		24	07/84 → 06/87	⊗		SVB10775	10x775
11	G11/631	42	01/84 → 03/91	⊗	07/84→06/89	SVB10635	10x635
		45	01/84 → 03/91	⊗	07/84→06/89	SVB10635	10x635



kW



...CITROËN

BERLINGO

1.6		66	04/08 →		A/C(-)	MVB1200R6	6PK1200
					A/C(+)	MVB1700R6	6PK1700
80		80	04/08 →			TB700	134x25.4
						TBK319	
					A/C(-)	MVB1200R6	6PK1200
					A/C(+)	MVB1700R6	6PK1700
						TB700	134x25.4
						TBK319	

BERLINGO (MF)

1.1 i (MFHDZ)	HDZ (TU1M), HFX (TU1JP)	44	07/96 →		A/C(-), MS, V-belt pulley (+), 06/00→10/02	SVB10710	10x710		
					A/C(-), MS, V-ribbed belt pulley (+), 06/00→10/02	MVB710R5	5PK710		
					Eng. TU1JP, A/C(+), 06/00→10/02	MVB855R4	4PK855		
					06/00→10/02, → Eng Nr 3762433	TB304	104x17		
					06/00→10/02, Eng Nr 3762434→	TB699	100x17		
					Eng. TU1JP, 06/00→10/02, → Eng Nr 3762433	TBK005			
					Eng. TU1JP, 06/00→10/02, Eng Nr 3762434→	TBK316			
					A/C(-), 06/00→07/01, → Ch. 09023	MVB875R5	5PK875		
1.4		53	11/02 → 10/05		A/C(-)	MVB1450R6	6PK1450		
					A/C(+)	MVB1560R6	6PK1560		
						TB711	104x17		
					Auto Tensioner	TBK312			
				54	05/05 →		A/C(-), →05/08	MVB1450R6	6PK1450
							A/C(+), →05/08	MVB1560R6	6PK1560
							→05/08	TB711	104x17
							→05/08	TBK312	
1.4 bivalent		48	11/02 →		A/C(-), →05/08	MVB1450R6	6PK1450		
					A/C(+), →10/05, → Ch. 10562	MVB1560R6	6PK1560		
					A/C(+), 05/05→05/08, Ch. 10563→	MVB1560R6	6PK1560		
					→05/08	TB711	104x17		
					→05/08	TBK312			
				1.4 GNC		48	11/02 →		A/C(-), →05/08
	A/C(+), →05/08	MVB1560R6	6PK1560						
	→05/08	TB711	104x17						
	Auto Tensioner, →05/08	TBK312							



kw



CITROËN

...CITROËN
...BERLINGO (MF)

1.4 i (MFKFX)	KFW (TU3JP), KFX (TU3JP)	55	07/96 →	⊗	A/C(-), MS, V-belt pulley (+), 11/96→10/02	SVB10710	10x710
				⊗	A/C(-), MS, V-ribbed belt pulley (+), 11/96→10/02	MVB710R5	5PK710
				⊗	A/C(+), 11/96→10/02	MVB855R4	4PK855
					11/96→10/02, → Eng Nr 3666765	TB259	108x17
				 	11/96→10/02, Eng Nr 3666766→ 11/96→10/02, → Eng Nr 3666765	TB711 TBK007	104x17
1.4 i bivalent		55	04/03 →	 	Auto Tensioner, 11/96→10/02, Eng Nr 3666766→	TBK312	
				⊗	A/C(-), 07/01→10/02, Ch. 09024→	MVB865R5	5PK865
				⊗	A/C(-), 11/96→07/01, → Ch. 09023	MVB875R5	5PK875
				⊗	A/C(+), 11/96→10/02	MVB1255R5	5PK1255
				⊗	A/C(-), →05/08	MVB1450R6	6PK1450
1.6		81	11/02 →	⊗	A/C(+), →10/05, → Ch. 10562	MVB1560R6	6PK1560
				⊗	A/C(+), 10/05→05/08, Ch. 10563→	MVB1560R6	6PK1560
				 	→05/08	TB711	104x17
				 	Auto Tensioner, →05/08	TBK312	
				⊗	A/C(-), →05/08	MVB1450R6	6PK1450
1.6 16V (MNFU)	NFU (TU5JP4)	80	10/00 →	⊗	A/C(+), →10/05, → Ch. 10562	MVB1560R6	6PK1560
				⊗	A/C(+), 10/05→05/08, Ch. 10563→	MVB1560R6	6PK1560
				 	→05/08	TB700	134x25.4
				 	→05/08, → Eng Nr 1806404	TBK318	
				 	→08/07, Eng Nr 1806405→, → Ch. 11253	TBK319	
1.8 D (MFA9A)	A9A (XUD7)	43	07/98 →	⊗	A/C(-), →05/08	MVB1450R6	6PK1450
				⊗	A/C(+), →10/05, → Ch. 10562	MVB1560R6	6PK1560
				⊗	A/C(+), 10/05→05/08, Ch. 10563→	MVB1560R6	6PK1560
				 	→05/08	TB700	134x25.4
				 	→05/08, → Eng Nr 1806404	TBK318	
1.8 i (MFLFX)	LFX (XU7JB)	66	05/97 →	 	→08/07, Eng Nr 1806405→, → Ch. 11253	TBK319	
				⊗	MS, →10/02	MVB800R5	5PK800
				⊗	PS, →10/02	MVB855R4	4PK855
				 	→10/02, → Eng Nr 1806404	TB700	134x25.4
				 	→10/02, Eng Nr 1806405→	TBK318 TBK319	
1.8 D (MFA9A)	A9A (XUD7)	43	07/98 →	⊗	A/C(-), →07/01, → Ch. 09023	MVB875R5	5PK875
				⊗	A/C(-), 07/01→10/02, Ch. 09024→	MVB865R5	5PK865
				⊗	A/C(+), →09/01	MVB1255R5	5PK1255
				⊗	A/C(+), 09/01→10/02	MVB1225R5	5PK1225
				⊗	A/C(-), MS, →10/02	MVB730R6	6PK730
1.8 i (MFLFX)	LFX (XU7JB)	66	05/97 →	⊗	A/C(-), PS, →10/02	MVB1115R6	6PK1115
				⊗	A/C(+), MS, →10/02	MVB1165R6	6PK1165
				⊗	A/C(+), PS, →10/02	MVB1740R6	6PK1740
				 	→10/02	TB175	136x25.4
				 	→10/02	TBK020	
1.8 i (MFLFX)	LFX (XU7JB)	66	05/97 →	⊗	A/C(-), →10/02	MVB1080R6	6PK1080
				⊗	A/C(+), →10/02	MVB1660R6	6PK1660
					→10/02	TB419	114x17
				 	→10/02	TBK010	



kW



...CITROËN

...BERLINGO (MF)

1.8 i 4WD (MFLFX)	LFX (XU7JB)	66	04/97 →	 KIT	A/C(-), →10/02 A/C(+), →10/02 →10/02 →10/02	MVB1080R6 MVB1660R6 TB419 TBK010	6PK1080 6PK1660 114x17
1.9 D (MFDJY)	D9B (XUD9A/L), DJY (XUD9A)	50	07/96 →	 KIT	A/C(-), MS, →01/99 A/C(-), PS, →01/99 A/C(+), MS, →01/99 A/C(+), PS, →01/99 →01/99 →01/99	MVB730R6 MVB1115R6 MVB1165R6 MVB1740R6 TB175 TBK020	6PK730 6PK1115 6PK1165 6PK1740 136x25.4
1.9 D (MFWJZ)	WJY (DW8B), WJZ (DW8)	51	07/98 →	 KIT	A/C(-), MS, →10/02 A/C(-), PS, →10/99, → Ch. 8399 A/C(-), PS, 10/99→10/02 Eng. DW8B, A/C(+), MS, →10/02 Eng. DW8B, A/C(+), PS, →10/02 →10/02 Eng. DW8B, →10/02	MVB860R6 MVB1388R6 MVB1440R6 MVB1035R6 MVB1755R6 TB631 TBK105	6PK860 6PK1388 6PK1440 6PK1035 6PK1755 140x25.4
1.9 D 4WD (MFWJZ)	WJZ (DW8)	51	07/98 →	 KIT	A/C(-), MS, →10/02 A/C(-), PS, →10/99, → Ch. 8399 A/C(-), PS, 10/99→10/02 A/C(+), MS, →10/02 A/C(+), PS, →10/02 →10/02 →10/02	MVB860R6 MVB1388R6 MVB1440R6 MVB1035R6 MVB1755R6 TB631 TBK105	6PK860 6PK1388 6PK1440 6PK1035 6PK1755 140x25.4
2.0 HDi		66	11/02 → 10/05	 KIT	A/C(-) A/C(+)	MVB1469R6 MVB1740R6 TB632 TBK274	6PK1469 6PK1740 141x25.4
2.0 HDi 90 (MFRHY)	RHY (DW10TD)	66	12/99 →	 KIT KIT	A/C(-), →10/02 A/C(+), →10/02 →10/02 →10/00, → Ch. 8735 10/00 →10/02, Ch. 8736 →	MVB1469R6 MVB1755R6 TB632 TBK106 TBK274	6PK1469 6PK1755 141x25.4

BERLINGO Box

1.6		66	04/08 →	 KIT	A/C(-) A/C(+)	MVB1200R6 MVB1700R6 TB700 TBK319	6PK1200 6PK1700 134x25.4
		80	04/08 →	 KIT	A/C(-), →05/08 A/C(+), →05/08, Ch. 10563→ →05/08 →05/08, → Eng Nr 1806404	MVB1450R6 MVB1560R6 TB700 TBK318	6PK1450 6PK1560 134x25.4
1.6 HDi 75		55	04/08 →	 KIT	A/C(-) A/C(+)	MVB1352R6 MVB1708R6 TB724 TBK302	6PK1352 6PK1708 137x25.4
1.6 HDi 90		66	04/08 →	 KIT	A/C(-) A/C(+)	MVB1352R6 MVB1708R6 TB724 TBK302	6PK1352 6PK1708 137x25.4



kw



CITROËN

...CITROËN

BERLINGO Box (M_)

Engine	Model	Power (kw)	Year	Accessories	Options	Part Numbers	Dimensions						
1.1 i (MAHDZ, MBHDZ)	HDZ (TU1M)	44	07/96 →		A/C(-), 11/02 →05/08	MVB1450R6	6PK1450						
					A/C(-), MS, V-belt pulley (+), →10/02	SVB10710	10x710						
						A/C(-), MS, V-ribbed belt pulley (+), →10/02	MVB710R5	5PK710					
						A/C(+), →10/02	MVB855R4	4PK855					
						A/C(+), 10/05 →05/08, Ch. 10563 →	MVB1560R6	6PK1560					
						A/C(+), 11/02 →10/05, → Ch. 10562	MVB1560R6	6PK1560					
						→05/08	TB699	100x17					
						→10/02, → Eng Nr 3762433	TB304	104x17					
						→05/08	TBK316						
						→10/02, → Eng Nr 3762433	TBK005						
						A/C(-), →07/01, → Ch. 09023	MVB875R5	5PK875					
						A/C(-), 07/01 →10/02, Ch. 09024 →	MVB865R5	5PK865					
					1.4 bivalent		48	11/02 →		A/C(+), →10/02	MVB1255R5	5PK1255	
										A/C(-), →05/08	MVB1450R6	6PK1450	
	A/C(+), →10/05	MVB1560R6	6PK1560										
	A/C(+), 10/05 →05/08, Ch. 10563 →	MVB1560R6	6PK1560										
	→05/08	TB711	104x17										
	Auto Tensioner, →05/08	TBK312											
1.4 i (MBKFX)	KFW (TU3JP), KFX (TU3JP)	55	07/96 →							A/C(-), MS, V-belt pulley (+), →10/02	SVB10710	10x710	
											A/C(-), MS, V-ribbed belt pulley (+), →10/02	MVB710R5	5PK710
											A/C(+), →10/02	MVB855R4	4PK855
											→10/02, → Eng Nr 3666765	TB259	108x17
											→10/02, Eng Nr 3666766 →	TB711	104x17
											→10/02, → Eng Nr 3666765	TBK007	
											Auto Tensioner, →10/02, Eng Nr 3666766 →	TBK312	
											A/C(-), →07/01, → Ch. 09023	MVB875R5	5PK875
					A/C(-), 07/01 →10/02, Ch. 09024 →	MVB865R5	5PK865						
					1.4 i bivalent	KFW (TU3JP)	55	04/03 →		A/C(+), →10/02	MVB1255R5	5PK1255	
										A/C(-), →05/08	MVB1450R6	6PK1450	
											A/C(+), →10/05, → Ch. 10562	MVB1560R6	6PK1560
											A/C(+), 10/05 →05/08, Ch. 10563 →	MVB1560R6	6PK1560
											→05/08	TB711	104x17
Auto Tensioner, →05/08	TBK312												
1.6 16V	NFU (TU5JP4)	80	10/00 →							A/C(-), 11/02 →05/08	MVB1450R6	6PK1450	
											A/C(+), 10/05 →05/08, Ch. 10563 →	MVB1560R6	6PK1560
											A/C(+), 11/02 →10/05, → Ch. 10562	MVB1560R6	6PK1560
											11/02 →05/08	TB700	134x25.4
											11/02 →05/08, → Eng Nr 1806404	TBK318	
											11/02 →08/07, Eng Nr 1806405 →, → Ch. 11253	TBK319	
											A/C(-), →05/08	MVB1352R6	6PK1352
											A/C(-), →10/05	MVB1335R6	6PK1335
					A/C(+), →05/08	MVB1708R6	6PK1708						
					→05/08	TB724	137x25.4						
					→05/08	TBK302							



kW



...CITROËN

...BERLINGO Box (M_)

1.6 HDI 90	DV6ATED4	66	07/05 →		A/C(-), →05/08, Ch. 10571→	MVB1352R6	6PK1352
					A/C(-), →10/05, → Ch. 10570	MVB1335R6	6PK1335
					A/C(+), →05/08	MVB1708R6	6PK1708
					→05/08	TB724	137x25.4
					→05/08	TBK302	
1.8 D (MBA9A, MCA9A)	A9A (XUD7)	43	07/96 →		A/C(-), MS, →10/99	MVB730R6	6PK730
					A/C(-), PS, →10/99	MVB1115R6	6PK1115
					A/C(+), MS, →10/99	MVB1165R6	6PK1165
					A/C(+), PS, →10/99	MVB1740R6	6PK1740
					→10/99	TB175	136x25.4
					→10/99	TBK020	
1.8 i	LFX (XU7JB)	66	08/99 → 10/02		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
1.9 D	DJY (XUD9A)	51	07/96 →		A/C(-), MS, →10/99	MVB730R6	6PK730
					A/C(-), PS, →10/99	MVB1115R6	6PK1115
					A/C(+), MS, →10/99	MVB1165R6	6PK1165
					A/C(+), PS, →10/99	MVB1740R6	6PK1740
					→10/99	TB175	136x25.4
					→10/99	TBK020	
1.9 D 70 4WD	WJZ (DW8)	51	07/98 →		A/C(-), 10/99→10/05	MVB1440R6	6PK1440
					A/C(-), MS, →10/02	MVB860R6	6PK860
					A/C(-), PS, →10/99, → Ch. 8399	MVB1388R6	6PK1388
					A/C(+), 11/02→10/05	MVB1675R6	6PK1675
					A/C(+), MS, →10/02	MVB1035R6	6PK1035
					A/C(+), PS, →10/02	MVB1755R6	6PK1755
					→10/05	TB631	140x25.4
					→10/05	TBK105	
1.9 D 70 (MBWJZ, MCWJZ)	WJZ (DW8)	51	04/99 →		A/C(-), 10/99→10/05	MVB1440R6	6PK1440
					A/C(-), MS, →10/02	MVB860R6	6PK860
					A/C(-), PS, →10/99, → Ch. 8399	MVB1388R6	6PK1388
					A/C(+), 11/02→10/05	MVB1675R6	6PK1675
					A/C(+), MS, →10/02	MVB1035R6	6PK1035
					A/C(+), PS, →10/02	MVB1755R6	6PK1755
					→10/05	TB631	140x25.4
					→10/05	TBK105	
2.0 HDI 90 4WD	RHY (DW10TD)	66	11/00 →		A/C(-), 11/02→10/05	MVB1469R6	6PK1469
					A/C(+), 11/02→10/05	MVB1740R6	6PK1740
					11/02→10/05	TB632	141x25.4
					11/02→10/05	TBK274	
2.0 HDI 90 (MBRHY, MCRHY)	RHY (DW10TD)	66	12/99 →		A/C(-), →10/05	MVB1469R6	6PK1469
					A/C(+), →10/02	MVB1755R6	6PK1755
					A/C(+), 11/02→10/05	MVB1740R6	6PK1740
					→10/05	TB632	141x25.4
					→10/00, → Ch. 8735	TBK106	
					10/00→10/05	TBK274	

BX (XB-)

1.8 D	161 (XUD7)	44	10/85 → 09/93		A/C(-), AUTO	MVB710R5	5PK710
					A/C(-), MAN	MVB700R4	4PK700
					A/C(+), →06/87, → Ch. 3857	MVB970R5	5PK970
					A/C(+), 01/88→10/88, Ch. 4071→4357	MVB1230R4	4PK1230
					A/C(+), 10/88→, Ch. 4357→	MVB1230R5	5PK1230
					A/C(+)	MVB1130R6	6PK1130
						TB175	136x25.4
						TBK019	
						SVB10625	10x625



kw



CITROËN

...CITROËN

...BX (XB-_)

11		42	10/86 → 06/92	②	→05/88, → Ch. 4205	SVB10913	10x913				
				②	05/88→01/92, Ch. 4206→	SVB10800	10x800				
HDZ (TU1M)		40	10/88 → 06/92	②	→01/92	TB304	104x17				
				②	→01/92	TBK005					
				⊕	→01/92	SVB10775	10x775				
				②	→01/92, Ch. 4206→	SVB10800	10x800				
				②	→01/92	TB304	104x17				
				②	→01/92	TBK005					
				⊕	→01/92	SVB10775	10x775				
				14	KDY (TU3M), KDZ (TU3M/Z)	55	01/89 → 02/93	②	Ch. 4193→	SVB10800	10x800
								②		TB259	108x17
								②	TU3F	TB376	101x17
②		TBK007									
②	TU3F	TBK004									
⊕	Ch. 4193→	SVB10710	10x710								
K1H (TU3A)		47	01/89 → 12/89					②	Ch. 4193→	SVB10800	10x800
								②		TB259	108x17
								②	TU3F	TB376	101x17
								②		TBK007	
				②	TU3F	TBK004					
				⊕	Ch. 4193→	SVB10710	10x710				
				14 E	150A	45	10/82 → 06/88	②	→ Ch. 4192	SVB10913	10x913
								②	05/88→, Ch. 4193→	SVB10800	10x800
								②		TB259	108x17
								②	TU3F	TB376	101x17
②		TBK007									
②	TU3F	TBK004									
⊕	→ Ch. 4192	SVB10775	10x775								
⊕	05/88→, Ch. 4193→	SVB10710	10x710								
150F		49	09/85 → 02/93					②	→05/88, → Ch. 4192	SVB10913	10x913
								②	05/88→, Ch. 4193→	SVB10800	10x800
				②		TB259	108x17				
				②	TU3F	TB376	101x17				
				②		TBK007					
				②	TU3F	TBK004					
				⊕	→05/88, → Ch. 4192	SVB10775	10x775				
				⊕	05/88→, Ch. 4193→	SVB10710	10x710				
				150C		52	04/83 → 07/89	②	→05/88, → Ch. 4192	SVB10913	10x913
								②	05/88→, Ch. 4193→	SVB10800	10x800
②		TB259	108x17								
②	TU3F	TB376	101x17								
②		TBK007									
②	TU3F	TBK004									
⊕	→05/88, → Ch. 4192	SVB10775	10x775								
⊕	05/88→, Ch. 4193→	SVB10710	10x710								
		53	04/83 → 02/93					②	→05/88, → Ch. 4192	SVB10913	10x913
								②	05/88→, Ch. 4193→	SVB10800	10x800
				②		TB259	108x17				
				②	TU3F	TB376	101x17				
				②		TBK007					
				②	TU3F	TBK004					
				⊕	→05/88, → Ch. 4192	SVB10775	10x775				
				⊕	05/88→, Ch. 4193→	SVB10710	10x710				
				15	B1E (XU51C)	59	10/87 → 05/92	②	A/C(-)	MVB960R4	4PK960
								②	A/C(+)	MVB1245R4	4PK1245
②	→01/92, → Ch. 5545	TB226	113x17								
②	01/92→, Ch. 5546→	TB419	114x17								
②	→01/92, → Ch. 5545	TBK009									
②	01/92→, Ch. 5546→	TBK010									
⊕		SVB10800	10x800								



kW



...CITROËN

...BX (XB-)

CITROËN

16	B1E (XU51C)	53	01/87 → 02/93		A/C(-)	MVB960R4	4PK960
					A/C(+)	MVB1245R4	4PK1245
					→01/92, → Ch. 5545	TB226	113x17
					01/92 →, Ch. 5546 →	TB419	114x17
					→01/92, → Ch. 5545	TBK009	
					01/92 →, Ch. 5546 →	TBK010	
						SVB10800	10x800
171D	64	07/85 → 02/93			A/C(-)	MVB960R4	4PK960
					A/C(+)	MVB1245R4	4PK1245
					→01/92, → Ch. 5545	TB226	113x17
					01/92 →, Ch. 5546 →	TB419	114x17
					→01/92, → Ch. 5545	TBK009	
					01/92 →, Ch. 5546 →	TBK010	
						SVB10800	10x800
171A, 171B, 171C	66	10/82 → 06/88			A/C(-)	MVB960R4	4PK960
					A/C(+)	MVB1245R4	4PK1245
					→ Ch. 5545	TB226	113x17
					→ Ch. 5545	TBK009	
					→11/83	SVB10775	10x775
					11/83 →	SVB10800	10x800
XU52C	68	10/82 → 12/92			A/C(-)	MVB960R4	4PK960
					A/C(+)	MVB1245R4	4PK1245
					→01/92, → Ch. 5545	TB226	113x17
					01/92 →, Ch. 5546 →	TB419	114x17
					→01/92, → Ch. 5545	TBK009	
					01/92 →, Ch. 5546 →	TBK010	
					→11/83	SVB10775	10x775
					11/83 →	SVB10800	10x800
180Z	76	03/86 → 02/93			A/C(-)	MVB960R4	4PK960
					A/C(+)	MVB1245R4	4PK1245
					→01/92, → Ch. 5545	TB226	113x17
					01/92 →, Ch. 5546 →	TB419	114x17
					→01/92, → Ch. 5545	TBK009	
					01/92 →, Ch. 5546 →	TBK010	
						SVB10800	10x800
B1A (XU51C/K)	58	09/87 → 02/93			A/C(-)	MVB960R4	4PK960
					A/C(+)	MVB1245R4	4PK1245
					→01/92, → Ch. 5545	TB226	113x17
					01/92 →, Ch. 5546 →	TB419	114x17
					→01/92, → Ch. 5545	TBK009	
					01/92 →, Ch. 5546 →	TBK010	
						SVB10800	10x800
BAY (XU5CP), BAZ (XU5CP)	55	09/88 → 02/93			A/C(-)	MVB960R4	4PK960
					A/C(+)	MVB1245R4	4PK1245
					→01/92, → Ch. 5545	TB226	113x17
					01/92 →, Ch. 5546 →	TB419	114x17
					→01/92, → Ch. 5545	TBK009	
					01/92 →, Ch. 5546 →	TBK010	
						SVB10800	10x800
16 E	BDY (XU5M), BDZ (XU5M)	65	05/89 → 02/93		A/C(-)	MVB960R4	4PK960
					A/C(+)	MVB1245R4	4PK1245
					→01/92, → Ch. 5545	TB226	113x17
					01/92 →, Ch. 5546 →	TB419	114x17
					→01/92, → Ch. 5545	TBK009	
					01/92 →, Ch. 5546 →	TBK010	
						SVB10800	10x800



kw



CITROËN

...CITROËN

...BX (XB-_)

19	D2C (XU92C)	70	09/86 → 11/89	①	A/C(-)	MVB960R4	4PK960
				②	A/C(-), Model BX sport	MVB755R4	4PK755
				③	A/C(+), 10/88→, Ch. 4358→	MVB1272R4	4PK1272
				④	A/C(+), Ch. 4358→	MVB1245R4	4PK1245
				⑤	→ Ch. 5545	TB226	113x17
				⑥	→ Ch. 5545	TBK009	
				⑦		SVB10800	10x800
				⑧			
				⑨			
				⑩			
				⑪			
				159A	75	07/86 → 05/89	①
②	A/C(-), Model BX sport	MVB755R4	4PK755				
③	A/C(+), 10/88→, Ch. 4358→	MVB1272R4	4PK1272				
④	A/C(+), Ch. 4358→	MVB1245R4	4PK1245				
⑤	→ Ch. 5545	TB226	113x17				
⑥	→ Ch. 5545	TBK009					
⑦		SVB10800	10x800				
⑧							
⑨							
⑩							
⑪							
D2A (XU92C)	77	07/86 → 05/89	①				A/C(-)
			②	A/C(-), Model BX sport	MVB755R4	4PK755	
			③	A/C(+), 10/88→, Ch. 4358→	MVB1272R4	4PK1272	
			④	A/C(+), Ch. 4358→	MVB1245R4	4PK1245	
			⑤	→ Ch. 5545	TB226	113x17	
			⑥	→ Ch. 5545	TBK009		
			⑦		SVB10800	10x800	
			⑧				
			⑨				
			⑩				
			⑪				
			19 D	162 (XUD9), D9A (XUD9)	47	09/83 → 12/87	①
②	A/C(-), MAN	MVB700R4					4PK700
③	A/C(+), →06/87, → Ch. 3857	MVB970R5					5PK970
④, ⑤	A/C(+)	MVB1130R6					6PK1130
⑥		TB175					136x25.4
⑦		TBK019					
⑧		SVB10625					10x625
⑨							
⑩							
⑪							
⑫							
D9B (XUD9A/U)	51	03/87 → 02/93					①
			②	A/C(-), MAN	MVB700R4	4PK700	
			③	A/C(+), →06/87, → Ch. 3857	MVB970R5	5PK970	
			④	A/C(+), 01/88→10/88, Ch. 4071→4357	MVB1230R4	4PK1230	
			⑤	A/C(+), 10/88→, Ch. 4357→	MVB1230R5	5PK1230	
			⑥, ⑦	A/C(+)	MVB1130R6	6PK1130	
			⑧		TB175	136x25.4	
			⑨		TBK019		
			⑩		SVB10625	10x625	
			⑪				
			⑫				
			19 E	DDZ (XU9M)	80	06/88 → 02/93	①
②	A/C(-), Model BX sport	MVB755R4					4PK755
③	A/C(+), 10/88→, Ch. 4358→	MVB1272R4					4PK1272
④	A/C(+), Ch. 4358→	MVB1245R4					4PK1245
⑤	→01/92, → Ch. 5545	TB226					113x17
⑥	01/92→, Ch. 5546→	TB419					114x17
⑦	→01/92, → Ch. 5545	TBK009					
⑧	01/92→, Ch. 5546→	TBK010					
⑨		SVB10800					10x800
⑩							
⑪							
19 E 4x4	D2F	80					04/89 → 02/93
			②	A/C(-), Model BX sport	MVB755R4	4PK755	
			③	A/C(+), Ch. 4358→	MVB1245R4	4PK1245	
			④	A/C(+), Ch. 4358→	MVB1272R4	4PK1272	
			⑤	→01/92, → Ch. 5545	TB226	113x17	
			⑥	01/92→, Ch. 5546→	TB419	114x17	
			⑦	→01/92, → Ch. 5545	TBK009		
			⑧	01/92→, Ch. 5546→	TBK010		
			⑨		SVB10800	10x800	
			⑩				
			⑪				



kW



...CITROËN

...BX (XB-)

CITROËN

19 GTi	DKZ (XU9JA)	88	06/88 → 02/93		A/C(-)	MVB960R4	4PK960			
					A/C(-), Model BX sport	MVB755R4	4PK755			
					A/C(+), 10/88 →, Ch. 4358 →	MVB1272R4	4PK1272			
					A/C(+), Ch. 4358 →	MVB1245R4	4PK1245			
					→01/92, → Ch. 5545	TB226	113x17			
					01/92 →, Ch. 5546 →	TB419	114x17			
					→01/92, → Ch. 5545	TBK009				
					01/92 →, Ch. 5546 →	TBK010				
						SVB10800	10x800			
				D6A (XU9J2)	90	07/86 → 02/93		A/C(-)	MVB960R4	4PK960
	A/C(-), 01/87 →	MVB725R5	5PK725							
	A/C(-), Model BX sport	MVB755R4	4PK755							
	A/C(+), 01/87 → 01/88, → Ch. 4091	MVB1015R5	5PK1015							
	A/C(+), 01/88 →, Ch. 4091 →	MVB1270R5	5PK1270							
	A/C(+), 10/88 →, Ch. 4358 →	MVB1272R4	4PK1272							
	A/C(+), Ch. 4358 →	MVB1245R4	4PK1245							
	→01/92, → Ch. 5545	TB226	113x17							
	01/92 →, Ch. 5546 →	TB419	114x17							
	→01/92, → Ch. 5545	TBK009								
	01/92 →, Ch. 5546 →	TBK010								
		SVB10800	10x800							
		SVB10625	10x625							
	01/87 → 06/88, → Ch. 4223	SVB10650	10x650							
19 GTi 16V	DFW (XU9J4)	108	03/88 → 02/93		A/C(-)	MVB725R5	5PK725			
					A/C(+)	MVB1270R5	5PK1270			
						TB345	133x25.4			
					→06/88, → Ch. 4223	SVB10625	10x625			
					Ch. 4224 →	SVB10650	10x650			
				D6C (XU9J4)	116	09/87 → 12/88		A/C(-)	MVB960R4	4PK960
								A/C(-), Model BX sport	MVB755R4	4PK755
								A/C(+), 10/88 →, Ch. 4358 →	MVB1272R4	4PK1272
								A/C(+), Ch. 4358 →	MVB1245R4	4PK1245
								→ Ch. 5545	TB226	113x17
	→ Ch. 5545	TBK009								
		SVB10800	10x800							
19 GTi 4x4	DKZ (XU9JA)	88	06/88 → 02/93					A/C(-)	MVB960R4	4PK960
								A/C(-), Model BX sport	MVB755R4	4PK755
								A/C(+), 10/88 →, Ch. 4358 →	MVB1272R4	4PK1272
					A/C(+), Ch. 4358 →	MVB1245R4	4PK1245			
					→01/92, → Ch. 5545	TB226	113x17			
					01/92 →, Ch. 5546 →	TB419	114x17			
					→01/92, → Ch. 5545	TBK009				
					01/92 →, Ch. 5546 →	TBK010				
						SVB10800	10x800			
				TRD Turbo	A8A (XUD7TE), AJZ (XUD7TE)	66	03/88 → 02/93		A/C(+), →10/88, Ch. 4071 → 4357	MVB1230R4
	A/C(+), 10/88 →, Ch. 4357 →	MVB1230R5	5PK1230							
	Eng. A8A, A/C(-), AUTO	MVB710R5	5PK710							
	Eng. A8A, A/C(-), MAN	MVB700R5	5PK700							
	A/C(+)	MVB1130R6	6PK1130							
		TB175	136x25.4							
	Eng. A8A	TBK019								
		SVB10625	10x625							



kW



CITROËN

...CITROËN

BX Break (XB-)

1.4		44	01/87 → 01/92	①	→05/88, → Ch. 4192	SVB10913	10x913
				②	05/88→, Ch. 4193→	SVB10800	10x800
						TB259	108x17
					TU3F	TB376	101x17
					TU3F	TBK004	
						TBK007	
				⊕	→05/88, → Ch. 4192	SVB10775	10x775
				⊕	05/88→, Ch. 4193→	SVB10710	10x710
				②	→05/88, → Ch. 4192	SVB10913	10x913
				②	05/88→, Ch. 4193→	SVB10800	10x800
						TB259	108x17
						TB376	101x17
		TBK004					
		TBK007					
⊕	→05/88, → Ch. 4192	SVB10775	10x775				
⊕	05/88→, Ch. 4193→	SVB10710	10x710				
1.6		85	01/87 → 01/92	②	A/C(-)	MVB960R4	4PK960
				②	A/C(+)	MVB1245R4	4PK1245
					→ Ch. 5545	TB226	113x17
					→ Ch. 5545	TBK009	
		SVB10800	10x800				
1.9 D		52	01/87 → 01/92	②	A/C(-), AUTO	MVB710R5	5PK710
				②	A/C(-), MAN	MVB700R4	4PK700
				②	A/C(+), →06/87, → Ch. 3857	MVB970R5	5PK970
				②	A/C(+), 01/88→10/88, Ch. 4071→4357	MVB1230R4	4PK1230
				②	A/C(+), 10/88→, Ch. 4357→	MVB1230R5	5PK1230
				②, ⊕	A/C(+)	MVB1130R6	6PK1130
						TB175	136x25.4
						TBK019	
						SVB10625	10x625
14	150C	53	01/86 → 02/93	②	→05/88, → Ch. 4192	SVB10913	10x913
				②	05/88→, Ch. 4193→	SVB10800	10x800
						TB259	108x17
					TU3F	TB376	101x17
					TU3F	TBK004	
						TBK007	
				⊕	→05/88, → Ch. 4192	SVB10775	10x775
				⊕	05/88→, Ch. 4193→	SVB10710	10x710
				②	Ch. 4193→	SVB10800	10x800
						TB259	108x17
					TU3F	TB376	101x17
					TU3F	TBK004	
			TBK007				
	⊕	Ch. 4193→	SVB10710	10x710			
	KDY (TU3M)	55	01/89 → 02/93	②	Ch. 4193→	SVB10800	10x800
						TB259	108x17
					TU3F	TB376	101x17
					TU3F	TBK004	
					TBK007		
⊕				Ch. 4193→	SVB10710	10x710	
K1H (TU3A)	47	01/89 → 12/89	②	Ch. 4193→	SVB10800	10x800	
					TB259	108x17	
				TU3F	TB376	101x17	
				TU3F	TBK004		
					TBK007		
			⊕	Ch. 4193→	SVB10710	10x710	
15	B1E (XU51C)	59	10/87 → 05/92	②	A/C(-)	MVB960R4	4PK960
				②	A/C(+)	MVB1245R4	4PK1245
					→01/92, → Ch. 5545	TB226	113x17
					01/92→, Ch. 5546→	TB419	114x17
					→01/92, → Ch. 5545	TBK009	
					01/92→, Ch. 5546→	TBK010	
						SVB10800	10x800



kW



...CITROËN

...BX Break (XB-_)

CITROËN

16	B1E (XU51C)	53	09/88 → 12/94		A/C(-)	MVB960R4	4PK960
					A/C(+)	MVB1245R4	4PK1245
					→01/92, → Ch. 5545	TB226	113x17
					01/92 →, Ch. 5546 →	TB419	114x17
					→01/92, → Ch. 5545	TBK009	
					01/92 →, Ch. 5546 →	TBK010	
						SVB10800	10x800
171D	64	07/85 → 12/94		A/C(-)	MVB960R4	4PK960	
				A/C(+)	MVB1245R4	4PK1245	
				→01/92, → Ch. 5545	TB226	113x17	
				01/92 →, Ch. 5546 →	TB419	114x17	
				→01/92, → Ch. 5545	TBK009		
				01/92 →, Ch. 5546 →	TBK010		
					SVB10800	10x800	
180Z	76	03/86 → 12/94		A/C(-)	MVB960R4	4PK960	
				A/C(+)	MVB1245R4	4PK1245	
				→01/92, → Ch. 5545	TB226	113x17	
				01/92 →, Ch. 5546 →	TB419	114x17	
				→01/92, → Ch. 5545	TBK009		
				01/92 →, Ch. 5546 →	TBK010		
					SVB10800	10x800	
BDY (XU5M), BDZ (XU5M)	65	05/89 → 12/94		A/C(-)	MVB960R4	4PK960	
				A/C(+)	MVB1245R4	4PK1245	
				→01/92, → Ch. 5545	TB226	113x17	
				01/92 →, Ch. 5546 →	TB419	114x17	
				→01/92, → Ch. 5545	TBK009		
				01/92 →, Ch. 5546 →	TBK010		
					SVB10800	10x800	
BAY (XU5CP), BAZ (XU5CP)	55	09/88 → 12/94		A/C(-)	MVB960R4	4PK960	
				A/C(+)	MVB1245R4	4PK1245	
				→01/92, → Ch. 5545	TB226	113x17	
				01/92 →, Ch. 5546 →	TB419	114x17	
				→01/92, → Ch. 5545	TBK009		
				01/92 →, Ch. 5546 →	TBK010		
					SVB10800	10x800	
171A, 171B, 171C	66	06/85 → 06/88		A/C(-)	MVB960R4	4PK960	
				A/C(+)	MVB1245R4	4PK1245	
				→ Ch. 5545	TB226	113x17	
				→ Ch. 5545	TBK009		
					SVB10800	10x800	
18 D	161A (XUD7)	44	10/85 → 09/93		A/C(-), AUTO	MVB710R5	5PK710
					A/C(-), MAN	MVB700R4	4PK700
					A/C(+), →06/87, → Ch. 3857	MVB970R5	5PK970
					A/C(+), 01/88 → 10/88, Ch. 4071 → 4357	MVB1230R4	4PK1230
					A/C(+), 10/88 →, Ch. 4357 →	MVB1230R5	5PK1230
					A/C(+)	MVB1130R6	6PK1130
						TB175	136x25.4
						TBK019	
						SVB10625	10x625



kw



CITROËN

...CITROËN

...BX Break (XB-_)

19	D2A (XU92C)	75	07/86 → 12/94	①	A/C(-)	MVB960R4	4PK960				
				②	A/C(-), Model BX sport	MVB755R4	4PK755				
				③	A/C(+), 10/88→, Ch. 4358→	MVB1272R4	4PK1272				
				④	A/C(+), Ch. 4358→	MVB1245R4	4PK1245				
				⑤	→01/92, → Ch. 5545	TB226	113x17				
				⑥	01/92→, Ch. 5546→	TB419	114x17				
				⑦	→01/92, → Ch. 5545	TBK009					
				⑧	01/92→, Ch. 5546→	TBK010					
				⑨		SVB10800	10x800				
				DKZ (XU9JA)	88	06/88 → 12/94	①	A/C(-)	MVB960R4	4PK960	
							②	A/C(-), Model BX sport	MVB755R4	4PK755	
							③	A/C(+), 10/88→, Ch. 4358→	MVB1272R4	4PK1272	
							④	A/C(+), Ch. 4358→	MVB1245R4	4PK1245	
							⑤	→01/92, → Ch. 5545	TB226	113x17	
							⑥	01/92→, Ch. 5546→	TB419	114x17	
⑦	→01/92, → Ch. 5545	TBK009									
⑧	01/92→, Ch. 5546→	TBK010									
⑨		SVB10800	10x800								
DDZ (XU9M)	80	06/88 → 12/94	①				A/C(-)	MVB960R4	4PK960		
			②				A/C(-), Model BX sport	MVB755R4	4PK755		
			③				A/C(+), 10/88→, Ch. 4358→	MVB1272R4	4PK1272		
			④				A/C(+), Ch. 4358→	MVB1245R4	4PK1245		
			⑤				→01/92, → Ch. 5545	TB226	113x17		
			⑥				01/92→, Ch. 5546→	TB419	114x17		
			⑦	→01/92, → Ch. 5545	TBK009						
			⑧	01/92→, Ch. 5546→	TBK010						
			⑨		SVB10800	10x800					
			D2C (XU92C)	70	12/87 → 12/89	①	A/C(-)	MVB960R4	4PK960		
						②	A/C(-), Model BX sport	MVB755R4	4PK755		
						③	A/C(+), 10/88→, Ch. 4358→	MVB1272R4	4PK1272		
						④	A/C(+), Ch. 4358→	MVB1245R4	4PK1245		
						⑤	→ Ch. 5545	TB226	113x17		
						⑥	→ Ch. 5545	TBK009			
⑦		SVB10800				10x800					
19 4x4	DDZ (XU9M)	80				10/90 → 05/91	①	A/C(-)	MVB960R4	4PK960	
							②	A/C(-), Model BX sport	MVB755R4	4PK755	
							③	A/C(+), Ch. 4358→	MVB1245R4	4PK1245	
							④	A/C(+), Ch. 4358→	MVB1272R4	4PK1272	
							⑤	→ Ch. 5545	TB226	113x17	
							⑥	→ Ch. 5545	TBK009		
							⑦		SVB10800	10x800	
							19 CAT	DFZ (XU9J1)	75	07/86 → 12/94	①
			②	A/C(-), Model BX sport	MVB755R4						4PK755
			③	A/C(+), 10/88→, Ch. 4358→	MVB1272R4						4PK1272
			④	A/C(+), Ch. 4358→	MVB1245R4						4PK1245
			⑤	→01/92, → Ch. 5545	TB226						113x17
			⑥	01/92→, Ch. 5546→	TB419						114x17
			⑦	→01/92, → Ch. 5545	TBK009						
			⑧	01/92→, Ch. 5546→	TBK010						
⑨		SVB10800	10x800								



kW



...CITROËN

...BX Break (XB-)

19 D	162 (XUD9), D9A (XUD9)	47	09/83 → 12/87	 KIT 	A/C(-), AUTO A/C(-), MAN A/C(+), →06/87, → Ch. 3857 A/C(+) 	MVB710R5 MVB700R4 MVB970R5 MVB1130R6 TB175 TBK019 SVB10625	5PK710 4PK700 5PK970 6PK1130 136x25.4 10x625
	D9B (XUD9A/U)	51	03/87 → 12/94	 KIT 	A/C(-), AUTO A/C(-), MAN A/C(+), →06/87, → Ch. 3857 A/C(+), 01/88→10/88, Ch. 4071→4357 A/C(+), 10/88→, Ch. 4357→ A/C(+) 	MVB710R5 MVB700R4 MVB970R5 MVB1230R4 MVB1230R5 MVB1130R6 TB175 TBK019 SVB10625	5PK710 4PK700 5PK970 4PK1230 5PK1230 6PK1130 136x25.4 10x625
TRD Turbo	A8A (XUD7TE), AJZ (XUD7TE)	66	03/88 → 12/94	 KIT 	A/C(+), →10/88, Ch. 4071→4357 	MVB1230R4	4PK1230
				 KIT 	A/C(+), 10/88→, Ch. 4357→ Eng. A8A, A/C(-), AUTO Eng. A8A, A/C(-), MAN A/C(+) Eng. A8A	MVB1230R5 MVB710R5 MVB700R5 MVB1130R6 TB175 TBK019 SVB10625	5PK1230 5PK710 5PK700 6PK1130 136x25.4 10x625

C1 (PM_, PN_)

1.0	1KR-FE	50	06/05 →	 	A/C(-) A/C(+) 	MVB850R6 MVB1215R6	6PK850 6PK1215
1.4 HDi	DV4D	40	06/05 →	 	A/C(-) A/C(+) 	MVB795R6 MVB962R6	6PK795 6PK962
				 KIT 		TB720 TBK230	114x25.4

C2 (JM_)

1.1	HFJ (TU1JP)	44	09/03 →	 	A/C(-) A/C(+) 	MVB730R6 MVB1050R6 MVB1125R6	6PK730 6PK1050 6PK1125
				 KIT 	A/C(+), →12/03, → Ch. 09884 	TB699 TBK316	100x17
1.4	KFV (TU3JP)	54	09/03 →	 	A/C(-) A/C(+) 	MVB730R6 MVB1050R6 MVB1125R6	6PK730 6PK1050 6PK1125
				 KIT 	A/C(+), →12/03, → Ch. 09884 	TB711 TBK312	104x17
1.4 16V	KFU (ET3J4)	65	06/06 →	 KIT 		TB813 TBK336	135x25.4
1.4 HDi	8HX (DV4TD)	50	09/03 →	 	A/C(-), Ch. 11073→ A/C(+), Ch. 11073→ 	MVB795R6 MVB975R6	6PK795 6PK975
				 KIT 		TB720 TBK230	114x25.4
1.6	NFU (TU5JP4)	80	09/03 →	 	A/C(-) A/C(+), →12/03, → Ch. 09884 	MVB730R6 MVB1125R6 MVB1050R6	6PK730 6PK1125 6PK1050
				 KIT 	A/C(+), Ch. 09885→ 	TB700 TBK319	134x25.4
1.6 HDi	9HZ-DV6TED4	80	09/05 →	 	A/C(-), 04/07→ A/C(+), 04/07→ 	MVB795R6 MVB975R6	6PK795 6PK975
				 KIT 	04/07→ 04/07→ 	TB724 TBK302	137x25.4



kw



CITROËN

...CITROËN

...C2 (JM_)

1.6 VTS	NFS (TU5JP4S)	90	01/05 →	 		MVB1050R6 TB700 TBK319	6PK1050 134x25.4
---------	---------------	----	---------	----------	--	---	---------------------

C3 (FC_)

1.1 i	HFX (TU1JP)	44	02/02 →	 	A/C(-) A/C(+), →12/03 A/C(+), 12/03→	MVB730R6 MVB1125R6 MVB1050R6 TB699 TBK316	6PK730 6PK1125 6PK1050 100x17
1.4 16V	KFU (ET3J4)	65	12/03 →	 	A/C(-) A/C(+)	MVB730R6 MVB1050R6 TB813 TBK336	6PK730 6PK1050 135x25.4
1.4 16V HDi	8HY (DV4TED4)	66	02/02 →	 	A/C(-), Ch. 11074→ A/C(+), → Ch. 11074	MVB795R6 MVB975R6 TB721	6PK795 6PK975 135x25.4
1.4 HDi	8HX (DV4TD)	50	02/02 →	 	A/C(-), Ch. 11074→ A/C(+), Ch. 11074→	MVB795R6 MVB975R6 TB720 TBK230	6PK795 6PK975 114x25.4
1.4 i	KFV (TU3JP)	54	02/02 →	 	A/C(-) A/C(+), →12/03 A/C(+), 12/03→	MVB730R6 MVB1125R6 MVB1050R6 TB711 TBK312	6PK730 6PK1125 6PK1050 104x17
1.4 i Bivalent	KFV (TU3JP)	54	02/02 →	 	A/C(-) A/C(+), →12/03 A/C(+), 12/03→	MVB730R6 MVB1125R6 MVB1050R6 TB711 TBK312	6PK730 6PK1125 6PK1050 104x17
1.6 16V	NFU (TU5JP4)	80	02/02 →	 	A/C(-) A/C(+), →12/03 A/C(+), 12/03→	MVB730R6 MVB1125R6 MVB1050R6 TB700 TBK318 TBK319	6PK730 6PK1125 6PK1050 134x25.4
				 	→ Eng Nr 1806404 →08/07, Eng Nr 1806405→, → Ch. 11253		
1.6 16V HDi	DV6TED4	80	09/05 →	 	A/C(-), Ch. 11074→ A/C(+), Ch. 11074→	MVB795R6 MVB975R6 TB724 TBK302	6PK795 6PK975 137x25.4
	9HX (DV6ATED4)	66	10/05 →	 	A/C(-), 03/07→, Ch. 11074→ A/C(+), 03/07→, Ch. 11074→	MVB795R6 MVB975R6 TB724 TBK302	6PK795 6PK975 137x25.4

C3 Pluriel (HB_)

1.4	KFV (TU3JP)	54	05/03 →	 	A/C(-) A/C(+)	MVB730R6 MVB1125R6 TB711 TBK312	6PK730 6PK1125 104x17
		54	05/05 →	 	A/C(-) A/C(+)	MVB730R6 MVB1050R6 TB711 TBK312	6PK730 6PK1050 104x17
1.4 HDi	8HX (DV4TD)	50	04/04 →	 	A/C(-), Ch. 11074→ A/C(+), Ch. 11074→	MVB795R6 MVB975R6 TB720 TBK230	6PK795 6PK975 114x25.4



kW



...CITROËN

...C3 Pluriel (HB_)

1.6	NFU (TU5JP4)	80	05/03 →		A/C(-)	MVB730R6	6PK730
					A/C(+)	MVB1125R6	6PK1125
						TB700	134x25.4
					→08/07, → Ch. 11253	TBK319	

C4 (LC_)

1.4 16V	KFU (ET3J4)	65	11/04 →		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1050R6	6PK1050
					A/C(+), Alt. 120A	MVB1065R6	6PK1065
						TB813	135x25.4
						TBK336	
1.6 16V	NFU (TU5JP4)	80	11/04 →		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1050R6	6PK1050
					A/C(+), Alt. 120A	MVB1065R6	6PK1065
						TB700	134x25.4
					→08/07, → Ch. 11253	TBK319	
1.6 16V Bio-Flex		80	09/07 →		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1050R6	6PK1050
					A/C(+), Alt. 120A	MVB1065R6	6PK1065
						TB700	134x25.4
1.6 HDi	9HX (DV6ATED4)	66	11/04 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
	9HY (DV6TED4), 9HZ-DV6TED4, DV6TED4	80	11/04 →		A/C(-), Ch. 11074 →	MVB795R6	6PK795
					A/C(+), Ch. 11074 →	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
2.0 16V	RFN (EW10J4)	100	11/04 →		→07/07	MVB1708R6	6PK1708
					→07/07	TB683	153x25.4
					→07/07	TBK279	
	EW10A, RFJ-EW10A	103	11/04 →			MVB1000R6	6PK1000
						TB744	153x25
	EW10J4S, RFK (EW10J4S)	130	11/04 →			MVB1708R6	6PK1708
						TB744	153x25
						TBK304	
2.0 HDi	DW10BTED4, RHR (DW10BTED4)	100	11/04 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	

C4 Coupe (LA_)

1.4 16V	KFU (ET3J4)	65	11/04 →		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1050R6	6PK1050
					A/C(+), Alt. 120A	MVB1065R6	6PK1065
						TB813	135x25.4
						TBK336	
1.6 16V	NFU (TU5JP4)	80	11/04 →		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1050R6	6PK1050
					A/C(+), Alt. 120A	MVB1065R6	6PK1065
						TB700	134x25.4
					→08/07, → Ch. 11253	TBK319	
1.6 HDi	9HX (DV6ATED4)	66	11/04 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
	9HY (DV6TED4), 9HZ-DV6TED4, DV6TED4	80	11/04 →		A/C(-), Ch. 11074 →	MVB795R6	6PK795
					A/C(+), Ch. 11074 →	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	



kw



CITROËN

...CITROËN

...C4 Coupe (LA_)

2.0 16V	RFN (EW10J4)	100	11/04 →		→07/07	MVB1708R6	6PK1708
					→07/07	TB683	153x25.4
					→07/07	TBK279	
	EW10J4S, RFK (EW10J4S)	130	11/04 →			MVB1708R6	6PK1708
						TB744	153x25
						TBK304	
2.0 HDi	DW10BTEd4, RHR (DW10BTEd4)	100	11/04 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	

C4 Grand Picasso (UA_)

1.6 HDi	9HY (DV6TED4), 9HZ-DV6TED4 80		10/06 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
1.8 i 16V	6FY-EW7A	92	10/06 →			MVB1000R6	6PK1000
						TB744	153x25
2.0 HDi	RHJ-DW10BTEd4, RHR (DW10BTEd4)	100	10/06 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.0 i 16V	RFJ-EW10A	103	10/06 →			MVB1000R6	6PK1000
						TB744	153x25

C4 Picasso (UD_)

1.6 HDi	9HY (DV6TED4), 9HZ-DV6TED4 80		02/07 →		A/C(-), Ch. 10949 →	MVB795R6	6PK795
					A/C(+), Ch. 10949 →	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
1.8 i 16V	6FY-EW7A	92	02/07 →			MVB1000R6	6PK1000
						TB744	153x25
2.0 HDi	RHJ-DW10BTEd4, RHR (DW10BTEd4)	100	02/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.0 i 16V	RFJ-EW10A	103	02/07 →			MVB1000R6	6PK1000
						TB744	153x25

C5 (DC_)

1.8 16V (DC6FZB, DC6FZE)	6FZ (EW7J4)	85	03/01 → 08/04		A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1708R6	6PK1708
						TB683	153x25.4
						TBK279	
2.0 16V (DCRFNC, DCRFNF)	RFN (EW10J4)	100	03/01 → 08/04		A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1708R6	6PK1708
						TB683	153x25.4
						TBK279	
2.0 16V HPI (DCRLZB)	RLZ (EW10D)	103	03/01 → 08/04		A/C(-), →08/02	MVB1190R6	6PK1190
					A/C(+), →08/02	MVB1708R6	6PK1708
					→08/02	TB702	143x25.4
2.0 HDi	RHS (DW10ATED), RHZ (DW10ATED)	79	03/01 → 08/04		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), For OE 5750Z7	MVB1755R6	6PK1755
						TB632	141x25.4
						TBK274	
2.0 HDi (DCRHVB)	RHY (DW10TD)	66	03/01 → 08/04		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), For OE 5750Z7	MVB1755R6	6PK1755
						TB632	141x25.4
						TBK274	
2.0 HDi (DCRHVB, DCRHZE)	RHZ (DW10ATED)	80	03/01 → 08/04		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), For OE 5750Z7	MVB1755R6	6PK1755
						TB632	141x25.4
						TBK274	



kW


...CITROËN
...C5 (DC_)

2.2 HDi (DC4HXB, DC4HXE)	4HX (DW12TED4/FAP)	98	03/01 → 08/04		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), For OE 5750Z7	MVB1755R6	6PK1755
						TB678	146x25.4
					→04/04	TBK303	
					04/04→	TBK355	
3.0 V6 (DCXFXC, DCXFXF)	XFX (ES9J4S)	152	03/01 → 08/04			MVB1580R6	6PK1580
						TB727	259x32

C5 (RC_)

1.6 HDi (RC8HZB)	DV6TED4	80	09/04 →		→01/08	MVB1708R6	6PK1708
					→01/08	TB724	137x25.4
					→01/08	TBK302	
1.8 16V		92	09/05 →		→01/08	MVB1000R6	6PK1000
					→01/08	TB744	153x25
1.8 16V (RC6FZB)	6FZ (EW7J4)	85	09/04 →		→08/05	MVB1708R6	6PK1708
					→08/05	TB683	153x25.4
					→08/05	TBK279	
2.0 16V (RCRFJB, RCRFJC)	EW10A	103	09/04 →		→01/08	MVB1000R6	6PK1000
					→01/08	TB744	153x25
2.0 HDi (RCRHRH)	DW10BTE4	100	09/04 →		→01/08	MVB1215R6	6PK1215
					→01/08	TB742	116x25
					→01/08	TBK338	
2.2 HDi		125	04/06 →		→01/08	MVB1200R6	6PK1200
					→01/08	TB810	118x25.4
2.2 HDi (RC4HXE)	4HX (DW12TED4/FAP)	98	09/04 →		→09/06	MVB1740R6	6PK1740
					→09/06	TB678	146x25.4
					→09/06	TBK355	
3.0 V6 (RCXFUF)	XFV (ES9A), XFX (ES9J4S)	152	09/04 →		→01/08	MVB1580R6	6PK1580
					→01/08	TB727	259x32

C5 (RD_)

1.6 HDi	DV6TED4	80	02/08 →			MVB1708R6	6PK1708
						TB724	137x25.4
						TBK302	
1.8 16V	6FY-EW7A	92	02/08 →			MVB1000R6	6PK1000
						TB744	153x25
2.0 16V	EW10A	103	02/08 →			MVB1000R6	6PK1000
						TB744	153x25
2.0 HDi	DW10BTE4	100	02/08 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.2 HDi	4HT (DW12BTE4)	125	02/08 →			MVB1200R6	6PK1200
						TB810	118x25.4
2.7 HDi	DT17ED4	150	02/08 →			MVB1885R6	6PK1885
						TB814	195x29
3.0 V6		155	02/08 →			MVB1588R6	6PK1588
						TB727	259x32

C5 Break (DE_)

1.8 16V (DE6FZB, DE6FZE)	6FZ (EW7J4)	85	06/01 → 08/04		A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1708R6	6PK1708
						TB683	153x25.4
						TBK279	
2.0 16V (DERFNF, DERFNC, RERFNC)	RFN (EW10J4)	100	06/01 → 08/04		A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1708R6	6PK1708
						TB683	153x25.4
						TBK279	
2.0 16V HPI (DERLZB)	RLZ (EW10D)	103	06/01 → 08/04		A/C(-), →08/02	MVB1190R6	6PK1190
					A/C(+), →08/02	MVB1708R6	6PK1708
					→08/02	TB702	143x25.4



kW



CITROËN

...CITROËN

...C5 Break (DE_)

2.0 HDi	RHZ (DW10ATED)	80	06/01 → 08/04		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), For OE 5750Z7	MVB1755R6	6PK1755
						TB632	141x25.4
						TBK274	
2.0 HDi (DERHSB, DERHSE)	RHS (DW10ATED), RHZ (DW10ATED)	79	06/01 → 08/04		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), For OE 5750Z7	MVB1755R6	6PK1755
						TB632	141x25.4
						TBK274	
2.0 HDi (DERHYB)	RHY (DW10TD)	66	06/01 → 08/04		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), For OE 5750Z7	MVB1755R6	6PK1755
						TB632	141x25.4
						TBK274	
2.2 HDi (DE4HXB, DE4HXE)	4HX (DW12TED4/FAP)	98	06/01 → 08/04		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), For OE 5750Z7	MVB1755R6	6PK1755
						TB678	146x25.4
					→04/04	TBK303	
					04/04→	TBK355	
3.0 V6 (DEXFXC, DEXFXF)	AFX (ES9J4S)	152	06/01 → 08/04			MVB1580R6	6PK1580
						TB727	259x32
Carlsson		173	09/03 → 08/04			MVB1580R6	6PK1580
						TB727	259x32

C5 Break (RE_)

1.6 HDi (RE8HZB)	9HY (DV6TED4)	80	09/04 →		→01/08	MVB1708R6	6PK1708
					→01/08	TB724	137x25.4
					→01/08	TBK302	
1.8 16V	6FY-EW7A	92	09/05 →		→01/08	MVB1000R6	6PK1000
					→01/08	TB744	153x25
1.8 16V (RE6FZB)	6FZ (EW7J4)	85	09/04 →		→08/05	MVB1708R6	6PK1708
					→08/05	TB683	153x25.4
					→08/05	TBK279	
2.0 16V (RERFJB, RERFJC)	RFJ-EW10A	103	09/04 →		→01/08	MVB1000R6	6PK1000
					→01/08	TB744	153x25
2.0 HDi (RERHRH)	RHR (DW10BTED4)	100	09/04 →		→01/08	MVB1215R6	6PK1215
					→01/08	TB742	116x25
					→01/08	TBK338	
2.2 HDi		125	04/06 →		→01/08	MVB1200R6	6PK1200
					→01/08	TB810	118x25.4
2.2 HDi (RE4HXE)	4HX (DW12TED4/FAP)	98	09/04 →		→09/06	MVB1740R6	6PK1740
					→09/06	TB678	146x25.4
					→09/06	TBK355	
3.0 V6 (REXFUF)		152	09/04 →		→01/08	MVB1580R6	6PK1580
					→01/08	TB727	259x32

C5 Break (TD_)

2.0 16V	EW10A, RFJ-EW10A	103	02/08 →			MVB1000R6	6PK1000
						TB744	153x25
2.0 HDi	DW10BTED4, RHR (DW10BTED4)	100	02/08 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.2 HDi	4HT (DW12BTED4)	125	02/08 →			MVB1200R6	6PK1200
						TB810	118x25.4
2.7 HDi	DT17ED4	150	02/08 →			MVB1885R6	6PK1885
						TB814	195x29
3.0 V6		155	02/08 →			MVB1588R6	6PK1588
						TB727	259x32



kW



...CITROËN

C6 (TD_)

2.2 HDi		125	06/06 →	 		MVB1200R6 TB810	6PK1200 118x25.4
2.7 HDi	DT17ED4	150	09/05 →	 		MVB1885R6 TB814 TB815	6PK1885 195x29 85x20
3.0 V6	ES9J4S	155	09/05 →	 		MVB1588R6 TB727	6PK1588 259x32

C8 (EA_, EB_)

2.0	RFN (EW10J4)	100	07/02 →	 KIT	A/C(-), →11/04 A/C(+), →11/04 →11/04 →11/04	MVB1190R6 MVB1708R6 TB683 TBK279	6PK1190 6PK1708 153x25.4
2.0 16V	RFJ-EW10A	103	09/05 →	 		MVB1000R6 TB744	6PK1000 153x25
2.0 HDi	RHM (DW10ATED4), RHT (DW10ATED4), RHW (DW10ATED4)	79	07/02 →	 		MVB1740R6 TB720	6PK1740 114x25.4
		100	03/06 →	 KIT		MVB1215R6 TB742 TBK338	6PK1215 116x25
2.2	3FZ (EW12J4)	116	07/02 →	 KIT	A/C(-) A/C(+)	MVB1190R6 MVB1708R6 TB683 TBK279	6PK1190 6PK1708 153x25.4
2.2 HDi	4HW (DW12TED4)	94	07/02 →	 KIT	→07/06 →07/06 →04/04 04/04→07/06	MVB1740R6 TB678 TBK303 TBK355	6PK1740 146x25.4
3.0 V6	XFX (ES9J4S)	150	07/02 →	 	→10/07 →10/07	MVB1580R6 TB727	6PK1580 259x32

C15 (VD-_)

1.0	TU9, XV8	33	10/84 → 12/97	 KIT 	→05/88, → Ch. 4195 05/88→07/96, Ch. 4196→ 05/88→07/96, Ch. 4196→ 05/88→07/96, Ch. 4196→ →07/96	SVB10913 SVB10710 TB304 TBK005 SVB10650	10x913 10x710 104x17
1.1	109K, E1A	35	10/84 → 12/96	 KIT 	→05/88, → Ch. 4195 05/88→07/96, Ch. 4196→ 05/88→07/96, Ch. 4196→ 05/88→07/96, Ch. 4196→ →07/96	SVB10913 SVB10710 TB304 TBK005 SVB10650	10x913 10x710 104x17
		40	10/84 → 07/87	 	→ Ch. 4195	SVB10913 SVB10650	10x913 10x650
1.1 i	HDZ (TU1M)	44	07/88 → 12/96	 KIT 	→07/96, Ch. 4196→ →07/96, Ch. 4196→ →07/96, Ch. 4196→ →07/96	SVB10710 TB304 TBK005 SVB10650	10x710 104x17
1.3	G1A	47	07/87 → 05/88	 		SVB101125 SVB10650	10x1125 10x650
1.4	K1H (TU3A)	49	07/87 → 12/96	 KIT KIT 	→05/88, → Ch. 4195 05/88→07/96, Ch. 4196→ 05/88→07/96, Ch. 4196→ 05/88→07/96, Ch. 4196→ →07/96, Ch. 4196→ →07/96, Ch. 4196→ →07/96	SVB10913 SVB10710 TB259 TB376 TBK004 TBK007 SVB10650	10x913 10x710 108x17 101x17



kw



CITROËN

...CITROËN

...C15 (VD-_)

1.4 E	150D (XY7)	44	05/87 → 12/96		→05/88, → Ch. 4195	SVB10913	10x913
					05/88→07/96, Ch. 4196→	SVB10710	10x710
					05/88→07/96, Ch. 4196→	TB259	108x17
					05/88→07/96, Ch. 4196→	TB376	101x17
					→07/96, Ch. 4196→	TBK004	
					→07/96, Ch. 4196→	TBK007	
					→07/96	SVB10650	10x650
					→05/88, → Ch. 4195	SVB10913	10x913
					05/88→07/96, Ch. 4196→	SVB10710	10x710
					05/88→07/96, Ch. 4196→	TB259	108x17
1.4 i	K3A	40	07/87 → 12/96		→05/88, → Ch. 4195	SVB10913	10x913
					05/88→07/96, Ch. 4196→	SVB10710	10x710
					05/88→07/96, Ch. 4196→	TB259	108x17
					05/88→07/96, Ch. 4196→	TB376	101x17
					→07/96, Ch. 4196→	TBK004	
					→07/96, Ch. 4196→	TBK007	
					→07/96	SVB10650	10x650
					→07/96, Ch. 4196→	SVB10710	10x710
					Eng. TU3F, →07/96, Ch. 4196→	TB376	101x17
					Eng. TU3m, →07/96, Ch. 4196→	TB259	108x17
1.8 D	161A (XUD7)	44	07/86 → 12/00		→07/96, Ch. 4196→	SVB10710	10x710
					Eng. TU3F, →07/96, Ch. 4196→	TB376	101x17
					Eng. TU3m, →07/96, Ch. 4196→	TB259	108x17
					→07/96, Ch. 4196→	TBK004	
					→07/96, Ch. 4196→	TBK007	
					→07/96	SVB10650	10x650
					→08/00	MVB700R4	4PK700
					→08/00	TB175	136x25.4
					→12/93	TBK019	
					01/94→08/00	TBK020	
1.9 D	161A (XUD7)	44	12/00 → 12/05		→08/00	SVB10650	10x650
					→07/05	MVB750R6	6PK750
					→07/05	TB631	140x25.4
					→07/05	TBK105	

C25 Box (280_, 290_)

2.0	170C (XN1T)	62	02/91 → 03/94			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
2.0 E	170A (XN1T), 170B (XN1T)	58	09/81 → 03/94			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
2.5 D 4x4	170A (XN1T), 170B (XN1T)	55	11/83 → 12/86			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
						TB177	62x19
						SVB10800	10x800
						SVB10600	10x600

C25 Bus (280_, 290_)

1.8 E	169 (XM7T)	51	07/87 → 02/94			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
1.9 D	D9B (XUD9A/U)	51	07/87 → 02/94		01/88→	MVB800R4	4PK800
					01/88→	TB175	136x25.4
					01/88→	TBK019	
					01/88→	SVB10625	10x625
1.9 TD	M705	60	04/92 → 02/94			MVB925R5	5PK925
						TB278	173x25.4
						SVB10800	10x800
2.0	170C (XN1T)	62	02/91 → 02/94			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
2.0 E	170A (XN1T), 170B (XN1T)	58	09/81 → 02/94			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888



kW



...CITROËN

...C25 Bus (280_, 290_)

2.5 D	CRD93L (U25-661)	54	10/85 → 02/94	 	inj. pump 	SVB10700 TB227 TBK049 TBK054 TB177 SVB10800 SVB10600	10x700 118x31.8 62x19 10x800 10x600
2.5 D 4x4	CRD93L (U25-661)	54	01/87 → 02/94	 	inj. pump 	SVB10700 TB227 TBK049 TBK054 TB177 SVB10800 SVB10600	10x700 118x31.8 62x19 10x800 10x600
2.5 D Turbo	CRD93LS (U25-673)	70	08/87 → 02/94	 	inj. pump 	SVB10700 TB227 TBK049 TBK054 TB177 SVB10800 SVB10600	10x700 118x31.8 62x19 10x800 10x600
2.5 D Turbo 4x4	CRD93LS (U25-673)	70	08/87 → 02/94	 	inj. pump 	SVB10700 TB227 TBK049 TBK054 TB177 SVB10800 SVB10600	10x700 118x31.8 62x19 10x800 10x600

C25 Flatbed / Chassis (280_, 290_)

1.9 DT		60	10/91 → 01/94	 		MVB925R5 TB278 SVB10800	5PK925 173x25.4 10x800
2.0	170C (XN1T)	62	02/91 → 03/94	 		SVB10925 SVB10790 SVB10888	10x925 10x790 10x888
2.0 1400 E		62	01/87 → 01/94	 		SVB10925 SVB10790 SVB10888	10x925 10x790 10x888

C35 Box

2.0	B20614	65	11/73 → 01/94	 		SVB10825 SVB101175	10x825 10x1175
2.2 D	B22615	45	11/73 → 01/80	 		SVB10825 SVB101175	10x825 10x1175
2.5 D	B25637	51	02/80 → 01/94	 		SVB10825 SVB101175	10x825 10x1175

C35 Bus

2.0	B20614	65	11/73 → 01/94	 		SVB10825 SVB101175	10x825 10x1175
2.2 D	B22615	45	11/73 → 01/80	 		SVB10825 SVB101175	10x825 10x1175
2.5 D	B25637	51	02/80 → 01/94	 		SVB10825 SVB101175	10x825 10x1175

C35 Pickup

2.0	B20614	65	11/73 → 01/94	 		SVB10825 SVB101175	10x825 10x1175
2.2 D	B22615	45	11/73 → 01/80	 		SVB10825 SVB101175	10x825 10x1175
2.5 D	B25637	51	02/80 → 01/94	 		SVB10825 SVB101175	10x825 10x1175



kW



CITROËN

...CITROËN

C-CROSSER (EP_)

2.2 HDi		115	02/07 →			09/07 →	MVB1740R6	6PK1740
						09/07 →	TB810	118x25.4

CX II

20 RE	829 A5	78	08/85 → 12/92			→07/89	SVB10675	10x675				
						→07/89	SVB10913	10x913				
						A/C(-), →07/89	SVB101000	10x1000				
						A/C(+), →07/89	SVB101150	10x1150				
						→07/89	TB421	116x19				
					KIT	→07/89	TBK281					
22 TRS	J6T A500	83	07/85 → 12/92			→07/89	SVB10913	10x913				
						A/C(-), →07/89	SVB101000	10x1000				
						A/C(+), →07/89	SVB101150	10x1150				
						→07/89	TB422	118x19				
					KIT	→07/89	TBK282					
						→07/89	SVB10600	10x600				
		85	07/85 → 07/89				SVB10913	10x913				
						A/C(-)	SVB101000	10x1000				
						A/C(+)	SVB101150	10x1150				
							TB422	118x19				
					KIT		TBK282					
							SVB10600	10x600				
25 D	M25-660	54	08/85 → 12/92				SVB10700	10x700				
							TB227	118x31.8				
					KIT		TBK049					
					KIT	inj. pump	TBK054					
						AUTO	SVB10665	10x665				
						MAN	SVB10625	10x625				
25 D Turbo	M25-648	70	08/85 → 12/86				SVB10700	10x700				
							TB227	118x31.8				
					KIT		TBK049					
					KIT	inj. pump	TBK054					
						AUTO	SVB10665	10x665				
						MAN	SVB10625	10x625				
	M25-669	88	01/87 → 12/92				SVB10700	10x700				
							TB227	118x31.8				
					KIT		TBK049					
					KIT	inj. pump	TBK054					
						AUTO	SVB10665	10x665				
						MAN	SVB10625	10x625				
25 GTi	M25-668	89	05/86 → 12/92			AUTO	SVB10840	10x840				
							SVB10700	10x700				
						AUTO	SVB10665	10x665				
						MAN	SVB10625	10x625				
25 GTi Turbo 2	M25-667	115	09/86 → 12/92			AUTO	SVB10840	10x840				
							SVB10700	10x700				
						AUTO	SVB10665	10x665				
						MAN	SVB10625	10x625				
				M25-662		122	08/85 → 12/92			AUTO	SVB10840	10x840
											SVB10700	10x700
		AUTO	SVB10665					10x665				
		MAN	SVB10625					10x625				
25 TRi	M25-659	100	08/85 → 12/92			AUTO	SVB10840	10x840				
							SVB10700	10x700				
						AUTO	SVB10665	10x665				
						MAN	SVB10625	10x625				



kW



...CITROËN

CX II Break

20	829 A5	78	08/85 → 08/86			SVB10675	10x675
						SVB10913	10x913
					A/C(-)	SVB101000	10x1000
					A/C(+)	SVB101150	10x1150
						TB421	116x19
						TBK281	
					A/C(-)	SVB10600	10x600
22 TRS	J6T A500	83	07/85 → 12/92		→07/89	SVB10913	10x913
					A/C(-), →07/89	SVB101000	10x1000
					A/C(+), →07/89	SVB101150	10x1150
					→07/89	TB422	118x19
					→07/89	TBK282	
					→07/89	SVB10600	10x600
22TRS	J6T A500	85	07/85 → 07/89			SVB10913	10x913
					A/C(-)	SVB101000	10x1000
					A/C(+)	SVB101150	10x1150
						TB422	118x19
						TBK282	
						SVB10600	10x600
25 D	M25-660	54	05/86 → 12/92			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
					AUTO	SVB10665	10x665
					MAN	SVB10625	10x625
						TB177	62x19
25 D Turbo 2	M25-669	88	01/87 → 12/92			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
					AUTO	SVB10665	10x665
					MAN	SVB10625	10x625
						TB177	62x19
25 i	M25-668	89	05/86 → 12/92		AUTO	SVB10840	10x840
						SVB10700	10x700
					AUTO	SVB10665	10x665
					MAN	SVB10625	10x625
25 TRI	M25-659	100	08/85 → 12/92		AUTO	SVB10840	10x840
						SVB10700	10x700
					AUTO	SVB10665	10x665
					MAN	SVB10625	10x625
2500 D Turbo	M25-648	70	08/85 → 12/86			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
					AUTO	SVB10665	10x665
					MAN	SVB10625	10x625
						TB177	62x19
EVASION (22, U6)							
1.8	LFZ (XU7JP)	73	05/97 → 07/02		A/C(-), Alt. 70.8A, →08/00	MVB1065R6	6PK1065
					A/C(-), Alt. 90A, →08/00	MVB1080R6	6PK1080
					A/C(+), →08/00	MVB1660R6	6PK1660
					→08/00	TB419	114x17
					→08/00	TBK010	



kw



CITROËN

...CITROËN

...EVASION (22, U6)

1.9 TD	D8B (XUD9TF), DHX (XUD9TF/BTF)	66	11/94 → 07/02	 	A/C(-), →09/00 A/C(+), →09/00 →09/00 →09/00	MVB1115R6 MVB1740R6 TB175 TBK020	6PK1115 6PK1740 136x25.4
	D8B (XUD9TF)	68	10/95 → 12/98	 	A/C(-) A/C(+)	MVB1115R6 MVB1740R6 TB175 TBK020	6PK1115 6PK1740 136x25.4
2.0	RFU (XU10J2/C)	89	06/94 → 07/02	 	A/C(-), Alt. 70A, →08/00 A/C(-), Alt. 80,9A, →08/00 A/C(+), →08/00 →08/00 →08/00	MVB1065R6 MVB1080R6 MVB1660R6 TB419 TBK010	6PK1065 6PK1080 6PK1660 114x17
2.0 16V	RFV (XU10J4R)	97	05/98 → 04/00	 	A/C(-), 09/99→ A/C(+), 09/99→ 09/99→ 09/99→	MVB1165R6 MVB1600R6 TB479 TBK113	6PK1165 6PK1600 136x25.4
	RFN (EW10J4)	100	05/00 → 07/02	 	A/C(-) A/C(-), 09/00→ A/C(+) A/C(+), 09/00→ 09/00→	MVB1165R6 MVB1190R6 MVB1600R6 MVB1708R6 TB479 TB683 TBK113 TBK279	6PK1165 6PK1190 6PK1600 6PK1708 136x25.4 153x25.4
2.0 HDI	RHZ (DW10ATED)	80	08/99 → 07/02	 	A/C(-) A/C(+) A/C(+), For OE 5750Z7 02/01→	MVB1469R6 MVB1740R6 MVB1755R6 TB632 TB720 TBK106	6PK1469 6PK1740 6PK1755 141x25.4 114x25.4
2.0 TD		68	05/97 → 07/02	 	A/C(-), →09/00 A/C(+), →09/00 →09/00 →09/00	MVB1115R6 MVB1740R6 TB175 TBK020	6PK1115 6PK1740 136x25.4
2.0 Turbo C.T.	RGX (XU10J2TE)	108	06/94 → 07/02		A/C(-), 01/97→08/00, Ch. 7392→	MVB1165R6	6PK1165
					A/C(-), Alt. 70,8A, →01/97, → Ch. 7389	MVB1065R6	6PK1065
					A/C(-), Alt. 90A, →01/97, → Ch. 7389	MVB1080R6	6PK1080
					A/C(+), →01/97, → Ch. 7389	MVB1660R6	6PK1660
					A/C(+), 01/97→08/00, Ch. 7392→	MVB1600R6	6PK1600
				 	→08/00 →08/00	TB419 TBK010	114x17
2.1 TD	P8C (XUD11BTE)	80	05/96 → 07/02		A/C(-), →08/00	MVB1115R6	6PK1115
					A/C(+), →08/00	MVB1740R6	6PK1740
					→08/00	TB320	149x25.4
				 	→08/00	TBK035	

ID Break

20 F		72	11/71 → 10/72	 REG		SVB10975 SVB10800 SVB10600	10x975 10x800 10x600
------	--	----	---------------	--------------------	--	---	----------------------------

JUMPER Box

2.2 HDi 100		74	04/06 →		A/C(+)	MVB1675R6	6PK1675
2.2 HDi 120		88	04/06 →		A/C(+)	MVB1675R6	6PK1675
3.0 HDi 160		115	09/06 →			MVB1165R6	6PK1165



kW



...CITROËN

JUMPER Box (230L)

1.9 D	D9B (XUD9A/U)	51	02/94 → 04/02		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1150R6	6PK1150
					A/C(+), Alt. 120A	MVB1155R6	6PK1155
						TB175	136x25.4
						TBK020	
					→12/96	SVB10710	10x710
					12/96→	MVB755R4	4PK755
		50	07/99 → 04/02		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1150R6	6PK1150
					A/C(+), Alt. 120A	MVB1155R6	6PK1155
						TB175	136x25.4
						TBK020	
						MVB755R4	4PK755
1.9 TD	D8C (XUD9UTF)	68	03/94 → 04/02		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1150R6	6PK1150
					A/C(+), Alt. 120A	MVB1155R6	6PK1155
						TB175	136x25.4
						TBK020	
					→12/96	SVB10710	10x710
					12/96→	MVB755R4	4PK755
	DHX (XUD9TF/BTF)	66	03/94 → 04/02		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1150R6	6PK1150
					A/C(+), Alt. 120A	MVB1155R6	6PK1155
						TB175	136x25.4
						TBK020	
					→12/96	SVB10710	10x710
					12/96→	MVB755R4	4PK755
2.0	RFW (XU10J2U)	80	03/94 → 04/02		A/C(-)	MVB698R6	6PK698
					A/C(+)	MVB1100R6	6PK1100
						TB454	114x25.4
						TBK344	
					→12/96	SVB10710	10x710
					12/96→	MVB755R4	4PK755
2.0 HDI	DW10UTD	62	11/01 → 04/02		A/C(-)	MVB1469R6	6PK1469
					A/C(+)	MVB1180R6	6PK1180
						TB632	141x25.4
						TBK106	
						MVB755R4	4PK755
2.5 D	T9A (DJ5)	63	03/94 → 04/02		MS	MVB795R6	6PK795
					PS	MVB1015R6	6PK1015
						TB459	141x28
						TBK029	
						MVB915R6	6PK915
					→05/96	MVB855R4	4PK855
2.5 D 4x4	T9A (DJ5)	63	03/00 → 04/02		MS	MVB915R6	6PK915
					PS	MVB795R6	6PK795
						MVB1015R6	6PK1015
						TB459	141x28
						TBK029	
2.5 DT 4x4		76	10/96 → 08/97		MS	MVB915R6	6PK915
					PS	MVB795R6	6PK795
						MVB1015R6	6PK1015
						TB459	141x28
						TBK029	
						MVB940R3	3PK940



kw



CITROËN

...CITROËN

...JUMPER Box (230L)

2.5 TD	T8A (DJ5T)	76	03/94 → 04/02	☼ ⊖ ⊖ ☼ ☼ ☼ ☼	→10/97 MS, →10/97 PS, →10/97 →10/97 →10/97 →05/96 05/96→10/97	MVB915R6 MVB795R6 MVB1015R6 TB459 TBK029 MVB950R4 MVB940R3	6PK915 6PK795 6PK1015 141x28 4PK950 3PK940
2.5 TDi	THX (DJ5TED)	79	12/96 → 11/00	☼ ⊖ ⊖ ☼ ☼ ☼	MS PS	MVB915R6 MVB795R6 MVB1015R6 TB525 MVB940R3	6PK915 6PK795 6PK1015 147x32 3PK940
2.5 TDi 4x4	THX (DJ5TED)	79	03/00 → 11/00	☼ ⊖ ⊖ ☼ ☼ ☼	MS PS	MVB915R6 MVB795R6 MVB1015R6 TB525 MVB940R3	6PK915 6PK795 6PK1015 147x32 3PK940
2.8 HDi	8140.43S	94	09/00 → 04/02	☼ ⊖ ⊖ ☼ ☼ ☼	→ Eng Nr 2976897 Eng Nr 2976898→	MVB1100R5 MVB915R6 MVB946R6 TB368 TBK037	5PK1100 6PK915 6PK946 152x30
2.8 HDi 4x4	8140.43S	94	09/00 → 04/02	☼ ⊖ ⊖ ☼ ☼ ☼	→ Eng Nr 2976897 Eng Nr 2976898→	MVB1100R5 MVB915R6 MVB946R6 TB368 TBK037	5PK1100 6PK915 6PK946 152x30

JUMPER Box (244)

2.0	XU10J2	81	04/02 →	⊖ ⊖ ☼ ☼ ☼ ☼	A/C(-), →06/06 A/C(+), →06/06 →06/06 →06/06 →06/06	MVB698R6 MVB1100R6 TB454 TBK344 MVB755R4	6PK698 6PK1100 114x25.4 4PK755
2.0 bivalent		81	02/03 →	⊖ ⊖ ☼ ☼ ☼ ☼	A/C(-), →06/06 A/C(+), →06/06 →06/06 →06/06 →06/06	MVB698R6 MVB1100R6 TB454 TBK344 MVB755R4	6PK698 6PK1100 114x25.4 4PK755
2.0 HDi	DW10UTD	62	04/02 →	⊖ ⊖ ☼ ☼ ☼ ☼	A/C(-), →06/06 A/C(+), →06/06 →06/06 →06/06 →06/06	MVB1469R6 MVB1180R6 TB632 TBK106 MVB755R4	6PK1469 6PK1180 141x25.4 4PK755
2.2 HDi	DW12TED	74	04/02 →	⊖ ⊖ ☼ ☼ ☼ ☼	A/C(-), →06/06 A/C(-), 05/04→06/06 A/C(+), →06/06 →06/06 →06/06	MVB1469R6 MVB870R6 MVB1180R6 TB722 MVB755R4	6PK1469 6PK870 6PK1180 143x25.4 4PK755
2.8 HDi	8140.43S	94	04/02 →	☼ ⊖ ⊖ ☼ ☼ ☼	→06/06 AUTO, →06/06 MAN, →06/06 →06/06 →06/06	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30
	8140.43N	107	05/04 →	☼ ⊖ ⊖ ☼ ☼ ☼	→06/06 →06/06 →06/06 →06/06	MVB1100R5 MVB946R6 TB368 TBK037	5PK1100 6PK946 152x30
2.8 HDi 4x4	8140.43S	94	04/02 →	☼ ⊖ ⊖ ☼ ☼ ☼	→06/06 AUTO, →06/06 MAN, →06/06 →06/06 →06/06	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30



kW



...CITROËN

JUMPER Bus

2.2 HDi 100		74	04/06 →		A/C(+)	MVB1675R6	6PK1675
2.2 HDi 120		88	04/06 →		A/C(+)	MVB1675R6	6PK1675
3.0 HDi 160		115	09/06 →			MVB1165R6	6PK1165

JUMPER Bus (230P)

1.9 D	D9B (XUD9A/U)	51	01/99 → 04/02		A/C(-)	MVB730R6	6PK730		
					A/C(+), Alt. 80A	MVB1150R6	6PK1150		
					A/C(+), Alt. 120A	MVB1155R6	6PK1155		
						TB175	136x25.4		
						TBK020			
						MVB755R4	4PK755		
1.9 TD	D8C (XUD9UTF)	68	02/94 → 04/02		A/C(-)	MVB730R6	6PK730		
					A/C(+), Alt. 80A	MVB1150R6	6PK1150		
					A/C(+), Alt. 120A	MVB1155R6	6PK1155		
						TB175	136x25.4		
								TBK020	
								SVB10710	10x710
								MVB755R4	4PK755
								MVB730R6	6PK730
		66	08/94 → 04/02		A/C(-)	MVB1150R6	6PK1150		
					A/C(+), Alt. 80A	MVB1155R6	6PK1155		
					A/C(+), Alt. 120A	MVB1155R6	6PK1155		
						TB175	136x25.4		
								TBK020	
								SVB10710	10x710
								MVB755R4	4PK755
								MVB730R6	6PK730
1.9 TD 4x4	D8C (XUD9UTF)	68	08/96 → 04/02		A/C(-)	MVB730R6	6PK730		
					A/C(+), Alt. 80A	MVB1150R6	6PK1150		
					A/C(+), Alt. 120A	MVB1155R6	6PK1155		
						TB175	136x25.4		
						TBK020			
						SVB10710	10x710		
						MVB755R4	4PK755		
2.0	RFW (XU10J2U)	80	02/94 → 04/02		A/C(-)	MVB698R6	6PK698		
					A/C(+)	MVB1100R6	6PK1100		
						TB454	114x25.4		
						TBK344			
						SVB10710	10x710		
						MVB755R4	4PK755		
2.0 4x4	RFW (XU10J2U)	80	08/96 → 04/02		A/C(-)	MVB698R6	6PK698		
					A/C(+)	MVB1100R6	6PK1100		
						TB454	114x25.4		
						TBK344			
						SVB10710	10x710		
						MVB755R4	4PK755		
2.5 D	T9A (DJ5)	63	08/94 → 04/02		MS	MVB795R6	6PK795		
					PS	MVB1015R6	6PK1015		
						TB459	141x28		
						TBK029			
						MVB915R6	6PK915		
						MVB855R4	4PK855		
2.5 D 4x4	T9A (DJ5)	63	08/96 → 04/02		MS	MVB915R6	6PK915		
					PS	MVB795R6	6PK795		
						MVB1015R6	6PK1015		
						TB459	141x28		
						TBK029			



kW



CITROËN

...CITROËN

...JUMPER Bus (230P)

2.5 TD	T8A (DJ5T)	76	08/94 → 04/02	 	→10/97 MS, →10/97 PS, →10/97 →10/97 →10/97 →05/96 05/96→10/97	MVB915R6 MVB795R6 MVB1015R6 TB459 TBK029 MVB950R4 MVB940R3	6PK915 6PK795 6PK1015 141x28 4PK950 3PK940
2.5 TD 4x4	T8A (DJ5T)	76	08/96 → 04/02	 	→08/97 MS, →08/97 PS, →08/97 →08/97 →08/97 →08/97	MVB915R6 MVB795R6 MVB1015R6 TB459 TBK029 MVB940R3	6PK915 6PK795 6PK1015 141x28 3PK940
2.5 TDi	THX (DJ5TED)	79	12/96 → 11/00	 	MS PS	MVB915R6 MVB795R6 MVB1015R6 TB525 MVB940R3	6PK915 6PK795 6PK1015 147x32 3PK940
2.5 TDi 4x4	THX (DJ5TED)	79	12/96 → 11/00	 	MS PS	MVB915R6 MVB795R6 MVB1015R6 TB525 MVB940R3	6PK915 6PK795 6PK1015 147x32 3PK940
2.8 HDi	8140.43S	94	09/00 → 04/02	 	→ Eng Nr 2976897 Eng Nr 2976898→	MVB1100R5 MVB915R6 MVB946R6 TB368 TBK037	5PK1100 6PK915 6PK946 152x30 6PK946
2.8 HDi 4x4	8140.43S	94	09/00 → 04/02	 	→ Eng Nr 2976897 Eng Nr 2976898→	MVB1100R5 MVB915R6 MVB946R6 TB368 TBK037	5PK1100 6PK915 6PK946 152x30 6PK946

JUMPER Bus (244, Z_)

2.0	XU10J2	81	04/02 →	 	A/C(-), →06/06 A/C(+), →06/06 →06/06 →06/06 →06/06	MVB698R6 MVB1100R6 TB454 TBK344 MVB755R4	6PK698 6PK1100 114x25.4 4PK755
2.0 bivalent		81	02/03 →	 	A/C(-), →06/06 A/C(+), →06/06 →06/06 →06/06	MVB698R6 MVB1100R6 TB454 TBK344 MVB755R4	6PK698 6PK1100 114x25.4 4PK755
2.0 HDi	DW10UTD	62	04/02 →	 	A/C(-), →06/06 A/C(+), →06/06 →06/06 →06/06	MVB1469R6 MVB1180R6 TB632 TBK106 MVB755R4	6PK1469 6PK1180 141x25.4 4PK755
2.2 HDi	DW12TED	74	04/02 →	 	A/C(-), →06/06 A/C(-), 05/04→06/06 A/C(+), →06/06 →06/06	MVB1469R6 MVB870R6 MVB1180R6 TB722 MVB755R4	6PK1469 6PK870 6PK1180 143x25.4 4PK755
2.8 HDi	8140.43S	94	04/02 →	 	→06/06 AUTO, →06/06 MAN, →06/06 →06/06 →06/06	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30 6PK946





kW



...CITROËN

JUMPER Flatbed / Chassis

2.2 HDi 100	74	04/06 →		A/C(+)	MVB1675R6	6PK1675
2.2 HDi 120	88	04/06 →		A/C(+)	MVB1675R6	6PK1675
3.0 HDi 160	115	09/06 →			MVB1165R6	6PK1165

JUMPER Flatbed / Chassis (230)

1.9 TD	D8C (XUD9UTF)	68	03/94 → 04/02		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1150R6	6PK1150
					A/C(+), Alt. 120A	MVB1155R6	6PK1155
						TB175	136x25.4
						TBK020	
						SVB10710	10x710
	DHX (XUD9TF/BTF)	66	03/94 → 04/02		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 80A	MVB1150R6	6PK1150
					A/C(+), Alt. 120A	MVB1155R6	6PK1155
						TB175	136x25.4
						TBK020	
						SVB10710	10x710
	RFX (XU10J2U)	80	03/94 → 04/02		A/C(-)	MVB698R6	6PK698
					A/C(+)	MVB1100R6	6PK1100
						TB454	114x25.4
						TBK344	
						SVB10710	10x710
						MVB755R4	4PK755
2.5 D	T9A (DJ5)	63	03/94 → 04/02		MS	MVB795R6	6PK795
					PS	MVB1015R6	6PK1015
						TB459	141x28
						TBK029	
						MVB915R6	6PK915
						MVB855R4	4PK855
2.5 D 4X4	T9A (DJ5)	63	03/00 → 04/02			MVB915R6	6PK915
					MS	MVB795R6	6PK795
					PS	MVB1015R6	6PK1015
						TB459	141x28
						TBK029	
						MVB915R6	6PK915
2.5 TD	T8A (DJ5T)	76	03/94 → 04/02		→10/97	MVB915R6	6PK915
					MS, →10/97	MVB795R6	6PK795
					PS, →10/97	MVB1015R6	6PK1015
					→10/97	TB459	141x28
					→10/97	TBK029	
					→05/96	MVB950R4	4PK950
2.5 TDi	THX (DJ5TED)	79	12/96 → 04/02			MVB940R3	3PK940
					MS	MVB915R6	6PK915
					PS	MVB795R6	6PK795
						MVB1015R6	6PK1015
						TB525	147x32
						MVB940R3	3PK940
2.5 TDi 4X4	THX (DJ5TED)	79	03/00 → 04/02			MVB915R6	6PK915
					MS	MVB795R6	6PK795
					PS	MVB1015R6	6PK1015
						TB525	147x32
						MVB940R3	3PK940
						MVB915R6	6PK915



kw



CITROËN

...CITROËN

...JUMPER Flatbed / Chassis (230)

2.8 HDi	8140.43S	94	09/00 → 04/02	 	→ Eng Nr 2976897 Eng Nr 2976898 →	MVB1100R5 MVB915R6 MVB946R6 TB368 TBK037	5PK1100 6PK915 6PK946 152x30
		93	10/00 → 01/02	 	→ Eng Nr 2976897 Eng Nr 2976898 →	MVB1100R5 MVB915R6 MVB946R6 TB368 TBK037	5PK1100 6PK915 6PK946 152x30

JUMPER Flatbed / Chassis (244)

2.0 HDi	DW10UTD	62	04/02 →	 	A/C(-), →06/06 A/C(+), →06/06 →06/06 →06/06 →06/06	MVB1469R6 MVB1180R6 TB632 TBK106 MVB755R4	6PK1469 6PK1180 141x25.4 4PK755
2.2 HDi	DW12TED	74	04/02 →	 	A/C(-), →06/06 A/C(-), 05/04 →06/06 A/C(+), →06/06 →06/06 →06/06	MVB1469R6 MVB870R6 MVB1180R6 TB722 MVB755R4	6PK1469 6PK870 6PK1180 143x25.4 4PK755
		74	02/02 → 06/06	 	A/C(-) A/C(-), 05/04 → A/C(+) →06/06	MVB1469R6 MVB870R6 MVB1180R6 TB722 MVB755R4	6PK1469 6PK870 6PK1180 143x25.4 4PK755
2.8 HDi	8140.43S	94	04/02 →	 	→06/06 AUTO, →06/06 MAN, →06/06 →06/06 →06/06	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30
	8140.43N	107	05/04 →	 	→06/06 →06/06 →06/06 →06/06	MVB1100R5 MVB946R6 TB368 TBK037	5PK1100 6PK946 152x30
		107	04/04 → 06/06	 	→06/06 →06/06 →06/06 →06/06	MVB1100R5 MVB946R6 TB368 TBK037	5PK1100 6PK946 152x30
2.8 HDi 4x4		94	02/02 → 06/06	 	AUTO MAN	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30

JUMPY

1.6 HDi 90		66	01/07 →	 	A/C(-)	MVB1708R6 MVB1352R6 TB724 TBK302	6PK1708 6PK1352 137x25.4
2.0 HDi 120	RHK (DW10UTED4)	88	01/07 →	 		MVB1215R6 TB742 TBK338	6PK1215 116x25
2.0 HDi 140	RHR (DW10BTED4)	100	01/07 →	 		MVB1215R6 TB742 TBK338	6PK1215 116x25
2.0 i		103	01/07 →	 		MVB1000R6 TB744	6PK1000 153x25



kW



...CITROËN

JUMPY (U6U)

1.6	1580 SPI, 220 A2.000	58	10/95 →		→08/00	MVB925R6	6PK925
					Eng. 220A2000, A/C(-), →08/00	MVB890R6	6PK890
					Eng. 220A2000, A/C(+), →08/00	MVB905R4	4PK905
					→08/00	TB305	138x15
					→08/00	TBK027	
1.9 D	D9B (XUD9A/U)	51	10/95 → 04/98		→08/00	SVB10675	10x675
					A/C(-), MS	MVB730R6	6PK730
					A/C(-), PS	MVB1115R6	6PK1115
					A/C(+), MS	MVB1165R6	6PK1165
					A/C(+), PS	MVB1740R6	6PK1740
1.9 D 70	WJZ (DW8)	51	04/98 →		→08/00	TB175	136x25.4
					→08/00	TBK020	
					A/C(-), 10/99→10/06	MVB1440R6	6PK1440
					A/C(-), MS, 09/98→10/00	MVB860R6	6PK860
					A/C(-), PS, 09/98→10/99, → Ch. 8374	MVB1388R6	6PK1388
					A/C(+), 09/98→12/02, → Ch. 09519	MVB1740R6	6PK1740
					A/C(+), 12/02→10/06, Ch. 09520→	MVB1675R6	6PK1675
					A/C(+), MS, 09/98→10/00	MVB1035R6	6PK1035
					A/C(+), PS, 09/98→10/00	MVB1755R6	6PK1755
					09/98→10/06	TB631	140x25.4
				1.9 TD	D8B (XUD9TF)	68	04/96 →
	A/C(-), MS, →08/00	MVB730R6	6PK730				
	A/C(-), PS, →08/00	MVB1115R6	6PK1115				
	A/C(+), MS, →08/00	MVB1165R6	6PK1165				
	A/C(+), PS, →08/00	MVB1740R6	6PK1740				
D8B (XUD9TF/BTF)	66	10/95 →			→08/00	TB175	136x25.4
					→08/00	TBK020	
					A/C(-), MS, →08/00	MVB730R6	6PK730
					A/C(-), PS, →08/00	MVB1115R6	6PK1115
					A/C(+), MS, →08/00	MVB1165R6	6PK1165
					A/C(+), PS, →08/00	MVB1740R6	6PK1740
2.0	RFN (EW10J4)	100	04/00 → 12/06		→08/00	TB175	136x25.4
					→08/00	TBK020	
					A/C(-), 09/00→	MVB1190R6	6PK1190
					A/C(+), 09/00→	MVB1708R6	6PK1708
					09/00→	TB683	153x25.4
2.0 HDi 110	RHZ (DW10ATED)	80	03/00 →		09/00→	TBK279	
					A/C(-), →10/06	MVB1469R6	6PK1469
					A/C(+), →10/06	MVB1740R6	6PK1740
					A/C(+), →10/06, For OE 5750Z7	MVB1755R6	6PK1755
					→10/06	TB632	141x25.4
2.0 HDi 95	RHX	69	10/99 →		11/03→10/06	TB720	114x25.4
					→10/06	TBK106	
					→10/06, → Ch. 08560	TBK274	
					A/C(-), 02/00→10/06	MVB1469R6	6PK1469
					A/C(+), 02/00→10/06	MVB1740R6	6PK1740
2.0 i 16V		102	03/00 →		A/C(+), 02/00→10/06, For OE 5750Z7	MVB1755R6	6PK1755
					02/00→10/06	TB632	141x25.4
					02/00→10/06	TBK106	
					04/00→10/06	TBK274	
					11/06→	MVB1000R6	6PK1000
					11/06→	TB744	153x25



kW



CITROËN

...CITROËN

JUMPY Box

1.6 HDi 90		66	01/07 →		A/C(-)	MVB1708R6	6PK1708
						MVB1352R6	6PK1352
						TB724	137x25.4
						TBK302	
2.0 HDi 120	RHK (DW10UTED4)	88	01/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.0 HDi 140	RHR (DW10BTED4)	100	01/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.0 i		103	01/07 →			MVB1000R6	6PK1000
						TB744	153x25

JUMPY Box (BS_, BT_, BY_, BZ_)

1.6 i	1580 SPI, 220 A2.000	58	10/95 →		→08/00	MVB925R6	6PK925
					Eng. 220A2000, A/C(-), →08/00	MVB890R6	6PK890
					Eng. 220A2000, A/C(+), →08/00	MVB905R4	4PK905
					→08/00	TB305	138x15
					→08/00	TBK027	
					→08/00	SVB10675	10x675
1.9 D 70	WJZ (DW8)	51	04/98 →		A/C(-), 10/99→10/06	MVB1440R6	6PK1440
					A/C(-), MS, 09/98→10/00	MVB860R6	6PK860
					A/C(-), PS, 09/98→10/99,	MVB1388R6	6PK1388
					→ Ch. 8374		
					A/C(+), 09/98→12/02,	MVB1740R6	6PK1740
					→ Ch. 09519		
					A/C(+), 12/02→10/06,	MVB1675R6	6PK1675
					Ch. 09520→		
					A/C(+), MS, 09/98→10/00	MVB1035R6	6PK1035
					A/C(+), PS, 09/98→10/00	MVB1755R6	6PK1755
					09/98→10/06	TB631	140x25.4
					09/98→10/06	TBK105	
1.9 TD	DHX (XUD9TF/BTF)	66	10/95 →		A/C(-), MS, →08/00	MVB730R6	6PK730
					A/C(-), PS, →08/00	MVB1115R6	6PK1115
					A/C(+), MS, →08/00	MVB1165R6	6PK1165
					A/C(+), PS, →08/00	MVB1740R6	6PK1740
					→08/00	TB175	136x25.4
					→08/00	TBK020	
2.0 HDi 110	RHZ (DW10ATED)	80	01/02 →		A/C(-), 12/03→10/06	MVB1469R6	6PK1469
					A/C(+), 12/03→10/06	MVB1740R6	6PK1740
					12/03→10/06	TB632	141x25.4
					12/03→10/06	TBK106	
2.0 HDi 95	RHX (DW10BTED)	69	10/99 →		A/C(-), 02/00→10/06	MVB1469R6	6PK1469
					A/C(+), 02/00→10/06	MVB1740R6	6PK1740
					A/C(+), 02/00→10/06	MVB1755R6	6PK1755
					02/00→10/06	TB632	141x25.4
					02/00→10/06	TBK106	
					04/00→10/06	TBK274	
2.0 i 16V		102	03/00 →		A/C(-), 09/00→10/06	MVB1190R6	6PK1190
					A/C(+), 09/00→10/06	MVB1708R6	6PK1708
					09/00→10/06	TB683	153x25.4
					09/00→10/06	TBK279	

JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_)

1.9 TD	D8B (XUD9TF)	68	10/99 →		A/C(-), MS, →08/00	MVB730R6	6PK730
					A/C(-), PS, →08/00	MVB1115R6	6PK1115
					A/C(+), MS, →08/00	MVB1165R6	6PK1165
					A/C(+), PS, →08/00	MVB1740R6	6PK1740
					→08/00	TB175	136x25.4
					→08/00	TBK020	



kW



...CITROËN

...JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_)

2.0		100	12/03 → 10/06		A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1708R6	6PK1708
						TB683	153x25.4
				KIT		TBK279	
2.0 HDi		80	12/03 → 10/06		A/C(-)	MVB1469R6	6PK1469
					A/C(+)	MVB1740R6	6PK1740
						TB632	141x25.4
				KIT		TBK106	
2.0 HDi 95		69	10/99 →		A/C(-), 02/00 → 10/06	MVB1469R6	6PK1469
					A/C(+), 02/00 → 10/06	MVB1740R6	6PK1740
					A/C(+), 02/00 → 10/06	MVB1755R6	6PK1755
					02/00 → 10/06	TB632	141x25.4
				KIT	02/00 → 10/06	TBK106	
				KIT	04/00 → 10/06	TBK274	

LNA

0.6	R06 627	24	11/76 → 07/79			SVB10775	10x775
	V06 644	25	07/82 → 04/85			SVB10775	10x775
	V06 630	26	11/78 → 07/82			SVB10775	10x775
1.0		33	07/84 → 10/86		→ 01/86	SVB10913	10x913
1.1	109/5E	37	07/82 → 04/85			SVB10913	10x913

MEHARI

0.6	M28/1 (AK2)	19	05/68 → 10/79		09/68 →	SVB10750	10x750
	A06/635, M28/1 (AK2)	21	10/79 → 10/87			SVB10750	10x750
4x4	A06/635	21	10/79 → 10/87			SVB10750	10x750

NEMO (AA_)

1.4		54	02/08 →		A/C(-)	MVB1225R6	6PK1225
					A/C(+)	MVB1560R6	6PK1560
						TB711	104x17
				KIT		TBK312	
1.4 HDi		50	02/08 →		A/C(-)	MVB1352R6	6PK1352
					A/C(+)	MVB1708R6	6PK1708
						TB720	114x25.4
				KIT		TBK230	

SAXO (S0, S1)

1.0 X	CDZ (TU9M)	33	05/96 → 11/98		A/C(-), V-belt pulley (+)	SVB10710	10x710
					A/C(-), V-ribbed belt pulley (+)	MVB710R5	5PK710
					A/C(+)	MVB1030R5	5PK1030
						TB304	104x17
		37	05/98 → 06/03	KIT		TBK005	
					A/C(-), V-belt pulley (+)	SVB10710	10x710
					A/C(-), V-ribbed belt pulley (+)	MVB710R5	5PK710
					A/C(+)	MVB1030R5	5PK1030
						TB304	104x17
				KIT		TBK005	



kW



...CITROËN

...SAXO (S0, S1)

1.1 X,SX	HDZ (TU1M)	40	05/96 → 09/03	⊗	A/C(-), V-belt pulley (+), →06/00	SVB10710	10x710
				⊗	A/C(-), V-ribbed belt pulley (+), →06/00	MVB710R5	5PK710
				⊗ 	A/C(+), →06/00 →06/00	MVB1030R5	5PK1030
				 KIT	→06/00	TB304	104x17
HDZ (TU1M), HFX (TU1JP)	44	05/96 → 09/03	⊗	A/C(-), V-belt pulley (+)	SVB10710	10x710	
			⊗	Eng. TU1M, A/C(-), V-ribbed belt pulley (+)	MVB710R5	5PK710	
			⊗ 	Eng. TU1M, A/C(+)	MVB1030R5	5PK1030	
			 KIT	07/00→, Eng Nr 3762434→ 07/00→, Eng Nr 3762434→ Eng. TU1M	TB304 TB699 TBK316 TBK005	104x17 100x17	
1.4 VTS	KFW (TU3JP), KFX (TU3JP)	55	05/96 → 06/03	⊗	A/C(-), V-belt pulley (+)	SVB10710	10x710
				⊗	A/C(-), V-ribbed belt pulley (+)	MVB710R5	5PK710
				⊗ 	A/C(+) → Eng Nr 3666765	MVB1030R5	5PK1030
				 KIT	Eng Nr 3666766→ → Eng Nr 3666765 Auto Tensioner, Eng Nr 3666766→	TB259 TB711 TBK007 TBK312	108x17 104x17
1.5 D	VJY (TUD5)	40	09/96 → 09/03	⊗	A/C(-), MS	MVB775R5	5PK775
				⊗	A/C(-), PS	MVB960R5	5PK960
				⊗ 	A/C(+)	MVB1030R5	5PK1030
				 KIT		TB457 TBK041 TBK308	136x25.4
VJZ (TUD5)	42	09/96 → 06/01	⊗	A/C(-), MS	MVB775R5	5PK775	
			⊗	A/C(-), PS	MVB960R5	5PK960	
			⊗ 	A/C(+)	MVB1030R5	5PK1030	
			 KIT		TB457 TBK041 TBK308	136x25.4	
1.6	NFZ (TU5JP)	66	02/96 → 06/03	⊗	A/C(-)	MVB710R5	5PK710
				⊗ 	A/C(+)	MVB1030R5	5PK1030
				 KIT		TB376 TBK004	101x17
				NFT	74	02/01 → 04/04	⊗
⊗	A/C(+)	MVB1030R5	5PK1030				
⊗ 		TB376 TBK004	101x17				
 KIT							
NFZ (TU5JP)	88	02/96 → 04/04	⊗	A/C(-)	MVB775R5	5PK775	
			⊗ 	A/C(+)	MVB1050R5	5PK1050	
			 KIT		TB700	134x25.4	
			1.6 VTL,VTR	NFZ (TU5JP)	65	05/96 → 06/03	⊗
⊗	A/C(+)	MVB1030R5					5PK1030
⊗ 		TB376 TBK004					101x17
 KIT							
1.6 VTS	NFZ (TU5JP)	87	06/96 → 09/03	⊗	A/C(-)	MVB775R5	5PK775
				⊗	A/C(+)	MVB1050R5	5PK1050
				⊗ 		TB700	134x25.4
				 KIT			
NFT	72	09/00 → 09/03	⊗	A/C(-)	MVB710R5	5PK710	
			⊗	A/C(+)	MVB1030R5	5PK1030	
			⊗ 		TB376 TBK004	101x17	
			 KIT				



kW



...CITROËN

VISA

0.6	V06/665	24	07/82 → 03/91		→12/87	SVB10775	10x775
	V06 630, V06 644	25	09/78 → 06/88		→12/87	SVB10775	10x775
1.0		33	09/84 → 06/88		→12/87	SVB10913	10x913
11 E	109K	35	09/78 → 06/88		→12/87	SVB10913	10x913
	109/5F	37	07/82 → 03/91		→12/87	SVB10913	10x913
	109/5	42	09/78 → 03/91		→12/87	SVB10913	10x913
14	150D (XY7)	44	07/84 → 03/91		→09/88	SVB10913	10x913
14 GT	150B (XY8)	58	03/82 → 03/91		→09/88	SVB10913	10x913
		55	03/82 → 03/87			SVB10913	10x913
16 GTI	180A (XU5J)	76	01/85 → 06/86			MVB700R4	4PK700
						TB226	113x17
						TBK009	
	B6D	83	06/86 → 03/91		→08/88	MVB700R4	4PK700
					→08/88	TB226	113x17
					→08/88	TBK009	
17 D	161A (XUD7)	44	04/84 → 03/91		→10/89	MVB700R4	4PK700
					→10/89	TB175	136x25.4
					→10/89	TBK019	
					→10/89	SVB10650	10x650
II Super X	129/5	47	07/80 → 06/82			SVB10913	10x913

VISA Convertible

11 RE	109/5F	37	03/83 → 10/88		→12/87	SVB10913	10x913
-------	--------	----	---------------	--	--------	----------	--------

XANTIA (X1)

1.6 i	BFZ (XU5JP)	65	03/93 → 01/98		A/C(-)	MVB1080R6	6PK1080				
					A/C(+)	MVB1660R6	6PK1660				
						TB419	114x17				
						TBK010					
1.8 i	LFZ (XU7JP)	74	03/93 → 01/98		A/C(-)	MVB1080R6	6PK1080				
					A/C(+)	MVB1660R6	6PK1660				
						TB419	114x17				
						TBK010					
	LFX (XU7JB)	66	04/97 → 01/98		A/C(-)	MVB1080R6	6PK1080				
					A/C(+)	MVB1660R6	6PK1660				
						TB419	114x17				
						TBK010					
1.8 i 16V	LFY (XU7JP4)	81	06/95 → 01/98		A/C(-)	MVB1080R6	6PK1080				
					A/C(+)	MVB1660R6	6PK1660				
					Auto Tensioner	TB479	136x25.4				
						TBK122					
1.9 D	DJZ (XUD9Y)	50	06/94 → 01/98		A/C(-), →06/95, → Ch. 6808	MVB1130R6	6PK1130				
					A/C(-), 07/95→, Ch. 6809→	MVB1105R6	6PK1105				
					A/C(+), →06/95, → Ch. 6808	MVB1700R6	6PK1700				
					A/C(+), →12/96, → Ch. 7358	MVB1708R6	6PK1708				
					A/C(+), 01/97→, Ch. 7359→	MVB1740R6	6PK1740				
					A/C(+), 07/95→, Ch. 6809→	MVB1725R6	6PK1725				
						TB175	136x25.4				
						TBK020					
				D9B (XUD9A/L)		51	06/94 → 01/98		A/C(-), →06/95, → Ch. 6808	MVB1130R6	6PK1130
									A/C(-), 07/95→, Ch. 6809→	MVB1105R6	6PK1105
	A/C(+), →06/95, → Ch. 6808	MVB1700R6	6PK1700								
	A/C(+), →12/96, → Ch. 7358	MVB1708R6	6PK1708								
	A/C(+), 01/97→, Ch. 7359→	MVB1740R6	6PK1740								
	A/C(+), 07/95→, Ch. 6809→	MVB1725R6	6PK1725								
		TB175	136x25.4								
		TBK020									



kw



CITROËN

...CITROËN

...XANTIA (X1)

1.9 SD	DHW (XUD9SD)	55	02/96 → 01/98	①	A/C(-), Ch. 6809→	MVB1105R6	6PK1105	
				②	A/C(+), →12/96, → Ch. 7358	MVB1708R6	6PK1708	
				③	A/C(+), 01/97→, Ch. 7359→	MVB1740R6	6PK1740	
				④	A/C(+), Ch. 6809→	MVB1725R6	6PK1725	
						TB175	136x25.4	
						TBK020		
1.9 Turbo D	DHX (XUD9TF/BTF), DHY (XUD9TE/Y)	66	10/94 → 01/98	①	A/C(-), →06/95, → Ch. 6808	MVB1130R6	6PK1130	
				②	A/C(-), 07/95→, Ch. 6809→	MVB1105R6	6PK1105	
				③	A/C(+), →06/95, → Ch. 6808	MVB1700R6	6PK1700	
				④	A/C(+), →12/96, → Ch. 7358	MVB1708R6	6PK1708	
				⑤	A/C(+), 01/97→, Ch. 7359→	MVB1740R6	6PK1740	
				⑥	A/C(+), 07/95→, Ch. 6809→	MVB1725R6	6PK1725	
						TB175	136x25.4	
						TBK020		
2.0 i	RFX (XU10J2C)	89	03/93 → 01/98	①	A/C(-)	MVB1080R6	6PK1080	
				②	A/C(+)	MVB1660R6	6PK1660	
						TB419	114x17	
						TBK010		
2.0 i 16V	RFY (XU10J4/Z)	112	03/93 → 01/98	①	A/C(-), →05/95	MVB1080R6	6PK1080	
				②	A/C(+), →05/95	MVB1660R6	6PK1660	
						TB453	134x25.4	
	RFT (XU10J4/Z)	110	06/94 → 01/98	①	A/C(-), 06/95→	MVB1200R6	6PK1200	
				②	A/C(+), 06/95→	MVB1650R6	6PK1650	
						TB419	114x17	
							TBK010	
	RFV (XU10J4R)	97	06/95 → 01/98	①	A/C(-)	MVB1200R6	6PK1200	
				②	A/C(+)	MVB1650R6	6PK1650	
					TB479	136x25.4		
						TBK113		
2.0 Turbo	RGX (XU10J2TE)	108	06/95 → 01/98	①	A/C(-)	MVB1200R6	6PK1200	
				②	A/C(+)	MVB1650R6	6PK1650	
						TB419	114x17	
						TBK010		
2.1 Turbo D 12V	P8C (XUD11BTE)	80	06/95 → 01/98	①	A/C(-)	MVB1105R6	6PK1105	
				②	A/C(+)	MVB1725R6	6PK1725	
				③	A/C(+)	MVB1740R6	6PK1740	
						TB320	149x25.4	
						TBK035		
3.0 i 24V	XFZ (ES9J4)	140	01/97 → 01/98	①	A/C(+)	MVB1625R6	6PK1625	
						TB727	259x32	

XANTIA (X2)

1.8 i	LFX (XU7JB)	66	01/98 → 04/03	①	A/C(-), →12/00	MVB1080R6	6PK1080
				②	A/C(+), →12/00	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
1.8 i 16V	LFY (XU7JP4)	81	01/98 → 04/03	①	A/C(-)	MVB1080R6	6PK1080
				②	A/C(+)	MVB1660R6	6PK1660
						TB479	136x25.4
						TBK122	
1.9 SD	DHW (XUD9SD)	55	01/98 → 04/03	①	A/C(-), →12/00, Ch. 6809→	MVB1105R6	6PK1105
				②	A/C(+), →12/00, Ch. 6809→	MVB1725R6	6PK1725
				③	A/C(+), →12/00, Ch. 7359→	MVB1740R6	6PK1740
						TB175	136x25.4
						TBK020	
1.9 Turbo D	DHX (XUD9TF/BTF), DHY (XUD9TE/Y)	66	01/98 → 04/03	①	A/C(-), →12/00, Ch. 6809→	MVB1105R6	6PK1105
				②	A/C(+), →12/00, Ch. 6809→	MVB1725R6	6PK1725
				③	A/C(+), →12/00, Ch. 7359→	MVB1740R6	6PK1740
						TB175	136x25.4
						TBK020	



kW



...CITROËN

...XANTIA (X2)

2.0 HDI 109	RHZ (DW10ATED)	80	02/99 → 04/03		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), →02/01, For OE 5750Z7	MVB1755R6	6PK1755
					A/C(+), 02/01→	MVB1740R6	6PK1740
						TB632	141x25.4
						TBK106	
2.0 HDI 90	RHY (DW10TD)	66	03/99 → 04/03		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1740R6	6PK1740
					A/C(+), →02/01, For OE 5750Z7	MVB1755R6	6PK1755
					A/C(+), 02/01→	MVB1740R6	6PK1740
						TB632	141x25.4
						TBK106	
2.0 i	RFX (XU10J2C)	89	01/98 → 04/03		A/C(-), →08/00	MVB1080R6	6PK1080
					A/C(+), →08/00	MVB1660R6	6PK1660
					→08/00	TB419	114x17
					→08/00	TBK010	
2.0 i 16V	RFV (XU10J4R)	97	01/98 → 04/03		A/C(-), →10/02	MVB1200R6	6PK1200
					A/C(+), →10/02	MVB1650R6	6PK1650
					→10/02	TB479	136x25.4
					→10/02	TBK113	
2.0 Turbo	RGX (XU10J2TE)	108	01/98 → 04/03		A/C(-), →08/99	MVB1200R6	6PK1200
					A/C(+), →08/99	MVB1650R6	6PK1650
					→08/99	TB419	114x17
					→08/99	TBK010	
2.1 Turbo D 12V	P8C (XUD11BTE)	80	01/98 → 02/99		A/C(-)	MVB1105R6	6PK1105
					A/C(+)	MVB1725R6	6PK1725
					A/C(+)	MVB1740R6	6PK1740
						TB320	149x25.4
						TBK035	
3.0 V6	XFZ (ES9J4)	140	01/98 → 04/03		A/C(+), →10/02	MVB1625R6	6PK1625
					→10/02	TB727	259x32

XANTIA Break (X1)

1.8 i	LFZ (XU7JP)	74	06/95 → 01/98		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
	LFX (XU7JB)	66	04/97 → 01/98		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
1.8 i 16V	LFY (XU7JP4)	81	06/95 → 01/98		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
					Auto Tensioner	TB479	136x25.4
						TBK122	
1.9 SD	DHW (XUD9SD)	55	04/97 → 01/98		A/C(-), Ch. 6809→	MVB1105R6	6PK1105
					A/C(+), Ch. 6809→	MVB1725R6	6PK1725
					A/C(+), Ch. 7359→	MVB1740R6	6PK1740
						TB175	136x25.4
						TBK020	
1.9 Turbo D	D8B (XUD9TF), DHX (XUD9TF/BTF), DHY (XUD9TE/Y)	66	06/95 → 01/98		A/C(-), Ch. 6809→	MVB1105R6	6PK1105
					A/C(+), →12/96, → Ch. 7358	MVB1708R6	6PK1708
					A/C(+), 01/97→, Ch. 7359→	MVB1740R6	6PK1740
					A/C(+), Ch. 6809→	MVB1725R6	6PK1725
						TB175	136x25.4
						TBK020	
2.0 i	RFX (XU10J2C)	89	06/95 → 01/98		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	



kw



CITROËN

...CITROËN

...XANTIA Break (X1)

2.0 i 16V	RFV (XU10J4R)	97	06/95 → 01/98	①	A/C(-)	MVB1200R6	6PK1200
				②	A/C(+)	MVB1650R6	6PK1650
						TB479	136x25.4
						TBK113	
2.0 Turbo	RGX (XU10J2TE)	108	06/95 → 01/98	①	A/C(-)	MVB1200R6	6PK1200
				②	A/C(+)	MVB1650R6	6PK1650
						TB419	114x17
						TBK010	
2.1 Turbo D 12V	P8C (XUD11BTE)	80	06/96 → 01/98	①	A/C(-)	MVB1105R6	6PK1105
				②	A/C(+)	MVB1725R6	6PK1725
				③	A/C(+)	MVB1740R6	6PK1740
						TB320	149x25.4
						TBK035	

XANTIA Break (X2)

1.8 i	LFX (XU7JB)	66	01/98 → 04/03	①	A/C(-), →12/00	MVB1080R6	6PK1080
				②	A/C(+), →12/00	MVB1660R6	6PK1660
				③	→12/00	TB419	114x17
						TBK010	
1.8 i 16V	LFY (XU7JP4)	81	01/98 → 04/03	①	A/C(-)	MVB1080R6	6PK1080
				②	A/C(+)	MVB1660R6	6PK1660
					Auto Tensioner	TB479	136x25.4
						TBK122	
1.9 SD	DHW (XUD9SD)	55	01/98 → 04/03	①	A/C(-), →12/00, Ch. 6809→	MVB1105R6	6PK1105
				②	A/C(+), →12/00, Ch. 6809→	MVB1725R6	6PK1725
				③	A/C(+), →12/00, Ch. 7359→	MVB1740R6	6PK1740
					→12/00	TB175	136x25.4
					→12/00	TBK020	
1.9 Turbo D	D8B (XUD9TF), DHX (XUD9TF/BTF)	66	01/98 → 04/03	①	A/C(-), →12/00, Ch. 6809→	MVB1105R6	6PK1105
				②	A/C(+), →12/00, Ch. 6809→	MVB1725R6	6PK1725
				③	A/C(+), →12/00, Ch. 7359→	MVB1740R6	6PK1740
					→12/00	TB175	136x25.4
					→12/00	TBK020	
2.0 HDI 109	RHZ (DW10ATED)	80	02/99 → 04/03	①	A/C(-)	MVB1450R6	6PK1450
				②	A/C(+)	MVB1740R6	6PK1740
				③	A/C(+), →02/01, For OE 5750Z7	MVB1755R6	6PK1755
				④	A/C(+), 02/01→	MVB1740R6	6PK1740
						TB632	141x25.4
						TBK106	
2.0 HDI 90	RHY (DW10TD)	66	03/99 → 04/03	①	A/C(-)	MVB1450R6	6PK1450
				②	A/C(+)	MVB1740R6	6PK1740
				③	A/C(+), →02/01, For OE 5750Z7	MVB1755R6	6PK1755
				④	A/C(+), 02/01→	MVB1740R6	6PK1740
						TB632	141x25.4
						TBK106	
2.0 i	RFX (XU10J2C)	89	01/98 → 04/03	①	A/C(-), →08/00	MVB1080R6	6PK1080
				②	A/C(+), →08/00	MVB1660R6	6PK1660
				③	→08/00	TB419	114x17
						TBK010	
2.0 i 16V	RFV (XU10J4R)	97	01/98 → 04/03	①	A/C(-), →10/02	MVB1200R6	6PK1200
				②	A/C(+), →10/02	MVB1650R6	6PK1650
				③	→10/02	TB479	136x25.4
						TBK113	
2.0 Turbo	RGX (XU10J2TE)	108	01/98 → 04/03	①	A/C(-), →08/99	MVB1200R6	6PK1200
				②	A/C(+), →08/99	MVB1650R6	6PK1650
				③	→08/99	TB419	114x17
					→08/99	TBK010	
2.1 Turbo D 12V	P8C (XUD11BTE)	80	01/98 → 02/99	①	A/C(-)	MVB1105R6	6PK1105
				②	A/C(+)	MVB1725R6	6PK1725
				③	A/C(+)	MVB1740R6	6PK1740
						TB320	149x25.4
						TBK035	
3.0 V6	XFZ (ES9J4)	140	01/98 → 04/03	①	A/C(+), →10/02	MVB1625R6	6PK1625
					→10/02	TB727	259x32



kW



...CITROËN

XM (Y3)

2.0		84	05/89 → 04/94		A/C(-), Alt. 60A	MVB688R5	5PK688	
					A/C(-), Alt. 80,9A	MVB710R5	5PK710	
					A/C(+), Alt. 60A	MVB1120R5	5PK1120	
					A/C(+), Alt. 80,9A	MVB1141R5	5PK1141	
						TB419	114x17	
2.0 i	RFZ (XU10J2)	89	05/89 → 06/94		A/C(-), Alt. 60A	MVB688R5	5PK688	
					A/C(-), Alt. 80,9A	MVB710R5	5PK710	
					A/C(+), Alt. 60A	MVB1120R5	5PK1120	
					A/C(+), Alt. 80,9A	MVB1141R5	5PK1141	
						TB419	114x17	
	RDZ (XU10MZ)	79	05/89 → 04/94		A/C(-), Alt. 60A	MVB688R5	5PK688	
					A/C(-), Alt. 80,9A	MVB710R5	5PK710	
					A/C(+), Alt. 60A	MVB1120R5	5PK1120	
					A/C(+), Alt. 80,9A	MVB1141R5	5PK1141	
						TB419	114x17	
2.0 i Turbo	RGY (XU10J2TE/Z)	104	09/92 → 06/94		A/C(-), Alt. 60A	MVB688R5	5PK688	
					A/C(-), Alt. 80,9A	MVB710R5	5PK710	
					A/C(+)	MVB1155R5	5PK1155	
						TB419	114x17	
						SVB101025	10x1025	
	2.1 D 12V	P9A (XUD11A)	60	05/89 → 06/94		A/C(-), AUTO, → Ch. 6778	MVB768R5	5PK768
						A/C(-), MAN, →07/90, → Ch. 6778	MVB710R5	5PK710
						A/C(-), MAN, 07/90 →, → Ch. 6778	MVB735R5	5PK735
						A/C(+), AUTO, → Ch. 6778	MVB1188R5	5PK1188
						A/C(+), MAN, → Ch. 6778	MVB1165R5	5PK1165
2.1 TD 12V	P8A (XUD11ATE), PHZ (XUD11ATE), PJZ (XUD11ATE)	80	05/89 → 06/94		A/C(-), AUTO, → Ch. 6778	MVB768R5	5PK768	
					A/C(-), MAN, → Ch. 6778	MVB735R5	5PK735	
					A/C(+), AUTO, → Ch. 6778	MVB1188R5	5PK1188	
					A/C(+), MAN, → Ch. 6778	MVB1165R5	5PK1165	
						TB320	149x25.4	
	3.0 V6	SFZ (ZPJ/Z), UFZ (ZPJ/Z)	123	05/89 → 06/94			TBK013	
							SVB10125	10x1125
							SVB101090	10x1090
						→ Ch. 4991	SVB101125	10x1125
						Ch. 4992 →	SVB101090	10x1090
3.0 V6 24V	SKZ (ZPJ4/Z), UKZ (ZPJ4/Z)	147	07/90 → 06/94			SVB10665	10x665	
					→01/92, → Ch. 5565	SVB10700	10x700	
					02/92 →, Ch. 5566 →	MVB850R5	5PK850	
					A/C(-)	MVB1388R5	5PK1388	
					A/C(+)	MVB850R5	5PK850	
3.0 V6 24V	SKZ (ZPJ4/Z), UKZ (ZPJ4/Z)	147	07/90 → 06/94		Eng. UKZ	MVB850R5	5PK850	
					→01/92, → Ch. 5565	SVB10665	10x665	
					02/92 →, Ch. 5566 →	SVB10700	10x700	
					Eng. UKZ, A/C(+)	MVB1450R5	5PK1450	



kw



CITROËN

...CITROËN

XM (Y4)

2.0 i 16V	RFV (XU10J4R)	97	05/94 → 10/00	①	A/C(-), →05/95, → Ch. 06778	MVB1080R6	6PK1080
				②	A/C(-), 06/95→04/00, Ch. 06779→	MVB1200R6	6PK1200
				③	A/C(+), →05/95, → Ch. 06778	MVB1660R6	6PK1660
				④	A/C(+), 06/95→04/00, Ch. 06779→	MVB1650R6	6PK1650
					→04/00	TB479	136x25.4
					→04/00	TBK113	
					A/C(-), 06/95→07/99	MVB1200R6	6PK1200
					A/C(-), Alt. 60A, →05/95, → Ch. 6778	MVB688R5	5PK688
					A/C(-), Alt. 80,9A, →05/95, → Ch. 6778	MVB710R5	5PK710
					A/C(+), →05/95, → Ch. 6778	MVB1155R5	5PK1155
2.0 Turbo	RGX (XU10J2TE)	108	05/94 → 10/00	①	A/C(+), 06/95→07/99	MVB1650R6	6PK1650
				②	→07/99	TB419	114x17
					→07/99	TBK010	
					→07/99	SVB101025	10x1025
					A/C(-), 06/95→04/00, Ch. 6779→	MVB1105R6	6PK1105
					A/C(-), AUTO, →05/95, → Ch. 6778	MVB768R5	5PK768
					A/C(-), MAN, →05/95, → Ch. 6778	MVB735R5	5PK735
					A/C(+), 06/95→04/00, Ch. 6779→	MVB1725R6	6PK1725
					A/C(+), AUTO, →05/95, → Ch. 6778	MVB1188R5	5PK1188
					A/C(+), MAN, →05/95, → Ch. 6778	MVB1165R5	5PK1165
2.1 TD 12V	P8A (XUD11ATE), P8C (XUD11BTE), PHZ (XUD11ATE), PJZ (XUD11ATE)	80	05/94 → 10/00		→04/00	TB320	149x25.4
					→04/00	TBK035	
					→04/00, → Ch. 4991	SVB101125	10x1125
					→04/00, Ch. 4992→	SVB101090	10x1090
					A/C(-), →04/00	MVB1190R6	6PK1190
					A/C(-), →04/00, For OE 5750M0	MVB1200R6	6PK1200
					A/C(+), →04/00	MVB1865R6	6PK1865
					→04/00	TB459	141x28
					→04/00	TBK029	
					→05/96, → Ch. 7143	MVB950R4	4PK950
2.5 TD	THY (DK5ATE)	95	05/94 → 10/00		05/96→04/00, Ch. 7144→	MVB940R3	3PK940
					A/C(+), →04/00	MVB1625R6	6PK1625
					→04/00	TB727	259x32
					→12/98, Ch. 5566→	SVB10700	10x700
					A/C(-), →12/98	MVB850R5	5PK850
					A/C(+), →12/98	MVB1388R5	5PK1388
					→04/97, Ch. 5566→	SVB10700	10x700
					Eng. UKZ, A/C(-), →04/97	MVB850R5	5PK850
					Eng. UKZ, A/C(+), →04/97	MVB1450R5	5PK1450
3.0 V6	XFZ (ES9J4)	140	04/97 → 10/00	①	A/C(+), →04/00	MVB1625R6	6PK1625
					→04/00	TB727	259x32
3.0 V6 24V	SKZ (ZPJ4/Z), UKZ (ZPJ4/Z)	147	05/94 → 10/00	①	→12/98, Ch. 5566→	SVB10700	10x700
					A/C(-), →12/98	MVB850R5	5PK850

XM Break (Y3)

2.0 i	RFZ (XU10J2)	89	11/91 → 04/94	①	A/C(-), Alt. 60A	MVB688R5	5PK688
				②	A/C(-), Alt. 80,9A	MVB710R5	5PK710
				③	A/C(+), Alt. 60A	MVB1120R5	5PK1120
				④	A/C(+), Alt. 80,9A	MVB1141R5	5PK1141
						TB419	114x17
						TBK010	
						SVB101025	10x1025



kW



...CITROËN

...XM Break (Y3)

2.0 i (Y3A)	RDZ (XU10MZ), XU102C	79	11/91 → 04/94		A/C(-), Alt. 60A	MVB688R5	5PK688
					A/C(-), Alt. 80,9A	MVB710R5	5PK710
					A/C(+), Alt. 60A	MVB1120R5	5PK1120
					A/C(+), Alt. 80,9A	MVB1141R5	5PK1141
						TB419	114x17
2.0 Turbo	RGY (XU10J2TE/Z)	104	09/92 → 04/94		A/C(-), Alt. 60A	MVB688R5	5PK688
					A/C(-), Alt. 80,9A	MVB710R5	5PK710
					A/C(+)	MVB1155R5	5PK1155
						TB419	114x17
						TBK010	
2.1 D 12V	P9A (XUD11A)	60	11/91 → 04/94		A/C(-), AUTO, → Ch. 6778	MVB768R5	5PK768
					A/C(-), MAN, → Ch. 6778	MVB735R5	5PK735
					A/C(+), AUTO, → Ch. 6778	MVB1188R5	5PK1188
					A/C(+), MAN, → Ch. 6778	MVB1165R5	5PK1165
						TB319	144x25.4
2.1 TD 12V	P8A (XUD11ATE), P8C (XUD11BTE), PHZ (XUD11ATE), PJZ (XUD11ATE)	80	11/91 → 04/94		A/C(-), AUTO, → Ch. 6778	MVB768R5	5PK768
					A/C(-), MAN, → Ch. 6778	MVB735R5	5PK735
					A/C(+), AUTO, → Ch. 6778	MVB1188R5	5PK1188
					A/C(+), MAN, → Ch. 6778	MVB1165R5	5PK1165
						TB320	149x25.4
3.0 V6	SFZ (ZPJ/Z), UFZ (ZPJ/Z)	123	11/91 → 04/94			MVB850R5	5PK850
					→01/92, → Ch. 5565	SVB10665	10x665
					Ch. 5566→	SVB10700	10x700
					A/C(+)	MVB1388R5	5PK1388

XM Break (Y4)

2.0 i 16V	RFV (XU10J4R)	97	05/94 → 10/00		A/C(-), →05/95, → Ch. 06778	MVB1080R6	6PK1080
					A/C(-), 06/95→04/00, Ch. 06779→	MVB1200R6	6PK1200
					A/C(+), →05/95, → Ch. 06778	MVB1660R6	6PK1660
					A/C(+), 06/95→04/00, Ch. 06779→	MVB1650R6	6PK1650
					→04/00	TB479	136x25.4
2.0 Turbo	RGX (XU10J2TE), RGY (XU10J2TE/Z)	108	05/94 → 10/00		A/C(-), Alt. 80,9A, →05/95, → Ch. 6778	MVB710R5	5PK710
					Eng. XU10J2TE, A/C(-), 06/95→07/99	MVB1200R6	6PK1200
					Eng. XU10J2TE, A/C(-), Alt. 60A, →05/95, → Ch. 6778	MVB688R5	5PK688
					Eng. XU10J2TE, A/C(+), →05/95, → Ch. 6778	MVB1155R5	5PK1155
					Eng. XU10J2TE, A/C(+), 06/95→07/99	MVB1650R6	6PK1650
					→07/99	TB419	114x17
					→07/99	TBK010	
					→07/99	SVB101025	10x1025



kW



CITROËN

...CITROËN

...XM Break (Y4)

2.1 D12	P9A (XUD11A)	60	07/94 → 06/96	⊗	A/C(-), 06/95→, Ch. 6779→	MVB1105R6	6PK1105
				⊗	A/C(-), AUTO, →05/95, → Ch. 6778	MVB768R5	5PK768
				⊗	A/C(-), MAN, → Ch. 6778	MVB735R5	5PK735
				⊗	A/C(+), 06/95→, Ch. 6779→	MVB1725R6	6PK1725
				⊗	A/C(+), AUTO, →05/95, → Ch. 6778	MVB1188R5	5PK1188
				⊗	A/C(+), MAN, →05/95, → Ch. 6778	MVB1165R5	5PK1165
				 KIT	→ Ch. 4991	TB319	144x25.4
2.1 TD 12V	P8C (XUD11BTE), PHZ (XUD11ATE), PJZ (XUD11ATE)	80	05/94 → 10/00	⊗	A/C(-), 06/95→04/00, Ch. 6779→	MVB1105R6	6PK1105
				⊗	A/C(-), AUTO, →05/95, → Ch. 6778	MVB768R5	5PK768
				⊗	A/C(-), MAN, →05/95, → Ch. 6778	MVB735R5	5PK735
				⊗	A/C(+), 06/95→04/00, Ch. 6779→	MVB1725R6	6PK1725
				⊗	A/C(+), AUTO, →05/95, → Ch. 6778	MVB1188R5	5PK1188
				⊗	A/C(+), MAN, →05/95, → Ch. 6778	MVB1165R5	5PK1165
				 KIT	→04/00	TB320	149x25.4
2.5 TD	THY (DK5ATE)	95	05/94 → 10/00	⊗	→04/00	TBK035	
				⊗	A/C(-), →04/00	MVB1190R6	6PK1190
				⊗	A/C(-), →04/00, For OE 5750M0	MVB1200R6	6PK1200
				⊗	A/C(+), →04/00	MVB1865R6	6PK1865
				 KIT	→04/00	TB459	141x28
				 KIT	→04/00	TBK029	
				 KIT	→05/96, → Ch. 7143	MVB950R4	4PK950
3.0 V6	XFZ (ES9J4) SFZ (ZPJ/Z), UFZ (ZPJ/Z)	140 123	04/97 → 10/00 05/94 → 10/00	⊗	05/96→04/00, Ch. 7144→	MVB940R3	3PK940
				⊗	A/C(+), →04/00	MVB1625R6	6PK1625
				 KIT	→04/00	TB727	259x32
				⊗	→12/98	MVB850R5	5PK850
				⊗	→12/98, Ch. 5566→	SVB10700	10x700
				 KIT	A/C(+), →12/98	MVB1388R5	5PK1388

XSARA (N1)

1.4 HDi	8HX (DV4TD)	50	01/03 → 03/05	⊗	A/C(-)	MVB1335R6	6PK1335
				⊗	A/C(+)	MVB1708R6	6PK1708
				 KIT		TB720	114x25.4
1.4 i	KFW (TU3JP), KFX (TU3JP)	55	04/97 → 03/05	⊗		TBK230	
				⊗	A/C(-), 09/00→10/04	MVB1450R6	6PK1450
				⊗	A/C(-), MS, →04/01	SVB10710	10x710
				⊗	A/C(+), →04/01	MVB855R4	4PK855
				⊗	A/C(+), 09/00→10/04	MVB1560R6	6PK1560
				 KIT	→10/04, → Eng Nr 3666765	TB259	108x17
				 KIT	→10/04, Eng Nr 3666766→	TB711	104x17
				 KIT	→10/04, → Eng Nr 3666765	TBK007	
				 KIT	Auto Tensioner, →10/04, Eng Nr 3666766→	TBK312	
				⊗	A/C(-), →04/98, → Ch. 7832	MVB875R5	5PK875
⊗	A/C(-), 04/98→04/01, Ch. 7883→	MVB830R5	5PK830				
1.5 D	VJZ (TUD5)	42	04/97 → 09/00	⊗	A/C(+), →04/01	MVB1255R5	5PK1255
				 KIT	05/98→	MVB960R5	5PK960
				 KIT	05/98→	TB457	136x25.4
				 KIT	05/98→	TBK041	



kW



...CITROËN

...XSARA (N1)

1.6 16V	NFU (TU5JP4)	80	09/00 → 03/05		A/C(-), →10/04	MVB1450R6	6PK1450
					A/C(+), →10/04	MVB1560R6	6PK1560
1.6 i	NFZ (TU5JP)	65	04/97 → 09/00		→10/04	TB700	134x25.4
					→10/04, → Eng Nr 1806404	TBK318	
					→10/04, Eng Nr 1806405→	TBK319	
					A/C(-), MS	SVB10710	10x710
					A/C(+)	MVB855R4	4PK855
						TB376	101x17
1.8 D	161A (XUD7), A9A (XUD7)	43	04/97 → 09/00			TBK004	
					A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1255R5	5PK1255
					A/C(-), MS, 05/98→05/99	MVB730R6	6PK730
					A/C(-), PS, 05/98→05/99	MVB1130R6	6PK1130
					A/C(+), 05/98→05/99	MVB1740R6	6PK1740
1.8 i	LFZ (XU7JB)	66	04/97 → 09/00		05/98→05/99	TB175	136x25.4
					05/98→05/99	TBK020	
					A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
1.8 i 16V	LFY (XU7JP4)	81	04/97 → 09/00		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB479	136x25.4
						TBK122	
					A/C(-), Alt. 70,8A	MVB1065R6	6PK1065
					A/C(-), Alt. 90A	MVB1080R6	6PK1080
1.8 i Aut.	LFZ (XU7JP)	74	04/97 → 09/00		A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
					A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
1.8 TD		66	10/97 → 09/00		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
					A/C(-), MS	MVB730R6	6PK730
					A/C(-), PS	MVB1130R6	6PK1130
1.9 D	DJY (XUD9A)	50	04/97 → 09/00		A/C(+)	MVB1740R6	6PK1740
						TB175	136x25.4
						TBK020	
					A/C(-), 10/99→	MVB1440R6	6PK1440
					A/C(-), MS, →08/00	MVB860R6	6PK860
					A/C(-), PS, →10/99, → Ch. 8374	MVB1388R6	6PK1388
	WJY (DW8B), WJZ (DW8)	51	07/98 → 03/05		A/C(+), 09/00→	MVB1740R6	6PK1740
					Eng. DW8, A/C(+), MS, →08/00	MVB1035R6	6PK1035
					Eng. DW8, A/C(+), PS, →08/00	MVB1755R6	6PK1755
						TB631	140x25.4
						TBK105	
					Eng. DW8B		
1.9 SD	DHV (XUD9BSD)	55	01/98 → 09/00		A/C(-), MS, →05/99	MVB730R6	6PK730
					A/C(-), PS, →05/99	MVB1130R6	6PK1130
					A/C(+), →05/99	MVB1740R6	6PK1740
					→05/99	TB175	136x25.4
					→05/99	TBK020	
1.9 TD	DHY (XUD9TE/Y)	66	04/97 → 09/00		A/C(-), MS	MVB730R6	6PK730
					A/C(-), PS	MVB1130R6	6PK1130
					A/C(+)	MVB1740R6	6PK1740
						TB175	136x25.4
						TBK020	



kw



CITROËN

...CITROËN

...XSARA (N1)

2.0 16V	RFS (XU10J4RS)	120	04/97 → 09/00	⊗	A/C(-), 01/98 →	MVB1165R6	6PK1165
				⊗	A/C(+), 01/98 →	MVB1600R6	6PK1600
				⊗	01/98 → 03/00, → Ch. 8546	TB479	136x25.4
				⊗	04/00 →, Ch. 8547 →	TB724	137x25.4
				⊗	01/98 → 03/00, → Ch. 8546	TBK113	
RFV (XU10J4R)	97	07/98 → 09/00	⊗	A/C(-)	MVB1165R6	6PK1165	
			⊗	A/C(+)	MVB1600R6	6PK1600	
			⊗		TB479	136x25.4	
				⊗		TBK113	
RFN (EW10J4)	100	09/00 → 03/05	⊗	A/C(-)	MVB1200R6	6PK1200	
			⊗	A/C(+)	MVB1725R6	6PK1725	
			⊗		TB683	153x25.4	
				⊗		TBK279	
2.0 HDi 109	RHZ (DW10ATED)	80	05/01 → 03/05	⊗	A/C(-)	MVB1469R6	6PK1469
				⊗	A/C(+)	MVB1740R6	6PK1740
				⊗		TB632	141x25.4
				⊗	Ch. 8736 →	TBK274	
2.0 HDi 90	RHY (DW10TD)	66	02/99 → 03/05	⊗	A/C(-), 06/99 →	MVB1469R6	6PK1469
				⊗	A/C(+), 06/99 →	MVB1740R6	6PK1740
				⊗	06/99 →	TB632	141x25.4
				⊗	06/99 → 10/00, → Ch. 8735	TBK106	
				⊗	10/00 →, Ch. 8736 →	TBK274	

XSARA Break (N2)

1.4 HDi	8HX (DV4TD)	50	01/03 → 08/05	⊗	A/C(-)	MVB1335R6	6PK1335
				⊗	A/C(+)	MVB1708R6	6PK1708
				⊗		TB720	114x25.4
				⊗		TBK230	
1.4 i	KFW (TU3JP), KFX (TU3JP)	55	10/97 → 08/05	⊗	A/C(-), 09/00 → 03/05	MVB1450R6	6PK1450
				⊗	A/C(-), MS, 05/98 → 08/00	SVB10710	10x710
				⊗	A/C(+), 05/98 → 08/00	MVB855R4	4PK855
				⊗	A/C(+), 09/00 → 03/05	MVB1560R6	6PK1560
				⊗	05/98 → 03/05,	TB259	108x17
					→ Eng Nr 3666765		
					05/98 → 03/05, Eng Nr 3666766 →	TB711	104x17
	05/98 → 03/05,	TBK007					
	→ Eng Nr 3666765						
		⊗	Auto Tensioner, 05/98 → 03/05,	TBK312			
		⊗	Eng Nr 3666766 →				
		⊗	A/C(-), 05/98 → 08/00	MVB830R5	5PK830		
		⊗	A/C(+), 05/98 → 08/00	MVB1255R5	5PK1255		
1.5 D	VJZ (TUD5)	42	10/97 → 09/00	⊗	05/98 →	MVB960R5	5PK960
				⊗	05/98 →	TB457	136x25.4
				⊗	05/98 →	TBK041	
1.6 16V	NFU (TU5JP4)	80	09/00 → 08/05	⊗	A/C(-)	MVB1450R6	6PK1450
				⊗	A/C(+)	MVB1560R6	6PK1560
				⊗		TB700	134x25.4
				⊗	→ Eng Nr 1806404	TBK318	
				⊗	Eng Nr 1806405 →	TBK319	
1.6 i	NFZ (TU5JP)	65	10/97 → 09/00	⊗	A/C(-), MS, 05/98 →	SVB10710	10x710
				⊗	A/C(+), 05/98 →	MVB855R4	4PK855
				⊗	05/98 →	TB376	101x17
				⊗	05/98 →	TBK004	
				⊗	A/C(-), 05/98 →	MVB875R5	5PK875
				⊗	A/C(+), 05/98 →	MVB1255R5	5PK1255
1.8 D	A9A (XUD7)	43	10/97 → 09/00	⊗	A/C(-), MS, 05/98 → 05/99	MVB730R6	6PK730
				⊗	A/C(-), PS, 05/98 → 05/99	MVB1130R6	6PK1130
				⊗	A/C(+), 05/98 → 05/99	MVB1740R6	6PK1740
				⊗	05/98 → 05/99	TB175	136x25.4
				⊗	05/98 → 05/99	TBK020	



kW



...CITROËN

...XSARA Break (N2)

1.8 i	LFX (XU7JB)	66	10/97 → 09/00		A/C(-), 05/98 →	MVB1080R6	6PK1080	
					A/C(+), 05/98 →	MVB1660R6	6PK1660	
					05/98 →	TB419	114x17	
					05/98 →	TBK010		
1.8 i 16V	LFY (XU7JP4)	81	10/97 → 09/00		A/C(-), 05/98 →	MVB1080R6	6PK1080	
					A/C(+), 05/98 →	MVB1660R6	6PK1660	
					05/98 →	TB479	136x25.4	
					05/98 →	TBK122		
1.8 i Aut.	LFZ (XU7JP)	74	10/97 → 09/00		A/C(-), Alt. 70.8A, 05/98 → 05/99	MVB1065R6	6PK1065	
					A/C(-), Alt. 90A, 05/98 → 05/99	MVB1080R6	6PK1080	
					A/C(+), 05/98 → 05/99	MVB1660R6	6PK1660	
					05/98 → 05/99	TB419	114x17	
		05/98 → 05/99	TBK010					
	1.9 D	DJY (XUD9A)	50	10/97 → 09/00		A/C(-), MS, 05/98 →	MVB730R6	6PK730
						A/C(-), PS, 05/98 →	MVB1130R6	6PK1130
						A/C(+), 05/98 →	MVB1740R6	6PK1740
					05/98 →	TB175	136x25.4	
	05/98 →	TBK020						
1.9 D	DHV (XUD9BSD)	55	01/98 → 09/00		A/C(-), MS, 05/98 → 05/99	MVB730R6	6PK730	
					A/C(-), PS, 05/98 → 05/99	MVB1130R6	6PK1130	
					A/C(+), 05/98 → 05/99	MVB1740R6	6PK1740	
					05/98 → 05/99	TB175	136x25.4	
		05/98 → 05/99	TBK020					
	1.9 D	WJY (DW8B), WJZ (DW8)	51	07/98 → 08/05		A/C(-), 10/99 →	MVB1440R6	6PK1440
						A/C(-), MS, 06/99 → 08/00	MVB860R6	6PK860
						A/C(-), PS, 06/99 → 10/99, → Ch. 8374	MVB1388R6	6PK1388
					A/C(+), 09/00 →	MVB1740R6	6PK1740	
	Eng. DW8, A/C(+), MS, 06/99 → 08/00	MVB1035R6	6PK1035					
	Eng. DW8, A/C(+), PS, 06/99 → 08/00	MVB1755R6	6PK1755					
	06/99 →	TB631	140x25.4					
	Eng. DW8B, 06/99 →	TBK105						
1.9 TD	DHY (XUD9TE/Y)	66	10/97 → 09/00		A/C(-), MS, 05/98 →	MVB730R6	6PK730	
					A/C(-), PS, 05/98 →	MVB1130R6	6PK1130	
					A/C(+), 05/98 →	MVB1740R6	6PK1740	
					05/98 →	TB175	136x25.4	
	05/98 →	TBK020						
2.0 16V	RFV (XU10J4R)	97	07/98 → 09/00		A/C(-)	MVB1165R6	6PK1165	
					A/C(+)	MVB1600R6	6PK1600	
						TB479	136x25.4	
						TBK113		
2.0 16V	RFN (EW10J4)	100	09/00 → 08/05		A/C(-)	MVB1200R6	6PK1200	
					A/C(+)	MVB1725R6	6PK1725	
						TB683	153x25.4	
						TBK279		
2.0 HDi 109	RHZ (DW10ATED)	80	05/01 → 08/05		A/C(-)	MVB1469R6	6PK1469	
					A/C(+)	MVB1740R6	6PK1740	
						TB632	141x25.4	
					Ch. 8736 →	TBK274		
2.0 HDi 90	RHY (DW10TD)	66	02/99 → 08/05		A/C(-), 06/99 →	MVB1469R6	6PK1469	
					A/C(+), 06/99 →	MVB1740R6	6PK1740	
					06/99 →	TB632	141x25.4	
					06/99 → 10/00, → Ch. 8735	TBK106		
	10/00 →, Ch. 8736 →	TBK274						



kw



CITROËN

...CITROËN

XSARA Coupe (N0)

1.4 HDi	8HX (DV4TD)	50	01/03 → 03/05	⊖	A/C(-)	MVB1335R6	6PK1335	
				⊕	A/C(+)	MVB1708R6	6PK1708	
						TB720	114x25.4	
						TBK230		
1.4 i	KFW (TU3JP), KFX (TU3JP)	55	03/98 → 03/05	⊖	A/C(-), 09/00→10/04	MVB1450R6	6PK1450	
				⊕	A/C(-), MS, →04/01	SVB10710	10x710	
				⊕	A/C(+), →04/01	MVB855R4	4PK855	
				⊕	A/C(+), 09/00→10/04	MVB1560R6	6PK1560	
					→10/04, → Eng Nr 3666765	TB259	108x17	
					→10/04, Eng Nr 3666766→	TB711	104x17	
					→10/04, → Eng Nr 3666765	TBK007		
					Auto Tensioner, →10/04,	TBK312		
					Eng Nr 3666766→			
					A/C(-), →04/01, Ch. 7883→	MVB830R5	5PK830	
		MVB875R5	5PK875					
		MVB1255R5	5PK1255					
1.6 16V	NFU (TU5JP4)	80	09/00 → 03/05	⊖	A/C(-), →10/04	MVB1450R6	6PK1450	
				⊕	A/C(+), →10/04	MVB1560R6	6PK1560	
					→10/04	TB700	134x25.4	
					→10/04, → Eng Nr 1806404	TBK318		
					→10/04, Eng Nr 1806405→	TBK319		
1.6 i	NFZ (TU5JP)	65	02/98 → 09/00	⊖	A/C(-), MS	SVB10710	10x710	
				⊕	A/C(+)	MVB855R4	4PK855	
						TB376	101x17	
						TBK004		
					A/C(-)	MVB875R5	5PK875	
		MVB1255R5	5PK1255					
1.8 i	LFX (XU7JB)	66	02/98 → 09/00	⊖	A/C(-)	MVB1080R6	6PK1080	
				⊕	A/C(+)	MVB1660R6	6PK1660	
						TB419	114x17	
							TBK010	
	LFZ (XU7JP)	74	02/98 → 09/00	⊖	A/C(-), Alt. 70,8A	MVB1065R6	6PK1065	
				⊖	A/C(-), Alt. 90A	MVB1080R6	6PK1080	
⊕				A/C(+)	MVB1660R6	6PK1660		
						TB419	114x17	
						TBK010		
1.8 i 16V	LFY (XU7JP4)	81	02/98 → 09/00	⊖	A/C(-)	MVB1080R6	6PK1080	
				⊕	A/C(+)	MVB1660R6	6PK1660	
						TB479	136x25.4	
						TBK122		
1.9 D	WJY (DW8B), WJZ (DW8)	51	02/99 → 03/05	⊖	A/C(-), 10/99→	MVB1440R6	6PK1440	
				⊖	A/C(-), MS, →08/00	MVB860R6	6PK860	
				⊖	A/C(-), PS, →10/99,	MVB1388R6	6PK1388	
					→ Ch. 8374			
				⊕	A/C(+), 09/00→	MVB1740R6	6PK1740	
	⊕	Eng. DW8, A/C(+), MS, →08/00	MVB1035R6	6PK1035				
	⊕	Eng. DW8, A/C(+), PS, →08/00	MVB1755R6	6PK1755				
			TB631	140x25.4				
		Eng. DW8B	TBK105					
	DJY (XUD9A)	50	02/98 → 09/00	⊖	A/C(-), MS	MVB730R6	6PK730	
⊖				A/C(-), PS	MVB1130R6	6PK1130		
⊕				A/C(+)	MVB1740R6	6PK1740		
					TB175	136x25.4		
					TBK020			
1.9 TD	DHY (XUD9TE/Y)	66	02/98 → 09/00	⊖	A/C(-), MS	MVB730R6	6PK730	
				⊖	A/C(-), PS	MVB1130R6	6PK1130	
				⊕	A/C(+)	MVB1740R6	6PK1740	
						TB175	136x25.4	
						TBK020		



kW



...CITROËN

...XSARA Coupe (N0)

2.0 16V	RFN (EW10J4)	100	09/00 → 03/05		A/C(-)	MVB1200R6	6PK1200
					A/C(+)	MVB1725R6	6PK1725
						TB683	153x25.4
						TBK279	
2.0 HDi 109	RHZ (DW10ATED)	80	05/01 → 03/05		A/C(-)	MVB1469R6	6PK1469
					A/C(+)	MVB1740R6	6PK1740
						TB632	141x25.4
					Ch. 8736→	TBK274	
2.0 HDi 90	RHY (DW10TD)	66	02/99 → 03/05		A/C(-), 06/99→	MVB1469R6	6PK1469
					A/C(+), 06/99→	MVB1740R6	6PK1740
					06/99→	TB632	141x25.4
					06/99→10/00, → Ch. 8735	TBK106	
2.0 i 16V	RFS (XU10J4RS)	120	02/98 → 03/05		A/C(-), →10/04	MVB1165R6	6PK1165
					A/C(+), →10/04	MVB1600R6	6PK1600
					→03/00, → Ch. 8546	TB479	136x25.4
					04/00→10/04, Ch. 8547→	TB724	137x25.4
					→03/00, → Ch. 8546	TBK113	

XSARA PICASSO (N68)

1.6	NFZ (TU5JP)	65	06/00 →		A/C(-), →08/05	MVB1450R6	6PK1450
					A/C(+), →12/01, → Ch. 09162	MVB1560R6	6PK1560
					A/C(+), 12/01→08/05,	MVB1560R6	6PK1560
					Ch. 09163→	TB376	101x17
					→08/05	TBK004	
		70	09/00 →		A/C(-), →08/05	MVB1450R6	6PK1450
					A/C(+), →12/01, → Ch. 09162	MVB1560R6	6PK1560
					A/C(+), 12/01→08/05,	MVB1560R6	6PK1560
					Ch. 09163→	TB376	101x17
					→08/05	TBK004	
1.6 16V	NFU (TU5JP4)	80	09/05 →		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1560R6	6PK1560
						TB700	134x25.4
					→08/07, → Ch. 11253	TBK319	
1.6 HDi	DV6TED4	80	05/04 →		A/C(-)	MVB1335R6	6PK1335
					A/C(+)	MVB1708R6	6PK1708
						TB724	137x25.4
						TBK302	
		66	09/05 →		A/C(-)	MVB1335R6	6PK1335
					A/C(+)	MVB1708R6	6PK1708
						TB724	137x25.4
						TBK302	
1.8 16V	6FZ (EW7J4), LFY (XU7JP4)	85	02/00 →		Eng. EW7J4, A/C(-), →08/05	MVB1200R6	6PK1200
					Eng. EW7J4, A/C(+), →08/05	MVB1725R6	6PK1725
					→08/05	TB683	153x25.4
					→08/05	TBK279	
2.0 16V	RFN (EW10J4)	100	01/03 →		A/C(-)	MVB1200R6	6PK1200
					A/C(+)	MVB1725R6	6PK1725
						TB683	153x25.4
						TBK279	
2.0 HDi	RHY (DW10TD)	66	12/99 →		A/C(-)	MVB1469R6	6PK1469
					A/C(+)	MVB1740R6	6PK1740
						TB632	141x25.4
					→10/00, → Ch. 08735	TBK106	
					10/00→, Ch. 08736→	TBK274	



kW



CITROËN

...CITROËN

ZX (N2)

1.1	H1A, H1B	40	03/91 → 08/93		MS	MVB800R5	5PK800
					A/C(-)	SVB10710	10x710
					A/C(+)	MVB855R4	4PK855
						TB304	104x17
						TBK005	
					A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1255R5	5PK1255
						MVB800R5	5PK800
					A/C(-)	SVB10710	10x710
					A/C(+)	MVB855R4	4PK855
1.1	HDZ (TU1M)	44	03/91 → 06/97		MS	MVB800R5	5PK800
					A/C(-)	SVB10710	10x710
					A/C(+)	MVB855R4	4PK855
						TB304	104x17
						TBK005	
					A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1255R5	5PK1255
						MVB800R5	5PK800
					A/C(-)	SVB10710	10x710
					A/C(+)	MVB855R4	4PK855
1.4	KDZ (TU3M/Z)	55	03/91 → 06/97		MS, →06/92, → Ch. 5713	MVB810R4	4PK810
					MS, 07/92→, Ch. 5714→	MVB800R5	5PK800
					A/C(-), MS	SVB10710	10x710
					A/C(-), PS	MVB855R4	4PK855
						TB259	108x17
						TBK007	
					A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1255R5	5PK1255
						MVB800R5	5PK800
					A/C(-)	SVB10710	10x710
1.4 D		37	07/94 → 10/97		A/C(-), MS	SVB10700	10x700
					A/C(-), PS	MVB1130R6	6PK1130
					A/C(+)	MVB1700R6	6PK1700
						TB245	143x25.4
						TBK030	
						MVB810R4	4PK810
					MS, →06/92, → Ch. 5713	MVB800R5	5PK800
					A/C(-), MS	SVB10710	10x710
					A/C(+), MS	MVB855R4	4PK855
						TB259	108x17
1.4 i	KDX (TU3M/Z), KDZ (TU3M/Z), KFX (TU3JP)	55	03/91 → 06/97		MS, →06/92, → Ch. 5713	MVB810R4	4PK810
					MS, 07/92→, Ch. 5714→	MVB800R5	5PK800
					A/C(-), MS	SVB10710	10x710
					A/C(+), MS	MVB855R4	4PK855
						TB259	108x17
						TBK007	
					A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1255R5	5PK1255
						MVB800R5	5PK800
					A/C(-)	SVB10710	10x710
1.6 i	BDY (XU5M), BFZ (XU5JP)	65	03/91 → 06/97		Eng. XU5M, →06/94	MVB835R4	4PK835
					A/C(-), MS, 07/94→	MVB698R6	6PK698
					Eng. XU5JP, A/C(-), PS, Alt. 70.8A, 07/94→	MVB1065R6	6PK1065
					Eng. XU5JP, A/C(-), PS, Alt. 90A, 07/94→	MVB1080R6	6PK1080
					Eng. XU5JP, A/C(+), MS, 07/94→	MVB1100R6	6PK1100
					Eng. XU5JP, A/C(+), PS, 07/94→	MVB1660R6	6PK1660
					Eng. XU5M, MS, →06/94	MVB700R4	4PK700
					PS, →06/94	MVB960R4	4PK960
					→01/92, → Ch. 5545	TB226	113x17
					01/92→	TB419	114x17
	→01/92, → Ch. 5545	TBK009					
	07/94→	TBK010					



kW



...CITROËN

...ZX (N2)

1.8 D	161A (XUD7)	44	06/93 → 06/97		A/C(-), MS	MVB730R6	6PK730				
					A/C(-), PS, →05/95, → Ch. 6778	MVB1150R6	6PK1150				
					A/C(-), PS, 06/95→, Ch. 6779→	MVB1130R6	6PK1130				
					A/C(+), MS	MVB1173R6	6PK1173				
					A/C(+), PS, →01/95, → Ch. 6628	MVB1700R6	6PK1700				
					A/C(+), PS, 01/95→, Ch. 6629→	MVB1740R6	6PK1740				
						TB175	136x25.4				
					→12/93	TBK019					
					01/94→	TBK020					
						SVB10650	10x650				
1.8 i	LFZ (XU7JP)	74	07/92 → 06/97		A/C(-), MS	MVB698R6	6PK698				
					A/C(-), PS, Alt. 70,8A	MVB1065R6	6PK1065				
					A/C(-), PS, Alt. 90A	MVB1080R6	6PK1080				
					A/C(+), MS	MVB1100R6	6PK1100				
					A/C(+), PS	MVB1660R6	6PK1660				
						TB419	114x17				
						TBK010					
1.8 i 16V	LFY (XU7JP4)	81	01/96 → 06/97		A/C(-)	MVB1080R6	6PK1080				
					A/C(+)	MVB1660R6	6PK1660				
						TB479	136x25.4				
						TBK122					
1.9 D	DJZ (XUD9Y)	47	03/91 → 06/97		A/C(-), MS	MVB730R6	6PK730				
					A/C(-), PS, 03/93→05/95, Ch. 5957→6778	MVB1150R6	6PK1150				
					A/C(-), PS, Ch. 6779→	MVB1130R6	6PK1130				
					A/C(+), MS	MVB1173R6	6PK1173				
					A/C(+), PS, →01/95, → Ch. 6628	MVB1700R6	6PK1700				
					A/C(+), PS, 01/95→, Ch. 6629→	MVB1740R6	6PK1740				
						TB175	136x25.4				
					→12/93	TBK019					
					01/94→	TBK020					
						SVB10650	10x650				
					D9B (XUD9A/U)	50	06/94 → 06/97		A/C(-), MS	MVB730R6	6PK730
									A/C(-), PS, →05/95, Ch. 5957→6778	MVB1150R6	6PK1150
									A/C(-), PS, 06/95→, Ch. 6779→	MVB1130R6	6PK1130
					A/C(+), MS	MVB1173R6	6PK1173				
					A/C(+), PS, →01/95, → Ch. 6628	MVB1700R6	6PK1700				
					A/C(+), PS, 01/95→, Ch. 6629→	MVB1740R6	6PK1740				
						TB175	136x25.4				
						TBK020					
						SVB10650	10x650				
1.9 i	DKZ (XU9JA)	88	03/91 → 06/97		→06/94	MVB835R4	4PK835				
					MS, →06/94	MVB700R4	4PK700				
					PS, →06/94	MVB960R4	4PK960				
					→01/92, → Ch. 5545	TB226	113x17				
					01/92→06/94, Ch. 5546→	TB419	114x17				
					→01/92, → Ch. 5545	TBK009					
					01/92→06/94, Ch. 5546→	TBK010					



kW



CITROËN

...CITROËN

...ZX (N2)

1.9 TD	DHY (XUD9TE/Y)	66	07/92 → 06/97	⊗	A/C(-), MS	MVB730R6	6PK730
				⊗	A/C(-), PS, 03/93→05/95, Ch. 5957→6778	MVB1150R6	6PK1150
				⊗	A/C(-), PS, Ch. 6779→	MVB1130R6	6PK1130
				⊗	A/C(+), MS	MVB1173R6	6PK1173
				⊗	A/C(+), PS, →01/95, → Ch. 6628	MVB1700R6	6PK1700
				⊗	A/C(+), PS, 01/95→, Ch. 6629→	MVB1740R6	6PK1740
					→12/93	TB175	136x25.4
					01/94→	TBK019	
					V-belt pulley (+)	TBK020	
						SVB10650	10x650
2.0 i	RFX (XU10J2C)	89	07/92 → 06/97	⊗	A/C(-), 07/96→, Ch. 7175→	MVB1165R6	6PK1165
				⊗	A/C(-), MS, →06/96, → Ch. 7174	MVB698R6	6PK698
				⊗	A/C(-), PS, Alt. 70,8A, →06/96, → Ch. 7174	MVB1065R6	6PK1065
				⊗	A/C(-), PS, Alt. 90A, →06/96, → Ch. 7174	MVB1080R6	6PK1080
				⊗	A/C(+), 07/96→, Ch. 7175→	MVB1600R6	6PK1600
				⊗	A/C(+), MS, →06/96, → Ch. 7174	MVB1100R6	6PK1100
				⊗	A/C(+), PS, →06/96, → Ch. 7174	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
				2.0 i 16V	RFT (XU10J4/Z), RFY (XU10J4/Z)	112	07/92 → 10/94
⊗	Eng. XU10J4, A/C(-), Alt. 70, 8A	MVB1065R6	6PK1065				
⊗	Eng. XU10J4, A/C(-), Alt. 90A	MVB1080R6	6PK1080				
		TB453	134x25.4				
		MVB1065R6	6PK1065				
RFT (XU10J4/Z)	110	06/94 → 06/97	⊗		A/C(-), Alt. 70,8A	MVB1065R6	6PK1065
			⊗		A/C(-), Alt. 90A	MVB1080R6	6PK1080
			⊗		A/C(+)	MVB1660R6	6PK1660
		TB453	134x25.4				
RFS (XU10J4RS)	120	05/96 → 06/97	⊗		A/C(-), 09/96→	MVB1165R6	6PK1165
			⊗	A/C(+), 09/96→	MVB1600R6	6PK1600	
					TB479	136x25.4	
		TBK113					

ZX Break (N2)

1.4 i	KDY (TU3M), KFX (TU3JP)	55	10/93 → 10/97	⊗	MS, Ch. 5714→	MVB800R5	5PK800				
				⊗	A/C(-), MS	SVB10710	10x710				
				⊗	A/C(+), PS	MVB855R4	4PK855				
						TB259	108x17				
						TBK007					
				⊗	A/C(-)	MVB875R5	5PK875				
				⊗	A/C(+)	MVB1255R5	5PK1255				
				1.6 i	BDY (XU5M), BFZ (XU5JP)	65	10/93 → 10/97	⊗	A/C(-), MS, 07/94→	MVB698R6	6PK698
								⊗	Eng. XU5JP, A/C(-), PS, Alt. 70,8A, 07/94→	MVB1065R6	6PK1065
								⊗	Eng. XU5JP, A/C(-), PS, Alt. 90A, 07/94→	MVB1080R6	6PK1080
⊗	Eng. XU5JP, A/C(+), MS, 07/94→	MVB1100R6	6PK1100								
⊗	Eng. XU5JP, A/C(+), PS, 07/94→	MVB1660R6	6PK1660								
		TB419	114x17								
		TBK010									



kW



...CITROËN

...ZX Break (N2)

1.8 D	161A (XUD7)	44	10/93 → 10/97	⊗	A/C(-), MS	MVB730R6	6PK730
				⊗	A/C(-), PS, →05/95, → Ch. 6778	MVB1150R6	6PK1150
				⊗	A/C(-), PS, 06/95→, Ch. 6779→	MVB1130R6	6PK1130
				⊗	A/C(+), MS	MVB1173R6	6PK1173
				⊗	A/C(+), PS, →01/95, → Ch. 6628	MVB1700R6	6PK1700
				⊗	A/C(+), PS, 01/95→, Ch. 6629→	MVB1740R6	6PK1740
						TB175	136x25.4
					KIT	TBK020	
					KIT	TBK019	
					→12/93	SVB10650	10x650
1.8 i	LFZ (XU7JP)	74	10/93 → 10/97	⊗	A/C(-), MS	MVB698R6	6PK698
				⊗	A/C(-), PS, Alt. 70,8A	MVB1065R6	6PK1065
				⊗	A/C(-), PS, Alt. 90A	MVB1080R6	6PK1080
				⊗	A/C(+), MS	MVB1100R6	6PK1100
				⊗	A/C(+), PS	MVB1660R6	6PK1660
						TB419	114x17
	KIT	TBK010					
1.8 i 16V	LFY (XU7JP4)	81	01/96 → 02/98	⊗	A/C(-), →10/97	MVB1080R6	6PK1080
				⊗	A/C(+), →10/97	MVB1660R6	6PK1660
					→10/97	TB479	136x25.4
					→10/97	TBK122	
1.9 D	DJZ (XUD9Y)	47	10/93 → 10/97	⊗	A/C(-), MS	MVB730R6	6PK730
				⊗	A/C(-), PS, →05/95, Ch. 5957→6778	MVB1150R6	6PK1150
				⊗	A/C(-), PS, 06/95→, Ch. 6779→	MVB1130R6	6PK1130
				⊗	A/C(+), MS	MVB1173R6	6PK1173
				⊗	A/C(+), PS, →01/95, → Ch. 6628	MVB1700R6	6PK1700
				⊗	A/C(+), PS, 01/95→, Ch. 6629→	MVB1740R6	6PK1740
						TB175	136x25.4
		KIT	TBK019				
		KIT	TBK020				
		01/94→	SVB10650	10x650			
	D9B (XUD9A/U)	50	06/94 → 10/97	⊗	A/C(-), MS	MVB730R6	6PK730
				⊗	A/C(-), PS, →05/95, Ch. 5957→6778	MVB1150R6	6PK1150
				⊗	A/C(-), PS, 06/95→, Ch. 6779→	MVB1130R6	6PK1130
				⊗	A/C(+), MS	MVB1173R6	6PK1173
⊗				A/C(+), PS, →01/95, → Ch. 6628	MVB1700R6	6PK1700	
⊗				A/C(+), PS, 01/95→, Ch. 6629→	MVB1740R6	6PK1740	
					TB175	136x25.4	
	KIT	TBK020					
	KIT	SVB10650	10x650				



kw



CITROËN

...CITROËN

...ZX Break (N2)

1.9 TD	DHY (XUD9TE/Y)	66	10/93 → 10/97		A/C(-), MS	MVB730R6	6PK730
					A/C(-), PS, →05/95, Ch. 5957→6778	MVB1150R6	6PK1150
					A/C(-), PS, 06/95→, Ch. 6779→	MVB1130R6	6PK1130
					A/C(+), MS	MVB1173R6	6PK1173
					A/C(+), PS, →01/95, → Ch. 6628	MVB1700R6	6PK1700
					A/C(+), PS, 01/95→, Ch. 6629→	MVB1740R6	6PK1740
						TB175	136x25.4
					→12/93	TBK019	
					01/94→	TBK020	
					V-belt pulley (+)	SVB10650	10x650

DACIA

1300

1.3	810-02/-99	40	12/72 → 05/83			SVB101225	10x1225
-----	------------	----	---------------	--	--	------------------	---------

1300 Estate

1.3		40	12/72 → 05/83			SVB101225	10x1225
-----	--	----	---------------	--	--	------------------	---------

1310 Estate

1.3		40	05/83 →		→12/94	SVB101225	10x1225
-----	--	----	---------	--	--------	------------------	---------

1310 Saloon (U, X)

1.3	810-02/-99	40	05/83 →		→12/94	SVB101225	10x1225
-----	------------	----	---------	--	--------	------------------	---------

LOGAN

1.4 (LSOA, LSOC, LSOE, LSOG)	K7J 710	55	09/04 →		A/C(-), PS	MVB1110R5	5PK1110
					A/C(+), PS	MVB1750R5	5PK1750
					MS	MVB715R4	4PK715
						TB529	96x17
						TBK096	

1.5 dCi (LS0J)	K9K 790	48	09/05 →		A/C(-)	MVB1135R5	5PK1135
					A/C(+)	MVB1200R6	6PK1200
						TB713	123x27
						TBK301	

1.5 dCi (LS0K)	K9K 792	50	01/06 →		A/C(-)	MVB1135R5	5PK1135
					A/C(+)	MVB1200R6	6PK1200
						TB713	123x27
						TBK301	

1.6 (LSOB, LSOD, LSOF, LSOH)	K7M 710	64	09/04 →		A/C(-), PS	MVB1110R5	5PK1110
					A/C(+), PS	MVB1750R5	5PK1750
					MS	MVB715R4	4PK715
						TB529	96x17
						TBK096	

1.6 16V (LS0M)	K4M 690	77	02/06 →		MS	MVB1200R6	6PK1200
					PS	MVB1820R6	6PK1820
						TB636	132x27
						TBK267	

LOGAN MCV

1.4	K7J 710	55	02/07 →		A/C(-), PS	MVB1110R5	5PK1110
					A/C(+), PS	MVB1750R5	5PK1750
					MS	MVB715R4	4PK715
						TB529	96x17
						TBK096	



kW



...DACIA

...LOGAN MCV

1.5 dCi	K9K 792	50	02/07 →		A/C(-)	MVB1135R5	5PK1135
					A/C(+)	MVB1200R6	6PK1200
						TB713	123x27
						TBK301	
1.6	K7M 710	64	02/07 →		A/C(-), PS	MVB1110R5	5PK1110
					A/C(+), PS	MVB1750R5	5PK1750
					MS	MVB715R4	4PK715
						TB529	96x17
						TBK096	
1.6 16V		77	02/07 →		MS	MVB1200R6	6PK1200
					PS	MVB1820R6	6PK1820
						TB636	132x27
						TBK267	

SOLENZA

1.4		55	02/03 →		A/C(-), →10/05	MVB1110R5	5PK1110
					A/C(+), →10/05	MVB1750R5	5PK1750
					→10/05	TB529	96x17
					→10/05	TBK096	
1.9 D		46	02/03 →		A/C(-), MS, →10/05	MVB890R6	6PK890
					A/C(-), PS, →10/05	MVB1400R6	6PK1400
					A/C(+), →10/05	MVB1190R6	6PK1190
					→10/05	TB735	151x25.4
					→10/05	TBK280	

DAEWOO

ESPERO (KLEJ)

1.5		55	10/97 → 09/99		MS, V-belt pulley (+)	SVB10913	10x913
					MS, V-ribbed belt pulley (+)	MVB869R5	5PK869
					PS	MVB970R5	5PK970
						TB336	111x17
						TBK008	
1.5 16V	A15MF	66	02/95 → 06/99		→11/97	SVB13825	13x825
					MS, →11/97	MVB869R5	5PK869
					PS, →11/97	MVB1000R5	5PK1000
					→11/97	TB458	127x25.4
					→11/97	TBK298	
		65	10/93 → 09/94		MS, V-belt pulley (+)	SVB10913	10x913
					MS, V-ribbed belt pulley (+)	MVB869R5	5PK869
					PS	MVB970R5	5PK970
						TB336	111x17
						TBK008	
1.8	C18LE	66	02/95 → 09/99		→11/97	SVB13875	13x875
					→11/97	MVB1263R5	5PK1263
					→11/97	TB480	125x20
		70	02/95 → 06/99		→11/97	SVB13875	13x875
					→11/97	MVB1263R5	5PK1263
					→11/97	TB480	125x20
2.0	C20LE	77	02/95 → 06/99		→11/97	SVB13875	13x875
					→11/97	MVB1263R5	5PK1263
					→11/97	TB480	125x20
		74	10/91 → 09/93			SVB13875	13x875
						MVB1263R5	5PK1263
						TB480	125x20
		81	10/93 → 09/94			SVB13875	13x875
						MVB1263R5	5PK1263
						TB480	125x20

EVANDA (KLAL)

2.0		96	08/02 →		→12/04	MVB1885R6	6PK1885
					→12/04	TB783	169x24
					→12/04	TBK261	



kw



DAEWOO

...DAEWOO

KALOS

1.4		61	11/02 → 12/04	 		MVB1875R6 TB336 TBK008	6PK1875 111x17
		69	05/03 → 12/04	 		MVB1875R6 TB458 TBK298	6PK1875 127x25.4

KALOS (KLAS)

1.2		53	04/03 →	 	→12/04 PS, →12/04 →12/04	MVB663R4 MVB950R4 TB786	4PK663 4PK950 109x25
1.4		61	09/02 →	 	→12/04 →12/04 →12/04	MVB1875R6 TB336 TBK008	6PK1875 111x17
1.4 16V	F14D3	69	04/03 →	 	→12/04 →12/04 →12/04	MVB1875R6 TB458 TBK298	6PK1875 127x25.4

KORANDO (KJ)

2.3		105	01/99 →	 	A/C(-), →05/05 A/C(+), →05/05	MVB2050R6 MVB2153R6	6PK2050 6PK2153
2.9 D	MB-OM 662	72	01/99 →	 	A/C(-), →05/05 A/C(+), →05/05	MVB2040R6 MVB2100R6	6PK2040 6PK2100
2.9 TD	MB-OM 601 29TD	88	01/99 →	 	A/C(-), →02/01 A/C(+), →03/00 A/C(+), 03/00 →02/01	MVB2040R6 MVB2100R6 MVB2120R6	6PK2040 6PK2100 6PK2120
3.2	M 104.995	156	01/99 →		→05/05	MVB2250R6	6PK2250

KORANDO Cabrio (KJ)

2.0 16V		94	02/99 →	 	A/C(-), →02/01 A/C(+), →02/01	MVB2050R6 MVB2153R6	6PK2050 6PK2153
2.3		105	02/99 →	 	A/C(-), →05/05 A/C(+), →05/05	MVB2050R6 MVB2153R6	6PK2050 6PK2153
2.9 D	MB-OM 662	72	02/99 →	 	A/C(-), →05/05 A/C(+), →05/05	MVB2040R6 MVB2100R6	6PK2040 6PK2100
2.9 TD	MB-OM 601 29TD	88	02/99 →	 	A/C(-), →02/01 A/C(+), →03/00 A/C(+), 03/00 →02/01	MVB2040R6 MVB2100R6 MVB2120R6	6PK2040 6PK2100 6PK2120

LACETTI Hatchback (KLAN)

1.4		70	02/04 →	 	→12/08 →12/08 →12/08	MVB1875R6 TB458 TBK298	6PK1875 127x25.4
1.6		80	02/04 →	 	→12/04 →12/04 →12/04	MVB1875R6 TB458 TBK298	6PK1875 127x25.4
1.8		90	02/04 →	 	A/C(-), →12/08 A/C(+), →12/08 →12/08 →12/08	MVB1725R6 MVB1885R6 TB783 TBK261	6PK1725 6PK1885 169x24

LANOS (KLAT)

1.4	A14SMS	55	05/97 →	 	→12/02 MS, →12/02 PS, →12/02 →12/02 →12/02	SVB13850 MVB869R5 MVB970R5 TB336 TBK008	13x850 5PK869 5PK970 111x17
1.5	A15SMS	63	05/97 →	 	→10/01 MS, →10/01 PS, →10/01 →10/01 →10/01	SVB13850 MVB869R5 MVB970R5 TB336 TBK008	13x850 5PK869 5PK970 111x17



kW



...DAEWOO

...LANOS (KLAT)

1.6 16V	A16DMS	78	05/97 →		→12/02	SVB13850	13x850
					MS, →12/02	MVB869R5	5PK869
					PS, →12/02	MVB1000R5	5PK1000
					→12/02	TB458	127x25.4
				KIT	→12/02	TBK298	

LANOS Saloon (KLAT)

1.4	A14SMS	55	05/97 →		→12/02	SVB13850	13x850
					MS, →12/02	MVB869R5	5PK869
					PS, →12/02	MVB970R5	5PK970
					→12/02	TB336	111x17
				KIT	→12/02	TBK008	
1.5	A15SMS	63	05/97 →		→10/01	SVB13850	13x850
					MS, →10/01	MVB869R5	5PK869
					PS, →10/01	MVB970R5	5PK970
					→10/01	TB336	111x17
				KIT	→10/01	TBK008	
1.6 16V	A16DMS	78	05/97 →		→12/02	SVB13850	13x850
					MS, →12/02	MVB869R5	5PK869
					PS, →12/02	MVB1000R5	5PK1000
					→12/02	TB458	127x25.4
				KIT	→12/02	TBK298	

LEGANZA (KLAV)

2.0 16V	X20SED	98	06/97 → 12/02		→ Ch. 185283	MVB1904R6	6PK1904
					Ch. 185284 →	MVB1885R6	6PK1885
						TB783	169x24
				KIT		TBK261	
	T20SED	93	07/00 →		→12/02, → Ch. 185283	MVB1904R6	6PK1904
					→12/02, Ch. 185284 →	MVB1885R6	6PK1885
					→12/02	TB783	169x24
				KIT	→12/02	TBK261	
2.2 16V	T22SED	100	04/99 → 12/02		→ Ch. 185283	MVB1904R6	6PK1904
					Ch. 185284 →	MVB1885R6	6PK1885
						TB524	171x24

LUBLIN II Box

2.4 D (3302)	4C90	52	04/97 →		→02/02	SVB10950	10x950
					→02/02	SVB10800	10x800
2.4 TD (3304)	4CT90-1	66	04/97 →		→02/02	SVB10950	10x950
					→02/02	SVB10800	10x800

LUBLIN II Flatbed / Chassis

2.4 D (3352)	4C90	52	04/97 →		→02/02	SVB10950	10x950
					→02/02	SVB10800	10x800
2.4 TD (3354)	4CT90-1	66	04/97 →		→02/02	SVB10950	10x950
					→02/02	SVB10800	10x800

MATIZ (KLYA)

0.8	F8CV	38	09/98 →		MS, →12/04	MVB735R4	4PK735
					→12/04	SVB10665	10x665
					→12/04	TB491	107x25.4
				KIT	→12/04	TBK317	
					A/C(-), →12/04	MVB663R4	4PK663
					A/C(+), →12/04	MVB915R4	4PK915
1.0		47	01/03 →		MS, →12/04	MVB663R4	4PK663
					→12/04	TB786	109x25
					A/C(-), →12/04	MVB715R4	4PK715

MUSSO (FJ)

2.2 TD	MB OM 601	74	09/99 →		A/C(-), →02/00	MVB2040R6	6PK2040
					A/C(+), →02/00	MVB2100R6	6PK2100
2.3	M 111.970	103	01/99 →		A/C(-), →02/00	MVB2050R6	6PK2050
					A/C(+), →02/00	MVB2153R6	6PK2153



kw



DAEWOO

...DAEWOO

...MUSSO (FJ)

2.9 D	MB-OM 662	73	01/99 → 09/99		A/C(-)	MVB2040R6	6PK2040
					A/C(+)	MVB2100R6	6PK2100
2.9 TD	MB-OM 601 29TD	88	01/99 →		A/C(-), →05/05	MVB2040R6	6PK2040
					A/C(+), →03/00	MVB2100R6	6PK2100
					A/C(+), 03/00 →05/05	MVB2120R6	6PK2120
3.2	M 104.992	162	01/99 →		→05/05	MVB2250R6	6PK2250

NEXIA (KLETN)

1.5	G15MF	52	02/95 → 08/97		MS, V-belt pulley (+)	SVB10913	10x913									
					MS, V-ribbed belt pulley (+)	MVB869R5	5PK869									
					PS	MVB970R5	5PK970									
						TB336	111x17									
						TBK008										
55	02/95 → 08/97		MS, V-belt pulley (+)	SVB10913	10x913		MS, V-ribbed belt pulley (+)	MVB869R5	5PK869							
											PS	MVB970R5	5PK970			
															TB336	111x17
44	08/96 → 08/97		MS, V-belt pulley (+)	SVB10913	10x913											
							MS, V-ribbed belt pulley (+)	MVB869R5	5PK869							
											PS	MVB970R5	5PK970			
															TB336	111x17
	TBK008															
			1.5 16V	A15MF	66	02/95 → 08/97		MS, V-belt pulley (+)	SVB13825							
								MS, V-ribbed belt pulley (+)	MVB1000R5	5PK1000						
								PS	MVB970R5	5PK970						
		TB458					127x25.4									
						TBK298										

NEXIA Saloon (KLETN)

1.5	G15MF	52	02/95 → 08/97		MS, V-belt pulley (+)	SVB10913	10x913									
					MS, V-ribbed belt pulley (+)	MVB869R5	5PK869									
					PS	MVB970R5	5PK970									
						TB336	111x17									
						TBK008										
55	02/95 → 08/97		MS, V-belt pulley (+)	SVB10913	10x913		MS, V-ribbed belt pulley (+)	MVB869R5	5PK869							
											PS	MVB970R5	5PK970			
															TB336	111x17
44	08/96 → 08/97		MS, V-belt pulley (+)	SVB10913	10x913											
							MS, V-ribbed belt pulley (+)	MVB869R5	5PK869							
											PS	MVB970R5	5PK970			
															TB336	111x17
	TBK008															
			1.5 16V	A15MF	66	02/95 → 08/97		MS, V-belt pulley (+)	SVB13825							
								MS, V-ribbed belt pulley (+)	MVB1000R5	5PK1000						
								PS	MVB970R5	5PK970						
		TB458					127x25.4									
						TBK298										

NUBIRA (KLAJ)

1.6 16V	A16DMS	78	05/97 →		→12/04	MVB1875R6	6PK1875
					→12/04	TB458	127x25.4
					→12/04	TBK298	
2.0 16V	X20SED, Z20L	98	05/97 →		A/C(-), →03/04	MVB1725R6	6PK1725
					A/C(+), →05/99	MVB1904R6	6PK1904
					A/C(+), 06/99 →03/04	MVB1885R6	6PK1885
					→03/04	TB783	169x24
					06/99 →03/04	TBK261	



kW



...DAEWOO

NUBIRA Saloon (KLAJ)

1.6 16V	A16DMS	78	05/97 →	⊗	→12/04	MVB1875R6	6PK1875	
					→12/04	TB458	127x25.4	
				KIT	→12/04	TBK298		
		76	07/00 →	⊗	→12/04	MVB1875R6	6PK1875	
					→12/04	TB458	127x25.4	
				KIT	→12/04	TBK298		
2.0 16V	X20SED	98	05/97 →	⊗	A/C(-), →03/04	MVB1725R6	6PK1725	
				⊗	A/C(+), →05/99	MVB1904R6	6PK1904	
				⊗	A/C(+), 06/99→03/04	MVB1885R6	6PK1885	
		T20SED	93	12/00 →		→03/04	TB783	169x24
					KIT	06/99→03/04	TBK261	
					⊗	A/C(-), →03/04	MVB1725R6	6PK1725
				⊗	A/C(+), →03/04	MVB1885R6	6PK1885	
					→03/04	TB783	169x24	
				KIT	→03/04	TBK261		

NUBIRA Saloon (KLAN)

1.4		69	10/03 → 12/04	⊗		MVB1875R6	6PK1875
						TB458	127x25.4
				KIT		TBK298	
1.6		80	07/03 →	⊗	→12/04	MVB1875R6	6PK1875
					→12/04	TB458	127x25.4
				KIT	→12/04	TBK298	
1.8		90	07/03 →	⊗	A/C(-), →12/04	MVB1725R6	6PK1725
				⊗	A/C(+), →12/04	MVB1885R6	6PK1885
					→12/04	TB783	169x24
				KIT	→12/04	TBK261	

NUBIRA Wagon (KLAJ)

1.6 16V	A16DMS	78	05/97 →	⊗	→12/04	MVB1875R6	6PK1875	
					→12/04	TB458	127x25.4	
				KIT	→12/04	TBK298		
		76	12/00 →	⊗	→12/04	MVB1875R6	6PK1875	
					→12/04	TB458	127x25.4	
				KIT	→12/04	TBK298		
		66	06/97 →	⊗	→12/04	MVB1875R6	6PK1875	
					→12/04	TB458	127x25.4	
				KIT	→12/04	TBK298		
2.0 16V	X20SED	98	05/97 →	⊗	A/C(-), →03/04	MVB1725R6	6PK1725	
				⊗	A/C(+), →05/99	MVB1904R6	6PK1904	
				⊗	A/C(+), 06/99→03/04	MVB1885R6	6PK1885	
		T20SED	93	12/00 →		→03/04	TB783	169x24
					KIT	06/99→03/04	TBK261	
					⊗	A/C(-), →03/04	MVB1725R6	6PK1725
				⊗	A/C(+), →03/04	MVB1885R6	6PK1885	
					→03/04	TB783	169x24	
				KIT	→03/04	TBK261		

NUBIRA Wagon (KLAN)

1.6		80	07/03 →	⊗	→12/04	MVB1875R6	6PK1875
					→12/04	TB458	127x25.4
				KIT	→12/04	TBK298	
1.8		90	07/03 →	⊗	A/C(-), →12/04	MVB1725R6	6PK1725
				⊗	A/C(+), →12/04	MVB1885R6	6PK1885
					→12/04	TB783	169x24
				KIT	→12/04	TBK261	

REXTON (GAB_)

2.9 TD		88	04/02 →	⊗	→05/04	MVB2225R6	6PK2225
3.2 V6		162	04/02 →	⊗	→05/04	MVB2225R6	6PK2225



kW



DAEWOO

...DAEWOO

REZZO (KLAU)

1.6		77	09/00 →	①	08/01 →12/04	MVB1875R6	6PK1875			
				②	08/01 →12/04	TB458	127x25.4			
				③	08/01 →12/04	TBK298				
1.8	A18DMS	74	09/00 →	①	→12/04	MVB1875R6	6PK1875			
				②	→12/04	MVB1875R6	6PK1875			
				③	→12/04	MVB1875R6	6PK1875			
				④	→12/04	MVB1875R6	6PK1875			
				⑤	→12/04	MVB1875R6	6PK1875			
2.0	F18D2	67	09/00 →	①	→12/04	MVB1875R6	6PK1875			
				②	A/C(-), →12/04	MVB1725R6	6PK1725			
				③	A/C(+), →12/04	MVB1885R6	6PK1885			
				④	→12/04	TB783	169x24			
				⑤	→12/04	TBK261				
				X20SED	89	09/01 →	①	A/C(-), →12/04	MVB1725R6	6PK1725
							②	A/C(+), →12/04	MVB1885R6	6PK1885
③	→12/04	TB783	169x24							
④	→12/04	TBK261								

TICO (KLY3)

0.8	F8C	35	02/95 → 12/00	①	04/96 →08/00	SVB10610	10x610
				②	04/96 →08/00	TB491	107x25.4
				③	04/96 →08/00	TBK317	
F8CV	38	01/96 → 12/00	①	→08/00	SVB10610	10x610	
			②	→08/00	TB491	107x25.4	
			③	→08/00	TBK317		

DAIHATSU

APPLAUSE I (A101, A111)

1.6 16V (A101)	HD-E	77	06/89 → 07/97	①		MVB835R4	4PK835			
				②	AUTO	MVB775R4	4PK775			
				③	AUTO, →09/93	MVB790R4	4PK790			
				④		TB347	95x25.4			
				HD	66	06/89 → 07/97	①		MVB835R4	4PK835
							②	AUTO	MVB775R4	4PK775
③	AUTO, →09/93	MVB790R4	4PK790							
1.6 16V 4WD (A111)	HD-E	77	06/89 → 07/97	①		MVB835R4	4PK835			
				②	AUTO	MVB775R4	4PK775			
				③	AUTO, →09/93	MVB790R4	4PK790			
				④		TB347	95x25.4			

APPLAUSE II

1.6 16V	HD-E	73	07/97 →	①	→05/00	MVB835R4	4PK835
				②	MAN, →05/00	MVB775R4	4PK775
				③	→05/00	TB347	95x25.4

CHARADE (L2_)

1.0	EJ-VE	43	03/03 →	①		MVB715R4	4PK715
				②		TB728	111x25.4

CHARADE II (G11, G30)

1.0 (G11)	CB 20, CB 22	38	10/83 → 03/87	①		SVB10800	10x800
				②		TB110	91x19
1.0 D (G30)	CL 10	27	10/83 → 03/87	①		SVB10813	10x813
				②		TB235	102x19
				③		TB269	63x19
1.0 TD (G30)	CL 60	34	02/85 → 03/87	①		SVB10813	10x813
				②		TB674	103x19
				③		TB269	63x19
				④			
1.0 Turbo (G11)	CB 60	50	10/83 → 03/87	①		SVB10800	10x800
				②		TB110	91x19
				③	02/87 →	MVB563R3	3PK563



kW



...DAIHATSU

CHARADE III (G100, G101, G102)

1.0 (G100)	CB 23	38	03/87 → 12/92			SVB10800	10x800
						TB110	91x19
						MVB563R3	3PK563
	CB 90	40	11/90 → 12/92			MVB785R3	3PK785
						TB328	91x19
		41	04/89 → 12/92		11/90 →	MVB563R3	3PK563
					11/90 →	MVB785R3	3PK785
					11/90 →	TB328	91x19
						MVB563R3	3PK563
1.0 D (G101)	CL 11	27	03/87 → 12/92			SVB10813	10x813
						TB235	102x19
						TB269	63x19
1.0 GTi (G100)	CB 80 T	74	03/87 → 12/92			SVB10790	10x790
						TB327	155x19
						MVB563R3	3PK563
1.0 TD (G101)	CL, CL 61	35	03/87 → 12/92			SVB10813	10x813
						TB674	103x19
						TB269	63x19
1.0 Turbo (G100)	CB 61	50	03/87 → 10/90			SVB10800	10x800
						TB110	91x19
						MVB563R3	3PK563
1.3 i (G102)	HCE	66	06/88 → 12/92			MVB775R4	4PK775
						TB330	93x25.4
						MVB563R3	3PK563
1.3 i 4WD (G102)	HCE	66	06/88 → 01/93			MVB775R4	4PK775
						TB330	93x25.4
						MVB563R3	3PK563

CHARADE III Saloon (G102)

1.3	HCE	66	11/90 → 02/93			MVB775R4	4PK775
						TB330	93x25.4
						MVB563R3	3PK563

CHARADE IV (G200, G202)

1.0	CB 22	38	09/94 → 03/96			MVB785R3	3PK785
						TB328	91x19
1.3	HC	44	09/96 → 11/99			MVB800R4	4PK800
					AUTO	MVB790R4	4PK790
					MAN	MVB775R4	4PK775
						TB330	93x25.4
						MVB538R3	3PK538
1.3 16V	HC	62	01/93 → 11/99		→04/94	MVB845R4	4PK845
					04/94 →	MVB800R4	4PK800
					AUTO	MVB790R4	4PK790
					MAN	MVB775R4	4PK775
						TB330	93x25.4
						MVB538R3	3PK538
		55	05/96 → 11/99			MVB800R4	4PK800
					AUTO	MVB790R4	4PK790
					MAN	MVB775R4	4PK775
						TB330	93x25.4
						MVB538R3	3PK538
1.5 16V	HEE, HEEG	66	01/97 → 11/99			MVB825R4	4PK825
					AUTO	MVB790R4	4PK790
					MAN	MVB775R4	4PK775
						TB347	95x25.4
						MVB538R3	3PK538
1.6 GTi	HD-E	77	03/93 → 11/99		→03/96	MVB825R4	4PK825
					AUTO, →03/96	MVB790R4	4PK790
					MAN, →03/96	MVB775R4	4PK775
					→03/96	TB347	95x25.4
					→03/96	MVB538R3	3PK538



kw



DAIHATSU

...DAIHATSU

CHARADE IV Saloon (G203)

1.5	HE	55	10/94 →	☼ ⊖ ⊖ ☞ ☼	→11/99 AUTO, →11/99 MAN, →11/99 →11/99 →11/99	MVB825R4 MVB790R4 MVB775R4 TB347 MVB538R3	4PK825 4PK790 4PK775 95x25.4 3PK538
1.5 16V	HEE	66	08/94 →	☼ ⊖ ⊖ ☞ ☼	→11/99 AUTO, →11/99 MAN, →11/99 →11/99 →11/99	MVB825R4 MVB790R4 MVB775R4 TB347 MVB538R3	4PK825 4PK790 4PK775 95x25.4 3PK538

CHARMANT (A)

1.3 (A35)	4K	48	11/81 → 07/87	☼ ⊖ ⊖	→02/83 02/83 →	SVB13925 SVB10888 SVB10875	13x925 10x888 10x875
1.6 (A45)	2T	55	12/81 → 09/84	☼ ⊖ ⊖	→08/83 →02/83 02/83 → 08/83	SVB13950 SVB10888 SVB10875	13x950 10x888 10x875
1.6 (A60)	4A	57	09/85 → 07/87	☼ ⊖ ☞ ☼		SVB13850 SVB10975 TB171 SVB13800	13x850 10x975 88x19 13x800
		60	05/86 → 07/87	☼ ⊖ ☞ ☼		SVB13850 SVB10975 TB171 SVB13800	13x850 10x975 88x19 13x800
		61	08/83 → 07/87	☼ ⊖ ☞ ☼		SVB13850 SVB10975 TB171 SVB13800	13x850 10x975 88x19 13x800

COPEN

0.7	JB	50	09/03 →	☼		SVB10740	10x740
-----	----	----	---------	---	--	-----------------	--------

CUORE I (L55, L60)

0.5 (L55)	AB 30	20	10/80 → 09/85	⊖ ☞	04/81 → 04/82 04/81 → 04/82	SVB10960 TB621	10x960 90x19
0.6 (L60)	AD 10	22	08/82 → 09/85	⊖ ☞		SVB10960 TB621	10x960 90x19

CUORE II (L80, L81)

0.8 (L80)	ED 10	29	11/89 → 12/90	⊖ ⊖ ☞	AUTO, →07/90 MAN, →07/90 →07/90	SVB10775 SVB10760 TB275	10x775 10x760 103x19
		32	09/85 → 06/90	⊖ ⊖ ☞ ⊖ ☞	AUTO, →01/89 AUTO, 01/89 → MAN 01/89 →	SVB10790 SVB10775 SVB10760 TB275	10x790 10x775 10x760 103x19
0.8 4WD (L81)	ED 10	32	09/86 → 10/88	⊖ ⊖	AUTO MAN	SVB10790 SVB10760	10x790 10x760

CUORE III (L201)

0.8	ED 10 K	30	10/90 → 12/94	⊖ ☞		SVB10775 TB275	10x775 103x19
-----	---------	----	---------------	--------	--	---------------------------------	------------------

CUORE IV (L501)

0.8	ED 20	32	01/95 → 11/96	⊖ ⊖ ☞	→02/95 02/95 →	SVB10800 SVB10790 TB275	10x800 10x790 103x19
-----	-------	----	---------------	-------------	-------------------	--	----------------------------

CUORE V (L5)

0.8	EF-EL	31	11/96 → 10/98	⊖ ☞		SVB10790 TB275	10x790 103x19
-----	-------	----	---------------	--------	--	---------------------------------	------------------



kW



...DAIHATSU

CUORE VI (L7_)

1.0 i (L701)	EJDE	41	10/98 → 05/03	 		SVB10700 10x700 MVB715R4 4PK715 TB728 111x25.4 MVB513R3 3PK513
--------------	------	----	---------------	--------------	--	---

CUORE VII (L251)

1.0	EJ-VE	43	05/03 →	 	→08/07 →08/07	MVB715R4 4PK715 TB728 111x25.4
-----	-------	----	---------	------	------------------	---

CUORE VIII

1.0	1KR-FE	51	04/07 →		A/C(+), 09/07 →	MVB1180R6 6PK1180
-----	--------	----	---------	--	-----------------	--------------------------

EXTOL Bus (S22_, S23_)

1.3	K3-VE	63	07/00 →			MVB706R4 4PK706
-----	-------	----	---------	--	--	------------------------

FEROZA Hard Top (F300)

1.6 16V	HDC	63	10/88 →		V-belt pulley (+), →12/97	SVB10790	10x790
					V-ribbed belt pulley (+), →05/92	MVB706R4	4PK706
1.6 i 16V	HD-E	70	10/88 →		V-ribbed belt pulley (+), 05/92 →12/97	MVB775R4	4PK775
					→12/97	TB347	95x25.4
					→12/97	MVB975R5	5PK975
1.6 i 16V	HD-E	70	10/88 →		V-belt pulley (+), →12/97	SVB10790	10x790
					V-ribbed belt pulley (+), →05/92	MVB706R4	4PK706
					V-ribbed belt pulley (+), 05/92 →12/97	MVB775R4	4PK775
					→12/97	TB347	95x25.4
					→12/97	MVB975R5	5PK975

FEROZA Soft Top (F300)

1.6 16V	HDC	63	10/88 →		V-belt pulley (+), →12/97	SVB10790	10x790
					V-ribbed belt pulley (+), →05/92	MVB706R4	4PK706
1.6 i 16V	HD-E	70	10/88 →		V-ribbed belt pulley (+), 05/92 →12/97	MVB775R4	4PK775
					→12/97	TB347	95x25.4
					→12/97	MVB975R5	5PK975
1.6 i 16V	HD-E	70	10/88 →		V-belt pulley (+), →12/97	SVB10790	10x790
					V-ribbed belt pulley (+), →05/92	MVB706R4	4PK706
					V-ribbed belt pulley (+), 05/92 →12/97	MVB775R4	4PK775
					→12/97	TB347	95x25.4
					→12/97	MVB975R5	5PK975

GRAN MOVE (G3)

1.5 16V (G303)	HEEG	66	10/96 → 07/98		02/97 →	MVB825R4	4PK825
					AUTO, 02/97 →	MVB790R4	4PK790
					MAN, 02/97 →	MVB775R4	4PK775
					02/97 →	TB347	95x25.4
1.6 16V (G301)	HDEP	67	05/98 →		02/97 →	MVB538R3	3PK538
					→07/02	MVB825R4	4PK825
					AUTO, →07/02	MVB790R4	4PK790
					MAN, →07/02	MVB775R4	4PK775
					→07/02	TB347	95x25.4
					→07/02	MVB538R3	3PK538

HIJET I Box

0.8	CD	29	06/86 → 12/89			SVB10800	10x800
					→10/87	TB110	91x19
					10/87 →	TB328	91x19



kw



DAIHATSU

...DAIHATSU

...HIJET I Box

1.0	CB	33	06/86 → 12/89		→08/89	SVB10760	10x760
					→10/87	TB110	91x19
					10/87→	TB328	91x19

HIJET I Bus

0.8	CD	29	06/86 → 12/89			SVB10800	10x800
					→10/87	TB110	91x19
					10/87→	TB328	91x19
1.0	CB	33	06/86 → 12/89		→08/89	SVB10760	10x760
					→10/87	TB110	91x19
					10/87→	TB328	91x19

HIJET II Box (S85)

1.0	CB41	33	12/92 → 05/98		→09/94	SVB10800	10x800
					→09/94	TB328	91x19
1.0 i	CB42	35	07/94 → 05/98			SVB10800	10x800
						TB328	91x19
1.2 D	LDW12	26	05/95 → 03/98		01/96→	SVB10760	10x760
1.3 i 16V		48	05/98 →		→10/05	SVB10775	10x775
					→10/05	TB330	93x25.4

HIJET II Bus (S85)

1.0 i	CB42	35	07/94 → 05/98			SVB10800	10x800
						TB328	91x19

MATERIA (M4_)

1.3	K3-VE	67	10/06 →		A/C(+), AUTO	MVB1580R6	6PK1580
1.5	3SZ-VE	76	10/06 →		A/C(+)	MVB1580R6	6PK1580
1.5 ECO 4WD	3SZ-VE	76	10/06 →		A/C(+)	MVB1580R6	6PK1580

MOVE (L6, L9)

0.8	ED 20	31	10/96 →		RHA(+), →11/99	SVB10675	10x675
					→11/99	SVB10790	10x790
					→11/99	TB275	103x19
1.0 i	EJDE	41	10/98 →		→09/02	SVB10700	10x700
					→09/02	MVB715R4	4PK715
					→09/02	TB728	111x25.4
					→09/02	MVB513R3	3PK513

ROCKY Hard Top (F7, F8)

2.0	3Y	65	02/85 → 04/93			SVB13875	13x875
					→09/87	SVB13900	13x900
						MVB825R5	5PK825
						MVB835R4	4PK835
						SVB131050	13x1050
2.8 D	DL	54	02/85 →		→09/87	SVB13900	13x900
					09/87→09/94	SVB13875	13x875
					→09/94	TB386	108x32
					→09/87	SVB13775	13x775
					09/87→09/94	SVB13780	13x780
2.8 TD	DL 51	67	12/87 → 04/93			SVB13875	13x875
						TB386	108x32
						SVB13780	13x780
	DL 52	75	09/91 →		→06/96	SVB13875	13x875
					→06/96	TB386	108x32
					→06/96	SVB13780	13x780
		72	05/93 →		07/96→06/01	SVB13875	13x875
					07/96→06/01	TB386	108x32
					07/96→06/01	SVB13780	13x780



kW



...DAIHATSU

ROCKY Soft Top (F7, F8)

2.0	3Y	65	02/85 → 04/93	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→08/91 →09/87 →08/91 →08/91 →08/91	SVB13875 SVB13900 MVB825R5 MVB835R4 SVB131050	13x875 13x900 5PK825 4PK835 13x1050
2.8 D	DL	54	02/85 →	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→09/87 09/87 → 09/94 →09/94 →09/87 09/87 → 09/94	SVB13900 SVB13875 TB386 SVB13775 SVB13780	13x900 13x875 108x32 13x775 13x780
2.8 TD	DL 51	67	12/87 → 04/93	⚙️ ⚙️ ⚙️		SVB13875 TB386 SVB13780	13x875 108x32 13x780
	DL 52	75	09/91 →	⚙️ ⚙️ ⚙️	→12/99 →12/99 →12/99	SVB13875 TB386 SVB13780	13x875 108x32 13x780

SIRION (M1)

1.0	EJDE	40	04/98 → 10/00	⚙️ ⚙️ ⚙️ ⚙️		SVB10700 MVB715R4 TB728 MVB513R3	10x700 4PK715 111x25.4 3PK513
1.0 i	EJ-VE	43	09/00 → 01/05	⚙️ ⚙️ ⚙️ ⚙️		SVB10700 MVB715R4 TB728 MVB513R3	10x700 4PK715 111x25.4 3PK513
1.0 i (M100)	EJDE	41	04/98 → 09/00	⚙️ ⚙️ ⚙️ ⚙️		SVB10700 MVB715R4 TB728 MVB513R3	10x700 4PK715 111x25.4 3PK513
1.0 i 4WD	EJDE	41	04/99 → 09/00	⚙️ ⚙️ ⚙️ ⚙️		SVB10700 MVB715R4 TB728 MVB513R3	10x700 4PK715 111x25.4 3PK513
	EJ-VE	43	09/00 → 01/05	⚙️ ⚙️ ⚙️ ⚙️		SVB10700 MVB715R4 TB728 MVB513R3	10x700 4PK715 111x25.4 3PK513
1.3 Sport	K3-VE2	75	08/00 → 01/05	⚙️	A/C(-)	MVB1708R4	4PK1708
1.3 Sport 4WD	K3-VE2	75	08/00 → 01/05	⚙️	A/C(-)	MVB1708R4	4PK1708

SIRION (M3_)

1.0	1KR-FE	51	01/05 →	⚙️ ⚙️	A/C(-) A/C(+)	MVB860R6 MVB1200R6	6PK860 6PK1200
-----	--------	----	---------	----------	------------------	-------------------------------------	-------------------

SPARCAR Box

0.8	CD	29	09/83 → 05/86	⚙️ ⚙️		SVB10800 TB110	10x800 91x19
-----	----	----	---------------	----------	--	---------------------------------	-----------------

SPARCAR Bus

0.8	CD	29	09/83 → 05/86	⚙️ ⚙️		SVB10800 TB110	10x800 91x19
-----	----	----	---------------	----------	--	---------------------------------	-----------------

TAFT

1.6 D 4x4 (F20)	12R	49	09/76 → 02/85	⚙️		SVB13900	13x900
2.8 D 4x4 (F60)	DL	51	08/82 → 02/85	⚙️ ⚙️ ⚙️		SVB13900 TB386 SVB13775	13x900 108x32 13x775

TERIOS (J1)

1.3 4WD	HE-EJ	61	10/97 → 10/00	⚙️ ⚙️ ⚙️	A/C(-)	MVB775R4 TB330 MVB1015R4	4PK775 93x25.4 4PK1015
---------	-------	----	---------------	----------------	--------	---	------------------------------



kw



DAIHATSU

...DAIHATSU

TERIOS (J2_)

1.5	3SZ-VE	77	11/05 →	⊖ ⊕	A/C(-) A/C(+)	MVB1820R6 MVB1875R6	6PK1820 6PK1875
1.5 4WD	3SZ-VE	77	05/06 →	⊖ ⊕	A/C(-) A/C(+)	MVB1820R6 MVB1875R6	6PK1820 6PK1875

TREVIS

1.0	EJ-VE	43	06/06 →	⊖ ⊕		MVB715R4 TB728	4PK715 111x25.4
-----	-------	----	---------	--------	--	-------------------	--------------------

WILDCAT/ROCKY (F70)

2.8 D	DL	54	02/85 → 03/87	⊖ ⊕		SVB13900 TB386 SVB13775	13x900 108x32 13x775
2.8 TD	DL 50	65	09/85 → 04/87	⊖ ⊕		SVB13900 TB386 SVB13775	13x900 108x32 13x775

WILDCAT/ROCKY (F75)

2.8 D	DL	54	02/85 → 03/87	⊖ ⊕		SVB13900 TB386 SVB13775	13x900 108x32 13x775
2.8 TD	DL 50	65	09/85 → 04/87	⊖ ⊕		SVB13900 TB386 SVB13775	13x900 108x32 13x775

YRV (M2)

1.0	EJ-VE	43	02/01 →	⊖ ⊕	→08/06 →08/06 →08/06 →08/06	SVB10700 MVB715R4 TB728 MVB513R3	10x700 4PK715 111x25.4 3PK513
1.3	K3-VE	64	02/01 →	⊖	A/C(-), →11/02	MVB1708R4	4PK1708
1.3 4WD	K3-VE	64	02/01 →	⊖	A/C(-), →11/02	MVB1708R4	4PK1708

DODGE

AVENGER

2.7 Flex-Fuel		139	06/07 →	⊖		MVB1190R6	6PK1190
---------------	--	-----	---------	---	--	-----------	---------

CALIBER

1.8		110	06/06 →	⊖ ⊕	A/C(-) A/C(+)	MVB2040R6 MVB2553R6	6PK2040 6PK2553
2.0		115	06/06 →	⊖ ⊕	A/C(-) A/C(+)	MVB2040R6 MVB2553R6	6PK2040 6PK2553
2.0 CRD		103	06/06 →	⊖		MVB1715R6	6PK1715
2.4		125	10/06 →	⊖ ⊕	A/C(-) A/C(+)	MVB2040R6 MVB2553R6	6PK2040 6PK2553

NEON

2.0 16V		107	06/94 → 08/99	⊖ ⊕	A/C(-) A/C(+)	MVB887R4 SVB101050 SVB101215	4PK887 10x1050 10x1215
	ECB	98	05/94 → 08/99	⊖ ⊕	A/C(-) A/C(+)	MVB887R4 SVB101050 SVB101215	4PK887 10x1050 10x1215
	ECC	109	04/96 → 08/99	⊖ ⊕	A/C(-) A/C(+)	MVB887R4 SVB101050 SVB101215	4PK887 10x1050 10x1215
		112	04/96 → 08/99	⊖ ⊕	A/C(-) A/C(+)	MVB887R4 SVB101050 SVB101215	4PK887 10x1050 10x1215



kW



...DODGE

NEON II

2.0 16V	ECB	98	08/99 →		→09/05	MVB1311R4	4PK1311
					→09/05	TB565	112x29
					A/C(-), →09/05	MVB1125R4	4PK1125
		112	08/99 →		→09/05	MVB1311R4	4PK1311
					→09/05	TB565	112x29
					A/C(-), →09/05	MVB1125R4	4PK1125

STRATUS

2.0 16V	ECB	98	12/95 →		→09/97	MVB1335R6	6PK1335
					→09/97	MVB900R4	4PK900
2.4 16 V		103	12/95 → 04/01		10/00 →	MVB938R5	5PK938
					10/00 →	TB406	123x29
					10/00 →	MVB1370R5	5PK1370
2.4 16V	EDZ	112	12/95 →		10/00 →	MVB1335R6	6PK1335
					10/97 → 09/00	MVB1369R6	6PK1369
					10/97 →	TB705	146x28
					10/97 →	MVB900R4	4PK900
2.5 V6		125	12/95 →		→09/00	MVB1428R6	6PK1428
					→09/00	TB673	187x32
					→09/00	MVB970R4	4PK970

FIAT

126

600	126 A.000	17	09/72 → 06/77			SVB10800	10x800
650	126 A1.000, 126 A1.048	17	07/77 → 09/87			SVB10800	10x800
	141 A.000	22	01/83 → 06/96		→09/87	SVB10800	10x800
		18	07/81 → 09/00		→09/87	SVB10800	10x800
700	126 A2.000, 126 A2.048	19	09/87 → 06/96		10/94 →	SVB10725	10x725

127

0.9	100 GL.048	29	06/71 → 05/83		→12/75	SVB10800	10x800
					LHD, →12/75	SVB10790	10x790
	100 GL.000	33	06/71 → 05/83		→06/81	SVB10800	10x800
					LHD, →12/75	SVB10790	10x790
1.0	127 A.000	37	04/77 → 12/86			SVB101000	10x1000
					→12/78	SVB10790	10x790
					→12/78	SVB10800	10x800
						TB121	117x15
1.0 Sport	127 A1.000	51	07/78 → 02/82			SVB101000	10x1000
						TB121	117x15
1.3 Diesel		33	04/81 → 12/86		→12/85	SVB101060	10x1060
					→12/85, → Eng Nr 35570	TB577	133x19
					→12/85, Eng Nr 35571 →	TB143	133x22
1.3 Sport	127 A3.000	55	12/81 → 05/83			SVB101000	10x1000
						TB247	120x15

127 Panorama

1.0	127 A.000	37	01/77 → 12/86			SVB101000	10x1000
						TB121	117x15
1.3 Diesel		33	06/81 → 12/86		→12/85	SVB101060	10x1060
					→12/85, → Eng Nr 35570	TB577	133x19
					→12/85, Eng Nr 35571 →	TB143	133x22

500

1.2	169 A4.000	51	10/07 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
						TB787	129x22
1.3 D Multijet	169 A1.000	55	10/07 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.4	169 A3.000	74	10/07 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
						TB637	124x22
						TBK313	

FIAT



kW



...FIAT

FIAT

ARGENTA (132A)

1600	132 D.000	72	04/81 → 12/85	 	 → Eng Nr 1480467 Eng Nr 1480468 →	SVB101100 10x1100 SVB10840 10x840 TB112 144x19 TB200 143x19 TB148 68x15
1600 i.e		66	04/81 → 12/85	 	 → Eng Nr 1480467 Eng Nr 1480468 →	SVB101100 10x1100 SVB10840 10x840 TB112 144x19 TB200 143x19 TB148 68x15
2000	132 C2.000, 132 D1.000	83	06/78 → 12/85	 	02/81 → 02/81 → 02/81 → 02/81 →	SVB101100 10x1100 SVB10840 10x840 TB122 148x19 TB148 68x15
2000 i.e.	132 C3.000	90	06/81 → 07/86	 		SVB10750 10x750 SVB101075 10x1075 TB122 148x19 TB148 68x15
2000 Volumex		99	06/84 → 07/85	 		SVB101100 10x1100 SVB10840 10x840 TB122 148x19 TB148 68x15
2500 Diesel	8144.61	53	06/81 → 11/85	 	A/C(-) A/C(+)	SVB10913 10x913 SVB10900 10x900 TB135 152x30 TBK045
2500 Turbodiesel	8144.61.500.81	66	07/83 → 08/85	 	A/C(+)	SVB10900 10x900 TB135 152x30 TBK045

BARCETTA (183)

1.8 16V	183 A1.000, 188 A6.000	96	04/95 →	 	A/C(-), →04/04, → Eng Nr 2988825 A/C(+), →08/00 A/C(+), 05/02 →04/04 A/C(+), 09/00 →05/02, Eng Nr 2988826 → Eng. 188A6000, A/C(-), 09/00 →04/04, Eng Nr 2988826 → Eng. 188A6000, A/C(+), 09/00 →04/04, → Eng Nr 2988825 →08/00 09/00 →04/04 09/00 →04/04 Eng. 183A1000, →05/98	MVB1045R6 6PK1045 MVB1842R6 6PK1842 MVB1760R6 6PK1760 MVB1795R6 6PK1795 MVB1025R6 6PK1025 MVB1820R6 6PK1820 TB468 168x24 TB559 166x24 TBK345 TBK356
---------	------------------------	----	---------	----------------------------------	---	--

BRAVA (182)

1.2 16V 80	182 B2.000	60	12/98 → 10/00	 	A/C(-) A/C(+)	MVB700R4 4PK700 MVB673R4 4PK673 MVB835R4 4PK835 TB637 124x22 TBK313 MVB915R3 3PK915
	188 A5.000	59	10/00 → 10/01	 	A/C(-) A/C(+), PS	MVB673R4 4PK673 MVB1590R5 5PK1590 TB637 124x22 TBK313 MVB915R3 3PK915



kW



...FIAT

...BRAVA (182)

1.4 (182.BG)	182 A5.000	55	10/95 → 10/01		A/C(-), MS, →02/97	MVB747R4	4PK747
					A/C(-), PS, →02/97	MVB1045R6	6PK1045
					A/C(+), PS, →02/97	MVB1842R6	6PK1842
					→02/97	TB470	134x18
					→02/97	TBK300	
					A/C(-), MS, →08/98	MVB747R4	4PK747
					A/C(-), PS, →08/98	MVB1045R6	6PK1045
					A/C(+), PS, →08/98	MVB1842R6	6PK1842
1.4 12 V (182.BA)	182 A3.000	59	10/95 → 08/98			TB470	134x18
						TBK300	
					→08/00	MVB960R4	4PK960
					→08/00	MVB938R5	5PK938
1.6 16V (182.BB)	182 A4.000	76	02/96 → 10/01		→08/00	TB471	158x25.4
					→08/00	TBK089	
					→08/00	MVB668R3	3PK668
					→02/97	MVB960R4	4PK960
1.6 16V (182.BH)	182 A6.000	66	10/95 → 10/01		→02/97	MVB938R5	5PK938
					→02/97	TB471	158x25.4
					→02/97	TBK089	
					→02/97	MVB668R3	3PK668
1.8 GT 16V (182.BC)	182 A2.000	83	10/95 → 10/01		A/C(-), →08/00	MVB1045R6	6PK1045
					A/C(+), →07/99	MVB1842R6	6PK1842
					A/C(+), 07/99→08/00	MVB1855R6	6PK1855
					→08/00	TB468	168x24
1.9 D	160 A7.000	48	10/95 → 10/01		→05/97	MVB938R5	5PK938
					A/C(-), →05/97	MVB925R6	6PK925
					A/C(+), →05/97	MVB986R6	6PK986
					→05/97	TB307	173x22
1.9 JTD	182 B9.000	74	09/00 → 10/01		→05/97	TBK065	
					→05/97	SVB10650	10x650
					A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1795R6	6PK1795
1.9 JTD 105	182 B4.000	77	12/98 → 10/01			TB639	190x24
						TBK283	
					A/C(-), →08/00	MVB1035R6	6PK1035
					A/C(+), →08/00,	MVB1775R6	6PK1775
1.9 TD 100 S (182.BF)	182 A7.000	74	03/96 → 10/01		→ Eng Nr 1370829		
					A/C(+), →08/00,	MVB1795R6	6PK1795
					Eng Nr 1370830→		
					→08/00	TB639	190x24
1.9 TD 75 S (182.BF)	182 A8.000	55	03/96 → 10/01		→08/00	TBK283	
					A/C(-), 09/96→08/00	MVB1035R6	6PK1035
					A/C(+), 09/96→08/00	MVB1833R6	6PK1833
					09/96→08/00	TB608	193x24
1.9 TD 100 S (182.BF)	182 A8.000	55	03/96 → 10/01		09/96→08/00	TBK352	
					A/C(-), 09/96→08/00	MVB1035R6	6PK1035
					A/C(+), 09/96→08/00	MVB1833R6	6PK1833
					09/96→08/00	TB608	193x24
1.9 TD 75 S (182.BF)	182 A8.000	55	03/96 → 10/01		09/96→08/00	TBK094	

BRAVO

1.4	192 B2.000	66	04/07 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
						TB637	124x22
						TBK313	
1.4 T-Jet		88	09/07 →			TBK313	
					A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
						TB637	124x22
		110	09/07 →			TBK313	
					A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
						TB637	124x22
						TBK313	



kW



FIAT

...FIAT

...BRAVO

1.9 D Multijet	192 A8.000	88	04/07 →	⊗	A/C(-)	MVB795R6	6PK795
				⊗	A/C(+)	MVB1250R6	6PK1250
				⊗	A/C(+)	MVB1270R6	6PK1270
				⊗		TB639	190x24
				⊗		TBK283	
	937A5.000	110	04/07 →	⊗	→ Ch. 4102283	MVB1360R6	6PK1360
				⊗		TB790	199x24
				⊗		TBK306	

BRAVO (182)

1.2 16V 80	182 B2.000	60	12/98 → 10/00	⊗		MVB835R4	4PK835
				⊗	A/C(-)	MVB673R4	4PK673
				⊗	A/C(+)	MVB700R4	4PK700
				⊗		TB637	124x22
				⊗		TBK313	
				⊗		MVB915R3	3PK915
	188 A5.000	59	10/00 → 10/01	⊗	A/C(-)	MVB673R4	4PK673
				⊗	A/C(+)	MVB1590R5	5PK1590
				⊗		TB637	124x22
				⊗		TBK313	
				⊗		MVB915R3	3PK915
1.4 (182.AA)	182 A3.000	59	10/95 → 10/01	⊗	A/C(-), MS, →08/98	MVB747R4	4PK747
				⊗	A/C(-), PS, →08/98	MVB1045R6	6PK1045
				⊗	A/C(+), PS, →08/98	MVB1842R6	6PK1842
				⊗	→08/98	TB470	134x18
				⊗	→08/98	TBK300	
1.4 (182.AG)	182 A5.000	55	10/95 → 10/01	⊗	A/C(-), MS, →02/97	MVB747R4	4PK747
				⊗	A/C(-), PS, →02/97	MVB1045R6	6PK1045
				⊗	A/C(+), PS, →02/97	MVB1842R6	6PK1842
				⊗	→02/97	TB470	134x18
				⊗	→02/97	TBK300	
1.6 16V (182.AB)	182 A4.000	76	03/96 → 10/01	⊗	→08/00	MVB960R4	4PK960
				⊗	→08/00	MVB938R5	5PK938
				⊗	→08/00	TB471	158x25.4
				⊗	→08/00	TBK089	
				⊗	→08/00	MVB668R3	3PK668
1.6 16V (182.AH)	182 A6.000	66	10/95 → 10/01	⊗	→02/97	MVB960R4	4PK960
				⊗	→02/97	MVB938R5	5PK938
				⊗	→02/97	TB471	158x25.4
				⊗	→02/97	TBK089	
				⊗	→02/97	MVB668R3	3PK668
1.8 GT (182.AC)	182 A2.000	83	10/95 → 10/01	⊗	A/C(-), 11/96→08/00	MVB1045R6	6PK1045
				⊗	A/C(+), 07/99→08/00	MVB1855R6	6PK1855
				⊗	A/C(+), 11/96→07/99	MVB1842R6	6PK1842
				⊗	11/96→08/00	TB468	168x24
1.9 D	160 A7.000	48	10/95 → 10/01	⊗	→05/97	MVB938R5	5PK938
				⊗	A/C(-), →05/97	MVB925R6	6PK925
				⊗	A/C(+), →05/97	MVB986R6	6PK986
				⊗	→05/97	TB307	173x22
				⊗	→05/97	TBK065	
				⊗	→05/97	SVB10650	10x650
1.9 JTD	182 B9.000	74	09/00 → 10/01	⊗	A/C(-)	MVB1035R6	6PK1035
				⊗	A/C(+)	MVB1795R6	6PK1795
				⊗		TB639	190x24
				⊗		TBK283	
1.9 JTD 105	182 B4.000	77	12/98 → 10/01	⊗	A/C(-), →08/00	MVB1035R6	6PK1035
				⊗	A/C(+), →08/00,	MVB1775R6	6PK1775
				⊗	→ Eng Nr 1370829		
				⊗	A/C(+), →08/00,	MVB1795R6	6PK1795
				⊗	Eng Nr 1370830→		
				⊗	→08/00	TB639	190x24
				⊗	→08/00	TBK283	



kW



...FIAT

...BRAVO (182)

1.9 TD 100 S (182.AF)	182 A7.000	74	03/96 → 10/01	 KIT	A/C(-), 09/96 → A/C(+), 09/96 → 09/96 → 09/96 →	MVB1035R6 MVB1833R6 TB608 TBK352	6PK1035 6PK1833 193x24 193x24
1.9 TD 75 S (182.AF)	182 A8.000	55	03/96 → 10/01	 KIT	A/C(-), 09/96 → A/C(+), 09/96 → 09/96 → 09/96 →	MVB1035R6 MVB1833R6 TB608 TBK094	6PK1035 6PK1833 193x24 193x24
2.0 HGT 20V (182.AD)	182 A1.000	108	10/95 → 07/98	 	A/C(-), 11/96 → 11/96 → 11/96 →	MVB698R6 TB462 MVB1137R6	6PK698 167x24 6PK1137
2.0 HGT 20V (182AQ)	182 B7.000	113	07/98 → 10/01	 	A/C(-), →08/00 →08/00 →08/00	MVB698R6 TB462 MVB1137R6	6PK698 167x24 6PK1137

CINQUECENTO (170)

0.7 (170AA)	170 A.000	23	12/91 → 01/96		04/92 →	SVB10740	10x740
0.7 i (170AD)	170 A.046	22	07/94 → 01/98			SVB10740	10x740
0.9 (170AB)	170 A1.000	30	07/91 → 12/93	 	03/92 → A/C(-), 03/92 → A/C(+), 03/92 →	SVB13850 SVB10800 SVB13840	13x850 10x800 13x840
0.9 i.e. (170AC)	170 A1.046	30	07/91 → 12/93	 	03/92 → A/C(-), 03/92 → A/C(+), 03/92 →	SVB13850 SVB10800 SVB13840	13x850 10x800 13x840
0.9 i.e. S (170AF, 170CF)	1170 A1.000, 1170 A1.046	29	07/91 → 07/99	 	03/92 → 07/98 A/C(-), 03/92 → 07/98 A/C(+), 03/92 → 07/98	SVB13850 SVB10800 SVB13840	13x850 10x800 13x840
1.1 Sporting (170AH)	176 B2.000	40	10/94 → 01/98	 KIT KIT	A/C(-) A/C(+) → Eng Nr 9042883 Eng Nr 9042884 → → Eng Nr 9042883 Eng Nr 9042884 →	MVB775R4 MVB673R4 MVB545R4 TB357 TB676 TBK043 TBK314	4PK775 4PK673 4PK545 107x19 125x15 125x15

COUPE (FA/175)

1.8 16V	183 A1.000	96	03/96 → 08/00	 	A/C(-) A/C(+), →05/98, → Eng Nr 1070426 A/C(+), 05/98 →, Eng Nr 1070427 →	MVB1045R6 MVB1842R6 MVB1855R6	6PK1045 6PK1842 6PK1855
				 KIT	→05/98	TB468 TBK356	168x24 168x24
2.0 16V	836 A3.000	102	11/93 → 08/96	 ST	A/C(-) A/C(+) A/C(-) A/C(+) A/C(-) A/C(+) A/C(-) A/C(+) A/C(-) A/C(+) A/C(-) A/C(+) A/C(-) A/C(+) A/C(-)	SVB13850 MVB1035R5 MVB1050R5 TB474 TB579 SVB13875 SVB13750 SVB13850 MVB1035R5 MVB1050R5 TB474 TB579 SVB13875 SVB13750 MVB698R6 TB462 MVB1137R6	13x850 5PK1035 5PK1050 173x18 97x15 13x875 13x750 13x850 5PK1035 5PK1050 173x18 97x15 13x875 13x750 6PK698 167x24 6PK1137
2.0 16V Turbo	175 A1.000	140	11/93 → 08/96	 ST	A/C(-) A/C(+) A/C(-) A/C(+) A/C(-) A/C(+) A/C(-) A/C(+) A/C(-)	SVB13850 MVB1035R5 MVB1050R5 TB474 TB579 SVB13875 SVB13750 MVB698R6 TB462 MVB1137R6	13x850 5PK1035 5PK1050 173x18 97x15 13x875 13x750 6PK698 167x24 6PK1137
2.0 20V	182 A1.000	108	08/96 → 04/98	 	A/C(-) A/C(-)	MVB698R6 TB462 MVB1137R6	6PK698 167x24 6PK1137
2.0 20V Turbo	175 A3.000	162	08/96 → 08/00	 	A/C(-) A/C(-)	MVB698R6 TB462 MVB1137R6	6PK698 167x24 6PK1137



kw



...FIAT

CROMA (154)

FIAT

Engine	Model	Power (kw)	Period	Options	Notes	Accessories	Dimensions
1600	154 A.048	61	12/85 → 12/90		08/86 → 10/88 08/86 → 10/88 08/86 → 10/88 A/C(-), 08/86 → 10/88, → Ch. 0206424 A/C(-), 08/86 → 10/88, Ch. 0206425 → A/C(+), 08/86 → 10/88	SVB10840 SVB101025 TB246 SVB10825 SVB13850 SVB10775	10x840 10x1025 110x18 10x825 13x850 10x775
1900 Turbo D i.d.	154 D1.000	69	11/92 → 12/96		→ Eng Nr 1896623 Eng Nr 1896624 → A/C(-), Eng Nr 1731342 → A/C(+)	MVB1060R5 MVB1030R5 MVB985R5 MVB970R5 TB286 SVB10740	5PK1060 5PK1030 5PK985 5PK970 170x25.4 10x740
1900 Turbo D i.d. (154.LL, 154.PL)	154 C6.000	66	05/89 → 10/92		→ Eng Nr 1896623 Eng Nr 1896624 → A/C(-) A/C(+)	MVB1060R5 MVB1030R5 MVB906R5 MVB970R5 TB286 SVB10710	5PK1060 5PK1030 5PK906 5PK970 170x25.4 10x710
2000 16V	154 E1.000	101	08/92 → 08/96		electronic susp control (-) electronic susp control (+) A/C(-) A/C(+)	SVB13875 SVB13775 MVB1100R5 TB474 TB579 SVB13850 SVB13750	13x875 13x775 5PK1100 173x18 97x15 13x850 13x750
2000 CHT		74	01/91 → 09/92		A/C(-) A/C(+)	SVB13875 MVB1100R4 TB303 TB579 SVB13850 SVB13750	13x875 4PK1100 142x18 97x15 13x850 13x750
2000 CHT (154.AC)	154 A1.000	66	12/85 → 02/89		08/86 →, → Ch. 0216250 08/86 →, Ch. 0216251 → A/C(+), 08/86 →, → Ch. 0216250 A/C(+), 08/86 →, Ch. 0216251 → 08/86 → A/C(-), 08/86 →, → Ch. 0206424 A/C(-), 08/86 →, Ch. 0206425 → A/C(+), 08/86 →, → Ch. 0216250 A/C(+), 08/86 →, Ch. 0216251 →	SVB10840 SVB13875 SVB101090 MVB1100R4 TB303 TB579 SVB10825 SVB13850 SVB10775 SVB13750	10x840 13x875 10x1090 4PK1100 142x18 97x15 10x825 13x850 10x775 13x750



kW



...FIAT

...CROMA (154)

2000 i.e. (154.AD)	154 C3.000, 834 B.000	88	03/87 → 09/92	⊗	→02/91, → Ch. 0216250	SVB10840	10x840
				⊗	electronic susp control (-)	SVB13875	13x875
				⊗	electronic susp control (+),	SVB13775	13x775
					03/91→		
				⊗		MVB1100R4	4PK1100
				⊗	A/C(-), →02/91	SVB101090	10x1090
				⊗		TB303	142x18
				⊗		TB579	97x15
				⊗	A/C(-), →02/91	SVB10825	10x825
				⊗	A/C(-),	SVB13850	13x850
					electronic susp control (-),		
					03/91→		
	A/C(-),	SVB13800	13x800				
	electronic susp control (+),						
	03/91→						
	A/C(+)	SVB13750	13x750				
	A/C(+), →02/91,	SVB10775	10x775				
	→ Ch. 0216250						
	A/C(+), →02/91,	SVB10750	10x750				
	→ Ch. 0216250						
2000 i.e. (154.AM)	834 B.048	83	03/86 → 09/90	⊗	→ Ch. 0216250	SVB10840	10x840
				⊗	Ch. 0216251→	SVB13875	13x875
				⊗	A/C(-)	SVB101090	10x1090
				⊗	A/C(+), Ch. 0216251→	MVB1100R4	4PK1100
				⊗		TB303	142x18
				⊗		TB579	97x15
				⊗	A/C(-)	SVB10825	10x825
				⊗	A/C(+), → Ch. 0216250	SVB10775	10x775
				⊗	A/C(+), Ch. 0216251→	SVB13750	13x750
				⊗	A/C(+), → Ch. 0216250	SVB10750	10x750
				2000 i.e. (154.AM, 154.LM)	154 C3.046, 834 B.146	85	10/87 → 08/96
	03/91→						
⊗	electronic susp control (+),	SVB13775	13x775				
	03/91→						
⊗	01/93→	MVB1100R5	5PK1100				
⊗	03/91→01/93	MVB1100R4	4PK1100				
⊗	03/91→	TB303	142x18				
⊗		TB579	97x15				
⊗	A/C(-),	SVB13850	13x850				
	electronic susp control (-),						
	03/91→						
	A/C(-),	SVB13800	13x800				
	electronic susp control (+),						
	03/91→						
	A/C(+), 03/91→	SVB13750	13x750				
2000 i.e. Turbo	834 C.146	111	11/86 → 11/88	⊗	→ Ch. 0216250	SVB10840	10x840
				⊗	Ch. 0216251→	SVB13875	13x875
				⊗	A/C(-)	SVB101090	10x1090
				⊗	A/C(+), Ch. 0216251→	MVB1100R4	4PK1100
				⊗		TB303	142x18
				⊗		TB579	97x15
				⊗	A/C(-)	SVB10825	10x825
				⊗	A/C(+), → Ch. 0216250	SVB10775	10x775
				⊗	A/C(+), Ch. 0216251→	SVB13750	13x750
				⊗	A/C(+), → Ch. 0216250	SVB10750	10x750



kW



...FIAT

...CROMA (154)

FIAT

2000 i.e. Turbo (154.AM)	154 A2.000	114	12/85 → 06/90	☼	→ Ch. 0216250	SVB10840	10x840
				☼	Ch. 0216251→	SVB13875	13x875
				⊖	A/C(-)	SVB101090	10x1090
				⊖	A/C(+), Ch. 0216251→	MVB1100R4	4PK1100
				☼		TB303	142x18
				☼, T		TB579	97x15
				⊖	A/C(-)	SVB10825	10x825
				⊖	A/C(+), → Ch. 0216250	SVB10775	10x775
				⊖, ☼	A/C(+), → Ch. 0216250	SVB10750	10x750
				⊖, ☼	A/C(+), Ch. 0216251→	SVB13750	13x750
2000 i.e. Turbo (154.AM, 154.LM)	154 C4.046, 834 C.146	110	06/87 → 08/96	☼	→02/91, → Ch. 0216250	SVB10840	10x840
				☼	electronic susp control (-)	SVB13875	13x875
				☼	electronic susp control (+), 03/91→	SVB13775	13x775
				⊖	→01/93	MVB1100R4	4PK1100
				⊖	01/93→	MVB1100R5	5PK1100
				⊖	A/C(-), →02/91	SVB101090	10x1090
				☼		TB303	142x18
				☼, T		TB579	97x15
				⊖	A/C(-), →02/91	SVB10825	10x825
				⊖	A/C(-), electronic susp control (-), 03/91→	SVB13850	13x850
				⊖	A/C(-), electronic susp control (+), 03/91→	SVB13800	13x800
				⊖	A/C(+)	SVB13750	13x750
				⊖	A/C(+), →02/91, → Ch. 0216250	SVB10775	10x775
				⊖, ☼	A/C(+), →02/91, → Ch. 0216250	SVB10750	10x750
2500 D	8144.67	55	12/85 → 12/89	☼	06/86→, → Eng Nr 752412	SVB10813	10x813
				☼	06/86→, Eng Nr 752413→	SVB13825	13x825
				⊖	06/86→	SVB10635	10x635
				☼	06/86→	TB348	99x19
				☼	06/86→	SVB10710	10x710
				☼	06/86→11/86	SVB10925	10x925
				☼	11/86→	SVB13925	13x925
2500 TD (154.AE)	8144.91.2000	74	12/85 → 08/89	☼	06/86→08/87, → Eng Nr 752412	SVB10813	10x813
				☼	06/86→08/87, Eng Nr 752413→	SVB13825	13x825
				⊖	06/86→08/87	SVB10635	10x635
				☼	06/86→08/87	TB348	99x19
				☼	06/86→08/87	SVB10710	10x710
				☼	06/86→11/86	SVB10925	10x925
				☼	11/86→08/87	SVB13925	13x925
2500 TD (154.LL, 154.PL)	8144.97, 8144.97 Y	85	05/89 → 08/96	☼	→02/91, → Eng Nr 752412	SVB10813	10x813
				☼	Eng. 814497Y	SVB13825	13x825
				⊖		SVB10635	10x635
				⊖	04/95→	MVB887R5	5PK887
				☼	→01/93	TB348	99x19
				☼	04/95→	TB448	95x19
				☼	→02/91	SVB10710	10x710
				☼		SVB13925	13x925
2500 TDE	8144.97 S	77	12/91 → 08/96	☼		SVB13825	13x825
				⊖		SVB10635	10x635
				☼	→01/93	TB348	99x19
				☼		SVB13925	13x925
2500 V6	834 G.000	119	06/93 → 08/96	⊖	A/C(+)	MVB1240R7	7PK1240
				☼		TB383	134x25.4
				⊖	electronic susp control (-)	MVB763R4	4PK763
				⊖	electronic susp control (+)	MVB790R4	4PK790



kW



...FIAT

CROMA (194)

1.8 16V	939 A4.000	103	12/05 →			MVB1550R5	5PK1550
						TB741	146x24
1.9 D Multijet	939A1.000	88	06/05 →			TB639	190x24
	939A2.000	110	06/05 →			TB790	199x24
					KIT	TBK306	
2.2 16V	194 A1.000	108	06/05 →			MVB1030R5	5PK1030
2.4 D Multijet	939A3.000	147	06/05 →			TB790	199x24

DOBLO (119)

1.2 (223AXA1A)	223 A5.000	48	03/01 →		→10/05	MVB835R4	4PK835
					A/C(-), →01/04, → Eng Nr 0714685	MVB673R4	4PK673
					A/C(-), →10/05	MVB663R4	4PK663
					A/C(+), →10/05	MVB700R4	4PK700
					→01/04	TB649	129x15
					02/04→10/05	TB787	129x22
					→01/04	TBK277	
					A/C(-), →10/05	MVB915R3	3PK915
1.3 D Multijet	223 A9.000	62	10/05 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.4	350 A1.000	57	10/05 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
						TB787	129x22
					A/C(-)	MVB915R3	3PK915
1.6 16V (223AXD1A)	182 B6.000	76	10/01 →		A/C(-)	MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
1.6 Natural Power	182 B6.000	76	09/02 →		A/C(-)	MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
1.9 D (223AXB1A)	223 A6.000	46	03/01 →		A/C(-), →10/05	MVB1050R6	6PK1050
					A/C(+), →10/05	MVB1820R6	6PK1820
					→10/05	TB608	193x24
					→10/05, → Eng Nr 3646771	TBK352	
					→10/05, Eng Nr 3646772→	TBK094	
1.9 D Multijet	186A9.000	88	10/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1820R6	6PK1820
						TB639	190x24
						TBK283	
1.9 JTD	223 A7.000, 223 B1.000	77	07/03 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1820R6	6PK1820
						TB639	190x24
						TBK283	
1.9 JTD (223AXE1A)	182 B9.000, 223 B2.000	74	10/01 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1820R6	6PK1820
						TB639	190x24
					→05/03, → Eng Nr 3646771	TBK104	
					05/03→, Eng Nr 3646772→	TBK283	

DOBLO Cargo (223)

1.2 (223XA1A)	223 A5.000	48	03/01 →		→01/04	MVB835R4	4PK835
					A/C(-), →01/04, → Eng Nr 0714685	MVB673R4	4PK673
					A/C(-), →01/04, Eng Nr 0714686→	MVB663R4	4PK663
					A/C(+), →01/04	MVB700R4	4PK700
					→01/04	TB649	129x15
					→01/04	TBK277	
					A/C(-), →01/04	MVB915R3	3PK915
1.3 D Multijet	199 A2.000	55	10/05 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306



kW



FIAT

...FIAT

...DOBLO Cargo (223)

1.3 JTD 16V	188 A9.000	51	05/04 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.4	350 A1.000	57	10/05 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
						TB787	129x22
					A/C(-)	MVB915R3	3PK915
1.6 16V (223ZXD1A)	182 B6.000	76	10/01 →		A/C(-)	MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
1.6 Natural Power	182 B6.000	76	09/02 →		A/C(-)	MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
1.9 D (223ZXB1A)	223 A6.000	46	03/01 →		A/C(-), →10/05	MVB1050R6	6PK1050
					A/C(+), →10/05	MVB1820R6	6PK1820
					→10/05	TB608	193x24
					→10/05, → Eng Nr 3646771	TBK352	
					→10/05, Eng Nr 3646772→	TBK094	
1.9 JTD		77	07/03 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1820R6	6PK1820
						TB639	190x24
					Eng Nr 3646772→	TBK283	
1.9 JTD (223ZXE1A)	182 B9.000	74	10/01 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1820R6	6PK1820
						TB639	190x24
					→05/03, → Eng Nr 3646771	TBK104	
					05/03→, Eng Nr 3646772→	TBK283	

DUCATO Box

100 Multijet 2,2 D	4HV	74	07/06 →		A/C(+)	MVB1675R6	6PK1675
120 Multijet 2,3 D	F1AE0481D	88	07/06 →			MVB1083R7	7PK1083
						TB723	178x30
160 Multijet Power 3,0 D	F1CE0481D	116	07/06 →			MVB1165R6	6PK1165

DUCATO Box (230L)

1.9 D	230 A2.000	51	03/94 → 04/02		11/94→08/98	MVB1050R5	5PK1050
					11/94→08/98	MVB938R5	5PK938
					11/94→08/98	TB278	173x25.4
					11/94→08/98	SVB10700	10x700
	DJY	50	04/98 → 04/02		A/C(-), →11/01	MVB730R6	6PK730
					A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
					A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
					→11/01	TB560	136x25.4
					→11/01	TBK020	
					→11/01	MVB755R4	4PK755
1.9 TD	DHX (XUD9TF/L)	66	04/98 → 04/02		A/C(-), →11/01	MVB730R6	6PK730
					A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
					A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
					→11/01	TB560	136x25.4
					→11/01	TBK020	
					→11/01	MVB755R4	4PK755
	230 A3.000	60	03/94 → 04/02		→08/98	MVB1050R5	5PK1050
					A/C(-), MS, →08/98	MVB925R5	5PK925
					A/C(-), PS, →08/98	MVB960R5	5PK960
					A/C(+), PS, →08/98	MVB962R6	6PK962
					→08/98	TB278	173x25.4
					→08/98	SVB10700	10x700
1.9 TD CAT	230 A4.000	59	08/94 → 04/02		→08/98	MVB1050R5	5PK1050
					A/C(-), MS, →08/98	MVB925R5	5PK925
					A/C(-), PS, →08/98	MVB960R5	5PK960
					A/C(+), PS, →08/98	MVB962R6	6PK962
					→08/98	TB278	173x25.4
					→08/98	SVB10700	10x700



kW



...FIAT

...DUCATO Box (230L)

2.0	RFW	80	03/94 → 04/02		A/C(-), →11/01	MVB698R6	6PK698
					A/C(+), →11/01	MVB1100R6	6PK1100
					→11/01	TB454	114x25.4
				KIT	→11/01	TBK344	
					→12/96	SVB10710	10x710
2.0 JTD	RHV (DW10)	62	10/01 → 04/02		A/C(-), →11/01	MVB1180R6	6PK1180
					A/C(+), →11/01	MVB1469R6	6PK1469
					→11/01	TB632	141x25.4
				KIT	→11/01	TBK106	
					→11/01	MVB755R4	4PK755
2.5 D	8140.67	62	03/94 → 04/02		→08/98	MVB1050R5	5PK1050
					→08/98	MVB890R6	6PK890
					→08/98	TB368	152x30
				KIT	→08/98	TBK037	
					→08/98		
2.5 TDI	8140.47R	80	03/94 → 04/02		→08/98	MVB1050R5	5PK1050
					→08/98	MVB890R6	6PK890
					→08/98	TB701	153x30
				KIT	→08/98	TBK039	
					→08/98		
2.5 TDI 4x4	8140.47	85	05/98 → 04/02		→08/98, → Eng Nr 2669395	MVB1090R5	5PK1090
					→08/98, Eng Nr 2669696→	MVB1100R5	5PK1100
					→08/98	MVB890R6	6PK890
				KIT	→08/98	TB701	153x30
					→08/98	TBK039	
2.5 TDI Maxi	8140.47	85	03/94 → 04/02		→08/98	MVB1050R5	5PK1050
					→08/98	MVB890R6	6PK890
					→08/98	TB701	153x30
				KIT	→08/98	TBK039	
					→08/98		
2.8 D	8140.63	64	05/98 → 04/02		→11/01	MVB1050R5	5PK1050
					→12/99, → Eng Nr 2976898	MVB915R6	6PK915
					12/99→11/01, Eng Nr 2976899→	MVB946R6	6PK946
				KIT	→11/01	TB701	153x30
					→11/01	TBK039	
2.8 D 4x4	8140.63	64	08/98 → 04/02		→11/01	MVB1100R5	5PK1100
					→12/99, → Eng Nr 2976898	MVB915R6	6PK915
					12/99→11/01, Eng Nr 2976899→	MVB946R6	6PK946
				KIT	→11/01	TB701	153x30
					→11/01	TBK039	
2.8 JTD	8140.43S	94	11/00 → 04/02		→09/01	MVB1100R5	5PK1100
					AUTO, 03/01→	MVB1050R5	5PK1050
					MAN	MVB1000R6	6PK1000
					→09/01	MVB946R6	6PK946
					→09/01	TB558	154x30
2.8 JTD 4x4	8140.43S	94	11/00 → 04/02		03/01→	TB368	152x30
				KIT	→09/01	TBK102	
					03/01→	TBK037	
					03/01→	MVB1100R5	5PK1100
					03/01→	MVB946R6	6PK946
2.8 TDI	8140.43	90	10/97 → 04/02		MAN, 03/01→	MVB1000R6	6PK1000
					03/01→	MVB946R6	6PK946
					03/01→	MVB1000R6	6PK1000
					03/01→	TB368	152x30
				KIT	03/01→	TBK037	
2.8 TDI 4x4	8140.43	90	06/99 → 04/02		05/98→	MVB1050R5	5PK1050
					05/98→, → Eng Nr 2976898	MVB915R6	6PK915
					05/98→, Eng Nr 2976899→	MVB946R6	6PK946
					05/98→	TB558	154x30
				KIT	05/98→	TBK102	

FIAT



kw



...FIAT

DUCATO Box (244)

2.0	RFL	81	04/02 →		A/C(-), →07/06	MVB698R6	6PK698
					A/C(+), →07/06	MVB1100R6	6PK1100
					→07/06	TB454	114x25.4
					→07/06	TBK344	
					→07/06	MVB755R4	4PK755
2.0 Bipower		81	11/02 →		A/C(-), 06/03→07/06	MVB698R6	6PK698
					A/C(+), 06/03→07/06	MVB1100R6	6PK1100
					06/03→07/06	TB454	114x25.4
					06/03→07/06	TBK344	
2.0 JTD	RHV (DW10)	62	04/02 →		A/C(-), →05/04, → Ch. 7431901	MVB1469R6	6PK1469
					A/C(-), 05/04→07/06, Ch. 7431902→	MVB870R6	6PK870
					A/C(+), →07/06	MVB1180R6	6PK1180
					→07/06	TB632	141x25.4
					→07/06	TBK106	
2.3 JTD	F1AE0481C	81	04/02 →		→07/06, → Eng Nr 0113089	MVB985R4	4PK985
					→07/06	MVB1083R7	7PK1083
					→07/06	TB723	178x30
						MVB755R4	4PK755
						MVB1100R5	5PK1100
2.8 JTD	8140.43S	94	04/02 →		→07/06	MVB1000R6	6PK1000
					AUTO, →07/06	MVB946R6	6PK946
					MAN, →07/06	MVB946R6	6PK946
					→07/06	TB368	152x30
					→07/06	TBK037	
2.8 JTD 4x4	8140.43S	94	07/02 →		→07/06	MVB1100R5	5PK1100
					AUTO, →07/06	MVB1000R6	6PK1000
					MAN, →07/06	MVB946R6	6PK946
					→07/06	TB368	152x30
					→07/06	TBK037	

DUCATO Box (280)

1.8	169 B	49	01/82 → 10/88			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
1.9 D	149 B1.000	52	01/88 → 08/90		→ Eng Nr 0889988	SVB10913	10x913
					Eng Nr 0889989→	MVB925R5	5PK925
						TB286	170x25.4
2.0	170 B	55	07/85 → 08/90			SVB10925	10x925
						SVB10888	10x888
	XN 1T	58	01/82 → 08/90			SVB10925	10x925
						SVB10888	10x888
						SVB10925	10x925
170 D	62	03/89 → 08/90			SVB10888	10x888	
					SVB10888	10x888	
2.4 D	8144.61	53	01/82 → 08/90			SVB10913	10x913
						TB135	152x30
						TBK045	
2.4 D 4x4		55	09/86 → 05/90			SVB10913	10x913
						TB135	152x30
						TBK045	
2.5 D	8144.67, CRD93L (U25-661)	55	01/82 → 08/90		09/86→	SVB10913	10x913
					09/86→	TB135	152x30
					09/86→	TBK045	
2.5 D 4x4	8144.67	55	03/89 → 08/90			SVB10913	10x913
						TB135	152x30
						TBK045	

DUCATO Box (290)

1.9 D	149 B1.000	52	07/90 → 03/94		→ Eng Nr 0889988	SVB10913	10x913
					Eng Nr 0889989→	MVB925R5	5PK925
						TB286	170x25.4



kW



FIAT

...FIAT

...DUCATO Box (290)

1.9 TD	280 A1.000	60	03/89 → 03/94		Eng Nr 0889989 →	MVB925R5 TB278	5PK925 173x25.4
2.0 4x4		63	06/90 → 05/94	 		SVB10925 SVB10888	10x925 10x888
2.5 D 4x4	8144.67	55	07/90 → 03/94	 KIT		SVB10913 TB368 TBK037	10x913 152x30
2.5 TD	8140.27	70	07/90 → 03/94	 KIT		SVB10913 TB701 TBK039	10x913 153x30
2.5 TD 4x4	8140.27	70	07/90 → 03/94	 KIT		SVB10913 TB701 TBK039	10x913 153x30

DUCATO Bus

100 Multijet 2,2 D	4HV	74	07/06 →		A/C(+)	MVB1675R6	6PK1675
120 Multijet 2,3 D	F1AE0481D	88	07/06 →	 		MVB1083R7 TB723	7PK1083 178x30
160 Multijet Power 3,0 D	F1CE0481D	116	07/06 →			MVB1165R6	6PK1165

DUCATO Bus (230)

1.9 D	D9B, DJY	50	04/98 → 04/02		A/C(-), →11/01	MVB730R6	6PK730
					A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
					A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
					A/C(+), PS, →10/00	MVB1740R6	6PK1740
					Eng. D9B, A/C(-), PS, →10/00	MVB1105R6	6PK1105
					Eng. D9B, A/C(+), MS, →10/00	MVB1165R6	6PK1165
1.9 D Combinato	230 A2.000	51	06/95 → 04/02		→11/01	TB560	136x25.4
					→11/01	TBK020	
					→11/01	MVB755R4	4PK755
					→08/98	MVB1050R5	5PK1050
1.9 TD	DHX (XUD9TF/L)	66	04/98 → 04/02		→08/98	MVB938R5	5PK938
					→08/98	TB278	173x25.4
					→08/98	SVB10700	10x700
					→08/98	MVB730R6	6PK730
1.9 TD Combinato	230 A4.000	59	08/94 → 04/02		A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
					A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
					→11/01	TB560	136x25.4
					→11/01	TBK020	
					→11/01	MVB755R4	4PK755
					→08/98	MVB1050R5	5PK1050
1.9 TD Panorama/Combinato	230 A3.000	60	03/94 → 04/02		A/C(-), MS, →08/98	MVB925R5	5PK925
					A/C(-), PS, →08/98	MVB960R5	5PK960
					A/C(+), PS, →08/98	MVB962R6	6PK962
					→08/98	TB278	173x25.4
					→08/98	SVB10700	10x700
					→08/98	MVB1050R5	5PK1050
2.0 JTD	RHV (DW10)	62	10/01 → 04/02		A/C(-), MS, →08/98	MVB925R5	5PK925
					A/C(-), PS, →08/98	MVB960R5	5PK960
					A/C(+), PS, →08/98	MVB962R6	6PK962
					→08/98	TB278	173x25.4
					→08/98	SVB10700	10x700
					→08/98	MVB1050R5	5PK1050
2.0 Panorama/Combinato	RFW	80	03/94 → 04/02		A/C(-), →11/01	MVB1180R6	6PK1180
					A/C(+), →11/01	MVB1469R6	6PK1469
					→11/01	TB632	141x25.4
					→11/01	TBK106	
					→11/01	MVB755R4	4PK755
					→11/01	MVB698R6	6PK698
2.0 Panorama/Combinato	RFW	80	03/94 → 04/02		A/C(+), →11/01	MVB1100R6	6PK1100
					→11/01	TB454	114x25.4
					→11/01	TBK344	
					→11/01	MVB755R4	4PK755
					→11/01, → Ch. 5355650	SVB10710	10x710



kW



FIAT

...FIAT

...DUCATO Bus (230)

2.5 D Combinato	8140.67	62	08/94 → 04/02	 	→08/98 →08/98 →08/98 →08/98	MVB1050R5 MVB890R6 TB368 TBK037	5PK1050 6PK890 152x30
2.5 TDI 4x4	8140.47	85	04/97 → 04/02	 	→04/98, → Eng Nr 2669395 →04/98, Eng Nr 2669396 → →04/98 →04/98 →04/98	MVB1090R5 MVB1100R5 MVB890R6 TB701 TBK039	5PK1090 5PK1100 6PK890 153x30
2.5 TDI Combinato	8140.47R	80	08/94 → 04/02	 	→08/98 →08/98 →08/98 →08/98	MVB1050R5 MVB890R6 TB701 TBK039	5PK1050 6PK890 153x30
2.5 TDI Panorama/Combinato	8140.47	85	03/94 → 04/02	 	→08/98 →08/98 →08/98 →08/98	MVB1050R5 MVB890R6 TB701 TBK039	5PK1050 6PK890 153x30
	8140.47R	80	07/94 → 04/02	 	→08/98 →08/98 →08/98 →08/98	MVB1050R5 MVB890R6 TB701 TBK039	5PK1050 6PK890 153x30
2.8 D	8140.63	64	02/98 → 04/02	 	→11/01 Alt. 110A, →12/99, → Eng Nr 2976898	MVB1050R5 MVB915R6	5PK1050 6PK915
				 	Alt. 120A, 12/99 →11/01, Eng Nr 2976899 → →11/01 →11/01	MVB946R6 TB701 TBK039	6PK946 153x30
2.8 JTD	8140.43S	94	11/00 → 04/02	 	03/01 → AUTO, 03/01 → MAN, 03/01 →	MVB1100R5 MVB1000R6 MVB946R6	5PK1100 6PK1000 6PK946
				 	03/01 → 03/01 →	TB368 TBK037	152x30
2.8 JTD 4x4	8140.43S	94	11/00 → 04/02	 	→09/01 MAN, Alt. 120A, →09/01 →09/01 →09/01	MVB1100R5 MVB946R6 TB558 TBK102	5PK1100 6PK946 154x30
2.8 TDI	8140.43	90	10/97 → 04/02	 	05/98 → 05/98 →, → Eng Nr 2976898	MVB1050R5 MVB915R6	5PK1050 6PK915
				 	05/98 → 05/98 →	TB558 TBK102	154x30
2.8 TDI 4x4	8140.43	90	07/99 → 04/02	 	→09/01 →12/99, → Eng Nr 2976898	MVB1100R5 MVB915R6	5PK1100 6PK915
				 	01/00 →09/01, Eng Nr 2976899 → →09/01 →09/01	MVB946R6 TB558 TBK102	6PK946 154x30

DUCATO Bus (244, Z_)

2.0	RFL	81	04/02 →	 	A/C(-), →07/06 A/C(+), →07/06	MVB698R6 MVB1100R6	6PK698 6PK1100
				 	→07/06 →07/06 →07/06	TB454 TBK344 MVB755R4	114x25.4 4PK755
2.0 Bipower		81	11/02 →	 	A/C(-), →07/06 A/C(+), →07/06	MVB698R6 MVB1100R6	6PK698 6PK1100
				 	→07/06 →07/06 →07/06	TB454 TBK344 MVB755R4	114x25.4 4PK755



kW



FIAT

...FIAT

...DUCATO Bus (244, Z_)

2.0 JTD	RHV (DW10)	62	04/02 →		A/C(-), →05/04, → Ch. 7431901	MVB1469R6	6PK1469
					A/C(-), 05/04→07/06, Ch. 7431902→	MVB870R6	6PK870
					A/C(+), →07/06	MVB1180R6	6PK1180
					→07/06	TB632	141x25.4
					→07/06	TBK106	
					→07/06	MVB755R4	4PK755
2.3 JTD	F1AE0481C	81	04/02 →		→07/06, → Eng Nr 0113089	MVB985R4	4PK985
					→07/06	MVB1083R7	7PK1083
					→07/06	TB723	178x30
2.8 JTD	8140.43S	94	04/02 →		→07/06	MVB1100R5	5PK1100
					AUTO, →07/06	MVB1000R6	6PK1000
					MAN, →07/06	MVB946R6	6PK946
					→07/06	TB368	152x30
					→07/06	TBK037	
2.8 JTD 4x4	8140.43S	94	07/02 →		→07/06	MVB1100R5	5PK1100
					AUTO, →07/06	MVB1000R6	6PK1000
					MAN, →07/06	MVB946R6	6PK946
					→07/06	TB368	152x30
					→07/06	TBK037	

DUCATO Flatbed / Chassis

100 Multijet 2,2 D	4HV	74	07/06 →		A/C(+)	MVB1675R6	6PK1675
120 Multijet 2,3 D	F1AE0481D	88	07/06 →			MVB1083R7	7PK1083
						TB723	178x30
160 Multijet Power 3,0 D	F1CE0481D	116	07/06 →			MVB1165R6	6PK1165

DUCATO Flatbed / Chassis (230)

1.9 D	230 A2.000	51	03/94 → 04/02		11/94→08/98	MVB1050R5	5PK1050
					11/94→08/98	MVB938R5	5PK938
					11/94→08/98	TB278	173x25.4
					11/94→08/98	SVB10700	10x700
	DJY	50	04/98 → 04/02		A/C(-), →11/01	MVB730R6	6PK730
					A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
					A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
					→11/01	TB560	136x25.4
					→11/01	TBK020	
					→11/01	MVB755R4	4PK755
1.9 TD	230 A3.000	60	03/94 → 04/02		→08/98	MVB1050R5	5PK1050
					A/C(-), MS, →08/98	MVB925R5	5PK925
					A/C(-), PS, →08/98	MVB960R5	5PK960
					A/C(+), PS, →08/98	MVB962R6	6PK962
					→08/98	TB278	173x25.4
					→08/98	SVB10700	10x700
	DHX (XUD9TF/L)	66	04/98 → 04/02		A/C(-), →11/01	MVB730R6	6PK730
					A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
					A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
					→11/01	TB560	136x25.4
					→11/01	TBK020	
					→11/01	MVB755R4	4PK755
1.9 TD CAT	230 A4.000	59	08/94 → 04/02		→08/98	MVB1050R5	5PK1050
					A/C(-), MS, →08/98	MVB925R5	5PK925
					A/C(-), PS, →08/98	MVB960R5	5PK960
					A/C(+), PS, →08/98	MVB962R6	6PK962
					→08/98	TB278	173x25.4
					→08/98	SVB10700	10x700
2.0	RFW	80	06/98 → 04/02		A/C(-), →11/01	MVB698R6	6PK698
					A/C(+), →11/01	MVB1100R6	6PK1100
					→11/01	TB454	114x25.4
					→11/01	TBK344	
					→11/01	MVB755R4	4PK755



kW



...FIAT

FIAT

...DUCATO Flatbed / Chassis (230)

2.0 4x4	RFW	80	06/98 → 04/02	⊗	A/C(-), →11/01	MVB698R6	6PK698
				⊗	A/C(+), →11/01	MVB1100R6	6PK1100
				☞	→11/01	TB454	114x25.4
				☞	→11/01	TBK344	
2.5 D	8140.67	62	03/94 → 04/02	☼	→08/98	MVB1050R5	5PK1050
				⊗	→08/98	MVB890R6	6PK890
				☞	→08/98	TB368	152x30
				☞	→08/98	TBK037	
2.5 D 4x4	8140.67	62	03/94 → 04/02	☼	→08/98, → Eng Nr 2669395	MVB1090R5	5PK1090
				☼	→08/98, Eng Nr 2669396→	MVB1100R5	5PK1100
				⊗	→08/98	MVB890R6	6PK890
				☞	→08/98	TB368	152x30
2.5 TDI	8140.47	85	03/94 → 04/02	☼	→08/98	MVB1050R5	5PK1050
				⊗	→08/98	MVB890R6	6PK890
				☞	→08/98	TB701	153x30
				☞	→08/98	TBK039	
2.5 TDI	8140.47R	80	03/94 → 04/02	☼	→08/98	MVB1050R5	5PK1050
				⊗	→08/98	MVB890R6	6PK890
				☞	→08/98	TB701	153x30
				☞	→08/98	TBK039	
2.5 TDI 4x4	8140.47	85	06/98 → 04/02	☼	→08/98, → Eng Nr 2669395	MVB1090R5	5PK1090
				☼	→08/98, Eng Nr 2669696→	MVB1100R5	5PK1100
				⊗	→08/98	MVB890R6	6PK890
				☞	→08/98	TB701	153x30
2.8 D	8140.63	64	02/98 → 04/02	☼	→11/01	MVB1050R5	5PK1050
				⊗	→12/99, → Eng Nr 2976898	MVB915R6	6PK915
				⊗	12/99→11/01, Eng Nr 2976899→	MVB946R6	6PK946
				☞	→11/01	TB701	153x30
2.8 JTD	8140.43S	94	11/00 → 04/02	☼	03/01→	MVB1100R5	5PK1100
				⊗	03/01→	MVB946R6	6PK946
				⊗	MAN, 03/01→	MVB1000R6	6PK1000
				☞	03/01→	TB368	152x30
2.8 TDI	8140.43	90	12/98 → 04/02	☼		MVB1050R5	5PK1050
				⊗	→ Eng Nr 2976898	MVB915R6	6PK915
				☞		TB558	154x30
				☞		TBK102	

DUCATO Flatbed / Chassis (244)

2.0 JTD	RHV (DW10)	62	04/02 →	⊗	A/C(-), →05/04, → Ch. 7431901	MVB1469R6	6PK1469
				⊗	A/C(-), 05/04→07/06, Ch. 7431902→	MVB870R6	6PK870
				⊗	A/C(+), →07/06	MVB1180R6	6PK1180
				☞	→07/06	TB632	141x25.4
2.3 JTD	F1AE0481C	81	04/02 →	☞	→07/06	TBK106	
				☞	→07/06	MVB755R4	4PK755
				☼	→07/06, → Eng Nr 0113089	MVB985R4	4PK985
				⊗	→07/06	MVB1083R7	7PK1083
2.8 JTD	8140.43S	94	04/02 →	☼	→07/06	TB723	178x30
				⊗	AUTO, →07/06	MVB1100R5	5PK1100
				⊗	MAN, →07/06	MVB1000R6	6PK1000
				☞	→07/06	MVB946R6	6PK946
				☞	→07/06	TB368	152x30
				☞	→07/06	TBK037	



kW



...FIAT

...DUCATO Flatbed / Chassis (244)

2.8 JTD 4x4	8140.43S	94	10/02 →		→07/06	MVB1100R5	5PK1100
					AUTO, →07/06	MVB1000R6	6PK1000
					MAN, →07/06	MVB946R6	6PK946
					→07/06	TB368	152x30
					→07/06	TBK037	

DUCATO Flatbed / Chassis (280)

1.9 D	149 B1.000	52	01/88 → 08/90		→ Eng Nr 0889988	SVB10913	10x913
					Eng Nr 0889989 →	MVB925R5	5PK925
						TB286	170x25.4
2.0	170 B	55	07/85 → 08/90			SVB10925	10x925
	170 D	62	08/88 → 08/90			SVB10888	10x888
						SVB10925	10x925
						SVB10888	10x888
2.5 D	8144.67, CRD93L (U25-661)	55	07/82 → 08/90		09/86 →	SVB10913	10x913
					09/86 →	TB135	152x30
					09/86 →	TBK045	
2.5 D 4x4	8144.67	55	03/89 → 08/90			SVB10913	10x913
						TB135	152x30
						TBK045	
2.5 TD	8144.21	68	01/86 → 08/90		09/86 →	SVB10913	10x913
					09/86 →	TB250	153x30
					09/86 →	TBK063	

DUCATO Flatbed / Chassis (290)

1.9 TD	280 A1.000	60	03/89 → 03/94		06/90 →, Eng Nr 0889989 →	MVB925R5	5PK925
					06/90 →	TB278	173x25.4
2.0	170 D	62	07/90 → 03/94			SVB10925	10x925
						SVB10888	10x888
2.0 4x4		63	06/90 → 05/94			SVB10925	10x925
						SVB10888	10x888
2.5 D	8144.67	55	07/90 → 03/94			SVB10913	10x913
						TB368	152x30
						TBK037	
2.5 D 4x4	8144.67	55	07/90 → 03/94			SVB10913	10x913
						TB368	152x30
						TBK037	
2.5 TD	8140.27	70	07/90 → 03/94			SVB10913	10x913
						TB701	153x30
						TBK039	
2.5 TD 4x4	8140.27	70	07/90 → 03/94			SVB10913	10x913
						TB701	153x30
						TBK039	

DUCATO Panorama (280)

1.8		51	07/82 → 12/88			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
1.9 D	149 B1.000	52	02/87 → 08/90		→ Eng Nr 0889988	SVB10913	10x913
					Eng Nr 0889989 →	MVB925R5	5PK925
						TB286	170x25.4
2.0	170 B	55	01/86 → 08/90			SVB10925	10x925
	XN 1T	58	07/82 → 05/85			SVB10888	10x888
	170 D	62	09/88 → 08/90			SVB10925	10x925
						SVB10888	10x888
2.4 D	8144.61	53	07/82 → 12/85			SVB10913	10x913
						TB135	152x30
						TBK045	
2.5 D	8144.67, CRD93L (U25-661)	55	01/86 → 08/90		09/86 →	SVB10913	10x913
					09/86 →	TB135	152x30
					09/86 →	TBK045	



kw



...FIAT

...DUCATO Panorama (280)

2.5 D 4x4	8144.67	55	01/87 → 08/90	 		SVB10913 TB135 TBK045	10x913 152x30
2.5 TD	8144.21	68	01/87 → 08/90	 		SVB10913 TB250 TBK063	10x913 153x30
2.5 TD 4x4	8144.21	68	01/86 → 08/90	 	09/86 → 09/86 → 09/86 →	SVB10913 TB250 TBK063	10x913 153x30

DUCATO Panorama (290)

1.9 D	149 B1.000	52	07/90 → 03/94	 	→ Eng Nr 0889988 Eng Nr 0889989 →	SVB10913 MVB925R5 TB286	10x913 5PK925 170x25.4
1.9 TD	280 A1.000	60	07/90 → 03/94	 	Eng Nr 0889989 →	MVB925R5 TB278	5PK925 173x25.4
2.0	170 D	62	07/90 → 03/94	 		SVB10925 SVB10888	10x925 10x888
2.0 4x4		63	06/90 → 05/94	 		SVB10925 SVB10888	10x925 10x888
2.5 D	8144.67	55	07/90 → 03/94	 		SVB10913 TB368 TBK037	10x913 152x30
2.5 D 4x4	8144.67	55	07/90 → 03/94	 		SVB10913 TB368 TBK037	10x913 152x30
2.5 TD	8140.27	70	08/90 → 03/94	 		SVB10913 TB701 TBK039	10x913 153x30
2.5 TD 4x4	8140.27	70	01/91 → 03/94	 		SVB10913 TB701 TBK039	10x913 153x30

DUNA (146 B)

60 1.1	146 A6.000	43	01/87 → 12/91	 		SVB101000 TB248	10x1000 118x15
70 1.3	146 A5.000	49	01/87 → 12/91	 		SVB101000 TB247	10x1000 120x15
DS 1.7	149 B3.000	44	01/87 → 12/91	 	→03/91 →03/91 →03/91	SVB10888 TB337 TBK040	10x888 168x22

DUNA Weekend (146 B)

60 1.1	146 A6.000	43	01/87 → 12/91	 	06/87 → 06/87 →	SVB101000 TB248	10x1000 118x15
70 1.3	146 A5.000	49	01/87 → 12/91	 	06/87 → 06/87 →	SVB101000 TB247	10x1000 120x15
DS 1.7	149 B3.000	44	01/87 → 12/91	 	06/87 →12/89 06/87 →12/89 06/87 →12/89	SVB10888 TB337 TBK040	10x888 168x22

ELBA (146_)

1.5	149 C1.000	55	01/92 → 12/96	 		SVB10825 TB126	10x825 118x19
1.6	159 A3.000	62	04/89 → 12/93	 	11/93 → 11/93 → 11/93 →	MVB915R4 TB305 TBK027	4PK915 138x15
		69	01/94 → 12/96	 	11/93 → →03/95 03/95 →	SVB10950 MVB915R4 MVB940R4 TB305 TBK027 SVB10950	10x950 4PK915 4PK940 138x15



kW



FIAT

...FIAT

...ELBA (146_)

1.7 D	146 B2.000	43	04/89 → 12/96	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	MS, 04/91 → PS, 04/91 → 04/91 → 04/91 → 04/91 →	SVB10913 MVB887R5 TB337 TBK040 MVB683R3	10x913 5PK887 168x22 168x22 3PK683
-------	------------	----	---------------	----------------------------	---	---	--

FIORINO (127)

900	100 GL.000	33	10/77 → 12/84	⊗	→06/84	SVB10800	10x800
1050	127 A.000	37	01/80 → 12/87	⊗ ⊗		SVB101000 TB121	10x1000 117x15

FIORINO (147)

1.0	127 A.000	37	01/80 → 12/87	⊗ ⊗		SVB101000 TB121	10x1000 117x15
1.1 60	146 A9.000	40	11/86 → 04/88	⊗ ⊗	01/88 → 01/88 →	SVB101000 TB248	10x1000 118x15
1.3		49	12/87 → 08/93	⊗ ⊗		SVB101000 TB247	10x1000 120x15
1.3 Diesel		33	03/82 → 12/87	⊗ ⊗ ⊗	07/84 → 07/84 →, → Eng Nr 35570 07/84 →, Eng Nr 35571 →	SVB101060 TB577 TB143	10x1060 133x19 133x22
1.5	149 C1.000	55	01/88 → 08/93	⊗ ⊗	→10/92 →10/92	SVB10825 TB126	10x825 118x19
1.7 Diesel	149 B2.000	42	01/88 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→10/99 →10/99 →10/99 →10/99 →10/99	SVB10888 SVB10913 TB337 TBK040	10x888 10x913 168x22
	149 B3.000	44	12/87 → 12/90	⊗ ⊗ ⊗ ⊗		SVB10888 SVB10913 TB337 TBK040	10x888 10x913 168x22

FIORINO Box

1.3 D Multijet		55	02/08 →	⊗ ⊗	A/C(-) A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318
----------------	--	----	---------	--------	------------------	------------------------	--------------------

FIORINO Box (146 Uno)

60 1.1	146 A9.000	40	05/88 → 12/93	⊗ ⊗	→10/92 →10/92	SVB101000 TB248	10x1000 118x15
60 1.7 D	149 B3.000	44	05/88 → 05/00	⊗ ⊗ ⊗ ⊗ ⊗	→10/99 →10/99 →10/99 →10/99	SVB10888 SVB10913 TB337 TBK040	10x888 10x913 168x22
	146 B2.000	42	05/88 → 10/96	⊗ ⊗ ⊗ ⊗		SVB10888 SVB10913 TB337 TBK040	10x888 10x913 168x22
65 1.7 TD	146 D7.000	46	01/97 → 05/01	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(-)	MVB648R3 MVB887R5 MVB975R5 TB337 TBK040 MVB683R3	3PK648 5PK887 5PK975 168x22 3PK683
70 1.3	146 A5.000	49	01/88 → 12/94	⊗ ⊗		SVB101000 TB247	10x1000 120x15
70 i.e. 1.4	146 C5.000, 146 D5.000	49	05/94 → 05/01	⊗ ⊗ ⊗ ⊗ ⊗	→03/95 03/95 →	MVB915R4 MVB940R4 TB305 TBK027 SVB10950	4PK915 4PK940 138x15
75 i.e. 1.5	149 C1.000	55	05/88 → 12/93	⊗ ⊗	→10/92 →10/92	SVB10825 TB126	10x825 118x19



kw



FIAT

...FIAT

...FIORINO Box (146 Uno)

75 i.e. 1.6	146 C6.000, 146 D6.000	55	10/93 → 05/01	 	→03/95 03/95→	MVB915R4 MVB940R4 TB305 TBK027 SVB10950	4PK915 4PK940 138x15 10x950
-------------	------------------------	----	---------------	--------------	------------------	--	--

FIORINO Pick up (146)

1.3	146 A5.000	49	01/88 → 12/94	 		SVB101000 TB247	10x1000 120x15
1.4	146 D5.000	49	05/94 → 05/01	 	→03/95 03/95→	MVB915R4 MVB940R4 TB305 TBK027 SVB10950	4PK915 4PK940 138x15 10x950
1.6	146 C6.000, 146 D6.000	55	01/94 → 05/01	 	→03/95 03/95→	MVB915R4 MVB940R4 TB305 TBK027 SVB10950	4PK915 4PK940 138x15 10x950
1.7 D	149 B3.000	44	05/88 → 10/99	 		SVB10888 SVB10913 TB337 TBK040	10x888 10x913 168x22 10x888
	146 B2.000	42	10/93 → 10/99	 	MS PS, 05/96→	SVB10888 SVB10913 MVB887R5 TB337 TBK040 MVB683R3	10x888 10x913 5PK887 168x22 3PK683
1.7 TD	146 D7.000	46	01/97 → 05/01	 	A/C(-) A/C(+)	MVB648R3 MVB887R5 MVB975R5 TB337 TBK040 MVB683R3	3PK648 5PK887 5PK975 168x22 3PK683

FIORINO Pick up (147)

1.0		37	10/82 → 10/87	 		SVB101000 TB121	10x1000 117x15
1.1		41	09/87 → 12/88	 	01/88→ 01/88→	SVB101000 TB248	10x1000 118x15
1.3 D	127 A5.000	33	05/84 → 12/88	 	→12/87 →12/87, → Eng Nr 35570 →12/87, Eng Nr 35571→	SVB101060 TB577 TB143	10x1060 133x19 133x22

GRANDE PUNTO (199)

1.2	199 A4.000	48	10/05 →	 	A/C(-) A/C(+)	MVB663R4 MVB1148R5 TB787	4PK663 5PK1148 129x22
1.3 D Multijet	199 A2.000	55	10/05 →	 	A/C(-) A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318
	199 A3.000	66	10/05 →	 	A/C(-) A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318
1.4	350 A1.000	57	10/05 →	 	A/C(-) A/C(+)	MVB663R4 MVB1148R5 TB787	4PK663 5PK1148 129x22
1.4 16V	199 A6.000	70	10/05 →	 	A/C(-) A/C(+)	MVB663R4 MVB1148R5 TB637 TBK313	4PK663 5PK1148 124x22 124x22
1.4 T-Jet		88	09/07 →	 	A/C(-) A/C(+)	MVB663R4 MVB1148R5 TB637 TBK313	4PK663 5PK1148 124x22 124x22



kW



...FIAT

...GRANDE PUNTO (199)

1.9 D Multijet	939A1.000	88	10/05 →			MVB1388R6	6PK1388
						TB639	190x24
						TBK283	
	199 A5.000	96	10/05 →			MVB1388R6	6PK1388
						TB639	190x24
						TBK283	

IDEA

1.2 16V	188 A5.000	59	01/04 →		A/C(-)	MVB673R4	4PK673
					A/C(+)	MVB1148R5	5PK1148
						TB637	124x22
						TBK313	
1.3 D Multijet	199 A3.000	66	10/05 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.3 JTD	188 A9.000	51	01/04 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.4	350 A1.000	57	10/05 →		A/C(-)	MVB673R4	4PK673
					A/C(+)	MVB1148R5	5PK1148
						TB787	129x22
1.4 16V	843 A1.000	70	01/04 →		A/C(-)	MVB673R4	4PK673
					A/C(+)	MVB1148R5	5PK1148
						TB637	124x22
						TBK313	
1.9 JTD	188 B2.000	74	01/04 →		→06/06	MVB1200R6	6PK1200
					06/06 →	MVB1180R6	6PK1180
						TB639	190x24
						TBK283	

LINEA

1.3 D Multijet	199 A3.000	66	06/07 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1318R6	6PK1318
1.4	350 A1.000	57	06/07 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
						TB787	129x22
1.4 T-Jet		88	09/07 →			MVB1148R5	5PK1148
						TB637	124x22
						TBK313	

MAREA (185)

1.2 16V	182 B2.000	60	10/98 →		03/99 → 08/00	MVB835R4	4PK835
					A/C(-), 03/99 → 08/00	MVB673R4	4PK673
					A/C(+), 03/99 → 08/00	MVB700R4	4PK700
					03/99 → 08/00	TB637	124x22
					03/99 → 08/00	TBK313	
					03/99 → 08/00	MVB915R3	3PK915
1.4 80 12V	182 A3.000	59	09/96 →		A/C(-), →02/99	MVB1045R6	6PK1045
					A/C(+), →02/99	MVB1842R6	6PK1842
					→02/99	TB470	134x18
					→02/99	TBK300	
1.6		76	09/00 → 08/02		→06/01	MVB960R4	4PK960
					A/C(+), → Eng Nr 0571417	MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
						MVB668R3	3PK668
1.6 100 16V	182 A4.000	76	09/96 →		→08/00	MVB960R4	4PK960
					→08/00	MVB938R5	5PK938
					→08/00	TB471	158x25.4
					→08/00	TBK089	
					→08/00	MVB668R3	3PK668
1.6 100 16V Bipower	185 A3.000, 186 A4.000	76	04/99 →		→08/00	MVB960R4	4PK960
					→08/00	MVB938R5	5PK938
					→08/00	TB471	158x25.4
					→08/00	TBK089	
					→08/00	MVB668R3	3PK668



kW



...FIAT

...MAREA (185)

1.8 115 16V	182 A2.000	83	09/96 →	⊗	A/C(-), →08/00	MVB1045R6	6PK1045
				⊗	A/C(+), →08/00	MVB1842R6	6PK1842
				⊗	A/C(+), →08/00	MVB1855R6	6PK1855
				🌀	→08/00	TB468	168x24
				🌀			
1.9 JTD 105	182 B4.000	77	04/99 → 01/01	⊗	A/C(-)	MVB1035R6	6PK1035
				⊗	A/C(+)	MVB1833R6	6PK1833
				🌀		TB639	190x24
				🌀		TBK283	
1.9 JTD 110	186 A6.000	81	01/01 →	⊗	A/C(-), →08/02	MVB1035R6	6PK1035
				⊗	A/C(+), →08/02	MVB1833R6	6PK1833
				🌀	→08/02	TB639	190x24
				🌀	→08/02	TBK283	
				🌀			
1.9 TD 100	182 A7.000	74	09/96 →	⊗	A/C(-), →08/00	MVB1035R6	6PK1035
				⊗	A/C(+), →08/00	MVB1833R6	6PK1833
				🌀	→08/00	TB608	193x24
				🌀	→08/00	TBK352	
				🌀			
1.9 TD 75	182 A8.000	55	09/96 →	⊗	A/C(-), →08/00	MVB1035R6	6PK1035
				⊗	A/C(+), →08/00	MVB1833R6	6PK1833
				🌀	→08/00	TB608	193x24
				🌀	→08/00	TBK352	
				🌀			
2.0 150 20V	182 A1.000	108	09/96 → 04/99	⊗	A/C(-)	MVB698R6	6PK698
				🌀		TB462	167x24
	185 A8.000	110	01/01 →	⊗	A/C(-), →06/06	MVB698R6	6PK698
				🌀	→06/06	TB559	166x24
				⊗	→06/06	MVB1137R6	6PK1137
2.0 155 20V	182 B7.000	113	04/99 → 01/01	⊗	A/C(-), →08/00	MVB698R6	6PK698
				🌀	→08/00	TB462	167x24
				⊗	→08/00	MVB1137R6	6PK1137
				🌀			
				🌀			
2.4 JTD 130	185 A6.000, 839 A5.000	96	04/99 →	⊗	Eng. 185A6000, A/C(-), →08/00	MVB1105R6	6PK1105
				⊗	Eng. 185A6000, A/C(+), →08/00	MVB1760R6	6PK1760
				🌀	→08/00	TB639	190x24
				🌀		TBK104	
				🌀			
2.4 TD 125	185 A2.000	91	09/96 → 04/99	⊗	A/C(-)	MVB1105R6	6PK1105
				⊗	A/C(+), → Eng Nr 543351	MVB1740R6	6PK1740
				⊗	A/C(+), Eng Nr 543352 →	MVB1760R6	6PK1760
				🌀		TB608	193x24
				🌀		TBK352	

MAREA Weekend (185)

1.2 16V	182 B2.000	60	10/98 →	⊗	03/99 → 08/00	MVB835R4	4PK835
				⊗	A/C(-), 03/99 → 08/00	MVB673R4	4PK673
				⊗	A/C(+), 03/99 → 08/00	MVB700R4	4PK700
				🌀	03/99 → 08/00	TB637	124x22
				🌀	03/99 → 08/00	TBK313	
1.4 80 12V	182 A3.000	59	09/96 →	⊗	03/99 → 08/00	MVB915R3	3PK915
				⊗	A/C(-), →02/99	MVB1045R6	6PK1045
				⊗	A/C(+), →02/99	MVB1842R6	6PK1842
				🌀	→02/99	TB470	134x18
				🌀	→02/99	TBK300	
1.6 100 16V	182 A4.000	76	09/96 →	⊗	→08/00	MVB960R4	4PK960
				⊗	→08/00	MVB938R5	5PK938
				🌀	→08/00	TB471	158x25.4
				🌀	→08/00	TBK089	
				⊗	→08/00	MVB668R3	3PK668
1.8 115 16V	182 A2.000	83	09/96 →	⊗	A/C(-), →08/00	MVB1045R6	6PK1045
				⊗	A/C(+), →08/00	MVB1842R6	6PK1842
				⊗	A/C(+), →08/00	MVB1855R6	6PK1855
				🌀	→08/00	TB468	168x24
				🌀			
1.9 JTD 105	182 B4.000	77	04/99 →	⊗	A/C(-), →06/03	MVB1035R6	6PK1035
				⊗	A/C(+), →06/03	MVB1833R6	6PK1833
				🌀	→06/03	TB639	190x24
				🌀	→06/03	TBK283	
				🌀			



kW



...FIAT

...MAREA Weekend (185)

1.9 JTD 110	186 A6.000	81	01/01 →		A/C(-), →06/03	MVB1035R6	6PK1035
					A/C(+), →06/03	MVB1833R6	6PK1833
					→06/03	TB639	190x24
				KIT	→06/03	TBK283	
1.9 TD 100	182 A7.000	74	09/96 →		A/C(-), →06/03	MVB1035R6	6PK1035
					A/C(+), →08/00	MVB1833R6	6PK1833
					A/C(+), 03/99→06/03	MVB1833R6	6PK1833
					→08/00	TB608	193x24
					03/99→06/03	TB639	190x24
				KIT	→08/00	TBK352	
1.9 TD 75	182 A8.000	55	09/96 →		A/C(-), →08/00	MVB1035R6	6PK1035
					A/C(+), →08/00	MVB1833R6	6PK1833
					→08/00	TB608	193x24
				KIT	→08/00	TBK352	
2.0 150 20V	182 A1.000	108	09/96 → 04/99		A/C(-)	MVB698R6	6PK698
						TB462	167x24
						MVB1137R6	6PK1137
2.0 155 20V	185 A8.000	110	01/01 →		A/C(-), →08/02	MVB698R6	6PK698
					→08/02	TB559	166x24
					→08/02	MVB1137R6	6PK1137
2.0 155 20V	182 B7.000	113	04/99 → 01/01		A/C(-), →08/00	MVB698R6	6PK698
					→08/00	TB462	167x24
					→08/00	MVB1137R6	6PK1137
2.4 JTD 130	185 A6.000, 839 A5.000	96	04/99 →		Eng. 185A6000, A/C(-), →08/00	MVB1105R6	6PK1105
					Eng. 185A6000, A/C(+), →08/00	MVB1760R6	6PK1760
					→08/00	TB639	190x24
				KIT	Eng. 185A6000, →08/00	TBK104	
2.4 TD 125	185 A2.000	91	09/96 → 04/99		A/C(-)	MVB1105R6	6PK1105
					A/C(+), → Eng Nr 543351	MVB1740R6	6PK1740
					A/C(+), Eng Nr 543352→	MVB1760R6	6PK1760
						TB608	193x24
				KIT		TBK352	

MULTIPLA (186)

1.6 100 16V (186AXA1A)	182 A4.000	76	04/99 →		→06/01	MVB960R4	4PK960
						MVB938R5	5PK938
						TB471	158x25.4
				KIT		TBK089	
1.6 16V Bipower (186AMB1A)	186 A4.000	76	04/99 →		→06/01	MVB960R4	4PK960
					→09/03	MVB938R5	5PK938
					→09/03	TB471	158x25.4
				KIT	→09/03	TBK089	
1.6 16V Bipower (186AXC1A)	182 B6.000	76	10/01 →			MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
						MVB668R3	3PK668
1.6 16V Blupower (186AGB1A)	182 B6.000	70	04/02 →			MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
						MVB668R3	3PK668
1.6 16V Blupower (186AMA1A)	186 A3.000	70	04/99 →		→06/01	MVB960R4	4PK960
					→08/05	MVB938R5	5PK938
					→08/05	TB471	158x25.4
					→08/05	TBK089	
					→08/05	MVB668R3	3PK668
1.9 JTD (186AXE1A)	186A9.000	88	04/02 →		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
				KIT		TBK283	



kw



...FIAT

...MULTIPLA (186)

1.9 JTD 105 (186AXB1A)	182 B4.000	77	04/99 →		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
					→ Eng Nr 4114649	TBK283	
					Eng Nr 4114650 →	TBK329	
1.9 JTD 110	186 A6.000	81	03/01 → 07/02		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
					→ Eng Nr 4114649	TBK283	
					Eng Nr 4114650 →	TBK329	
1.9 JTD 115	186 A8.000	85	07/02 →		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
					→ Eng Nr 4114649	TBK283	
					Eng Nr 4114650 →	TBK329	

PALIO (178BX)

1.0		45	04/96 →		06/97 → 10/03	MVB755R4	4PK755
					A/C(-), MS, 06/97 → 10/03	MVB1105R6	6PK1105
					A/C(+), MS, 06/97 → 10/03	MVB1125R6	6PK1125
					A/C(+), PS, 06/97 → 10/03	MVB1388R6	6PK1388
					06/97 → 10/03	TB798	131x17
		56	04/96 →		06/97 → 10/03	MVB755R4	4PK755
					A/C(-), MS, 06/97 → 10/03	MVB1105R6	6PK1105
					A/C(+), MS, 06/97 → 10/03	MVB1125R6	6PK1125
					A/C(+), PS, 06/97 → 10/03	MVB1388R6	6PK1388
					06/97 → 10/03	TB798	131x17
1.2	178 E2.000	54	06/98 →		A/C(-), MS, → Eng Nr 0714685	MVB835R4	4PK835
					A/C(-), MS, Eng Nr 0714686 →	MVB673R4	4PK673
					A/C(+)	MVB663R4	4PK663
					→ Eng Nr 9042883	MVB700R4	4PK700
					Eng Nr 9042884 →	TB660	108x15
					→ Eng Nr 9042883	TB649	129x15
					Eng Nr 9042884 →	TBK085	
						TBK277	
						MVB915R3	3PK915
1.4	178 B2.000	51	04/96 →			MVB855R4	4PK855
						MVB950R5	5PK950
						TB305	138x15
						SVB10690	10x690
1.4 CAT	178 B2.016	51	04/96 →		07/00 → 08/01	MVB835R4	4PK835
					09/99 → 07/00	MVB855R4	4PK855
					09/99 → 08/01	MVB950R5	5PK950
					09/99 → 08/01	TB305	138x15
					09/99 → 08/01	SVB10690	10x690
1.6 16V	178 B3.000	74	04/96 →		07/97 →	MVB855R4	4PK855
					07/97 → 10/99	MVB950R5	5PK950
					10/99 →	MVB938R5	5PK938
					07/97 →	TB471	158x25.4
					07/97 →	TBK089	
					07/97 →	MVB668R3	3PK668



kW



...FIAT

PALIO Weekend (178DX)

1.2 (178DX.G1A)	178 B5.000	54	04/96 → 02/01		07/97 →	MVB835R4	4PK835
					A/C(-), 07/97 →, → Eng Nr 0714685	MVB673R4	4PK673
					A/C(-), 07/97 →, Eng Nr 0714686 →	MVB663R4	4PK663
					A/C(+), 07/97 →	MVB700R4	4PK700
					07/97 →, → Eng Nr 9042883	TB660	108x15
					07/97 →, Eng Nr 9042884 →	TB649	129x15
					07/97 →, → Eng Nr 9042883	TBK085	
					07/97 →, Eng Nr 9042884 →	TBK277	
					07/97 →	MVB915R3	3PK915
1.2 (178DYA1A)	188 A4.000	44	02/01 →		A/C(-)	MVB673R4	4PK673
					A/C(+)	MVB1188R5	5PK1188
						TB649	129x15
						TBK277	
1.6 16V (178DX.D1A)	178 B3.000	74	04/96 → 02/01		07/97 →	MVB855R4	4PK855
					07/97 → 02/00	MVB950R5	5PK950
					10/99 →	MVB938R5	5PK938
					07/97 →	TB471	158x25.4
					07/97 →	TBK089	
					07/97 →	MVB668R3	3PK668
1.6 16V (178DYC1A06)	182 B6.000	76	02/01 →			MVB855R4	4PK855
						MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
						MVB668R3	3PK668
1.7 TD (178DX.H1A)	176 A3.000	51	04/96 → 03/01		07/97 →, → Eng Nr 02138439	MVB940R4	4PK940
					07/97 →, Eng Nr 02138440 →	MVB905R4	4PK905
					07/97 →	MVB986R6	6PK986
					07/97 →	TB337	168x22
					07/97 →	TBK040	
					07/97 →	MVB720R3	3PK720
1.9 D (178DYD1A07)	223 A6.000	46	03/01 →			MVB1820R6	6PK1820
						TB608	193x24
					→ Eng Nr 3646771	TBK352	
					Eng Nr 3646772 →	TBK094	

PANDA (141A_)

650	141 A.000	22	01/82 → 07/04		→ 04/86	SVB10800	10x800
					→ 04/86, Ch. 5175082 →	SVB10865	10x865
					→ 04/86, Ch. 5643428, 6160408 →	SVB101025	10x1025
		22	01/82 → 07/04		→ 04/86	SVB10800	10x800
					→ 04/86, → Ch. 5643427, 6160407	SVB10865	10x865
					→ 04/86, Ch. 5643428, 6160408 →	SVB101025	10x1025
750 (141AA)	156 A4.000	25	01/86 → 01/95		05/86 →	SVB10675	10x675
					05/86 →	TB129	104x15
					05/86 →	TBK006	
750 (141AI)	141 B.000	25	01/86 → 01/95		05/86 → 12/93	SVB10800	10x800
750 (141AM) CAT	156 A4.048	25	01/95 → 12/97			SVB10675	10x675
						TB129	104x15
						TBK006	
800		25	02/81 → 12/85			SVB10800	10x800
900	100 GL3.000, 146 A.000	33	10/80 → 06/94			SVB10800	10x800
	1170 A1.046	29	04/92 → 12/96			SVB10800	10x800
950 4x4	A 112 B1.054	35	09/83 → 12/86			SVB10800	10x800
1000	156 A2.100	32	01/86 → 04/92		05/86 →, → Eng Nr 9042883	TB129	104x15
					05/86 →, Eng Nr 9042884 →	TB676	125x15
					05/86 →, → Eng Nr 9042883	TBK006	
					05/86 →, Eng Nr 9042884 →	TBK314	

FIAT



kw



...FIAT

...PANDA (141A_)

FIAT

1000 4x4	156 A2.100, 156 A3.100	32	01/86 → 07/89		05/86 →, → Eng Nr 9042883	TB129	104x15	
					05/86 →, Eng Nr 9042884 →	TB676	125x15	
				KIT	05/86 →, → Eng Nr 9042883	TBK006		
				KIT	05/86 →, Eng Nr 9042884 →	TBK314		
	156 A3.000	37	01/86 → 12/92		→04/86	SVB10800	10x800	
					05/86 →, → Eng Nr 9042883	TB129	104x15	
					05/86 →, Eng Nr 9042884 →	TB676	125x15	
				KIT	05/86 →, → Eng Nr 9042883	TBK006		
	141 C2.000, 156 A2.246	33	05/86 → 12/94		→ Eng Nr 4233955	SVB10675	10x675	
					Eng Nr 4233956 →	MVB673R4	4PK673	
					→ Eng Nr 9042883	TB129	104x15	
					Eng Nr 9042884 →	TB676	125x15	
1000 i.e. CAT	141 C2.000, 156 A2.246	33	10/87 → 08/98		→ Eng Nr 4233955	SVB10675	10x675	
					Eng Nr 4233956 →	MVB673R4	4PK673	
					→ Eng Nr 9042883	TB129	104x15	
					Eng Nr 9042884 →	TB676	125x15	
	1100	156 C.046	37	05/91 → 12/99		→01/93	SVB10675	10x675
						01/93 →03/95	MVB673R4	4PK673
						→03/95, → Eng Nr 9042883	TB129	104x15
						→03/95, Eng Nr 9042884 →	TB676	125x15
	176 B2.000, 187 A1.000	40	02/95 → 09/03		→03/95, → Eng Nr 9042883	TBK006		
					→03/95, → Eng Nr 9042883	TBK314		
					→03/95, Eng Nr 9042884 →			
				KIT	→03/95, Eng Nr 9042884 →			
1100 4x4	176 B2.000	40	02/95 → 07/04		→ Eng Nr 0714685	MVB673R4	4PK673	
					09/00 →, Eng Nr 0714685 →	MVB663R4	4PK663	
					→08/00, → Eng Nr 9042883	TB676	125x15	
					→08/00, → Eng Nr 9042883	TB129	104x15	
	1100 Trekking 4x4	156 C.046	37	10/91 → 07/04		Eng. 176B2000, →08/00,	TBK006	
						→ Eng Nr 9042883		
					KIT	Eng. 187A1000	TBK314	
					KIT	Eng. 187A1000		
	1300 D	156 A5.000	27	04/86 → 12/92		→ Eng Nr 0714685	MVB673R4	4PK673
						09/00 →, Eng Nr 0714685 →	MVB663R4	4PK663
						→08/00, → Eng Nr 9042883	TB676	125x15
						→08/00, → Eng Nr 9042883	TB129	104x15
1300 D	156 A5.000	27	04/86 → 12/92		→08/00, → Eng Nr 9042883	TBK314		
					→08/00, → Eng Nr 9042883	TBK006		
				KIT	→08/00, → Eng Nr 9042883			
				KIT	→08/00, → Eng Nr 9042883			

PANDA (169)

1.1	187 A1.000	40	09/03 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
					→ Eng Nr 2533527	TB676	125x15
					Eng Nr 2533528 →	TB794	125x22
1.2	188 A4.000	44	09/03 →		→ Eng Nr 2533527	TBK314	
					A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
1.2	188 A4.000	44	09/03 →		→ Eng Nr 2533528	TB649	129x15
					Eng Nr 2533529 →	TB787	129x22
					→ Eng Nr 2533528	TBK277	
				KIT	→ Eng Nr 2533528		



kW



...FIAT

...PANDA (169)

1.2 4x4	188 A4.000	44	10/04 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
					→ Eng Nr 2533528	TB649	129x15
					Eng Nr 2533529→	TB787	129x22
					→ Eng Nr 2533528	TBK277	
1.2 Bi-Power	188 A4.000	44	01/07 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
					→ Eng Nr 2533528	TB649	129x15
					Eng Nr 2533529→	TB787	129x22
					→ Eng Nr 2533528	TBK277	
1.3 JTD	188 A9.000	51	09/03 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.3 JTD 4x4	188 A9.000	51	10/04 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.4	169 A3.000	74	10/06 →			MVB1148R5	5PK1148
						TB637	124x22
						TBK313	

PANDA Van (141_)

1.2		44	09/04 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
					→ Eng Nr 2533528	TB649	129x15
					Eng Nr 2533529→	TB787	129x22
					→ Eng Nr 2533528	TBK277	
1.2 X		44	09/04 →		A/C(-)	MVB663R4	4PK663
					A/C(+)	MVB1148R5	5PK1148
					→ Eng Nr 2533528	TB649	129x15
					Eng Nr 2533529→	TB787	129x22
					→ Eng Nr 2533528	TBK277	
1.3 JTD		55	06/06 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
		51	03/04 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
750	141 B.000	25	01/86 → 07/92		05/91→	SVB10800	10x800
					10/88→04/91	SVB10675	10x675
					10/88→04/91	TB129	104x15
					10/88→04/91	TBK006	
1000	156 A2.100, 156 A3.100	32	01/86 → 02/92		05/86→, → Eng Nr 9042883	TB129	104x15
					05/86→, Eng Nr 9042884→	TB676	125x15
					05/86→, → Eng Nr 9042883	TBK006	
					05/86→, Eng Nr 9042884→	TBK314	
1000 i.e	156 A2.246	33	08/92 → 02/04		→08/00, → Eng Nr 4233955	SVB10675	10x675
					→08/00, Eng Nr 4233956→	MVB673R4	4PK673
					→08/00, → Eng Nr 9042883	TB129	104x15
					→08/00, Eng Nr 9042884→	TB676	125x15
					→08/00, → Eng Nr 9042883	TBK006	
					→08/00, Eng Nr 9042884→	TBK314	

FIAT



kW



...FIAT

PUNTO (176)

FIAT

1.4 GT Turbo	176 A4.000	98	01/94 → 09/96	☼	→04/95	MVB1000R3	3PK1000			
				☼	04/95→	MVB975R4	4PK975			
				⊖	A/C(-)	MVB938R5	5PK938			
				⊖	A/C(+)	MVB975R5	5PK975			
				⊖	A/C(+)	MVB985R5	5PK985			
				☼		TB305	138x15			
				☼		TBK027				
				☼		SVB10690	10x690			
				176 B6.000	96	09/96 → 09/99	☼		MVB975R4	4PK975
							⊖	A/C(-)	MVB938R5	5PK938
⊖	A/C(+)	MVB975R5	5PK975							
⊖	A/C(+)	MVB985R5	5PK985							
☼		TB305	138x15							
☼		TBK027								
☼		SVB10690	10x690							
1.7 D	176 B3.000	42	04/94 → 09/97				⊖		MVB938R6	6PK938
							☼		TB337	168x22
							☼		TBK040	
				☼		MVB720R3	3PK720			
1.7 TD	176 A5.000	52	01/94 → 09/99	☼		MVB950R4	4PK950			
				⊖	A/C(-), → Eng Nr 01815651	MVB938R5	5PK938			
				⊖	A/C(-), Eng Nr 01815652→	MVB938R6	6PK938			
				⊖	A/C(+)	MVB986R6	6PK986			
				☼		TB337	168x22			
				☼		TBK040				
				☼		MVB720R3	3PK720			
				176 A3.000	51	01/94 → 09/99	☼		MVB950R4	4PK950
							⊖	A/C(-), → Eng Nr 01815651	MVB938R5	5PK938
							⊖	A/C(-), Eng Nr 01815652→	MVB938R6	6PK938
⊖	A/C(+)	MVB986R6	6PK986							
☼		TB337	168x22							
☼		TBK040								
55 1.1	176 A6.000, 176 B2.000	40	09/93 → 09/99	☼	PS, →11/96	MVB855R4	4PK855			
				⊖		MVB673R4	4PK673			
				⊖	A/C(+), PS, →11/96	MVB706R4	4PK706			
				☼	→11/96	TB129	104x15			
				☼	12/96→, → Eng Nr 9042883	TB357	107x19			
				☼	12/96→, Eng Nr 9042884→	TB676	125x15			
				☼	→11/96	TBK006				
				☼	12/96→, → Eng Nr 9042883	TBK043				
				☼	12/96→, Eng Nr 9042884→	TBK314				
				☼	12/96→	MVB915R3	3PK915			



kW



...FIAT

...PUNTO (176)

60 1.2	176 A7.000	43	01/94 → 09/99	⊗	→ Eng Nr 7882272	MVB855R4	4PK855
				⊗	Eng Nr 7882273→	MVB835R4	4PK835
				⊗	A/C(-)	MVB673R4	4PK673
				⊗	A/C(+), → Eng Nr 7882272	MVB706R4	4PK706
				⊗	A/C(+), Eng Nr 7882273→	MVB700R4	4PK700
					→ Eng Nr 9042883	TB660	108x15
					Eng Nr 9042884→	TB649	129x15
				KIT	→ Eng Nr 9042883	TBK085	
				KIT	Eng Nr 9042884→	TBK277	
				⊗		MVB915R3	3PK915
176 B1.000, 176 B4.000	44	03/94 → 09/99	⊗	→ Eng Nr 7882272	MVB855R4	4PK855	
			⊗	Eng Nr 7882273→	MVB835R4	4PK835	
			⊗	A/C(-)	MVB673R4	4PK673	
			⊗	A/C(+), → Eng Nr 7882272	MVB706R4	4PK706	
			⊗	A/C(+), Eng Nr 7882273→	MVB700R4	4PK700	
				→ Eng Nr 9042883	TB660	108x15	
				Eng Nr 9042884→	TB649	129x15	
			KIT	→ Eng Nr 9042883	TBK085		
			KIT	Eng Nr 9042884→	TBK277		
			⊗		MVB915R3	3PK915	
60 TD 1.7	176 B7.000	46	09/96 → 09/99	⊗		MVB950R4	4PK950
				⊗	A/C(-), → Eng Nr 01815651	MVB938R5	5PK938
				⊗	A/C(-), Eng Nr 01815652→	MVB938R6	6PK938
				⊗	A/C(+)	MVB986R6	6PK986
						TB337	168x22
				KIT		TBK040	
				⊗		MVB720R3	3PK720
75 1.2	176 A8.000	54	01/94 → 09/99	⊗	→10/98, → Eng Nr 7882272	MVB855R4	4PK855
				⊗	→10/98, Eng Nr 7882273→	MVB835R4	4PK835
				⊗	A/C(-), →10/98	MVB673R4	4PK673
				⊗	A/C(+), →10/98,	MVB706R4	4PK706
					→ Eng Nr 7882272		
				⊗	A/C(+), →10/98,	MVB700R4	4PK700
					Eng Nr 7882273→		
					→10/98, → Eng Nr 9042883	TB660	108x15
					→10/98, Eng Nr 9042884→	TB649	129x15
				KIT	→10/98, → Eng Nr 9042883	TBK085	
KIT	→10/98, Eng Nr 9042884→	TBK277					
⊗	→10/98, → Eng Nr 5795654	MVB940R3	3PK940				
⊗	→10/98, Eng Nr 5795655→	MVB915R3	3PK915				
85 16V 1.2	176 B9.000	63	04/97 → 09/99	⊗	→ Eng Nr 7882272	MVB855R4	4PK855
				⊗	Eng Nr 7882273→	MVB835R4	4PK835
				⊗	A/C(-)	MVB673R4	4PK673
				⊗	A/C(+), → Eng Nr 7882272	MVB706R4	4PK706
				⊗	A/C(+), Eng Nr 7882273→	MVB700R4	4PK700
						TB637	124x22
				KIT		TBK313	
				⊗		MVB915R3	3PK915
90 1.6	176 A9.000	65	01/94 → 04/97	⊗	→ Eng Nr 09396121	MVB1000R4	4PK1000
				⊗	Eng Nr 09396122→	MVB975R4	4PK975
				⊗		MVB938R5	5PK938
						TB305	138x15
				KIT		TBK027	
				⊗		SVB10690	10x690

FIAT



kw



...FIAT

FIAT

PUNTO (188)

1.2 16V 80 (188.233, .235, .253, .255, .333, .353, .639, .63)	188 A5.000	59	09/99 →		RHA(+), →04/06	MVB835R4	4PK835
					A/C(-), →04/06, → Eng Nr 0714685	MVB673R4	4PK673
					A/C(-), →04/06, Eng Nr 0714686→	MVB663R4	4PK663
					A/C(+), LHD, →04/06, → Eng Nr 0616579	MVB1175R5	5PK1175
					A/C(+), LHD, 01/02→04/06, Eng Nr 0616580→	MVB1155R5	5PK1155
1.2 60 (188.030, .050, .130, .150, .230, .250)	188 A4.000	44	09/99 →		RHA(+)	MVB835R4	4PK835
					A/C(-), LHD, Eng Nr 0714686→	MVB663R4	4PK663
					A/C(-), RHA, Euro 3 (D3)	MVB673R4	4PK673
					A/C(+), LHD, →01/02	MVB1175R5	5PK1175
					A/C(+), LHD, 01/02→	MVB1155R5	5PK1155
1.2 Natural Power	188 A4.000	44	09/03 →		RHA(+)	MVB835R4	4PK835
					A/C(-), → Eng Nr 0714685	MVB673R4	4PK673
					A/C(-), Eng Nr 0714686→	MVB663R4	4PK663
					A/C(+)	MVB1155R5	5PK1155
					A/C(+), RHA	MVB700R4	4PK700
1.3 JTD 16V	188 A9.000	51	06/03 →		→ Eng Nr 2533528	TB649	129x15
					Eng Nr 2533529→	TB787	129x22
					→ Eng Nr 2533528	TBK277	
					RHA(+)	MVB835R4	4PK835
					A/C(-), → Eng Nr 0714685	MVB673R4	4PK673
1.4	843 A1.000	70	09/03 →		A/C(-), →04/06	MVB1180R6	6PK1180
					A/C(+), →04/06	MVB1306R6	6PK1306
1.8 130 HGT (188.738, .718)	183 A1.000, 188 A6.000	96	09/99 →		A/C(-), →10/05	MVB673R4	4PK673
					A/C(+), →10/05	MVB1148R5	5PK1148
					→10/05	TB637	124x22
					→10/05	TBK313	
					→08/00	MVB1842R6	6PK1842
1.9 DS 60 (188.031, .051, .231, .251)	188 A3.000	44	09/99 →		02/02→05/02	MVB1795R6	6PK1795
					05/02→10/05	MVB1760R6	6PK1760
					09/00→02/02	MVB1820R6	6PK1820
					→08/00	TB468	168x24
					09/00→10/05	TB559	166x24
1.9 JTD	188 A7.000	63	10/01 →		09/00→10/05	TBK345	
					A/C(-), →10/03	MVB825R6	6PK825
					A/C(+), →04/02	MVB1230R6	6PK1230
					A/C(+), 04/02→10/03	MVB1200R6	6PK1200
					→10/03	TB608	193x24
1.9 JTD 80 (188.237, .257, .337, .357)	188 A2.000	59	09/99 →		→10/03	TBK094	
					A/C(-), →10/05	MVB825R6	6PK825
					A/C(+), →04/02	MVB1230R6	6PK1230
					A/C(+), 04/02→10/05	MVB1200R6	6PK1200
					→10/05	TB639	190x24
1.9 JTD 80 (188.237, .257, .337, .357)	188 B2.000	74	06/03 →		→10/05	TBK283	
					→10/05	MVB1200R6	6PK1200
					→10/05	TB639	190x24
					→10/05, → Eng Nr 4115088	TBK283	
					→10/05, Eng Nr 4115089→	TBK329	
1.9 JTD 80 (188.237, .257, .337, .357)	188 A2.000	59	09/99 →		A/C(-), →10/03	MVB825R6	6PK825
					A/C(+), →04/02	MVB1230R6	6PK1230
					A/C(+), 04/02→10/03	MVB1200R6	6PK1200
					→10/03	TB639	190x24
					→10/03	TBK283	



kW



...FIAT

PUNTO Convertible (176C)

60 1.2	176 A7.000	43	04/94 → 06/00		→03/97, → Eng Nr 7882272	MVB855R4	4PK855				
					→03/97, Eng Nr 7882273→	MVB835R4	4PK835				
					A/C(-), →03/97	MVB673R4	4PK673				
					A/C(+), →03/97,	MVB706R4	4PK706				
					→ Eng Nr 7882272						
					A/C(+), →03/97,	MVB700R4	4PK700				
					Eng Nr 7882273→						
					→03/97	TB660	108x15				
					→03/97	TBK085					
					→03/97	MVB915R3	3PK915				
176 B1.000, 176 B4.000	44	05/95 → 06/00		Eng. 176B4000, 04/97→,	MVB855R4	4PK855					
				→ Eng Nr 7882272							
				Eng. 176B4000, 04/97→,	MVB835R4	4PK835					
				Eng Nr 7882273→							
				Eng. 176B4000, A/C(-), 04/97→	MVB673R4	4PK673					
				Eng. 176B4000,	MVB706R4	4PK706					
				A/C(+), 04/97→,							
				→ Eng Nr 7882272	MVB700R4	4PK700					
				Eng. 176B4000,							
				A/C(+), 04/97→,							
	Eng Nr 7882273→										
	04/97→, → Eng Nr 9042883	TB660	108x15								
	04/97→, Eng Nr 9042884→	TB649	129x15								
	Eng. 176B4000, 04/97→,	TBK085									
	→ Eng Nr 9042883										
	Eng. 176B4000, 04/97→,	TBK277									
	Eng Nr 9042884→										
	Eng. 176B4000, 04/97→	MVB915R3	3PK915								
85 16V 1.2	176 B9.000	63	04/97 → 06/00		→ Eng Nr 7882272	MVB855R4	4PK855				
					Eng Nr 7882273→	MVB835R4	4PK835				
					A/C(-)	MVB673R4	4PK673				
					A/C(+), → Eng Nr 7882272	MVB706R4	4PK706				
					A/C(+), Eng Nr 7882273→	MVB700R4	4PK700				
						TB637	124x22				
						TBK313					
						MVB915R3	3PK915				
				90 1.6	176 A9.000	65	04/94 → 04/97		→ Eng Nr 09396121	MVB1000R4	4PK1000
									Eng Nr 09396122→	MVB975R4	4PK975
		MVB938R5	5PK938								
		TB305	138x15								
		TBK027									
		SVB10690	10x690								
PUNTO Van (176L)											
1.1	176 B2.000	40	04/96 → 02/00		PS, →11/96	MVB855R4	4PK855				
						MVB673R4	4PK673				
					A/C(+), PS, →11/96	MVB706R4	4PK706				
					→11/96	TB129	104x15				
					12/96→, → Eng Nr 9042883	TB357	107x19				
					12/96→, Eng Nr 9042884→	TB676	125x15				
					→11/96	TBK006					
					12/96→, → Eng Nr 9042883	TBK043					
					12/96→, Eng Nr 9042884→	TBK314					
					12/96→	MVB915R3	3PK915				
1.7 D	176 B3.000	42	04/96 → 02/00		→11/96	MVB938R6	6PK938				
					→11/96	TB337	168x22				
					→11/96	TBK040					
					→11/96	MVB720R3	3PK720				
					→11/96						

FIAT



kW



...FIAT

...PUNTO Van (176L)

1.7 TD	176 A5.000	52	04/96 → 02/00	☀ ⊖	→03/97 A/C(-), →03/97, → Eng Nr 01815651	MVB950R4 MVB938R5	4PK950 5PK938
				⊖	A/C(-), →03/97, Eng Nr 01815652→	MVB938R6	6PK938
				⊖ ☞	A/C(+), →03/97	MVB986R6	6PK986
				☞ ☞ KIT	→03/97	TB337	168x22
				☞	→03/97	TBK040	
				☞	→03/97	MVB720R3	3PK720

PUNTO Van (188AX)

1.2 60	188 A4.000	44	02/00 →	☀ ⊖	RHA(+), 09/00→10/05 A/C(-), 09/00→10/05, → Eng Nr 0714685	MVB835R4 MVB673R4	4PK835 4PK673
				⊖	A/C(-), 09/00→10/05, Eng Nr 0714686→	MVB663R4	4PK663
				⊖	A/C(+), LHD, 01/02→10/05	MVB1155R5	5PK1155
				⊖	A/C(+), LHD, 09/00→01/02	MVB1175R5	5PK1175
				⊖ ☞	A/C(+), RHA, 09/00→10/05	MVB700R4	4PK700
				☞	09/00→10/05, → Eng Nr 2533528	TB649	129x15
				☞ ☞ KIT	09/00→10/05, Eng Nr 2533529→	TB787	129x22
				☞	09/00→10/05, → Eng Nr 2533528	TBK277	
1.3 JTD		51	06/03 → 10/05	⊖	A/C(-)	MVB1180R6	6PK1180
				⊖	A/C(+)	MVB1306R6	6PK1306
1.9 D 60	188 A3.000	44	02/00 →	⊖	A/C(-), 09/00→10/03	MVB825R6	6PK825
				⊖	A/C(+), 04/02→10/03	MVB1200R6	6PK1200
				⊖ ☞	A/C(+), 09/00→04/02	MVB1230R6	6PK1230
				☞ ☞ KIT	09/00→10/03	TB608	193x24
				☞	09/00→10/03	TBK094	
1.9 JTD	188 A7.000	63	02/00 →	⊖	A/C(-), 09/01→10/05	MVB825R6	6PK825
				⊖	A/C(+), 04/02→10/05	MVB1200R6	6PK1200
				⊖	A/C(+), 09/01→04/02	MVB1230R6	6PK1230
				☞	09/01→10/05	TB639	190x24
				☞ ☞ KIT	09/01→10/05	TBK283	

REGATA (138)

60 Diesel 1.7	149 B3.000	44	05/85 → 03/89	⊖ ☞	09/86→10/88 09/86→10/88	SVB10888 TB349	10x888 141x25.4
	138 B6.000	43	09/83 → 12/86	⊖ ☞	06/84→08/86 06/84→08/86	SVB10825 TB150	10x825 138x25.4
65 Diesel 1.9	149 A1.000	48	04/84 → 07/89	⊖	A/C(-), MS, → Ch. 7056787, 7380450	SVB10875	10x875
				⊖	A/C(-), MS, Ch. 7056788, 7380451→	SVB10888	10x888
				⊖	A/C(+)	MVB1613R6	6PK1613
				⊖	PS	MVB836R5	5PK836
				☞	A/C(-), → Ch. 7056787,7380450	TB186	139x25.4
				☞	A/C(-), Ch. 7056788,7380451→	TB350	143x25.4
				☞	A/C(+)	TB351	126x25.4
				☞	A/C(+)	TB352	57x19
☞	A/C(-), Eng Nr 387355→	SVB10650	10x650				
☞	A/C(+)	SVB10775	10x775				



kW



...FIAT

...REGATA (138)

70 1.3	149 A3.000, 149 A7.000	48	09/83 → 07/89		→08/86	SVB10825	10x825
					A/C(+), →08/86	SVB10550	10x550
					A/C(-), MAN, →08/86, → Eng Nr 5771822	TB114	116x19
					A/C(+), →08/86	TB126	118x19
					A/C(+), →08/86	TB248	118x15
138 B2.000	50	09/83 → 07/86			SVB10825	10x825	
				A/C(+)	SVB10550	10x550	
				A/C(-), MAN, → Eng Nr 5771822	TB114	116x19	
				A/C(+)	TB126	118x19	
				A/C(+)	TB248	118x15	
75 1.5	138 B3.048, 138 C3.048	55	12/83 → 12/87		A/C(-), →08/86	SVB10825	10x825
					A/C(+), →08/86	SVB10550	10x550
					A/C(-), →08/86	TB126	118x19
					A/C(+), →08/86	TB248	118x15
					A/C(+), →08/86	SVB10690	10x690
80 Turbo Diesel 1.9	831 D1.000	59	05/86 → 07/89		09/86 →	MVB850R5	5PK850
					09/86 →	TB351	126x25.4
					09/86 →	TB352	57x19
					09/86 →	SVB10740	10x740
					A/C(-), 09/86 →, → Eng Nr 387354	SVB10775	10x775
					A/C(-), 09/86 →, Eng Nr 387355 →	SVB10650	10x650
85 1.5	149 A5.000	58	05/85 → 12/87		→08/86	SVB10825	10x825
					A/C(+), →08/86	SVB10550	10x550
					A/C(+), →08/86	TB126	118x19
					A/C(+), →08/86	TB248	118x15
					A/C(+), →08/86	SVB10690	10x690
85 1.6	149 A.000	60	10/83 → 06/90		Left, →08/85	SVB10775	10x775
					Right, →08/85	SVB10825	10x825
					→08/85, → Ch. 7409423	SVB10888	10x888
					→08/85, Ch. 7409424 →	SVB10960	10x960
					→08/85, → Eng Nr 1484418	TB118	123x19
					→08/85, Eng Nr 1484419 →	TB102	122x19
					→08/85, Eng Nr 1484419 →	TB246	110x18
					Left, →08/85	SVB10690	10x690
					Right, →08/85	SVB10813	10x813
85 Super 1.5	138 B3.000	60	09/83 → 04/85		A/C(-)	SVB10825	10x825
					A/C(+)	SVB10550	10x550
					A/C(+)	TB126	118x19
					A/C(+)	TB248	118x15
					A/C(+)	SVB10690	10x690
90 i.e. 1.6	149 C2.000	66	01/87 → 07/89		Left	SVB10775	10x775
					Right	SVB10825	10x825
					A/C(-), Right	SVB10940	10x940
					A/C(+), Right	SVB10913	10x913
					Left	SVB101050	10x1050
						TB249	138x18
					→ Eng Nr 1484418	TB112	144x19
					Eng Nr 1484419 →	TB200	143x19
					Left	SVB10690	10x690
	Right	SVB10813	10x813				

FIAT



kw



...FIAT

...REGATA (138)

FIAT

100 Super 1.6	149 A2.000, 149 A4.000	74	10/83 → 12/90	☼	Left, →06/89	SVB10775	10x775
				☼	Right, →06/89	SVB10825	10x825
				⊖	A/C(-), Right, →06/89	SVB10940	10x940
				⊖	A/C(+), Right, →06/89	SVB10913	10x913
				⊖	Left, →06/89	SVB101050	10x1050
				☼	→06/89	TB249	138x18
				☼	→06/89, → Eng Nr 1484418	TB112	144x19
				☼	Eng. 138AR000, →06/89,	TB200	143x19
				☼	Eng Nr 1484419→		
				⊖	Left, →06/89	SVB10690	10x690
				⊖	Right, →06/89	SVB10813	10x813
		70	10/83 → 07/89	☼	Left	SVB10775	10x775
				☼	Right	SVB10825	10x825
				⊖	A/C(-), Right	SVB10940	10x940
				⊖	A/C(+), Right	SVB10913	10x913
				⊖	Left	SVB101050	10x1050
				☼		TB249	138x18
				☼	→ Eng Nr 1484418	TB112	144x19
				☼	Eng Nr 1484419→	TB200	143x19
				⊖	Left	SVB10690	10x690
				⊖	Right	SVB10813	10x813

REGATA Weekend

60 Diesel 1.7	149 B3.000	44	01/84 → 12/89	⊖	09/86→06/89	SVB10888	10x888
				☼	09/86→06/89	TB349	141x25.4
65 Diesel 1.9	149 A1.000	48	04/84 → 07/89	⊖	A/C(-), MS, → Ch. 7056787,	SVB10875	10x875
					7380450		
				⊖	A/C(-), MS, Ch. 7056788,	SVB10888	10x888
					7380451→		
				⊖	A/C(+)	MVB1613R6	6PK1613
				⊖	PS	MVB836R5	5PK836
				☼	A/C(-), → Ch. 7056787,7380450	TB186	139x25.4
				☼	A/C(-), Ch. 7056788,7380451→	TB350	143x25.4
				☼	A/C(+)	TB351	126x25.4
				⊖	A/C(+)	TB352	57x19
				⊖	A/C(-), Eng Nr 387355→	SVB10650	10x650
				⊖	A/C(+)	SVB10775	10x775
70 1.3	138 B2.000	50	01/84 → 07/89	☼	→08/86	SVB10825	10x825
				⊖	A/C(+), →08/86	SVB10550	10x550
				☼	A/C(-), MAN, →08/86,	TB114	116x19
					→ Eng Nr 5771822		
				☼	A/C(+), →08/86	TB126	118x19
				☼	A/C(+), →08/86	TB248	118x15
				⊖	A/C(+), →08/86	SVB10690	10x690
75 1.5	138 B3.048, 138 C3.048	55	09/84 → 07/89	☼	→08/86	SVB10825	10x825
				⊖	A/C(+), →08/86	SVB10550	10x550
				☼	A/C(+), →08/86	TB126	118x19
				☼	A/C(+), →08/86	TB248	118x15
				⊖	A/C(+), →08/86	SVB10690	10x690
80 Turbo Diesel 1.9	831 D1.000	59	05/86 → 07/89	⊖	09/86→	MVB850R5	5PK850
				☼	09/86→	TB351	126x25.4
				⊖	09/86→	TB352	57x19
				⊖	09/86→	SVB10740	10x740
				⊖	A/C(-), 09/86→,	SVB10775	10x775
					→ Eng Nr 387354		
				⊖	A/C(-), 09/86→,	SVB10650	10x650
					Eng Nr 387355→		
85 1.5		60	01/84 → 04/89	☼	→08/86	SVB10825	10x825
				⊖	A/C(+), →08/86	SVB10550	10x550
				☼	A/C(+), →08/86	TB126	118x19
				☼	A/C(+), →08/86	TB248	118x15
				⊖	A/C(+), →08/86	SVB10690	10x690



kW



...FIAT

...REGATA Weekend

100 1.6 (RF)	149 A4.000	74	09/84 → 12/86	☼	Left	SVB10775	10x775
				☼	Right	SVB10825	10x825
				⌚	A/C(-), Right	SVB10940	10x940
				⌚	A/C(+), Right	SVB10913	10x913
				⌚	Left	SVB101050	10x1050
				🌀		TB249	138x18
				🌀	→ Eng Nr 1484418	TB112	144x19
				🌀	Eng Nr 1484419→	TB200	143x19
				⊕	Left	SVB10690	10x690
				⊕	Right	SVB10813	10x813
100 i.e. 1.6		74	01/87 → 12/90	☼	Left, →06/89	SVB10775	10x775
				☼	Right, →06/89	SVB10825	10x825
				⌚	A/C(-), Right, →06/89	SVB10940	10x940
				⌚	A/C(+), Right, →06/89	SVB10913	10x913
				⌚	Left, →06/89	SVB101050	10x1050
				🌀	→06/89	TB249	138x18
				🌀	→06/89, → Eng Nr 1484418	TB112	144x19
				🌀	→06/89, Eng Nr 1484419→	TB200	143x19
				⊕	Left, →06/89	SVB10690	10x690
				⊕	Right, →06/89	SVB10813	10x813

RITMO I (138A)

60 1.0	127 A6.000	44	09/78 → 09/82	⌚	→ Eng Nr 408850	SVB10825	10x825
				⌚	Eng Nr 408851→	SVB101000	10x1000
				🌀	→02/79	TB114	116x19
				🌀	02/79→	TB121	117x15
65 1.3	138 A1.000	48	01/78 → 09/82	⌚	A/C(-)	SVB10825	10x825
				🌀		TB114	116x19
70 1.3	149 A3.000, 149 A7.000	48	11/83 → 08/85	☼		SVB10825	10x825
				⌚	A/C(+)	SVB10550	10x550
				⌚		TB114	116x19
				⊕	A/C(+)	SVB10690	10x690
75 1.5	138 A2.000, 138 C3.048	55	01/78 → 10/82	☼	05/80→	SVB10825	10x825
				⌚	A/C(-), SPI, 05/80→	SVB10840	10x840
				⌚	A/C(+), 05/80→	SVB10550	10x550
				🌀	A/C(-), 05/80→	TB126	118x19
				🌀	A/C(+), 05/80→	TB248	118x15
				⊕	A/C(+), 05/80→	SVB10690	10x690
75 i.e. 1.5	138 C2.048, 149 C1.000	55	10/85 → 05/87	⌚	A/C(-), MPI	SVB10825	10x825
				⌚	A/C(-), SPI	SVB10840	10x840
				⌚	A/C(+)	SVB10550	10x550
				🌀	A/C(-)	TB126	118x19
				🌀	A/C(+)	TB248	118x15
				⊕	A/C(+)	SVB10690	10x690
85 1.5	138 A4.000	63	01/81 → 09/82	☼		SVB10825	10x825
				⌚	A/C(-), SPI	SVB10840	10x840
				⌚	A/C(+)	SVB10550	10x550
				🌀	A/C(-)	TB126	118x19
				🌀	A/C(+)	TB248	118x15
				⊕	A/C(+)	SVB10690	10x690
90 i.e. 1.6	149 C2.000	66	09/85 → 12/87	⌚	→ Ch. 4880207	SVB101050	10x1050
				⌚	Ch. 4880208→	SVB10940	10x940
				🌀	→ Eng Nr 1484451	TB112	144x19
				🌀	Ch. 4880208→	TB249	138x18
				🌀	Eng Nr 1484452→,	TB200	143x19
					→ Ch. 4880207		
105 Sport 1.6	138 AR.000	77	05/81 → 12/82	⌚		SVB10850	10x850
				⌚	Ch. 4880208→	SVB10940	10x940
				🌀	→ Eng Nr 1484451	TB112	144x19
				🌀	Ch. 4880208→	TB249	138x18
				🌀	Eng Nr 1484452→,	TB200	143x19
					→ Ch. 4880207		
125 TC Abarth 2.0	138 AR1.000	92	11/81 → 09/82	⌚		SVB10850	10x850
				🌀		TB122	148x19



kW



...FIAT

RITMO II (138A)

FIAT

60 1.1	138 B.000, 138 B1.000, 138 C1.000	40	10/82 → 10/85		A/C(-)	SVB10825	10x825	
					A/C(+)	SVB10550	10x550	
					A/C(+)	TB114	116x19	
					A/C(+)	SVB10690	10x690	
146 A4.048		43	04/85 → 12/87			SVB10825	10x825	
					A/C(+)	SVB10550	10x550	
					A/C(+)	TB114	116x19	
					A/C(+)	SVB10690	10x690	
60 Diesel 1.7	138 C.000, 149 B3.000	44	05/85 → 12/87			SVB10888	10x888	
						TB349	141x25.4	
	138 B6.000	43	10/82 → 10/85		03/83→04/85	SVB10825	10x825	
					03/83→04/85	TB150	138x25.4	
70 1.3	138 B2.000	50	01/83 → 04/85			SVB10825	10x825	
					A/C(+)	SVB10550	10x550	
					A/C(+)	TB114	116x19	
					A/C(+)	SVB10690	10x690	
75 1.5		55	09/85 → 12/88		→08/88	SVB10825	10x825	
					A/C(-), SPI, →08/88	SVB10840	10x840	
					A/C(+), →08/88	SVB10550	10x550	
					A/C(-), →08/88	TB126	118x19	
					A/C(+), →08/88	TB248	118x15	
					A/C(+), →08/88	SVB10690	10x690	
75 1.5 CAT	138 C2.048, 149 C1.000	55	09/85 → 12/88		→08/88	SVB10825	10x825	
					A/C(-), →08/88	SVB10840	10x840	
					A/C(+), →08/88	SVB10550	10x550	
					A/C(-), →08/88	TB126	118x19	
					A/C(+), →08/88	TB248	118x15	
					A/C(+), →08/88	SVB10690	10x690	
80 Turbo Diesel 1.9	831 D1.000	59	12/85 → 12/87			MVB850R5	5PK850	
						TB351	126x25.4	
						TB352	57x19	
						SVB10740	10x740	
85 1.5	138 B3.000	60	01/83 → 12/87			SVB10825	10x825	
					A/C(-), SPI	SVB10840	10x840	
					A/C(+)	SVB10550	10x550	
						A/C(-)	TB126	118x19
						A/C(+)	TB248	118x15
						A/C(+)	SVB10690	10x690
149 A5.000		58	08/85 → 05/87			SVB10825	10x825	
					A/C(-), SPI	SVB10840	10x840	
					A/C(+)	SVB10550	10x550	
					A/C(-)	TB126	118x19	
					A/C(+)	TB248	118x15	
					A/C(+)	SVB10690	10x690	
90 1.6 i.e.	138 AR.000	66	12/85 → 12/87		→ Ch. 4880207	SVB101050	10x1050	
					Ch. 4880208→	SVB10940	10x940	
					→ Eng Nr 1484451	TB112	144x19	
					Ch. 4880208→	TB249	138x18	
					Eng Nr 1484452→,	TB200	143x19	
					→ Ch. 4880207			
100 1.6		74	01/83 → 12/87		→ Ch. 4880207	SVB101050	10x1050	
					Ch. 4880208→	SVB10940	10x940	
					→ Eng Nr 1484451	TB112	144x19	
					Ch. 4880208→	TB249	138x18	
					Eng Nr 1484452→,	TB200	143x19	
					→ Ch. 4880207			



kW



...FIAT

...RITMO II (138A)

105 1.6	138 AR.000	77	01/83 → 12/87		→ Ch. 4880207	SVB101050	10x1050
					Ch. 4880208→	SVB10940	10x940
					→ Eng Nr 1484451	TB112	144x19
					Ch. 4880208→	TB249	138x18
					Eng Nr 1484452→,	TB200	143x19
					→ Ch. 4880207		
125 TC Abarth 2.0		92	12/82 → 12/87			SVB10850	10x850
						TB122	148x19
130 TC Abarth 2.0	138 AR2.000	96	04/83 → 12/87			SVB10850	10x850
						TB122	148x19

SCUDO

1.6 D Multijet		66	01/07 →		A/C(+)	MVB1708R6	6PK1708
						TB724	137x25.4
2.0 D Multijet	RHK	88	01/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
	RHR	100	01/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	

SCUDO Box

1.6 D Multijet		66	01/07 →		A/C(+)	MVB1708R6	6PK1708
						TB724	137x25.4
2.0 D Multijet	RHK	88	01/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
	RHR	100	01/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	

SCUDO Box (220L)

1.6	220 A 2.000	58	02/96 →		→08/00	MVB925R6	6PK925
					A/C(-), →08/00	MVB890R6	6PK890
					A/C(+), →08/00	MVB905R4	4PK905
					→08/00	TB305	138x15
					→08/00	TBK027	
					→08/00	SVB10690	10x690
1.9 D	D9B	51	02/96 →		A/C(-), MS, →08/98	MVB730R6	6PK730
					A/C(-), PS, →08/98	MVB1115R6	6PK1115
					A/C(+), MS, →08/98	MVB1165R6	6PK1165
					A/C(+), PS, →08/98	MVB1740R6	6PK1740
					→08/98	TB560	136x25.4
					→08/98	TBK020	
	WJZ (DW8)	51	04/98 →		A/C(-), MS, →08/01	MVB860R6	6PK860
					A/C(-), PS, →10/99,	MVB1388R6	6PK1388
					→ Ch. 8374		
					A/C(-), PS, 10/99→08/01,	MVB1440R6	6PK1440
					Ch. 8375→		
					A/C(+), MS, →08/01	MVB1045R6	6PK1045
					A/C(+), PS, →08/01	MVB1740R6	6PK1740
					→08/01	TB631	140x25.4
					→08/01	TBK105	



kW



...FIAT

...SCUDO Box (220L)

1.9 TD	D8B	68	02/98 →		A/C(-), MS, →08/00	MVB730R6	6PK730			
					A/C(-), PS, →08/00	MVB1105R6	6PK1105			
					A/C(-), PS, →08/00	MVB1115R6	6PK1115			
					A/C(+), MS, →08/00	MVB1165R6	6PK1165			
					A/C(+), PS, →08/00	MVB1740R6	6PK1740			
					→08/00	TB560	136x25.4			
					→08/00	TBK020				
				DHX (XUD9TF/L)	66	02/96 →		A/C(-), MS, →08/00	MVB730R6	6PK730
								A/C(-), PS, →08/00	MVB1105R6	6PK1105
								A/C(-), PS, →08/00	MVB1115R6	6PK1115
	A/C(+), MS, →08/00	MVB1165R6	6PK1165							
	A/C(+), PS, →08/00	MVB1740R6	6PK1740							
	→08/00	TB560	136x25.4							
2.0	RFN	100	09/02 →		A/C(-), →10/06	MVB1190R6	6PK1190			
					A/C(+), →10/06	MVB1708R6	6PK1708			
					→10/06	TB683	153x25.4			
					→10/06	TBK279				
2.0 JTD	RHX	69	12/99 →		A/C(-), →10/06	MVB1469R6	6PK1469			
					A/C(+), →06/01	MVB1740R6	6PK1740			
					→10/06	TB632	141x25.4			
					→04/00, → Ch. 8561	TBK106				
					04/00→10/06	TBK274				
				RHZ	80	12/02 →		A/C(-), →10/06	MVB1469R6	6PK1469
	A/C(+), →10/06	MVB1740R6	6PK1740							
	→10/06	TB720	114x25.4							

SCUDO Combinato (220P)

1.6	220 A 2.000	58	02/96 →		→08/00	MVB925R6	6PK925
					A/C(-), →08/00	MVB890R6	6PK890
					A/C(+), →08/00	MVB905R4	4PK905
					→08/00	TB305	138x15
					→08/00	TBK027	
					→08/00	SVB10690	10x690
1.9 D	D9B	51	02/96 → 04/98		A/C(-), MS	MVB730R6	6PK730
					A/C(-), PS	MVB1115R6	6PK1115
					A/C(+), MS	MVB1165R6	6PK1165
					A/C(+), PS	MVB1740R6	6PK1740
	WJZ (DW8)	51	04/98 →		A/C(-), 08/98→10/06	MVB1440R6	6PK1440
					A/C(+), 08/98→12/02, → Ch. 9520	MVB1740R6	6PK1740
					A/C(+), 12/02→10/06, Ch. 9521→	MVB1675R6	6PK1675
					08/98→10/06	TB631	140x25.4
1.9 TD	D8B	68	02/96 →		A/C(-), MS, →08/00	MVB730R6	6PK730
					A/C(-), PS, →08/00	MVB1105R6	6PK1105
					A/C(-), PS, →08/00	MVB1115R6	6PK1115
					A/C(+), MS, →08/00	MVB1165R6	6PK1165
1.9 TD Eco	DHX (XUD9TF/L)	66	02/96 →		A/C(-), PS, →08/00	MVB1740R6	6PK1740
					→08/00	TB560	136x25.4
					→08/00	TBK020	
					A/C(-), MS, →08/00	MVB730R6	6PK730
					A/C(-), PS, →08/00	MVB1105R6	6PK1105
					A/C(-), PS, →08/00	MVB1115R6	6PK1115
					A/C(+), MS, →08/00	MVB1165R6	6PK1165
					A/C(+), PS, →08/00	MVB1740R6	6PK1740
					→08/00	TB560	136x25.4
					→08/00	TBK020	



kW



...FIAT

...SCUDO Combinato (220P)

2.0 16V	RFN	100	06/00 →		A/C(-), →10/06	MVB1190R6	6PK1190
					A/C(+), →10/06	MVB1708R6	6PK1708
					→10/06	TB683	153x25.4
					→10/06	TBK279	
2.0 JTD	RHZ	80	12/99 →		A/C(-), →10/06	MVB1469R6	6PK1469
					A/C(+), →10/06	MVB1740R6	6PK1740
					→10/06	TB632	141x25.4
					09/00→10/06	TB720	114x25.4
					→04/00, → Ch. 8561	TBK106	
					04/00→10/06	TBK274	
		69	01/04 →		A/C(-), →10/06	MVB1469R6	6PK1469
					→10/06	TB632	141x25.4
					→10/06	TBK274	

SCUDO Flatbed / Chassis

1.6 D Multijet		66	01/07 →		A/C(+)	MVB1708R6	6PK1708
						TB724	137x25.4
2.0 D Multijet	RHK	88	01/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
	RHR	100	01/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	

SEDICI

1.6 16V	M16A	79	06/06 →			MVB810R4	4PK810
						MVB836R5	5PK836
1.9 D Multijet	D19AA	88	06/06 →			MVB1388R6	6PK1388
						TB639	190x24

SEICENTO (187)

0.9 (187AXA, 187AXA1A)	1170 A1.046	29	01/98 →		→02/00	SVB10800	10x800
1.1 (187AXB, 187AXB1A)	176 B2.000, 187 A1.000	40	01/98 →		→10/02	MVB775R4	4PK775
					A/C(-), 03/00→10/02	MVB663R4	4PK663
					Eng. 176B2000, A/C(-), →12/00	MVB673R4	4PK673
					Eng. 176B2000, A/C(+), →12/00	MVB545R4	4PK545
					→10/02	TB676	125x15
					→12/00, → Eng Nr 9042883	TB357	107x19
					Eng. 176B2000, →12/00,	TBK043	
					→ Eng Nr 9042883		
					Eng. 187A1000, →10/02,	TBK314	
					→ Eng Nr 2934169		

SEICENTO Van (187)

0.9 (187AXA)	1170 A1.046	29	01/98 →		→02/00	SVB10800	10x800
1.1 (187CXB/C)	176 B2.000	40	01/98 →		→10/02	MVB775R4	4PK775
					A/C(-), →12/00	MVB673R4	4PK673
					A/C(-), 03/00→10/02	MVB663R4	4PK663
					A/C(+), →12/00	MVB545R4	4PK545
					→10/02	TB676	125x15
					→12/00, → Eng Nr 9042883	TB357	107x19
					→10/02, → Eng Nr 2934169	TBK314	
					→12/00, → Eng Nr 9042883	TBK043	

SIENA (178_)

1.0		45	09/98 →		06/99→	MVB755R4	4PK755
					A/C(-), MS, 06/99→	MVB1105R6	6PK1105
					A/C(+), MS, 06/99→	MVB1125R6	6PK1125
					A/C(+), PS, 06/99→	MVB1388R6	6PK1388
					06/99→	TB798	131x17



kW



...FIAT

...SIENA (178_)

1.2	178 B5.000	54	09/98 →	☼	→10/03	MVB835R4	4PK835
				⊖	A/C(-)	MVB673R4	4PK673
				⊖	A/C(-), →10/03,	MVB663R4	4PK663
					Eng Nr 0714686→		
				⊕	A/C(+), →10/03	MVB700R4	4PK700
				⊕	A/C(+), 02/06→	MVB1188R5	5PK1188
					→10/03, → Eng Nr 9042883	TB660	108x15
					→10/03, Eng Nr 9042884→	TB649	129x15
					02/06→	TB637	124x22
					→10/03, → Eng Nr 9042883	TBK085	
					→10/03, Eng Nr 9042884→	TBK277	
					02/06→	TBK313	
	→10/03	MVB915R3	3PK915				
1.4	178 B2.000	51	04/96 →	☼	06/99→10/03	MVB835R4	4PK835
				☼	07/97→05/99	MVB855R4	4PK855
				⊖	07/97→10/03	MVB950R5	5PK950
					07/97→10/03	TB305	138x15
				⊕	07/97→10/03	SVB10690	10x690
1.4 CAT	178 B2.016	51	04/96 →	☼	06/99→10/03	MVB835R4	4PK835
				☼	07/97→05/99	MVB855R4	4PK855
				⊖	07/97→10/03	MVB950R5	5PK950
					07/97→10/03	TB305	138x15
				⊕	07/97→10/03	SVB10690	10x690
1.6 16V		78	09/98 →	☼		MVB855R4	4PK855
				⊖	→10/99	MVB950R5	5PK950
				⊖	10/99→	MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
				⊕		MVB668R3	3PK668

STILO (192)

1.2 16V (192_XA1B)	188 A5.000	59	02/02 →	⊖	A/C(-), →10/03	MVB673R4	4PK673
				⊖	A/C(+), →10/03	MVB1155R5	5PK1155
					→10/03	TB637	124x22
					→10/03	TBK313	
1.4 16V	843 A1.000	70	01/04 →	⊖	A/C(-)	MVB673R4	4PK673
				⊖	A/C(+)	MVB1148R5	5PK1148
						TB637	124x22
	192 B2.000	66	03/05 →	⊖	A/C(-), Cold climates (-)	MVB673R4	4PK673
				⊖	A/C(-), Cold climates (+)	MVB663R4	4PK663
				⊖	A/C(+)	MVB1148R5	5PK1148
		TB637	124x22				
		TBK313					
1.6 16V (192_XB1A)	182 B6.000	76	10/01 →	⊖		MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
1.8 16V (192_XC1A)	192 A4.000	98	10/01 →	⊖	→02/03	MVB1290R6	6PK1290
				⊖	03/03→	MVB1270R6	6PK1270
						TB559	166x24
						TBK345	
1.9 D Multijet	192 A8.000	88	09/05 →	⊖		MVB1250R6	6PK1250
						TB639	190x24
	937A5.000	110	09/05 →	⊖		TBK283	
						MVB1360R6	6PK1360
						TB790	199x24
						TBK306	



kW



...FIAT

...STILO (192)

1.9 JTD	192 A5.000	103	01/04 →	 KIT		MVB1360R6 TB725 TBK350	6PK1360 198x24
	937A4.000	93	09/03 →	 KIT		MVB1360R6 TB725 TBK350	6PK1360 198x24
	192 B1.000	100	04/04 →	 KIT		MVB1360R6 TB725 TBK350	6PK1360 198x24
1.9 JTD (192_XE1A)	192 A1.000, 937A7.000	85	10/01 →	 KIT KIT	A/C(-), →08/05 A/C(+), →10/05 A/C(+), 10/05→ →08/05, Eng Nr 4114650→ Eng. 937A7000	MVB825R6 MVB1270R6 MVB1250R6 TB639 TBK329 TBK283	6PK825 6PK1270 6PK1250 190x24
1.9 JTD (192_XF1A)	192 A3.000	59	02/02 →	 KIT KIT	A/C(-), →08/05 A/C(+), →08/05 →08/05 →08/05, → Eng Nr 4114649 →08/05, Eng Nr 4114650→	MVB825R6 MVB1270R6 TB639 TBK283 TBK329	6PK825 6PK1270 190x24
1.9 JTD (192AXS1B, 192BXS1B)	192 B5.000	66	09/04 →	 KIT	A/C(-), Ch. 066903→ A/C(+), → Ch. 066902 A/C(+), Ch. 066903→	MVB795R6 MVB1270R6 MVB1250R6 TB639 TBK283	6PK795 6PK1270 6PK1250 190x24
2.4 20V (192_XD1A)	192 A2.000	125	10/01 →	 KIT		MVB1150R6 TB468	6PK1150 168x24

STILO Multi Wagon (192)

1.4 16V	843 A1.000	70	01/04 →	 KIT	A/C(-) A/C(+)	MVB673R4 MVB1148R5 TB637 TBK313	4PK673 5PK1148 124x22
	192 B2.000	66	03/05 →	 KIT	A/C(-), Cold climates (-) A/C(-), Cold climates (+) A/C(+)	MVB673R4 MVB663R4 MVB1148R5 TB637 TBK313	4PK673 4PK663 5PK1148 124x22
1.6 16V	182 B6.000	76	01/03 →	 KIT		MVB938R5 TB471 TBK089	5PK938 158x25.4
1.8 16V	192 A4.000	98	01/03 →	 KIT	→02/03 02/03→	MVB1290R6 MVB1270R6 TB559 TBK345	6PK1290 6PK1270 166x24
1.9 D Multijet	192 A8.000	88	09/05 →	 KIT		MVB1250R6 TB639 TBK283	6PK1250 190x24
	937A5.000	110	09/05 →	 KIT		MVB1360R6 TB790 TBK306	6PK1360 199x24



kw



...FIAT

...STILO Multi Wagon (192)

1.9 JTD	192 A3.000	59	01/03 →		A/C(-), →08/05	MVB825R6	6PK825
					A/C(+), →08/05	MVB1270R6	6PK1270
					→08/05	TB639	190x24
					→08/05, → Eng Nr 4114649	TBK283	
					→08/05, Eng Nr 4114650→	TBK329	
192 A1.000, 937A7.000	85	01/03 →		A/C(-), →08/05	MVB825R6	6PK825	
				A/C(+)	MVB1270R6	6PK1270	
				A/C(+), 09/04→	MVB1250R6	6PK1250	
					TB639	190x24	
				→08/05, Eng Nr 4114650→	TBK329		
				Eng. 937A7000	TBK283		
192 A5.000	103	01/04 →			MVB1360R6	6PK1360	
					TB725	198x24	
					TBK350		
937A4.000	93	09/03 →			MVB1360R6	6PK1360	
					TB725	198x24	
					TBK350		
192 B1.000	100	04/04 →			MVB1360R6	6PK1360	
					TB725	198x24	
					TBK350		

STRADA (178E)

1.2	178 B5.000	54	06/99 →		02/00→05/01	MVB835R4	4PK835
					A/C(-), 02/00→05/01	MVB673R4	4PK673
					A/C(+), 02/00→05/01	MVB700R4	4PK700
					02/00→05/01,	TB660	108x15
					→ Eng Nr 9042883		
					02/00→05/01, Eng Nr 9042884→	TB649	129x15
					02/00→05/01,	TBK085	
					→ Eng Nr 9042883		
					02/00→05/01, Eng Nr 9042883→	TBK277	
					02/00→05/01	MVB915R3	3PK915
188 A4.000	44	04/03 →		→10/05	MVB835R4	4PK835	
				A/C(-), →10/05	MVB673R4	4PK673	
				A/C(+), →10/05	MVB1188R5	5PK1188	
				A/C(+), PS, →10/05	MVB700R4	4PK700	
				→10/05	TB649	129x15	
				→10/05	TBK277		
				→10/05	MVB915R3	3PK915	
1.3 D Multijet	223 A9.000	62	05/06 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.7 TD	176 A3.000	51	06/99 →		02/00→05/01	MVB905R4	4PK905
					02/00→05/01	MVB986R6	6PK986
					02/00→05/01	TB337	168x22
					02/00→05/01	TBK040	
					02/00→05/01	MVB720R3	3PK720
1.9 D	223 A6.000	46	12/00 →		A/C(-), 06/01→10/05	MVB1045R6	6PK1045
					A/C(+), 06/01→10/05	MVB1820R6	6PK1820
					06/01→10/05	TB608	193x24
					06/01→10/05,	TBK352	
					→ Eng Nr 3646771		
					06/01→10/05, Eng Nr 3646772→	TBK094	
1.9 JTD	188 A2.000	59	04/03 →		A/C(-), →08/05	MVB1088R6	6PK1088
					A/C(+), →08/05	MVB1855R6	6PK1855
					→08/05	TB639	190x24
					→08/05	TBK283	

TALENTO Box (290)

1.9 D (290UK)	149 B1.000	52	03/89 → 03/94		09/89→, → Eng Nr 0889988	SVB10913	10x913
					09/89→, Eng Nr 0889989→	MVB925R5	5PK925
					09/89→	TB286	170x25.4
2.0 (290U4)	170 B	55	03/89 → 03/94		09/89→	SVB10925	10x925
					09/89→	SVB10888	10x888



kW



...FIAT

TALENTO Bus (290)

1.9 D (290UEHK)	149 B1.000	52	03/89 → 03/94	 	09/89 →, → Eng Nr 0889988 09/89 →, Eng Nr 0889989 → 09/89 →	SVB10913 MVB925R5 TB286	10x913 5PK925 170x25.4
2.0 (290UEH4)	170 B	55	03/89 → 03/94	 	09/89 → 09/89 →	SVB10925 SVB10888	10x925 10x888

TALENTO Flatbed / Chassis (290)

1.9 D (290UAK, 290UTK)	149 B1.000	52	03/89 → 03/94	 	09/89 →, → Eng Nr 0889988 09/89 →, Eng Nr 0889989 → 09/89 →	SVB10913 MVB925R5 TB286	10x913 5PK925 170x25.4
2.0 (290UA4)	170 B	55	03/89 → 03/94	 	09/89 → 09/89 →	SVB10925 SVB10888	10x925 10x888

TEMPRA (159)

1.4 i.e. (159.AC)	159 A2.000	57	03/91 → 08/96	 	07/93 → 07/93 →, → Eng Nr 9336692 07/93 →, Eng Nr 9336693 → 07/93 → 07/93 →	SVB131050 MVB915R4 MVB940R4 TB305 TBK027	13x1050 4PK915 4PK940 138x15
1.4 i.e. (159.AC, 159.AX)	160 A1.046, 836 A4.000	51	03/92 → 08/96	 	A/C(-), MS, →06/93 A/C(-), PS, MAN A/C(+), MS A/C(+), PS, AUTO A/C(+), PS, MAN Eng. 160A1046, A/C(-) AUTO MAN, Eng Nr 8129260 →	SVB131050 SVB10865 MVB925R5 MVB960R4 MVB925R4 MVB960R5 MVB915R4 TB305 TBK027 SVB10740 SVB10690	13x1050 10x865 5PK925 4PK960 4PK925 5PK960 4PK915 138x15 10x740 10x690
1.6	159 A3.000	63	03/90 → 04/93	 	A/C(-), MS A/C(-), PS, AUTO A/C(-), PS, MAN A/C(+), MS A/C(+), PS, MAN Eng. 160A1046, A/C(-) MAN MAN, 05/91 →	SVB131050 SVB10865 MVB925R4 MVB925R5 MVB960R4 MVB960R5 TB305 TBK027 SVB10740 SVB10690	13x1050 10x865 4PK925 5PK925 4PK960 5PK960 138x15 10x740 10x690
1.6 i.e. (159.AE)	159 A3.046	57	06/90 → 07/92	 	A/C(-), MS A/C(-), PS, AUTO A/C(-), PS, MAN A/C(+), MS A/C(+), PS, MAN Eng. 160A1046, A/C(-) MAN MAN, 05/91 →	SVB131050 SVB10865 MVB925R4 MVB925R5 MVB960R4 MVB960R5 TB305 TBK027 SVB10740 SVB10690	13x1050 10x865 4PK925 5PK925 4PK960 5PK960 138x15 10x740 10x690

FIAT



kw



...FIAT

...TEMPRA (159)

FIAT

1.6 i.e. (159.AJ)	159 B9.000	66	06/94 → 08/96	⚙️		SVB131050	13x1050				
				⚙️	A/C(-), MS	SVB10865	10x865				
				⚙️	A/C(-), PS, AUTO	MVB925R4	4PK925				
				⚙️	A/C(-), PS, MAN	MVB925R5	5PK925				
				⚙️	A/C(+), MS	MVB960R4	4PK960				
				⚙️	A/C(+), PS, MAN	MVB960R5	5PK960				
				⚙️		TB305	138x15				
				⚙️		TBK027					
				⚙️	AUTO	SVB10740	10x740				
				⚙️	MAN	SVB10690	10x690				
				63	06/94 → 08/96	⚙️		SVB131050	13x1050		
						⚙️	A/C(-), MS	SVB10865	10x865		
						⚙️	A/C(-), PS, AUTO	MVB925R4	4PK925		
						⚙️	A/C(-), PS, MAN	MVB925R5	5PK925		
⚙️	A/C(+), MS	MVB960R4	4PK960								
⚙️	A/C(+), PS, MAN	MVB960R5	5PK960								
⚙️		TB305	138x15								
⚙️		TBK027									
⚙️	AUTO	SVB10740	10x740								
⚙️	MAN	SVB10690	10x690								
1.6 i.e. (159.AS, 159.AT)	159 A3.048, 835 C1.000	55	06/92 → 08/96			⚙️		SVB131050	13x1050		
						⚙️	A/C(-), MS	SVB10865	10x865		
						⚙️	A/C(-), PS, MAN	MVB925R5	5PK925		
						⚙️	A/C(+), MS	MVB960R4	4PK960		
				⚙️	A/C(+), PS, AUTO	MVB925R4	4PK925				
				⚙️	A/C(+), PS, MAN	MVB960R5	5PK960				
				⚙️		TB305	138x15				
				⚙️		TBK027					
				⚙️	AUTO	SVB10740	10x740				
				⚙️	MAN	SVB10690	10x690				
				1.8 i.e. (159.AN)	159 A4.046	77	03/92 → 08/96	⚙️	→12/92	MVB1015R5	5PK1015
								⚙️	01/93→	MVB1035R5	5PK1035
								⚙️		TB299	139x18
								⚙️		TB303	142x18
⚙️		TBK118									
⚙️	A/C(-)	SVB13850	13x850								
⚙️	A/C(-), 01/93→12/94	SVB13825	13x825								
⚙️	A/C(-), 01/94→	SVB13875	13x875								
⚙️	A/C(+), →12/92	SVB13710	13x710								
⚙️	A/C(+), 01/93→	SVB13750	13x750								
81	03/90 → 08/96	⚙️	→12/92					MVB1015R5	5PK1015		
		⚙️	01/93→					MVB1035R5	5PK1035		
		⚙️						TB299	139x18		
		⚙️						TB303	142x18		
		⚙️		TBK118							
		⚙️	A/C(-)	SVB13850	13x850						
		⚙️	A/C(-), 01/93→12/94	SVB13825	13x825						
		⚙️	A/C(-), 01/94→	SVB13875	13x875						
		⚙️	A/C(+), →12/92	SVB13710	13x710						
		⚙️	A/C(+), 01/93→	SVB13750	13x750						
		1.8 i.e. (159.AV)	835 C2.000	76	09/93 → 08/96	⚙️		SVB13850	13x850		
						⚙️	A/C(-)	MVB1015R5	5PK1015		
						⚙️	A/C(+)	MVB1035R5	5PK1035		
						⚙️		TB299	139x18		
⚙️						TB303	142x18				
⚙️						TBK118					
⚙️	A/C(-), →12/94					SVB13825	13x825				
⚙️	A/C(-), 01/94→					SVB13875	13x875				
⚙️	A/C(+)					SVB13750	13x750				



kW



...FIAT

...TEMPRA (159)

1.8 i.e. (159.AZ)	836 C4.000	66	09/93 → 08/96	⚙️		SVB13850	13x850
				⚙️	For OE 7646849	MVB1050R5	5PK1050
				⚙️	For OE 7695968	MVB1035R5	5PK1035
				🔧		TB303	142x18
				🔧KIT		TBK118	
				⚙️	A/C(-)	SVB13875	13x875
1.8 i.e. (159.BY)	836 A5.000	74	10/94 → 08/96	⚙️		SVB13850	13x850
				⚙️	For OE 7646849	MVB1050R5	5PK1050
				⚙️	For OE 7695968	MVB1035R5	5PK1035
				🔧		TB303	142x18
				🔧KIT		TBK118	
				⚙️	A/C(-)	SVB13875	13x875
1.9 D (159.AG)	160 A7.000	48	07/91 → 08/96	⚙️	→ Eng Nr 1904365	MVB985R5	5PK985
				⚙️	Eng Nr 1904366→	MVB938R5	5PK938
				⚙️	A/C(-), MS	SVB10950	10x950
				⚙️	A/C(-), PS	MVB915R5	5PK915
				🔧		TB307	173x22
				🔧KIT		TBK065	
1.9 TD (159.AQ)	160 B6.046	59	07/92 → 08/96	⚙️	→ Eng Nr 1249961	SVB10740	10x740
				⚙️	Eng Nr 1249962→	SVB10650	10x650
				⚙️	→ Eng Nr 1167624	MVB985R5	5PK985
				⚙️	Eng Nr 1167625→	MVB938R5	5PK938
				⚙️	A/C(-), → Eng Nr 1730139	MVB906R5	5PK906
				⚙️	A/C(-), Eng Nr 1730140→	MVB915R5	5PK915
1.9 TD (159.CU, 159.AU, 159.AI, 159.BI)	160 A6.000, 160 D1.000	66	05/90 → 08/96	⚙️	A/C(+), → Eng Nr 0953304	MVB960R5	5PK960
				⚙️	A/C(+), Eng Nr 0953305→	MVB970R5	5PK970
				🔧		TB307	173x22
				🔧KIT		TBK065	
				⚙️	→ Eng Nr 1071902	SVB10740	10x740
				⚙️	Eng Nr 1071903→	SVB10650	10x650
2.0 i.e. (159.AP)	159 A6.046	83	10/90 → 08/96	⚙️		SVB13850	13x850
				⚙️	A/C(-), →07/91	MVB1050R4	4PK1050
				⚙️	A/C(-), 08/91→	MVB1035R5	5PK1035
				⚙️	A/C(+), →07/91	MVB1050R4	4PK1050
				⚙️	A/C(+), 08/91→	MVB1050R5	5PK1050
				🔧		TB303	142x18
2.0 i.e. (159.AP)	159 A6.046	83	10/90 → 08/96	🔧		TBK118	
				🔧KIT		TB579	97x15
				⚙️	A/C(-), →12/94	SVB13825	13x825
				⚙️	A/C(-), 01/94→	SVB13875	13x875
				⚙️	A/C(+)	SVB13750	13x750

FIAT



kw



...FIAT

FIAT

TEMPRA S.W. (159)

Model	Price	Power (kw)	Year Range	Accessories	Options	Part Numbers	Dimensions
1.4 i.e. (159.AC)	159 A2.000	57	03/91 → 08/96	 	→06/93	SVB131050	13x1050
					A/C(-), MS, →06/93	SVB10865	10x865
					A/C(-), PS, MAN, →06/93	MVB925R5	5PK925
					A/C(+), MS, →06/93	MVB960R4	4PK960
					A/C(+), PS, AUTO, →06/93	MVB925R4	4PK925
					A/C(+), PS, MAN, →06/93	MVB960R5	5PK960
					→06/93	TB305	138x15
					→06/93	TBK027	
					AUTO, →06/93	SVB10740	10x740
					MAN, →06/93	SVB10690	10x690
1.4 i.e. (159.AC, 159.AX)	160 A1.046, 836 A4.000	51	10/92 → 08/96	 	07/93→	SVB131050	13x1050
					A/C(-), 07/93→,	MVB915R4	4PK915
					→ Eng Nr 9336692		
					A/C(-), 07/93→,	MVB940R4	4PK940
					Eng Nr 9336693→		
					A/C(-), PS, 07/93→,	MVB925R5	5PK925
					→ Eng Nr 9336692		
					A/C(-), PS, 07/93→,	MVB938R5	5PK938
					Eng Nr 9336693→		
					Eng. 836A4000, A/C(+), 07/93→	MVB960R5	5PK960
07/93→	TB305	138x15					
07/93→	TBK027						
07/93→	SVB10690	10x690					
1.6	159 A3.000	63	12/90 → 04/93	 	A/C(-), MS	SVB131050	13x1050
					A/C(-), PS, MAN	SVB10865	10x865
					A/C(+), MS	MVB925R5	5PK925
					A/C(+), PS, AUTO	MVB960R4	4PK960
					A/C(+), PS, MAN	MVB925R4	4PK925
						MVB960R5	5PK960
						TB305	138x15
						TBK027	
					MAN	SVB10740	10x740
					MAN, 05/91→	SVB10690	10x690
1.6 i.e. (159.AE)	159 A3.046, 835 C1.000	57	10/90 → 08/96	 	A/C(-), MS	SVB131050	13x1050
					A/C(-), PS, MAN	SVB10865	10x865
					A/C(+), MS	MVB925R5	5PK925
					A/C(+), PS, AUTO	MVB960R4	4PK960
					A/C(+), PS, MAN	MVB925R4	4PK925
						MVB960R5	5PK960
						TB305	138x15
						TBK027	
					MAN	SVB10740	10x740
					MAN, 05/91→	SVB10690	10x690
1.6 i.e. (159.AJ)	159 B9.000	66	06/94 → 08/96	 	A/C(-), MS	SVB131050	13x1050
					A/C(-), PS, MAN	SVB10865	10x865
					A/C(+), MS	MVB925R5	5PK925
					A/C(+), PS, AUTO	MVB960R4	4PK960
					A/C(+), PS, MAN	MVB925R4	4PK925
						MVB960R5	5PK960
						TB305	138x15
						TBK027	
					AUTO	SVB10740	10x740
					MAN	SVB10690	10x690





kW



...FIAT

...TEMPRA S.W. (159)

Engine	Power (kW)	Year Range	Accessories	Part Numbers	Dimensions		
1.6 i.e. (159.AS, 159.AT)	159 A3.048, 835 C1.000	55	10/92 → 08/96	⚙️	SVB131050	13x1050	
				⚙️	A/C(-), MS	SVB10865	10x865
				⚙️	A/C(-), PS, MAN	MVB925R5	5PK925
				⚙️	A/C(+), MS	MVB960R4	4PK960
				⚙️	A/C(+), PS, AUTO	MVB925R4	4PK925
				⚙️	A/C(+), PS, MAN	MVB960R5	5PK960
				🌀	TB305	138x15	
				🌀	TBK027		
				⊕	AUTO	SVB10740	10x740
				⊕	MAN	SVB10690	10x690
1.8 4x4	80	07/92 → 06/93	⚙️	MVB1015R5	5PK1015		
			⚙️	MVB1035R5	5PK1035		
			🌀	TB299	139x18		
			🌀	TB303	142x18		
			🌀	TBK118			
			⊕	A/C(-)	SVB13850	13x850	
			⊕	A/C(-), 01/93→	SVB13825	13x825	
			⊕	A/C(+), →12/92	SVB13710	13x710	
			⊕	A/C(+), 01/93→	SVB13750	13x750	
			1.8 i.e. (159.AN)	159 A4.046	77	03/92 → 12/93	⚙️
⚙️	MVB1035R5	5PK1035					
🌀	TB299	139x18					
🌀	TB303	142x18					
🌀	TBK118						
🌀	TB579	97x15					
⊕	A/C(-)	SVB13850					13x850
⊕	A/C(-), 01/93→	SVB13825					13x825
⊕	A/C(+), →12/92	SVB13710					13x710
⊕	A/C(+), 01/93→	SVB13750					13x750
1.8 i.e. (159.AV)	835 C2.000	76	09/93 → 08/96	⚙️	MVB1035R5	5PK1035	
				⚙️	MVB1015R5	5PK1015	
				🌀	TB303	142x18	
				🌀	TB299	139x18	
				🌀	TBK118		
				⊕	A/C(-), 01/93→12/94	SVB13825	13x825
				⊕	A/C(-), 01/94→	SVB13875	13x875
				⊕	A/C(-), 04/91→	SVB13850	13x850
				⊕	A/C(+), 01/93→	SVB13750	13x750
				⊕	A/C(+), 04/91→12/92	SVB13710	13x710
1.8 i.e. (159.AZ)	835 C4.000	66	09/93 → 08/96	⚙️	SVB13850	13x850	
				⚙️	For OE 7646849	MVB1050R5	5PK1050
				⚙️	For OE 7695968	MVB1035R5	5PK1035
				🌀	TB303	142x18	
				🌀	TBK118		
1.8 i.e. (159.BY)	836 A5.000	74	10/94 → 08/96	⚙️	SVB13850	13x850	
				⚙️	For OE 7646849	MVB1050R5	5PK1050
				⚙️	For OE 7695968	MVB1035R5	5PK1035
				🌀	TB303	142x18	
				🌀	TBK118		

FIAT



kW



FIAT

...FIAT

...TEMPRA S.W. (159)

1.9 D (159.AG)	160 A6.000	48	07/91 → 08/96	⊗		MVB985R5	5PK985
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	MVB915R5	5PK915
				⊗		TB307	173x22
				⊗		TBK065	
				⊗	→ Eng Nr 1249961	SVB10740	10x740
				⊗	Eng Nr 1249962→	SVB10650	10x650
1.9 TD (159.AI, 159.BI, 159.CU, 159.AU)	160 A6.000, 160 D1.000	66	07/91 → 02/95	⊗	→ Eng Nr 1167624	MVB985R5	5PK985
				⊗	Eng Nr 1167624→	MVB938R5	5PK938
				⊗	A/C(-), → Eng Nr 1730139	MVB906R5	5PK906
				⊗	A/C(-), Eng Nr 1730140→	MVB915R5	5PK915
				⊗	A/C(+), → Eng Nr 0953304	MVB960R5	5PK960
				⊗	A/C(+), Eng Nr 0953305→	MVB970R5	5PK970
				⊗		TB307	173x22
				⊗		TBK065	
				⊗	→ Eng Nr 1249961	SVB10740	10x740
				⊗	Eng Nr 1249962→	SVB10650	10x650
1.9 TD (159.AQ)	160 B6.046	59	03/92 → 06/93	⊗	→ Eng Nr 1167624	MVB985R5	5PK985
				⊗	Eng Nr 1167624→	MVB938R5	5PK938
				⊗	A/C(-), → Eng Nr 1730139	MVB906R5	5PK906
				⊗	A/C(-), Eng Nr 1730140→	MVB915R5	5PK915
				⊗	A/C(+), → Eng Nr 0953304	MVB960R5	5PK960
				⊗	A/C(+), Eng Nr 0953305→	MVB970R5	5PK970
				⊗		TB307	173x22
				⊗		TBK065	
				⊗	→ Eng Nr 1249961	SVB10740	10x740
				⊗	Eng Nr 1249962→	SVB10650	10x650
2.0 i.e. (159.AP)	159 A6.046	83	01/91 → 03/95	⊗		SVB13850	13x850
				⊗	A/C(-), →07/91	MVB1050R4	4PK1050
				⊗	A/C(-), 08/91→	MVB1035R5	5PK1035
				⊗	A/C(+), →07/91	MVB1050R4	4PK1050
				⊗	A/C(+), 08/91→	MVB1050R5	5PK1050
				⊗		TB303	142x18
				⊗		TBK118	
				⊗	A/C(-)	SVB13825	13x825
				⊗	A/C(+)	SVB13750	13x750
2.0 i.e. 4x4 (159.AP)	159 A6.046	83	03/92 → 03/95	⊗		SVB13850	13x850
				⊗	A/C(-)	MVB1035R5	5PK1035
				⊗	A/C(+)	MVB1050R5	5PK1050
				⊗		TB303	142x18
				⊗		TBK118	
				⊗	A/C(-)	SVB13825	13x825
				⊗	A/C(-), 01/95→	SVB13875	13x875

TIPO (160)

1.1 (160.AA)	160 A3.000	41	01/88 → 10/91	⊗		SVB131050	13x1050
				⊗	A/C(-)	SVB10675	10x675
				⊗	A/C(-), PS, MAN	MVB925R5	5PK925
				⊗	A/C(+), MS, → Eng Nr 6876503	MVB887R4	4PK887
				⊗	A/C(+), MS, Eng Nr 6876504→	MVB960R4	4PK960
				⊗	A/C(+), PS, AUTO	MVB925R4	4PK925
				⊗	A/C(+), PS, MAN	MVB960R5	5PK960
				⊗		TB129	104x15
				⊗		TBK006	
				⊗	A/C(-), AUTO	SVB10740	10x740
				⊗	A/C(-), MAN, Eng Nr 8127854→	SVB10690	10x690



kW



...FIAT

...TIPO (160)

Model	Part Number	kW	Year Range	Icon	Specs	Part Number	Dimensions
1.4 (160.AC)	160 A1.000, 160 A1.048	52	07/87 → 12/89	⚙️	03/88 →	SVB131050	13x1050
				⚙️	A/C(-), MS, 03/88 →, → Eng Nr 7131547	SVB10850	10x850
				⚙️	A/C(-), MS, 03/88 →, Eng Nr 7131548 →	SVB10865	10x865
				⚙️	A/C(-), PS, MAN, 03/88 →	MVB925R5	5PK925
				⚙️	A/C(+), MS, 03/88 →, → Eng Nr 8876503	MVB887R4	4PK887
				⚙️	A/C(+), MS, 03/88 →, Eng Nr 8876504 →	MVB960R4	4PK960
				⚙️	A/C(+), PS, AUTO, 03/88 →	MVB925R4	4PK925
				⚙️	A/C(+), PS, MAN, 03/88 →	MVB960R5	5PK960
				⚙️	03/88 →	TB305	138x15
				⚙️	03/88 →	TBK027	
1.4 i.e.		57	05/89 → 04/95	⚙️	AUTO, 03/88 →	SVB10740	10x740
				⚙️		SVB131050	13x1050
				⚙️	A/C(-), MS, → Eng Nr 7131547	SVB10850	10x850
				⚙️	A/C(-), MS, Eng Nr 7131548 →	SVB10865	10x865
				⚙️	A/C(-), PS, AUTO	MVB925R4	4PK925
				⚙️	A/C(-), PS, MAN	MVB925R5	5PK925
				⚙️	A/C(+), MS, → Eng Nr 8876503	MVB887R4	4PK887
				⚙️	A/C(+), MS, Eng Nr 8876504 →	MVB960R4	4PK960
				⚙️	A/C(+), PS, MAN	MVB960R5	5PK960
				⚙️		TB305	138x15
1.4 i.e. (160.AP, 160.AD, 160.EA)	160 A1.046, 836 A4.000	51	05/89 → 04/95	⚙️		TBK027	
				⚙️	AUTO, →09/93	SVB10740	10x740
				⚙️	AUTO, 05/91 →	SVB10690	10x690
				⚙️		SVB131050	13x1050
				⚙️	A/C(-), MS, Carb, → Eng Nr 7131547	SVB10850	10x850
				⚙️	A/C(-), MS, Carb, Eng Nr 7131548 →	SVB10865	10x865
				⚙️	A/C(-), MS, Inj, → Ch. 2125555	MVB915R3	3PK915
				⚙️	A/C(-), MS, Inj, Ch. 2125556 →	MVB915R4	4PK915
				⚙️	A/C(-), PS, MAN	MVB925R5	5PK925
				⚙️	A/C(+), MS, → Eng Nr 8876503	MVB887R4	4PK887
1.6 (160.AE)	160 A2.000	61	01/88 → 10/91	⚙️	A/C(+), MS, Eng Nr 8876504 →	MVB960R4	4PK960
				⚙️	A/C(+), PS, AUTO	MVB925R4	4PK925
				⚙️	A/C(+), PS, MAN	MVB960R5	5PK960
				⚙️		TB305	138x15
				⚙️		TBK027	
				⚙️	AUTO, →09/93	SVB10740	10x740
				⚙️	AUTO, 05/91 →	SVB10690	10x690
				⚙️		SVB131050	13x1050
				⚙️	A/C(-), MS, Carb, → Eng Nr 7131547	SVB10850	10x850
				⚙️	A/C(-), MS, Carb, Eng Nr 7131548 →	SVB10865	10x865
1.6 (160.AE)	160 A2.000	61	01/88 → 10/91	⚙️	A/C(-), MS, Inj, → Ch. 2125555	MVB915R3	3PK915
				⚙️	A/C(-), MS, Inj, Ch. 2125556 →	MVB915R4	4PK915
				⚙️	A/C(-), PS, AUTO	MVB925R4	4PK925
				⚙️	A/C(-), PS, MAN	MVB925R5	5PK925
				⚙️	A/C(+), MS, → Eng Nr 8876503	MVB887R4	4PK887
				⚙️	A/C(+), MS, Eng Nr 8876504 →	MVB960R4	4PK960
				⚙️	A/C(+), PS, AUTO	MVB925R4	4PK925
				⚙️	A/C(+), PS, MAN	MVB960R5	5PK960
				⚙️		TB305	138x15
				⚙️		TBK027	
⚙️	MAN	SVB10740	10x740				
⚙️	MAN, 04/91 →	SVB10690	10x690				

FIAT



kW



FIAT

...FIAT

...TIPO (160)

1.6 i.e.	149 C2.046	66	02/88 → 05/91	☼	→10/90	SVB13750	13x750
				⊗	→10/90	MVB906R5	5PK906
				⊗	→10/90	TB249	138x18
				⊗	→10/90	SVB13850	13x850
1.6 i.e. (160.A1, 160.EC, 160.EB)	159 A3.048, 835 C1.000	55	10/92 → 04/95	☼		SVB131050	13x1050
				⊗		MVB925R4	4PK925
				⊗	A/C(-), → Eng Nr 9336692	MVB925R5	5PK925
				⊗	A/C(-), Eng Nr 9336693→	MVB938R5	5PK938
				⊗	A/C(+)	MVB960R5	5PK960
				⊗		TB305	138x15
				⊗		TBK027	
				⊗	Eng Nr 8860209→	SVB10690	10x690
				⊗	Eng. 159A3048, →09/93,	SVB10740	10x740
				⊗	→ Eng Nr 8860208		
1.6 i.e. (160.AF)	159 A3.046	57	07/90 → 01/93	☼		SVB131050	13x1050
				⊗	A/C(-), MS, → Ch. 2125555	MVB915R3	3PK915
				⊗	A/C(-), MS, Ch. 2125556→	MVB915R4	4PK915
				⊗	A/C(-), PS, AUTO	MVB925R4	4PK925
				⊗	A/C(-), PS, MAN	MVB925R5	5PK925
				⊗	A/C(+), MS, → Eng Nr 8876503	MVB887R4	4PK887
				⊗	A/C(+), MS, Eng Nr 8876504→	MVB960R4	4PK960
				⊗	A/C(+), PS, MAN	MVB960R5	5PK960
				⊗		TB305	138x15
				⊗		TBK027	
				⊗	MAN	SVB10740	10x740
				1.7 D (160.AG)	149 B4.000	43	01/88 → 10/94
⊗	A/C(-), MS, 06/88→,	SVB10913	10x913				
	→ Eng Nr 0622598						
⊗	A/C(-), MS, 06/88→,	SVB10950	10x950				
	Eng Nr 0622599→						
⊗	A/C(-), PS, 06/88→	MVB915R5	5PK915				
⊗	06/88→	TB306	170x22				
45	01/88 → 10/95	⊗	06/88→			SVB10650	10x650
		⊗	A/C(-), MS, 06/88→,			SVB10913	10x913
			→ Eng Nr 0622598				
		⊗	A/C(-), MS, 06/88→,			SVB10950	10x950
			Eng Nr 0622599→				
		⊗	A/C(-), PS, 06/88→			MVB915R5	5PK915
		⊗	A/C(+), 06/88→			MVB985R5	5PK985
⊗	06/88→	TB306	170x22				
⊗	06/88→	SVB10650	10x650				
1.8 i.e	836 A5.000	71	03/93 → 04/95	☼		SVB13850	13x850
				⊗	A/C(-)	MVB1035R5	5PK1035
				⊗	A/C(+)	MVB1050R5	5PK1050
				⊗		TB303	142x18
				⊗		TBK118	
				⊗	A/C(-)	SVB13875	13x875
⊗	A/C(+)	SVB13750	13x750				



kW



...FIAT

...TIPO (160)

1.8 i.e.	835 C4.000	66	09/93 → 04/95	⚙️		SVB13850	13x850				
				⚙️	A/C(-)	MVB1035R5	5PK1035				
				⚙️	A/C(+)	MVB1050R5	5PK1050				
				🌀		TB303	142x18				
				🌀		TBK118					
				⚙️	A/C(-)	SVB13875	13x875				
				⚙️	A/C(+)	SVB13750	13x750				
				81	10/90 → 06/93	⚙️	→12/92	MVB1015R5	5PK1015		
				⚙️	A/C(-), 01/93→	MVB1035R5	5PK1035				
				⚙️	A/C(+), 01/93→	MVB1050R5	5PK1050				
1.8 i.e. (160.AM)	159 A4.000	74	10/94 → 04/95	🌀		SVB13850	13x850				
				⚙️	A/C(-)	MVB1035R5	5PK1035				
				⚙️	A/C(+)	MVB1050R5	5PK1050				
				🌀	→Eng.1066635	TB303	142x18				
				🌀	Eng.1066636→	TB299	139x18				
				🌀		TBK118					
				⚙️	A/C(-)	SVB13825	13x825				
				⚙️	A/C(+)	SVB13750	13x750				
				1.8 i.e. (160.AY)	159 A4.046	77	10/90 → 06/93	⚙️	→12/92	MVB1015R5	5PK1015
				⚙️	A/C(-), 01/93→	MVB1035R5	5PK1035				
⚙️	A/C(+), 01/93→	MVB1050R5	5PK1050								
🌀		TB299	139x18								
🌀		TB303	142x18								
🌀	01/93→	TBK118									
⚙️	A/C(-)	SVB13850	13x850								
⚙️	A/C(-), 01/93→	SVB13825	13x825								
⚙️	A/C(+), →12/92	SVB13710	13x710								
⚙️	A/C(+), 01/93→	SVB13750	13x750								
1.8 i.e. (160.ED)	835 C2.000	76	04/93 → 04/95	⚙️		SVB13850	13x850				
				⚙️	A/C(-)	MVB1035R5	5PK1035				
				⚙️	A/C(+)	MVB1050R5	5PK1050				
				🌀	→Eng.1066635	TB303	142x18				
				🌀	Eng.1066636→	TB299	139x18				
				🌀		TBK118					
				⚙️	A/C(-)	SVB13825	13x825				
				⚙️	A/C(+)	SVB13750	13x750				
				1.8 i.e.16V Sport	160 A5.000	100	11/89 → 06/92	⚙️	04/90→	SVB13850	13x850
				⚙️	04/90→	MVB1000R5	5PK1000				
🌀	04/90→, → Eng Nr 1066635	TB303	142x18								
🌀	04/90→, Eng Nr 1066636→	TB298	168x18								
⚙️	A/C(+), 04/90→	SVB13710	13x710								
1.9 D	160 A7.000	48	07/91 → 08/96	⚙️	11/92→09/95	MVB985R5	5PK985				
				⚙️	A/C(-), 11/92→09/95	MVB915R5	5PK915				
				🌀	11/92→09/95	TB307	173x22				
				🌀	11/92→09/95	TBK065					
				⚙️	11/92→09/95	SVB10650	10x650				

FIAT



kw



...FIAT

...TIPO (160)

FIAT

1.9 TD (160.AW)	160 B6.046	59	03/92 → 06/93	☼	→10/92, → Eng Nr 1167658	MVB985R5	5PK985				
				☼	→10/92, Eng Nr 1167659→	MVB938R5	5PK938				
				⊖	A/C(-), →10/92	MVB906R5	5PK906				
				⊖	A/C(+), →10/92,	MVB960R5	5PK960				
				⊖	→ Eng Nr 0953304						
				⊖	A/C(+), →10/92,	MVB970R5	5PK970				
				⊖	Eng Nr 0953305→						
				⊖	→10/92	TB307	173x22				
				⊖	→10/92	TBK065					
				⊖	→10/92, → Eng Nr 1249961	SVB10740	10x740				
1.9 TD (160.EL, 160.GL, 160.AQ, 160.EI, 160.AR)	160 A6.000, 160 A6.046, 160 D1.000	66	09/90 → 04/95	☼	→ Eng Nr 1167658	MVB985R5	5PK985				
				☼	Eng Nr 1167659→	MVB938R5	5PK938				
				⊖	A/C(-)	MVB906R5	5PK906				
				⊖	A/C(+), → Eng Nr 0953304	MVB960R5	5PK960				
				⊖	A/C(+), Eng Nr 0953305→	MVB970R5	5PK970				
				⊖		TB307	173x22				
				⊖		TBK065					
				⊖	→ Eng Nr 1249961	SVB10740	10x740				
				⊖	Eng Nr 1249962→	SVB10650	10x650				
				2.0 16V (160.AV)	160 A8.046	107	07/91 → 04/95	☼	11/91→	SVB13850	13x850
⊖	A/C(-), 11/91→	MVB1035R5	5PK1035								
⊖	A/C(+), 11/91→	MVB1050R5	5PK1050								
⊖	11/91→	TB474	173x18								
⊖	A/C(-), 11/91→	SVB13825	13x825								
⊖	A/C(+), 11/91→	SVB13750	13x750								
2.0 i.e. (160.AJ)	159 A5.046	80	06/90 → 03/92					☼		SVB13850	13x850
								⊖	A/C(-), →07/91	MVB1050R4	4PK1050
								⊖	A/C(-), MAN, 08/91→	MVB1035R5	5PK1035
								⊖	A/C(+), →07/91	MVB1050R4	4PK1050
				⊖	A/C(+), 08/91→	MVB1050R5	5PK1050				
				⊖		TB303	142x18				
				⊖		TBK118					
				⊖	A/C(-)	SVB13825	13x825				
				⊖	A/C(+)	SVB13750	13x750				
				2.0 i.e. (160.AT, 160.AJ)	159 A6.046	83	03/90 → 04/95	☼	→10/92	SVB13850	13x850
⊖	A/C(-), →07/91	MVB1050R4	4PK1050								
⊖	A/C(-), MAN, 08/91→10/92	MVB1035R5	5PK1035								
⊖	A/C(+), →07/91	MVB1050R4	4PK1050								
⊖	A/C(+), 08/91→10/92	MVB1050R5	5PK1050								
⊖	→10/92	TB303	142x18								
⊖	→10/92	TBK118									
⊖	A/C(-), →10/92	SVB13825	13x825								
⊖	A/C(+), →10/92	SVB13750	13x750								
2.0 i.e. 16V Sport (160.EF)	836 A3.000	102	03/93 → 04/95					☼		SVB13850	13x850
				⊖	A/C(-)	MVB1035R5	5PK1035				
				⊖	A/C(+)	MVB1050R5	5PK1050				
				⊖		TB474	173x18				
				⊖		TB579	97x15				
				⊖	A/C(-)	SVB13825	13x825				
				⊖	A/C(+)	SVB13750	13x750				

ULYSSE (179AX)

2.0	RFN(EW10J4)	100	08/02 →	⊖	A/C(-), →07/06	MVB1190R6	6PK1190
				⊖	A/C(+), →07/06	MVB1708R6	6PK1708
				⊖	→07/06	TB683	153x25.4
				⊖	→07/06	TBK279	
2.0 D Multijet	RHK	88	05/06 →	⊖		MVB1215R6	6PK1215
				⊖		TB742	116x25
				⊖		TBK338	
				⊖		MVB1215R6	6PK1215
	RHR	100	05/06 →	⊖		TB742	116x25
				⊖		TBK338	



kW



...FIAT

...ULYSSE (179AX)

2.0 JTD	RHW(DW10ATED4)	80	08/02 →		→07/06	MVB1740R6	6PK1740
					→07/06	TB720	114x25.4
	RHM(DW10ATED4)	79	05/03 →			MVB1740R6	6PK1740
						TB720	114x25.4
2.2 D Multijet		125	03/08 →			MVB1200R6	6PK1200
						TB810	118x25.4
2.2 JTD	4HW(DW12ATED4)	94	08/02 →		→07/06	MVB1740R6	6PK1740
					→07/06	TB678	146x25.4
					→04/04	TBK303	
					05/04→07/06	TBK355	
3.0 V6	XFW	150	08/02 →		→07/06	MVB1580R6	6PK1580
					→07/06	TB727	259x32

ULYSSE (220)

1.8 (220.BB5)	LFW	73	05/97 → 08/02		A/C(-), Alt. 70A, →08/00	MVB1065R6	6PK1065
					A/C(-), Alt. 80,9A, →08/00	MVB1080R6	6PK1080
					A/C(+), →08/00	MVB1660R6	6PK1660
					→08/00	TB419	114x17
					→08/00	TBK010	
1.9 TD (220AH5)	DHX (XUD9TF/L)	66	02/95 → 08/02		A/C(-), →06/95	MVB1115R6	6PK1115
					A/C(-), 06/95→08/00	MVB1105R6	6PK1105
					A/C(+), →08/00	MVB1740R6	6PK1740
					→08/00	TB560	136x25.4
					→08/00	TBK020	
2.0 (220.AC5)	RFU (XU10J2C)	89	06/94 → 08/02		A/C(-), Alt. 70A, →08/00	MVB1065R6	6PK1065
					A/C(-), Alt. 80,9A, →08/00	MVB1080R6	6PK1080
					A/C(+), →08/00	MVB1660R6	6PK1660
					→08/00	TB419	114x17
					→08/00	TBK010	
2.0 16V	RFV	97	05/98 → 09/00		A/C(-), 06/99→	MVB1190R6	6PK1190
					A/C(-), 09/98→	MVB1165R6	6PK1165
					A/C(+), 06/99→	MVB1708R6	6PK1708
					A/C(+), 09/98→	MVB1600R6	6PK1600
					06/99→	TB683	153x25.4
	RFN	100	09/00 → 08/02		09/98→	TB479	136x25.4
					06/99→	TBK279	
					09/98→	TBK113	
					A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1708R6	6PK1708
2.0 JTD	RHZ	80	10/99 → 08/02		A/C(-)	MVB1469R6	6PK1469
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1755R6	6PK1755
					→04/00	TB632	141x25.4
					09/00→	TB720	114x25.4
					→04/00	TBK106	
2.0 Turbo (220.AD5)	RGX (XU10J2CTE)	108	06/94 → 08/02		A/C(-), 02/97→08/00, Ch. 7393→	MVB1165R6	6PK1165
					A/C(-), Alt. 70A, →01/97, → Ch. 7392	MVB1065R6	6PK1065
					A/C(-), Alt. 80,9A, →01/97, → Ch. 7392	MVB1080R6	6PK1080
					A/C(+), →01/97, → Ch. 7392	MVB1660R6	6PK1660
					A/C(+), 02/97→08/00, Ch. 7393→	MVB1600R6	6PK1600
					→08/00	TB419	114x17
					→08/00	TBK010	
2.1 TD	P8C	80	03/96 → 10/99		A/C(-)	MVB1105R6	6PK1105
					A/C(+)	MVB1740R6	6PK1740
						TB320	149x25.4
						TBK035	

FIAT



kW



...FIAT

UNO (146A/E)

1.3 Super Diesel	127 A5.000, 146 B1.000	33	06/83 → 03/92		04/84 →	SVB101060	10x1060
					04/84 →	TB143	133x22
1.3 Turbo i.e.	146 A2.146	73	01/87 → 12/87			SVB10840	10x840
						TB126	118x19
				146 A2.000	77	04/85 → 08/89	
						TB126	118x19
	146 A2.246	74	09/89 → 03/91			SVB10840	10x840
						TB126	118x19
1.4 Turbo i.e.	146 A8.046	82	09/89 → 09/93			MVB905R4	4PK905
						TB305	138x15
						TBK027	
	146 A8.000	87	12/89 → 12/96		→12/94	MVB905R4	4PK905
					→12/94	TB305	138x15
					→12/94	TBK027	
1.9 D	149 B5.046	44	09/89 → 03/94		→07/93	SVB10913	10x913
					→07/93	TB306	170x22
45 0.9	146 A.000, 146 A.1000	33	03/83 → 09/92		02/84 →	SVB10800	10x800
45 1.0 (146A.ED)	156 A2.048, 156 A2.100	32	06/86 → 12/93		V-belt pulley (+)	SVB10675	10x675
					→ Eng Nr 9042883	TB129	104x15
					Eng Nr 9042884 →	TB676	125x15
					→ Eng Nr 9042883	TBK006	
		37	06/86 → 12/93		V-belt pulley (+)	SVB10675	10x675
					→ Eng Nr 9042883	TB129	104x15
					Eng Nr 9042884 →	TB676	125x15
					→ Eng Nr 9042883	TBK006	
45 i.e. 1.0	156 A2.246	33	04/84 → 10/95		11/94 →	MVB775R4	4PK775
					09/89 →	SVB101000	10x1000
					A/C(-)	SVB10675	10x675
					A/C(+), 11/94 →	MVB545R4	4PK545
					V-ribbed belt pulley (+),	MVB675R3	3PK675
					09/89 →		
					→ Eng Nr 9042883	TB129	104x15
					11/94 →, → Eng Nr 9042883	TB357	107x19
					Eng Nr 9042884 →	TB676	125x15
					→ Eng Nr 9042883	TBK006	
					11/94 →, → Eng Nr 9042883	TBK043	
					11/94 →, Eng Nr 9042884 →	TBK314	
50 1.1	146 A4.044	37	01/86 → 12/89		→12/88	SVB10825	10x825
					01/89 →	SVB10675	10x675
					→12/88	TB114	116x19
					01/89 →, → Eng Nr 9042883	TB129	104x15
					01/89 →, Eng Nr 9042884 →	TB676	125x15
					01/89 →, → Eng Nr 9042883	TBK006	
					01/89 →, Eng Nr 9042884 →	TBK314	
					10/90 →07/93,	TB129	104x15
					→ Eng Nr 9042883		
					10/90 →07/93, Eng Nr 9042884 →	TB676	125x15
					10/90 →07/93,	TBK006	
					→ Eng Nr 9042883		
					10/90 →07/93, Eng Nr 9042884 →	TBK314	
50 i.e. 1.1	146 C3.000	36	06/92 → 12/93		→07/93	SVB10675	10x675
					→07/93, → Eng Nr 9042883	TB129	104x15
					→07/93, Eng Nr 9042884 →	TB676	125x15
					→07/93, → Eng Nr 9042883	TBK006	
					→07/93, Eng Nr 9042884 →	TBK314	
55 1.1	138 B.000	40	01/83 → 08/89		12/83 →12/88	SVB10825	10x825
					12/83 →12/88	TB114	116x19



kW



FORD

...FIAT

...UNO (146A/E)

60 1.1	160 A3.000	42	04/89 → 12/92			SVB10675	10x675
					→ Eng Nr 9042883	TB129	104x15
					Eng Nr 9042884→	TB676	125x15
					→ Eng Nr 9042883	TBK006	
					Eng Nr 9042884→	TBK314	
60 1.1 (146A.EG)	146 A4.048	43	05/85 → 08/89			SVB10825	10x825
					06/89→	SVB101000	10x1000
						TB114	116x19
					06/89→	TB248	118x15
60 Diesel 1.7	149 B3.000	44	07/86 → 08/89		→12/88	SVB10888	10x888
					01/89→	SVB10913	10x913
						TB337	168x22
						TBK040	
	146 B2.000	42	09/89 → 12/93			SVB10913	10x913
						TB337	168x22
						TBK040	
70 1.3	149 A7.000	48	05/85 → 08/89		→12/88	SVB10825	10x825
					→12/88	TB114	116x19
	138 B2.000	50	01/83 → 04/85		02/84→	SVB10825	10x825
					02/84→	TB114	116x19
70 i.e. 1.4	160 A1.046	51	09/89 → 12/93		A/C(-)	SVB10865	10x865
					A/C(+)	MVB960R4	4PK960
						TB305	138x15
						TBK027	
		53	09/89 → 12/93		A/C(-)	SVB10865	10x865
					A/C(+)	MVB960R4	4PK960
						TB305	138x15
						TBK027	
70 S 1.4	160 A1.048	52	09/89 → 10/92		A/C(-), Inj	SVB10865	10x865
					A/C(+)	MVB960R4	4PK960
						TB305	138x15
						TBK027	
70 TD 1.4	146 B.000, 146 B3.000	52	10/86 → 10/90		01/89→	SVB10888	10x888
					01/89→	TB515	165x22
75 i.e. 1.5	138 C2.048, 149 C1.000	55	10/85 → 12/93		Eng. 146C2028	MVB887R5	5PK887
					A/C(-)	SVB10825	10x825
					Eng. 149C1000, A/C(+)	MVB960R4	4PK960
					→12/88	TB126	118x19
					01/89→	TB305	138x15
					01/89→	TBK027	

FORD

C-MAX

1.6		74	02/07 →			TB472	117x22
1.6 TDCi		66	02/07 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
		80	02/07 →		A/C(-), →08/07	MVB795R6	6PK795
					A/C(+), →08/07	MVB975R6	6PK975
					→08/07	TB724	137x25.4
1.8		92	02/07 →			MVB1306R6	6PK1306
1.8 Flexifuel		92	02/07 →			MVB1306R6	6PK1306
2.0		107	02/07 →			MVB1306R6	6PK1306
2.0 TDCi		100	02/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
		81	02/08 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	



kW



...FORD

COUGAR (EC_)

2.0 16V	EDBA, EDBB, EDBC, EDBD	96	08/98 → 12/01	⊗	A/C(-), →08/01	MVB1980R6	6PK1980
				⊗	A/C(+), AUTO, →08/01	MVB2100R6	6PK2100
				⊗	A/C(+), MAN, →08/01	MVB2120R6	6PK2120
				⊗	→08/01	TB633	129x25.4
				⊗	→01/99	TBK326	
2.5 ST 200	SGA	151	01/00 → 12/01	⊗	→09/00	MVB1820R6	6PK1820
				⊗	09/00 →08/01	MVB2080R6	6PK2080
				⊗	→08/01	MVB683R3	3PK683
2.5 V6 24V	LCBA	125	08/98 → 12/01	⊗	→09/00	MVB1820R6	6PK1820
				⊗	09/00 →08/01	MVB2080R6	6PK2080
				⊗	→08/01	MVB683R3	3PK683
	LCBB, LCBC, LCBE	125	06/00 → 12/01	⊗	→08/01	MVB2080R6	6PK2080
				⊗	→09/00	MVB1820R6	6PK1820
				⊗	→08/01	MVB683R3	3PK683
				⊗			

ECONOVAN (KBA, KCA)

1.4	UC	48	03/86 → 03/92	⊗	→10/91	SVB10825	10x825
2.0 D	RF	41	03/86 → 03/92	⊗	→10/91	SVB131125	13x1125
				⊗	→10/91	TB590	162x25.4

ECONOVAN Box (KAA)

1.4	UC	48	03/86 → 03/92	⊗	→10/91	SVB10825	10x825
2.0 D	RF	41	03/86 → 03/92	⊗	→10/91	SVB131125	13x1125
				⊗	→10/91	TB590	162x25.4

ESCORT '81 Express (AVA)

1.1	GLB	37	03/81 → 02/86	⊗		SVB10775	10x775
				⊗		TB239	92x19.8
1.3	JPA	51	03/81 → 02/86	⊗		SVB12795	12x795
				⊗		TB239	92x19.8
1.6		61	03/81 → 02/86	⊗		TB251	120x9
				⊗		SVB13850	13x850
				⊗	A/C(-)	SVB12760	12x760
				⊗	A/C(+)	SVB10625	10x625
				⊗		TB240	97x19.8
				⊗		TBK288	
1.6 D	LTA	40	02/84 → 02/86	⊗		SVB10840	10x840
				⊗		TB201	98x19.1
				⊗		TBK050	

ESCORT '86 Express (AVF)

1.1	GSG	37	05/86 → 07/90	⊗	→08/88	SVB10825	10x825
				⊗	08/88 →	SVB12795	12x795
1.3	JBA	46	07/88 → 07/90	⊗	→08/88	SVB10825	10x825
				⊗		SVB10825	10x825
1.4 i	F6B, F6D, FUC	54	02/86 → 07/90	⊗	09/86 →10/88	TB251	120x9
				⊗	10/88 →	TB252	122x9
				⊗	09/86 →12/88	SVB13850	13x850
				⊗	A/C(-), Carb, 09/86 →12/88	SVB12760	12x760
				⊗	A/C(-), Carb, 12/88 →	SVB12795	12x795
				⊗	A/C(-), Inj, 09/86 →	SVB12775	12x775
				⊗	A/C(+), 01/89 →	MVB915R6	6PK915
				⊗	A/C(+), 09/86 →12/88	SVB10625	10x625
				⊗	09/86 →	TB240	97x19.8
				⊗	09/86 →	TBK288	
1.6 D	LTA	40	02/86 → 07/90	⊗	→08/88	TB251	120x9
				⊗	→08/88	SVB10840	10x840
				⊗	→08/88	TB201	98x19.1
				⊗	→08/88	TBK050	



kW



...FORD

...ESCORT '86 Express (AVF)

1.8 D	RTA, RTB	44	07/88 → 07/90			TB252	122x9
						MVB648R3	3PK648
						TB237	116x20
					Eng. RTA	TBK011	
					Eng. RTA, inj. pump	TBK012	
						TB495	85x22

ESCORT '91 Express (AVL)

1.3	JBD	46	07/90 → 12/94		12/90 → 08/93	SVB12795	12x795
1.4	F6F, F6G	52	07/90 → 12/94		A/C(-), MS, →08/94	SVB10760	10x760
					A/C(-), PS, →08/94	MVB1420R6	6PK1420
					A/C(+), MS, →08/94	MVB1000R6	6PK1000
					A/C(+), PS, →08/94	MVB1635R6	6PK1635
					→04/92	TB240	97x19.8
					04/92 → 08/94	TB389	97x21.6
					→04/92	TBK288	
					04/92 → 08/94	TBK078	
1.8 D	RTH	44	07/90 → 12/94		A/C(-), MS, →05/91	MVB648R3	3PK648
					A/C(-), MS, 05/91 → 07/93	MVB675R3	3PK675
					A/C(-), MS, 07/93 → 08/94	MVB710R5	5PK710
					A/C(-), PS, →08/94	MVB1015R5	5PK1015
					→08/94	TB237	116x20
					→08/94	TBK011	
					→08/94, inj. pump	TBK012	
					→08/94	TB495	85x22
					A/C(+), →08/94	MVB648R4	4PK648

ESCORT '95 Box (AVL)

1.4	F4B	54	01/95 →		A/C(-), MS, →08/00	SVB10760	10x760
					A/C(-), PS, →01/96	MVB1420R6	6PK1420
					A/C(-), PS, 01/96 → 08/00	MVB1413R6	6PK1413
					A/C(+), MS, →04/00	MVB1015R6	6PK1015
					A/C(+), MS, →08/00	MVB1000R6	6PK1000
					A/C(+), PS, →04/00	MVB1650R6	6PK1650
					A/C(+), PS, →08/00	MVB1635R6	6PK1635
					→08/00	TB389	97x21.6
					→08/00	TBK078	
1.8 D	RTF, RTH	44	01/95 →		A/C(-), MS, →08/00	MVB710R5	5PK710
					A/C(-), PS, →08/00	MVB1015R5	5PK1015
					A/C(+), MS, 03/96 → 08/00	MVB1030R5	5PK1030
					→10/95	TB237	116x20
					10/95 → 08/00	TB496	116x22
					→10/95	TBK011	
					→10/95, inj. pump	TBK012	
					01/97 → 08/00	TBK121	
					10/95 → 08/00	TBK014	
					→08/00	TB495	85x22
					→08/00	MVB648R4	4PK648
1.8 Turbo D	RVA	51	12/95 → 06/01		A/C(-), MS	MVB710R5	5PK710
					A/C(+), MS	MVB1015R5	5PK1015
					A/C(+), PS	MVB1030R5	5PK1030
						TB496	116x22
					→09/96	TBK014	
					09/96 → 08/00	TBK121	
						TB495	85x22
						MVB648R4	4PK648



kW



...FORD

ESCORT CLASSIC (AAL, ABL)

1.6 16V	L1E	66	10/98 → 07/00	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
						TB390	131x25.4
					KIT	TBK120	
1.8 TD	RFD, RFK	66	10/98 → 07/00	⊗	Eng. F6B, A/C(-), MS	MVB710R5	5PK710
				⊗	Eng. F6B, A/C(-), PS	MVB1141R5	5PK1141
				⊗	Eng. F6B, A/C(+), PS	MVB1030R5	5PK1030
						TB496	116x22
					Eng. RFK	TBK121	
						TB495	85x22
					Eng. RFK	MVB648R4	4PK648

ESCORT CLASSIC Turnier (ANL)

1.6 16V	L1E	66	02/99 → 07/00	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
						TB390	131x25.4
					KIT	TBK120	
1.8 TD	RFD, RFK	66	02/99 → 07/00	⊗	Eng. F6B, A/C(-), MS	MVB710R5	5PK710
				⊗	Eng. F6B, A/C(-), PS	MVB1141R5	5PK1141
				⊗	Eng. F6B, A/C(+), PS	MVB1030R5	5PK1030
						TB496	116x22
					Eng. RFK	TBK121	
						TB495	85x22
					Eng. RFK	MVB648R4	4PK648

ESCORT III (GAA)

1.1	GSE	37	08/83 → 12/85	⊗		SVB12775	12x775
						TB239	92x19.8
	GLB, GMA	40	09/80 → 08/83	⊗		SVB12775	12x775
	GPA	43	09/80 → 08/83			TB239	92x19.8
				⊗		SVB12775	12x775
1.3	JPA	51	09/80 → 12/85	⊗		SVB12795	12x795
						TB239	92x19.8
1.6	LP1, LPA	58	09/80 → 12/85	⊗		SVB12795	12x795
						TB240	97x19.8
	LUA	71	09/80 → 10/82	⊗		SVB12795	12x795
						TB240	97x19.8
1.6 D	LTA	40	02/84 → 12/85	⊗		TB251	120x9
				⊗		SVB10840	10x840
						TB201	98x19.1
					KIT	TBK050	
1.6 i (GAA)	L4B	66	07/85 → 12/85	⊗		SVB12795	12x795
						TB240	97x19.8
						TBK288	
1.6 RS Turbo	LNA	97	11/84 → 12/85	⊗		SVB12785	12x785
						TB240	97x19.8
						TBK288	
1.6 XR3i	LR1, LRA	77	10/82 → 12/85	⊗	08/83 →	SVB12785	12x785
						TB240	97x19.8
						TBK288	
					06/83 →	TBK288	
RS 1600i		85	05/82 → 12/85	⊗	08/83 →	SVB12785	12x785
						TB240	97x19.8
						TBK288	
					06/83 →	TBK288	



kW



...FORD

ESCORT III Convertible (ALD)

1.3	JPA	51	09/83 → 12/85			SVB12795	12x795
						TB239	92x19.8
1.6	LP1, LPA	58	09/83 → 12/85			SVB12795	12x795
						TB240	97x19.8
						TBK288	
1.6 i	LR1, LRA	77	09/83 → 12/85			SVB12785	12x785
						TB240	97x19.8
						TBK288	

ESCORT III Estate (AWA)

1.1	GSE	37	08/83 → 12/85			SVB12775	12x775
						TB239	92x19.8
	GLB, GMA	40	09/80 → 08/83			SVB12775	12x775
						TB239	92x19.8
1.3	JPA	51	03/81 → 12/85			SVB12795	12x795
						TB239	92x19.8
1.6	LP1, LPA	58	09/80 → 12/85			TB251	120x9
						SVB13850	13x850
						SVB12795	12x795
					A/C(-)	SVB12760	12x760
					A/C(+)	SVB10625	10x625
						TB240	97x19.8
						TBK288	
1.6 D	LTA	40	02/84 → 12/85			TB251	120x9
						SVB10840	10x840
						TB201	98x19.1
						TBK050	

ESCORT IV (GAF, AWF, ABFT)

1.1	GSG	37	12/85 → 07/90		→08/88	SVB10825	10x825
					08/88→	SVB12795	12x795
1.3	JBB, JLA, JLB	44	01/86 → 07/90		→08/88	SVB10825	10x825
					08/88→	SVB12795	12x795
		51	11/86 → 07/88			SVB10825	10x825
1.3 (GAF)	JBA	46	07/88 → 10/90			SVB12795	12x795
					→08/88	SVB10825	10x825
1.4	F6B, F6D, FUC	54	01/86 → 07/90		→10/88	TB251	120x9
					10/88→	TB252	122x9
					→12/88	SVB13850	13x850
					A/C(-)	SVB12775	12x775
					A/C(+), 01/89→	MVB915R6	6PK915
					Eng. F6B, A/C(+), →12/88	SVB10625	10x625
						TB240	97x19.8
						TBK288	
	FUA	55	01/86 → 07/90		→10/88	TB251	120x9
					10/88→	TB252	122x9
					→12/88	SVB13850	13x850
					A/C(-), →12/88	SVB12760	12x760
					A/C(-), 12/88→	SVB12795	12x795
					A/C(+), →12/88	SVB10625	10x625
					A/C(+), 01/89→	MVB915R6	6PK915
						TB240	97x19.8
						TBK288	
	FUAA	51	10/85 → 10/90		03/86→10/88	TB251	120x9
					10/88→	TB252	122x9
					03/86→12/88	SVB13850	13x850
					A/C(-), 03/86→12/88	SVB12760	12x760
					A/C(-), 12/88→	SVB12795	12x795
					A/C(+), 01/89→	MVB915R6	6PK915
					A/C(+), 03/86→12/88	SVB10625	10x625
					03/86→	TB240	97x19.8
					03/86→	TBK288	

FORD



kW



...FORD

...ESCORT IV (GAF, AWF, ABFT)

FORD

1.6	LUG	65	04/89 → 07/90		A/C(-)	TB252	122x9
						A/C(+)	SVB12775
						MVB915R6	6PK915
						TB240	97x19.8
						TBK288	
	LP2	58	01/86 → 12/88		A/C(-)	TB252	122x9
						A/C(+)	SVB13850
						SVB12760	12x760
						SVB10625	10x625
						TB240	97x19.8
						TBK288	
1.6 D	LTC	40	01/86 → 01/89		→10/88	TB251	120x9
						10/88→	TB252
						SVB10840	10x840
						TB201	98x19.1
						TBK050	
1.6 i	L4B	66	01/86 → 05/90		→10/88	TB251	120x9
						10/88→	TB252
						SVB13850	13x850
						SVB12775	12x775
						SVB10625	10x625
						MVB915R6	6PK915
						TB240	97x19.8
						TBK288	
	LJB	75	08/89 → 07/90		A/C(-)	TB252	122x9
						A/C(+)	SVB12775
						MVB915R6	6PK915
						TB240	97x19.8
						TBK288	
1.6 Turbo RS	LNB	97	01/86 → 07/90		→10/88	TB251	120x9
						10/88→	TB252
						SVB13850	13x850
						SVB12775	12x775
						SVB10625	10x625
						MVB915R6	6PK915
						TB240	97x19.8
						TBK288	
1.6 XR3i	LR2, LRB	77	01/86 → 08/89		→10/88	TB251	120x9
						10/88→	TB252
						SVB13850	13x850
						SVB12775	12x775
						SVB10625	10x625
						MVB915R6	6PK915
						TB240	97x19.8
						TBK288	
1.8 D	RTA, RTB	44	01/89 → 07/90			TB252	122x9
							MVB648R3
						TB237	116x20
						TBK011	
					inj. pump	TBK012	
						TB495	85x22



kW



...FORD

ESCORT IV Convertible (ALF)

Power (kW)	Model	Power (kW)	Year Range	Accessories	Year Range	Part Number	Dimensions					
1.4	F6B, F6D, FUC	54	02/87 → 07/90	→10/88 10/88 → →12/88 A/C(-), Carb, 12/88 → A/C(-), Inj A/C(+), 01/89 → Eng. F6B, A/C(-), Carb, →12/88 Eng. F6B, A/C(+), →12/88 KIT		TB251	120x9					
						TB252	122x9					
						SVB13850	13x850					
						SVB12795	12x795					
						SVB12775	12x775					
						MVB915R6	6PK915					
						SVB12760	12x760					
						SVB10625	10x625					
						TB240	97x19.8					
						TBK288						
						55	FUA	01/86 → 07/90	→10/88 10/88 → →12/88 A/C(-), Carb, →12/88 A/C(-), Carb, 12/88 → A/C(-), Inj A/C(+), →12/88 A/C(+), 01/89 → KIT		TB251	120x9
											TB252	122x9
											SVB13850	13x850
											SVB12760	12x760
SVB12795	12x795											
SVB12775	12x775											
SVB10625	10x625											
MVB915R6	6PK915											
TB240	97x19.8											
TBK288												
66	L4B	01/86 → 07/90	→10/88 10/88 → →12/88 A/C(-) A/C(+), →12/88 A/C(+), 01/89 → KIT		TB251						120x9	
					TB252						122x9	
					SVB13850						13x850	
					SVB12775						12x775	
					SVB10625	10x625						
					MVB915R6	6PK915						
					TB240	97x19.8						
					TBK288							
					75	LJB	08/89 → 07/90	A/C(-) A/C(+) KIT		TB252	122x9	
										SVB12775	12x775	
										MVB915R6	6PK915	
										TB240	97x19.8	
										TBK288		
										77	LR2, LRB	01/86 → 07/90
TB252	122x9											
SVB13850	13x850											
SVB12775	12x775											
SVB10625	10x625											
MVB915R6	6PK915											
TB240	97x19.8											
TBK288												
ESCORT IV Estate (AWF, AVF)												
1.1	GSG	37	10/85 → 09/90	03/86 →08/88 08/88 →		SVB10825	10x825					
						SVB12795	12x795					
1.3	JBB, JLA, JLB	44	01/86 → 07/90	08/88 →		SVB10825	10x825					
						SVB12795	12x795					
		51	11/86 → 07/88			SVB10825	10x825					

FORD



kW



...FORD

...ESCORT IV Estate (AWF, AVF)

FORD

1.4	F6B, F6D, FUC	54	01/86 → 07/90		→10/88	TB251	120x9		
					10/88→	TB252	122x9		
					→12/88	SVB13850	13x850		
					A/C(-)	SVB12775	12x775		
					A/C(+), →12/88	SVB10625	10x625		
					A/C(+), 01/89→	MVB915R6	6PK915		
						TB240	97x19.8		
						TBK288			
								TB251	120x9
								TB252	122x9
				SVB13850	13x850				
				SVB12760	12x760				
				SVB12795	12x795				
				SVB10625	10x625				
				MVB915R6	6PK915				
				TB240	97x19.8				
				TBK288					
1.4	FUA	55	01/86 → 07/90		→10/88	TB251	120x9		
					10/88→	TB252	122x9		
					→12/88	SVB13850	13x850		
					A/C(-), →12/88	SVB12760	12x760		
					A/C(-), 12/88→	SVB12795	12x795		
					A/C(+), →12/88	SVB10625	10x625		
					A/C(+), 01/89→	MVB915R6	6PK915		
						TB240	97x19.8		
						TBK288			
								TB251	120x9
				TB252	122x9				
				SVB13850	13x850				
				SVB10760	10x760				
				SVB10800	10x800				
				SVB12760	12x760				
				SVB12795	12x795				
				MVB915R6	6PK915				
				SVB10625	10x625				
				TB240	97x19.8				
				TBK288					
1.6	LP2	58	01/86 → 07/90		→10/88	TB251	120x9		
					10/88→	TB252	122x9		
					→12/88	SVB13850	13x850		
					A/C(-), →12/88	SVB12760	12x760		
					A/C(-), 12/88→	SVB12795	12x795		
					A/C(+), →12/88	SVB10625	10x625		
					A/C(+), 01/89→	MVB915R6	6PK915		
						TB240	97x19.8		
						TBK288			
								TB251	120x9
				TB252	122x9				
				SVB13850	13x850				
				SVB10760	10x760				
				SVB10800	10x800				
				SVB12760	12x760				
				SVB12795	12x795				
				MVB915R6	6PK915				
				SVB10625	10x625				
				TB240	97x19.8				
				TBK288					
1.6 D	LTC	40	01/86 → 01/89			TB251	120x9		
					10/88→	TB252	122x9		
						SVB10840	10x840		
						TB201	98x19.1		
						TBK050			
								TB251	120x9
								TB252	122x9
								SVB13850	13x850
								SVB12785	12x785
								SVB12775	12x775
				SVB10625	10x625				
				MVB915R6	6PK915				
				TB240	97x19.8				
				TBK288					
1.8 D	RTA, RTB	44	01/89 → 07/90			TB252	122x9		
						MVB648R3	3PK648		
						TB237	116x20		
						TBK011			
						TBK012			
					inj. pump	TB495	85x22		



kW



...FORD

ESCORT V (GAL)

1.3	J4B, J6A	44	07/90 → 09/92			SVB12795	12x795
1.4	F6F, F6G	52	07/90 → 09/92		A/C(-), MS	SVB10760	10x760
					A/C(-), PS	MVB1420R6	6PK1420
					A/C(+), MS	MVB1000R6	6PK1000
					A/C(+), PS	MVB1635R6	6PK1635
					→04/92	TB240	97x19.8
					04/92→	TB389	97x21.6
					→04/92	TBK288	
					04/92→	TBK078	
1.6	LJF	77	07/90 → 12/92		A/C(-), MS	SVB10760	10x760
					A/C(-), PS	MVB1420R6	6PK1420
					A/C(+), MS	MVB1000R6	6PK1000
					A/C(+), PS	MVB1635R6	6PK1635
					→04/92	TB240	97x19.8
					04/92→	TB389	97x21.6
					→04/92	TBK288	
					04/92→	TBK078	
	LUJ, LUK	66	07/90 → 08/92		A/C(-), MS	SVB10760	10x760
					A/C(-), PS	MVB1420R6	6PK1420
					A/C(+), MS	MVB1000R6	6PK1000
					A/C(+), PS	MVB1635R6	6PK1635
					→04/92	TB240	97x19.8
					04/92→	TB389	97x21.6
					→04/92	TBK288	
					04/92→	TBK078	
1.8 16V XR3i	RDA	77	02/92 → 12/92		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1820R6	6PK1820
					A/C(-), PS, AUTO	MVB1650R6	6PK1650
					A/C(+), MS	MVB1538R6	6PK1538
					A/C(+), PS	MVB1904R6	6PK1904
						TB390	131x25.4
					check kit comp.	TBK079	
					check kit comp.	TBK120	
	RQB	96	02/92 → 12/92		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1820R6	6PK1820
					A/C(-), PS, AUTO	MVB1650R6	6PK1650
					A/C(+), MS	MVB1538R6	6PK1538
					A/C(+), PS	MVB1904R6	6PK1904
						TB390	131x25.4
					check kit comp.	TBK079	
					check kit comp.	TBK120	
1.8 D	RTE, RTF, RTH	44	07/90 → 12/92		A/C(-), MS	MVB710R5	5PK710
					A/C(-), MS, →08/91	MVB648R3	3PK648
					A/C(-), MS, 08/91→	MVB675R3	3PK675
					A/C(-), PS	MVB1015R5	5PK1015
					A/C(+), PS	MVB1030R5	5PK1030
						TB237	116x20
						TBK011	
					inj. pump	TBK012	
						TB495	85x22
						MVB648R4	4PK648
RS 2000	N7A	110	05/91 → 12/92		A/C(-)	MVB1352R6	6PK1352
					A/C(+)	MVB1650R6	6PK1650



kW



...FORD

ESCORT V Convertible (ALL)

1.4	F6F, F6G	52	07/90 → 12/92	⊗	A/C(-), MS	SVB10760	10x760
				⊗	A/C(-), PS	MVB1420R6	6PK1420
				⊗	A/C(+), MS	MVB1000R6	6PK1000
				⊗	A/C(+), PS	MVB1635R6	6PK1635
				⊗	→04/92	TB240	97x19.8
				⊗	04/92→	TB389	97x21.6
				⊗	→04/92	TBK288	
				⊗	04/92→	TBK078	
				⊗	⊗		
				⊗	⊗		
1.6	LJF	77	07/90 → 12/92	⊗	A/C(-), MS	SVB10760	10x760
				⊗	A/C(-), PS	MVB1420R6	6PK1420
				⊗	A/C(+), MS	MVB1000R6	6PK1000
				⊗	A/C(+), PS	MVB1635R6	6PK1635
				⊗	→04/92	TB240	97x19.8
				⊗	04/92→	TB389	97x21.6
				⊗	→04/92	TBK288	
				⊗	04/92→	TBK078	
				⊗	⊗		
				⊗	⊗		
1.8 16V XR3i	RDA	77	02/92 → 12/92	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1820R6	6PK1820
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(+), MS	MVB1538R6	6PK1538
				⊗	A/C(+), PS	MVB1904R6	6PK1904
	⊗	⊗	check kit comp.	TB390	131x25.4		
	⊗	⊗	check kit comp.	TBK079			
	⊗	⊗	check kit comp.	TBK120			
	RQB	96	02/92 → 12/92	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1820R6	6PK1820
⊗				A/C(-), PS, AUTO	MVB1650R6	6PK1650	
⊗				A/C(+), MS	MVB1538R6	6PK1538	
⊗				A/C(+), PS	MVB1904R6	6PK1904	
⊗	⊗	check kit comp.	TB390	131x25.4			
⊗	⊗	check kit comp.	TBK079				
⊗	⊗	check kit comp.	TBK120				

ESCORT V Estate (GAL, AVL)

1.3	J4B, J6A	44	09/91 → 09/92	⊗		SVB12795	12x795
1.4	F6F, F6G	52	07/90 → 09/92	⊗	A/C(-), MS	SVB10760	10x760
				⊗	A/C(-), PS	MVB1420R6	6PK1420
				⊗	A/C(+), MS	MVB1000R6	6PK1000
				⊗	A/C(+), PS	MVB1635R6	6PK1635
				⊗	→04/92	TB240	97x19.8
				⊗	04/92→	TB389	97x21.6
				⊗	→04/92	TBK288	
				⊗	04/92→	TBK078	
				⊗	⊗		
				⊗	⊗		
1.6	LJF	77	07/90 → 09/92	⊗	A/C(-), MS	SVB10760	10x760
				⊗	A/C(-), PS	MVB1420R6	6PK1420
				⊗	A/C(+), MS	MVB1000R6	6PK1000
				⊗	A/C(+), PS	MVB1635R6	6PK1635
				⊗	→04/92	TB240	97x19.8
	⊗	04/92→	TB389	97x21.6			
	⊗	→04/92	TBK288				
	⊗	04/92→	TBK078				
	LUJ, LUK	66	07/90 → 08/92	⊗	A/C(-), MS	SVB10760	10x760
				⊗	A/C(-), PS	MVB1420R6	6PK1420
⊗				A/C(+), MS	MVB1000R6	6PK1000	
⊗				A/C(+), PS	MVB1635R6	6PK1635	
⊗				→04/92	TB240	97x19.8	
⊗	04/92→	TB389	97x21.6				
⊗	→04/92	TBK288					
⊗	04/92→	TBK078					



kW



...FORD

...ESCORT V Estate (GAL, AVL)

1.8 16V	RDA	77	02/92 → 12/92		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1820R6	6PK1820
					A/C(-), PS, AUTO	MVB1650R6	6PK1650
					A/C(+), MS	MVB1538R6	6PK1538
					A/C(+), PS	MVB1904R6	6PK1904
						TB390	131x25.4
1.8 D	RTE, RTF, RTH	44	07/90 → 12/92		A/C(-), MS	MVB710R5	5PK710
					A/C(-), MS, →08/91	MVB648R3	3PK648
					A/C(-), MS, 05/91→	MVB675R3	3PK675
					A/C(-), PS	MVB1015R5	5PK1015
					A/C(+), MS	MVB1030R5	5PK1030
						TB237	116x20
1.8 TD		55	05/91 → 12/92			MVB813R3	3PK813
						TB237	116x20
						TBK011	
						TBK012	
					inj. pump	TB495	85x22
						MVB648R4	4PK648
1.8 TD		55	05/91 → 12/92			MVB813R3	3PK813
						TB237	116x20
						TBK011	
						TBK012	
					inj. pump	TB495	85x22
						MVB825R3	3PK825
					MS	MVB1025R3	3PK1025
					PS	MVB1025R3	3PK1025

ESCORT VI (GAL)

1.3	J4B, J6A	44	09/92 → 01/95			SVB12795	12x795				
1.4	F6F, F6G	52	09/92 → 01/95		A/C(-), MS	SVB10760	10x760				
					A/C(-), PS	MVB1420R6	6PK1420				
					A/C(+), MS	MVB1000R6	6PK1000				
					A/C(+), PS	MVB1635R6	6PK1635				
						TB389	97x21.6				
						TBK078					
1.4	FUH	55	01/94 → 01/95		A/C(-), MS	SVB10760	10x760				
					A/C(-), PS	MVB1420R6	6PK1420				
					A/C(+), MS	MVB1000R6	6PK1000				
					A/C(+), PS	MVB1635R6	6PK1635				
						TB389	97x21.6				
						TBK078					
1.6 i 16V	L1E	66	09/92 → 01/95		A/C(-), MS	MVB915R6	6PK915				
					A/C(-), PS	MVB1650R6	6PK1650				
					A/C(-), PS, →06/93	MVB1820R6	6PK1820				
					A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675				
					A/C(+), MS, →08/93	MVB1538R6	6PK1538				
					A/C(+), MS, 08/93→	MVB1550R6	6PK1550				
					A/C(+), PS, →08/93	MVB1904R6	6PK1904				
					A/C(+), PS, 08/93→	MVB1920R6	6PK1920				
						TB390	131x25.4				
						TBK079					
					check kit comp.	TBK120					
				1.6 i 16V	L1H	65	01/94 → 01/95		A/C(-), MS	MVB915R6	6PK915
									A/C(-), PS	MVB1650R6	6PK1650
									A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
	A/C(+), MS	MVB1550R6	6PK1550								
	A/C(+), PS	MVB1920R6	6PK1920								
		TB390	131x25.4								
		TBK079									
	check kit comp.	TBK120									
	check kit comp.	TBK120									



kw



...FORD

...ESCORT VI (GAL)

FORD

1.8 16V XR3i	RQB	96	09/92 → 01/95	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1650R6	6PK1650
				⊗	A/C(-), PS, →06/93	MVB1820R6	6PK1820
				⊗	A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
				⊗	A/C(+), MS, →08/93	MVB1538R6	6PK1538
				⊗	A/C(+), MS, 08/93→	MVB1550R6	6PK1550
				⊗	A/C(+), PS, →08/93	MVB1904R6	6PK1904
				⊗	A/C(+), PS, 08/93→	MVB1920R6	6PK1920
						TB390	131x25.4
					check kit comp.	TBK079	
	check kit comp.	TBK120					
1.8 D	RTE, RTF, RTH	44	09/92 → 01/95	⊗	A/C(-), MS	MVB710R5	5PK710
				⊗	A/C(-), PS, →07/93	MVB675R3	3PK675
				⊗	A/C(-), PS	MVB1015R5	5PK1015
				⊗	A/C(+), PS	MVB1030R5	5PK1030
						TB237	116x20
						TBK011	
					inj. pump	TBK012	
						TB495	85x22
						MVB648R4	4PK648
1.8 i 16V	RDA	77	09/92 → 01/95	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1650R6	6PK1650
				⊗	A/C(-), PS, →06/93	MVB1820R6	6PK1820
				⊗	A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
				⊗	A/C(+), MS, →08/93	MVB1538R6	6PK1538
				⊗	A/C(+), MS, 08/93→	MVB1550R6	6PK1550
				⊗	A/C(+), PS, →08/93	MVB1904R6	6PK1904
				⊗	A/C(+), PS, 08/93→	MVB1920R6	6PK1920
						TB390	131x25.4
					check kit comp.	TBK079	
	check kit comp.	TBK120					
1.8 TD	RFD, RFK, RFS	66	02/93 → 01/95	⊗	06/93→	MVB1015R5	5PK1015
						TB237	116x20
						TBK011	
					06/93→, inj. pump	TBK012	
					06/93→	TB495	85x22
					06/93→	MVB648R4	4PK648
1.8 XR3i 16V 4x4	RDA	77	08/93 → 01/95	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
			TB390	131x25.4			
		check kit comp.	TBK079				
		check kit comp.	TBK120				
	RQB	96	08/93 → 01/95	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1650R6	6PK1650
⊗				A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675	
⊗				A/C(+), MS	MVB1550R6	6PK1550	
⊗				A/C(+), PS	MVB1920R6	6PK1920	
		TB390	131x25.4				
	check kit comp.	TBK079					
	check kit comp.	TBK120					
RS 2000	N7A	110	09/92 → 01/95	⊗	A/C(-)	MVB1352R6	6PK1352
				⊗	A/C(+)	MVB1650R6	6PK1650
RS 2000 4x4	N7A	110	08/93 → 01/95	⊗	A/C(-)	MVB1352R6	6PK1352
				⊗	A/C(+)	MVB1650R6	6PK1650
RS Cosworth 4x4	N5F	162	09/92 → 01/95	⊗		MVB985R4	4PK985
				⊗		MVB1413R6	6PK1413
						TB319	144x25.4



kW



...FORD

ESCORT VI Convertible (ALL)

1.4	F6F, F6G	52	12/92 → 04/94		A/C(-), MS	SVB10760	10x760
					A/C(-), PS	MVB1420R6	6PK1420
					A/C(+), MS	MVB1000R6	6PK1000
					A/C(+), PS	MVB1635R6	6PK1635
					TB389	97x21.6	
					KIT	TBK078	
1.4 i	F4B	55	07/93 → 01/95		A/C(-), MS	SVB10760	10x760
					A/C(-), PS	MVB1420R6	6PK1420
					A/C(+), MS	MVB1000R6	6PK1000
					A/C(+), PS	MVB1635R6	6PK1635
					TB389	97x21.6	
					KIT	TBK078	
1.6 16V XR3i	L1E	66	12/92 → 01/95		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1650R6	6PK1650
					A/C(-), PS, →06/93	MVB1820R6	6PK1820
					A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
					A/C(+), MS, →08/93	MVB1538R6	6PK1538
					A/C(+), MS, 08/93→	MVB1550R6	6PK1550
					A/C(+), PS, →08/93	MVB1904R6	6PK1904
					A/C(+), PS, 08/93→	MVB1920R6	6PK1920
					TB390	131x25.4	
					check kit comp.	TBK120	
1.6 i 16V	L1H	65	02/94 → 01/95		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1650R6	6PK1650
					A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
					A/C(+), MS	MVB1550R6	6PK1550
					A/C(+), PS	MVB1920R6	6PK1920
					TB390	131x25.4	
					KIT	TBK079	
					check kit comp.	TBK120	
1.8 16V XR3i	RQB	96	12/92 → 01/95		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1650R6	6PK1650
					A/C(-), PS, →06/93	MVB1820R6	6PK1820
					A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
					A/C(+), MS, →08/93	MVB1538R6	6PK1538
					A/C(+), MS, 08/93→	MVB1550R6	6PK1550
					A/C(+), PS, →08/93	MVB1904R6	6PK1904
					A/C(+), PS, 08/93→	MVB1920R6	6PK1920
					TB390	131x25.4	
					check kit comp.	TBK120	
RDA		77	12/92 → 01/95		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1650R6	6PK1650
					A/C(-), PS, →06/93	MVB1820R6	6PK1820
					A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
					A/C(+), MS, →08/93	MVB1538R6	6PK1538
					A/C(+), MS, 08/93→	MVB1550R6	6PK1550
					A/C(+), PS, →08/93	MVB1904R6	6PK1904
					A/C(+), PS, 08/93→	MVB1920R6	6PK1920
					TB390	131x25.4	
					check kit comp.	TBK120	



kw



...FORD

ESCORT VI Estate (GAL)

1.3	J4B, J6A	44	09/92 → 01/95			SVB12795	12x795
1.4	F4B	55	01/94 → 01/95		A/C(-), MS	SVB10760	10x760
					A/C(-), PS	MVB1420R6	6PK1420
					A/C(+), MS	MVB1000R6	6PK1000
					A/C(+), PS	MVB1635R6	6PK1635
						TB389	97x21.6
						TBK078	
	F6F, F6G	52	09/92 → 01/94		A/C(-), MS	SVB10760	10x760
					A/C(-), PS	MVB1420R6	6PK1420
					A/C(+), MS	MVB1000R6	6PK1000
					A/C(+), PS	MVB1635R6	6PK1635
						TB389	97x21.6
						TBK078	
1.6 i 16V	L1E	66	09/92 → 01/95		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1650R6	6PK1650
					A/C(-), PS, →06/93	MVB1820R6	6PK1820
					A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
					A/C(+), MS, →08/93	MVB1538R6	6PK1538
					A/C(+), MS, 08/93→	MVB1550R6	6PK1550
					A/C(+), PS, →08/93	MVB1904R6	6PK1904
					A/C(+), PS, 08/93→	MVB1920R6	6PK1920
						TB390	131x25.4
					check kit comp.	TBK079	
					check kit comp.	TBK120	
	L1H	65	01/94 → 01/95		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1650R6	6PK1650
					A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
					A/C(+), MS	MVB1550R6	6PK1550
					A/C(+), PS	MVB1920R6	6PK1920
						TB390	131x25.4
					check kit comp.	TBK079	
					check kit comp.	TBK120	
1.8 D	RTH	44	09/92 → 01/95		A/C(-), MS	MVB710R5	5PK710
					A/C(-), MS, →07/93	MVB675R3	3PK675
					A/C(-), PS	MVB1015R5	5PK1015
					A/C(+), MS	MVB1030R5	5PK1030
						TB237	116x20
						TBK011	
					inj. pump	TBK012	
						TB495	85x22
						MVB648R4	4PK648



kW



...FORD

...ESCORT VI Estate (GAL)

1.8 i 16V	RQB	96	02/93 → 01/95	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1650R6	6PK1650
				⊗	A/C(-), PS, →06/93	MVB1820R6	6PK1820
				⊗	A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
				⊗	A/C(+), MS, →08/93	MVB1538R6	6PK1538
				⊗	A/C(+), MS, 08/93→	MVB1550R6	6PK1550
				⊗	A/C(+), PS, →08/93	MVB1904R6	6PK1904
				⊗	A/C(+), PS, 08/93→	MVB1920R6	6PK1920
				⊗		TB390	131x25.4
				⊗		TBK079	
				⊗		TBK120	
				⊗	check kit comp.		
				⊗	check kit comp.		
				1.8 TD	RDA	77	01/93 → 01/95
⊗	A/C(-), PS	MVB1650R6	6PK1650				
⊗	A/C(-), PS, →06/93	MVB1820R6	6PK1820				
⊗	A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675				
⊗	A/C(+), MS, →08/93	MVB1538R6	6PK1538				
⊗	A/C(+), MS, 08/93→	MVB1550R6	6PK1550				
⊗	A/C(+), PS, →08/93	MVB1904R6	6PK1904				
⊗	A/C(+), PS, 08/93→	MVB1920R6	6PK1920				
⊗		TB390	131x25.4				
⊗		TBK079					
⊗		TBK120					
⊗	check kit comp.						
⊗	check kit comp.						
1.8 TD	RFD, RFK	66	02/93 → 01/95				
				⊗		TB237	116x20
				⊗		TBK011	
				⊗	inj. pump	TBK012	
				⊗		TB495	85x22
				⊗	06/93→	MVB648R4	4PK648
				⊗	Eng. RFK	MVB575R5	5PK575

ESCORT VI Saloon (GAL)

1.3	J4B, J6A	44	08/93 → 01/95	⊗		SVB12795	12x795
1.4	F4B	55	08/93 → 01/95	⊗	A/C(-), MS	SVB10760	10x760
				⊗	A/C(-), PS	MVB1420R6	6PK1420
				⊗	A/C(+), MS	MVB1000R6	6PK1000
				⊗	A/C(+), PS	MVB1635R6	6PK1635
				⊗		TB389	97x21.6
				⊗		TBK078	
				⊗		SVB10760	10x760
				⊗		MVB1420R6	6PK1420
				⊗		MVB1000R6	6PK1000
				⊗		MVB1635R6	6PK1635
1.4	F6F, F6G	52	08/93 → 04/94	⊗	A/C(-), MS	SVB10760	10x760
				⊗	A/C(-), PS	MVB1420R6	6PK1420
				⊗	A/C(+), MS	MVB1000R6	6PK1000
				⊗	A/C(+), PS	MVB1635R6	6PK1635
				⊗		TB389	97x21.6
				⊗		TBK078	
				⊗		SVB10760	10x760
				⊗		MVB1420R6	6PK1420
				⊗		MVB1000R6	6PK1000
				⊗		MVB1635R6	6PK1635
1.6 i 16V	L1H	65	01/94 → 01/95	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
				⊗		TB390	131x25.4
				⊗		TBK079	
				⊗		TBK120	
				⊗	check kit comp.		
				⊗	check kit comp.		
1.6 i 16V	L1E, L1K	66	08/93 → 01/95	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
				⊗		TB390	131x25.4
				⊗		TBK079	
				⊗		TBK120	
				⊗	check kit comp.		
				⊗	check kit comp.		



kw



...FORD

...ESCORT VI Saloon (GAL)

FORD

1.8 D	RTE, RTF, RTH	44	08/93 → 01/95	⊗	A/C(-), MS	MVB710R5	5PK710
				⊗	A/C(-), PS	MVB1015R5	5PK1015
				⊗	A/C(+), PS	MVB1030R5	5PK1030
				⊗		TB237	116x20
				⊗		TBK011	
				⊗	inj. pump	TBK012	
1.8 i 16V	RDA	77	08/93 → 01/95	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN, 07/94→	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
				⊗		TB390	131x25.4
1.8 TD	RFD, RFK	66	08/93 → 01/95	⊗		TBK079	
				⊗	check kit comp.	TBK120	
				⊗		MVB1015R5	5PK1015
				⊗		TB237	116x20
				⊗		TBK011	
				⊗	inj. pump	TBK012	
1.8 TD	RFD, RFK	66	08/93 → 01/95	⊗		TB495	85x22
				⊗		MVB648R4	4PK648

ESCORT VII (GAL, AAL, ABL)

1.3	J4B, J6A	44	01/95 → 10/98	⊗	→09/97	SVB12795	12x795
1.4	F4B	55	01/95 → 10/98	⊗	→09/96	MVB1420R6	6PK1420
				⊗	A/C(-), PS, 01/96→	MVB1413R6	6PK1413
				⊗	A/C(+), MS	MVB1015R6	6PK1015
				⊗	A/C(+), PS	MVB1650R6	6PK1650
				⊗		TB389	97x21.6
				⊗		TBK078	
1.6 16V	L1E	66	01/95 → 10/98	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
				⊗		TB390	131x25.4
1.6 16V 4x4	L1E	66	01/95 → 10/98	⊗		TBK120	
				⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
1.6 i 16V	L1H	65	01/95 → 08/95	⊗		TB390	131x25.4
				⊗		TBK120	
				⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
1.6 i 16V	L1H	65	01/95 → 08/95	⊗	A/C(+), PS	MVB1920R6	6PK1920
				⊗		TB390	131x25.4
				⊗		TBK120	



kW



...FORD

...ESCORT VII (GAL, AAL, ABL)

FORD

1.8 16V	RKC	85	01/95 → 10/98		A/C(-), MS	MVB915R6	6PK915			
					A/C(-), PS, AUTO	MVB1650R6	6PK1650			
					A/C(-), PS, MAN	MVB1675R6	6PK1675			
					A/C(+), MS	MVB1550R6	6PK1550			
					A/C(+), PS	MVB1920R6	6PK1920			
						TB390	131x25.4			
					check kit comp.	TBK079				
					check kit comp.	TBK120				
				RDA	77	01/95 → 08/95		A/C(-), MS	MVB915R6	6PK915
								A/C(-), PS, AUTO	MVB1650R6	6PK1650
	A/C(-), PS, MAN	MVB1675R6	6PK1675							
	A/C(+), MS	MVB1550R6	6PK1550							
	A/C(+), PS	MVB1920R6	6PK1920							
		TB390	131x25.4							
	check kit comp.	TBK079								
	check kit comp.	TBK120								
1.8 D	RTE, RTF, RTH	44	01/95 → 12/96					A/C(-), MS	MVB710R5	5PK710
								A/C(-), PS	MVB1015R5	5PK1015
					A/C(+), MS	MVB1030R5	5PK1030			
					→10/95	TB237	116x20			
					10/95 →	TB496	116x22			
					→10/95	TBK011				
					→10/95, inj. pump	TBK012				
					10/95 →	TBK014				
						TB495	85x22			
						MVB648R4	4PK648			
1.8 TD	RFD, RFK	66	01/95 → 10/98		A/C(-), PS, →01/97	MVB1015R5	5PK1015			
					Eng. RFK, A/C(-), MS	MVB710R5	5PK710			
					Eng. RFK, A/C(-), PS	MVB1141R5	5PK1141			
					Eng. RFK, A/C(+), PS	MVB1030R5	5PK1030			
					→10/95	TB237	116x20			
					10/95 →	TB496	116x22			
					→10/95, inj. pump	TBK012				
					Eng. RFK, →10/95	TBK011				
					Eng. RFK, 09/96 →, inj. pump	TBK121				
					Eng. RFK, 10/95 →09/96, inj. pump	TBK014				
		TB495	85x22							
	Eng. RFK	MVB648R4	4PK648							
1.8 Turbo D	RVA	51	12/95 → 10/98		A/C(-), MS	MVB710R5	5PK710			
					A/C(+), MS	MVB1015R5	5PK1015			
					A/C(+), PS	MVB1030R5	5PK1030			
						TB496	116x22			
					04/96 →09/96	TBK014				
					09/96 →	TBK121				
		TB495	85x22							
		MVB648R4	4PK648							
RS 2000	N7A	110	02/95 → 02/98		A/C(-)	MVB1352R6	6PK1352			
					A/C(+)	MVB1650R6	6PK1650			
RS 2000 4x4	N7A	110	02/95 → 10/98		A/C(-), →12/97	MVB1352R6	6PK1352			
					A/C(+), →12/97	MVB1650R6	6PK1650			
RS Cosworth 4x4	N5F	162	02/95 → 10/98		→10/96	MVB985R4	4PK985			
					→10/96	MVB1413R6	6PK1413			
					→10/96	TB319	144x25.4			

ESCORT VII Convertible (ALL)

1.4	F4B	55	02/95 → 08/98		→09/96	MVB1420R6	6PK1420
					A/C(-), PS, 01/96 →	MVB1413R6	6PK1413
					A/C(+), MS	MVB1015R6	6PK1015
					A/C(+), PS	MVB1650R6	6PK1650
						TB389	97x21.6
						TBK078	



kw



...FORD

...ESCORT VII Convertible (ALL)

FORD

1.6 16V XR3i	L1H	65	02/95 → 12/96	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
						TB390	131x25.4
						TBK120	
						MVB915R6	6PK915
						MVB1650R6	6PK1650
						MVB1675R6	6PK1675
1.6 16V XR3i	RKC	85	10/95 → 08/98	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
						TB390	131x25.4
						TBK079	
						TBK120	
						check kit comp.	
						check kit comp.	
1.8 TD	RQB	96	02/95 → 08/00	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
						TB390	131x25.4
						TBK079	
						TBK120	
						check kit comp.	
						check kit comp.	
1.8 TD	RDA	77	02/95 → 08/98	⊗	A/C(-), MS	MVB915R6	6PK915
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675
				⊗	A/C(+), MS	MVB1550R6	6PK1550
				⊗	A/C(+), PS	MVB1920R6	6PK1920
						TB390	131x25.4
						TBK079	
						TBK120	
						check kit comp.	
						check kit comp.	
1.8 TD	RFD, RFK	66	09/95 → 08/98	⊗	A/C(-), PS, →01/97	MVB1015R5	5PK1015
				⊗	Eng. RFK, A/C(-), MS	MVB710R5	5PK710
				⊗	Eng. RFK, A/C(-), PS	MVB1141R5	5PK1141
				⊗	Eng. RFK, A/C(+), PS	MVB1030R5	5PK1030
						TB237	116x20
						TB496	116x22
						TBK012	
						TBK011	
						TBK121	
						TBK014	
1.8 Turbo D	RVA	51	10/96 → 08/99	⊗	Eng. RFK	TB495	85x22
				⊗	Eng. RFK	MVB648R4	4PK648
				⊗	A/C(-), MS	MVB710R5	5PK710
				⊗	A/C(+), MS, →01/97	MVB1015R5	5PK1015
				⊗	A/C(+), PS	MVB1030R5	5PK1030
						TB496	116x22
						TBK014	
						TBK121	
						TB495	85x22
						MVB648R4	4PK648



kW



...FORD

ESCORT VII Estate (GAL, ANL)

Power (kW)	Model	Power (kW)	Year Range	Timing Belt	Notes	Part Number	Dimensions	
1.3	J4B, J6A	44	01/95 → 10/98		→08/97	SVB10825	10x825	
					→09/97	SVB12795	12x795	
1.4	F4B, FUH	55	01/95 → 02/99		→09/96	MVB1420R6	6PK1420	
					A/C(-), PS, 01/96→	MVB1413R6	6PK1413	
					Eng. F4B, A/C(+), MS	MVB1015R6	6PK1015	
					Eng. F4B, A/C(+), PS	MVB1650R6	6PK1650	
					 KIT	TB389	97x21.6	
1.6 16V	L1E	66	01/95 → 02/99		A/C(-), MS	MVB915R6	6PK915	
					A/C(-), PS, AUTO	MVB1650R6	6PK1650	
					A/C(-), PS, MAN	MVB1675R6	6PK1675	
					A/C(+), MS	MVB1550R6	6PK1550	
					A/C(+), PS	MVB1920R6	6PK1920	
					 KIT	check kit comp.	TB390	131x25.4
					 KIT	check kit comp.	TBK079	
 KIT		TBK120						
1.6 i 16V	L1H	65	01/95 → 08/95		A/C(-), MS	MVB915R6	6PK915	
					A/C(-), PS, AUTO	MVB1650R6	6PK1650	
					A/C(-), PS, MAN	MVB1675R6	6PK1675	
					A/C(+), MS	MVB1550R6	6PK1550	
					A/C(+), PS	MVB1920R6	6PK1920	
 KIT		TB390	131x25.4					
1.8 16V	RKC	85	01/95 → 02/99		A/C(-), MS	MVB915R6	6PK915	
					A/C(-), PS, AUTO	MVB1650R6	6PK1650	
					A/C(-), PS, MAN	MVB1675R6	6PK1675	
					A/C(+), MS	MVB1550R6	6PK1550	
					A/C(+), PS	MVB1920R6	6PK1920	
	 KIT	check kit comp.	TB390	131x25.4				
	 KIT	check kit comp.	TBK079					
	 KIT	check kit comp.	TBK120					
	RDA	77	01/95 → 08/95		A/C(-), MS	MVB915R6	6PK915	
					A/C(-), PS, AUTO	MVB1650R6	6PK1650	
A/C(-), PS, MAN					MVB1675R6	6PK1675		
A/C(+), MS					MVB1550R6	6PK1550		
A/C(+), PS					MVB1920R6	6PK1920		
 KIT	check kit comp.	TB390	131x25.4					
 KIT	check kit comp.	TBK079						
 KIT	check kit comp.	TBK120						
1.8 D	RTH	44	01/95 → 02/99		A/C(-), MS	MVB710R5	5PK710	
					A/C(-), PS	MVB1015R5	5PK1015	
					A/C(+), MS	MVB1030R5	5PK1030	
					→10/95	TB237	116x20	
					10/95→	TB496	116x22	
					→10/95	TBK011		
					→10/95, inj. pump	TBK012		
10/95→	TBK014							
 KIT		TB495	85x22					
 KIT		MVB648R4	4PK648					

FORD



kW



...FORD

...ESCORT VII Estate (GAL, ANL)

1.8 TD	RFD, RFK	66	01/95 → 02/99	⊗	A/C(-), PS, →01/97	MVB1015R5	5PK1015
				⊗	Eng. RFK, A/C(-), MS	MVB710R5	5PK710
				⊗	Eng. RFK, A/C(-), PS	MVB1141R5	5PK1141
				⊗	Eng. RFK, A/C(+), PS	MVB1030R5	5PK1030
					→10/95	TB237	116x20
					10/95→	TB496	116x22
					→10/95, inj. pump	TBK012	
					Eng. RFK, →10/95	TBK011	
					Eng. RFK, 09/96→, inj. pump	TBK121	
					Eng. RFK, 10/95→09/96, inj. pump	TBK014	
						TB495	85x22
					Eng. RFK	MVB648R4	4PK648
				1.8 Turbo D	RVA	51	12/95 → 02/99
⊗	A/C(+), MS, 04/96→01/97	MVB1015R5	5PK1015				
⊗	A/C(+), PS, 04/96→	MVB1030R5	5PK1030				
	04/96→	TB496	116x22				
	04/96→09/96	TBK014					
	09/96→	TBK121					
	04/96→	TB495	85x22				
	04/96→	MVB648R4	4PK648				

ESCORT VII Saloon (GAL, AFL)

1.3	J4B, J6A	44	01/95 → 02/99	⊗	→09/97	SVB12795	12x795				
				1.4	F4B, FUH	55	01/95 → 02/99	⊗	→09/96	MVB1420R6	6PK1420
								⊗	A/C(-), PS, 01/96→	MVB1413R6	6PK1413
								⊗	Eng. F4B, A/C(+), MS	MVB1015R6	6PK1015
								⊗	Eng. F4B, A/C(+), PS	MVB1650R6	6PK1650
		TB389	97x21.6								
		TBK078									
1.6 i 16V	L1E, L1K	66	01/95 → 02/99	⊗	A/C(-), MS	MVB915R6	6PK915				
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650				
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675				
				⊗	A/C(+), MS	MVB1550R6	6PK1550				
				⊗	A/C(+), PS	MVB1920R6	6PK1920				
			TB390	131x25.4							
			TBK120								
	L1H	65	01/95 → 08/95	⊗	A/C(-), MS	MVB915R6	6PK915				
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650				
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675				
⊗				A/C(+), MS	MVB1550R6	6PK1550					
⊗				A/C(+), PS	MVB1920R6	6PK1920					
		TB390	131x25.4								
		TBK120									
1.8 16V	RKC	85	01/95 → 02/99	⊗	A/C(-), MS	MVB915R6	6PK915				
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650				
				⊗	A/C(-), PS, MAN	MVB1675R6	6PK1675				
				⊗	A/C(+), MS	MVB1550R6	6PK1550				
				⊗	A/C(+), PS	MVB1920R6	6PK1920				
			TB390	131x25.4							
			TBK079								
			TBK120								
	RDA	77	01/95 → 08/95	⊗	A/C(-), MS	MVB915R6	6PK915				
				⊗	A/C(-), PS, AUTO	MVB1650R6	6PK1650				
⊗				A/C(-), PS, MAN	MVB1675R6	6PK1675					
⊗				A/C(+), MS	MVB1550R6	6PK1550					
⊗				A/C(+), PS	MVB1920R6	6PK1920					
		TB390	131x25.4								
		TBK079									
		TBK120									



kW



...FORD

...ESCORT VII Saloon (GAL, AFL)

1.8 D	RTE, RTF, RTH	44	01/95 → 12/96		A/C(-), MS	MVB710R5	5PK710
					A/C(-), PS	MVB1015R5	5PK1015
					A/C(+), MS	MVB1030R5	5PK1030
					→10/95	TB237	116x20
					10/95→	TB496	116x22
				KIT	→10/95	TBK011	
				KIT	→10/95, inj. pump	TBK012	
				KIT	10/95→	TBK014	
						TB495	85x22
						MVB648R4	4PK648
1.8 TD	RFD, RFK	66	01/95 → 10/98		A/C(-), PS, →01/97	MVB1015R5	5PK1015
					Eng. RFK, A/C(-), MS	MVB710R5	5PK710
					Eng. RFK, A/C(-), PS	MVB1141R5	5PK1141
					Eng. RFK, A/C(+), PS	MVB1030R5	5PK1030
					→10/95	TB237	116x20
					10/95→	TB496	116x22
				KIT	Eng. RFK, →10/95	TBK011	
				KIT	Eng. RFK, →10/95, inj. pump	TBK012	
				KIT	Eng. RFK, 09/96→, inj. pump	TBK121	
				KIT	Eng. RFK, 10/95→09/96, inj. pump	TBK014	
		TB495	85x22				
	Eng. RFK	MVB648R4	4PK648				
1.8 Turbo D	RVA	51	12/95 → 02/99		A/C(-), MS, 04/96→	MVB710R5	5PK710
					A/C(+), MS, 04/96→01/97	MVB1015R5	5PK1015
					A/C(+), PS, 04/96→	MVB1030R5	5PK1030
					04/96→	TB496	116x22
				KIT	04/96→09/96	TBK014	
				KIT	09/96→	TBK121	
					04/96→	TB495	85x22
					04/96→	MVB648R4	4PK648

FIESTA Box (F3L, F5L)

1.3	J6B	44	09/91 → 02/96		→08/95	MVB825R4	4PK825
					→08/95	SVB12795	12x795
					→08/95	MVB860R4	4PK860
1.8 D	RTC, RTD, RTG	44	09/91 → 02/96			TB252	122x9
					A/C(-), MS, →07/93	MVB675R3	3PK675
					A/C(-), MS, 07/93→	MVB710R5	5PK710
					A/C(+)	MVB1015R5	5PK1015
					→10/95	TB237	116x20
					10/95→	TB496	116x22
				KIT	→10/95	TBK011	
				KIT	→10/95, inj. pump	TBK012	
				KIT	10/95→	TBK014	
						TB495	85x22
	A/C(+)	MVB648R4	4PK648				

FIESTA Box (FVD)

1.0		33	08/83 → 11/89			SVB10825	10x825
1.4		52	09/86 → 09/89			SVB10675	10x675
						SVB10690	10x690
						TB240	97x19.8
1.6 D		40	09/83 → 09/89	KIT		TBK288	
						SVB10840	10x840
						TB201	98x19.1
				KIT		TBK050	



kw



...FORD

...FIESTA Box (FVD)

1.8 D (FVJ)	RTC, RTD, RTG	43	03/89 → 12/95		10/89 →	TB252	122x9
					A/C(-), MS, 05/91 → 07/93	MVB675R3	3PK675
					A/C(-), MS, 07/93 →	MVB710R5	5PK710
					A/C(-), MS, 10/89 → 05/91	MVB648R3	3PK648
					PS, 10/89 →	MVB1015R5	5PK1015
					10/89 →	TB237	116x20
					10/89 →	TBK011	
					10/89 →, inj. pump	TBK012	
					10/89 →	TB495	85x22
					A/C(+), 10/89 →	MVB648R4	4PK648

FIESTA Box (J5_, J3_)

1.3	J4C	44	02/96 →		A/C(-), MS, →01/98	MVB860R6	6PK860
					A/C(-), MS, 01/98 → 04/02	SVB10825	10x825
					A/C(-), PS, →01/98	MVB1740R6	6PK1740
					A/C(-), PS, 01/98 → 08/98	MVB1760R6	6PK1760
					A/C(-), PS, 01/98 → 08/98	MVB1768R6	6PK1768
					A/C(-), PS, 09/98 → 08/03	MVB1450R6	6PK1450
					A/C(+), MS, →08/03	MVB1440R6	6PK1440
					A/C(+), PS, →01/98	MVB1904R6	6PK1904
					A/C(+), PS, 01/98 → 08/03	MVB1930R6	6PK1930
1.4 i		66	04/96 → 10/99		A/C(-), MS	MVB1180R6	6PK1180
					A/C(-), PS, →01/99	MVB1755R6	6PK1755
					A/C(-), PS, 02/98 →	MVB1768R6	6PK1768
					A/C(+), MS	MVB1775R6	6PK1775
					A/C(+), PS	MVB1930R6	6PK1930
						TB472	117x22
					→02/97	TBK310	
					02/98 →	TBK276	
1.8 D	RTK	44	02/96 →		A/C(-), MS, →04/02	MVB887R5	5PK887
					A/C(+), PS, →04/02	MVB1141R5	5PK1141
					→04/02	TB496	116x22
					→01/97	TBK014	
					01/97 → 04/02	TBK121	
					→04/02	TB495	85x22
					A/C(+), →04/02	MVB675R5	5PK675
1.8 DI	RTN, RTP	55	09/00 →		A/C(-), →08/03	MVB1685R6	6PK1685
					A/C(+), →08/03	MVB1613R6	6PK1613
					Auto Tensioner, →08/03	TB681	91x9.52
					→08/03	TBK278	

FIESTA Box (JV_)

D 1.8	RTJ, RTK	44	05/98 →		A/C(-), MS, →12/01	MVB887R5	5PK887
					A/C(+), PS, →12/01	MVB1141R5	5PK1141
					→12/01	TB496	116x22
					→12/01	TBK121	
					→12/01	TB495	85x22
					A/C(+), →12/01	MVB675R5	5PK675
TD 1.8		55	03/00 →		A/C(-), →04/00	MVB1675R6	6PK1675
					A/C(-), →08/03	MVB1685R6	6PK1685
					A/C(+), →08/03	MVB1613R6	6PK1613
					Auto Tensioner, →08/03	TB681	91x9.52
					→08/03	TBK278	

FIESTA Box (WFVT)

1.0 (WFVT)		29	10/77 → 11/86		→08/81	SVB10800	10x800
					08/81 → 08/83	SVB10813	10x813
1.1 (WFVT)		39	10/77 → 11/86		04/78 → 08/81	SVB10800	10x800
					08/81 → 08/83	SVB10813	10x813
					09/83 →	SVB10825	10x825



kW



...FORD

FIESTA II (FBD)

1.0 (FBD)	TKB	33	09/83 → 02/89			SVB10825	10x825
1.1 (FBD)	GSH	36	05/86 → 02/89			SVB10825	10x825
	GLC, GSF	37	09/83 → 02/89			SVB10825	10x825
	JPC	51	09/83 → 01/87			SVB10825	10x825
1.4	FUBA	51	09/83 → 01/87			SVB10690	10x690
					→09/86	SVB12675	12x675
					10/86→	SVB10675	10x675
						TB240	97x19.8
					01/86→	TBK288	
1.4 (FBD)	F6A, F6C	52	10/86 → 02/89		Eng. F6A	SVB10675	10x675
					Eng. F6A	SVB10690	10x690
						TB240	97x19.8
						TBK288	
	FUD	54	02/87 → 02/89			SVB10675	10x675
						SVB10690	10x690
						TB240	97x19.8
						TBK288	
	FUB	55	10/85 → 11/89			SVB10690	10x690
					→09/86	SVB12675	12x675
					10/86→	SVB10675	10x675
						TB240	97x19.8
1.6 D (FBD)	LTB	40	04/84 → 02/89			SVB10840	10x840
						TB201	98x19.1
						TBK050	
1.6 XR2 (FBD)	LUD	70	03/84 → 02/89			SVB10675	10x675
						TB240	97x19.8
	LUB	71	04/84 → 02/89			SVB10675	10x675
						TB240	97x19.8
						TBK288	

FIESTA III (GFJ)

1.0	TLB	33	03/89 → 12/95		10/89→	SVB12795	12x795
1.1	GUD, GUE	40	03/89 → 12/95			SVB10800	10x800
	G6A	37	03/89 → 12/95			SVB10800	10x800
1.3	JBC	44	03/89 → 12/92			MVB825R4	4PK825
						SVB12795	12x795
						MVB860R4	4PK860
1.3 CAT	J6B	44	05/91 → 12/95			MVB825R4	4PK825
						SVB12795	12x795
						MVB860R4	4PK860
1.4	FUG, FUJ	54	03/89 → 12/95		10/89→12/93	TB252	122x9
					10/89→12/93	SVB10690	10x690
					04/92→	TB389	97x21.6
					10/89→04/92	TB240	97x19.8
					04/92→	TBK078	
					10/89→04/92	TBK288	
	F6E	52	03/89 → 12/95		10/89→12/93	TB252	122x9
					10/89→12/93	SVB10690	10x690
					04/92→	TB389	97x21.6
					10/89→04/92	TB240	97x19.8
					04/92→	TBK078	
					10/89→04/92	TBK288	
1.4 CAT	F4A	54	03/89 → 12/95		10/89→12/93	TB252	122x9
					10/89→12/93	SVB10690	10x690
					04/92→	TB389	97x21.6
					10/89→04/92	TB240	97x19.8
					04/92→	TBK078	
					10/89→04/92	TBK288	

FORD



kw



...FORD

...FIESTA III (GFJ)

FORD

1.6	LUH	65	01/89 → 01/94		10/89→12/92	TB252	122x9
					10/89→12/92	SVB10690	10x690
					04/92→12/92	TB389	97x21.6
					10/89→04/92	TB240	97x19.8
					04/92→12/92	TBK078	
1.6 i 16V	L1G	65	01/94 → 12/95		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS	MVB1260R6	6PK1260
					A/C(-), PS, AUTO	MVB1650R6	6PK1650
					A/C(-), PS, MAN, 08/94→	MVB1675R6	6PK1675
					A/C(+), MS	MVB1538R6	6PK1538
1.6 Turbo (FBJT)	LHA	96	03/90 → 10/92		A/C(+)	MVB1550R6	6PK1550
					A/C(+), PS	MVB1920R6	6PK1920
						TB390	131x25.4
					check kit comp.	TBK079	
					check kit comp.	TBK120	
1.6 XR2i	LJD	76	03/89 → 03/93			TB252	122x9
						SVB10690	10x690
						TB240	97x19.8
						TBK288	
1.6 XR2i	LJC	81	03/89 → 01/94		10/89→	TB252	122x9
					10/89→	SVB10690	10x690
					04/92→	TB389	97x21.6
					10/89→04/92	TB240	97x19.8
					04/92→	TBK078	
1.8 16V	RDB	77	02/92 → 12/95		10/89→04/92	TBK288	
					10/89→12/92	TB252	122x9
					10/89→12/92	SVB10690	10x690
					04/92→12/92	TB389	97x21.6
					10/89→04/92	TB240	97x19.8
1.8 D	RTC, RTD, RTG	44	03/89 → 12/95		04/92→12/92	TBK078	
					10/89→04/92	TBK288	
					10/89→12/92	TB252	122x9
					10/89→12/92	SVB10690	10x690
					04/92→12/92	TB389	97x21.6
1.8 16V	RDB	77	02/92 → 12/95		10/89→12/92	TB240	97x19.8
					04/92→12/92	TBK078	
					10/89→04/92	TBK288	
					A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS, →06/93	MVB1820R6	6PK1820
1.8 D	RTC, RTD, RTG	44	03/89 → 12/95		A/C(-), PS, 01/94→	MVB1260R6	6PK1260
					A/C(-), PS, 06/93→01/94	MVB1650R6	6PK1650
					A/C(+), MS	MVB1538R6	6PK1538
					A/C(+), MS, 08/93→03/94	MVB1550R6	6PK1550
					A/C(+), PS, →08/93	MVB1904R6	6PK1904
1.8 D	RTC, RTD, RTG	44	03/89 → 12/95		A/C(+), PS, 08/93→	MVB1920R6	6PK1920
						TB390	131x25.4
					check kit comp.	TBK079	
					check kit comp.	TBK120	
1.8 D	RTC, RTD, RTG	44	03/89 → 12/95		10/89→	TB252	122x9
					A/C(-), MS, 05/91→07/93	MVB675R3	3PK675
					A/C(-), MS, 07/93→	MVB710R5	5PK710
					A/C(-), MS, 10/89→05/91	MVB648R3	3PK648
					A/C(+), 10/89→	MVB1015R5	5PK1015
1.8 D	RTC, RTD, RTG	44	03/89 → 12/95		10/89→	TB237	116x20
					10/95→	TB496	116x22
					10/89→	TBK011	
					10/89→, inj. pump	TBK012	
					10/95→, inj. pump	TBK014	
1.8 D	RTC, RTD, RTG	44	03/89 → 12/95		10/89→	TB495	85x22
					A/C(+), 10/89→	MVB648R4	4PK648



kW



...FORD

...FIESTA III (GFJ)

1.8 TD		57	03/93 → 12/95			TB252	122x9
					A/C(-), MS, →07/93	MVB675R3	3PK675
					A/C(-), MS, 07/93 →	MVB710R5	5PK710
					A/C(+)	MVB1015R5	5PK1015
						TB237	116x20
					10/95 →	TB496	116x22
						TBK011	
					10/95 →	TBK014	
					inj. pump	TBK012	
						TB495	85x22
					A/C(+)	MVB648R4	4PK648
1.8 XR2i 16V	RQC	96	02/92 → 12/95		A/C(-), MS	MVB915R6	6PK915
					A/C(-), PS, →06/93	MVB1820R6	6PK1820
					A/C(-), PS, 01/94 →	MVB1260R6	6PK1260
					A/C(-), PS, 06/93 → 01/94	MVB1650R6	6PK1650
					A/C(+), MS	MVB1538R6	6PK1538
					A/C(+), MS, 08/93 → 03/94	MVB1550R6	6PK1550
					A/C(+), PS, →08/93	MVB1904R6	6PK1904
					A/C(+), PS, 08/93 →	MVB1920R6	6PK1920
						TB390	131x25.4
					check kit comp.	TBK079	
					check kit comp.	TBK120	

FIESTA IV (JA_, JB_)

1.0 i		38	02/97 → 09/99		A/C(-), MS	SVB10825	10x825
					A/C(-), PS	MVB1450R6	6PK1450
					A/C(+), PS	MVB1930R6	6PK1930
		48	09/99 → 01/02		A/C(-), MS	SVB10825	10x825
					A/C(-), PS	MVB1450R6	6PK1450
					A/C(+), PS	MVB1930R6	6PK1930
1.25 i 16V	DHA, DHB, DHC, DHD, DHE, DHF, DHG	55	08/95 → 01/02		A/C(-), PS, →01/99	MVB1755R6	6PK1755
					A/C(-), PS, 01/99 → 10/00	MVB1768R6	6PK1768
					A/C(+), PS, →10/00	MVB1930R6	6PK1930
					Eng. DHF, A/C(-), MS, →10/00	MVB1180R6	6PK1180
					Eng. DHF, A/C(+), MS, →10/00	MVB1775R6	6PK1775
						TB472	117x22
					→02/97	TBK310	
					02/97 →	TBK276	
1.3 i	JJA, JJC, JJE, JJJ, JJK, JJM	37	08/95 → 01/02		A/C(-), MS, →01/98	MVB860R6	6PK860
					A/C(-), MS, 01/98 →	SVB10825	10x825
					A/C(-), PS, 01/98 → 08/98	MVB1760R6	6PK1760
					A/C(-), PS, 09/98 →	MVB1450R6	6PK1450
					A/C(+), MS	MVB1440R6	6PK1440
					A/C(+), PS, 01/98 →	MVB1930R6	6PK1930
					Eng. JJA, A/C(-), PS, →01/98	MVB1740R6	6PK1740
					Eng. JJA, A/C(+), PS, →01/98	MVB1904R6	6PK1904
	J4C, J4J, J4L, J4Q, J4R, J4T	44	08/95 → 01/02		A/C(-), MS, →01/98	MVB860R6	6PK860
					A/C(-), MS, 01/98 →	SVB10825	10x825
					A/C(-), PS, →01/98	MVB1740R6	6PK1740
					A/C(-), PS, 01/98 → 08/98	MVB1760R6	6PK1760
					A/C(-), PS, 09/98 →	MVB1450R6	6PK1450
					A/C(+), MS	MVB1440R6	6PK1440
					A/C(+), PS, →01/98	MVB1904R6	6PK1904
					A/C(+), PS, 01/98 →	MVB1930R6	6PK1930
1.4 i 16V	FHA, FHE	66	04/96 → 01/02		A/C(-), MS	MVB1180R6	6PK1180
					A/C(-), PS, →01/99	MVB1755R6	6PK1755
					A/C(-), PS, 01/99 →	MVB1768R6	6PK1768
					A/C(+), MS	MVB1775R6	6PK1775
					A/C(+), PS	MVB1930R6	6PK1930
						TB472	117x22
					→02/97	TBK310	
					02/97 →	TBK276	



kW



...FORD

...FIESTA IV (JA_, JB_)

1.6 16V Sport	L1T, L1V	76	02/00 → 01/02		A/C(-)	MVB1768R6	6PK1768
					A/C(+)	MVB1930R6	6PK1930
						TB472	117x22
						TBK276	
1.8 D	RTJ, RTK	44	08/95 → 04/00		A/C(-), MS	MVB887R5	5PK887
					Eng. RTJ, A/C(+)	MVB1141R5	5PK1141
						TB496	116x22
					→01/97	TBK014	
					01/97→	TBK121	
					Eng. RTJ, A/C(+)	TB495	85x22
						MVB675R5	5PK675
1.8 DI	RTN, RTP, RTQ	55	04/00 → 01/02		A/C(-), MS, →10/00	MVB887R5	5PK887
					Eng. RTN, PS, →10/00	MVB1141R5	5PK1141
					Eng. RTP, A/C(-), 11/00→	MVB1685R6	6PK1685
					Eng. RTP, A/C(+), 11/00→	MVB1613R6	6PK1613
					→10/00	TB496	116x22
					Auto Tensioner, 11/00→	TB681	91x9.52
					11/00→	TBK278	
					Eng. RTN, →10/00, inj. pump	TBK121	
					→10/00	TB495	85x22
					Eng. RTN, A/C(+), →10/00	MVB675R5	5PK675

FIESTA V (JH_, JD_)

1.25 16V	M7JA, M7JB	51	03/03 →		→07/08	TB472	117x22
					→04/05	TBK276	
						TB472	117x22
					→04/05	TBK276	
1.3	BAJA	44	11/01 →		A/C(-), MS, 05/02→07/08	MVB1700R6	6PK1700
					A/C(-), PS, 05/02→07/08	MVB1685R6	6PK1685
	A9JA, A9JB	51	11/01 →		A/C(+), PS, 05/02→07/08	MVB2170R6	6PK2170
					A/C(-), MS, 05/02→07/08	MVB1700R6	6PK1700
					A/C(-), PS, 05/02→07/08	MVB1685R6	6PK1685
					A/C(+), PS, 05/02→07/08	MVB2170R6	6PK2170
1.4 16V	FXJA, FXJB	59	11/01 →		05/02→07/08	TB472	117x22
					05/02→04/05	TBK276	
1.4 TDCi	F6JA, F6JB	50	11/01 →		A/C(-), 05/02→07/08	MVB1335R6	6PK1335
					A/C(+), 05/02→07/08	MVB1708R6	6PK1708
					05/02→07/08	TB720	114x25.4
					05/02→07/08	TBK230	
1.6 16V	FYJA, FYJB	74	11/01 →		05/02→07/08	TB472	117x22
					05/02→04/05	TBK276	
1.6 TDCi	HHJA, HHJB	66	11/04 →		A/C(-), →07/08	MVB795R6	6PK795
					A/C(+), →07/08	MVB975R6	6PK975
					→07/08	TB724	137x25.4
					→07/08	TBK302	
ST150	N4JB	110	03/05 →		→11/05	MVB2225R6	6PK2225
					11/05→07/08	MVB2215R6	6PK2215

FIESTA Van

1.3		51	10/03 →		A/C(-), MS, →07/08	MVB1700R6	6PK1700
					A/C(-), PS, →07/08	MVB1685R6	6PK1685
					A/C(+), PS, →07/08	MVB2170R6	6PK2170
1.4 TDCi		50	10/03 →		A/C(-), →07/08	MVB1335R6	6PK1335
					A/C(+), →07/08	MVB1708R6	6PK1708
					→07/08	TB720	114x25.4
					→07/08	TBK230	

FOCUS (DAW, DBW)

1.4 16V	FXDA, FXDB, FXDC, FXDD	55	10/98 → 11/04		A/C(-), →08/01	MVB1740R6	6PK1740
					A/C(+), →02/02	MVB1885R6	6PK1885
					A/C(+), 03/02→	MVB1913R6	6PK1913
						TB472	117x22
						TBK276	



kW



...FORD

...FOCUS (DAW, DBW)

1.6 16V	FYDA, FYDB, FYDC, FYDD, FYDH	74	10/98 → 11/04		A/C(-), →08/01	MVB1740R6	6PK1740
					A/C(+), →02/02	MVB1885R6	6PK1885
					A/C(+), 03/02→	MVB1913R6	6PK1913
				 KIT		TB472	117x22
1.8 16V	EYDB, EYDC, EYDD, EYDE, EYDF, EYDG, EYDI, EYDJ, EYDL	85	10/98 → 11/04		A/C(+), PS	MVB2100R6	6PK2100
					Eng. EYDL, A/C(-), PS	MVB1980R6	6PK1980
					Eng. EYDL, A/C(+), MS	MVB1550R6	6PK1550
				 KIT	→01/99	TB633	129x25.4
1.8 DI / TDDi	BHDA, BHDB	55	08/99 → 11/04		A/C(-), →05/01	MVB1413R6	6PK1413
					A/C(-), 05/01→	MVB1420R6	6PK1420
					A/C(+)	MVB1715R6	6PK1715
				 KIT	Auto Tensioner 09/00→	TB681	91x9.52
1.8 TDCi	F9DA, F9DB	85	03/01 → 11/04		A/C(-)	MVB1420R6	6PK1420
					A/C(-), →05/01	MVB1413R6	6PK1413
					A/C(+)	MVB1715R6	6PK1715
				 KIT	Auto Tensioner	TB681	91x9.52
	FFDA	74	09/02 → 11/04		A/C(-)	MVB1420R6	6PK1420
					A/C(+)	MVB1715R6	6PK1715
					Auto Tensioner	TB681	91x9.52
				 KIT		TBK278	
1.8 Turbo DI / TDDi	C9DA, C9DB, C9DC	66	10/98 → 11/04		A/C(-), →05/01	MVB1413R6	6PK1413
					A/C(-), 05/01→	MVB1420R6	6PK1420
					A/C(+)	MVB1715R6	6PK1715
				 KIT	Auto Tensioner 09/00→	TB681	91x9.52
2.0 16V	EDDB, EDDC, EDDD, EDDF	96	10/98 → 11/04		A/C(-), PS	MVB1980R6	6PK1980
					A/C(+), MS	MVB1550R6	6PK1550
					A/C(+), PS	MVB2100R6	6PK2100
				 KIT	→01/99	TB633	129x25.4
RS	HMDA	158	10/02 → 11/04		→07/04	TBK326	
					→07/04	TBK327	
					→07/04	TB633	129x25.4
				 KIT		TBK327	
ST170	ALDA	127	03/02 → 11/04		→05/02	MVB2100R6	6PK2100
					→07/04	MVB2120R6	6PK2120
				 KIT	→07/04	TB633	129x25.4

FOCUS C-MAX

1.6	HWDA, HWDB	74	10/03 → 03/07			TB472	117x22
				 KIT	→04/05	TBK276	
1.6 TDCi	G8DA, G8DB	80	10/03 → 03/07		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
				 KIT	→04/06	TBK302	
	HHDA, HHDB	66	02/05 → 03/07		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
				 KIT	→04/06	TBK302	
1.6 Ti	HXDA	85	08/04 → 03/07			TB472	117x22
				 KIT	→04/05	TBK276	
1.8	CSDA, CSDB	88	10/03 → 03/07		Eng. CSDA, →10/04	MVB1306R6	6PK1306
	Q7DA, QQDA, QQDB	92	04/04 → 03/07			MVB1306R6	6PK1306
1.8 Flexifuel	Q7DA	92	01/06 → 03/07			MVB1306R6	6PK1306
1.8 TDCi	KKDA	85	01/05 → 03/07		A/C(-)	MVB1352R6	6PK1352
					A/C(+)	MVB1520R6	6PK1520
				 KIT	Auto Tensioner	TB681	91x9.52
				 KIT		TBK278	



kW



...FORD

...FOCUS C-MAX

2.0	AODA, AODB	107	04/04 → 03/07			MVB1306R6	6PK1306
2.0 TDCi	G6DA, G6DB, G6DD	100	10/03 → 03/07			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	

FOCUS Estate (DNW)

1.4 16V	FXDA, FXDB, FXDC, FXDD	55	02/99 → 11/04		A/C(-), →08/01	MVB1740R6	6PK1740
					A/C(+), →02/02	MVB1885R6	6PK1885
					A/C(+), 03/02→	MVB1913R6	6PK1913
						TB472	117x22
						TBK276	
1.6 16V	FYDA, FYDB, FYDC, FYDD, FYDH	74	02/99 → 11/04		A/C(-), →08/01	MVB1740R6	6PK1740
					A/C(+), →02/02	MVB1885R6	6PK1885
					A/C(+), 03/02→	MVB1913R6	6PK1913
						TB472	117x22
						TBK276	
1.8 16V	EYDB, EYDC, EYDD, EYDE, EYDF, EYDG, EYDI, EYDJ, EYDL	85	02/99 → 11/04		A/C(-), PS	MVB1980R6	6PK1980
					A/C(+), MS	MVB1550R6	6PK1550
					A/C(+), PS	MVB2100R6	6PK2100
						TB633	129x25.4
						TBK327	
1.8 DI / TDDi	BHDA, BHDB	55	08/99 → 11/04		A/C(-), →05/01	MVB1413R6	6PK1413
					A/C(-), 05/01→	MVB1420R6	6PK1420
					A/C(+)	MVB1715R6	6PK1715
					Auto Tensioner	TB681	91x9.52
						TBK278	
1.8 TDCi	F9DA, F9DB	85	03/01 → 11/04		A/C(-)	MVB1420R6	6PK1420
					A/C(-), →05/01	MVB1413R6	6PK1413
					A/C(+)	MVB1715R6	6PK1715
					Auto Tensioner	TB681	91x9.52
						TBK278	
	FFDA	74	09/02 → 11/04		A/C(-)	MVB1420R6	6PK1420
					A/C(+)	MVB1715R6	6PK1715
					Auto Tensioner	TB681	91x9.52
						TBK278	
1.8 Turbo DI / TDDi	C9DA, C9DB, C9DC	66	02/99 → 11/04		A/C(-), →05/01	MVB1413R6	6PK1413
					A/C(-), 05/01→	MVB1420R6	6PK1420
					A/C(+)	MVB1715R6	6PK1715
					Auto Tensioner	TB681	91x9.52
						TBK278	
2.0 16V	EDDB, EDDC, EDDD, EDDF	96	02/99 → 11/04		A/C(-), PS	MVB1980R6	6PK1980
					A/C(+), MS	MVB1550R6	6PK1550
					A/C(+), PS	MVB2100R6	6PK2100
						TB633	129x25.4
						TBK327	
ST170	ALDA	127	09/02 → 11/04			MVB2120R6	6PK2120
						TB633	129x25.4

FOCUS II (DA_)

1.4	ASDA, ASDB	59	11/04 →			TB472	117x22
						TBK276	
					→04/05		
1.6	HWDA, HWDB	74	11/04 →			TB472	117x22
						TBK276	
					→04/05		
1.6 TDCi	G8DA, G8DB	80	11/04 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
	HHDA, HHDB	66	01/05 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
1.6 Ti	HXDA	85	11/04 →			TB472	117x22
						TBK276	
					→04/05		



kW



...FORD

...FOCUS II (DA_)

1.8 Flexifuel	Q7DA	92	01/06 →			MVB1306R6	6PK1306
1.8 TDCi	KKDA	85	01/05 →		A/C(-)	MVB1352R6	6PK1352
					A/C(+)	MVB1520R6	6PK1520
				 KIT	Auto Tensioner	TB681 TBK278	91x9.52
2.0	AODA, AODB	107	11/04 →			MVB1306R6	6PK1306
2.0 TDCi	G6DA, G6DB, G6DD	100	11/04 →			MVB1215R6	6PK1215
						TB742	116x25
				 KIT		TBK338	
2.5 ST	HYDA	166	10/05 →			TB643	142x23

FOCUS II Convertible

1.6	HWDA, HWDB	74	10/06 →			TB472	117x22
2.0	AODA, AODB	107	10/06 →			MVB1306R6	6PK1306
2.0 TDCi	G6DA, G6DB, G6DD	100	10/06 →			MVB1215R6	6PK1215
						TB742	116x25
				 KIT		TBK338	

FOCUS II Saloon (DA_)

1.4	ASDA, ASDB	59	04/05 →			TB472	117x22
1.6	HWDA, HWDB	74	04/05 →			TB472	117x22
1.6 TDCi	HHDA, HHDB	66	04/05 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
				 KIT		TBK302	
						MVB795R6	6PK795
	G8DA, G8DB	80	04/05 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
				 KIT		TB724 TBK302	137x25.4
1.6 Ti	HXDA	85	04/05 →			TB472	117x22
1.8 Flexifuel	Q7DA	92	06/06 →			MVB1306R6	6PK1306
1.8 TDCi	KKDA	85	04/05 →		A/C(-)	MVB1352R6	6PK1352
					A/C(+)	MVB1520R6	6PK1520
					Auto Tensioner	TB681 TBK278	91x9.52
				 KIT		MVB1306R6	6PK1306
2.0	AODA, AODB	107	04/05 →			MVB1306R6	6PK1306
2.0 TDCi	G6DA, G6DB, G6DD	100	04/05 →			MVB1215R6	6PK1215
						TB742	116x25
				 KIT		TBK338	

FOCUS II Turnier (DAW_)

1.4	ASDA, ASDB	59	11/04 →			TB472	117x22
				 KIT	→04/05	TBK276	
1.6	HWDA, HWDB	74	11/04 →			TB472	117x22
				 KIT	→04/05	TBK276	
1.6 TDCi	G8DA, G8DB	80	11/04 →		Eng. C16DD0X, A/C(-)	MVB795R6	6PK795
					Eng. C16DD0X, A/C(+)	MVB975R6	6PK975
					→01/08	TB724	137x25.4
				 KIT	→04/06	TBK302	
						MVB795R6	6PK795
	HHDA, HHDB	66	11/04 →		Eng. C16DD0X, A/C(-)	MVB795R6	6PK795
					Eng. C16DD0X, A/C(+)	MVB975R6	6PK975
				 KIT		TB724 TBK302	137x25.4
1.6 Ti	HXDA	85	11/04 →			TB472	117x22
				 KIT	→04/05	TBK276	
1.8 Flexifuel	Q7DA	92	01/06 →			MVB1306R6	6PK1306
1.8 TDCi	KKDA	85	11/04 →		A/C(-), 04/05 →	MVB1352R6	6PK1352
					A/C(+), 04/05 →	MVB1520R6	6PK1520
					Auto Tensioner, 04/05 →	TB681	91x9.52
				 KIT	04/05 →	TBK278	
2.0	AODA, AODB	107	11/04 →			MVB1306R6	6PK1306
2.0 TDCi	G6DA, G6DB, G6DD	100	11/04 →			MVB1215R6	6PK1215
						TB742	116x25
				 KIT		TBK338	



kw



...FORD

FOCUS Saloon (DFW)

1.4 16V	FXDA, FXDB, FXDC, FXDD	55	02/99 → 11/04	①	A/C(-), →08/01	MVB1740R6	6PK1740	
				②	A/C(+), →02/02	MVB1885R6	6PK1885	
				③	A/C(+), 03/02→	MVB1913R6	6PK1913	
						TB472	117x22	
						TBK276		
1.6 16V MVB1740R6	FYDA, FYDB, FYDC, FYDD, FYDH 6PK1740		7402/99	→	11/04	①	A/C(-), →08/01	
				②	A/C(+), →02/02	MVB1885R6	6PK1885	
				③	A/C(+), 03/02→	MVB1913R6	6PK1913	
						TB472	117x22	
						TBK276		
1.8 16V	EYDB, EYDC, EYDD, EYDE, EYDF, EYDG, EYDI, EYDJ, EYDL	85	02/99 → 11/04	①	A/C(-), PS	MVB1980R6	6PK1980	
				②	A/C(+), MS	MVB1550R6	6PK1550	
				③	A/C(+), PS	MVB2100R6	6PK2100	
						TB633	129x25.4	
						TBK327		
1.8 TDCi	F9DA, F9DB	85	03/01 → 11/04	①	A/C(-)	MVB1420R6	6PK1420	
				②	A/C(-), →05/01	MVB1413R6	6PK1413	
				③	A/C(+)	MVB1715R6	6PK1715	
					Auto Tensioner	TB681	91x9.52	
							TBK278	
	FFDA	74	09/02 → 11/04	①	A/C(-)	MVB1420R6	6PK1420	
				②	A/C(+)	MVB1715R6	6PK1715	
					Auto Tensioner	TB681	91x9.52	
					TBK278			
1.8 Turbo DI / TDDi	C9DA, C9DB, C9DC	66	02/99 → 11/04	①	A/C(-), →05/01	MVB1413R6	6PK1413	
				②	A/C(-), 05/01→	MVB1420R6	6PK1420	
				③	A/C(+)	MVB1715R6	6PK1715	
					Auto Tensioner	TB681	91x9.52	
						TBK278		
2.0 16V	EDDB, EDDC, EDDD, EDDF	96	02/99 → 11/04	①	A/C(-), PS	MVB1980R6	6PK1980	
				②	A/C(+), MS	MVB1550R6	6PK1550	
				③	A/C(+), PS	MVB2100R6	6PK2100	
						TB633	129x25.4	
						TBK327		

FUSION (JU_)

1.25	FUJA, FUJB	55	08/04 →			TB472	117x22
						TBK276	
1.4	FXJA, FXJB	59	08/02 →			TB472	117x22
						TBK276	
1.4 TDCi	F6JA, F6JB	50	08/02 →	①	A/C(-)	MVB1335R6	6PK1335
				②	A/C(+)	MVB1708R6	6PK1708
						TB720	114x25.4
						TBK230	
1.6	FYJA, FYJB	74	08/02 →			TB472	117x22
						TBK276	
1.6 TDCi	HHJA, HHJB	66	11/04 →	①	A/C(-)	MVB795R6	6PK795
				②	A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	

GALAXY

1.8 TDCi	FFWA	74	05/06 →	①		MVB1685R6	6PK1685
					Auto Tensioner	TB681	91x9.52
						TBK278	
	QYWA	92	05/06 →	①		MVB1685R6	6PK1685
					Auto Tensioner	TB681	91x9.52
						TBK278	
2.0	AOWA	107	05/06 →	①		MVB2196R6	6PK2196



kW



...FORD

...GALAXY

2.0 TDCi	AZWA	96	05/06 →			MVB1200R6 TB742 TBK338	6PK1200 116x25
	QXWA, QXWB	103	05/06 →			MVB1200R6 TB742 TBK338	6PK1200 116x25
		85	11/07 →			MVB1200R6 TB742 TBK338	6PK1200 116x25
2.2 TDCi		129	03/08 →			TB810	118x25.4
2.3		118	07/07 →			MVB2250R6	6PK2250

GALAXY (WGR)

1.9 TDI	1Z, AHU, ANU	66	03/95 →		09/99 → 03/06	MVB1200R6D	6DPK1200				
					A/C(-), Alt. 90A, →04/00	MVB925R6	6PK925				
					A/C(-), Alt. 120A, 09/99 → 04/00	MVB1050R6	6PK1050				
					Eng. AHU, A/C(+), Alt. 120A, →09/99	MVB1045R6	6PK1045				
					Eng. AHU, A/C(+), →09/99 →04/00	MVB1150R6 TB384	6PK1150 137x25.4				
					09/99 → 03/06 →04/00	TB680 TBK305	120x30				
					05/02 → 03/06	TBK270					
					09/99 → 04/02	TBK225					
					09/99 → 04/02, VD(+)	TBK269					
					Eng. ANU, A/C(-), →04/00	SVB12735	12x735				
					Eng. ANU, A/C(+), →04/00	SVB11790	11x790				
					AFN, AVG	81	08/97 → 04/00		A/C(-), Alt. 90A	MVB925R6	6PK925
									A/C(-), Alt. 120A, →09/99	MVB1045R6	6PK1045
									A/C(-), Alt. 120A, 09/99 →	MVB1050R6	6PK1050
					A/C(+), →09/99	MVB1150R6	6PK1150				
					A/C(+), 09/99 →	MVB1200R6D TB384 TBK305	6DPK1200 137x25.4				
					A/C(-)	SVB12735	12x735				
					A/C(+)	SVB11790	11x790				
	AUY	85	04/00 →		→03/06	MVB1200R6D	6DPK1200				
					→03/06	TB680	120x30				
					→04/02	TBK225					
					→04/02, VD(+)	TBK269					
					05/02 → 03/06	TBK270					
	ASZ	96	02/03 →		→03/06	MVB1200R6D	6DPK1200				
					→03/06	TB680	120x30				
					→03/06	TBK270					
	BTB	110	05/05 →		→03/06	MVB1200R6D	6DPK1200				
					→03/06	TB680	120x30				
					→03/06	TBK270					
2.0 i	NSE, ZVSA	85	11/95 →		→03/06	MVB1570R6	6PK1570				
					A/C(-), →04/00	MVB1428R6	6PK1428				
2.3 16V	E5SA, Y5B	107	01/97 →		→03/06	MVB1570R6	6PK1570				
	E5SB	103	09/01 →		A/C(-), →04/00	MVB1428R6	6PK1428				
2.8 i V6	AAA, AMY	128	11/95 → 04/00		→03/06	MVB1570R6	6PK1570				
					Eng. AAA, A/C(-)	MVB1285R7	7PK1285				
					Eng. AAA, A/C(+)	MVB1360R7D	7DPK1360				
2.8 i V6 4x4	AAA, AMY	128	04/96 → 04/00		Eng. AAA, A/C(-)	MVB1285R7	7PK1285				
					Eng. AAA, A/C(+)	MVB1360R7D	7DPK1360				
2.8 V6	AYL	150	04/00 →		A/C(+), →03/06	MVB1325R6D	6DPK1325				



kw



...FORD

KA (RB_)

1.3 i	JJB	37	09/96 → 10/02	⊗	A/C(-), MS, →01/98	MVB860R6	6PK860
				⊗	A/C(-), MS, 01/98 →	SVB10825	10x825
				⊗	A/C(-), PS	MVB1450R6	6PK1450
				⊗	A/C(-), PS	MVB1760R6	6PK1760
	BAA, J4D, J4K, J4M, J4N, J4P, J4S	44	09/96 →	⊗	A/C(+), PS	MVB1930R6	6PK1930
				⊗	A/C(-), 06/02 →	MVB1700R6	6PK1700
				⊗	A/C(-), MS, →01/98	MVB860R6	6PK860
				⊗	A/C(-), MS, 01/98 →09/02	SVB10825	10x825
				⊗	A/C(-), PS, →09/02	MVB1450R6	6PK1450
				⊗	A/C(-), PS, →09/02	MVB1760R6	6PK1760
				⊗	A/C(+), 06/02 →	MVB2190R6	6PK2190
				⊗	A/C(+), PS, →09/02	MVB1930R6	6PK1930
JJD, JJF, JJG, JJH, JJJ	36	06/98 →	⊗	A/C(-), MS, →09/02	SVB10825	10x825	
			⊗	A/C(-), PS, →09/02	MVB1450R6	6PK1450	
			⊗	A/C(-), PS, →09/02	MVB1760R6	6PK1760	
			⊗	A/C(+), PS, →09/02	MVB1930R6	6PK1930	
A9A, A9B	51	08/02 →	⊗	A/C(-)	MVB1700R6	6PK1700	
			⊗	A/C(+)	MVB2190R6	6PK2190	
1.6 i	CDB, CDC	70	07/03 →	⊗	A/C(-)	MVB1700R6	6PK1700
				⊗	A/C(+)	MVB2190R6	6PK2190

KUGA

2.0 TDCi	100	03/08 →	⊗		MVB1215R6	6PK1215
					TB742	116x25
2.0 TDCi AWD	100	03/08 →	⊗		MVB1215R6	6PK1215
					TB742	116x25
				KIT	TBK338	

MAVERICK

2.0 16V	YF	91	02/01 →	⊗	A/C(-), →02/04	MVB1980R6	6PK1980
				⊗	A/C(+), →02/04	MVB2100R6	6PK2100
					→02/04	TB633	129x25.4
2.3 16V	GZ	110	03/04 →	⊗	A/C(+)	MVB2271R6	6PK2271
3.0 V6 24V	AJ	145	02/01 →	⊗	→02/04	MVB2080R6	6PK2080
					→02/04	MVB683R3	3PK683

MAVERICK (UDS, UNS)

2.4 i	KA24-E	91	02/93 → 08/96	⊗		SVB13925	13x925
				⊗		SVB10900	10x900
				⊗		SVB131150	13x1150
	KA-24	87	09/96 → 04/98	⊗		SVB13925	13x925
				⊗		SVB10900	10x900
				⊗		SVB131150	13x1150
2.4 i (UDS)	KA-24	85	09/96 → 04/98	⊗		SVB13925	13x925
				⊗		SVB10900	10x900
				⊗		SVB131150	13x1150
2.7 TD	TD27	74	02/93 → 08/96	⊗		SVB13925	13x925
				⊗		SVB131150	13x1150
				⊗		SVB13925	13x925
	TD27E	92	09/96 → 04/98	⊗		SVB131150	13x1150

MONDEO I (GBP)

1.6 i 16V	L1F	66	02/93 → 08/96	⊗	A/C(-)	MVB1715R6	6PK1715
				⊗	A/C(+), AUTO, 09/95 →	MVB2080R6	6PK2080
				⊗	A/C(+), MAN, 08/95 →	MVB2100R6	6PK2100
						TB390	131x25.4
						TBK120	
				L1J	65	07/94 → 08/96	⊗
⊗	A/C(+), AUTO, 09/95 →	MVB2080R6	6PK2080				
⊗	A/C(+), MAN, 08/95 →	MVB2100R6	6PK2100				
		TB390	131x25.4				
		TBK120					



kW



...FORD

...MONDEO I (GBP)

1.8 i 16V	RKA	85	02/93 → 08/96		A/C(-)	MVB1715R6	6PK1715	
					A/C(+), AUTO	MVB2080R6	6PK2080	
					A/C(+), MAN, 09/95 →	MVB2100R6	6PK2100	
						TB390	131x25.4	
					check kit comp.	TBK079		
					check kit comp.	TBK120		
1.8 i 16V 4x4	RKA	85	02/93 → 08/96		A/C(-)	MVB1715R6	6PK1715	
					A/C(+), AUTO	MVB2080R6	6PK2080	
					A/C(+), MAN, 09/95 →	MVB2100R6	6PK2100	
						TB390	131x25.4	
					check kit comp.	TBK079		
					check kit comp.	TBK120		
1.8 TD	RFM, RFN	65	06/93 → 08/96			MVB887R5	5PK887	
						MVB869R5	5PK869	
					→10/95	TB237	116x20	
					10/95 →	TB496	116x22	
					→10/95	TBK011		
					→10/95, inj. pump	TBK012		
	66	10/95 → 08/96				10/95 →, inj. pump	TBK014	
							TB495	85x22
							MVB575R5	5PK575
							MVB887R5	5PK887
							MVB869R5	5PK869
							TB496	116x22
2.0 i 16V	NGA	100	02/93 → 08/96		A/C(-)	MVB1715R6	6PK1715	
					A/C(+), AUTO	MVB2080R6	6PK2080	
					A/C(+), MAN, 09/95 →	MVB2100R6	6PK2100	
						TB390	131x25.4	
						TBK120		
				97	12/94 → 08/96			
	A/C(+), AUTO	MVB2080R6	6PK2080					
	A/C(+), MAN, 09/95 →	MVB2100R6	6PK2100					
		TB390	131x25.4					
		TBK120						
2.0 i 16V 4x4	NGA	97	12/94 → 08/96					
					A/C(+), AUTO	MVB2080R6	6PK2080	
					A/C(+), MAN, 09/95 →	MVB2100R6	6PK2100	
						TB390	131x25.4	
						TBK120		
				2.5 i 24V	SEA	125	07/94 → 08/96	
	A/C(+)	MVB1820R6	6PK1820					
		MVB683R3	3PK683					

MONDEO I Estate (BNP)

1.6 i 16V	L1F	66	04/93 → 08/96		A/C(-)	MVB1715R6	6PK1715
					A/C(+), AUTO	MVB2080R6	6PK2080
					A/C(+), MAN	MVB2100R6	6PK2100
						TB390	131x25.4
						TBK120	
				L1J	65	07/94 → 08/96	
	A/C(+), AUTO	MVB2080R6	6PK2080				
	A/C(+), MAN	MVB2100R6	6PK2100				
		TB390	131x25.4				
		TBK120					



kW



...FORD

...MONDEO I Estate (BNP)

FORD

1.8 i 16V	RKA	85	04/93 → 08/96	⊗	A/C(-)	MVB1715R6	6PK1715		
				⊗	A/C(+), AUTO	MVB2080R6	6PK2080		
				⊗	A/C(+), MAN, 09/95→	MVB2100R6	6PK2100		
						TB390	131x25.4		
				KIT	check kit comp.	TBK079			
				KIT	check kit comp.	TBK120			
RKB	82	07/94 → 08/96	⊗	A/C(-)	MVB1715R6	6PK1715			
			⊗	A/C(+), AUTO	MVB2080R6	6PK2080			
			⊗	A/C(+), MAN, 09/95→	MVB2100R6	6PK2100			
					TB390	131x25.4			
			KIT	check kit comp.	TBK079				
			KIT	check kit comp.	TBK120				
1.8 i 16V 4x4	RKA	85	04/93 → 08/96	⊗	A/C(-)	MVB1715R6	6PK1715		
				⊗	A/C(+), AUTO	MVB2080R6	6PK2080		
				⊗	A/C(+), MAN, 09/95→	MVB2100R6	6PK2100		
						TB390	131x25.4		
				KIT	check kit comp.	TBK079			
				KIT	check kit comp.	TBK120			
1.8 TD	RFM, RFN	65	06/93 → 08/96	⊗		MVB887R5	5PK887		
				⊗	Eng. RFN	MVB869R5	5PK869		
					→10/95	TB237	116x20		
					10/95→	TB496	116x22		
				KIT	Eng. RFN, →10/95	TBK011			
				KIT	Eng. RFN, →10/95, inj. pump	TBK012			
		66	11/95 → 08/96			KIT	Eng. RFN, 10/95→	TBK014	
								TB495	85x22
						⊗	Eng. RFN	MVB575R5	5PK575
						⊗		MVB887R5	5PK887
							Eng. RFN	MVB869R5	5PK869
								TB496	116x22
2.0 i 16V	NGA	100	04/93 → 08/96	⊗	A/C(-)	MVB1715R6	6PK1715		
				⊗	A/C(+), AUTO	MVB2080R6	6PK2080		
				⊗	A/C(+), MAN, 09/95→	MVB2100R6	6PK2100		
						TB390	131x25.4		
				KIT		TBK120			
				97	01/93 → 08/96			⊗	A/C(-)
		⊗	A/C(+), AUTO					MVB2080R6	6PK2080
		⊗	A/C(+), MAN, 09/95→					MVB2100R6	6PK2100
								TB390	131x25.4
		KIT						TBK120	
		2.0 i 16V 4x4	NGA					100	04/93 → 08/96
				⊗	A/C(+), AUTO	MVB2080R6	6PK2080		
⊗	A/C(+), MAN, 09/95→			MVB2100R6	6PK2100				
				TB390	131x25.4				
KIT				TBK120					
97	12/94 → 08/96					⊗	A/C(-)		
			⊗			A/C(+), AUTO	MVB2080R6	6PK2080	
			⊗			A/C(+), MAN, 09/95→	MVB2100R6	6PK2100	
							TB390	131x25.4	
			KIT				TBK120		
			2.5 i 24V			SEA	125	07/94 → 08/96	⊗
⊗	A/C(+)			MVB1820R6	6PK1820				
⊗		MVB683R3		3PK683					



kW



...FORD

MONDEO I Saloon (GBP)

1.6 i 16V	L1F	66	02/93 → 08/96	A/C(-) A/C(+), AUTO, 09/95 → A/C(+), MAN, 08/95 → KIT	MVB1715R6 6PK1715 MVB2080R6 6PK2080 MVB2100R6 6PK2100 TB390 131x25.4 TBK120
	L1J	65	07/94 → 08/96	A/C(-) A/C(+), AUTO, 09/95 → A/C(+), MAN, 08/95 → KIT	MVB1715R6 6PK1715 MVB2080R6 6PK2080 MVB2100R6 6PK2100 TB390 131x25.4 TBK120
1.8 i 16V	RKA	85	02/93 → 08/96	A/C(-) A/C(+), AUTO A/C(+), MAN, 09/95 → KIT	MVB1715R6 6PK1715 MVB2080R6 6PK2080 MVB2100R6 6PK2100 TB390 131x25.4 TBK079 TBK120
	RKB	82	01/94 → 08/96	A/C(-) A/C(+), AUTO A/C(+), MAN, 09/95 → KIT	MVB1715R6 6PK1715 MVB2080R6 6PK2080 MVB2100R6 6PK2100 TB390 131x25.4 TBK079 TBK120
1.8 TD	RFM, RFN	65	06/93 → 08/96	MVB887R5 5PK887 MVB869R5 5PK869 TB237 116x20 TB496 116x22 KIT TBK011 KIT TBK012 KIT TBK014 TB495 85x22	
				MVB575R5 5PK575 MVB887R5 5PK887 MVB869R5 5PK869 TB496 116x22 KIT TBK014 TB495 85x22 MVB575R5 5PK575	
2.0 i 16V	NGA	100	02/93 → 08/96	A/C(-) A/C(+), AUTO A/C(+), MAN, 09/95 → KIT	MVB1715R6 6PK1715 MVB2080R6 6PK2080 MVB2100R6 6PK2100 TB390 131x25.4 TBK120
				A/C(-) A/C(+), AUTO A/C(+), MAN, 09/95 → KIT	MVB1715R6 6PK1715 MVB2080R6 6PK2080 MVB2100R6 6PK2100 TB390 131x25.4 TBK120
2.0 i 16V 4x4	NGA	97	12/94 → 08/96	A/C(-) A/C(+), AUTO A/C(+), MAN, 09/95 → KIT	MVB1715R6 6PK1715 MVB2080R6 6PK2080 MVB2100R6 6PK2100 TB390 131x25.4 TBK120
2.5 i 24V	SEA	125	07/94 → 08/96	A/C(-) A/C(+) KIT	MVB1588R6 6PK1588 MVB1820R6 6PK1820 MVB683R3 3PK683
				A/C(-) A/C(+) KIT	MVB1588R6 6PK1588 MVB1820R6 6PK1820 MVB683R3 3PK683



kw



...FORD

MONDEO II (BAP)

1.6 i	L1J	66	09/96 → 11/00		A/C(-), →05/98	MVB1715R6	6PK1715				
					A/C(-), 05/98→	MVB1980R6	6PK1980				
					A/C(+), AUTO	MVB2100R6	6PK2100				
					A/C(+), AUTO, →05/98	MVB2080R6	6PK2080				
					A/C(+), MAN, 05/98→	MVB2120R6	6PK2120				
					→05/98	TB390	131x25.4				
					05/98→	TB633	129x25.4				
					→05/98, check kit comp.	TBK079					
					→05/98, check kit comp.	TBK120					
					02/99→	TBK327					
					05/98→01/99	TBK326					
				1.6 i 16V	L1L, L1N, L1Q	70	05/98 → 11/00		A/C(-)	MVB1980R6	6PK1980
									A/C(+), AUTO	MVB2100R6	6PK2100
	A/C(+), MAN	MVB2120R6	6PK2120								
		TB633	129x25.4								
	→01/99	TBK326									
1.8 i	RKB, RKF, RKH, RKJ, RKK	85	09/96 → 11/00		A/C(-), →05/98	MVB1715R6	6PK1715				
					A/C(-), 05/98→	MVB1980R6	6PK1980				
					A/C(+), AUTO	MVB2100R6	6PK2100				
					A/C(+), AUTO, →05/98	MVB2080R6	6PK2080				
					A/C(+), MAN, 05/98→	MVB2120R6	6PK2120				
1.8 TD	RFN	66	09/96 → 11/00			MVB887R5	5PK887				
						MVB869R5	5PK869				
						TB496	116x22				
						TBK014					
						TBK121					
						TB495	85x22				
						MVB575R5	5PK575				
				2.0 i	NGA, NGB, NGC, NGD	96	09/96 → 11/00		A/C(-), →05/98	MVB1715R6	6PK1715
									A/C(-), 05/98→	MVB1980R6	6PK1980
									A/C(+), AUTO	MVB2100R6	6PK2100
	A/C(+), AUTO, →05/98	MVB2080R6	6PK2080								
	A/C(+), MAN, 05/98→	MVB2120R6	6PK2120								
	→05/98	TB390	131x25.4								
	05/98→	TB633	129x25.4								
	→05/98, check kit comp.	TBK079									
	→05/98, check kit comp.	TBK120									
	02/99→	TBK327									
2.5 24V	SEA	125	09/96 → 11/00		A/C(-)	MVB1588R6	6PK1588				
					A/C(+)	MVB1820R6	6PK1820				
						MVB683R3	3PK683				
				SEB, SEC	125	06/00 → 11/00		A/C(-)	MVB1588R6	6PK1588	
								A/C(+)	MVB1820R6	6PK1820	
			MVB683R3				3PK683				
	2.5 ST 200	SGA	151				05/99 → 11/00		A/C(-)	MVB1588R6	6PK1588
									A/C(+)	MVB1820R6	6PK1820
						MVB683R3		3PK683			



kW



...FORD

MONDEO II Estate (BNP)

Engine	Model	kW	Year Range	Accessories	Notes	Part Numbers	Dimensions
1.6 i	L1J	66	09/96 → 11/00		A/C(-), →05/98	MVB1715R6	6PK1715
					A/C(-), 05/98 →	MVB1980R6	6PK1980
					A/C(+), AUTO	MVB2100R6	6PK2100
					A/C(+), AUTO, →05/98	MVB2080R6	6PK2080
					A/C(+), MAN, 05/98 →	MVB2120R6	6PK2120
					→05/98	TB390	131x25.4
					05/98 →	TB633	129x25.4
				KIT	→05/98, check kit comp.	TBK079	
				KIT	→05/98, check kit comp.	TBK120	
				KIT	02/99 →	TBK327	
1.6 i 16V	L1L, L1N, L1Q	70	05/98 → 11/00		A/C(-)	MVB1980R6	6PK1980
					A/C(+), AUTO	MVB2100R6	6PK2100
					A/C(+), MAN	MVB2120R6	6PK2120
						TB633	129x25.4
				KIT	→01/99	TBK326	
KIT	02/99 →	TBK327					
1.8 i	RKB, RKF, RKH, RKJ, RKK	85	09/96 → 11/00		A/C(-), →05/98	MVB1715R6	6PK1715
					A/C(-), 05/98 →	MVB1980R6	6PK1980
					A/C(+), AUTO	MVB2100R6	6PK2100
					A/C(+), AUTO, →05/98	MVB2080R6	6PK2080
					A/C(+), MAN, 05/98 →	MVB2120R6	6PK2120
					→05/98	TB390	131x25.4
					05/98 →	TB633	129x25.4
				KIT	→05/98, check kit comp.	TBK079	
				KIT	→05/98, check kit comp.	TBK120	
				KIT	02/99 →	TBK327	
1.8 TD	RFN	66	09/96 → 11/00			MVB887R5	5PK887
						MVB869R5	5PK869
						TB496	116x22
				KIT		TBK014	
				KIT		TBK121	
		TB495	85x22				
		MVB575R5	5PK575				
2.0 i	NGA, NGB, NGC, NGD	96	09/96 → 11/00		A/C(-), →05/98	MVB1715R6	6PK1715
					A/C(-), 05/98 →	MVB1980R6	6PK1980
					A/C(+), AUTO	MVB2100R6	6PK2100
					A/C(+), AUTO, →05/98	MVB2080R6	6PK2080
					A/C(+), MAN, 05/98 →	MVB2120R6	6PK2120
					→05/98	TB390	131x25.4
					05/98 →	TB633	129x25.4
				KIT	→05/98, check kit comp.	TBK079	
				KIT	→05/98, check kit comp.	TBK120	
				KIT	02/99 →	TBK327	
2.5 24V	SEA	125	09/96 → 11/00		A/C(-)	MVB1588R6	6PK1588
					A/C(+)	MVB1820R6	6PK1820
						MVB683R3	3PK683
	SEB, SEC	125	06/00 → 11/00		A/C(-)	MVB1588R6	6PK1588
					A/C(+)	MVB1820R6	6PK1820
		MVB683R3	3PK683				
2.5 ST 200	SGA	151	05/99 → 11/00		A/C(-)	MVB1588R6	6PK1588
					A/C(+)	MVB1820R6	6PK1820
						MVB683R3	3PK683



kw



...FORD

MONDEO II Saloon (BFP)

1.6 i	L1J	66	09/96 → 11/00		A/C(-), →05/98	MVB1715R6	6PK1715				
					A/C(-), 05/98→	MVB1980R6	6PK1980				
					A/C(+), AUTO	MVB2100R6	6PK2100				
					A/C(+), AUTO, →05/98	MVB2080R6	6PK2080				
					A/C(+), MAN, 05/98→	MVB2120R6	6PK2120				
					→05/98	TB390	131x25.4				
					05/98→	TB633	129x25.4				
					→05/98, check kit comp.	TBK079					
					→05/98, check kit comp.	TBK120					
					02/99→	TBK327					
					05/98→01/99	TBK326					
				1.6 i 16V	L1L, L1N, L1Q	70	05/98 → 11/00		A/C(-)	MVB1980R6	6PK1980
	A/C(+), AUTO	MVB2100R6	6PK2100								
	A/C(+), MAN	MVB2120R6	6PK2120								
		TB633	129x25.4								
	→01/99	TBK326									
1.8 i	RKB, RKF, RKH, RKJ, RKK	85	09/96 → 11/00		A/C(-), →05/98	MVB1715R6	6PK1715				
					A/C(-), 05/98→	MVB1980R6	6PK1980				
					A/C(+), AUTO	MVB2100R6	6PK2100				
					A/C(+), AUTO, →05/98	MVB2080R6	6PK2080				
					A/C(+), MAN, 05/98→	MVB2120R6	6PK2120				
1.8 TD	RFN	66	09/96 → 11/00			MVB887R5	5PK887				
						MVB869R5	5PK869				
						TB496	116x22				
					check kit comp.	TBK014					
					check kit comp.	TBK121					
						TB495	85x22				
						MVB575R5	5PK575				
				2.0 i	NGA, NGB, NGC, NGD	96	09/96 → 11/00		A/C(-), →05/98	MVB1715R6	6PK1715
									A/C(-), 05/98→	MVB1980R6	6PK1980
									A/C(+), AUTO	MVB2100R6	6PK2100
	A/C(+), AUTO, →05/98	MVB2080R6	6PK2080								
	A/C(+), MAN, 05/98→	MVB2120R6	6PK2120								
	→05/98	TB390	131x25.4								
	05/98→	TB633	129x25.4								
	→05/98, check kit comp.	TBK079									
	→05/98, check kit comp.	TBK120									
	02/99→	TBK327									
2.5 24V	SEA	125	09/96 → 11/00		A/C(-)	MVB1588R6	6PK1588				
					A/C(+)	MVB1820R6	6PK1820				
						MVB683R3	3PK683				
				SEB, SEC	125	06/00 → 11/00		A/C(-)	MVB1588R6	6PK1588	
								A/C(+)	MVB1820R6	6PK1820	
			MVB683R3				3PK683				
	2.5 ST 200	SGA	151				05/99 → 11/00		A/C(-)	MVB1588R6	6PK1588
									A/C(+)	MVB1820R6	6PK1820
						MVB683R3		3PK683			

MONDEO III (B5Y)

1.8 16V	CGBA, CGBB	81	11/00 →			MVB2225R6	6PK2225
	CHBA, CHBB	92	11/00 →			MVB2225R6	6PK2225
1.8 SCi	CFBA	96	06/03 →		→09/05	MVB2225R6	6PK2225
2.0 16V	CJBA, CJBB	107	11/00 →			MVB2225R6	6PK2225



kW



FORD

...FORD

...MONDEO III (B5Y)

2.0 16V DI / TDDi / TDCi	D5BA, SDBA	66	11/00 →		→02/07 →09/04	MVB1642R6 MVB735R4	6PK1642 4PK735
2.0 16V TDDi / TDCi	D6BA, HJBA, HJBB, HJBC	85	11/00 →		→02/07 →09/04	MVB1642R6 MVB735R4	6PK1642 4PK735
2.0 TDCi	FMBA, N7BA	96	10/01 →		→02/07 →09/04	MVB1642R6 MVB735R4	6PK1642 4PK735
2.2 TDCi	QJBA, QJBB	114	09/04 →		→02/07	MVB1642R6	6PK1642
2.5 V6 24V	LCBD	125	11/00 →		→02/07 →02/07	MVB2080R6 MVB683R3	6PK2080 3PK683
3.0 V6 24V	REBA	150	09/04 →		→02/07	MVB2080R6	6PK2080
ST220	MEBA	166	04/02 →		→02/07 →10/03	MVB2080R6 MVB683R3	6PK2080 3PK683

MONDEO III Estate (BWY)

1.8 16V	CGBA, CGBB CHBA, CHBB	81 92	11/00 → 11/00 →			MVB2225R6 MVB2225R6	6PK2225 6PK2225
1.8 SCi	CFBA	96	06/03 →		→09/05	MVB2225R6	6PK2225
2.0 16V	CJBA, CJBB	107	11/00 →			MVB2225R6	6PK2225
2.0 16V DI / TDDi / TDCi	D5BA, SDBA	66	11/00 →		→02/07 →09/04	MVB1642R6 MVB735R4	6PK1642 4PK735
2.0 16V TDDi / TDCi	D6BA, HJBA, HJBB, HJBC	85	11/00 →		→02/07 →09/04	MVB1642R6 MVB735R4	6PK1642 4PK735
2.0 TDCi	FMBA, N7BA	96	10/01 →		→02/07 →09/04	MVB1642R6 MVB735R4	6PK1642 4PK735
2.2 TDCi	QJBA, QJBB	114	09/04 →		→02/07	MVB1642R6	6PK1642
2.5 V6 24V	LCBD	125	11/00 →		→02/07 →02/07	MVB2080R6 MVB683R3	6PK2080 3PK683
3.0 V6 24V	REBA	150	09/04 →		→02/07	MVB2080R6	6PK2080
ST220	MEBA	166	04/02 →		→02/07 →10/03	MVB2080R6 MVB683R3	6PK2080 3PK683

MONDEO III Saloon (B4Y)

1.8 16V	CGBA, CGBB CHBA, CHBB	81 92	11/00 → 11/00 →			MVB2225R6 MVB2225R6	6PK2225 6PK2225
1.8 SCi	CFBA	96	06/03 →		→09/05	MVB2225R6	6PK2225
2.0 16V	CJBA, CJBB	107	11/00 →			MVB2225R6	6PK2225
2.0 16V DI / TDDi / TDCi	D5BA, SDBA	66	11/00 →		→02/07 →09/04	MVB1642R6 MVB735R4	6PK1642 4PK735
2.0 16V TDDi / TDCi	D6BA, HJBA, HJBB, HJBC	85	11/00 →		→02/07 →09/04	MVB1642R6 MVB735R4	6PK1642 4PK735
2.0 TDCi	FMBA, N7BA	96	10/01 →		→02/07 →09/04	MVB1642R6 MVB735R4	6PK1642 4PK735
2.2 TDCi	QJBA, QJBB	114	09/04 →		→02/07	MVB1642R6	6PK1642
2.5 V6 24V	LCBD	125	11/00 →		→02/07 →02/07	MVB2080R6 MVB683R3	6PK2080 3PK683
3.0 V6 24V	REBA	150	09/04 →		→02/07	MVB2080R6	6PK2080
ST220	MEBA	166	04/02 →		→02/07 →10/03	MVB2080R6 MVB683R3	6PK2080 3PK683

MONDEO IV

1.6 Ti		81 92	03/07 → 03/07 →			TB472 TB472	117x22 117x22
1.8 TDCi		74	03/07 →			MVB1685R6 TB681 TBK278	6PK1685 91x9.52
2.0		107	03/07 →			MVB2196R6	6PK2196
2.0 TDCi		96	03/07 →			TB742 TBK338	116x25
		103	03/07 →			TB742 TBK338	116x25
		85	11/07 →			TB742 TBK338	116x25
2.2 TDCi		129	03/08 →			TB810	118x25.4
2.3		118	07/07 →			MVB2250R6	6PK2250
2.5		162	03/07 →			TB643	142x23



kW



...FORD

FORD

MONDEO IV Saloon

2.0		107	03/07 →		MVB2196R6	6PK2196
2.0 TDCi		96	03/07 →		TB742	116x25
					TBK338	
	103	03/07 →		TB742	116x25	
					TBK338	
	85	11/07 →		TB742	116x25	
					TBK338	
2.2 TDCi		129	03/08 →		TB810	118x25.4
2.3		118	07/07 →		MVB2250R6	6PK2250
2.5		162	03/07 →		TB643	142x23

MONDEO IV Turnier

1.6 Ti		81	03/07 →		TB472	117x22
					TB472	117x22
1.8 TDCi		74	03/07 →		MVB1685R6	6PK1685
					TB681	91x9.52
					TBK278	
2.0		107	03/07 →		MVB2196R6	6PK2196
2.0 TDCi		96	03/07 →		TB742	116x25
					TBK338	
	103	03/07 →		TB742	116x25	
					TBK338	
2.3		118	07/07 →		MVB2250R6	6PK2250
2.5		162	03/07 →		TB643	142x23

ORION I (AFD)

1.3	JPA	51	07/83 → 03/86		SVB12795	12x795
					TB239	92x19.8
1.6	LP1, LPA	58	07/83 → 03/86		SVB12795	12x795
					TB240	97x19.8
					TBK288	
1.6 D	LTA	40	02/84 → 03/86		TB251	120x9
					SVB10840	10x840
					TB201	98x19.1
					TBK050	
1.6 i	LR1, LRA	77	07/83 → 03/86		SVB12785	12x785
					TB240	97x19.8
					TBK288	

ORION II (AFF)

1.3	JBB, JLA, JLB	51	11/86 → 07/88		SVB12795	12x795
					SVB10825	10x825
					SVB12795	12x795
					TB239	92x19.8



kW



...FORD

...ORION II (AFF)

FORD

Model	Code	kW	Year Range	Icons	Notes	Part Numbers	Dimensions
1.4	FUA	55	12/85 → 07/90		→10/88	TB251	120x9
					10/88→	TB252	122x9
					→12/88	SVB13850	13x850
					A/C(-), →12/88	SVB12760	12x760
					A/C(-), 12/88→	SVB12795	12x795
					A/C(+), →12/88	SVB10625	10x625
					A/C(+), 01/89→	MVB915R6	6PK915
						TB240	97x19.8
						TBK288	
						TB251	120x9
						TB252	122x9
				52	03/86 → 07/90		→10/88
	10/88→	TB252	122x9				
	→12/88	SVB13850	13x850				
	A/C(-), →12/88	SVB12760	12x760				
	A/C(-), 12/88→	SVB12795	12x795				
	A/C(+), →12/88	SVB10625	10x625				
	A/C(+), 01/89→	MVB915R6	6PK915				
		TB240	97x19.8				
		TBK288					
		TB251	120x9				
		TB252	122x9				
FUC	54	01/86 → 07/90				→10/88	TB251
				10/88→	TB252	122x9	
				→12/88	SVB13850	13x850	
				A/C(-), Carb, →12/88	SVB12760	12x760	
				A/C(-), Carb, 12/88→	SVB12795	12x795	
				A/C(-), Inj	SVB12775	12x775	
				A/C(+), →12/88	SVB10625	10x625	
				A/C(+), 01/89→	MVB915R6	6PK915	
					TB240	97x19.8	
					TBK288		
					TB251	120x9	
			1.4 CAT	F6B, F6D	54	02/87 → 07/90	
	10/88→	TB252					122x9
	→12/88	SVB13850					13x850
	A/C(-), Carb, 12/88→	SVB12795					12x795
	A/C(-), Inj	SVB12775					12x775
	A/C(+), 01/89→	MVB915R6					6PK915
	Eng. F6B, A/C(-), Carb, →12/88	SVB12760					12x760
	Eng. F6B, A/C(+), →12/88	SVB10625					10x625
		TB240					97x19.8
		TBK288					
		TB251					120x9
1.6	LUC	66					12/85 → 07/90
				10/88→	TB252	122x9	
				→12/88	SVB13850	13x850	
				A/C(-), Carb, →12/88	SVB12760	12x760	
				A/C(-), Carb, 12/88→	SVB12795	12x795	
				A/C(-), Inj	SVB12775	12x775	
				A/C(+), →12/88	SVB10625	10x625	
				A/C(+), 01/89→	MVB915R6	6PK915	
					TB240	97x19.8	
					TBK288		
					TB251	120x9	
			1.6 D	LTC	40	12/85 → 01/89	
	10/88→	TB252					122x9
		SVB10840					10x840
		TB201					98x19.1
		TBK050					



kw



...FORD

...ORION II (AFF)

1.6 i	LRB	77	03/86 → 07/90		→10/88	TB251	120x9
					10/88→	TB252	122x9
					→12/88	SVB13850	13x850
					A/C(-)	SVB12775	12x775
					A/C(+), →12/88	SVB10625	10x625
					A/C(+), 01/89→	MVB915R6	6PK915
						TB240	97x19.8
						TBK288	
						TB252	122x9
					A/C(-)	SVB12775	12x775
1.6 i CAT	L4B	66	03/86 → 07/90		→10/88	TB251	120x9
					10/88→	TB252	122x9
					→12/88	SVB13850	13x850
					A/C(-)	SVB12775	12x775
					A/C(+), →12/88	SVB10625	10x625
					A/C(+), 01/89→	MVB915R6	6PK915
						TB240	97x19.8
						TBK288	
						TB252	122x9
						MVB648R3	3PK648
1.8 D	RTA, RTB	44	01/89 → 07/90			TB237	116x20
					Eng. RTA	TBK011	
					Eng. RTA, inj. pump	TBK012	
						TB495	85x22

ORION III (GAL)

1.3	J4B, J6A	44	07/90 → 12/93		→08/93	SVB12795	12x795				
					A/C(-), MS, →08/93	SVB10760	10x760				
					A/C(-), PS, →08/93	MVB1420R6	6PK1420				
					A/C(+), MS, →08/93	MVB1000R6	6PK1000				
					A/C(+), PS, →08/93	MVB1635R6	6PK1635				
					→04/92	TB240	97x19.8				
					04/92→08/93	TB389	97x21.6				
					→04/92	TBK288					
					04/92→08/93	TBK078					
				1.4	F6F, F6G	52	07/90 → 12/93		A/C(-), MS, →08/93	SVB10760	10x760
	A/C(-), PS, →08/93	MVB1420R6	6PK1420								
	A/C(+), MS, →08/93	MVB1000R6	6PK1000								
	A/C(+), PS, →08/93	MVB1635R6	6PK1635								
	→04/92	TB240	97x19.8								
	04/92→08/93	TB389	97x21.6								
	→04/92	TBK288									
	04/92→08/93	TBK078									
1.6	LUJ, LUK	66	07/90 → 12/92						A/C(-), MS	SVB10760	10x760
									A/C(-), PS	MVB1420R6	6PK1420
					A/C(+), MS	MVB1000R6	6PK1000				
					A/C(+), PS	MVB1635R6	6PK1635				
					→04/92	TB240	97x19.8				
					04/92→	TB389	97x21.6				
					→04/92	TBK288					
					04/92→	TBK078					
				1.6 i	LJF	77	07/90 → 09/92		A/C(-), MS	SVB10760	10x760
									A/C(-), PS	MVB1420R6	6PK1420
	A/C(+), MS	MVB1000R6	6PK1000								
	A/C(+), PS	MVB1635R6	6PK1635								
	→04/92	TB240	97x19.8								
	04/92→	TB389	97x21.6								
	→04/92	TBK288									
	04/92→	TBK078									



kW



FORD

...FORD

...ORION III (GAL)

1.6 i 16V	L1E, L1K	66	07/92 → 12/93		Eng. L1E, A/C(-), MS, →08/93	MVB915R6	6PK915
					Eng. L1E, A/C(-), PS, →08/93	MVB1820R6	6PK1820
					Eng. L1E, A/C(+), MS, →08/93	MVB1538R6	6PK1538
					Eng. L1E, A/C(+), PS, →08/93	MVB1904R6	6PK1904
					→08/93	TB390	131x25.4
					→08/93, check kit comp.	TBK079	
					→08/93, check kit comp.	TBK120	
					A/C(-), MS, →05/91	MVB648R3	3PK648
					A/C(-), MS, 05/91 →08/93	MVB675R3	3PK675
					A/C(+), →08/93	MVB1015R5	5PK1015
1.8 D	RTE, RTF, RTH	44	11/90 → 12/93		→08/93	TB237	116x20
					→08/93	TBK011	
					→08/93, inj. pump	TBK012	
					→08/93	TB495	85x22
					A/C(-), MS, →08/93	MVB915R6	6PK915
1.8 i 16V	RDA	77	02/92 → 12/93		A/C(-), PS, →08/93	MVB1820R6	6PK1820
					A/C(+), MS, →08/93	MVB1538R6	6PK1538
					A/C(+), PS, →08/93	MVB1904R6	6PK1904
					→08/93	TB390	131x25.4
					→08/93, check kit comp.	TBK079	
	RQB	96	01/92 → 12/93		→08/93, check kit comp.	TBK120	
					A/C(-), MS, →08/93	MVB915R6	6PK915
					A/C(-), PS, →08/93	MVB1820R6	6PK1820
					A/C(+), MS, →08/93	MVB1538R6	6PK1538
					A/C(+), PS, →08/93	MVB1904R6	6PK1904
1.8 TD	RFD, RFK	66	03/92 → 12/93		→08/93	TB390	131x25.4
					→08/93, check kit comp.	TBK079	
					→08/93, check kit comp.	TBK120	
					A/C(-), MS, →08/93	MVB675R3	3PK675
					A/C(+), →08/93	MVB1015R5	5PK1015
					→08/93	TB237	116x20
					→08/93	TBK011	
					→08/93, inj. pump	TBK012	
					→08/93	TB495	85x22
					A/C(-), MS, →08/93	MVB675R3	3PK675

P 100 II

1.8 TD	RFA	55	10/87 → 12/92			MVB813R3	3PK813
						TB237	116x20
						TBK011	
					inj. pump	TBK012	
						TB495	85x22
2.0	NAE	57	10/87 →		MS	MVB825R3	3PK825
					PS	MVB1025R3	3PK1025
					→12/94	SVB10913	10x913
					→12/94	TB102	122x19
					→12/94	TBK058	

PUMA (EC_)

1.4 16V	FHD, FHF	66	11/97 → 10/00		A/C(-), MS	MVB1180R6	6PK1180
					A/C(-), PS	MVB1768R6	6PK1768
					A/C(+), MS	MVB1775R6	6PK1775
					A/C(+), PS	MVB1930R6	6PK1930
						TB472	117x22
1.6 16V	L1W	76	08/00 →			TBK276	
					A/C(-), →05/02	MVB1768R6	6PK1768
					A/C(+), →05/02	MVB1930R6	6PK1930
					→05/02	TB472	117x22
					→05/02	TBK276	
1.7 16V	MHA, MHB	92	03/97 →		A/C(-), →05/02	MVB1755R6	6PK1755
					A/C(+), →05/02	MVB1930R6	6PK1930
					→05/02	TB472	117x22



kw



...FORD

...PUMA (EC_)

ST 160		118	06/99 →		A/C(-), →05/02	MVB1755R6	6PK1755
					A/C(+), →05/02	MVB1930R6	6PK1930
					→05/02	TB472	117x22

RANGER (TU_)

2.5 D	WL	57	10/99 → 04/02			SVB131000	13x1000
						SVB131100	13x1100
						TB536	101x30
2.5 D 4x4	WL	57	10/99 → 04/02			SVB131000	13x1000
						SVB131100	13x1100
						TB536	101x30
2.5 TD		62	04/02 →		→09/05	SVB131000	13x1000
					→09/05	SVB131100	13x1100
					→09/05	TB536	101x30
2.5 TD 4x4	WL-T	80	10/99 →		→09/05	SVB131000	13x1000
					→09/05	SVB131100	13x1100
					→09/05	TB536	101x30
		62	04/02 →		→09/05	SVB131000	13x1000
					→09/05	SVB131100	13x1100
					→09/05	TB536	101x30
3.0 TDCi		115	10/05 →			SVB131000	13x1000
3.0 TDCi 4x4		115	10/05 →			SVB131000	13x1000

SCORPIO I (GAE, GGE)

1.8	REC	66	04/85 → 02/92		→10/88	SVB10975	10x975
					MS, →10/88	SVB12885	12x885
					PS, →10/88	SVB121170	12x1170
					→10/88	TB102	122x19
					→10/88	TBK058	
2.0	N8D, NEL	77	04/85 → 08/89			SVB10975	10x975
					MS	SVB10913	10x913
					MS	SVB12885	12x885
					PS	SVB121170	12x1170
						TB102	122x19
						TBK058	
		80	11/88 → 10/92		A/C(-), MS, AUTO	MVB1230R6	6PK1230
					A/C(-), MS, MAN	MVB1270R6	6PK1270
					A/C(-), PS, →04/92	MVB1820R6	6PK1820
					A/C(-), PS, 04/92 →	MVB1805R6	6PK1805
					A/C(+), MS	MVB1560R6	6PK1560
					A/C(+), PS, →04/92	MVB1960R6	6PK1960
					A/C(+), PS, 04/92 →	MVB1950R6	6PK1950
2.0 i	NRC	74	10/85 → 12/90		→02/90	SVB10975	10x975
					MS, Carb, →02/90	SVB10913	10x913
					MS, Carb, →02/90	SVB12885	12x885
					PS, →02/90	SVB121170	12x1170
					→02/90	TB102	122x19
					→02/90	TBK058	
	NRA, NRI	85	04/85 → 02/92		Eng. NRA	SVB10975	10x975
					A/C(-), MS, 11/88 →	MVB1230R6	6PK1230
					A/C(-), PS, 11/88 →	MVB1820R6	6PK1820
					A/C(+), MS, 11/88 →	MVB1560R6	6PK1560
					A/C(+), PS, 11/88 →	MVB1960R6	6PK1960
					Eng. NRA, PS	SVB121170	12x1170
						TB102	122x19
						TBK058	
		85	02/92 → 09/94		A/C(-), MS	MVB1230R6	6PK1230
					A/C(-), PS	MVB1805R6	6PK1805
					A/C(-), PS, →04/92	MVB1820R6	6PK1820
					A/C(+), MS	MVB1560R6	6PK1560
					A/C(+), PS	MVB1950R6	6PK1950
					A/C(+), PS, →04/92	MVB1960R6	6PK1960





kW



...FORD

...SCORPIO I (GAE, GGE)

...2.0 i	N9D	88	05/89 → 09/94	⊗	A/C(-), PS, →04/92	MVB1820R6	6PK1820
				⊗	A/C(-), PS, 04/92→	MVB1805R6	6PK1805
				⊗	A/C(+), MS	MVB1560R6	6PK1560
				⊗	A/C(+), PS, →04/92	MVB1960R6	6PK1960
				⊗	A/C(+), PS, 04/92→	MVB1950R6	6PK1950
2.4 i	ARD	92	10/88 → 02/92	⊗		SVB121015	12x1015
				⊗		SVB13900	13x900
	ARC	96	09/86 → 09/88	⊗		SVB131200	13x1200
				⊗		SVB10888	10x888
				⊗		SVB121015	12x1015
2.4 i CAT	ARD	92	10/88 → 09/94	⊗		SVB13900	13x900
				⊗		SVB121015	12x1015
				⊗		SVB131200	13x1200
				⊗		SVB13900	13x900
				⊗		SVB131200	13x1200
2.5 D	STR	51	12/85 → 02/92	⊗		SVB13950	13x950
				⊗		SVB131150	13x1150
				⊗		SVB131025	13x1025
				⊗		SVB10690	10x690
				⊗		SVB131200	13x1200
2.5 TD	SFA, SFB	68	06/88 → 07/93	⊗		SVB13950	13x950
				⊗		SVB131150	13x1150
				⊗		SVB131025	13x1025
				⊗		SVB131200	13x1200
				⊗		SVB13900	13x900
2.8 i	PRE	110	04/85 → 11/86	⊗		SVB10888	10x888
				⊗		SVB121015	12x1015
				⊗		SVB13900	13x900
				⊗		SVB131175	13x1175
				⊗		SVB131200	13x1200
2.8 i 4x4	PRE	110	10/85 → 11/86	⊗		SVB10888	10x888
				⊗		SVB13900	13x900
				⊗		SVB131175	13x1175
				⊗		SVB131200	13x1200
				⊗		SVB10888	10x888
2.9 i	BRD, BRE, BRF	107	09/86 → 09/94	⊗		SVB10888	10x888
				⊗		SVB10975	10x975
				⊗		SVB13900	13x900
				⊗		SVB131200	13x1200
				⊗		SVB10888	10x888
	BRC	110	09/86 → 09/94	⊗		SVB10888	10x888
				⊗		SVB10975	10x975
				⊗		SVB13900	13x900
				⊗		SVB131200	13x1200
				⊗		SVB10888	10x888
2.9 i 24V	BOA	143	04/91 → 09/94	⊗		MVB975R4	4PK975
				⊗		SVB10975	10x975
				⊗		SVB13900	13x900
				⊗		MVB1413R6	6PK1413
				⊗		SVB131200	13x1200
2.9 i 4x4	BRC	110	09/86 → 09/94	⊗		SVB10888	10x888
				⊗		SVB121015	12x1015
				⊗		SVB13900	13x900
				⊗		SVB131200	13x1200
				⊗		SVB10888	10x888
	BRD, BRE, BRF	107	05/88 → 02/93	⊗		SVB10888	10x888
				⊗		SVB10975	10x975
				⊗		SVB13900	13x900
				⊗		SVB131200	13x1200
				⊗		SVB10888	10x888
2.9 i CAT	BRE	107	10/87 → 09/94	⊗		SVB10888	10x888
				⊗		SVB10975	10x975
				⊗		SVB13900	13x900
				⊗		SVB131200	13x1200
				⊗		SVB10888	10x888



kW



...FORD

FORD

SCORPIO I Estate (GGE)

2.0 i	N9F	85	09/91 → 09/94	⊗	A/C(-), MS	MVB1230R6	6PK1230
				⊗	A/C(-), PS, →04/92	MVB1820R6	6PK1820
				⊗	A/C(-), PS, 04/92→	MVB1805R6	6PK1805
				⊗	A/C(+), MS	MVB1560R6	6PK1560
				⊗	A/C(+), PS, →04/92	MVB1960R6	6PK1960
	N9D	88	09/91 → 09/94	⊗	A/C(-), PS, →04/92	MVB1820R6	6PK1820
				⊗	A/C(-), PS, 04/92→	MVB1805R6	6PK1805
				⊗	A/C(+), MS	MVB1560R6	6PK1560
				⊗	A/C(+), PS, →04/92	MVB1960R6	6PK1960
				⊗	A/C(+), PS, 04/92→	MVB1950R6	6PK1950
2.4 i	ARD	92	09/91 → 09/94	⊗		SVB121015	12x1015
				⊗		SVB13900	13x900
				⊗	→02/92	SVB131200	13x1200
2.5 D		51	10/90 → 08/92	⊗		SVB13950	13x950
				⊗		SVB131150	13x1150
				⊗		SVB131025	13x1025
				⊗		SVB10690	10x690
2.5 TD	SFA, SFB	68	09/91 → 07/93	⊗		SVB13950	13x950
				⊗		SVB131150	13x1150
				⊗		SVB131025	13x1025
2.9 24V	BOA	143	08/93 → 09/94	⊗		MVB975R4	4PK975
				⊗		MVB1413R6	6PK1413
2.9 i	BRD, BRE, BRF	107	09/91 → 09/94	⊗	Cat(+)	SVB10975	10x975
				⊗		SVB13900	13x900
				⊗	→02/92	SVB131200	13x1200
2.9 i 4x4	BRD, BRE, BRF	107	05/88 → 02/93	⊗	→08/88	SVB10888	10x888
				⊗	Cat(+)	SVB10975	10x975
				⊗		SVB13900	13x900
				⊗	→02/92	SVB131200	13x1200

SCORPIO I Saloon (GGE)

2.0 i	N9F	85	02/92 → 09/94	⊗	A/C(-), MS	MVB1230R6	6PK1230
				⊗	A/C(-), PS	MVB1805R6	6PK1805
				⊗	A/C(-), PS, →04/92	MVB1820R6	6PK1820
				⊗	A/C(+), MS	MVB1560R6	6PK1560
				⊗	A/C(+), PS	MVB1950R6	6PK1950
	N9D	88	05/89 → 09/94	⊗	A/C(+), PS, →04/92	MVB1960R6	6PK1960
				⊗	A/C(-), PS, →04/92	MVB1820R6	6PK1820
				⊗	A/C(-), PS, 04/92→	MVB1805R6	6PK1805
				⊗	A/C(+), MS	MVB1560R6	6PK1560
				⊗	A/C(+), PS, →04/92	MVB1960R6	6PK1960
		92	05/89 → 02/92	⊗	A/C(+), PS, 04/92→	MVB1950R6	6PK1950
				⊗	A/C(-), MS, AUTO	MVB1230R6	6PK1230
				⊗	A/C(-), MS, MAN	MVB1270R6	6PK1270
				⊗	A/C(-), PS	MVB1820R6	6PK1820
				⊗	A/C(+), MS	MVB1560R6	6PK1560
2.4 i	ARD	92	10/88 → 10/94	⊗	A/C(+), PS	MVB1960R6	6PK1960
				⊗		SVB121015	12x1015
				⊗		SVB13900	13x900
2.5 D		51	12/89 → 12/94	⊗	→02/92	SVB131200	13x1200
				⊗	→08/92	SVB13950	13x950
				⊗	→08/92	SVB131150	13x1150
				⊗	→08/92	SVB131025	13x1025
2.5 TD	SFA, SFB	68	06/88 → 07/93	⊗	→08/92	SVB10690	10x690
				⊗		SVB13950	13x950
				⊗		SVB131150	13x1150
				⊗		SVB131025	13x1025
				⊗		SVB10690	10x690
				⊗		SVB131025	13x1025



kW



FORD

...FORD

...SCORPIO I Saloon (GGE)

2.9 i	BRD, BRE, BRF	107	09/86 → 12/94		→08/88	SVB10888	10x888
					Cat(+)	SVB10975	10x975
						SVB13900	13x900
					→02/92	SVB131200	13x1200
2.9 i 24V	BOA	143	04/91 → 09/94		08/91 → 08/92	MVB960R4	4PK960
					08/92 →	MVB975R4	4PK975
					Cat(-)	SVB121015	12x1015
					Cat(+)	SVB10975	10x975
						SVB13900	13x900
					08/91 →	MVB1413R6	6PK1413
					→02/92	SVB131200	13x1200
2.9 i 4x4	BRD, BRE, BRF	107	12/89 → 10/94		Cat(+)	SVB121015	12x1015
						SVB13900	13x900
					→02/92	SVB131200	13x1200

SCORPIO II (GFR, GGR)

2.0 i	NSD	85	10/94 → 08/98		A/C(-)	MVB1755R6	6PK1755
					A/C(+)	MVB1904R6	6PK1904
2.0 i 16V	N3A	100	10/94 → 08/98		A/C(-), →05/96	MVB1755R6	6PK1755
					A/C(+), →05/96	MVB1904R6	6PK1904
2.3 i 16V	Y5A	108	06/96 → 08/98		A/C(-), MAN	MVB1755R6	6PK1755
					A/C(+), MAN	MVB2040R6	6PK2040
					AUTO	MVB1904R6	6PK1904
2.5 TD	SCC	85	10/94 → 08/98		A/C(-), 09/96 →	MVB1910R7	7PK1910
	VM	92	09/96 → 08/98		A/C(-)	MVB1910R7	7PK1910
2.9 i	BRG	110	02/95 → 08/98		→06/96	MVB1015R4	4PK1015
					→06/96	MVB1413R6	6PK1413
2.9 i 24V	BOB	152	10/94 → 08/98			MVB1015R4	4PK1015
						MVB1413R6	6PK1413

SCORPIO II Estate (GNR, GGR)

2.0 i	NSD	85	10/94 → 08/98		A/C(-)	MVB1755R6	6PK1755
					A/C(+)	MVB1904R6	6PK1904
2.0 i 16V	N3A	100	10/94 → 08/98		A/C(-), →05/96	MVB1755R6	6PK1755
					A/C(+), →05/96	MVB1904R6	6PK1904
2.3 i 16V	Y5A	108	06/96 → 08/98		A/C(-), MAN	MVB1755R6	6PK1755
					A/C(+), MAN	MVB2040R6	6PK2040
					AUTO	MVB1904R6	6PK1904
2.5 TD	SCC	85	10/94 → 08/98		A/C(-), 09/96 →	MVB1910R7	7PK1910
	VM	92	09/96 → 08/98		A/C(-)	MVB1910R7	7PK1910
2.9 i	BRG	110	02/95 → 08/98		→06/96	MVB1015R4	4PK1015
					→06/96	MVB1413R6	6PK1413
2.9 i 24V	BOB	152	10/94 → 08/98			MVB1015R4	4PK1015
						MVB1413R6	6PK1413

SIERRA (GBG, GB4)

1.6	LSE	55	01/87 → 02/93		→09/91	SVB10775	10x775
					→09/91	TB240	97x19.8
					→09/91	TBK288	
	LSF	53	01/88 → 02/93			SVB12775	12x775
					→04/92	TB240	97x19.8
					04/92 →	TB389	97x21.6
					→04/92	TBK288	
					04/92 →	TBK078	
1.6 i	L6B	59	10/89 → 02/93			SVB10775	10x775
						SVB10913	10x913
					→04/92	TB240	97x19.8
					→12/89	TB102	122x19
					04/92 →	TB389	97x21.6
					SOHC/OHC	TB101	119x19
					→04/92	TBK288	
					→12/89	TBK058	
					04/92 →	TBK078	
					SOHC/OHC	TBK057	



kw



...FORD

...SIERRA (GBG, GB4)

FORD

1.8	R2C, R6A	64	05/88 → 02/93		MS, MAN, 10/89 →	MVB788R5	5PK788
					PS, 10/89 →	MVB1050R5	5PK1050
					10/89 →	TB230	97x25.4
	R2A, RED	66	01/87 → 05/88		Eng. R2A	SVB12875	12x875
					Eng. R2A	SVB10975	10x975
					Eng. R2A, MS	SVB10913	10x913
					Eng. R2A, PS	SVB121170	12x1170
					MS	SVB12885	12x885
						TB102	122x19
						TBK058	
1.8 TD	RFA, RFB, RFL	55	08/88 → 02/93		Eng. RFB, 10/89 →	MVB813R3	3PK813
					10/89 →	TB237	116x20
					Eng. RFB, 10/89 →	TBK011	
					Eng. RFB, 10/89 →, inj. pump	TBK012	
					10/89 →	TB495	85x22
					Eng. RFB, PS, 10/89 →	MVB1025R3	3PK1025
2.0	N8C, NES	77	01/87 → 02/93		→09/89	SVB10975	10x975
					MS, →09/89	SVB12885	12x885
					MS, MAN, →09/89	SVB10913	10x913
					PS, →09/89	SVB121170	12x1170
					→09/89	TB102	122x19
					→09/89	TBK058	
2.0 4x4	N9C	88	01/90 → 02/93		A/C(-), MS	MVB1230R6	6PK1230
					A/C(-), PS, →04/92	MVB1820R6	6PK1820
					A/C(-), PS, 04/92 →	MVB1805R6	6PK1805
					A/C(+), MS	MVB1560R6	6PK1560
					A/C(+), PS, →04/92	MVB1960R6	6PK1960
					A/C(+), PS, 04/92 →	MVB1950R6	6PK1950
					A/C(-), MS, Inj	MVB1230R6	6PK1230
	92	01/90 → 02/93		A/C(-), MS, MAN, Carb	MVB1270R6	6PK1270	
				A/C(-), PS, →04/92	MVB1820R6	6PK1820	
				A/C(-), PS, 04/92 →	MVB1805R6	6PK1805	
				A/C(+), MS	MVB1560R6	6PK1560	
				A/C(+), PS, →04/92	MVB1960R6	6PK1960	
				A/C(+), PS, 04/92 →	MVB1950R6	6PK1950	
2.0 i	N4A, N4I	85	01/87 → 02/93		→09/89	SVB10975	10x975
					MS, AUTO, →09/89	SVB10913	10x913
					MS, MAN, →09/89	SVB12885	12x885
					PS, →09/89	SVB121170	12x1170
					→09/89	TB102	122x19
					→09/89	TBK058	
	N9C	88	01/90 → 02/93		A/C(-), MS	MVB1230R6	6PK1230
					A/C(-), PS, →04/92	MVB1820R6	6PK1820
					A/C(-), PS, 04/92 →	MVB1805R6	6PK1805
					A/C(+), MS	MVB1560R6	6PK1560
					A/C(+), PS, →04/92	MVB1960R6	6PK1960
					A/C(+), PS, 04/92 →	MVB1950R6	6PK1950
	NE5, NEJ	74	01/87 → 12/89		MS	SVB10975	10x975
					MS, AUTO	SVB12885	12x885
					PS	SVB10913	10x913
						SVB121170	12x1170
						TB102	122x19
						TBK058	
N9C	92	01/90 → 02/93		A/C(-), MS	MVB1230R6	6PK1230	
				A/C(-), PS, →04/92	MVB1820R6	6PK1820	
				A/C(-), PS, 04/92 →	MVB1805R6	6PK1805	
				A/C(+), MS	MVB1560R6	6PK1560	
				A/C(+), PS, →04/92	MVB1960R6	6PK1960	
				A/C(+), PS, 04/92 →	MVB1950R6	6PK1950	



kW



...FORD

...SIERRA (GBG, GB4)

2.0 i CAT	N4B	74	01/87 → 02/93	⚙️	→09/89	SVB10975	10x975
				⚙️	MS, →09/89	SVB12885	12x885
				⚙️	MS, AUTO, →09/89	SVB10913	10x913
				⚙️	PS, →09/89	SVB121170	12x1170
					→09/89	TB102	122x19
				KIT	→09/89	TBK058	
2.0 i DOHC	N9E	85	12/91 → 02/93	⚙️	A/C(-), MS, AUTO	MVB1230R6	6PK1230
				⚙️	A/C(-), MS, MAN	MVB1270R6	6PK1270
				⚙️	A/C(-), PS, →04/92	MVB1820R6	6PK1820
				⚙️	A/C(-), PS, 04/92→	MVB1805R6	6PK1805
				⚙️	A/C(+), MS	MVB1560R6	6PK1560
				⚙️	A/C(+), PS, →04/92	MVB1960R6	6PK1960
2.3 D	YTR, YTT	49	01/87 → 09/89	⚙️	Eng. YTR	SVB131150	13x1150
				⊕	Eng. YTR	SVB131025	13x1025
					Eng. YTR	SVB10690	10x690
					Eng. YTR	SVB13900	13x900
2.9 4x4	B4B, B4C	110	08/88 → 02/93	⚙️		SVB121015	12x1015
				⚙️	PS	SVB13900	13x900
				⊕	→02/92	SVB131200	13x1200
		107	08/88 → 02/93	⚙️		SVB121015	12x1015
				⚙️	PS	SVB13900	13x900
				⊕	→02/92	SVB131200	13x1200
2.9 i	B4B, B4C	107	08/88 → 02/93	⚙️		SVB121015	12x1015
				⚙️	PS	SVB13900	13x900
				⊕	→02/92	SVB131200	13x1200
		110	08/88 → 02/93	⚙️		SVB121015	12x1015
				⚙️	PS	SVB13900	13x900
				⊕	→02/92	SVB131200	13x1200

SIERRA Estate (BNC)

1.6	LCS, LCT, LSD	55	08/82 → 12/86	⚙️	→08/84	SVB12875	12x875
				⚙️	08/84→	SVB10913	10x913
						TB101	119x19
						TB102	122x19
				KIT		TBK057	
				KIT		TBK058	
1.8	REB	66	10/84 → 12/86			SVB12875	12x875
				⚙️		SVB10975	10x975
				⚙️	MS	SVB10913	10x913
				⚙️	MS	SVB12885	12x885
				⚙️	PS	SVB121170	12x1170
						TB102	122x19
2.0	NRD	74	10/85 → 12/86	⚙️	MS	SVB10913	10x913
				⚙️	PS	SVB101375	10x1375
						TB102	122x19
	NET	77	08/82 → 12/86	KIT		TBK058	
						SVB12885	12x885
				⚙️	MS, →08/84	SVB12875	12x875
NR2, NRB	85	03/85 → 12/86	08/82 → 12/86	⚙️	MS, 08/84→	SVB10913	10x913
				⚙️	PS, →10/84	SVB121170	12x1170
				⚙️	PS, 10/84→	SVB101375	10x1375
						TB102	122x19
				KIT		TBK058	
						SVB12885	12x885
NYT	66	08/82 → 10/84	⚙️	Eng. NR2, A/C(-)	SVB10913	10x913	
			⚙️	Eng. NR2, A/C(+)	SVB10975	10x975	
					TB102	122x19	
				KIT		TBK058	
				⚙️		SVB121040	12x1040
				⚙️		SVB101000	10x1000
				⊕		SVB131225	13x1225



kW



...FORD

...SIERRA Estate (BNC)

2.3	YTT	84	08/82 → 12/86	⊗	→10/84	SVB101000	10x1000	
				⊗	MS	SVB121040	12x1040	
				⊗	PS, 10/84→	SVB13900	13x900	
				⊗	→10/84	SVB131225	13x1225	
				⊗	10/84→	SVB131175	13x1175	
2.3 D	YTT	49	08/82 → 12/86	⊗		SVB10950	10x950	
				⊗	→02/86	SVB10913	10x913	
				⊗	02/86→	SVB10925	10x925	
				⊗	→07/84	SVB10725	10x725	
				⊗	07/84→	SVB10710	10x710	
				⊗		SVB101075	10x1075	
2.8 i 4x4		105	08/82 → 12/86	⊗		SVB121040	12x1040	
				⊗	→10/84	SVB101000	10x1000	
				⊗	PS, 10/84→	SVB13900	13x900	
				⊗	→10/84	SVB131225	13x1225	
				⊗	10/84→	SVB131175	13x1175	
			107	08/82 → 12/86	⊗		SVB121040	12x1040
					⊗	→10/84	SVB101000	10x1000
					⊗	PS, 10/84→	SVB13900	13x900
					⊗	→10/84	SVB131225	13x1225
					⊗	10/84→	SVB131175	13x1175
2.8 XR4i	PR6	105	08/82 → 12/86	⊗		SVB121040	12x1040	
				⊗	→10/84	SVB101000	10x1000	
				⊗	PS, 10/84→	SVB13900	13x900	
				⊗	→10/84	SVB131225	13x1225	
	PR5	107	08/82 → 12/86	08/82 → 12/86	⊗		SVB121040	12x1040
					⊗	→10/84	SVB101000	10x1000
					⊗	PS, 10/84→	SVB13900	13x900
					⊗	→10/84	SVB131225	13x1225
					⊗	10/84→	SVB131175	13x1175

SIERRA Estate (BNG)

1.6	LSF	53	01/88 → 02/93	⊗		SVB12775	12x775	
				⊗	→04/92	TB240	97x19.8	
				⊗	04/92→	TB389	97x21.6	
				⊗	→04/92	TBK288		
	LSE	55	01/87 → 02/93	01/87 → 02/93	⊗		SVB12775	12x775
					⊗	→02/87	SVB10913	10x913
					⊗	→02/87, check teeth	TB101	119x19
					⊗	→02/87, check teeth	TB102	122x19
					⊗	→04/92	TB240	97x19.8
					⊗	04/92→	TB389	97x21.6
1.6 i	L6B	59	10/89 → 02/93	⊗		SVB10775	10x775	
				⊗		SVB10913	10x913	
				⊗	→04/92	TB240	97x19.8	
				⊗	04/92→	TB389	97x21.6	
				⊗	check teeth	TB101	119x19	
				⊗	check teeth	TB102	122x19	
				⊗	→04/92	TBK288		
				⊗	04/92→	TBK078		
				⊗	check teeth	TBK057		
				⊗	check teeth	TBK058		



kW



...FORD

...SIERRA Estate (BNG)

1.8	R2C, R6A	64	05/88 → 02/93		MS, MAN, 10/89→	MVB788R5	5PK788
					PS, 10/89→	MVB1050R5	5PK1050
					10/89→	TB230	97x25.4
1.8 TD	R2A, RED	66	01/87 → 05/88			SVB12875	12x875
						SVB10975	10x975
					MS	SVB10913	10x913
					MS	SVB12885	12x885
					PS	SVB121170	12x1170
						TB102	122x19
						TBK058	
1.8 TD	RFA, RFB, RFL	55	08/88 → 02/93		10/89→	MVB813R3	3PK813
					10/89→	TB237	116x20
					10/89→	TBK011	
					10/89→, inj. pump	TBK012	
					10/89→	TB495	85x22
					MS, 10/89→	MVB825R3	3PK825
2.0	N8C, NES	77	01/87 → 02/93		PS, 10/89→	MVB1025R3	3PK1025
					→09/89	SVB10975	10x975
2.0	N8C, NES	77	01/87 → 02/93		MS, AUTO, →09/89	SVB10913	10x913
					MS, MAN, →09/89	SVB12885	12x885
					PS, →09/89	SVB121170	12x1170
					→09/89	TB102	122x19
					→09/89	TBK058	
2.0 4x4	N9C	88	02/90 → 02/93		A/C(-), MS, 10/91→	MVB1230R6	6PK1230
					A/C(-), PS, 04/92→	MVB1805R6	6PK1805
					A/C(-), PS, 10/91→04/92	MVB1820R6	6PK1820
					A/C(+), MS, 10/91→	MVB1560R6	6PK1560
					A/C(+), PS, 04/92→	MVB1950R6	6PK1950
					A/C(+), PS, 10/91→04/92	MVB1960R6	6PK1960
					A/C(+), PS, 04/92→	MVB1820R6	6PK1820
		92	05/89 → 02/93		A/C(-), PS, →04/92	MVB1805R6	6PK1805
					A/C(-), PS, 04/92→	MVB1805R6	6PK1805
					A/C(+), MS	MVB1560R6	6PK1560
					A/C(+), PS, →04/92	MVB1960R6	6PK1960
					A/C(+), PS, 04/92→	MVB1950R6	6PK1950
2.0 i	N4A, N4I	85	01/87 → 02/93		→09/89	SVB10975	10x975
					MS, AUTO, →09/89	SVB10913	10x913
					MS, MAN, →09/89	SVB12885	12x885
					PS, →09/89	SVB121170	12x1170
					→09/89	TB102	122x19
					→09/89	TBK058	
	N9C	88	05/89 → 02/93		A/C(-), PS, →04/92	MVB1820R6	6PK1820
					A/C(-), PS, 04/92→	MVB1805R6	6PK1805
					A/C(+), MS	MVB1560R6	6PK1560
					A/C(+), PS, →04/92	MVB1960R6	6PK1960
					A/C(+), PS, 04/92→	MVB1950R6	6PK1950
NE5, NEJ	74	01/87 → 02/93		→09/89	SVB10975	10x975	
				MS, AUTO, →09/89	SVB10913	10x913	
				MS, MAN, →09/89	SVB12885	12x885	
				PS, →09/89	SVB121170	12x1170	
				→09/89	TB102	122x19	
				→09/89	TBK058		
N9C	92	05/89 → 02/93		A/C(-), MS, AUTO	MVB1230R6	6PK1230	
				A/C(-), MS, MAN	MVB1270R6	6PK1270	
				A/C(-), PS, →04/92	MVB1820R6	6PK1820	
				A/C(-), PS, 04/92→	MVB1805R6	6PK1805	
				A/C(+), MS	MVB1560R6	6PK1560	
				A/C(+), PS, →04/92	MVB1960R6	6PK1960	
				A/C(+), PS, 04/92→	MVB1950R6	6PK1950	



kw



...FORD

...SIERRA Estate (BNG)

FORD	2.0 i CAT	N4B	74	01/87 → 02/93	☼ ⊗ ⊗ ⊗ ☞ ☞KIT	→09/89 MS, →09/89 MS, MAN, →09/89 PS, →09/89 →09/89 →09/89	SVB10975 SVB12885 SVB10913 SVB121170 TB102 TBK058	10x975 12x885 10x913 12x1170 122x19
	2.0 i DOHC	N9E	85	12/91 → 02/93	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), MS, AUTO A/C(-), MS, MAN A/C(-), PS, →04/92 A/C(-), PS, 04/92→ A/C(+), MS A/C(+), PS, →04/92 A/C(+), PS, 04/92→	MVB1230R6 MVB1270R6 MVB1820R6 MVB1805R6 MVB1560R6 MVB1960R6 MVB1950R6	6PK1230 6PK1270 6PK1820 6PK1805 6PK1560 6PK1960 6PK1950
	2.3 D	YTR	49	01/87 → 02/93	⊗ ☺ ☼ ☞	→01/90 →01/90 →01/90 →01/90	SVB131150 SVB131025 SVB10690 SVB13900	13x1150 13x1025 10x690 13x900
	2.8 4x4	PRG	110	01/87 → 08/88	☼ ⊗ ☺ ☼	PS →04/87	SVB121040 SVB13900 SVB131200 SVB131175	12x1040 13x900 13x1200 13x1175
	2.9	B4B, B4C	107	08/88 → 02/93	☼ ⊗ ☺	PS →02/92	SVB121015 SVB13900 SVB131200	12x1015 13x900 13x1200
	2.9 4x4	B4B, B4C	107	08/88 → 02/93	☼ ⊗ ☺ ☼ ⊗ ☺	PS →02/92	SVB121015 SVB13900 SVB131200 SVB121015 SVB13900 SVB131200	12x1015 13x900 13x1200 12x1015 13x900 13x1200
	2.9 4x4	B4B, B4C	110	08/88 → 02/93	☼ ⊗ ☺	PS →02/92	SVB121015 SVB13900 SVB131200	12x1015 13x900 13x1200
	2.9 i	B4B, B4C	110	08/88 → 02/93	☼ ⊗ ☺	PS →02/92	SVB121015 SVB13900 SVB131200	12x1015 13x900 13x1200

SIERRA Hatchback (GBC)

FORD	1.3	JCT	44	08/82 → 12/86	⊗ ⊗ ☞ ☞KIT	→08/84 08/84→	SVB12875 SVB10913 TB101 TBK057	12x875 10x913 119x19
	1.6	LCS, LCT, LSD	55	08/82 → 12/86	⊗ ⊗ ☞ ☞ ☞KIT ☞KIT	→08/84 08/84→ check teeth check teeth check teeth check teeth	SVB12875 SVB10913 TB101 TB102 TBK057 TBK058	12x875 10x913 119x19 122x19
	1.6	LCS, LCT, LSD	58	08/84 → 12/86	⊗ ☞ ☞ ☞KIT ☞KIT	check teeth check teeth check teeth check teeth	SVB10913 TB101 TB102 TBK057 TBK058	10x913 119x19 122x19
	1.8	REB	66	10/84 → 12/86	☼ ☼ ⊗ ⊗ ⊗ ☞ ☞KIT	MS MS PS	SVB12875 SVB10975 SVB10913 SVB12885 SVB121170 TB102 TBK058	12x875 10x975 10x913 12x885 12x1170 122x19





kW



...FORD

...SIERRA Hatchback (GBC)

FORD

2.0	NRD	74	10/85 → 12/86		MS	SVB10913	10x913
					PS	SVB101375	10x1375
						TB102	122x19
						TBK058	
						SVB12885	12x885
	NET	77	08/82 → 12/86		MS, →08/84	SVB12875	12x875
				MS, 08/84 →	SVB10913	10x913	
					PS, →10/84	SVB121170	12x1170
					PS, 10/84 →	SVB101375	10x1375
						TB102	122x19
						TBK058	
						SVB12885	12x885
	NYT	66	08/82 → 10/84			SVB121040	12x1040
						SVB101000	10x1000
						SVB131225	13x1225
2.0 4x4		150	10/85 → 02/87			SVB10913	10x913
						TB319	144x25.4
2.0 i	NR2, NRB	85	03/85 → 12/86		Eng. NR2, A/C(-)	SVB10913	10x913
					Eng. NR2, A/C(+)	SVB10975	10x975
						TB102	122x19
						TBK058	
2.3	YYT	84	08/82 → 12/86		→10/84	SVB101000	10x1000
					MS	SVB121040	12x1040
					PS, 10/84 →	SVB13900	13x900
					→10/84	SVB131225	13x1225
					10/84 →	SVB131175	13x1175
2.3 D	YTT	49	08/82 → 12/86			SVB10950	10x950
					→02/86	SVB10913	10x913
					02/86 →	SVB10925	10x925
					→07/84	SVB10725	10x725
					07/84 →	SVB10710	10x710
						SVB101075	10x1075
2.8 i XR 4x4		107	09/83 → 12/86			SVB121040	12x1040
					→10/84	SVB101000	10x1000
					PS, 10/84 →	SVB13900	13x900
					→10/84	SVB131225	13x1225
					10/84 →	SVB131175	13x1175
2.8 XR 4x4	PRT	110	02/85 → 12/86			SVB121040	12x1040
					PS	SVB13900	13x900
						SVB131175	13x1175
2.8 XR4i	PRT	110	08/82 → 12/86			SVB121040	12x1040
					→10/84	SVB101000	10x1000
					PS, 10/84 →	SVB13900	13x900
					→10/84	SVB131225	13x1225
					10/84 →	SVB131175	13x1175
	PR6	105	08/82 → 12/86			SVB121040	12x1040
					→10/84	SVB101000	10x1000
					PS, 10/84 →	SVB13900	13x900
					→10/84	SVB131225	13x1225
					10/84 →	SVB131175	13x1175
PR5	107	08/82 → 12/86			SVB121040	12x1040	
				→10/84	SVB101000	10x1000	
				PS, 10/84 →	SVB13900	13x900	
				→10/84	SVB131225	13x1225	
				10/84 →	SVB131175	13x1175	



kw



...FORD

SIERRA Hatchback (GBC, GBG)

FORD

1.6	LSE	55	01/87 → 02/93			SVB12775	12x775	
					→04/92	TB240	97x19.8	
					04/92 →	TB389	97x21.6	
	LSF	53	01/88 → 02/93			SVB12775	12x775	
					→04/92	TB240	97x19.8	
					04/92 →	TB389	97x21.6	
1.6 i	L6B	59	10/89 → 02/93			SVB10775	10x775	
						SVB10913	10x913	
					→04/92	TB240	97x19.8	
					04/92 →	TB389	97x21.6	
					check teeth	TB101	119x19	
					check teeth	TB102	122x19	
	1.8	R2C, R6A	64	05/88 → 02/93		MS, MAN, 10/89 →	MVB788R5	5PK788
						PS, 10/89 →	MVB1050R5	5PK1050
						10/89 →	TB230	97x25.4
		R2A, RED	66	01/87 → 05/88			SVB12875	12x875
							SVB10975	10x975
						MS	SVB10913	10x913
1.8 TD	RFA, RFB, RFL	55	08/88 → 02/93		MS	SVB12885	12x885	
					PS	SVB121170	12x1170	
						TB102	122x19	
						TBK058		
					10/89 →	MVB813R3	3PK813	
					10/89 →	TB237	116x20	
2.0	N8C, NES	77	01/87 → 02/93		10/89 →	TBK011		
					10/89 →	TBK012		
					10/89 →, inj. pump	TB495	85x22	
					10/89 →	MVB825R3	3PK825	
					MS, 10/89 →	MVB1025R3	3PK1025	
					PS, 10/89 →			
2.0 4x4	N5D	88	10/91 → 03/93		→09/89	SVB10975	10x975	
					MS, →09/89	SVB12885	12x885	
					MS, AUTO, →09/89	SVB10913	10x913	
					PS, →09/89	SVB121170	12x1170	
					→09/89	TB102	122x19	
					→09/89	TBK058		
2.0 16V Cosworth 4x4	N5C	162	01/90 → 02/93		A/C(-), MS	MVB1230R6	6PK1230	
					A/C(-), PS, →04/92	MVB1820R6	6PK1820	
					A/C(-), PS, 04/92 →	MVB1805R6	6PK1805	
					A/C(+), MS	MVB1560R6	6PK1560	
					A/C(+), PS, →04/92	MVB1960R6	6PK1960	
					A/C(+), PS, 04/92 →	MVB1950R6	6PK1950	
2.0 16V Cosworth 4x4 CAT	N5D	162	01/90 → 02/93			SVB10990	10x990	
					→08/90	SVB10913	10x913	
					08/90 →	MVB1413R6	6PK1413	
						TB319	144x25.4	
					→08/90	SVB10900	10x900	
2.0 16V Cosworth 4x4 CAT	N5C	162	01/90 → 02/93			SVB10990	10x990	
					→08/90	SVB10913	10x913	
					08/90 →	MVB1413R6	6PK1413	
						TB319	144x25.4	
					→08/90	SVB10900	10x900	



kW



...FORD

...SIERRA Hatchback (GBC, GBG)

Model	Engine	kW	Year Range	Accessories	Options	Part Numbers	Dimensions	
2.0 i	N4A, N4I	85	01/87 → 02/93	⚙️	→09/89	SVB10975	10x975	
				⚙️	MS, →09/89	SVB12885	12x885	
				⚙️	MS, AUTO, →09/89	SVB10913	10x913	
				⚙️	PS, →09/89	SVB121170	12x1170	
				⚙️	→09/89	TB102	122x19	
	N9C	88	06/89 → 02/93	⚙️	→09/89	TBK058		
				⚙️	→09/89	TBK058		
				⚙️	A/C(-), MS	MVB1230R6	6PK1230	
				⚙️	A/C(-), PS, →04/92	MVB1820R6	6PK1820	
				⚙️	A/C(-), PS, 04/92 →	MVB1805R6	6PK1805	
	N8A	80	06/89 → 02/93	⚙️	A/C(+), MS	MVB1560R6	6PK1560	
				⚙️	A/C(+), PS, →04/92	MVB1960R6	6PK1960	
				⚙️	A/C(+), PS, 04/92 →	MVB1950R6	6PK1950	
				⚙️	A/C(-), PS, →04/92	MVB1820R6	6PK1820	
				⚙️	A/C(-), PS, 04/92 →	MVB1805R6	6PK1805	
	N9B	92	06/89 → 02/93	⚙️	A/C(+), MS	MVB1560R6	6PK1560	
				⚙️	A/C(+), PS, →04/92	MVB1960R6	6PK1960	
				⚙️	A/C(+), PS, 04/92 →	MVB1950R6	6PK1950	
				⚙️	A/C(-), MS, AUTO	MVB1230R6	6PK1230	
				⚙️	A/C(-), MS, MAN	MVB1270R6	6PK1270	
NE5, NEJ	74	01/87 → 02/93	⚙️	A/C(-), PS, →04/92	MVB1820R6	6PK1820		
			⚙️	A/C(-), PS, 04/92 →	MVB1805R6	6PK1805		
			⚙️	A/C(+), MS	MVB1560R6	6PK1560		
			⚙️	A/C(+), PS, →04/92	MVB1960R6	6PK1960		
			⚙️	A/C(+), PS, 04/92 →	MVB1950R6	6PK1950		
2.0 i CAT	N4B	74	01/87 → 02/93	⚙️	→09/89	SVB10975	10x975	
				⚙️	MS, →09/89	SVB12885	12x885	
				⚙️	MS, AUTO, →09/89	SVB10913	10x913	
				⚙️	PS, →09/89	SVB121170	12x1170	
				⚙️	→09/89	TB102	122x19	
	N9E	85	12/91 → 02/93	⚙️	→09/89	TBK058		
				⚙️	→09/89	TBK058		
				⚙️	A/C(-), MS, AUTO	MVB1230R6	6PK1230	
				⚙️	A/C(-), MS, MAN	MVB1270R6	6PK1270	
				⚙️	A/C(-), PS, →04/92	MVB1820R6	6PK1820	
	2.0 RS Cosworth	N5B	150	11/87 → 01/90	⚙️	A/C(-), PS, 04/92 →	MVB1805R6	6PK1805
					⚙️	A/C(+), MS	MVB1560R6	6PK1560
					⚙️	A/C(+), PS, →04/92	MVB1960R6	6PK1960
					⚙️	A/C(+), PS, 04/92 →	MVB1950R6	6PK1950
					⚙️	→09/89	SVB10990	10x990
	2.3 D	YTR	49	01/87 → 09/89	⚙️	→09/89	SVB10913	10x913
					⚙️	→09/89	TB319	144x25.4
					⚙️	→09/89	SVB10900	10x900
					⚙️	→09/89	SVB131150	13x1150
					⚙️	→09/89	SVB131025	13x1025
2.8 i XR 4x4	PRG	110	01/87 → 08/88	⚙️	→09/89	SVB10690	10x690	
				⚙️	→09/89	SVB13900	13x900	
				⚙️	→09/89	SVB121040	12x1040	
				⚙️	→09/89	SVB13900	13x900	
				⚙️	→09/89	SVB131200	13x1200	
2.9 i	B4B, B4C	107	08/88 → 02/93	⚙️	→04/87	SVB131175	13x1175	
				⚙️	→04/87	SVB121015	12x1015	
				⚙️	PS	SVB13900	13x900	
				⚙️	PS	SVB131200	13x1200	
				⚙️	→02/92	SVB131200	13x1200	

FORD



kw



...FORD

...SIERRA Hatchback (GBC, GBG)

2.9 i XR 4x4	B4A	110	08/88 → 02/93		PS	SVB121015	12x1015
					→02/92	SVB13900	13x900
						SVB131200	13x1200
	B4B, B4C	107	08/88 → 02/93		PS	SVB121015	12x1015
					→02/92	SVB13900	13x900
						SVB131200	13x1200

S-MAX

1.8 TDCi	QYWA	92	05/06 →		Auto Tensioner	MVB1685R6	6PK1685
						TB681	91x9.52
						TBK278	
2.0	AOWA	107	05/06 →			MVB2196R6	6PK2196
2.0 TDCi	AZWA	96	05/06 →			MVB1200R6	6PK1200
						TB742	116x25
						TBK338	
	QXWA, QXWB	103	05/06 →			MVB1200R6	6PK1200
						TB742	116x25
						TBK338	
		85	11/07 →			MVB1200R6	6PK1200
						TB742	116x25
						TBK338	
2.2 TDCi		129	03/08 →			TB810	118x25.4
2.3		118	07/07 →			MVB2250R6	6PK2250
2.5 ST	HUWA	162	05/06 →			TB643	142x23

STREET KA

1.6	CDRA, CDRB	70	05/03 → 07/05		A/C(-)	MVB1700R6	6PK1700
					A/C(+)	MVB2190R6	6PK2190

TOURNEO CONNECT

1.8 16V	EYPA, EYPC	85	06/02 →		A/C(-)	MVB1980R6	6PK1980
					A/C(+)	MVB2100R6	6PK2100
						TB633	129x25.4
						TBK327	
1.8 Di	BHPA	55	06/02 →		A/C(-), →05/03	MVB1420R6	6PK1420
					A/C(+), →05/07	MVB1715R6	6PK1715
					Auto Tensioner	TB681	91x9.52
						TBK278	
1.8 TDCi	RWPA	81	08/06 →		A/C(+), →05/07	MVB1715R6	6PK1715
					Auto Tensioner	TB681	91x9.52
						TBK278	
1.8 Turbo Di	HCPA, HCPB	66	06/02 →		A/C(-), →05/03	MVB1420R6	6PK1420
					A/C(+), →05/07	MVB1715R6	6PK1715
					Auto Tensioner	TB681	91x9.52
						TBK278	

TRANSIT Box

2.2 TDCi	QVFA	81	07/06 →		A/C(+)	MVB1675R6	6PK1675
	QWFA	96	07/06 →		A/C(+)	MVB1675R6	6PK1675
	P8FA	63	07/06 →		A/C(+)	MVB1675R6	6PK1675
2.3 16V	GZFA	107	07/06 →		A/C(-), →08/07	MVB2205R6	6PK2205
2.4 TDCi	JXFA	85	07/06 →		A/C(-), →08/07	MVB2710R7	7PK2710
	H9FB	103	07/06 →		A/C(-), →08/07	MVB2710R7	7PK2710
	PHFA	74	07/06 →		A/C(-), →08/07	MVB2710R7	7PK2710

TRANSIT Box (E_ _)

2.0	NBA	66	09/91 → 06/94		MS	SVB10913	10x913
					PS	SVB121170	12x1170
						TB102	122x19
						TBK058	
2.0 (EAL, EAS)	NSF, NSG	84	06/94 → 03/00		A/C(-), MS, extra heating (-)	MVB1413R6	6PK1413
					A/C(-), PS, extra heating (-)	MVB1775R6	6PK1775
					A/C(+), PS, extra heating (-)	MVB1980R6	6PK1980
					extra heating (+)	MVB1930R6	6PK1930



kW



...FORD

...TRANSIT Box (E_ _)

2.0 i (EAL, EAS)	NCA	72	09/91 → 06/94	⊗	MS	SVB10913	10x913
				⊗	PS	SVB121170	12x1170
						TB102	122x19
				KIT		TBK058	
2.5 DI (EAL, EAS)	4HB, 4HC	56	06/94 → 03/00	⊗		MVB1488R4	4PK1488
				⊗		MVB1510R4	4PK1510
					Auto Tensioner, →09/97	TB370	130x25.4
					Auto Tensioner, 07/97→	TB629	130x28
				KIT	→09/97	TBK077	
				KIT	07/97→	TBK334	
		A/C(-), extra heating (-), →10/96	SVB131025	13x1025			
		A/C(-), extra heating (-), 10/96→	SVB13975	13x975			
		A/C(-), extra heating (+)	MVB1635R6	6PK1635			
		A/C(+)	MVB1428R6	6PK1428			
	4BC, 4CC, 4FA	51	05/91 → 06/94	⊗		MVB1520R4	4PK1520
					→08/91	TB223	130x25.4
					Auto Tensioner	TB370	130x25.4
				KIT		TBK077	
			KIT	→08/91	TBK056		
			⊗		SVB131025	13x1025	
4GA	63	10/92 → 06/94	⊗		MVB1488R4	4PK1488	
				Auto Tensioner	TB370	130x25.4	
			KIT		TBK077		
			⊗		SVB131025	13x1025	
4FA, 4FB, 4FC, 4FD	51	06/94 → 03/00	⊗		MVB1510R4	4PK1510	
			⊗	→07/94	MVB1520R4	4PK1520	
			⊗	→08/97	MVB1488R4	4PK1488	
				Auto Tensioner, →09/97	TB370	130x25.4	
				Auto Tensioner, 07/97→	TB629	130x28	
			KIT	→09/97	TBK077		
			KIT	07/97→	TBK334		
				A/C(-), extra heating (-), →10/96	SVB131025	13x1025	
				A/C(-), extra heating (-), 10/96→	SVB13975	13x975	
				A/C(-), extra heating (+)	MVB1635R6	6PK1635	
	A/C(+)	MVB1428R6	6PK1428				
4ED	85	05/99 → 03/00	⊗		MVB1488R4	4PK1488	
			⊗	A/C(-), extra heating (-)	SVB13975	13x975	
			⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635	
			⊗	A/C(+)	MVB1428R6	6PK1428	
				Auto Tensioner	TB629	130x28	
			KIT		TBK334		
2.5 DI (EAS, EAL)	4DA	59	05/91 → 06/94	⊗		MVB1520R4	4PK1520
					→08/91	TB223	130x25.4
					Auto Tensioner	TB370	130x25.4
				KIT		TBK077	
				KIT	→08/91	TBK056	
						SVB131025	13x1025
		A/C(-), extra heating (+)	MVB1635R6	6PK1635			
		A/C(+)	MVB1428R6	6PK1428			

FORD



kW



...FORD

...TRANSIT Box (E_ _)

2.5 TD (EAL, EAS)	4GA, 4GB, 4GC, 4GD, 4GE, 4GF	63	06/94 → 03/00	⊗		MVB1488R4	4PK1488
				⊗	→07/94	MVB1520R4	4PK1520
				⊗	08/97→	MVB1510R4	4PK1510
					Auto Tensioner, →09/97	TB370	130x25.4
					Auto Tensioner, 09/97→	TB629	130x28
				KIT	→09/97	TBK077	
				KIT	09/97→	TBK334	
				⊗	A/C(-), extra heating (-), →10/96	SVB131025	13x1025
				⊗	A/C(-), extra heating (-), 10/96→	SVB13975	13x975
				⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635
2.5 TD (EAS)	4HA, 4HD	55	10/98 → 03/00	⊗		MVB1428R6	6PK1428
				⊗	A/C(-), extra heating (+)	MVB1510R4	4PK1510
				⊗	A/C(-), standard heating (+)	MVB1635R6	6PK1635
				⊗	A/C(+)	MVB1488R4	4PK1488
					Auto Tensioner	MVB1428R6	6PK1428
				KIT		TB629	130x28
				KIT		TBK334	
				⊗	A/C(-), extra heating (-)	SVB13975	13x975
				⊗	→08/91	MVB1520R4	4PK1520
				⊗	Auto Tensioner	TB223	130x25.4
2.5 TD (EAS, EAL)	4EA	74	05/91 → 06/94	⊗		TB370	130x25.4
						TBK077	
				KIT		TBK056	
				KIT	→08/91	SVB131025	13x1025
				⊗	A/C(-), extra heating (-)	MVB1635R6	6PK1635
				⊗	A/C(-), extra heating (+)	MVB1428R6	6PK1428
				⊗	A/C(+)	MVB1488R4	4PK1488
				⊗	→07/94	MVB1510R4	4PK1510
					Auto Tensioner, →09/97	MVB1520R4	4PK1520
					Auto Tensioner, 07/97→	TB370	130x25.4
2.5 TDI (EAL, EAS)	4EB, 4EC	74	06/94 → 03/00	⊗		TB629	130x28
				⊗	→09/97	TBK077	
				KIT	07/97→	TBK334	
				KIT		SVB131025	13x1025
				⊗	A/C(-), extra heating (-), →10/96	SVB13975	13x975
				⊗	A/C(-), extra heating (-), 10/96→	MVB1635R6	6PK1635
				⊗	A/C(-), extra heating (+)	MVB1428R6	6PK1428
				⊗	A/C(+)	MVB1488R4	4PK1488
				⊗	→07/94	MVB1510R4	4PK1510
				⊗	Auto Tensioner, →09/97	MVB1520R4	4PK1520

TRANSIT Box (FA_ _)

2.0 DI (FAE_, FAF_, FAG_)	D3FA	55	08/00 →	⊗	A/C(+), →03/06	MVB1642R6	6PK1642
				⊗	→04/03	MVB735R4	4PK735
				⊗	A/C(+), →03/06	MVB1642R6	6PK1642
	ABFA	74	08/00 →	⊗	→04/03	MVB735R4	4PK735
				⊗	A/C(+), →03/06	MVB1642R6	6PK1642
				⊗	→04/03	MVB735R4	4PK735
	F3FA	63	08/00 →	⊗	A/C(+), →03/06	MVB1642R6	6PK1642
				⊗	→04/03	MVB735R4	4PK735
				⊗	A/C(+), →03/06	MVB1642R6	6PK1642
2.0 TDCi	F1FA	92	08/02 →	⊗	A/C(+), →03/06	MVB1642R6	6PK1642
				⊗	→04/03	MVB735R4	4PK735
				⊗	A/C(+), →03/06	MVB1642R6	6PK1642
2.3		107	03/01 → 03/06	⊗	A/C(-)	MVB1775R6	6PK1775
				⊗	A/C(+)	MVB1950R6	6PK1950
				⊗	A/C(-)	MVB1775R6	6PK1775
		105	03/01 → 03/06	⊗	A/C(+)	MVB1950R6	6PK1950
				⊗	A/C(-), →03/06	MVB1775R6	6PK1775
				⊗	A/C(+), →03/06	MVB1950R6	6PK1950
2.3 16V (FAA_, FAB_, FAC_)	E5FA, E5FC	107	04/01 →	⊗	A/C(-), →03/06	MVB1775R6	6PK1775
				⊗	A/C(+), →03/06	MVB1950R6	6PK1950
				⊗	A/C(-), →03/06	MVB2710R7	7PK2710
2.4 DI (FAA_, FAB_, FAC_, FAD_)	D2FA, D2FB, D2FE	66	01/00 →	⊗	A/C(+), →03/06	MVB2875R7	7PK2875
				⊗	A/C(-), →03/06	MVB2710R7	7PK2710
				⊗	A/C(+), →03/06	MVB2875R7	7PK2875
	D4FA	88	01/00 →	⊗	A/C(-), →03/06	MVB2710R7	7PK2710
				⊗	A/C(+), →03/06	MVB2875R7	7PK2875
				⊗	A/C(-), →03/06	MVB2710R7	7PK2710
	F4FA	55	01/00 →	⊗	A/C(+), →03/06	MVB2875R7	7PK2875
				⊗	A/C(-), →03/06	MVB2710R7	7PK2710
				⊗	A/C(+), →03/06	MVB2875R7	7PK2875



kW



...FORD

...TRANSIT Box (FA_ _)

2.4 TDCi	H9FA	101	03/04 →		A/C(-), →03/06	MVB2710R7	7PK2710
					A/C(+), →03/06	MVB2875R7	7PK2875
2.4 TDDi		88	08/00 → 08/03		A/C(-)	MVB2710R7	7PK2710
					A/C(+)	MVB2875R7	7PK2875
2.4 TDE	DOFA	92	07/01 →		A/C(-), →03/06	MVB2710R7	7PK2710
					A/C(+), →03/06	MVB2875R7	7PK2875
	FXFA	85	03/04 →		A/C(-), →03/06	MVB2710R7	7PK2710
					A/C(+), →03/06	MVB2875R7	7PK2875

TRANSIT Box (T_ _)

1.6 (TAS)	LAT	46	09/85 → 09/92		MS, →07/87	SVB10913	10x913
					PS, →07/87	SVB121170	12x1170
					→07/87	TB101	119x19
					→07/87	TBK057	
2.0 (TAL, TAS, TGL, TWS)	NAT, NAV	57	09/85 → 09/92		Eng. NAT, MS	SVB10913	10x913
					Eng. NAT, PS	SVB121170	12x1170
						TB102	122x19
						TBK058	
2.5 D (TAL, TAS, TGL, TWS)	4BA, 4CA	52	10/88 → 09/91		04/91 →	MVB1510R4	4PK1510
					04/91 →	MVB1520R4	4PK1520
					Auto Tensioner, 04/91 →	TB370	130x25.4
					04/91 →	TBK077	
					A/C(-), extra heating (-),	SVB131025	13x1025
					04/91 →		
					A/C(-), extra heating (+),	MVB1635R6	6PK1635
					04/91 →		
					A/C(+), 04/91 →	MVB1428R6	6PK1428
	4AB	50	01/86 → 09/91		→03/91	MVB1520R4	4PK1520
					→03/91	TB223	130x25.4
					→03/91	TBK056	
					→03/91	SVB131025	13x1025

TRANSIT Box (V_ _)

1.6 (WS)	4RB	48	11/77 → 10/86		→10/84	SVB10865	10x865
					MS, 11/84 →	SVB10913	10x913
					PS, 10/85 →	SVB121170	12x1170
						TB101	119x19
						TBK057	
2.0 (VHL, VVS)	4RC	57	11/77 → 10/86		→10/84	SVB12865	12x865
					→12/77	SVB101350	10x1350
					11/84 → 09/85	SVB10913	10x913
					→09/85	TB102	122x19
					→09/85	TBK058	
2.0 (VVL)	4RC	55	11/77 → 10/86		→12/77	SVB101350	10x1350
					→12/77	TB102	122x19
					→12/77	TBK058	
2.0 (VVS)	4RC	43	11/77 → 07/82			SVB12865	12x865
						TB102	122x19
						TBK058	
2.4 D (VVS)	4AA	46	11/77 → 10/86		→09/85	SVB101175	10x1175
					→09/85	SVB10888	10x888
					extra cooling (+), →09/85	SVB101300	10x1300
					standard cooling (+), →09/85	SVB101250	10x1250
					→09/85	TB103	123x25.4
					→09/85	TBK042	
					→09/85	SVB10925	10x925
2.5 D (VVL)	4AB	50	10/83 → 10/86			SVB10825	10x825
						TB223	130x25.4
						TBK056	
						SVB10940	10x940



kw



...FORD

...TRANSIT Bus

TRANSIT Bus

2.2 TDCi	P8FA	63	07/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
	QVFA	81	07/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
	QWFA	96	07/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
2.4 TDCi	JXFA	85	07/06 →	⊗	A/C(-), →08/07	MVB2710R7	7PK2710
	H9FB	103	07/06 →	⊗	A/C(-), →08/07	MVB2710R7	7PK2710
	PHFA	74	07/06 →	⊗	A/C(-), →08/07	MVB2710R7	7PK2710
2.4 TDCi All-wheel Drive		103	07/06 →	⊗	A/C(-), →08/07	MVB2710R7	7PK2710

TRANSIT Bus (E_ _)

2.0	NBA	66	09/91 → 09/94	⊗	MS	SVB10913	10x913
				⊗	PS	SVB121170	12x1170
				⊗		TB102	122x19
				⊗		TBK058	
2.0 (EBL, EBS, ECL, EDS, EDL, EGL, ESS, ESL, EUS)	NSF, NSG	84	09/95 → 03/00	⊗	A/C(-), MS, extra heating (-)	MVB1413R6	6PK1413
				⊗	A/C(-), PS, extra heating (-)	MVB1775R6	6PK1775
				⊗	A/C(+), PS, extra heating (-)	MVB1980R6	6PK1980
				⊗	extra heating (+)	MVB1930R6	6PK1930
2.0 CNG	NSH	84	06/94 → 03/00	⊗	A/C(-), MS, extra heating (-)	MVB1413R6	6PK1413
				⊗	A/C(-), PS, extra heating (-)	MVB1775R6	6PK1775
				⊗	A/C(+), PS, extra heating (-)	MVB1980R6	6PK1980
				⊗	extra heating (+)	MVB1930R6	6PK1930
2.0 i (EBL, EDL, EGL, ESS, EUS)	NCA	72	09/91 → 07/94	⊗	MS	SVB10913	10x913
				⊗	PS	SVB121170	12x1170
				⊗		TB102	122x19
				⊗		TBK058	
2.5 DI (EBL, ECL, EDS, EDL)	4HB, 4HC	56	07/94 → 03/00	⊗		MVB1510R4	4PK1510
				⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635
				⊗	A/C(-), standard heating (+)	MVB1488R4	4PK1488
				⊗	A/C(+)	MVB1428R6	6PK1428
				⊗	Auto Tensioner, →09/97	TB370	130x25.4
				⊗	Auto Tensioner, 07/97→	TB629	130x28
				⊗	→09/97	TBK077	
				⊗	07/97→	TBK334	
				⊗	A/C(-), extra heating (-), →10/96	SVB131025	13x1025
				⊗	A/C(-), extra heating (-), 10/96→	SVB13975	13x975
2.5 DI (EBL, EDL, EDS, ESL, ESS)	4ED	85	08/97 → 03/00	⊗		MVB1488R4	4PK1488
				⊗	A/C(-), extra heating (-)	SVB13975	13x975
				⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635
				⊗	A/C(+)	MVB1428R6	6PK1428
				⊗	Auto Tensioner	TB629	130x28
				⊗	Auto Tensioner, →09/97	TB370	130x25.4
				⊗		TBK334	
2.5 DI (EBL, EDS, ESL, ESS, EUS)	4FA, 4FB, 4FC, 4FD 51	4PK1510	08/94	→		TBK077	
				⊗	→08/97	MVB1488R4	4PK1488
				⊗	Auto Tensioner, →09/97	TB370	130x25.4
				⊗	Auto Tensioner, 07/97→	TB629	130x28
				⊗	→09/97	TBK077	
				⊗	07/97→	TBK334	
				⊗	A/C(-), extra heating (-), →10/96	SVB131025	13x1025
				⊗	A/C(-), extra heating (-), 10/96→	SVB13975	13x975
				⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635
				⊗	A/C(+)	MVB1428R6	6PK1428



kW



...FORD

...TRANSIT Bus (E_ _)

2.5 DI (EBS, EDS, EDL, ESS, EUS)	4BC, 4CC, 4FA	51	08/91 → 07/94		Auto Tensioner	MVB1520R4 TB370 TBK077 SVB131025	4PK1520 130x25.4 13x1025
2.5 DI (EBS, EDS, EGL, ESS, EUS)	4DA	59	09/91 → 07/94		Auto Tensioner	MVB1520R4 TB370 TBK077 SVB131025	4PK1520 130x25.4 13x1025
2.5 TD (EB_ , ED_ , ES_)	4HA, 4HD	55	08/94 → 06/00		A/C(-), extra heating (+) A/C(-), standard heating (+) A/C(+) Auto Tensioner, →09/97 Auto Tensioner, 07/97→ →09/97 07/97→ A/C(-), extra heating (-), →10/96 A/C(-), extra heating (-), 10/96→	MVB1510R4 MVB1635R6 MVB1488R4 MVB1428R6 TB370 TB629 TBK077 TBK334 SVB131025 SVB13975	4PK1510 6PK1635 4PK1488 6PK1428 130x25.4 130x28 13x1025 13x975
2.5 TD (EBL, EDL, EDS, EGL, ESL, ESS, EUS)	4GA, 4GB, 4GC, 4GD, 4GE, 4GF	63	01/95 → 03/00		Auto Tensioner, →09/97 Auto Tensioner, 09/97→ →09/97 09/97→ A/C(-), extra heating (-), →10/96 A/C(-), extra heating (-), 10/96→ A/C(-), extra heating (+) A/C(+)	MVB1488R4 TB370 TB629 TBK077 TBK334 SVB131025 SVB13975 MVB1635R6 MVB1428R6	4PK1488 130x25.4 130x28 13x1025 13x975 6PK1635 6PK1428
2.5 TD (EBS, EBL, ECL, EDS, EDL, ESS, EUS)	4GA, 4GB, 4GC	63	10/92 → 07/94		Auto Tensioner	MVB1488R4 TB370 TBK077 SVB131025	4PK1488 130x25.4 13x1025
2.5 TD (ECL, EDL, EDS, ESL, ESS, EUS)	4EB, 4EC	74	07/94 → 03/00		Auto Tensioner, →09/97 Auto Tensioner, 09/97→ →09/97 09/97→ A/C(-), extra heating (-), →10/96 A/C(-), extra heating (-), 10/96→ A/C(-), extra heating (+) A/C(+)	MVB1488R4 TB370 TB629 TBK077 TBK334 SVB131025 SVB13975 MVB1635R6 MVB1428R6	4PK1488 130x25.4 130x28 13x1025 13x975 6PK1635 6PK1428
2.5 TD (ECL, EDS, EDL, EGL, ESS, EUS)	4EA	74	09/91 → 07/94		Auto Tensioner	MVB1520R4 TB370 TBK077 SVB131025	4PK1520 130x25.4 13x1025
2.9 i	BRT	107	01/91 →		11/91→07/94 11/91→07/94	SVB131075 SVB131200	13x1075 13x1200

TRANSIT Bus (FD_ _ , FB_ _ , FS_ _ , FZ_ _ , FC_ _)

2.0 DI (F_E_ , F_F_ , F_G_)	D3FA	55	08/00 →		A/C(+), →03/06 →04/03	MVB1642R6 MVB735R4	6PK1642 4PK735
	ABFA	74	08/00 →		A/C(+), →03/06 →04/03	MVB1642R6 MVB735R4	6PK1642 4PK735
	F3FA	63	08/00 →		A/C(+), →03/06 →04/03	MVB1642R6 MVB735R4	6PK1642 4PK735
2.0 TDCi (F_F_ , F_E_ , F_G_)	F1FA	92	08/02 →		A/C(+), →03/06 →04/03	MVB1642R6 MVB735R4	6PK1642 4PK735



kW



...FORD

FORD

...TRANSIT Bus (FD_, FB_, FS_, FZ_, FC_)

2.3 16V (F_B_, F_C_, F_A_) E5FA, E5FC	107	08/00 →		Eng. E5FA, A/C(-), →03/06	MVB1775R6	6PK1775
				Eng. E5FA, A/C(+), →03/06	MVB1950R6	6PK1950
2.4 DI (F_B_, F_C_) F4FA	55	01/00 →		A/C(-), →03/06	MVB2710R7	7PK2710
				A/C(+), →03/06	MVB2875R7	7PK2875
2.4 DI (F_B_, F_C_, F_A_) D4FA	88	01/00 →		A/C(-), →03/06	MVB2710R7	7PK2710
				A/C(+), →03/06	MVB2875R7	7PK2875
	D2FA, D2FB, D2FE	66	01/00 →	A/C(-), →03/06	MVB2710R7	7PK2710
				A/C(+), →03/06	MVB2875R7	7PK2875
2.4 TDCi H9FA	101	03/04 →		A/C(-), →03/06	MVB2710R7	7PK2710
				A/C(+), →03/06	MVB2875R7	7PK2875
2.4 TDE FXFA	85	03/04 →		A/C(-), →03/06	MVB2710R7	7PK2710
				A/C(+), →03/06	MVB2875R7	7PK2875
2.4 TDE (F_C_, F_B_, F_A_) DOFA	92	07/01 →		A/C(-), →03/06	MVB2710R7	7PK2710
				A/C(+), →03/06	MVB2875R7	7PK2875

TRANSIT Bus (T_)

1.6 (TBL, TES) LAT	46	12/85 → 01/89		MS, →07/87	SVB10913	10x913
				PS, →07/87	SVB121170	12x1170
				→07/87	TB101	119x19
				→07/87	TBK057	
2.0 (TBS, TCL, TCS) CAT N6T	57	12/85 → 09/92		MS	SVB10913	10x913
				PS	SVB121170	12x1170
					TB102	122x19
					TBK058	
2.0 (TBS, TCL, TCS, TEL, TES) NAT, NAV	57	11/85 → 09/92		Eng. NAT, MS	SVB10913	10x913
				Eng. NAT, PS	SVB121170	12x1170
					TB102	122x19
					TBK058	
2.5 D (TBS, TCL, TCS, TEL, TES) 4AB	50	12/85 → 01/89			MVB1520R4	4PK1520
					TB223	130x25.4
					TBK056	
					SVB131025	13x1025
2.5 D (TBS, TEL, TES) 4BA, 4CA	52	09/88 → 09/92		04/91 →	MVB1520R4	4PK1520
				Auto Tensioner, 04/91 →	TB370	130x25.4
				04/91 →	TBK077	
				04/91 →	SVB131025	13x1025
				A/C(-), extra heating (+),	MVB1635R6	6PK1635
				04/91 →		
				A/C(+), 04/91 →	MVB1428R6	6PK1428

TRANSIT Bus (V_)

1.6	62	01/78 → 09/85		→10/84	SVB10865	10x865
				11/84 →	SVB10913	10x913
					TB101	119x19
					TBK057	
1.6 (VAS, VLS, VZS) 4RB	48	12/77 → 10/86		→10/84	SVB10865	10x865
				11/84 → 09/85	SVB10913	10x913
				→09/85	TB101	119x19
				→09/85	TBK057	
2.0 (VAS, VBLVIL, VLS, VUL, VZS) 4RC	43	12/77 → 07/82			SVB12865	12x865
					TB102	122x19
					TBK058	
2.0 (VAS, VIL, VLS, VUL, VZS) 4RC	57	11/77 → 10/86		→10/84	SVB12865	12x865
				→12/77	SVB101350	10x1350
				11/84 → 09/85	SVB10913	10x913
				→09/85	TB102	122x19
				→09/85	TBK058	
2.0 (VAS, VLS, VZS) 4RC	55	11/77 → 10/86		→12/77	SVB101350	10x1350
				→12/77	TB102	122x19
				→12/77	TBK058	



kW



...FORD

...TRANSIT Bus (V_ _)

2.4 D (VAS, VBL, VIL, VUL, VZS)	4AA	46	12/77 → 10/86	⊗	→09/85	SVB101175	10x1175
				⊗	→09/85	SVB10888	10x888
				⊗	extra cooling (+), →09/85	SVB101300	10x1300
				⊗	standard cooling (+), →09/85	SVB101250	10x1250
					→09/85	TB103	123x25.4
2.5 D (VAS, VBL, VIL, VUL, VZS)	4AB	50	10/83 → 10/86		→09/85	SVB10925	10x925
						SVB10825	10x825
						TB223	130x25.4
						TBK056	
						SVB10940	10x940

TRANSIT CONNECT (P65_, P70_, P80_)

1.8 16V	EYPA, EYPC	85	06/02 →	⊗	A/C(-)	MVB1980R6	6PK1980
				⊗	A/C(+)	MVB2100R6	6PK2100
						TB633	129x25.4
						TBK327	
1.8 Di	BHPA	55	06/02 →	⊗	A/C(-), →05/03	MVB1420R6	6PK1420
				⊗	A/C(+), →05/07	MVB1715R6	6PK1715
					Auto Tensioner	TB681	91x9.52
						TBK278	
1.8 TDCi	HCPA, HCPB	66	06/02 →	⊗	A/C(-), →05/03	MVB1420R6	6PK1420
				⊗	A/C(+), →05/07	MVB1715R6	6PK1715
	RWPA	81	08/06 →		Auto Tensioner	TB681	91x9.52
						TBK278	

TRANSIT Flatbed / Chassis

2.2 TDCi	QVFA	81	07/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
	P8FA	63	07/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
	QWFA	96	07/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
2.3 16V	GZFA	107	07/06 →	⊗	A/C(-), →08/07	MVB2205R6	6PK2205
2.4 TDCi	PHFA	74	07/06 →	⊗	A/C(-), →08/07	MVB2710R7	7PK2710
	JXFA	85	07/06 →	⊗	A/C(-), →08/07	MVB2710R7	7PK2710
	H9FB	103	07/06 →	⊗	A/C(-), →08/07	MVB2710R7	7PK2710

TRANSIT Flatbed / Chassis (E_ _)

2.0 (EME/L/S, ENE/L/S)	NSF, NSG	84	08/94 → 03/00	⊗	A/C(-), MS, extra heating (-)	MVB1413R6	6PK1413
				⊗	A/C(-), PS, extra heating (-)	MVB1775R6	6PK1775
				⊗	A/C(+), PS, extra heating (-)	MVB1980R6	6PK1980
				⊗	extra heating (+)	MVB1930R6	6PK1930
NCA	72	09/91 → 08/94	⊗	MS	SVB10913	10x913	
			⊗	PS	SVB121170	12x1170	
					TB102	122x19	
					TBK058		



kW



...FORD

...TRANSIT Flatbed / Chassis (E_ _)

FORD

2.5 DI (EME/L/S, ENE/L/S)	4HB, 4HC	56	08/94 → 03/00	⊗		MVB1488R4	4PK1488
				⊗		MVB1510R4	4PK1510
					Auto Tensioner, →09/97	TB370	130x25.4
					Auto Tensioner, 07/97→	TB629	130x28
				KIT	→09/97	TBK077	
				KIT	07/97→	TBK334	
				⊗	A/C(-), extra heating (-), →10/96	SVB131025	13x1025
				⊗	A/C(-), extra heating (-), 10/96→	SVB13975	13x975
				⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635
				⊗	A/C(+)	MVB1428R6	6PK1428
4DA	59	09/91 → 08/94	⊗		MVB1520R4	4PK1520	
				Auto Tensioner	TB370	130x25.4	
			KIT		TBK077		
			⊗		SVB131025	13x1025	
			⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635	
2.5 DI (EML, ENE/L)	4ED	85	05/99 → 03/00	⊗		MVB1488R4	4PK1488
				⊗	A/C(-), extra heating (-)	SVB13975	13x975
				⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635
				⊗	A/C(+)	MVB1428R6	6PK1428
				KIT	Auto Tensioner	TB629	130x28
2.5 DI (EML/S, ENL/S)	4FA, 4FB, 4FC, 4FD	51	08/94 → 03/00	⊗		MVB1510R4	4PK1510
				⊗	→08/97	MVB1488R4	4PK1488
					Auto Tensioner, →09/97	TB370	130x25.4
					Auto Tensioner, 07/97→	TB629	130x28
				KIT	→09/97	TBK077	
				KIT	07/97→	TBK334	
				⊗	A/C(-), extra heating (-), →10/96	SVB131025	13x1025
				⊗	A/C(-), extra heating (-), 10/96→	SVB13975	13x975
				⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635
				⊗	A/C(+)	MVB1428R6	6PK1428
4BC, 4CC, 4FA	51	09/91 → 08/94	⊗		MVB1520R4	4PK1520	
				Auto Tensioner	TB370	130x25.4	
			KIT		TBK077		
			⊗		SVB131025	13x1025	
			⊗		MVB1520R4	4PK1520	
2.5 TD (EME/L/S, ENE/L)	4EA	74	09/91 → 08/94	⊗		MVB1520R4	4PK1520
					Auto Tensioner	TB370	130x25.4
				KIT		TBK077	
				⊗	A/C(-), extra heating (-)	SVB131025	13x1025
				⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635
⊗	A/C(+)	MVB1428R6	6PK1428				



kW



...FORD

...TRANSIT Flatbed / Chassis (E_ _)

2.5 TD (EME/L/S, ENE/L/S)	4GA, 4GB, 4GC, 4GD, 4GE, 4GF	63	08/94 → 03/00	⊗		MVB1488R4	4PK1488
				⊗	08/97 →	MVB1510R4	4PK1510
					Auto Tensioner, →09/97	TB370	130x25.4
					Auto Tensioner, 09/97 →	TB629	130x28
				KIT	→09/97	TBK077	
				KIT	09/97 →	TBK334	
				⊗	A/C(-), extra heating (-), →10/96	SVB131025	13x1025
				⊗	A/C(-), extra heating (-), 10/96 →	SVB13975	13x975
				⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635
				⊗	A/C(+)	MVB1428R6	6PK1428
4EB, 4EC	74	08/94 → 03/00	⊗		MVB1488R4	4PK1488	
			⊗		MVB1510R4	4PK1510	
				Auto Tensioner, →09/97	TB370	130x25.4	
				Auto Tensioner, 07/97 →	TB629	130x28	
			KIT	→09/97	TBK077		
			KIT	07/97 →	TBK334		
			⊗	A/C(-), extra heating (-), →10/96	SVB131025	13x1025	
			⊗	A/C(-), extra heating (-), 10/96 →	SVB13975	13x975	
			⊗	A/C(-), extra heating (+)	MVB1635R6	6PK1635	
			⊗	A/C(+)	MVB1428R6	6PK1428	
4GA	63	11/92 → 08/94	⊗		MVB1520R4	4PK1520	
				Auto Tensioner	TB370	130x25.4	
			KIT		TBK077		
4HA, 4HD	55	10/98 →	⊗	→06/00	MVB1510R4	4PK1510	
			⊗	A/C(-), extra heating (+), →06/00	MVB1635R6	6PK1635	
			⊗	A/C(-), standard heating (+), →06/00	MVB1488R4	4PK1488	
			⊗	A/C(+), →06/00	MVB1428R6	6PK1428	
				Auto Tensioner, →06/00	TB629	130x28	
			KIT	→06/00	TBK334		
⊗	A/C(-), extra heating (-), →06/00	SVB13975	13x975				

TRANSIT Flatbed / Chassis (FM_ _ , FN_ _)

2.0 DI (F_E_, F_F_)	D3FA	55	08/00 →	⊗	A/C(+), →03/06	MVB1642R6	6PK1642
				⊗	→04/03	MVB735R4	4PK735
	ABFA	74	08/00 →	⊗	A/C(+), →03/06	MVB1642R6	6PK1642
				⊗	→04/03	MVB735R4	4PK735
	F3FA	63	08/00 →	⊗	A/C(+), →03/06	MVB1642R6	6PK1642
				⊗	→04/03	MVB735R4	4PK735
2.0 TDCi (F_E_, F_F_)	FIFA	92	08/02 →	⊗	A/C(+), →03/06	MVB1642R6	6PK1642
				⊗	→04/03	MVB735R4	4PK735
2.3 16V (F_A_, F_B_, F_C_, F_D_)	E5FA, E5FC	107	04/01 →	⊗	Eng. E5FA, A/C(-), →03/06	MVB1775R6	6PK1775
				⊗	Eng. E5FA, A/C(+), →03/06	MVB1950R6	6PK1950
2.4 DI (F_A_, F_B_, F_C_, F_D_)	D2FA, D2FB, D2FE	66	01/00 →	⊗	A/C(-), →03/06	MVB2710R7	7PK2710
				⊗	A/C(+), →03/06	MVB2875R7	7PK2875
	D4FA	88	01/00 →	⊗	A/C(-), →03/06	MVB2710R7	7PK2710
				⊗	A/C(+), →03/06	MVB2875R7	7PK2875
F4FA	55	01/00 →	⊗	A/C(-), →03/06	MVB2710R7	7PK2710	
			⊗	A/C(+), →03/06	MVB2875R7	7PK2875	
2.4 TDCi	H9FA	101	03/04 →	⊗	A/C(-), →03/06	MVB2710R7	7PK2710
				⊗	A/C(+), →03/06	MVB2875R7	7PK2875
2.4 TDE	DOFA	92	07/01 →	⊗	A/C(-), →03/06	MVB2710R7	7PK2710
				⊗	A/C(+), →03/06	MVB2875R7	7PK2875
	FXFA	85	03/04 →	⊗	A/C(-), →03/06	MVB2710R7	7PK2710
				⊗	A/C(+), →03/06	MVB2875R7	7PK2875



kW



...FORD

FORD

TRANSIT Flatbed / Chassis (T_ _)

2.0 (TTE, TTL, TTS)	NAT, NAV	57	01/86 → 09/92		Eng. NAT, MS, →03/91 Eng. NAT, PS, →03/91 →03/91 →03/91	SVB10913 SVB121170 TB102 TBK058	10x913 12x1170 122x19
2.0 (TUL) CAT	N6T	57	11/85 → 09/92		MS PS	SVB10913 SVB121170 TB102 TBK058	10x913 12x1170 122x19
2.5 D (TTL, TTS, TUL, TUS, TTE) CAT	4AB	50	01/86 → 01/89		→06/88 →06/88	MVB1520R4 SVB10825 TB223 TBK056 SVB131025 SVB10940	4PK1520 10x825 130x25.4 13x1025 10x940
2.5 DI (TTE, TTL, TTS, TUL)	4BA, 4CA	52	09/88 → 09/92		04/91 → 04/91 → Auto Tensioner, 04/91 → 04/91 → A/C(-), extra heating (-), 04/91 → A/C(-), extra heating (+), 04/91 → A/C(+), 04/91 →	MVB1510R4 MVB1520R4 TB370 TBK077 SVB131025 MVB1635R6 MVB1428R6	4PK1510 4PK1520 130x25.4 13x1025 6PK1635 6PK1428

TRANSIT Flatbed / Chassis (V_ _)

1.6 (VCS, VDS)	B	48	11/77 → 10/86		→10/84 11/84 →09/85 →09/85 →09/85	SVB10865 SVB10913 TB101 TBK057	10x865 10x913 119x19
2.0 (VGL, VSL, VTL)	4RC	43	11/77 → 07/82			SVB12865 TB102 TBK058	12x865 122x19
2.0 (VGL, VSL, VTL, VCS, VDS)	4RC	57	11/77 → 10/86		→10/84 11/84 →09/85 →09/85 →09/85	SVB12865 SVB10913 TB102 TBK058	12x865 10x913 122x19
2.4 D (VGL, VSL, VTL, VCS, VDS)	4AA	46	11/77 → 09/85		extra cooling (+) standard cooling (+)	SVB101175 SVB10888 SVB101300 SVB101250 TB103 TBK042 SVB10925	10x1175 10x888 10x1300 10x1250 123x25.4 10x925
2.5 D (VGL, VSL, VTL, VCS, VDS)	4AB	50	10/83 → 10/86			SVB10825 TB223 TBK056 SVB10940	10x825 130x25.4 10x940

TRANSIT TOURNEO

2.2 TDCi	QVFA	81	07/06 →		A/C(+)	MVB1675R6	6PK1675
	QWFA	96	07/06 →		A/C(+)	MVB1675R6	6PK1675

FORD USA

PROBE I

2.2		82	08/88 → 07/93		MS, →05/92 →05/92 →05/92 A/C(-), →05/92 A/C(+), →05/92	MVB950R5 MVB760R3 TB358 MVB1015R5 MVB1060R5	5PK950 3PK760 110x25.4 5PK1015 5PK1060
-----	--	----	---------------	--	--	--	--



kW



...FORD USA

...PROBE I

2.2 GT		108	08/88 → 12/92	 	MS, →05/92 →05/92 →05/92 A/C(-), →05/92 A/C(+), →05/92	MVB950R5 MVB760R3 TB358 MVB1015R5 MVB1060R5	5PK950 3PK760 110x25.4 5PK1015 5PK1060
3.0 V6		104	09/89 → 07/93	 	A/C(-), →05/92 A/C(+), →05/92 →05/92	MVB1538R6 MVB1795R6 MVB905R4	6PK1538 6PK1795 4PK905

PROBE II (ECP)

2.0 16V	FS	85	10/93 → 03/98	 	A/C(-) A/C(+)	MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4 5PK1030 5PK1165
2.5 V6 24V	KL	119	10/93 → 03/98	 	A/C(-) A/C(+)	MVB865R5 MVB1015R5 TB399 MVB920R4	5PK865 5PK1015 192x30 4PK920
		120	12/94 → 03/98	 	A/C(-) A/C(+)	MVB865R5 MVB1015R5 TB399 MVB920R4	5PK865 5PK1015 192x30 4PK920

TAURUS (P5_)

3.0		108	09/96 →		A/C(-), →12/01	MVB2080R6	6PK2080
		130	05/96 → 12/01			MVB1913R6	6PK1913
3.0 24V		149	09/96 →		→12/01	MVB1913R6	6PK1913
3.0 V6		115	03/99 →		→09/05	MVB1920R6	6PK1920
3.4 SHO		175	05/96 → 10/98			MVB2271R6	6PK2271

TAURUS Wagon (P5_)

3.0		108	09/96 →		A/C(-), →12/01	MVB2080R6	6PK2080
		95	11/98 →		→09/05	MVB1920R6	6PK1920
3.0 24V		149	09/96 →		→12/01	MVB1913R6	6PK1913
3.0 V6		115	03/99 →		→09/05	MVB1920R6	6PK1920

F50

125P

1.3	116 C 076	47	10/67 → 08/92		→10/91	SVB10950	10x950
1.5		55	10/67 → 08/92		→12/71	SVB10913	10x913
					01/72 →10/91	SVB10925	10x925

125P Estate

1.3	116 C 076	47	10/67 → 08/92		→10/91	SVB10950	10x950
1.5	115 C 076	55	10/67 → 08/92		→12/71	SVB10913	10x913
					01/72 →10/91	SVB10925	10x925

126P

0.6		22	07/77 → 12/91			SVB10800	10x800
650		18	07/81 → 09/00		→10/99	SVB10800	10x800

127P

0.9		33	10/69 → 10/76			SVB10800	10x800
-----	--	----	---------------	--	--	-----------------	--------

132P

1.6		72	01/74 → 09/78	 		SVB101100 SVB10850 TB112 TB148	10x1100 10x850 144x19 68x15
1.8		79	07/75 → 09/78	 		SVB101100 SVB10850 TB113 TB148	10x1100 10x850 146x19 68x15



kw



FSO

...FSO

...POLONEZ I

POLONEZ I

1.5		60	01/78 → 08/88		11/80 →	SVB10913	10x913
					11/80 →	TB115	54x19
1.5 Turbo		70	01/78 → 12/91		11/80 → 07/88	SVB10913	10x913
					11/80 → 07/88	TB115	54x19

POLONEZ II

1.5		55	08/88 → 08/92			SVB10913	10x913
						TB115	54x19
1.5 i		55	08/88 → 08/92			SVB10913	10x913
						TB115	54x19
1.9 D		51	08/88 → 08/92		11/91 →	MVB700R4	4PK700
					11/91 →	TB560	136x25.4
					11/91 →	TBK019	

POLONEZ III

1.4 i 16V	Rover K16 DOHC	76	09/92 →		→10/98	MVB747R4	4PK747
					→10/98	TB295	143x23
					→10/98	MVB760R3	3PK760
1.6 i		57	09/92 →		10/93 → 10/98	SVB10925	10x925
					10/93 → 10/98	TB795	54x17
1.9 D		51	09/92 →		→10/98	MVB700R4	4PK700
					→10/98	TB560	136x25.4
					→12/93	TBK019	
					01/94 → 10/98	TBK020	

POLONEZ III Saloon

1.6 i		57	09/92 →		10/93 → 10/03	SVB10925	10x925
					10/93 → 10/03	TB795	54x17

GAZ

VOLGA (3102)

2.4		77	02/72 → 01/93	*		SVB101025	10x1025
-----	--	----	---------------	---	--	------------------	---------

VOLGA Estate (3102)

2.4		77	02/72 → 01/93	*		SVB101025	10x1025
-----	--	----	---------------	---	--	------------------	---------

HONDA

ACCORD II (AC, AD)

1.6 EX (AC)	EZ	65	09/83 → 10/85			MVB950R4	4PK950
						TB202	108x24
						SVB10900	10x900
1.8 EX (AD)	ET1	74	09/83 → 10/85			MVB950R4	4PK950
						TB202	108x24
					→12/83	TB127	95x19
						SVB10900	10x900
					→12/83	SVB10940	10x940

ACCORD II Hatchback (AC, AD)

1.6 EX (AC)	EZ	65	09/83 → 10/85			MVB950R4	4PK950
						TB202	108x24
						SVB10900	10x900
1.8 EX (AD)	ET1	74	09/83 → 10/85			MVB950R4	4PK950
						TB202	108x24
					→12/83	TB127	95x19
						SVB10900	10x900
					→12/83	SVB10940	10x940

ACCORD III (CA4, CA5)

1.6 L (CA4)	A16A1	65	11/85 → 12/89			MVB938R5	5PK938
						TB202	108x24



kW



...HONDA

...ACCORD III (CA4, CA5)

2.0 EX (CA5)	A20A1	75	11/85 → 12/89	⊗	MVB915R4	4PK915		
				⊗			MVB938R5	5PK938
				⊗			TB202	108x24
76	11/85 → 12/89	⊗	MVB915R4	4PK915				
		⊗	MVB938R5	5PK938				
		⊗	TB202	108x24				
A20A2	78	11/85 → 05/89	⊗	MVB915R4	4PK915			
			⊗	MVB938R5	5PK938			
			⊗	TB202	108x24			
2.0 EXi (CA5)	A20A3	85	01/86 → 12/89	⊗	MVB915R4	4PK915		
				⊗	MVB938R5	5PK938		
				⊗	TB202	108x24		
A20A4	90	11/85 → 12/87	⊗	MVB915R4	4PK915			
			⊗	MVB938R5	5PK938			
			⊗	TB202	108x24			
2.0 i 16V (CA5)	B20A8	98	10/87 → 12/89	⊗	MVB915R4	4PK915		
				⊗	MVB813R3	3PK813		
				⊗	TB313	133x24		
B20A2	101	01/87 → 12/87	⊗	MVB915R4	4PK915			
			⊗	MVB813R3	3PK813			
			⊗	TB313	133x24			
SVB10900				⊗	SVB10900	10x900		

ACCORD III Aerodeck (CA5)

1.6 L (CA4)		65	11/85 → 12/89	⊗	→12/85	MVB950R4	4PK950			
				⊗		TB202	108x24			
				⊗		SVB10900	10x900			
2.0		101	01/86 → 12/86	⊗	MVB915R4	4PK915				
				⊗	MVB938R5	5PK938				
				⊗	TB202	108x24				
2.0 EX	A20A1	75	10/87 → 12/89	⊗	MVB915R4	4PK915				
				⊗	MVB938R5	5PK938				
				⊗	TB202	108x24				
SVB10900				⊗	SVB10900	10x900				
				2.0 EX (CA5)	A20A2	78	11/85 → 05/89	⊗	MVB915R4	4PK915
								⊗	MVB938R5	5PK938
⊗	TB202	108x24								
SVB10900				⊗	SVB10900	10x900				
				A20A1	76	10/87 → 12/89	⊗	MVB915R4	4PK915	
							⊗	MVB938R5	5PK938	
⊗	TB202	108x24								
SVB10900				⊗	SVB10900	10x900				
				2.0 EXi (CA5)	A20A3	85	10/87 → 12/89	⊗	MVB915R4	4PK915
								⊗	MVB938R5	5PK938
⊗	TB202	108x24								
SVB10900				⊗	SVB10900	10x900				
				A20A4	90	11/85 → 12/87	⊗	MVB915R4	4PK915	
							⊗	MVB938R5	5PK938	
⊗	TB202	108x24								
SVB10900				⊗	SVB10900	10x900				



kw



HONDA

...HONDA

ACCORD IV (CB3, CB7)

1.8		77	01/90 → 12/91	 KIT 	A/C(-) A/C(+) → Ch. 1000751 Ch. 1000752→	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1050R4 MVB1070R4	5PK950 5PK1100 70x16 113x24 4PK1050 4PK1070
2.0 16V (CB3)	F20A6	66	01/90 → 03/93	 KIT 	A/C(-) A/C(+) AUTO, Ch. 1501805→	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1070R4	5PK950 5PK1100 70x16 113x24 4PK1070
	F20A2	81	01/90 → 03/93	 KIT 	A/C(-) A/C(+) MAN, → Ch. 1002589	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1050R4	5PK950 5PK1100 70x16 113x24 4PK1050
2.0 i 16V (CB3)	F20A4, F20A8	98	01/90 → 03/93	 KIT 	A/C(-) A/C(+) AUTO, Ch. 1501882→	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1070R4	5PK950 5PK1100 70x16 113x24 4PK1070
2.2 i 16V (CB7)	F22A3	110	01/90 → 03/93	 KIT 	A/C(-) A/C(+) AUTO, → Ch. 1501881	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1050R4	5PK950 5PK1100 70x16 113x24 4PK1050
				 	AUTO, Ch. 1501882→	MVB1070R4	4PK1070
2.2 i 16V Automatik (CB7)	F22A3	108	01/90 → 03/93	 KIT 	A/C(-) A/C(+) AUTO, → Ch. 1501881	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1050R4	5PK950 5PK1100 70x16 113x24 4PK1050
				 	AUTO, Ch. 1501882→	MVB1070R4	4PK1070

ACCORD IV Aerodeck (CB8, CC)

2.2 i 16V (CB8)	F22A8	108	01/91 → 12/93	 KIT 	A/C(-) A/C(+) AUTO, → Ch. 1501881	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1050R4	5PK950 5PK1100 70x16 113x24 4PK1050
	F22A7	110	01/91 → 12/93	 KIT 	AUTO, Ch. 1501882→ A/C(-) A/C(+) AUTO, Ch. 1501882→	MVB1070R4 MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1070R4	4PK1070 5PK950 5PK1100 70x16 113x24 4PK1070
				 	MAN, → Ch. 1002607	MVB1050R4	4PK1050

ACCORD IV Coupe (CC1)

2.0 i 16V	F20A7	98	01/92 → 09/93	 	A/C(-), 08/93→ A/C(+), 08/93→ 08/93→	MVB938R6 MVB1115R6 TB354	6PK938 6PK1115 70x16
					08/93→	TB353	113x24



kW



HONDA

...HONDA

ACCORD V (CC7)

2.0 i	F20Z2	85	03/93 → 01/96	⊗	A/C(-), 01/94 →	MVB950R5	5PK950
				⊗	A/C(+), 01/94 →	MVB1100R5	5PK1100
				⊕	01/94 →	TB354	70x16
				⊕	01/94 →	TB353	113x24
				⊕	01/94 →	TBK290	
2.0 i S	F20Z1	96	03/93 → 01/96	⊗	A/C(-), 01/94 →	MVB950R5	5PK950
				⊗	A/C(+), 01/94 →	MVB1100R5	5PK1100
				⊕	01/94 →	TB354	70x16
				⊕	01/94 →	TB353	113x24
				⊕	01/94 →	TBK290	
2.3 i SR	H23A3	116	03/93 → 01/96	⊗	A/C(-), 01/94 →	MVB950R5	5PK950
				⊗	A/C(+), 01/94 →	MVB1100R5	5PK1100
				⊕	01/94 →	TB354	70x16
				⊕	01/94 →	TB378	127x24
				⊕	01/94 →	MVB1070R4	4PK1070

ACCORD V Aerodeck (CE)

2.0 i LS 16V (CE2)	F20B3	100	09/93 → 02/98	⊗	A/C(-), 01/94 → 10/97	MVB938R6	6PK938
				⊗	A/C(+), 01/94 → 10/97	MVB1115R6	6PK1115
				⊕	01/94 → 10/97	TB354	70x16
				⊕	01/94 → 10/97	TB353	113x24
				⊕	01/94 → 10/97	TBK290	
2.2 i ES (CE1)	F22B5	110	09/93 → 02/98	⊗	A/C(-), 01/94 → 10/97	MVB938R6	6PK938
				⊗	A/C(+), 01/94 → 10/97	MVB1115R6	6PK1115
				⊕	01/94 → 10/97	TB354	70x16
				⊕	01/94 → 10/97	TB353	113x24
				⊕	01/94 → 10/97	TBK290	
				⊕	01/94 → 10/97	MVB1065R4	4PK1065

ACCORD V Coupe (CD7, CD9)

2.0 (DC9)	F20B3	100	09/93 → 12/97	⊗	A/C(-)	MVB938R6	6PK938
				⊗	A/C(+)	MVB1115R6	6PK1115
				⊕		TB354	70x16
				⊕		TB353	113x24
2.2 i ES	F22B5	110	09/93 → 02/98	⊗	A/C(-)	MVB938R6	6PK938
				⊗	A/C(+)	MVB1115R6	6PK1115
				⊕		TB354	70x16
				⊕		TB353	113x24
				⊕		TBK290	
				⊕		MVB1065R4	4PK1065

ACCORD VI (CE, CF)

1.9 i (CE7)	F18A3	85	02/96 → 10/98	⊗	A/C(-)	MVB950R5	5PK950
				⊗	A/C(+)	MVB1100R5	5PK1100
				⊕		TB354	70x16
				⊕		TB353	113x24
				⊕		TBK290	
2.0 i LS (CE8)	F20Z1	96	02/96 → 10/98	⊗	A/C(-)	MVB950R5	5PK950
				⊗	A/C(+)	MVB1100R5	5PK1100
				⊕		TB354	70x16
				⊕		TB353	113x24
				⊕		TBK290	
2.0 TDi (CF1)	20T2N	77	04/96 → 10/98	⊗	A/C(-)	MVB1180R6	6PK1180
				⊗	A/C(+)	MVB1460R6	6PK1460
				⊕		TB477	112x28
				⊕		TB513	78x22
				⊕			



kw



HONDA

...HONDA

...ACCORD VI (CE, CF)

2.2 i VTEC (CE9)	F22Z2	110	02/96 → 10/98	⊗ ⊗ ⊕ ⊕ ⊕ ^{KIT} ⊗	A/C(-) A/C(+)	MVB950R5 MVB1100R5 TB354 TB538 TBK346 MVB1070R4	5PK950 5PK1100 70x16 112x24 4PK1070
------------------	-------	-----	---------------	---	------------------	--	---

ACCORD VII (CG)

1.6 i	D16B6	85	10/98 → 12/02	⊗ ⊗ ⊕ ⊕ ^{KIT} ⊗		MVB825R4 MVB790R4 TB451 TBK297 MVB845R4	4PK825 4PK790 104x24 4PK845
1.8 i	F18B2	100	10/98 → 12/02	⊗ ⊗ ⊕ ⊕ ⊕ ^{KIT} ⊗	A/C(-) A/C(+)	MVB955R6 MVB1105R6 TB354 TB538 TBK346 MVB1065R4	6PK955 6PK1105 70x16 112x24 4PK1065
2.0 i	F20B6	108	10/98 → 01/01	⊗ ⊗ ⊕ ⊕ ⊕ ^{KIT} ⊗	A/C(-) A/C(+)	MVB955R6 MVB1105R6 TB354 TB538 TBK346 MVB1065R4	6PK955 6PK1105 70x16 112x24 4PK1065
2.0 Turbo DI	20T2N	77	02/99 → 12/02	⊗ ⊗ ⊕ ⊕ ^{KIT} ⊗	A/C(-) A/C(+)	MVB1180R6 MVB1460R6 TB477 TB513	6PK1180 6PK1460 112x28 78x22
2.2 Type-R	H22A7	156	02/99 → 12/02	⊗ ⊗ ⊕ ⊕ ⊕ ^{KIT} ⊗	A/C(-) A/C(+)	MVB915R6 MVB1045R6 TB354 TB715 MVB1020R4	6PK915 6PK1045 70x16 155x24 4PK1020
2.3	F23Z5	113	01/01 → 12/02	⊗ ⊕ ⊕ ⊕ ^{KIT} ⊗		MVB1105R6 TB354 TB538 TBK346 MVB1065R4	6PK1105 70x16 112x24 4PK1065

ACCORD VII Coupe (CG)

2.0 i 16V	F20B5, F20B7	108	02/98 → 06/03	⊗ ⊗ ⊕ ⊕ ⊕ ^{KIT} ⊗	A/C(-), →10/02 A/C(+), →10/02 →10/02 →10/02 →10/02 →10/02	MVB938R6 MVB1105R6 TB354 TB538 TBK346 MVB1065R4	6PK938 6PK1105 70x16 112x24 4PK1065
3.0 V6 24V	J30A1	147	02/98 → 06/03	⊗ ⊕ ⊗		MVB1173R6 TB805 MVB1110R4	6PK1173 197x26 4PK1110

ACCORD VII Hatchback (CH)

1.8 i (CH6)	F18B2	100	12/99 → 12/02	⊗ ⊗ ⊕ ⊕ ⊕ ^{KIT} ⊗	A/C(-) A/C(+)	MVB955R6 MVB1105R6 TB354 TB538 TBK346 MVB1065R4	6PK955 6PK1105 70x16 112x24 4PK1065
2.0 (CH7)	F20B6	108	12/99 → 12/02	⊗ ⊗ ⊕ ⊕ ⊕ ^{KIT} ⊗	A/C(-) A/C(+)	MVB955R6 MVB1105R6 TB354 TB538 TBK346 MVB1065R4	6PK955 6PK1105 70x16 112x24 4PK1065





kW



HONDA

...HONDA

...ACCORD VII Hatchback (CH)

2.0 TDi	20T2N	77	12/99 → 10/00	 	A/C(-) A/C(+)	MVB1180R6 MVB1460R6 TB477 TB513	6PK1180 6PK1460 112x28 78x22
2.3 (CL4)	F23Z5	113	11/00 → 12/02	 		MVB1105R6 TB354 TB538 TBK346 MVB1065R4	6PK1105 70x16 112x24 4PK1065

ACCORD VIII (CL_, CM_)

2.0 (CL7)	K20A	114	02/03 →			MVB1760R7	7PK1760
2.0 All-wheel Drive (CL8)	K20A	114	02/03 →			MVB1760R7	7PK1760
2.2 i-CTDi	N22A1	103	01/04 →		→05/08	MVB2265R7	7PK2265

ACCORD VIII Tourer (CM_)

2.0 (CM1)	K20A	114	04/03 →			MVB1760R7	7PK1760
2.2 i-CTDi	N22A1	103	01/04 →		→05/08	MVB2265R7	7PK2265

CIVIC II

1.2	D12B1, ZA2	40	01/85 → 10/87	 		MVB735R3 TB203 SVB10888	3PK735 101x24 10x888
1.3	EV2	52	10/83 → 10/87	 		MVB735R3 TB203 SVB10888	3PK735 101x24 10x888
1.5 GL	EW2	63	10/83 → 10/87	 		SVB13850 MVB735R3 TB203 SVB10888	13x850 3PK735 101x24 10x888
1.5 GT	EW3	74	01/85 → 10/87	 		SVB13850 MVB735R3 TB203 SVB10888	13x850 3PK735 101x24 10x888
1.5 GTI	EW4	66	03/86 → 10/87	 		SVB13850 MVB735R3 TB203 SVB10888	13x850 3PK735 101x24 10x888

CIVIC II Hatchback (AL, AJ, AG, AH)

1.2 (AL)	D12B1, ZA2	40	01/84 → 10/87	 		MVB735R3 TB203 SVB10888	3PK735 101x24 10x888
1.3 (AG)	EV2	52	10/83 → 10/87	 		MVB735R3 TB203 SVB10888	3PK735 101x24 10x888
1.5 GL (AH)	EW2	63	10/83 → 10/87	 		SVB13850 MVB735R3 TB203 SVB10888	13x850 3PK735 101x24 10x888
1.5 GT (AH)	EW3	74	01/85 → 10/87	 		SVB13850 MVB735R3 TB203 SVB10888	13x850 3PK735 101x24 10x888
1.5 GTI (AH)	EW4	66	03/86 → 10/87	 		SVB13850 MVB735R3 TB203 SVB10888	13x850 3PK735 101x24 10x888

CIVIC II Shuttle (EE)

1.4 i 16V (EE1)	D14A1	66	01/88 → 12/92	 		MVB870R4 MVB760R3 TB316 SVB10790	4PK870 3PK760 106x24 10x790
-----------------	-------	----	---------------	----------	--	---	--------------------------------------



kW



HONDA

...HONDA

...CIVIC II Shuttle (EE)

1.5 i 16V (EE2)	D15B2	69	01/88 → 11/91	 	MVB870R4 MVB760R3 TB316 SVB10790	4PK870 3PK760 106x24 10x790
1.6 i 16V 4WD (EE4)	D16A6	80	01/88 → 12/89	 	MVB870R4 MVB760R3 TB317 TBK070 SVB10790	4PK870 3PK760 107x24 10x790
		81	01/88 → 02/95	 	MVB870R4 MVB760R3 TB317 TBK070 SVB10790	4PK870 3PK760 107x24 10x790

CIVIC III Hatchback (EC, ED, EE)

1.3 (EC8)	D13B1	55	10/87 → 12/89	 	MVB870R4 MVB760R3 TB316 TBK289 SVB10790	4PK870 3PK760 106x24 10x790
1.3 16 V (EC8) CAT	D13B2	55	09/89 → 09/91	 	MVB870R4 MVB760R3 TB316 TBK289 SVB10790	4PK870 3PK760 106x24 10x790
1.4 L (EC9)	D14A1	66	10/87 → 12/89	 	MVB870R4 MVB760R3 TB316 TBK289 SVB10790	4PK870 3PK760 106x24 10x790
1.5 i 16V	D15B2	66	10/88 → 09/91	 	MVB870R4 MVB760R3 TB316 TBK289 SVB10790	4PK870 3PK760 106x24 10x790
1.5 i 16V (ED6)	D15B2	69	10/88 → 09/91	 	MVB870R4 MVB760R3 TB316 TBK289 SVB10790	4PK870 3PK760 106x24 10x790
1.6 i 16V	D16A7, D16A9	96	09/87 → 09/91	 	Eng. D16A9, 01/88 → Eng. D16A9, 01/88 → MVB870R4 MVB760R3 TB272	4PK870 3PK760 124x24
1.6 i 16V (ED7)	D16A6	80	10/87 → 09/91	 	MVB870R4 MVB760R3 TB317 TBK070 SVB10790	4PK870 3PK760 107x24 10x790
		81	10/87 → 09/91	 	MVB870R4 MVB760R3 TB317 TBK070 SVB10790	4PK870 3PK760 107x24 10x790
1.6 i 16V Vtec (EE9)	B16A1	110	10/89 → 09/91	 	MVB845R4 MVB775R4 TB377	4PK845 4PK775 124x26



kW



HONDA

...HONDA

CIVIC III Saloon (ED)

1.3	D13B1	55	10/87 → 12/89	 		MVB870R4 4PK870 MVB760R3 3PK760 TB316 106x24 TBK289 SVB10790 10x790
1.4 L (ED2)	D14A1	66	10/87 → 12/89	 		MVB870R4 4PK870 MVB760R3 3PK760 TB316 106x24 TBK289 SVB10790 10x790
1.5 i 16V	D15B2	66	10/87 → 09/91	 		MVB870R4 4PK870 MVB760R3 3PK760 TB316 106x24 TBK289 SVB10790 10x790
1.5 i 16V (ED3)	D15B2	69	10/87 → 09/91	 		MVB870R4 4PK870 MVB760R3 3PK760 TB316 106x24 TBK289 SVB10790 10x790
1.6 i 16V	D16A7	96	09/87 → 09/91	 	01/88 → 01/88 → 01/88 → 01/88 → 01/88 →	MVB870R4 4PK870 MVB760R3 3PK760 TB317 107x24 TBK070 SVB10790 10x790
1.6 i 16V (ED4)	D16A6	80	11/87 → 09/91	 		MVB870R4 4PK870 MVB760R3 3PK760 TB317 107x24 TBK070 SVB10790 10x790
	D16Z2	81	10/87 → 09/91	 		MVB870R4 4PK870 MVB760R3 3PK760 TB317 107x24 TBK070 SVB10790 10x790
1.6 i 16V 4x4	D16A6	80	10/89 → 09/91	 	→12/89 12/89 → →12/89 12/88 → →12/89 SOHC/OHC 12/89 → 12/89 →	MVB845R4 4PK845 MVB870R4 4PK870 MVB775R4 4PK775 MVB760R3 3PK760 TB377 124x26 TB317 107x24 TBK070 SVB10790 10x790

CIVIC IV (EG, EH)

1.3		55	01/92 → 12/92	 		MVB800R4 4PK800 MVB870R4 4PK870 MVB775R4 4PK775 TB316 106x24 TBK289 MVB810R4 4PK810
1.5 i 16V (EG8)	D15B2, D15Z1	69	10/91 → 11/95	 	Eng. D15B2 Eng. D15Z1 Eng. D15B2 Eng. D15Z1	MVB800R4 4PK800 MVB870R4 4PK870 MVB775R4 4PK775 TB316 106x24 TB450 103x24 TBK289 TBK296 MVB810R4 4PK810



kW



HONDA

...HONDA

...CIVIC IV (EG, EH)

1.6 16V Vtec (EH9)	D16Z6, D16Z7	92	10/91 → 11/95	 	Eng. D16Z7 Eng. D16Z7	MVB800R4 4PK800 MVB775R4 4PK775 TB451 104x24 TBK297 MVB810R4 4PK810
1.6 VTi (EG9)	B16A2	118	10/91 → 11/95	 		MVB835R4 4PK835 MVB775R4 4PK775 TB377 124x26 MVB870R4 4PK870

CIVIC IV Coupe (EJ)

1.5 i LSi (EJ2)	D15B7	74	01/94 → 11/95	 		MVB800R4 4PK800 MVB775R4 4PK775 TB316 106x24 TBK289 MVB810R4 4PK810
1.6 i (EJ6)	D16Y7	77	01/94 → 11/95	 		MVB825R4 4PK825 MVB800R4 4PK800 TB451 104x24 TBK297 MVB845R4 4PK845
1.6 i Vtec (EJ1)	D16Y6, D16Z9	92	01/94 → 03/96	 		MVB800R4 4PK800 MVB775R4 4PK775 TB451 104x24 TBK297 MVB810R4 4PK810

CIVIC IV Fastback (MA, MB)

1.4 i (MA8)	D14A2	66	09/94 → 01/97	 	11/95 → 11/95 → 11/95 → 11/95 → 11/95 →	MVB800R4 4PK800 MVB790R4 4PK790 TB316 106x24 TBK289 MVB810R4 4PK810
1.5 i Vtec-E (MA9)	D15Z3	66	09/94 → 01/97	 	11/95 → 11/95 → 11/95 → 11/95 → 11/95 →	MVB800R4 4PK800 MVB790R4 4PK790 TB450 103x24 TBK296 MVB810R4 4PK810
1.6 i (MB1)	D16Y3	83	09/94 → 01/97	 	11/95 → 11/95 → 11/95 → 11/95 →	MVB800R4 4PK800 MVB790R4 4PK790 TB317 107x24 MVB810R4 4PK810
1.6 i Vtec (MB1)	D16Y2	93	09/94 → 01/97	 	11/95 → 11/95 → 11/95 → 11/95 →	MVB800R4 4PK800 MVB790R4 4PK790 TB317 107x24 TBK070 MVB810R4 4PK810

CIVIC IV Hatchback (EG)

1.3 16V (EG3)	D13B2	55	10/91 → 11/95	 		MVB800R4 4PK800 MVB870R4 4PK870 MVB775R4 4PK775 TB316 106x24 TBK289 MVB810R4 4PK810
1.5 i 16V	D15B2	66	10/91 → 11/95	 	Eng. D15B2 Eng. D15Z1 Eng. D15B2 Eng. D15Z1	MVB800R4 4PK800 MVB870R4 4PK870 MVB775R4 4PK775 TB316 106x24 TB450 103x24 TBK289 TBK296 MVB810R4 4PK810





kW



...HONDA

...CIVIC IV Hatchback (EG)

1.5 i 16V (EG4)	D15B2, D15Z1	69	10/91 → 11/95	 	Eng. D15B2 Eng. D15Z1 Eng. D15B2 Eng. D15Z1 Eng. D15B2 Eng. D15Z1	MVB870R4 MVB800R4 MVB775R4 TB316 TB450 TBK289 TBK296 MVB810R4	4PK870 4PK800 4PK775 106x24 103x24 4PK810
1.6 16V Vtec (EG5)	D16Z6	92	10/91 → 11/95	 		MVB800R4 MVB775R4 TB451 TBK297 MVB810R4	4PK800 4PK775 104x24 4PK810
1.6 VTi 16V (EG6)	B16A2	118	10/91 → 11/95	 		MVB835R4 MVB775R4 TB377 MVB870R4	4PK835 4PK775 124x26 4PK870

CIVIC V (EJ9, EK3/4)

1.4 i (EJ9)	D14A4	66	11/95 → 02/01	 		MVB825R4 MVB800R4 TB450 TBK296 MVB845R4	4PK825 4PK800 103x24 4PK845
1.5 i (EK3)	D15Z6	84	11/95 → 02/01	 		MVB825R4 MVB800R4 TB450 TBK296 MVB845R4	4PK825 4PK800 103x24 4PK845
1.6 i Vtec	D16Y6, D16Y8	92	11/95 → 02/01	 		MVB825R4 MVB800R4 TB451 TBK297 MVB845R4	4PK825 4PK800 104x24 4PK845
1.6 VTi (EK4)	B16A2	118	11/95 → 02/01	 		MVB845R4 MVB775R4 TB377 MVB875R4	4PK845 4PK775 124x26 4PK875

CIVIC V Aerodeck (MC)

1.4 16V (MB8)	D14A7	55	04/98 → 02/01	 		MVB825R4 MVB790R4 TB450 TBK296 MVB845R4	4PK825 4PK790 103x24 4PK845
	D14A8	66	04/98 → 02/01	 		MVB825R4 MVB790R4 TB450 TBK296 MVB845R4	4PK825 4PK790 103x24 4PK845
1.5 16V (MB9)	D15Z8	84	04/98 → 02/01	 		MVB825R4 MVB790R4 TB450 TBK296 MVB845R4	4PK825 4PK790 103x24 4PK845
1.6 16V (MC1)	D16B2	85	04/98 → 02/01	 		MVB825R4 MVB790R4 TB451 TBK297 MVB845R4	4PK825 4PK790 104x24 4PK845



kW



HONDA

...HONDA

...CIVIC V Aerodeck (MC)

1.8 16V (MC2)	B18C4	124	04/98 → 02/01	 		MVB845R4 4PK845 MVB790R4 4PK790 TB804 126x26 MVB920R4 4PK920
2.0 i D (MC3)	20T2N	77	04/98 → 02/01	 	A/C(+)	MVB1460R6 6PK1460 TB477 112x28

CIVIC V Coupe (EJ6, EJ8)

1.6 i	D16Y7	77	03/96 → 03/00	 		MVB825R4 4PK825 MVB800R4 4PK800 TB451 104x24 TBK297 MVB845R4 4PK845
1.6 i Vtec	D16Y8	92	03/96 → 03/00	 		MVB825R4 4PK825 MVB800R4 4PK800 TB451 104x24 TBK297 MVB845R4 4PK845
	B16A2	118	04/99 → 12/00	 		MVB845R4 4PK845 MVB775R4 4PK775 TB377 124x26 MVB875R4 4PK875

CIVIC V Fastback (MB)

1.4 16V (MB2)	D14A7	55	01/97 → 02/01	 	11/98 → 10/00 11/98 → 10/00 11/98 → 10/00 11/98 → 10/00 11/98 → 10/00	MVB825R4 4PK825 MVB790R4 4PK790 TB450 103x24 TBK296 MVB845R4 4PK845
	D14A8	66	01/97 → 02/01	 	11/98 → 10/00 11/98 → 10/00 11/98 → 10/00 11/98 → 10/00 11/98 → 10/00	MVB825R4 4PK825 MVB790R4 4PK790 TB450 103x24 TBK296 MVB845R4 4PK845
1.5 16V (MB3)	D15Z8	84	01/97 → 02/01	 	→ 10/00 → 10/00 → 10/00 → 10/00 → 10/00	MVB825R4 4PK825 MVB790R4 4PK790 TB450 103x24 TBK296 MVB845R4 4PK845
1.6 16V (MB4)	D16B2	85	01/97 → 02/01	 	→ 10/00 → 10/00 → 10/00 → 10/00 → 10/00	MVB825R4 4PK825 MVB790R4 4PK790 TB451 104x24 TBK297 MVB845R4 4PK845
1.8 16V (MB6)	B18C4	124	01/97 → 02/01	 	→ 10/00 → 10/00 → 10/00 → 10/00	MVB845R4 4PK845 MVB790R4 4PK790 TB804 126x26 MVB920R4 4PK920
2.0 i TD (MB7)		63	01/97 → 02/01	 	A/C(-), → 12/98 A/C(+), → 12/98 → 12/98 → 12/98	MVB1180R6 6PK1180 MVB1460R6 6PK1460 TB477 112x28 TB513 78x22
2.0 TDiC		77	11/98 → 10/00	 		MVB1460R6 6PK1460 TB477 112x28

CIVIC V Hatchback (EJ9, EK1/3/4)

1.4 i (EJ9)	D14A3, D14Z1	55	11/95 → 02/01	 		MVB825R4 4PK825 MVB800R4 4PK800 TB450 103x24 TBK296 MVB845R4 4PK845
-------------	--------------	----	---------------	------------------	--	--



kW



...HONDA

...CIVIC V Hatchback (EJ9, EK1/3/4)

1.4 i S (EJ9)	D14A4	66	11/95 → 02/01	 		MVB825R4 4PK825 MVB800R4 4PK800 TB450 103x24 TBK296 MVB845R4 4PK845
1.6 i (EK1)	D16Y5	84	11/95 → 02/01	 		MVB825R4 4PK825 MVB800R4 4PK800 TB451 104x24 TBK297 MVB845R4 4PK845
1.6 VTi (EK4)	B16A2	118	11/95 → 02/01	 		MVB845R4 4PK845 MVB775R4 4PK775 TB377 124x26 MVB875R4 4PK875
2.0 TDiC		77	11/98 → 10/00	 		MVB1460R6 6PK1460 TB477 112x28

CIVIC VI

1.4 (ES4)	D14Z5	66	02/01 → 09/05	 	A/C(-) A/C(+)	MVB860R6 6PK860 MVB1000R6 6PK1000 TB736 103x22
1.6		81	02/01 → 09/05	 	→10/04 →10/04	MVB1000R6 6PK1000 TB749 104x22

CIVIC VI Coupe (EM)

1.6 i		81	02/01 → 12/05	 	→10/04 →10/04 →10/04	MVB986R6 6PK986 TB749 104x22 MVB1015R4 4PK1015
1.7 i		88	05/01 → 12/05	 	→10/04 →10/04 →10/04	MVB986R6 6PK986 TB749 104x22 MVB1015R4 4PK1015
1.7 i VTEC		92	05/01 → 12/05	 	→10/04 →10/04 →10/04	MVB986R6 6PK986 TB749 104x22 MVB1015R4 4PK1015

CIVIC VI Hatchback (EU_, EP_)

1.4 i		55	02/01 → 09/05	 	→03/01 →03/01 →03/01 →03/01 →03/01	MVB825R4 4PK825 MVB800R4 4PK800 TB450 103x24 TBK296 MVB845R4 4PK845
1.4 iS (EP1)	D14Z6	66	02/01 → 09/05	 	A/C(-) A/C(+)	MVB860R6 6PK860 MVB1000R6 6PK1000 TB736 103x22
1.6 i	D16V1	81	02/01 → 09/05	 	A/C(-) A/C(+)	MVB860R6 6PK860 MVB1000R6 6PK1000 TB749 104x22
1.7 CTDi	4EE-2	74	01/02 → 09/05	 	A/C(-) A/C(+)	MVB1270R6 6PK1270 MVB1625R6 6PK1625 TB740 129x25
2.0 i Sport	K20A3	118	01/04 → 09/05			MVB1760R7 7PK1760
2.0 Type-R	K20A2	147	09/01 → 09/05	 	A/C(-) A/C(+)	MVB1285R7 7PK1285 MVB1638R7 7PK1638

CIVIC VII Hatchback (FD_)

1.4	L13A7	61	01/06 →	 		MVB1000R6 6PK1000 TB736 103x22
Type R		148	09/06 →			MVB1638R7 7PK1638



kW



HONDA

...HONDA

CONCERTO (HW)

1.4	D14A1, D14A8	66	08/89 → 10/91	 	Eng. D14A1 Eng. D14A1	MVB870R4 MVB760R3 TB316 TBK289 SVB10888	4PK870 3PK760 106x24 10x888
	D14A1	61	10/89 → 10/92	 	→12/91 01/92→ →12/91 01/92→	MVB870R4 MVB810R4 MVB760R3 MVB785R3 TB316 TBK289 SVB10888	4PK870 4PK810 3PK760 3PK785 106x24 10x888
1.5 i 16V	D15B2	66	08/89 → 03/95	 	→12/91 01/92→ →12/91 01/92→	MVB870R4 MVB810R4 MVB760R3 MVB785R3 TB316 TBK289 SVB10888	4PK870 4PK810 3PK760 3PK785 106x24 10x888
1.6 16V	D16Z2	82	08/89 → 03/95	 	→12/91 01/92→ →12/91 01/92→	MVB870R4 MVB810R4 MVB760R3 MVB785R3 TB317 TBK070 SVB10888	4PK870 4PK810 3PK760 3PK785 107x24 10x888
1.6 i 16V				D16A8	90	08/89 → 03/95	
1.8 TD	XUD7T	58	08/94 → 10/96	 		MVB700R5 TB560 TBK020 SVB10710	5PK700 136x25.4 10x710
				65		08/94 → 10/96	

CONCERTO Saloon (HWW)

1.4	D14A1, D14A8	66	08/89 → 10/91	 	Eng. D14A1 Eng. D14A1	MVB870R4 MVB760R3 TB316 TBK289 SVB10888	4PK870 3PK760 106x24 10x888
	D14A1	61	10/89 → 10/92	 	→12/91 01/92→ →12/91 01/92→	MVB870R4 MVB810R4 MVB760R3 MVB785R3 TB316 TBK289 SVB10888	4PK870 4PK810 3PK760 3PK785 106x24 10x888



kW



...HONDA

...CONCERTO Saloon (HWW)

1.5 i 16V	D15B2	66	08/89 → 05/95	⊗	→12/91	MVB870R4	4PK870
				⊗	01/92→	MVB810R4	4PK810
				⊗	→12/91	MVB760R3	3PK760
				⊗	01/92→	MVB785R3	3PK785
				⊗		TB316	106x24
1.6 16V		78	08/89 → 03/95	⊗	→12/91	MVB870R4	4PK870
				⊗	01/92→	MVB810R4	4PK810
				⊗	→12/91	MVB760R3	3PK760
				⊗	01/92→	MVB785R3	3PK785
				⊗		TB317	107x24
1.6 i 16V	D16Z2	82	08/89 → 03/95	⊗	→12/91	MVB870R4	4PK870
				⊗	01/92→	MVB810R4	4PK810
				⊗	→12/91	MVB760R3	3PK760
				⊗	01/92→	MVB785R3	3PK785
				⊗		TB317	107x24
	D16A8	90	08/89 → 03/95	⊗	→12/91	MVB870R4	4PK870
				⊗	01/92→	MVB810R4	4PK810
				⊗	→12/91	MVB760R3	3PK760
				⊗	01/92→	MVB785R3	3PK785
				⊗		TB272	124x24
				⊗		SVB10940	10x940

CR-V I (RD)

2.0 16V (RD1, RD3)	B20B	94	10/95 → 01/99	⊗	02/97→	MVB845R4	4PK845
				⊗	02/97→	MVB825R4	4PK825
				⊗	02/97→	TB616	125x26
				⊗	02/97→	MVB900R4	4PK900
	B20Z1	108	01/99 → 02/02	⊗		MVB845R4	4PK845
				⊗		MVB825R4	4PK825
				⊗		TB616	125x26
				⊗		MVB900R4	4PK900

CR-V II (RD_)

2.0	K20A4	110	07/02 → 09/06	⊗		MVB1730R7	7PK1730
2.2 CTDi	N22A2	103	02/05 → 09/06	⊗		MVB2265R7	7PK2265

CR-V III

2.2 i-CTDi	N22A2	103	01/07 →	⊗		MVB2265R7	7PK2265
------------	-------	-----	---------	---	--	-----------	---------

CRX I (AF, AS)

1.5 i (AF)	EW3	74	10/83 → 11/86	⊗		MVB870R4	4PK870
				⊗		MVB735R3	3PK735
				⊗		TB203	101x24
1.6 i 16V (AS)	ZC1	92	03/86 → 10/87	⊗		MVB870R4	4PK870
				⊗		MVB715R3	3PK715
				⊗		TB355	129x24
				⊗		SVB10800	10x800



kw



HONDA

...HONDA

CRX II (ED, EE)

1.6 i 16V (ED9)	D16A9	96	10/87 → 12/89	→12/87 →12/87 →12/87 →12/87 →12/87	MVB870R4 4PK870 MVB760R3 3PK760 MVB715R3 3PK715 TB272 124x24 TB355 129x24 SVB10800 10x800
	D16Z5	91	10/87 → 02/92	→12/87 →12/87 →12/87 →12/87 →12/87	MVB870R4 4PK870 MVB760R3 3PK760 MVB715R3 3PK715 TB272 124x24 TB355 129x24 SVB10800 10x800
1.6 i 16V Vtec (EE8)	B16A1	110	10/89 → 02/92	 	MVB845R4 4PK845 MVB775R4 4PK775 TB377 124x26

CRX III (EH, EG)

1.6 ESi (EH6)	D16Z6	92	03/92 → 12/98	→12/95 01/96 → 04/98 →12/95 01/96 → 04/98 →04/98 →04/98 →12/95 01/96 → 04/98	MVB800R4 4PK800 MVB825R4 4PK825 MVB775R4 4PK775 MVB800R4 4PK800 TB451 104x24 TBK297 MVB810R4 4PK810 MVB1020R4 4PK1020
1.6 i VTi (EG2)	B16A2	118	03/92 → 12/98	→12/95 01/96 → 04/98 →04/98 →04/98 →04/98	MVB835R4 4PK835 MVB825R4 4PK825 MVB775R4 4PK775 TB377 124x26 MVB870R4 4PK870

FR-V

1.7	D17A2	92	02/05 →	→09/06 →09/06 →09/06	MVB986R6 6PK986 TB749 104x22 MVB1025R4 4PK1025
2.2 i CTDi	N22A1	103	07/05 →		MVB2265R7 7PK2265

HR-V (GH)

1.6 16V	D16W1	77	03/99 →	→09/05 →09/05 →09/05 →09/05 →09/05	MVB845R4 4PK845 MVB800R4 4PK800 TB451 104x24 TBK297
1.6 16V 4WD	D16W1	77	03/99 →	→09/05 →09/05 →09/05 →09/05 →09/05	MVB845R4 4PK845 MVB800R4 4PK800 TB451 104x24 TBK297
	D16W5	91	10/99 →	→09/05 →09/05 →09/05 →09/05	MVB845R4 4PK845 MVB800R4 4PK800 TB451 104x24 TBK297

INTEGRA (DA_)

1.5	D15A1	63	10/85 → 08/89	 	SVB13825 13x825 MVB735R3 3PK735 TB203 101x24 SVB10875 10x875
1.6	D16A3	88	03/86 → 08/89	 	SVB13900 13x900 MVB715R3 3PK715 TB355 129x24 SVB10900 10x900



kW



HONDA

...HONDA

INTEGRA (DC2)

1.8 Type-R	B18C6	140	11/97 → 10/01	→10/00 →10/00 →10/00 →10/00	MVB810R4 4PK810 MVB763R4 4PK763 TB804 126x26 MVB920R4 4PK920
------------	-------	-----	---------------	--------------------------------------	---

JAZZ (AA)

45 1.2	ER2	33	02/84 → 10/86	→10/00 →10/00	MVB960R3 3PK960 TB181 97x19
55 1.2	ER4	40	09/84 → 10/86	→10/00 →10/00	MVB960R3 3PK960 TB181 97x19
56 1.2	ER1	41	10/83 → 10/86	→10/00 →10/00	MVB960R3 3PK960 TB181 97x19

JAZZ (GD)

1.2	L12A1	57	03/02 →	→09/07 A/C(-), →09/07 A/C(+), →09/07	MVB1155R5 5PK1155 MVB850R5 5PK850 MVB1137R6 6PK1137
1.4	L13A1	61	03/02 →	A/C(-), →06/06 A/C(+), →06/06 A/C(+), →06/06	MVB850R5 5PK850 MVB1137R6 6PK1137 MVB1155R5 5PK1155

LEGEND I (HS, KA)

2.5 i (HS)	C25A1	110	01/86 → 12/87	→12/87 →12/87 →12/87	MVB915R4 4PK915 TB312 192x28 SVB101050 10x1050
	C25A2	127	02/87 → 06/88	→12/87 →12/87 →12/87	MVB915R4 4PK915 TB312 192x28 SVB101050 10x1050
2.7 i 24V (KA4)	C27A1	124	01/88 → 12/90	→12/87 →12/87 →12/87	MVB915R4 4PK915 TB312 192x28 SVB101075 10x1075

LEGEND I Coupe (KA3)

2.7 i 24V	C27A1	124	10/87 → 12/90	→12/87 →12/87 →12/87	MVB915R4 4PK915 TB312 192x28 SVB101050 10x1050
-----------	-------	-----	---------------	----------------------------	---

LEGEND II (KA7)

3.2 i 24V	C32A2	151	01/91 → 02/96	→09/04 →09/04 →09/04 →09/04	MVB960R5 5PK960 MVB938R5 5PK938 TB391 196x28 MVB950R4 4PK950
-----------	-------	-----	---------------	--------------------------------------	---

LEGEND II Coupe (KA8)

3.2 i 24V	C32A2	151	01/91 → 02/96	→09/04 →09/04 →09/04 →09/04	MVB960R5 5PK960 MVB938R5 5PK938 TB391 196x28 MVB950R4 4PK950
-----------	-------	-----	---------------	--------------------------------------	---

LEGEND III (KA9)

3.5 i 24V	C35A2	151	02/96 →	→09/04 →09/04 →09/04	MVB950R5 5PK950 MVB938R5 5PK938 MVB950R4 4PK950
-----------	-------	-----	---------	----------------------------	--

LOGO (GA3)

1.3	D13B7	48	03/99 → 03/02	→11/01 →11/01 →11/01	MVB800R4 4PK800 TB736 103x22 MVB887R3 3PK887
-----	-------	----	---------------	----------------------------	---

NSX Convertible (NA)

3.0 24V Vtec	C30A3	201	03/95 → 09/05	→11/01 →11/01	MVB975R4 4PK975 MVB1100R5 5PK1100
3.0 24V Vtec Automatic	C30A4	188	03/95 → 09/05	→11/01 →11/01	MVB975R4 4PK975 MVB1100R5 5PK1100



kw



HONDA

...HONDA

...NSX Convertible (NA)

3.2 24V Vtec	C32B2	206	01/97 → 09/05	☼ Ⓢ		MVB975R4 MVB1100R5	4PK975 5PK1100
--------------	-------	-----	---------------	--------	--	-----------------------	-------------------

NSX Coupe (NA)

3.0 24V Vtec (NA1)	C30A3	201	06/90 → 09/05	☼ Ⓢ		MVB975R4 MVB1100R5	4PK975 5PK1100
3.0 24V Vtec Automatik (NA1)	C30A4	188	06/90 → 09/05	☼ Ⓢ		MVB975R4 MVB1100R5	4PK975 5PK1100
3.2 24V Vtec (NA2)	C32B2	206	01/97 → 09/05	☼ Ⓢ		MVB975R4 MVB1100R5	4PK975 5PK1100

PRELUDE II (AB)

1.8 EX	ET3, ET4	74	11/85 → 04/87	Ⓢ Ⓢ		SVB10950 TB202	10x950 108x24
	ET2, ET3	77	11/83 → 04/87	Ⓢ Ⓢ		SVB10950 TB202	10x950 108x24

PRELUDE III (BA)

2.0 (BA4)	B20A4	84	08/87 → 01/92	☼	→09/91	MVB1050R5	5PK1050
				Ⓢ	→09/91	MVB875R5	5PK875
				Ⓢ	→09/91	TB317	107x24
				Ⓢ	→09/91	MVB975R4	4PK975
2.0 EX (BA4)	B20A3	80	04/87 → 01/92	☼	10/87→09/91	MVB1050R5	5PK1050
				Ⓢ	10/87→09/91	MVB875R5	5PK875
				Ⓢ	10/87→09/91	TB317	107x24
				Ⓢ	10/87→09/91	MVB975R4	4PK975
2.0 i EX 16V	B20A1	101	04/86 → 12/87	☼		MVB1050R5	5PK1050
				Ⓢ		MVB813R3	3PK813
				Ⓢ		TB313	133x24
	B20A7	110	10/87 → 12/90	☼		SVB10900	10x900
				Ⓢ		MVB1050R5	5PK1050
				Ⓢ		MVB875R5	5PK875
2.0 i EX 16V (BA2)	B20A1	101	04/86 → 12/87	☼		TB272	124x24
				Ⓢ		MVB975R4	4PK975
				Ⓢ		MVB1050R5	5PK1050
				Ⓢ		MVB813R3	3PK813
2.0 i EX 16V (BA4)	B20A9	103	04/90 → 01/92	☼	→09/91	TB313	133x24
				Ⓢ	→09/91	SVB10900	10x900
				Ⓢ	→09/91	MVB1050R5	5PK1050
				Ⓢ	→09/91	MVB875R5	5PK875
2.0 i EX 16V (BA4) CAT	B20A5	101	04/87 → 01/92	☼	→09/91	TB272	124x24
				Ⓢ	→09/91	MVB975R4	4PK975
				Ⓢ	10/87→09/91	MVB1050R5	5PK1050
				Ⓢ	10/87→09/91	MVB875R5	5PK875
				☼	10/87→09/91	TB272	124x24
				Ⓢ	10/87→09/91	MVB975R4	4PK975
				Ⓢ		MVB1050R5	5PK1050
				Ⓢ		MVB875R5	5PK875

PRELUDE IV (BB)

2.0 i 16V (BB3)	F20A4	98	02/92 → 09/96	☼		MVB1073R5	5PK1073
				Ⓢ		MVB950R5	5PK950
				Ⓢ		TB354	70x16
				Ⓢ		TB353	113x24
				Ⓢ		TBK290	
2.2 i 16V Vtec (BB1)	H22A2	136	02/93 → 09/96	☼		MVB1020R4	4PK1020
				Ⓢ		MVB1045R6	6PK1045
				Ⓢ		MVB915R6	6PK915
				Ⓢ		TB354	70x16
				Ⓢ		TB715	155x24
2.3 i 16V (BB2)	H23A2	118	02/92 → 09/96	☼		MVB1020R4	4PK1020
				Ⓢ		MVB1073R5	5PK1073
				Ⓢ		MVB950R5	5PK950
				Ⓢ		TB354	70x16
				Ⓢ		TB378	127x24
				☼		MVB1020R4	4PK1020





kW



...HONDA

PRELUDE V (BB)

2.0 16V (BB9)	F20A4	98	10/96 → 10/00	 	A/C(-) A/C(+)	MVB946R6 MVB1080R6 TB354 TB353 TBK290 MVB1050R4	6PK946 6PK1080 70x16 113x24 4PK1050
2.2 16V	H22A5	147	10/96 → 10/00	 		MVB1045R6 TB354 TB715 MVB1020R4	6PK1045 70x16 155x24 4PK1020
2.2 16V (BB6, BB8)	H22A5	136	10/96 → 10/00	 		MVB1045R6 TB354 TB715 MVB1020R4	6PK1045 70x16 155x24 4PK1020

S2000 (AP)

2.0	F20C VTEC	177	06/99 →	 	→09/04 A/C(-), →09/04	MVB1469R6 MVB1137R6	6PK1469 6PK1137
-----	-----------	-----	---------	------	--------------------------	--------------------------------------	--------------------

SHUTTLE (RA)

2.2 16V	F22B8	110	10/94 → 02/98	 	A/C(-), 03/95 → A/C(+), 03/95 → 03/95 → 03/95 → 03/95 → 03/95 →	MVB938R6 MVB1088R6 TB354 TB353 TBK290 MVB1065R4	6PK938 6PK1088 70x16 113x24 4PK1065
2.3 16V	F23A7	110	10/97 → 06/02	 	A/C(-) A/C(+) →10/00 →12/97	MVB938R6 MVB1088R6 TB354 TB353 TB538 TBK290 MVB1065R4	6PK938 6PK1088 70x16 113x24 112x24 4PK1065

STREAM (RN)

1.7 16V	D17A2	92	05/01 →	 	A/C(-), →09/05 A/C(+), →09/05 →09/05 →09/05	MVB860R6 MVB986R6 TB749 MVB1025R4	6PK860 6PK986 104x22 4PK1025
2.0 16V	K20A	115	05/01 →	 	A/C(-), →09/05 A/C(+), →09/05	MVB1388R7 MVB1775R7	7PK1388 7PK1775

HYUNDAI

ACCENT (LC)

1.3	G4E-A	55	01/00 →	 	→08/06 →08/06 →08/06 →08/06 →08/06	MVB855R4 MVB900R4 TB679 TBK339 MVB613R4	4PK855 4PK900 110x22 4PK613
				 	→08/06 →08/06 →08/06 →08/06 →08/06	MVB855R4 MVB900R4 TB679 TBK339 MVB613R4	4PK855 4PK900 110x22 4PK613
				 	→08/06 →08/06 →08/06 →08/06 →08/06	MVB855R4 MVB900R4 TB679 TBK339 MVB613R4	4PK855 4PK900 110x22 4PK613
	G4E-A	63	01/00 →	 	→08/06 →08/06 →08/06 →08/06 →08/06	MVB855R4 MVB900R4 TB679 TBK339 MVB613R4	4PK855 4PK900 110x22 4PK613



kW



HYUNDAI

...HYUNDAI

...ACCENT (LC)

...1.3		62	08/02 →	 	→08/06 →08/06 →08/06 →08/06 →08/06	MVB855R4 MVB900R4 TB679 TBK339 MVB613R4	4PK855 4PK900 110x22 4PK613
1.5	G4EC-G	75	09/00 →	 	→02/03 →02/03 →02/03 →02/03 →10/02	MVB810R4 MVB855R4 TB537 TBK325 MVB613R4	4PK810 4PK855 105x22 4PK613
	G4EB	66	01/00 →	 	→02/03 →02/03 →02/03 →02/03 →02/03	MVB850R4 MVB900R4 TB679 TBK339 MVB613R4	4PK850 4PK900 110x22 4PK613
1.5 CRDi	D3-EA	60	04/02 →	 	A/C(+), PS, →08/06 PS, →08/06 →08/06	MVB900R4 MVB1440R6 TB714	4PK900 6PK1440 123x28
1.6	G4ED-G	77	12/02 →	 	→08/06 →08/06 →08/06 →08/06 →08/06 →08/06	MVB810R4 MVB850R4 MVB855R4 TB537 TBK325 SVB13655	4PK810 4PK850 4PK855 105x22 13x655

ACCENT (MC)

1.4 GL	G4EE	71	11/05 →	 		MVB810R4 MVB850R4 TB537 TBK325	4PK810 4PK850 105x22 5PK1800
1.5 CRDi GLS	D4FA	81	11/05 →			MVB1800R5	
1.6 GLS	G4ED	82	11/05 →	 		MVB810R4 MVB850R4 TB537 TBK325	4PK810 4PK850 105x22 4PK613

ACCENT (X-3)

1.3	G4EH	44	10/94 → 01/00	 	→06/97 06/97 →08/99 →08/99 →08/99 →08/99	MVB875R4 MVB850R4 MVB900R4 TB366 TBK307	4PK875 4PK850 4PK900 92x22 4PK613
		55	10/94 → 01/00	 	→06/97 06/97 →08/99 →08/99 →08/99 →08/99	MVB875R4 MVB850R4 MVB900R4 TB366 TBK307	4PK875 4PK850 4PK900 92x22 4PK613
1.3 i 12V	G4EH	62	10/94 → 01/00	 	→06/97 06/97 → →08/99	MVB875R4 MVB850R4 MVB900R4 TB366 TBK307	4PK875 4PK850 4PK900 92x22 4PK613
1.5 i 12V	G4EK	65	10/94 → 01/00	 	→06/97 06/97 → →08/99	MVB875R4 MVB850R4 MVB900R4 TB366 TBK307	4PK875 4PK850 4PK900 92x22 4PK613





kW



...HYUNDAI

...ACCENT (X-3)

1.5 i 16V		73	12/95 → 01/00	⊗	→06/97	MVB875R4	4PK875
				⊗	06/97 →	MVB850R4	4PK850
				⊗	06/97 → 09/97	MVB825R4	4PK825
				⊗	09/97 →	MVB810R4	4PK810
				⊗	10/96 → 06/97	MVB835R4	4PK835
				⊗		MVB900R4	4PK900
				⊗	09/99 →	MVB855R4	4PK855
				⊗	10/96 → 08/99	MVB845R4	4PK845
				⊗		TB366	92x22
				⊗	10/96 →	TB537	105x22
				⊗	10/96 →	TBK325	
				⊗		MVB613R4	4PK613
				⊗	10/96 → 08/99	SVB13675	13x675

ACCENT Saloon (LC)

1.3	G4E-A	55	01/00 →	⊗	→08/06	MVB855R4	4PK855
				⊗	→08/06	MVB900R4	4PK900
				⊗	→08/06	TB679	110x22
				⊗	→08/06	TBK339	
				⊗	→08/06	MVB613R4	4PK613
		63	01/00 →	⊗	→08/06	MVB855R4	4PK855
				⊗	→08/06	MVB900R4	4PK900
				⊗	→08/06	TB679	110x22
				⊗	→08/06	TBK339	
				⊗	→08/06	MVB613R4	4PK613
1.5	G4EB	66	01/00 →	⊗	→10/02	MVB850R4	4PK850
				⊗	→10/02	MVB900R4	4PK900
				⊗	→10/02	TB679	110x22
				⊗	→10/02	TBK339	
				⊗	→10/02	MVB613R4	4PK613
1.5 CRDi	D3-EA	60	01/02 →	⊗	PS, →08/06	MVB1440R6	6PK1440
				⊗	→08/06	TB714	123x28
1.6	G4ED-G	77	12/02 →	⊗	→08/06	MVB810R4	4PK810
				⊗	→08/06	MVB855R4	4PK855
				⊗	→08/06	TB537	105x22
				⊗	→08/06	TBK325	

ACCENT Saloon (MC)

1.4 GL	G4EE	71	11/05 →	⊗		MVB810R4	4PK810
				⊗		MVB850R4	4PK850
				⊗		TB537	105x22
				⊗		TBK325	
1.5 CRDi GLS	D4FA	81	11/05 →	⊗		MVB1800R5	5PK1800
1.6 GLS	G4ED	82	11/05 →	⊗		MVB810R4	4PK810
				⊗		MVB850R4	4PK850
				⊗		TB537	105x22
				⊗		TBK325	

ACCENT Saloon (X-3)

1.3	G4EH	44	10/94 → 01/00	⊗	→06/97	MVB875R4	4PK875
				⊗	06/97 → 08/99	MVB850R4	4PK850
				⊗		MVB900R4	4PK900
				⊗		TB366	92x22
				⊗		TBK307	
				⊗		MVB613R4	4PK613
		55	10/94 → 01/00	⊗	→06/97	MVB875R4	4PK875
				⊗	06/97 → 08/99	MVB850R4	4PK850
				⊗		MVB900R4	4PK900
				⊗		TB366	92x22
				⊗		TBK307	
				⊗		MVB613R4	4PK613



kw



HYUNDAI

...HYUNDAI

...ACCENT Saloon (X-3)

1.3 i 12V	G4EH	62	10/94 → 01/00	⊗	→06/97	MVB875R4	4PK875
				⊗	06/97→	MVB850R4	4PK850
				⊗		MVB900R4	4PK900
				⊗		TB366	92x22
				⊗	→08/99	TBK307	
1.5 i 12V	G4EK	65	10/94 → 01/00	⊗	→06/97	MVB875R4	4PK875
				⊗	06/97→	MVB850R4	4PK850
				⊗		MVB900R4	4PK900
				⊗		TB366	92x22
				⊗	→08/99	TBK307	
1.5 i 16V		73	10/95 → 01/00	⊗	→06/97	MVB875R4	4PK875
				⊗	06/97→	MVB850R4	4PK850
				⊗	09/99→	MVB810R4	4PK810
				⊗		MVB900R4	4PK900
				⊗	09/99→	MVB855R4	4PK855
				⊗		TB366	92x22
				⊗	09/99→	TB537	105x22
				⊗	→12/95	TBK307	
				⊗	09/99→	TBK325	
				⊗		MVB613R4	4PK613

ATOS (MX)

1.0 i	G4HC	40	02/98 → 03/02	⊗		MVB673R4	4PK673
				⊗		MVB775R4	4PK775
				⊗		TB730	101x20
				⊗		TBK328	
				⊗		SVB13775	13x775
	G4HC-E	43	03/01 →	⊗	→12/05	MVB673R4	4PK673
				⊗	→12/05	MVB775R4	4PK775
				⊗	→12/05	TB730	101x20
				⊗	→12/05	TBK328	
				⊗	→08/02	SVB13775	13x775
1.1	G4HG	46	03/04 →	⊗	08/02→12/05	MVB747R4	4PK747
				⊗	06/05→02/08	MVB673R4	4PK673
				⊗	06/05→02/08	MVB775R4	4PK775
				⊗	06/05→02/08	TB730	101x20
				⊗	06/05→02/08	TBK328	
		46	06/05 →	⊗	06/05→02/08	MVB747R4	4PK747
				⊗	→02/08	MVB673R4	4PK673
				⊗	→02/08	MVB775R4	4PK775
				⊗	→02/08	TB730	101x20
				⊗	→02/08	TBK328	
				⊗	→02/08	MVB747R4	4PK747

ATOS PRIME (MX)

1.0 i	G4HC	40	08/99 →	⊗	→12/05	MVB673R4	4PK673
				⊗	→12/05	MVB775R4	4PK775
				⊗	→12/05	TB730	101x20
				⊗	→12/05	TBK328	
				⊗	→08/02	SVB13775	13x775
	G4HC-E	43	03/01 →	⊗	08/02→12/05	MVB747R4	4PK747
				⊗	→12/05	MVB673R4	4PK673
				⊗	→12/05	MVB775R4	4PK775
				⊗	→12/05	TB730	101x20
				⊗	→12/05	TBK328	
				⊗	→08/02	SVB13775	13x775
				⊗	08/02→12/05	MVB747R4	4PK747



kW



...HYUNDAI

...ATOS PRIME (MX)

1.1	G4HD	43	06/03 →	⊗	→08/08	MVB673R4	4PK673
				⊗	→01/05	MVB775R4	4PK775
				⊗	01/05→08/08	MVB775R4	4PK775
				⊗	→08/08	TB730	101x20
				⊗	→08/08	TBK328	
G4HG	46	09/05 →	⊗	→08/08	MVB673R4	4PK673	
			⊗	→08/08	MVB775R4	4PK775	
			⊗	→08/08	TB730	101x20	
			⊗	→08/08	TBK328		
			⊗	→08/08	MVB747R4	4PK747	

COUPE (GK)

1.6 16V	G4ED-G	77	03/02 →	⊗		MVB810R4	4PK810
				⊗		MVB845R4	4PK845
				⊗		TB537	105x22
				⊗		TBK325	
				⊗		SVB13655	13x655
79	03/02 →	⊗	10/06 →	MVB810R4	4PK810		
		⊗	10/06 →	MVB845R4	4PK845		
		⊗	10/06 →	TB537	105x22		
		⊗	10/06 →	TBK325			
		⊗	10/06 →	SVB13655	13x655		
2.0	G4GC-G	102	03/02 →	⊗	→06/03	MVB850R4	4PK850
				⊗	→06/03	MVB875R4	4PK875
				⊗	→06/03	TB539	113x25.4
2.0 GLS	G4GC-G	105	02/03 →	⊗	→09/06	MVB850R4	4PK850
				⊗	10/06 →	MVB855R4	4PK855
				⊗		MVB875R4	4PK875
				⊗		TB539	113x25.4
				⊗	10/06 →	MVB675R3	3PK675
2.7 V6	G6BA-G	123	03/02 →	⊗	A/C(-)	MVB1700R6	6PK1700
				⊗		TB707	207x32

COUPE (RD)

1.6 16V	G4GR	85	03/98 → 04/02	⊗		MVB850R4	4PK850
				⊗		MVB875R4	4PK875
				⊗	→05/00	TB290	111x25.4
				⊗	05/00 →	TB537	105x22
				⊗	05/00 →	TBK325	
1.6 i 16V	4G61	84	12/96 → 04/02	⊗		SVB13655	13x655
				⊗		SVB13675	13x675
				⊗		MVB850R4	4PK850
				⊗	→05/00	MVB875R4	4PK875
				⊗	→05/00	TB290	111x25.4
2.0 16V	G4GF	102	08/96 → 04/02	⊗		TB537	105x22
				⊗	05/00 →	TB537	105x22
				⊗	05/00 →	TBK325	
				⊗		SVB13655	13x655
				⊗		SVB13675	13x675
99	03/01 → 04/02	⊗		MVB850R4	4PK850		
		⊗		MVB875R4	4PK875		
		⊗		TB539	113x25.4		
		⊗		SVB13655	13x655		
		⊗		SVB13675	13x675		



kW



HYUNDAI

...HYUNDAI

ELANTRA (XD)

1.6	G4ED-G	79	06/00 →	☼	→07/02	MVB810R4	4PK810					
				⊖	→05/06	MVB845R4	4PK845					
				☼	→05/06	TB537	105x22					
				☼KIT	→05/06	TBK325						
				⊕	→05/06	SVB13655	13x655					
				⊖	→05/06	MVB845R4	4PK845					
	77	05/03 →	77	05/03 →	☼	→05/06	MVB845R4	4PK845				
					⊖	→05/06	TB537	105x22				
					☼KIT	→05/06	TBK325					
					⊕	→05/06	SVB13655	13x655				
					66	06/00 → 07/03	66	06/00 → 07/03	☼	→07/02	MVB810R4	4PK810
									⊖		MVB845R4	4PK845
☼		TB537	105x22									
☼KIT		TBK325										
⊕		SVB13655	13x655									
1.8	G4ED-G	97	06/00 →	☼					→07/03	MVB850R4	4PK850	
				☼	08/03 → 05/06	MVB855R4	4PK855					
				⊖	→07/03	MVB875R4	4PK875					
				⊖	08/03 → 05/06	MVB887R4	4PK887					
				☼	→05/06	TB290	111x25.4					
				⊕	→07/03	MVB668R3	3PK668					
	104	06/00 →	104	06/00 →	⊕	08/03 → 05/06	MVB660R3	3PK660				
					2.0	G4GC-G	102	06/00 →	☼	→05/06	MVB850R4	4PK850
									⊖	→05/06	MVB875R4	4PK875
									☼	→05/06	TB539	113x25.4
									☼	→05/06	MVB850R4	4PK850
									⊖	→05/06	MVB875R4	4PK875
☼	→05/06	TB539	113x25.4									
105	10/03 →	105	10/03 →	☼		→05/06	MVB850R4	4PK850				
				⊖		→05/06	MVB875R4	4PK875				
				☼		→05/06	TB539	113x25.4				
				2.0 CRDi		D4EA	83	04/01 →	⊖	→05/06	MVB1513R6	6PK1513
									☼	→05/06	TB714	123x28

ELANTRA Saloon (XD)

1.6	G4ED-G	79	06/00 →	☼	→07/02	MVB810R4	4PK810					
				⊖	→05/06	MVB845R4	4PK845					
				☼	→05/06	TB537	105x22					
				☼KIT	→05/06	TBK325						
				⊕	→05/06	SVB13655	13x655					
				⊖	→05/06	MVB845R4	4PK845					
	77	05/03 →	77	05/03 →	☼	→05/06	MVB845R4	4PK845				
					⊖	→05/06	TB537	105x22				
					☼KIT	→05/06	TBK325					
					⊕	→05/06	SVB13655	13x655				
					66	06/00 → 07/03	66	06/00 → 07/03	☼	→07/02	MVB810R4	4PK810
									⊖		MVB845R4	4PK845
☼		TB537	105x22									
☼KIT		TBK325										
⊕		SVB13655	13x655									
1.8	G4BB	97	06/00 →	☼					→07/03	MVB850R4	4PK850	
				☼	08/03 → 05/06	MVB855R4	4PK855					
				⊖	→07/03	MVB875R4	4PK875					
				⊖	08/03 → 05/06	MVB887R4	4PK887					
				☼	→05/06	TB290	111x25.4					
				⊕	→07/03	MVB668R3	3PK668					
	104	06/00 →	104	06/00 →	⊕	08/03 → 05/06	MVB660R3	3PK660				



kW



...HYUNDAI

...ELANTRA Saloon (XD)

2.0		104	06/00 →	→05/06 06/06 → →05/06 06/06 → 	MVB850R4 4PK850 MVB855R4 4PK855 MVB875R4 4PK875 MVB887R4 4PK887 TB539 113x25.4
	G4GC-G	102	06/00 →	→05/06 06/06 → →05/06 06/06 → 	MVB850R4 4PK850 MVB855R4 4PK855 MVB875R4 4PK875 MVB887R4 4PK887 TB539 113x25.4
		105	10/03 →	→05/06 →05/06 →05/06 	MVB850R4 4PK850 MVB875R4 4PK875 TB539 113x25.4
2.0 CRDi	D4EA	83	04/01 →	→05/06 →05/06 	MVB1513R6 6PK1513 TB714 123x28

GALLOPER I

2.5 TD		62	08/91 → 07/98	SVB13925 13x925 SVB101100 10x1100 TB490 99x19 TB489 163x25.4 TBK311 SVB13780 13x780
2.5 TD intercooler		70	08/91 → 07/98	SVB13925 13x925 SVB101100 10x1100 TB490 99x19 TB489 163x25.4 TBK311 SVB13780 13x780

GALLOPER II (JK-01)

2.5 TCI D		77	08/98 →	→06/03 →06/03 →06/03 →06/03 TBK311 →06/03 SVB13780 13x780
2.5 TD		65	08/98 →	→06/03 →06/03 →06/03 →06/03 TB489 163x25.4 →06/03 SVB13780 13x780
2.5 TD intercooler	D4BH	73	08/98 →	→06/03 →06/03 →06/03 →06/03 TB489 163x25.4 →06/03 TBK311 →06/03 SVB13780 13x780
3.0 V6	G6AT	104	08/98 →	→06/03 →06/03 →06/03 →06/03 SVB13800 13x800

GETZ (TB)

1.1	G4HD	46	09/02 →	→10/06 →10/06 →10/06 TB730 101x20 →10/06 TBK328 →10/06 MVB747R4 4PK747
		49	09/05 →	11/06 → 11/06 → 11/06 → 11/06 → MVB775R4 4PK775 TB730 101x20 TBK328 MVB747R4 4PK747 MVB870R4 4PK870



kW



HYUNDAI

...HYUNDAI

...GETZ (TB)

1.3	G4E-A	60	09/02 →	☼	→10/06	MVB850R4	4PK850	
				⊖	→10/06	MVB900R4	4PK900	
				☼	→10/06	TB679	110x22	
				☼KIT	→10/06	TBK339		
				⊖	→10/06	MVB613R4	4PK613	
				⊖	→10/06	MVB850R4	4PK850	
	63	09/03 →	63	09/03 →	☼	→10/06	MVB850R4	4PK850
					⊖	→10/06	MVB900R4	4PK900
					☼	→10/06	TB679	110x22
					☼KIT	→10/06	TBK339	
					⊖	→10/06	MVB613R4	4PK613
					⊖	→10/06	MVB850R4	4PK850
1.4	G4EE	71	08/05 →	⊖	11/06 →	MVB850R4	4PK850	
				☼	11/06 →	TB537	105x22	
				☼KIT	11/06 →	TBK325		
				⊖	11/06 →	SVB13655	13x655	
1.5 CRDi	D3-EA	60	03/03 →	⊖	PS, →10/06	MVB1440R6	6PK1440	
				☼	→10/06	TB714	123x28	
1.6	G4ED-G	77	09/02 →	☼	→10/06	MVB825R4	4PK825	
				⊖	→10/06	MVB845R4	4PK845	
				☼	→10/06	TB537	105x22	
				☼KIT	→10/06	TBK325		
				⊖	→10/06	SVB13655	13x655	
				⊖	→10/06	MVB835R4	4PK835	
	78	08/05 →	78	08/05 →	☼	11/06 →	MVB835R4	4PK835
					⊖	11/06 →	MVB850R4	4PK850
					☼	11/06 →	TB537	105x22
					☼KIT	11/06 →	TBK325	
					⊖	11/06 →	SVB13655	13x655
					⊖	11/06 →	MVB850R4	4PK850

GRANDEUR

2.2 CRDi		110	06/06 →	⊖		MVB1513R6	6PK1513
				☼		TB714	123x28
				⊖		MVB1513R6	6PK1513
3.3	G6DB	173	04/05 →	☼		TB714	123x28
				⊖		MVB2475R6	6PK2475

H-1 Box

2.4		82	03/00 →	☼	→08/00	SVB13975	13x975	
				⊖	→10/06	MVB975R4	4PK975	
				☼	→10/06	TB302	55x12.7	
				☼	→10/06	TB356	123x19	
				☼KIT	→10/06	TBK292		
				⊖	→10/06	SVB131000	13x1000	
2.5 CRDi		103	08/03 →	⊖	A/C(-), →09/07	MVB1730R7	7PK1730	
				⊖	A/C(+), →09/07	MVB2271R7	7PK2271	
2.5 TD	D4BF	59	03/00 → 09/00	☼		SVB13950	13x950	
				☼	Van	SVB13975	13x975	
				☼	Wagon	SVB13925	13x925	
				⊖		SVB101100	10x1100	
				☼		TB490	99x19	
				☼		TB489	163x25.4	
	D4BH	73	03/00 →	03/00 →	☼KIT		TBK311	
					⊖		MVB1050R4	4PK1050
					☼	→10/05	SVB13950	13x950
					⊖	→10/05	SVB101090	10x1090
					☼	→10/05	TB490	99x19
					☼	→10/05	TB489	163x25.4
74	10/01 →	74	10/01 →	☼KIT	→10/05	TBK311		
				⊖	→10/05	MVB1050R4	4PK1050	
				☼	→10/05	SVB13950	13x950	
				☼	11/06 →	MVB940R4	4PK940	
				⊖	→10/05	SVB101090	10x1090	
				☼		TB490	99x19	
				☼		TB489	163x25.4	
				⊖		MVB1050R4	4PK1050	





kW



...HYUNDAI

H-1 Bus (KMF)

HYUNDAI

2.4	G4CS	82	10/97 →	⚙️	→10/03	SVB13975	13x975				
				⚙️	→10/06	MVB975R4	4PK975				
				⚙️	→10/06	TB302	55x12.7				
				⚙️	→10/06	TB356	123x19				
				⚙️ KIT	→10/06	TBK292					
				⚙️	→10/06	SVB131000	13x1000				
				101	02/03 → 04/04	⚙️		MVB950R4	4PK950		
						⚙️		TB739	65x12.7		
						⚙️		MVB1110R5	5PK1110		
						⚙️		MVB1388R5	5PK1388		
107	11/01 →	⚙️	→08/07	MVB950R4	4PK950						
		⚙️	→08/07	TB739	65x12.7						
		⚙️	A/C(-), →08/07	MVB1110R5	5PK1110						
		⚙️	A/C(+), →08/07	MVB1388R5	5PK1388						
2.4 4WD	G4CS	82	10/97 →	⚙️	→10/03	SVB13975	13x975				
				⚙️	→10/06	MVB975R4	4PK975				
				⚙️	→10/06	TB302	55x12.7				
				⚙️	→10/06	TB356	123x19				
				⚙️ KIT	→10/06	TBK292					
				⚙️	→10/06	SVB131000	13x1000				
				2.5 CRDi		103	12/02 →	⚙️	A/C(-), →09/07	MVB1730R7	7PK1730
								⚙️	A/C(+), →09/07	MVB2271R7	7PK2271
				2.5 CRDi 4WD		103	12/02 →	⚙️	A/C(-), →09/07	MVB1730R7	7PK1730
								⚙️	A/C(+), →09/07	MVB2271R7	7PK2271
2.5 D	D4BB	57	10/97 →	⚙️	→06/99	SVB13925	13x925				
				⚙️	06/99 → 04/04	SVB13950	13x950				
				⚙️	→04/04	SVB101100	10x1100				
				⚙️	→04/04	TB490	99x19				
				⚙️	→04/04	TB489	163x25.4				
				⚙️	→04/04	MVB1050R4	4PK1050				
				2.5 TD	D4BH	73	10/99 → 11/01	⚙️		SVB13950	13x950
⚙️		SVB101090	10x1090								
⚙️		TB490	99x19								
⚙️		TB489	163x25.4								
⚙️ KIT		TBK311									
D4BF	59	10/97 →	⚙️		→11/02	SVB13925	13x925				
			⚙️		→11/02	SVB13975	13x975				
			⚙️		06/99 → 04/04	SVB13950	13x950				
			⚙️		→04/04	SVB101100	10x1100				
			⚙️		→04/04	TB490	99x19				
D4BH	74	11/01 →	⚙️	→04/04	TB489	163x25.4					
			⚙️ KIT	→08/00	TBK311						
			⚙️	→04/04	MVB1050R4	4PK1050					
			⚙️	→05/98	SVB13750	13x750					
			⚙️	→10/05	SVB13950	13x950					
				⚙️	05/04 →	MVB940R4	4PK940				
				⚙️	→10/05	SVB101090	10x1090				
				⚙️		TB490	99x19				
				⚙️		TB489	163x25.4				
				⚙️		MVB1050R4	4PK1050				



kw



HYUNDAI

...HYUNDAI

...H-1 Bus (KMF)

2.5 TD 4WD		73	03/01 →	⊗	→10/05	SVB13950	13x950
				⊗	05/04→10/05	MVB940R4	4PK940
				⊗	→10/05	MVB1050R4	4PK1050
				⊗	→10/05	SVB101090	10x1090
				T	→10/05	TB490	99x19
				⊗	→10/05	TB489	163x25.4
				⊗	→10/05	SVB13950	13x950
				⊗	05/04→10/05	MVB940R4	4PK940
				⊗	→10/05	MVB1050R4	4PK1050
				⊗	→10/05	SVB101090	10x1090
2.6 TdC		63	10/97 → 10/02	T	→10/05	TB490	99x19
				⊗	→10/05	TB489	163x25.4
				⊗	→08/00	SVB13950	13x950
				⊗	→08/00	SVB101100	10x1100
				T	→08/00	TB490	99x19
				⊗	→08/00	TB489	163x25.4
				⊗	→08/00	MVB1050R4	4PK1050

H100 Box

2.5 D	D4BB	57	12/94 → 03/00	⊗	→05/99	SVB13925	13x925
				⊗	05/99→	SVB131400	13x1400
				⊗	ABS(-)	SVB101100	10x1100
				T	→05/98	TB792	83x19
				T	01/96→	TB490	99x19
				⊗		TB489	163x25.4
				⊗	→06/96	TB359	163x25.4
				⊗	06/96→	TBK311	
				⊗		SVB13750	13x750
				D4BA, D4BX	55	07/93 → 12/94	⊗
⊗	A/C(+), ABS(+)	SVB101100	10x1100				
T	→03/94	TB268	83x19				
T	03/94→	TB792	83x19				
⊗		TB359	163x25.4				
⊗		SVB13750	13x750				

H100 Bus (P)

2.4	G4CS	84	01/97 → 03/00	⊗		SVB13975	13x975		
				⊗	→07/97	SVB10960	10x960		
				⊗	07/97→	MVB975R4	4PK975		
				T		TB302	55x12.7		
				⊗		TB356	123x19		
				⊗		TBK292			
				⊗		SVB131000	13x1000		
				90	07/93 → 03/00	⊗		SVB13975	13x975
						⊗	→07/97	SVB10960	10x960
						⊗	07/97→	MVB975R4	4PK975
T		TB302	55x12.7						
⊗		TB356	123x19						
⊗		TBK292							
⊗		SVB131000	13x1000						



kW



...HYUNDAI

...H100 Bus (P)

2.5 D	D4BB	57	12/94 → 03/00	⊗	→05/99	SVB13925	13x925
				⊗	05/99 →	SVB131400	13x1400
				⊗	ABS(-)	SVB101100	10x1100
				⊗	→01/96	TB792	83x19
				⊗	01/96 →	TB490	99x19
				⊗	→06/96	TB359	163x25.4
				⊗	06/96 →	TB489	163x25.4
				⊗	06/96 →	TBK311	
				⊗		SVB13750	13x750
	D4BA, D4BX	55	07/93 → 12/94	⊗	A/C(+), ABS(+)	SVB13925	13x925
				⊗	→03/94	SVB101100	10x1100
				⊗	03/94 →	TB268	83x19
				⊗		TB792	83x19
				⊗		TB359	163x25.4
				⊗		SVB13750	13x750
2.5 TD	D4BF	59	07/93 → 03/00	⊗	→05/99	SVB13925	13x925
				⊗	05/99 →	SVB131400	13x1400
				⊗	ABS(-)	SVB101100	10x1100
				⊗	→03/94	TB268	83x19
				⊗	01/96 →	TB490	99x19
				⊗	03/94 → 01/96	TB792	83x19
				⊗	→06/96	TB359	163x25.4
				⊗	06/96 →	TB489	163x25.4
				⊗	06/96 →	TBK311	
				⊗		SVB13750	13x750

HIGHWAY VAN

2.0 16V		100	03/00 →	⊗	→03/04	MVB950R4	4PK950
				⊗	→03/04	TB739	65x12.7
				⊗	→03/04	TB708	173x29
				⊗	A/C(-), →03/04	MVB1110R5	5PK1110
				⊗	A/C(+), →03/04	MVB1388R5	5PK1388
2.7 V6 24V		125	03/00 →	⊗	A/C(-), →03/04	MVB1700R6	6PK1700
				⊗	→03/04	TB707	207x32

i10

1.1	G4HG	49	01/08 →	⊗		MVB775R4	4PK775
-----	------	----	---------	---	--	-----------------	--------

i30

1.4		80	10/07 →	⊗	A/C(-)	MVB955R6	6PK955
				⊗	A/C(+)	MVB1250R6	6PK1250
1.6		90	10/07 →	⊗	A/C(-)	MVB955R6	6PK955
				⊗	A/C(+)	MVB1250R6	6PK1250
1.6 CRDi	D4FB	85	10/07 →	⊗	A/C(+)	MVB1800R5	5PK1800
2.0		105	10/07 →	⊗		MVB887R4	4PK887
				⊗		TB539	113x25.4
2.0 CRDi		103	10/07 →	⊗		MVB1400R6	6PK1400
				⊗		TB714	123x28

i30 CW Estate

1.6		90	02/08 →	⊗	A/C(-)	MVB955R6	6PK955
				⊗	A/C(+)	MVB1250R6	6PK1250
1.6 CRDi		85	02/08 →	⊗	A/C(+)	MVB1800R5	5PK1800
2.0		105	02/08 →	⊗		MVB887R4	4PK887
				⊗		TB539	113x25.4

LANTRA I (J-1)

1.5 i.e.	G15B, G4DJ	63	10/90 → 11/95	⊗	Eng. G4DJ, →05/95	SVB13825	13x825
				⊗	→05/95	MVB870R4	4PK870
				⊗	→05/95	TB518	92x19
				⊗	→05/95	TBK291	
				⊗	Eng. G4DJ, →05/95	SVB13625	13x625



kw



HYUNDAI

...HYUNDAI

...LANTRA I (J-1)

1.6 i.e. 16V	G4CR	78	10/90 → 11/95	☼	→02/93	MVB915R4	4PK915
				☼	02/93→05/95	MVB940R4	4PK940
				⊖	→05/95	MVB975R4	4PK975
				⊕	→05/95	TB326	65x12.7
				⊕	→05/95	TB402	151x29
				⊕	→05/95	SVB13675	13x675
		84	10/90 → 11/95	☼	→02/93	MVB915R4	4PK915
				☼	02/93→05/95	MVB940R4	4PK940
				⊖	→05/95	MVB975R4	4PK975
				⊕	→05/95	TB326	65x12.7
				⊕	→05/95	TB402	151x29
				⊕	→05/95	SVB13675	13x675
1.8 i.e. 16V	G4CN	93	10/90 → 11/95	☼	→02/93	MVB915R4	4PK915
				☼	02/93→05/95	MVB940R4	4PK940
				⊖	→05/95	MVB995R4	4PK995
				⊕	→05/95	TB326	65x12.7
				⊕	→05/95	TB325	153x29
				⊕	→05/95	SVB13675	13x675

LANTRA II (J-2)

1.5 12V	G4EK	65	12/96 → 09/00	☼	→05/00	MVB850R4	4PK850
				⊖	→05/00	MVB900R4	4PK900
				⊕	→11/98	TB366	92x22
				⊕	11/98→05/00	TB679	110x22
				⊕	→11/98	TBK307	
				⊕	→05/00	MVB613R4	4PK613
1.6 16V	4G61	84	11/95 → 09/00	☼	→05/00	MVB850R4	4PK850
				⊖	→05/00	MVB875R4	4PK875
				⊕	→05/00	TB290	111x25.4
				⊕	→05/00	SVB13655	13x655
1.6 i	G4GR	66	11/95 → 09/00	☼	→05/00	MVB850R4	4PK850
				⊖	→05/00	MVB875R4	4PK875
				⊕	→05/00	TB290	111x25.4
				⊕	→05/00	SVB13655	13x655
1.8 16V	G4GM	94	11/95 → 09/00	☼	→05/00	MVB850R4	4PK850
				⊖	→05/00	MVB875R4	4PK875
				⊕	→05/00	TB290	111x25.4
				⊕	→05/00	SVB13655	13x655
1.9 D		50	03/98 → 09/00	⊖	A/C(-), PS, →05/00	MVB1130R6	6PK1130
				⊖	A/C(+), PS, →05/00	MVB1740R6	6PK1740
				⊕	→05/00	TB560	136x25.4
				⊕	→05/00	TBK020	
2.0 16V	G4GF	102	08/96 → 09/00	☼	04/97→05/00	MVB850R4	4PK850
				⊖	04/97→05/00	MVB875R4	4PK875
				⊕	04/97→05/00	TB539	113x25.4
				⊕	04/97→05/00	SVB13675	13x675

LANTRA II Wagon (J2)

1.5 12V	G4EK	65	04/97 →	☼	→05/00	MVB855R4	4PK855
				⊖	→05/00	MVB900R4	4PK900
				⊕	→05/00	TB366	92x22
				⊕	→05/00	TBK307	
				⊕	→05/00	MVB613R4	4PK613
1.6 16V	4G61	84	02/96 →	☼	→05/00	MVB850R4	4PK850
				⊖	→05/00	MVB875R4	4PK875
				⊕	→05/00	TB290	111x25.4
				⊕	→05/00	SVB13655	13x655
1.6 i	G4GR	66	02/96 →	☼	→05/00	MVB850R4	4PK850
				⊖	→05/00	MVB875R4	4PK875
				⊕	→05/00	TB290	111x25.4
				⊕	→05/00	SVB13655	13x655



kW



...HYUNDAI

...LANTRA II Wagon (J2)

1.8 16V	G4GM	94	02/96 →	☼ ⊗ 🌀 ⊕	→05/00 →05/00 →05/00 →05/00	MVB850R4 MVB875R4 TB290 SVB13655	4PK850 4PK875 111x25.4 13x655
1.9 D		50	03/98 →	⊗ ⊗ 🌀 🌀KIT	A/C(-), PS, →05/00 A/C(+), PS, →05/00 →05/00 →05/00	MVB1130R6 MVB1740R6 TB560 TBK020	6PK1130 6PK1740 136x25.4
2.0 16V	G4GF	102	12/96 →	☼ ⊗ 🌀 ⊕	04/97→05/00 04/97→05/00 04/97→05/00 04/97→05/00	MVB850R4 MVB875R4 TB539 SVB13675	4PK850 4PK875 113x25.4 13x675

MATRIX (FC)

1.5 CRDi	D3-EA	60	10/01 →	⊗ 🌀	→02/05 →02/05	MVB1440R6 TB714	6PK1440 123x28
	D4FA	75	12/04 →	⊗ ⊗	A/C(-), →04/08 A/C(+), →04/08	MVB1745R5 MVB1850R5	5PK1745 5PK1850
1.5 CRDi VGT	D4FA	81	08/05 →	⊗ ⊗	A/C(-), →04/08 A/C(+), →04/08	MVB1745R5 MVB1850R5	5PK1745 5PK1850
1.6	G4ED-G	76	06/01 →	☼ ⊗ 🌀 🌀KIT ⊕	→04/08 →04/08 →04/08 →04/08 →04/08	MVB810R4 MVB845R4 TB537 TBK325 SVB13655	4PK810 4PK845 105x22 13x655
1.8	G4GB-G	90	06/01 →	☼ ⊗ 🌀 ⊕	→04/08 →04/08 →04/08 →04/08	MVB855R4 MVB875R4 TB290 MVB660R3	4PK855 4PK875 111x25.4 3PK660

PONY

1.2		40	06/74 →	⊗	10/78→06/85	SVB10813	10x813
1.3	G13B	50	10/85 → 09/89	⊗ ⊗ 🌀 ⊕	→02/87 03/87→	SVB10875 MVB870R4 TB160 SVB13675	10x875 4PK870 92x19 13x675
1.4		50	08/77 →	⊗	10/78→06/85	SVB10813	10x813
1.5	G15B, G4DJ	53	10/85 → 09/89	⊗ ⊗ 🌀 ⊕	→02/87 03/87→	SVB10875 MVB870R4 TB160 SVB13675	10x875 4PK870 92x19 13x675

PONY (X-2)

1.3	G4DG	43	10/89 → 01/95	☼ ☼ ⊗ 🌀 🌀 🌀KIT ⊕ ⊕	→09/92 09/92→08/94 →08/94 →08/94 →12/89 →08/94 →08/94 →12/89	SVB13850 SVB13825 MVB870R4 TB518 TB160 TBK291 SVB13625 SVB13675	13x850 13x825 4PK870 92x19 92x19 13x625 13x675
		49	10/89 → 01/95	☼ ☼ ⊗ 🌀 🌀 🌀KIT ⊕ ⊕	→09/92 09/92→09/94 →09/94 →09/94 →12/89 →09/94 →09/94 →12/89	SVB13850 SVB13825 MVB870R4 TB518 TB160 TBK291 SVB13625 SVB13675	13x850 13x825 4PK870 92x19 92x19 13x625 13x675



kW



HYUNDAI

...HYUNDAI

...PONY (X-2)

1.5	G15B, G4DJ	53	10/89 → 01/95	☼	→09/92	SVB13850	13x850				
				☼	09/92→08/94	SVB13825	13x825				
				⊖	→08/94	MVB870R4	4PK870				
				☼	→08/94	TB518	92x19				
				☼	→12/89	TB160	92x19				
				☼KIT	→08/94	TBK291					
				⊖	→08/94	SVB13625	13x625				
				⊖	→12/89	SVB13675	13x675				
				1.5 i	G15B, G4DJ	61	10/89 → 01/95	☼	→09/92	SVB13850	13x850
								☼	09/92→08/94	SVB13825	13x825
⊖	→08/94	MVB870R4	4PK870								
☼	→08/94	TB518	92x19								
☼	→12/89	TB160	92x19								
62	10/89 → 01/95	☼KIT	→08/94			TBK291					
		⊖	→08/94			SVB13625	13x625				
		⊖	→12/89			SVB13675	13x675				
		☼	→09/92			SVB13850	13x850				
		☼	09/92→09/94			SVB13825	13x825				
				⊖	→09/94	MVB870R4	4PK870				
				☼	→09/94	TB518	92x19				
				☼	→12/89	TB160	92x19				
				☼KIT	→09/94	TBK291					
				⊖	→09/94	SVB13625	13x625				
				⊖	→12/89	SVB13675	13x675				

PONY Saloon

1.3	G13B	50	10/85 → 09/89	⊖	→02/87	SVB10875	10x875
				⊖	03/87→	MVB870R4	4PK870
				☼		TB160	92x19
1.5	G15B, G4DJ	53	10/85 → 09/89	⊖	→02/87	SVB10875	10x875
				⊖	03/87→	MVB870R4	4PK870
				☼		TB160	92x19
				⊖		SVB13675	13x675

PONY Wagon

1.2		40	02/78 →	⊖	10/78→06/85	SVB10813	10x813
1.4		50	02/78 →	⊖	10/78→06/85	SVB10813	10x813

PONY/EXCEL Saloon (X-2)

1.3		49	01/90 → 01/95	☼	→09/92	SVB13850	13x850
				☼	09/92→08/94	SVB13825	13x825
				⊖	→08/94	MVB870R4	4PK870
				☼	→08/94	TB518	92x19
				☼KIT	→08/94	TBK291	
1.5	G15B, G4DJ	53	01/90 → 01/95	⊖	→08/94	SVB13625	13x625
				☼	→09/92	SVB13850	13x850
				☼	09/92→08/94	SVB13825	13x825
				⊖	→08/94	MVB870R4	4PK870
				☼	→08/94	TB518	92x19
				☼KIT	→08/94	TBK291	
				⊖	→08/94	SVB13625	13x625



kW



...HYUNDAI

...PONY/EXCEL Saloon (X-2)

1.5 i	G15B, G4DJ	61	01/90 → 01/95	⊗	→09/92	SVB13850	13x850
				⊗	09/92→08/94	SVB13825	13x825
				⊗	→08/94	MVB870R4	4PK870
				⊗	→08/94	TB518	92x19
				⊗	→08/94	TBK291	
				⊗	→08/94	SVB13625	13x625
		62	01/90 → 01/95	⊗	→09/92	SVB13850	13x850
				⊗	09/92→08/94	SVB13825	13x825
				⊗	→08/94	MVB870R4	4PK870
				⊗	→08/94	TB518	92x19
				⊗	→08/94	TBK291	
				⊗	→08/94	SVB13625	13x625

PORTER Box

2.5 TD		57	07/94 → 04/04	⊗	→05/99	SVB13925	13x925
				⊗	05/99→	SVB131400	13x1400
				⊗	ABS(-)	SVB101100	10x1100
				⊗	→01/96	TB792	83x19
				⊗	01/96→	TB490	99x19
				⊗	→06/96	TB359	163x25.4
				⊗	06/96→	TB489	163x25.4
				⊗	06/96→	TBK311	
				⊗		SVB13750	13x750
		73	07/94 → 04/04	⊗	→04/98	SVB13975	13x975
				⊗	→03/00	SVB101100	10x1100
				⊗	03/00→	SVB101090	10x1090
				⊗		TB490	99x19
				⊗		TB489	163x25.4
				⊗		MVB1050R4	4PK1050

PORTER Pickup

2.5 TD		73	07/94 → 04/04	⊗	→04/98	SVB13975	13x975
				⊗	→03/00	SVB101100	10x1100
				⊗	03/00→	SVB101090	10x1090
				⊗		TB490	99x19
				⊗		TB489	163x25.4
				⊗		MVB1050R4	4PK1050
		57	07/94 → 04/04	⊗	→05/99	SVB13925	13x925
				⊗	05/99→	SVB131400	13x1400
				⊗	ABS(-)	SVB101100	10x1100
				⊗	→01/96	TB792	83x19
				⊗	01/96→	TB490	99x19
				⊗	→06/96	TB359	163x25.4
				⊗	06/96→	TB489	163x25.4
				⊗	06/96→	TBK311	
				⊗		SVB13750	13x750

S COUPE (SLC)

1.5 i	G15B, G4DJ	62	02/90 → 05/96	⊗	→12/92	SVB13850	13x850
				⊗	→12/92	MVB870R4	4PK870
				⊗	→12/92	TB518	92x19
				⊗	→12/92	TBK291	
				⊗	→12/92	SVB13625	13x625
	G4EK	65	04/92 → 05/96	⊗		MVB950R4	4PK950
				⊗		MVB900R4	4PK900
				⊗		TB518	92x19
				⊗		TBK291	
				⊗		MVB640R4	4PK640
1.5 i Turbo	G4EK-TC	85	04/91 → 05/96	⊗	07/92→	MVB950R4	4PK950
				⊗	07/92→	MVB900R4	4PK900
				⊗	07/92→	TB518	92x19
				⊗	07/92→	TBK291	
				⊗	07/92→	MVB640R4	4PK640



kW



HYUNDAI

...HYUNDAI

SANTA FE (CM)

2.2 CRDi		102	03/06 →		→08/06	MVB1513R6	6PK1513
					→08/06	TB714	123x28
		114	03/06 →		09/06 →	MVB1513R6	6PK1513
					09/06 →	TB714	123x28
2.2 CRDi 4x4		102	03/06 →		→08/06	MVB1513R6	6PK1513
					→08/06	TB714	123x28
		114	03/06 →		09/06 →	MVB1513R6	6PK1513
					09/06 →	TB714	123x28
2.2 CRDi GLS	D4EB	110	03/06 →		→08/06	MVB1513R6	6PK1513
					→08/06	TB714	123x28
2.2 CRDi GLS 4x4	D4EB	110	03/06 →		→08/06	MVB1513R6	6PK1513
					→08/06	TB714	123x28
2.7		125	03/06 →			MVB2050R6	6PK2050
2.7 4x4		125	03/06 →			MVB2050R6	6PK2050
2.7 V6 GLS	G6EA	139	03/06 →			MVB2050R6	6PK2050
2.7 V6 GLS 4x4	G6EA	139	03/06 →			MVB2050R6	6PK2050

SANTA FE (SM)

2.0	G4BP	99	08/01 →		→02/06	MVB950R4	4PK950
					→06/02	TB739	65x12.7
					→02/06	TB708	173x29
					A/C(-), →02/06	MVB1110R5	5PK1110
					A/C(+), →02/06	MVB1388R5	5PK1388
2.0 CRDi	D4EA	83	08/01 →		→07/03	MVB1513R6	6PK1513
					→07/03	TB714	123x28
2.0 CRDi 4x4	D4EA	83	04/01 →		→07/03	MVB1513R6	6PK1513
					→07/03	TB714	123x28
		92	08/03 →		→02/06	MVB1513R6	6PK1513
					→02/06	TB714	123x28
2.2 CRDi	D4EB	110	10/05 →		03/06 →08/06	MVB1513R6	6PK1513
					03/06 →08/06	TB714	123x28
2.2 CRDi 4x4	D4EB	110	10/05 →		03/06 →08/06	MVB1513R6	6PK1513
					03/06 →08/06	TB714	123x28
2.4 16V	G4JS-G	100	02/01 →		→02/06	MVB950R4	4PK950
					→02/06	TB739	65x12.7
					A/C(-), →02/06	MVB1110R5	5PK1110
					A/C(+), →02/06	MVB1388R5	5PK1388
		107	02/01 →		→02/06	MVB950R4	4PK950
					→02/06	TB739	65x12.7
					A/C(-), →02/06	MVB1110R5	5PK1110
					A/C(+), →02/06	MVB1388R5	5PK1388
2.4 16V 4x4	G4JS-G	100	02/01 →		→02/06	MVB950R4	4PK950
					→02/06	TB739	65x12.7
					A/C(-), →02/06	MVB1110R5	5PK1110
					A/C(+), →02/06	MVB1388R5	5PK1388
		107	02/01 →		→02/06	MVB950R4	4PK950
					→02/06	TB739	65x12.7
					A/C(-), →02/06	MVB1110R5	5PK1110
					A/C(+), →02/06	MVB1388R5	5PK1388
2.7	G6EA	139	10/05 →		03/06 →	MVB2050R6	6PK2050
2.7 4x4	G6EA	139	10/05 →		03/06 →	MVB2050R6	6PK2050
2.7 V6 4x4	G6BA-G	127	02/01 →		→02/06	TB707	207x32

SANTAMO

2.0 16V		102	05/99 →		→10/02	MVB960R4	4PK960
					→10/02	MVB995R4	4PK995
					→10/02	TB326	65x12.7
					→10/02	TB325	153x29
					→10/02	SVB13675	13x675



kW



...HYUNDAI

...SANTAMO

2.0 16V 4x4		102	05/99 →	⊗ ⊗ ⊕ ⊕ ⊕ ⊕	→10/02 →10/02 →10/02 →10/02 →10/02	MVB960R4 MVB995R4 TB326 TB325 SVB13675	4PK960 4PK995 65x12.7 153x29 13x675
-------------	--	-----	---------	----------------------------	--	---	---

SONATA I (Y-2)

1.8 i		70	09/88 → 10/93	⊗ ⊗ ⊕ ⊕ ⊕ ⊕	→03/91 07/93 →	SVB13950 MVB975R4 TB302 TB213 TB400 SVB13655	13x950 4PK975 55x12.7 122x19 122x24 13x655
2.0 i	G4CP-U	80	01/91 → 10/93	⊗ ⊗ ⊕ ⊕ ⊕ ⊕	→03/91 07/93 →	SVB13975 MVB975R4 TB302 TB213 TB400 SVB13655	13x975 4PK975 55x12.7 122x19 122x24 13x655
		74	09/88 → 08/91	⊗ ⊗ ⊕ ⊕ ⊕ ⊕	→03/91	SVB13975 MVB975R4 TB302 TB213 SVB13655	13x975 4PK975 55x12.7 122x19 13x655
2.4 i		83	09/88 → 08/91	⊗ ⊗ ⊕ ⊕ ⊕ ⊕ ⊕ ^{KIT}	→03/91	SVB13975 MVB975R4 TB302 TB356 TBK292 SVB13655	13x975 4PK975 55x12.7 123x19 13x655
3.0 i V6	G6AT	107	01/91 → 10/93	⊗ ⊗ ⊕		SVB13975 MVB1240R5 TB401	13x975 5PK1240 149x25.4

SONATA II (Y-3)

1.8 i		72	05/93 → 06/98	⊗ ⊕ ⊕ ⊕ ⊕ ⊕	→07/93 →10/95 10/95 →	MVB975R4 TB302 TB213 TB400 TB405 SVB13655	4PK975 55x12.7 122x19 122x24 122x19 13x655
2.0 i	G4CP	77	06/94 → 08/96	⊗ ⊕ ⊕ ⊕ ⊕	→10/95 10/95 →	MVB975R4 TB302 TB400 TB405 SVB13655	4PK975 55x12.7 122x24 122x19 13x655
		70	08/96 → 06/98	⊗ ⊕ ⊕ ⊕		MVB975R4 TB302 TB405 SVB13655	4PK975 55x12.7 122x19 13x655
2.0 i 16V	G4CP-D	102	05/93 → 06/98	⊗ ⊗ ⊕ ⊕ ⊕ ⊕	11/94 → 11/94 → 11/94 → 11/94 → 11/94 →	MVB960R4 MVB995R4 TB326 TB325 SVB13675	4PK960 4PK995 65x12.7 153x29 13x675
	G4CP-DM	92	06/96 → 06/98	⊗ ⊗ ⊕ ⊕ ⊕		MVB960R4 MVB995R4 TB326 TB325 SVB13675	4PK960 4PK995 65x12.7 153x29 13x675
3.0 i V6	G6AT	107	05/93 → 06/98	⊗ ⊗ ⊕		SVB13975 MVB1240R5 TB401	13x975 5PK1240 149x25.4



kW



HYUNDAI

...HYUNDAI

SONATA III (EF)

2.0 16V	G4JP-G	100	06/98 → 10/01	⊗ ⊗ T T ⊗ ⊗	A/C(+)	MVB940R4 MVB950R4 TB739 TB708 MVB1388R5	4PK940 4PK950 65x12.7 173x29 5PK1388
2.4 16V		105	03/98 → 10/01	⊗ T ⊗ ⊗	→05/01 →05/01 A/C(-), →05/01 A/C(+), →05/01	MVB950R4 TB739 MVB1110R5 MVB1388R5	4PK950 65x12.7 5PK1110 5PK1388
2.5 V6 24V	G6BV-G	118	06/98 → 10/01	⊗ T	A/C(+), →05/01 →05/01	MVB1995R6 TB707	6PK1995 207x32

SONATA IV (EU4)

2.0	G4JP-EG	96	10/01 → 11/04	⊗ ⊗ T T ⊗ ⊗	A/C(+)	MVB940R4 MVB950R4 TB739 TB708 MVB1388R5	4PK940 4PK950 65x12.7 173x29 5PK1388
2.7 V6	G6BA-G	127	10/01 → 11/04	⊗ T	A/C(-)	MVB1700R6 TB707	6PK1700 207x32

SONATA V

2.0 CRDi	D4EA	103	02/06 →	⊗ T	A/C(+)	MVB1513R6 TB714	6PK1513 123x28
		100	02/06 →	⊗ T	A/C(+)	MVB1513R6 TB714	6PK1513 123x28
2.0 VVTi GLS		106	05/05 →	⊗		MVB2585R6	6PK2585
2.4		119	01/05 →	⊗ ⊗	A/C(-) A/C(+)	MVB2510R6 MVB2585R6	6PK2510 6PK2585
3.3		171	01/05 →	⊗	06/05 →	MVB2475R6	6PK2475

STAREX (H1)

2.4	G4CS	82	06/97 →	⊗ ⊗ T T ⊗ ⊗	→08/00 →08/00 →08/00 →08/00 →08/00 →08/00	SVB13975 MVB975R4 TB302 TB356 TBK292 SVB131000	13x975 4PK975 55x12.7 123x19 13x1000
2.4 4WD	G4CS	82	02/98 →	⊗ ⊗ T T ⊗ ⊗	→08/00 →08/00 →08/00 →08/00 →08/00 →08/00	SVB13975 MVB975R4 TB302 TB356 TBK292 SVB131000	13x975 4PK975 55x12.7 123x19 13x1000
2.5 TD		59	06/97 →	⊗ ⊗ T T ⊗ ⊗	→08/00 →08/00 →08/00 →08/00 →08/00 →08/00	SVB13950 SVB101100 TB490 TB489 MVB1050R4	13x950 10x1100 99x19 163x25.4 4PK1050
2.5 TD 4WD		59	02/98 →	⊗ ⊗ T T ⊗ ⊗	→08/00 →08/00 →08/00 →08/00 →08/00 →08/00	SVB13950 SVB101100 TB490 TB489 MVB1050R4	13x950 10x1100 99x19 163x25.4 4PK1050

STELLAR (F31_, SF2_)

1.4		50	10/83 → 08/86	⊗	→04/86	SVB10813	10x813
1.6		56	10/83 → 12/91	⊗	→12/89	SVB10813	10x813

TERRACAN (HP)

2.5 TD		74	12/01 →	T T ⊗	→10/03 →10/03 →10/03	TB490 TB489 SVB13780	99x19 163x25.4 13x780
--------	--	----	---------	-------------	----------------------------	----------------------------	-----------------------------



kW



...HYUNDAI

...TERRACAN (HP)

2.9 CRDi		110	12/01 →	⊗ ⊗ ⊗ ⊗	→07/03 →07/03 →07/03 →07/03	SVB13975 MVB1680R5 TB716 MVB835R4	13x975 5PK1680 152x29 4PK835
	J3	120	11/03 →	⊗ ⊗ ⊗		MVB1680R5 TB716 MVB835R4	5PK1680 152x29 4PK835
		110	11/01 → 07/03	⊗ ⊗ ⊗ ⊗		SVB13975 MVB1680R5 TB716 MVB835R4	13x975 5PK1680 152x29 4PK835
3.5 i V6 4WD		147	12/01 →	⊗ ⊗ ⊗	04/02 → 09/03 04/02 → 09/03 04/02 → 09/03	MVB940R4 MVB1135R5 MVB1080R4	4PK940 5PK1135 4PK1080
	G6CU	143	12/01 →	⊗ ⊗ ⊗	10/03 → 10/03 → 10/03 →	MVB940R4 MVB1135R5 MVB1080R4	4PK940 5PK1135 4PK1080

TRAJET (FO)

2.0	G4JP-G	100	03/00 →	⊗ ⊗ ⊗ ⊗	→10/03 →10/03 →10/03 A/C(-), →10/03 A/C(+), →10/03	MVB950R4 TB739 TB708 MVB1110R5 MVB1388R5	4PK950 65x12.7 173x29 5PK1110 5PK1388
	G4GC-G	103	01/04 →	⊗ ⊗ ⊗ ⊗	→07/08 →07/08 →07/08 →07/08	MVB855R4 MVB887R4 TB539 MVB675R3	4PK855 4PK887 113x25.4 3PK675
2.0 CRDi	D4EA	83	04/01 →	⊗ ⊗	→07/08 →07/08	MVB1513R6 TB714	6PK1513 123x28
2.7 V6	G6BA-G	127	09/00 →	⊗ ⊗	A/C(-), →07/08 →07/08	MVB1700R6 TB707	6PK1700 207x32

TUCSON (JM)

2.0	G4GC	104	08/04 →	⊗ ⊗ ⊗		MVB875R4 TB539 MVB675R3	4PK875 113x25.4 3PK675
2.0 All-wheel Drive	G4GC	104	08/04 →	⊗ ⊗ ⊗		MVB887R4 TB539 MVB675R3	4PK887 113x25.4 3PK675
2.0 CRDi	D4EA	83	08/04 →	⊗ ⊗		MVB1513R6 TB714	6PK1513 123x28
	D4EA-V	103	01/06 →	⊗ ⊗		MVB1513R6 TB714	6PK1513 123x28
		100	01/06 →	⊗ ⊗		MVB1513R6 TB714	6PK1513 123x28
2.0 CRDi All-wheel Drive	D4EA	83	08/04 →	⊗ ⊗		MVB1513R6 TB714	6PK1513 123x28
	D4EA-F, D4EA-V	103	01/06 →	⊗ ⊗		MVB1513R6 TB714	6PK1513 123x28
		100	01/06 →	⊗ ⊗		MVB1513R6 TB714	6PK1513 123x28
2.7 All-wheel Drive	G6BA-G	129	08/04 →	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1690R6 MVB1995R6 TB707	6PK1690 6PK1995 207x32

XG

25		120	12/98 →	⊗ ⊗ ⊗	06/99 → 09/05 06/99 → 09/05 06/99 → 09/05	MVB1995R6 TB707 MVB906R5	6PK1995 207x32 5PK906
30/300	G6CT-G	138	12/98 →	⊗ ⊗	A/C(+), 09/99 → 09/05 09/99 → 09/05	MVB1230R6 MVB906R5	6PK1230 5PK906
350	G6CU	145	04/03 →	⊗ ⊗	→09/05 →09/05	MVB1200R6 MVB906R5	6PK1200 5PK906



kw



ISUZU

ISUZU

CAMPO (KB)

2.0 (KB23)		52	01/83 → 03/88	☼ ☾ ✱ ☺		SVB13950 TB265 SVB13900 SVB13750	13x950 115x19 13x900 13x750
2.0 (KB28)	G200Z	58	06/85 → 12/88	☼ ☾ ✱ ☺	→03/88 →03/88 →03/88 →03/88	SVB13950 TB265 SVB13900 SVB13750	13x950 115x19 13x900 13x750
2.0 4WD (KB43, KB48)		52	01/83 → 03/88	☼ ☾ ✱ ☺		SVB13950 TB265 SVB13900 SVB13750	13x950 115x19 13x900 13x750
2.0 4WD (KB48)	G200Z	58	06/85 → 12/88	☼ ☾ ✱ ☺	→03/88 →03/88 →03/88 →03/88	SVB13950 TB265 SVB13900 SVB13750	13x950 115x19 13x900 13x750
2.2 (TFS)		66	01/89 → 12/90	☼ ☾ ✱ ☺		SVB10760 TB265 SVB13875 SVB131025	10x760 115x19 13x875 13x1025
2.2 D (KBD27)	C223	39	04/86 → 12/90	☼ ☾ ✱ ☺	→03/88 A/C(+), →03/88 →03/88 A/C(+), →03/88	SVB131500 SVB171055 TB162 SVB131525	13x1500 17x1055 87x34 13x1525
2.2 D 4WD (KBD42, KBD47)	C223	39	01/83 → 12/90	☼ ☾ ✱ ☺	→08/89 LHD, 06/85 → 08/89 06/85 → 08/89 A/C(+), 06/85 → 03/88	TB162 SVB171055 SVB131500 SVB131525	87x34 17x1055 13x1500 13x1525
2.5 D (KBD27)		55	01/83 → 12/90	☼ ☾ ☾ ☺		SVB171055 TB291 TBK075 SVB131375	17x1055 119x32 13x1375
2.5 D 4WD (KBD47)	4JA1	55	01/83 → 12/90	☼ ☾ ☾ ☺		SVB171055 TB291 TBK075 SVB131375	17x1055 119x32 13x1375

D-MAX (8DH)

2.5 D 4x4		74	05/02 →	☼	10/02 →	SVB131525	13x1525
	4JK1-TC	100	01/07 →	☼		SVB131525	13x1525
3.0 D 4x4		96	05/02 →	☼	10/02 →	SVB131550	13x1550

TROOPER

3.0 DTI	4 JX1	118	04/00 →	☼ ☾ ☾ ☺	→08/04 →08/04 →08/04	SVB131250 SVB10990 TB749	13x1250 10x990 104x22
3.5 V6 24V	6 VE1	158	04/00 →	☼ ☾ ☾	A/C(-), →08/04 A/C(+), →08/04 →08/04	MVB2040R6 MVB2280R6 TB436	6PK2040 6PK2280 191x32

TROOPER (UB)

3.1 TD		84	08/91 → 07/98	☼ ☾ ☾ ☺	A/C(-) A/C(+)	SVB171055 TB291 TBK075 SVB131450 SVB131525	17x1055 119x32 13x1450 13x1525
3.2		130	08/91 → 07/98	☼ ☾ ☾ ☺		MVB800R4 MVB960R4 TB393 SVB101025	4PK800 4PK960 223x32 10x1025



kW



...ISUZU

TROOPER (UBS)

2.2 D 4x4	C223	39	05/84 → 12/89		PS, →02/88	SVB131525 TB162 SVB171055 SVB131500	13x1525 87x34 17x1055 13x1500
2.8 TD (UBS55)	4JB1T	71	10/87 → 12/91		MS PS	SVB131500 SVB131525 SVB171055 TB291 TBK075	13x1500 13x1525 17x1055 119x32
	4JB1-TC	78	10/88 → 12/91		A/C(-) MS A/C(-) A/C(+)	SVB131450 SVB131500 SVB171055 TB291 TBK075 SVB131450 SVB131525	13x1450 13x1500 17x1055 119x32 13x1450 13x1525

TROOPER Open Off-Road Vehicle

3.0 DTI		118	04/00 →		→08/04 →08/04 →08/04	SVB131250 SVB10990 TB749	13x1250 10x990 104x22
3.5 V6 24V		158	04/00 →		A/C(-), →08/04 A/C(+), →08/04 →08/04	MVB2040R6 MVB2280R6 TB436	6PK2040 6PK2280 191x32

TROOPER Open Off-Road Vehicle (UB)

3.1 TD		84	08/91 → 07/98		A/C(-) A/C(+)	SVB171055 TB291 TBK075 SVB131450 SVB131525	17x1055 119x32 13x1450 13x1525
3.2		130	08/91 → 07/98			MVB800R4 MVB960R4 TB393 SVB101025	4PK800 4PK960 223x32 10x1025

TROOPER Open Off-Road Vehicle (UBS)

2.2 D 4x4	C223	39	05/84 → 07/89		PS A/C(-) A/C(+) A/C(+)	SVB131500 SVB171055 SVB171000 TB162 SVB131525	13x1500 17x1055 17x1000 87x34 13x1525
2.2 TD (UBS52)	C223T	53	03/84 → 12/91		PS, →07/91 →07/91 →07/91 A/C(+), →02/88	SVB131500 TB162 SVB171055 SVB131525	13x1500 87x34 17x1055 13x1525
2.3 (UBS16)	4ZD1	66	11/85 → 12/91		→12/85	SVB10760 SVB131000 SVB13950 TB265 SVB13900 SVB131025 SVB13750	10x760 13x1000 13x950 115x19 13x900 13x1025 13x750
2.6 i (UBS17)	4ZE1	85	10/87 → 12/91		→07/91 →07/91 →07/91 11/88→07/91 →07/91 →07/91 11/88→07/91	SVB10760 SVB131000 SVB13875 SVB13890 TB519 SVB131025 SVB131015	10x760 13x1000 13x875 13x890 137x25.4 13x1025 13x1015



kw



IVECO

Daily I

30-8	8140.61.200	53	01/78 → 12/89			SVB10925	10x925	
						TB135	152x30	
	8140.07.2700, 8140.67F.	55-60	01/92 → 08/98			SVB10925	10x925	
					Eng. 814007, → Eng. Nr 1307400	TB250	153x30	
	8140.67F.	60	01/96 → 08/98			SVB10925	10x925	
30-8 V,30-8 C	8140.61.200	53	01/78 → 12/89			SVB10950	10x950	
						TB135	152x30	
	8140.07.2700, 8140.07.2712, 8140.67F.	55-60	01/89 → 08/98			SVB10925	10x925	
	8140.67F.	60	01/96 → 08/98		Eng. 814007	TB250	153x30	
						SVB10925	10x925	
					Eng. 814007	TB250	153x30	
35-10	8140.21.200	68	01/85 → 12/89		Alt. 35, 55 A	SVB10925	10x925	
					Alt. 85 A	SVB10913	10x913	
					→ Eng. Nr 1307400	TB250	153x30	
	8140.47R.2790, 8140.97.2781	68-76	01/89 → 12/96		→ Eng. Nr 1927815	SVB10850	10x850	
					Eng Nr. 1927816 →	SVB10875	10x875	
					A/C (+)	SVB10925	10x925	
					A/C (+)	SVB13750	13x750	
	8140.23.	76	01/96 →			SVB13882	13x882	
						SVB10940	10x940	
					A/C (+)	SVB101050	10x1050	
					Alt. 85 A	SVB10925	10x925	
						SVB13800	13x800	
35-10 K	8140.23.	76	01/97 →			SVB13882	13x882	
						SVB10940	10x940	
					A/C (+)	SVB101050	10x1050	
					Alt. 85 A	SVB10925	10x925	
						SVB13800	13x800	
35-10 V,35-10 C	8140.21.200, 8140.27 S	68	01/85 → 12/89		Alt. 35, 55 A	SVB10925	10x925	
						TB135	152x30	
	8140.47R, 8140.47R.2790	76-80	01/89 → 08/98		→ Eng. Nr 1927815	SVB10850	10x850	
					Eng Nr. 1927816 →	SVB13875	13x875	
					A/C (+)	SVB10925	10x925	
						A/C (+)	SVB101075	10x1075
					A/C (+)	SVB13750	13x750	
	8140.23.	76	01/96 →			SVB13882	13x882	
						SVB10940	10x940	
					A/C (+)	SVB101050	10x1050	
					Alt. 85 A	SVB10925	10x925	
35-12	8140.47.2700	85	01/90 → 04/96		→ Eng. Nr 1927815	SVB10850	10x850	
					Eng Nr. 1927816 →	SVB10875	10x875	
						SVB10925	10x925	
					A/C (+)	SVB101075	10x1075	
						A/C (+)	SVB13750	13x750
		8140.43.	90	05/96 →			SVB13882	13x882
						SVB10940	10x940	
					A/C (+)	SVB101050	10x1050	
					Alt. 85 A	SVB10925	10x925	
						SVB13800	13x800	
35-12 K	8140.43.	90	09/96 → 08/98			SVB13882	13x882	
						SVB10940	10x940	
					A/C (+)	SVB101050	10x1050	
					Alt. 85 A	SVB10925	10x925	
						SVB13800	13x800	
35-12 V,35-12 C	8140.47.2700	85	01/90 → 04/96		→ Eng. Nr 1927815	SVB10850	10x850	
					Eng Nr. 1927816 →	SVB13875	13x875	
						SVB10925	10x925	
					A/C (+)	SVB101075	10x1075	
						A/C (+)	SVB13750	13x750
							SVB13750	13x750



kW



...IVECO

...Daily I

35-8	8140.61.200	53	01/78 → 12/89			SVB10925	10x925
						TB135	152x30
35-8 V,35-8 C	8140.07.2700, 8140.07.2712, 8140.67F.	55-60	01/89 → 08/98		Eng. 814007	SVB10925	10x925
						TB250	153x30
35-8 V,35-8 C	8140.61.200	53	01/78 → 12/89			SVB10925	10x925
						TB135	152x30
40-10	8140.07.2700, 8140.07.2712, 8140.67F.	55-60	01/91 → 08/98		Eng. 814007	SVB10925	10x925
						TB250	153x30
40-10	8140.27 S	68	01/85 → 12/89		→ Eng. Nr 1927815	SVB10850	10x850
					Eng Nr. 1927816 →	SVB10875	10x875
						SVB10925	10x925
					A/C (+)	SVB101075	10x1075
					→ Eng. Nr 1307400	TB250	153x30
					A/C (+)	SVB13750	13x750
40-10 V	8140.27 S	68	01/85 → 12/89		→ Eng. Nr 1927815	SVB10850	10x850
					Eng Nr. 1927816 →	SVB13875	13x875
						SVB10925	10x925
					A/C (+)	SVB101075	10x1075
					→ Eng. Nr 1307400	TB250	153x30
					A/C (+)	SVB13750	13x750
40-10 VV,40-10 WC	8140.27.2720	76	01/90 → 04/96		→ Eng. Nr 1927815	SVB10850	10x850
					Eng Nr. 1927816 →	SVB13875	13x875
						SVB10925	10x925
					A/C (+)	SVB101075	10x1075
					→ Eng. Nr 1307400	TB250	153x30
					A/C (+)	SVB13750	13x750
40-10 VV,40-10 WC	8140.23.	76	01/97 →			SVB10940	10x940
					Alt. 85 A	SVB10925	10x925
45-10	8140.21.200	68	01/85 → 12/89			SVB10925	10x925
					→ Eng. Nr 1307400	TB250	153x30
45-10	8140.27.2720	76	01/89 → 04/96		→ Eng. Nr 1927815	SVB10850	10x850
					Eng Nr. 1927816 →	SVB13875	13x875
						SVB10925	10x925
					A/C (+)	SVB101075	10x1075
					→ Eng. Nr 1307400	TB250	153x30
					A/C (+)	SVB13750	13x750
45-10	8140.21.200	68	01/85 → 12/89		→ Eng. Nr 1927815	SVB10850	10x850
					Eng Nr. 1927816 →	SVB13875	13x875
						SVB10925	10x925
					A/C (+)	SVB101075	10x1075
					→ Eng. Nr 1307400	TB250	153x30
					A/C (+)	SVB13750	13x750
45-10 V	8140.27.2720	76	01/89 → 04/96		→ Eng. Nr 1927815	SVB10850	10x850
					Eng Nr. 1927816 →	SVB13875	13x875
						SVB10925	10x925
					A/C (+)	SVB101075	10x1075
					→ Eng. Nr 1307400	TB250	153x30
					A/C (+)	SVB13750	13x750



kW



...IVECO

...Daily I

IVECO

49-10	8140.21.200	68	01/85 → 12/89	☀	→ Eng. Nr 1927815	SVB10850	10x850						
				☀	Eng Nr. 1927816 →	SVB13875	13x875						
				⌚		SVB10925	10x925						
				⌚	A/C (+)	SVB101075	10x1075						
				🔧	→ Eng. Nr 1307400	TB250	153x30						
				⌚	A/C (+)	SVB13750	13x750						
				8140.27.2700, 8140.47R.2790		76	01/89 → 04/96	☀	→ Eng. Nr 1927815	SVB10850	10x850		
				☀	Eng Nr. 1927816 →			SVB13875	13x875				
				⌚				SVB10925	10x925				
				⌚	A/C (+)			SVB101075	10x1075				
8140.23.		76	05/96 →	🔧	Eng. 814027	TB250	153x30						
⌚	A/C (+)			SVB13750	13x750								
⌚				SVB13882	13x882								
⌚	A/C (+)			SVB10940	10x940								
				⌚		SVB101050	10x1050						
						⌚	Alt. 85 A	SVB10925	10x925				
								⌚		SVB13800	13x800		
								⌚					
49-10 K	8140.27.2700, 8140.47R.2790	76	01/89 → 04/96			☀	→ Eng. Nr 1927815	SVB10850	10x850				
				☀	Eng Nr. 1927816 →	SVB13875	13x875						
				⌚		SVB10925	10x925						
				⌚	A/C (+)	SVB101075	10x1075						
				🔧	Eng. 814027	TB250	153x30						
				⌚	A/C (+)	SVB13750	13x750						
				8140.23.		76	05/96 →	☀		SVB13882	13x882		
										⌚		SVB10940	10x940
												⌚	A/C (+)
												⌚	Alt. 85 A
				⌚		SVB13800	13x800						
						⌚							
49-10 V	8140.21.200	68	01/85 → 12/89			☀	→ Eng. Nr 1927815	SVB10850	10x850				
				☀	Eng Nr. 1927816 →	SVB13875	13x875						
				⌚		SVB10925	10x925						
				⌚	A/C (+)	SVB101075	10x1075						
				🔧	→ Eng. Nr 1307400	TB250	153x30						
				⌚	A/C (+)	SVB13750	13x750						
				8140.27.2700, 8140.47R.2790		76	01/89 → 04/96	☀	→ Eng. Nr 1927815	SVB10850	10x850		
				☀	Eng Nr. 1927816 →			SVB13875	13x875				
				⌚				SVB10925	10x925				
				⌚	A/C (+)			SVB101075	10x1075				
8140.43.		90	05/96 →	🔧	→ Eng. Nr 1307400	TB250	153x30						
						⌚	A/C (+)	SVB13750	13x750				
								⌚		SVB13882	13x882		
								⌚	A/C (+)	SVB10940	10x940		
						⌚	Alt. 85 A	SVB101050	10x1050				
						⌚		SVB10925	10x925				
						⌚		SVB13800	13x800				
						⌚							
49-12 K	8140.47.2711, 8140.47.2721	85	06/90 → 04/96			☀	→ Eng. Nr 1927815	SVB10850	10x850				
				☀	Eng Nr. 1927816 →	SVB13875	13x875						
				⌚		SVB10925	10x925						
				⌚	A/C (+)	SVB101075	10x1075						
				⌚	A/C (+)	SVB13750	13x750						
				8140.43.		90	05/96 →	☀		SVB13882	13x882		
										⌚		SVB10940	10x940
												⌚	A/C (+)
												⌚	Alt. 85 A
										⌚		SVB13800	13x800
				⌚									
						⌚							
						⌚							
						⌚							
						⌚							



kW



...IVECO

...Daily I

49-12 V	8140.47.2711, 8140.47.2721	85	06/90 → 04/96	⚙	→ Eng. Nr 1927815	SVB10850	10x850
				⚙	Eng Nr. 1927816 →	SVB13875	13x875
				⚙		SVB10925	10x925
				⚙	A/C (+)	SVB101075	10x1075
				⚙	A/C (+)	SVB13750	13x750
8140.43.	90	05/96 →	⚙		SVB13882	13x882	
			⚙		SVB10940	10x940	
			⚙	A/C (+)	SVB101050	10x1050	
			⚙	Alt. 85 A	SVB10925	10x925	
			⚙		SVB13800	13x800	
59-12	8140.47.2700, 8140.47.2711	85	05/91 → 04/96	⚙	→ Eng. Nr 1927815	SVB10850	10x850
				⚙	Eng Nr. 1927816 →	SVB13875	13x875
				⚙		SVB10925	10x925
				⚙	A/C (+)	SVB101075	10x1075
				⚙	A/C (+)	SVB13750	13x750
8140.43.	90	05/96 →	⚙		SVB13882	13x882	
			⚙		SVB10940	10x940	
			⚙	A/C (+)	SVB101050	10x1050	
			⚙	Alt. 85 A	SVB10925	10x925	
			⚙		SVB13800	13x800	
59-12 K	8140.47.2700, 8140.47.2711	85	05/91 → 04/96	⚙	→ Eng. Nr 1927815	SVB10850	10x850
				⚙	Eng Nr. 1927816 →	SVB13875	13x875
				⚙		SVB10925	10x925
				⚙	A/C (+)	SVB101075	10x1075
				⚙	A/C (+)	SVB13750	13x750
8140.43.	90	05/96 →	⚙		SVB13882	13x882	
			⚙		SVB10940	10x940	
			⚙	A/C (+)	SVB101050	10x1050	
			⚙	Alt. 85 A	SVB10925	10x925	
			⚙		SVB13800	13x800	
59-12 V	8140.47.2700, 8140.47.2711	85	05/91 → 04/96	⚙	→ Eng. Nr 1927815	SVB10850	10x850
				⚙	Eng Nr. 1927816 →	SVB13875	13x875
				⚙		SVB10925	10x925
				⚙	A/C (+)	SVB101075	10x1075
				⚙	→ Eng. Nr 1307400	TB250	153x30
8140.43.	90	05/96 →	⚙		SVB13750	13x750	
			⚙		SVB13882	13x882	
			⚙		SVB10940	10x940	
			⚙	A/C (+)	SVB101050	10x1050	
			⚙	Alt. 85 A	SVB10925	10x925	
A 40-10	8140.27.2720	76	01/91 → 12/96	⚙	→ Eng. Nr 1927815	SVB10850	10x850
				⚙	Eng Nr. 1927816 →	SVB13875	13x875
				⚙		SVB10925	10x925
				⚙	A/C (+)	SVB101075	10x1075
				⚙	→ Eng. Nr 1307400	TB250	153x30
8140.23.	76	09/96 →	⚙		SVB13750	13x750	
			⚙		SVB13882	13x882	
			⚙		SVB10925	10x925	
			⚙	A/C (+)	SVB101050	10x1050	
			⚙		SVB13800	13x800	
A 40-12	8140.43.	90	05/96 →	⚙		SVB10925	10x925
A 45-10	8140.27.2720	76	01/91 → 04/96	⚙	→ Eng. Nr 1927815	SVB10850	10x850
				⚙	Eng Nr. 1927816 →	SVB13875	13x875
				⚙		SVB10925	10x925
				⚙	A/C (+)	SVB101075	10x1075
				⚙	→ Eng. Nr 1307400	TB250	153x30
				⚙	A/C (+)	SVB13750	13x750
	8140.23.	76	05/96 →	⚙		SVB13882	13x882
				⚙		SVB10925	10x925
				⚙	A/C (+)	SVB101050	10x1050
				⚙		SVB13800	13x800



kW



...IVECO

...Daily I

A 45-12	8140.47.2711, 8140.47.2721	85	06/90 → 04/96		→ Eng. Nr 1927815	SVB10850	10x850
					Eng Nr. 1927816 →	SVB13875	13x875
						SVB10925	10x925
					A/C (+)	SVB101075	10x1075
					A/C (+)	SVB13750	13x750
	8140.43.	90	05/96 →			SVB10925	10x925

Daily II

29 L 10 V	F1AE0481A	70	09/02 →		Eng. F1AE0481A	TB723	178x30
29L10	F1AE0481A	70	09/02 →		Eng. F1AE0481A	TB723	178x30
35 C 10 V, 35 S 10 V	F1AE0481A	70	09/02 →		Eng. F1AE0481A	TB723	178x30
35 S 11 V, 35 C 11 V	8140.43C	78	05/99 →		Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R4	4PK1050
					Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R6	6PK1050
					Eng. 8149.03, 01/00 →, Mod. CNG GAS	MVB1050R6	6PK1050
					Eng. 8149.03, 01/00 →, Mod. CNG GAS	TB558	154x30
					Eng. 8149.03, 01/00 →, Mod. CNG GAS	TBK102	
35 S 11, 35 C 11	8140.43C	78	05/99 →		Eng. 8149.03, 01/00 →, Mod. CNG GAS	MVB1050R6	6PK1050
					Eng. 8149.03, 01/00 →, Mod. CNG GAS	TB558	154x30
					Eng. 8149.03, 01/00 →, Mod. CNG GAS	TBK102	
35 S 13 V, 35 C 13 V	8140.43S	92	05/99 →		Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R4	4PK1050
					Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R6	6PK1050
35 S 13, 35 C 13	8140.43S	92	05/99 →		Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R4	4PK1050
					Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R6	6PK1050
35S10	F1AE0481A	70	09/02 →		Eng. F1AE0481A	TB723	178x30
50 C 13	8140.43S	92	05/99 →		Eng. 8140.43S, 01/00 →, Mod. UNIJET	MVB1050R4	4PK1050
					Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R4	4PK1050
					Eng. 8140.43S, 01/00 →, Mod. UNIJET	MVB1050R6	6PK1050
					Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R6	6PK1050
					Eng. 8140.43S, 01/00 →, Mod. UNIJET	MVB1050R4	4PK1050
					Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R4	4PK1050
					Eng. 8140.43S, 01/00 →, Mod. UNIJET	MVB1050R6	6PK1050
					Eng. 8140.43S, 8140.43N, 8140.43K, Mod. UNIJET	MVB1050R6	6PK1050



kW



...IVECO

Daily III

29L10 V	F1AE0481FA	70	05/06 →			TB723	178x30
29L10, 29L10 D, 29L10 D/P	F1AE0481FA	70	05/06 →			TB723	178x30
29L12 V, 29L12 V/P	F1AE0481GA	85	05/06 →			TB723	178x30
29L12, 29L12 /P, 29L12 D	F1AE0481GA	85	05/06 →			TB723	178x30
29L14 C, 29L14 C/P, 29L14 V, 29L14 V/P	F1AE0481HA	100	05/06 →			SVB13900	13x775
29L14, 29L14 /P, 29L14 D, 29L14 D/P	F1AE0481HA	100	05/06 →			SVB13775	13x775
35C10 K, 35C10 DK	F1AE0481FA	70	05/06 →			TB723	178x30
35C10 V, 35S10 V	F1AE0481FA	70	05/06 →			TB723	178x30
35C10, 35C10 D, 35S10, 35S10 D	F1AE0481FA	70	05/06 →			TB723	178x30
35C12 K, 35C12 DK	F1AE0481GA	85	05/06 →			TB723	178x30
35C12, 35C12 /P, 35S12, 35S12 /P, 35S12 D, 35S12 D/P	F1AE0481GA	85	05/06 →			TB723	178x30
35C12V, 35C12 V/P, 35S12 V, 35S12 V/P	F1AE0481GA	85	05/06 →			TB723	178x30
35S14 C, 35S14 C/P, 35S14 V, 35S14 V/P	F1AE0481HA	100	05/06 →			TB723	178x30
35S14, 35S14 /P, 35S14 D, 35S14 D/P	F1AE0481HA	100	05/06 →			TB723	178x30
40C10 V	F1AE0481FA	70	05/06 →			TB723	178x30
40C10, 40C10 D, 40S10	F1AE0481FA	70	05/06 →			TB723	178x30
40C12 V, 40C14 V/P	F1AE0481GA	85	05/06 →			TB723	178x30
40C12, 40C12 /P, 40C12 D, 40C12 D/P	F1AE0481GA	85	05/06 →			TB723	178x30

JAGUAR

S-TYPE (CCX)

2.7 D		152	06/04 →			TB814	195x29
						TB815	85x20
4.0 V8	AJ-V8	203	01/99 → 04/02		A/C(+), →10/01	MVB2390R6	6PK2390

XJ

2.8		132	10/68 → 10/73			SVB10850	10x850
					MS	SVB13750	13x750
					PS	SVB131125	13x1125
6 2,7 D		152	10/05 →			TB814	195x29
						TB815	85x20
6 2.8		110	09/68 → 09/73			SVB10850	10x850
					MS	SVB13750	13x750
					PS	SVB131125	13x1125
6 3.4	XK 3.4 (82-86)	119	05/75 → 10/86		→09/85	SVB10900	10x900
					→09/85	SVB131175	13x1175
					→09/85	SVB13875	13x875



kW



JAGUAR

...JAGUAR

...XJ

6 4.2	XK 4.2 (-79)	124	01/75 → 09/79	⊗		SVB10900	10x900			
				*	MS	SVB13875	13x875			
				*	PS	SVB131175	13x1175			
	XK 4.2 (82-87)	151	09/79 → 12/87	⊗	→09/86	SVB10888	10x888			
				⊗	→09/86	SVB131000	13x1000			
				⊗	→12/81	SVB10850	10x850			
				⊗	01/82 →09/86	SVB10825	10x825			
				⊗	→09/86	SVB131150	13x1150			
				⊗		SVB10900	10x900			
	127	01/75 → 12/79		⊗		MS	SVB13875	13x875		
				*		PS	SVB131175	13x1175		
				*		SVB10888	10x888			
⊗					SVB131000	13x1000				
⊗					SVB10825	10x825				
⊗					SVB131150	13x1150				
130				09/85 → 12/86		⊗		SVB10888	10x888	
						⊗		SVB131000	13x1000	
						⊗		SVB10825	10x825	
						⊗		SVB131150	13x1150	
						⊗		SVB10888	10x888	
						⊗		SVB131000	13x1000	
133	09/85 → 12/86		⊗		SVB10825	10x825				
			⊗		SVB131150	13x1150				
			⊗		SVB10888	10x888				
			⊗		SVB131000	13x1000				
			⊗		SVB10825	10x825				
			⊗		SVB131150	13x1150				
137	10/69 → 05/75		⊗		MS	SVB13875	13x875			
			*		PS	SVB131175	13x1175			
			*		SVB131525	13x1525				
			⊗		SVB10850	10x850				
			⊗		SVB13800	13x800				
			⊗		SVB131075	13x1075				
12 5.3	V 12 (75-79)	211	05/75 → 12/82	⊗		SVB131525	13x1525			
				⊗		SVB10850	10x850			
				⊗		SVB13800	13x800			
				⊗		SVB131075	13x1075			
				⊗		SVB131525	13x1525			
				⊗		SVB10850	10x850			
				⊗		SVB13800	13x800			
				⊗		SVB131075	13x1075			
				186	09/73 → 12/76		⊗		SVB131525	13x1525
							⊗		SVB10850	10x850
							⊗		SVB13800	13x800
							⊗		SVB131075	13x1075
⊗		SVB131525	13x1525							
⊗		SVB10850	10x850							
187	08/86 → 09/89		⊗	→12/88	SVB10850	10x850				
			⊗	01/89 →	MVB835R4	4PK835				
			⊗		SVB13800	13x800				
			⊗		SVB131075	13x1075				
			⊗		SVB131525	13x1525				
			⊗		SVB10850	10x850				
198	06/72 → 09/73		⊗		SVB13800	13x800				
			⊗		SVB131075	13x1075				
			⊗		SVB131525	13x1525				
			⊗		SVB10850	10x850				
			⊗		SVB13800	13x800				
			⊗		SVB131075	13x1075				
12 H.E.	V 12 (82-90)	217	09/81 → 12/92	⊗	→09/85	SVB10850	10x850			
				⊗	→09/85	SVB13800	13x800			
				⊗	→09/85	SVB131075	13x1075			
Sovereign V12	7P	194	10/86 → 12/92	⊗		SVB131525	13x1525			
				⊗	→12/88	SVB10850	10x850			
				⊗	01/89 →	MVB835R4	4PK835			
				⊗		SVB13800	13x800			
				⊗		SVB131075	13x1075			
				⊗		SVB131525	13x1525			
	V 12 (90-93, 197KW)	197	07/85 → 12/92		⊗	→12/88	SVB10850	10x850		
					⊗	01/89 →	MVB835R4	4PK835		
					⊗		SVB13800	13x800		
					⊗		SVB131075	13x1075		
					⊗		SVB131525	13x1525		
					⊗		SVB10850	10x850		

XJ (NAW, NBW)

8 3.2		174	07/97 → 05/03	⊗		MVB2337R7	7PK2337
8 4.0	BC	209	07/97 → 05/03	⊗		MVB2337R7	7PK2337

XJ (X300)

6 3.2	9JPGRB	155	11/94 → 07/97	⊗		SVB13975	13x975
				⊗		MVB995R4	4PK995



kW



...JAGUAR

...XJ (X300)

6 Sovereign 4.0	9JPF RB	177	11/94 → 07/97	⊗ ⊗ ⊗ ⊗		MVB1020R4 SVB13975 MVB975R5 SVB101000	4PK1020 13x975 5PK975 10x1000
12 6.0	8E	229	11/94 → 07/97	⊗ ⊗		MVB1070R4 MVB836R5	4PK1070 5PK836
R Super Charged 4.0	9KPDRB	235	11/94 → 07/97	⊗ ⊗		MVB1020R4 MVB975R5	4PK1020 5PK975

XJ (XJ 40, 81)

6 2.9	AJ 6 (2.9, KAT)	108	10/86 → 08/90	⊗	A/C(+)	SVB13975	13x975
	AJ 6 (2.9)	117	10/86 → 08/90	⊗	A/C(+)	SVB13975	13x975
		123	10/86 → 08/90	⊗	A/C(+)	SVB13975	13x975
6 3.2 24V	9BPMNA	146	09/90 → 11/94	⊗		SVB13975	13x975
				⊗		MVB995R4	4PK995
6 3.6	9DPANA	145	10/86 → 08/89	⊗		SVB13975	13x975
				⊗		MVB995R4	4PK995
	9DPANA, AJ 6 (3.6, 156KW)	156	10/86 → 08/89	⊗		SVB13975	13x975
				⊗		MVB995R4	4PK995
	136	10/86 → 08/89	⊗		SVB13975	13x975	
⊗				MVB995R4	4PK995		
6 4.0	9EPCNA	163	09/89 → 11/94	⊗		SVB13975	13x975
				⊗		MVB995R4	4PK995
V12 6.0	8C (92-94)	229	03/93 → 11/94	⊗	09/94 →	MVB1070R4	4PK1070
				⊗	09/94 →	MVB836R5	5PK836

XJS Coupe

3.6		136	01/88 → 05/92	⊗	→02/91	SVB13975	13x975
				⊗	→02/91	MVB995R4	4PK995
	AJ 6 (3.6, 156KW)	156	08/87 → 12/89	⊗		SVB13975	13x975
				⊗		MVB995R4	4PK995
	AJ 6 (3.6, 162KW)	162	10/83 → 12/88	⊗	→09/87	SVB13975	13x975
				⊗	→09/87	SVB101000	10x1000
	9DPALA, 9DPANA	146	01/88 → 05/91	⊗		SVB13975	13x975
				⊗		MVB995R4	4PK995
4.0	9EPCNA	163	05/91 → 09/94	⊗	09/92 →	SVB10650	10x650
				⊗		SVB13975	13x975
				⊗	→08/92	MVB995R4	4PK995
				⊗	09/92 →	MVB975R5	5PK975
				⊗	→12/94	SVB10650	10x650
	9LPFRB	171	07/94 → 03/96	⊗		SVB13975	13x975
⊗					MVB975R5	5PK975	



kW



JAGUAR

...JAGUAR

...XJS Coupe

5.3		197	01/86 → 12/89	⊗ ⊖ ⊖ * ⊕		SVB131525 SVB10850 MVB835R4 SVB13800 SVB131075	13x1525 10x850 4PK835 13x800 13x1075
	V 12 (90-93, 211KW)	211	01/88 → 05/92	⊗ ⊖ ⊖ * ⊕	→12/88 01/89→	SVB131525 SVB10850 MVB835R4 SVB13800 SVB131075	13x1525 10x850 4PK835 13x800 13x1075
	8C (88-92)	202	01/88 → 06/91	⊗ ⊖ ⊖ * ⊕	→12/88 01/89→	SVB131525 SVB10850 MVB835R4 SVB13800 SVB131075	13x1525 10x850 4PK835 13x800 13x1075
	8S (92-93)	207	05/91 → 08/93	⊗ ⊖ * ⊕	→08/92 →08/92 →08/92 →08/92	SVB131525 MVB835R4 SVB13800 SVB131075	13x1525 4PK835 13x800 13x1075
		213	09/75 → 07/81	⊖ * ⊕		SVB10850 SVB13800 SVB131075	10x850 13x800 13x1075
5.3 H.E.	8S (86-88)	194	01/86 → 12/89	⊗ ⊖ ⊖ * ⊕	→12/88 01/89→	SVB131525 SVB10850 MVB835R4 SVB13800 SVB131075	13x1525 10x850 4PK835 13x800 13x1075
	V 12 (82-90)	217	07/81 → 12/87	⊗ ⊖ * ⊕		SVB131525 SVB10850 SVB13800 SVB131075	13x1525 10x850 13x800 13x1075
6.0	8D	222	05/93 → 03/96	⊗ ⊖		MVB1070R4 MVB836R5	4PK1070 5PK836

XJSC Convertible

3.6		136	08/87 → 05/91	⊗ ⊖		SVB13975 MVB995R4	13x975 4PK995
	AJ 6 (3.6, 156KW)	156	08/87 → 05/91	⊗ ⊖		SVB13975 MVB995R4	13x975 4PK995
	AJ 6 (3.6, 162KW)	162	10/86 → 12/88	⊗ ⊖	→09/87 →09/87	SVB13975 SVB101000	13x975 10x1000
4.0	9EPCNA	163	05/91 → 09/94	⊗ ⊖		SVB13975 MVB995R4	13x975 4PK995
	9LPFRB	171	07/94 → 03/96	⊗ ⊖		SVB13975 MVB995R4	13x975 4PK995
5.3		197	01/86 → 05/88	⊗ ⊖ * ⊕		SVB131525 SVB10850 SVB13800 SVB131075	13x1525 10x850 13x800 13x1075
	V 12 (90-93, 211KW)	211	01/88 → 05/92	⊗ ⊖ ⊖ * ⊕	→12/88 01/89→	SVB131525 SVB10850 MVB835R4 SVB13800 SVB131075	13x1525 10x850 4PK835 13x800 13x1075
	8C (88-92)	202	01/88 → 09/91	⊗ ⊖ ⊖ * ⊕	→12/88 01/89→	SVB131525 SVB10850 MVB835R4 SVB13800 SVB131075	13x1525 10x850 4PK835 13x800 13x1075
	8S (92-93)	207	05/91 → 08/93	⊗ ⊖ * ⊕	→08/92 →08/92 →08/92 →08/92	SVB131525 MVB835R4 SVB13800 SVB131075	13x1525 4PK835 13x800 13x1075



kW



...JAGUAR

...XJSC Convertible

5.3 H.E.	8S (86-88)	194	07/85 → 05/92	⊗ ⊗ ⊗ ⊗ ⊗	→12/88 01/89→	SVB131525 SVB10850 MVB835R4 SVB13800 SVB131075	13x1525 10x850 4PK835 13x800 13x1075
	V 12 (82-90)	217	09/85 → 12/90	⊗ ⊗ ⊗ ⊗ ⊗	→12/88 01/89→	SVB131525 SVB10850 MVB835R4 SVB13800 SVB131075	13x1525 10x850 4PK835 13x800 13x1075
6.0	8D	222	05/93 → 03/96	⊗ ⊗		MVB1070R4 MVB836R5	4PK1070 5PK836

XK 8 Convertible (QDV)

4.0	CC, CE	209	03/96 →	⊗	→10/02	MVB2337R7	7PK2337
-----	--------	-----	---------	---	--------	-----------	---------

XK 8 Coupe (QEV)

4.0	CC, CE	209	03/96 →	⊗	→10/02	MVB2337R7	7PK2337
-----	--------	-----	---------	---	--------	-----------	---------

X-TYPE (CF1)

2.0 D		96	07/03 → 10/05	⊗ ⊗		MVB1642R6 MVB735R4	6PK1642 4PK735
2.0 V6		115	03/02 → 10/05	⊗		MVB2460R6	6PK2460
2.5 V6		144	06/01 →	⊗		MVB2460R6	6PK2460
3.0 V6		169	06/01 →	⊗		MVB2460R6	6PK2460

X-TYPE Estate

2.0 D		96	02/04 → 10/05	⊗ ⊗		MVB1642R6 MVB735R4	6PK1642 4PK735
2.0 V6		115	11/03 →	⊗		MVB2460R6	6PK2460
2.5		144	02/04 →	⊗		MVB2460R6	6PK2460
3.0		169	02/04 →	⊗		MVB2460R6	6PK2460

JEEP

CHEROKEE

2.5		81	10/83 → 09/86	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+), PS A/C(-)	SVB101350 SVB101090 MVB2080R6 SVB131175	10x1350 10x1090 6PK2080 13x1175
2.5 4x4		87	10/83 → 09/86	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+), PS A/C(-)	SVB101350 SVB101090 MVB2080R6 SVB131175	10x1350 10x1090 6PK2080 13x1175
2.8 4x4		81	10/83 → 09/86	⊗ ⊗ ⊗ ⊗	A/C(-), V-ribbed belt pulley (+) A/C(+), V-ribbed belt pulley (+) V-belt pulley (+) V-belt pulley (+)	MVB1855R6 MVB2080R6 SVB101090 SVB131175	6PK1855 6PK2080 10x1090 13x1175

CHEROKEE (KJ)

2.4		108	09/01 →	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB2145R6 MVB2325R6 TB705	6PK2145 6PK2325 146x28
2.4 Laredo		108	10/01 → 09/04	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB2145R6 MVB2325R6 TB705	6PK2145 6PK2325 146x28
2.5 CRD		105	09/01 →	⊗	→09/04	TB719	220x28
2.8 CRD		110	11/02 →	⊗		TB719	220x28
		120	11/04 →	⊗		TB719	220x28
3.7 Laredo		150	10/01 → 09/04	⊗		MVB2225R6	6PK2225



kw



...JEEP

...CHEROKEE (KJ)

3.7 V6		155	09/01 →	⊗	→09/04	MVB2190R6	6PK2190
				⊗	→09/04	MVB2225R6	6PK2225
				⊗	10/04 →	MVB2205R6	6PK2205
				⊗	→09/04	MVB2225R6	6PK2225

CHEROKEE (XJ)

2.1 D 4x4		59	10/86 → 09/92	⊗		MVB875R4	4PK875		
				⊗		SVB121030	12x1030		
						TB156	148x25.4		
				KIT	incl. guide pulley	TBK123			
				KIT	Manu Tensioner	TBK117			
2.1 TD	J8S	64	10/84 →	⊗	10/86 → 09/94	SVB10690	10x690		
					10/86 → 09/94	TB156	148x25.4		
				KIT	10/86 → 09/94,	TBK123			
					incl. guide pulley				
				KIT	Manu Tensioner, 10/86 → 09/94	TBK117			
		59	06/89 → 03/92	59	06/89 → 03/92	* *	A/C(-), 10/86 → 09/94	SVB13825	13x825
						* *	A/C(+), 10/86 → 09/94	SVB13975	13x975
						⊗	10/86 → 09/94	SVB10840	10x840
						⊗		MVB875R4	4PK875
						⊗		SVB121030	12x1030
2.5		89	10/90 → 09/96	⊗	A/C(-), →12/95	MVB1805R6	6PK1805		
				⊗	A/C(-), 01/96 →	MVB1980R6	6PK1980		
				⊗	A/C(+), LHD, →12/95	MVB2460R6	6PK2460		
				⊗	A/C(+), LHD, 01/96 →	MVB2315R6	6PK2315		
				⊗	A/C(+), RHA	MVB2190R6	6PK2190		
		90	10/86 → 09/90	90	10/86 → 09/90	⊗	A/C(-),	MVB1855R6	6PK1855
						⊗	V-ribbed belt pulley (+)		
						⊗	A/C(+),	MVB2080R6	6PK2080
						⊗	V-ribbed belt pulley (+)		
						⊗	V-belt pulley (+)	SVB101090	10x1090
2.5 4x4		90	10/86 → 09/90	⊗	V-belt pulley (+)	SVB131175	13x1175		
				⊗	A/C(-),	MVB1855R6	6PK1855		
				⊗	V-ribbed belt pulley (+)				
				⊗	A/C(+),	MVB2080R6	6PK2080		
				⊗	V-ribbed belt pulley (+)				
		2.5 i	EPE, HX	90	12/91 →	⊗	V-belt pulley (+)	SVB101090	10x1090
						⊗	V-belt pulley (+)	SVB131175	13x1175
						⊗	A/C(-), RHA, 01/96 → 08/01	MVB1980R6	6PK1980
						⊗	A/C(+), LHD, 01/96 → 08/01	MVB2315R6	6PK2315
						⊗	A/C(+), RHA, →12/96	MVB2190R6	6PK2190
2.5 SE		87	11/96 →	⊗	A/C(+), RHA, 01/97 → 08/01	MVB2415R6	6PK2415		
				⊗	Eng. EPE, A/C(-), →12/95	MVB1805R6	6PK1805		
				⊗	Eng. EPE, A/C(+), LHD, →12/95	MVB2460R6	6PK2460		
				⊗	A/C(-), RHA, →09/00	MVB1980R6	6PK1980		
				⊗	A/C(+), LHD, →09/00	MVB2315R6	6PK2315		
		87	10/96 → 09/99	87	10/96 → 09/99	⊗	A/C(+), RHA, →09/00	MVB2415R6	6PK2415
						⊗	A/C(+), RHA, →12/96	MVB2190R6	6PK2190
						⊗	A/C(-)	MVB1980R6	6PK1980
						⊗	A/C(+), LHD	MVB2315R6	6PK2315
						⊗	A/C(+), RHA	MVB2415R6	6PK2415
2.5 TD		85	01/88 →	⊗	A/C(+), RHA, →12/96	MVB2190R6	6PK2190		
				⊗	01/94 → 09/01	MVB2188R8	8PK2188		
				⊗	01/96 → 12/96	MVB2275R8	8PK2275		
				⊗	A/C(-), RHA, 02/99 → 08/01	MVB1980R6	6PK1980		
				⊗	A/C(+), LHD, 02/99 → 08/01	MVB2315R6	6PK2315		
89	10/95 →	89	10/95 →	⊗	A/C(+), RHA, 02/99 → 08/01	MVB2415R6	6PK2415		



kW



...JEEP

...CHEROKEE (XJ)

4.0 i	MX	135	12/91 →	⊗	LHD, →12/95	MVB2475R6	6PK2475
				⊗	LHD, 01/96→09/01	MVB2415R6	6PK2415
				⊗	RHA(+), 01/96→09/01	MVB2271R6	6PK2271
ERH	136	01/88 →	⊗	LHD, 01/91→12/95	MVB2475R6	6PK2475	
			⊗	LHD, 01/96→09/01	MVB2415R6	6PK2415	
			⊗	RHA(+), 01/96→09/01	MVB2271R6	6PK2271	
			⊗	LHD, →12/95	MVB2475R6	6PK2475	
			⊗	LHD, 01/96→09/01	MVB2415R6	6PK2415	
			⊗	RHA(+), 01/96→09/01	MVB2271R6	6PK2271	
131	01/95 →	⊗	LHD, →12/95	MVB2475R6	6PK2475		
		⊗	LHD, 01/96→09/01	MVB2415R6	6PK2415		
		⊗	RHA(+), 01/96→09/01	MVB2271R6	6PK2271		
127	07/98 →	⊗	LHD, 02/99→08/01	MVB2415R6	6PK2415		
		⊗	RHA(+), 02/99→08/01	MVB2271R6	6PK2271		
135	02/99 →	⊗	LHD, →08/01	MVB2415R6	6PK2415		
		⊗	RHA(+), →08/01	MVB2271R6	6PK2271		

CJ5 - CJ8

2.5	65	01/80 → 12/83	⊗	10/80→	SVB101350	10x1350
			⊗	10/80→	SVB101200	10x1200
			⊗	10/80→	SVB101275	10x1275

COMMANDER

3.0 CRD	160	04/06 →	⊗		MVB2035R7	7PK2035
3.7 V6	157	09/05 →	⊗		MVB2205R6	6PK2205
4.7 V8	170	09/05 →	⊗		MVB2205R6	6PK2205
5.7 V8	240	09/05 →	⊗		MVB2080R6	6PK2080

COMPASS

2.0 CRD	103	09/06 →	⊗		MVB1715R6	6PK1715
2.0 D	103	08/06 →	⊗		MVB1715R6	6PK1715
2.4	125	09/06 →	⊗	A/C(-)	MVB2040R6	6PK2040
			⊗	A/C(+)	MVB2553R6	6PK2553
	125	08/06 →	⊗	A/C(-)	MVB2040R6	6PK2040
			⊗	A/C(+)	MVB2553R6	6PK2553

GRAND CHEROKEE I (Z)

2.5 TD Laredo	85	10/96 → 09/98	⊗		MVB2188R8	8PK2188	
4.0 i (Z)	S01	130	10/95 → 04/99	⊗	→12/96	MVB2275R8	8PK2275
				⊗	A/C(-), →12/96	MVB1805R6	6PK1805
				⊗	A/C(+), →12/95	MVB2460R6	6PK2460
4.0 i (ZJ)	132	09/91 → 04/99	⊗	Alt. 117A, RHA(+), 01/97→09/98	MVB2280R6	6PK2280	
			⊗	LHD, 01/97→09/98	MVB2325R6	6PK2325	
			⊗	A/C(-), →12/96	MVB1805R6	6PK1805	
			⊗	A/C(+), →12/95	MVB2460R6	6PK2460	
			⊗	Alt. 117A, RHA(+), 01/97→09/98	MVB2280R6	6PK2280	
			⊗	LHD, 01/97→09/98	MVB2325R6	6PK2325	
4.0 Laredo	131	10/96 → 09/98	⊗	A/C(-), →12/96	MVB1805R6	6PK1805	
			⊗	Alt. 117A, RHA(+)	MVB2280R6	6PK2280	
			⊗	LHD	MVB2325R6	6PK2325	
5.2	164	10/96 → 09/98	⊗		MVB2265R7	7PK2265	
5.2 (Z)	Y01	156	10/95 → 04/99	⊗	→09/98	MVB2265R7	7PK2265
				⊗	→09/98	MVB2271R7	7PK2271
5.2 4WD	164	10/96 → 09/98	⊗		MVB2265R7	7PK2265	
			⊗		MVB2271R7	7PK2271	
5.2 i (ZJ)	155	01/92 → 04/99	⊗	→09/98	MVB2265R7	7PK2265	
			⊗	→09/98	MVB2271R7	7PK2271	
			⊗	→09/98	MVB2265R7	7PK2265	
Y	158	09/92 → 04/99	⊗	→09/98	MVB2265R7	7PK2265	
			⊗	→09/98	MVB2271R7	7PK2271	



kW



...JEEP

...GRAND CHEROKEE I (Z)

5.2 Limited 4x4	136	10/96 → 09/98	⊗		MVB2265R7	7PK2265
			⊗		MVB2271R7	7PK2271
5.9 i	177	08/97 → 04/99	⊗	→09/98	MVB2265R7	7PK2265

GRAND CHEROKEE II (WJ, WG)

3.1 TD	103	04/99 →	⊗	→03/02	MVB2488R8	8PK2488
3.7 Laredo	157	10/04 → 09/05	⊗		MVB2205R6	6PK2205
4.0	140	04/99 →	⊗		MVB2240R6	6PK2240
4.7	167	10/04 →	⊗		MVB2205R6	6PK2205
4.7 V8	162	04/99 → 08/00	⊗		MVB2215R6	6PK2215
	164	08/00 →	⊗		MVB2215R6	6PK2215
			⊗	→09/04	MVB2225R6	6PK2225
	190	10/01 →	⊗		MVB2215R6	6PK2215
			⊗	→09/04	MVB2225R6	6PK2225
4.7 V8 4x4	167	06/03 →	⊗		MVB2215R6	6PK2215
			⊗	→09/04	MVB2225R6	6PK2225

GRAND CHEROKEE III

3.0 CRD	160	06/05 →	⊗		MVB2035R7	7PK2035
3.7 V6	157	06/05 →	⊗	→09/05	MVB2205R6	6PK2205
4.7 V8	170	06/05 →	⊗		MVB2215R6	6PK2215
5.7 V8	240	06/05 →	⊗		MVB2080R6	6PK2080
6.1 V8	313	03/06 →	⊗		MVB2080R6	6PK2080

PATRIOT

2.0 TD	103	01/08 →	⊗		MVB1715R6	6PK1715
2.4	125	01/08 →	⊗	A/C(-)	MVB2040R6	6PK2040
			⊗	A/C(+)	MVB2553R6	6PK2553

WRANGLER I (YJ, SJ_)

2.5		01/88 → 12/91	⊗		SVB101090	10x1090
			⊗		SVB131175	13x1175
			⊗		SVB101090	10x1090
			⊗		SVB131175	13x1175
4.0		12/91 → 08/96	⊗	A/C(-), MS	MVB1760R6	6PK1760
			⊗	A/C(-), PS	MVB1805R6	6PK1805
			⊗	A/C(+), MS	MVB2403R6	6PK2403
			⊗	A/C(+), PS	MVB2460R6	6PK2460
4.2	6L <C 2V>	08/86 → 08/89	⊗	A/C(-), V-belt pulley (+)	SVB101090	10x1090
			⊗	MS, V-ribbed belt pulley (+)	MVB1995R6	6PK1995
			⊗	PS, V-ribbed belt pulley (+)	MVB2080R6	6PK2080
			⊗	V-belt pulley (+)	SVB131175	13x1175
4.2 2WD		10/86 → 09/90	⊗	A/C(-), V-belt pulley (+)	SVB101090	10x1090
			⊗	MS, V-ribbed belt pulley (+)	MVB1995R6	6PK1995
			⊗	PS, V-ribbed belt pulley (+)	MVB2080R6	6PK2080
			⊗	V-belt pulley (+)	SVB131175	13x1175

WRANGLER II (TJ)

2.4		11/02 →	⊗	A/C(-), →02/06	MVB2145R6	6PK2145
			⊗	A/C(+), →02/06	MVB2325R6	6PK2325
			⊗	→02/06	TB705	146x28
2.5	P00	08/96 →	⊗	→09/96	SVB101090	10x1090
			⊗	A/C(-), MS, LHD, →09/02	MVB1980R6	6PK1980
			⊗	A/C(-), PS, RHA, →09/02	MVB2250R6	6PK2250
			⊗	A/C(+), PS, →09/02	MVB2315R6	6PK2315
3.8		02/06 →	⊗	→09/96	SVB131175	13x1175
			⊗	A/C(+)	MVB2280R6	6PK2280
			⊗	A/C(+)	MVB2280R6	6PK2280
3.8 Rubicon Rear Wheel Drive		03/06 →	⊗	A/C(+)	MVB2280R6	6PK2280



kW



...JEEP

...WRANGLER II (TJ)

4.0	S01	130	08/96 →	⊗	A/C(-), MS, →12/96	MVB1760R6	6PK1760
				⊗	A/C(-), MS, LHD, 01/97→09/99	MVB1980R6	6PK1980
				⊗	A/C(-), PS, →12/96	MVB1805R6	6PK1805
				⊗	A/C(-), PS, RHA, 01/97→09/99	MVB2250R6	6PK2250
				⊗	A/C(+), MS, →12/96	MVB2403R6	6PK2403
				⊗	A/C(+), PS, →12/96	MVB2460R6	6PK2460
				⊗	A/C(+), PS, 01/97→09/99	MVB2315R6	6PK2315
		124	06/98 →	⊗	A/C(-), 10/99→02/06	MVB1913R6	6PK1913
				⊗	A/C(+), 10/99→02/06	MVB2240R6	6PK2240
4.0 Rubicon		128	08/03 →	⊗	A/C(-), →02/06	MVB1913R6	6PK1913
				⊗	A/C(+), →02/06	MVB2240R6	6PK2240

WRANGLER III (JK)

3.8		146	04/07 →	⊗	A/C(+)	MVB2280R6	6PK2280
-----	--	-----	---------	---	--------	------------------	---------

KIA

BESTA Box

2.2 D	R2	48	02/96 →	⊗	→10/97	SVB131125	13x1125
				⊗	→10/97	TB271	164x25.4
				⊗	→10/97	SVB13875	13x875

CARENS I (FC)

1.8		81	11/00 → 07/02	⊗		MVB885R4	4PK885
				⊗		TB548	154x22
				⊗	A/C(-)	MVB925R4	4PK925
				⊗	A/C(+), →05/01	MVB1080R4	4PK1080
				⊗	A/C(+), 05/01→	MVB1050R4	4PK1050

CARENS II (FJ)

1.6		77	07/02 →	⊗	→04/06	MVB885R4	4PK885
				⊗	→04/06	TB709	137x22
				⊗	A/C(-), →04/06	MVB887R4	4PK887
1.8		93	07/02 →	⊗	→04/06	MVB885R4	4PK885
				⊗	→04/06	TB548	154x22
				⊗	A/C(-), →04/06	MVB925R4	4PK925
				⊗	A/C(+), →12/02	MVB1050R4	4PK1050
2.0 CRDi		83	07/02 →	⊗		MVB1513R6	6PK1513
				⊗		TB714	123x28
	D4EA	103	11/05 →	⊗		MVB1513R6	6PK1513
				⊗		TB714	123x28
2.0 CVT	G4GC	102	08/04 →	⊗	→04/06	MVB855R4	4PK855
				⊗	→04/06	MVB887R4	4PK887
				⊗	→04/06	TB539	113x25.4
				⊗	→04/06	MVB675R3	3PK675

CARENS III

2.0 CRDi	D4EA	103	09/06 →	⊗		MVB1513R6	6PK1513
				⊗		TB714	123x28
2.0 CVT	G4KA	106	09/06 →	⊗	A/C(-)	MVB2510R6	6PK2510
				⊗	A/C(+)	MVB2585R6	6PK2585

CARNIVAL (UP)

2.5 V6		121	08/99 → 10/01	⊗	A/C(+)	MVB1580R6	6PK1580
				⊗		TB717	176x28
				⊗		TB747	59x22
2.9 TD		93	08/99 → 10/01	⊗		MVB870R4	4PK870
				⊗		MVB1590R5	5PK1590
				⊗	→06/00	TB706	151x30
				⊗	06/00→	TB716	152x29

CARNIVAL II

2.5 V6		110	10/01 →	⊗	A/C(+), →10/06	MVB1580R6	6PK1580
				⊗	→10/06	TB717	176x28
				⊗	→10/06, 2 belts	TB747	59x22



kw



...KIA

...CARNIVAL II

2.9 CRDi		106	10/01 →	☼ ⊖ ☼	→10/06 →10/06 →10/06	MVB870R4 MVB1590R5 TB716	4PK870 5PK1590 152x29
2.9 TD		93	10/01 →	☼ ⊖ ☼	→11/01 →11/01 →11/01	MVB870R4 MVB1590R5 TB716	4PK870 5PK1590 152x29

CARNIVAL III (UVP_)

2.7 V6		139	06/06 →	⊖		MVB2050R6	6PK2050
2.9 CRDi	J3	136	06/06 →	☼ ⊖		MVB850R4 MVB1590R5	4PK850 5PK1590

CEE'D Estate

1.4	G4FA	80	09/07 →	⊖ ☼		MVB887R4 TB539	4PK887 113x25.4
1.6	G4FC	90	09/07 →	⊖ ⊖	A/C(-) A/C(+)	MVB955R6 MVB1250R6	6PK955 6PK1250
		93	09/07 →	⊖ ⊖	A/C(-) A/C(+)	MVB955R6 MVB1250R6	6PK955 6PK1250
1.6 CRDi 115	D4FB	85	09/07 →	⊖	A/C(+)	MVB1800R5	5PK1800
1.6 CRDi 90	D4FB-L	66	09/07 →	⊖	A/C(+)	MVB1800R5	5PK1800
2.0	G4GC	105	09/07 →	⊖ ☼		MVB887R4 TB539	4PK887 113x25.4
2.0 CRDi	D4EA-F	103	09/07 →	⊖ ☼		MVB1400R6 TB714	6PK1400 123x28

CEE'D Hatchback

1.4	G4FA	80	12/06 →	⊖ ⊖	A/C(-) A/C(+)	MVB955R6 MVB1250R6	6PK955 6PK1250
1.6	G4FC	90	12/06 →	⊖ ⊖	A/C(-) A/C(+)	MVB955R6 MVB1250R6	6PK955 6PK1250
		93	02/08 →	⊖ ⊖	A/C(-) A/C(+)	MVB955R6 MVB1250R6	6PK955 6PK1250
1.6 CRDi 115	D4FB	85	12/06 →	⊖	A/C(+)	MVB1800R5	5PK1800
1.6 CRDi 90	D4FB-L	66	12/06 →	⊖	A/C(+)	MVB1800R5	5PK1800
2.0	G4GC	105	12/06 →	⊖ ☼		MVB887R4 TB539	4PK887 113x25.4
2.0 CRDi	D4EA-F	103	09/07 →	⊖ ☼		MVB1400R6 TB714	6PK1400 123x28

CERATO

1.5 CRDi		75	07/05 →	⊖	A/C(+), MS	MVB1800R5	5PK1800
1.6		77	07/04 →	☼ ⊖ ☼ ☼ ☼ ☼		MVB810R4 MVB850R4 TB537 TBK325 SVB13655	4PK810 4PK850 105x22 13x655
1.6 CRDi	D4FB	85	06/05 →	⊖ ⊖	A/C(-), 05/06 → A/C(+), 05/06 →	MVB1745R5 MVB1850R5	5PK1745 5PK1850
2.0	G4GC	105	04/04 →	☼ ⊖ ☼ ☼ ☼		MVB855R4 MVB887R4 TB539 MVB675R3	4PK855 4PK887 113x25.4 3PK675
2.0 CRDi	D4EA	83	04/04 →	⊖ ☼	→05/06 →05/06	MVB1513R6 TB714	6PK1513 123x28

CERATO Saloon

1.5 CRDi		75	07/05 →	⊖	A/C(+), MS	MVB1800R5	5PK1800
1.6		77	04/04 →	☼ ⊖ ☼ ☼ ☼ ☼		MVB810R4 MVB850R4 TB537 TBK325 SVB13655	4PK810 4PK850 105x22 13x655
	G4FC	90	05/06 →	⊖ ⊖	A/C(-) A/C(+)	MVB1530R6 MVB2135R6	6PK1530 6PK2135



kW



KIA

...KIA

...CERATO Saloon

1.6 CRDi	D4FB	85	06/05 →		A/C(-), 05/06 →	MVB1745R5	5PK1745
					A/C(+), 05/06 →	MVB1850R5	5PK1850
2.0	G4GC	105	04/04 →			MVB855R4	4PK855
						MVB887R4	4PK887
						TB539	113x25.4
						MVB675R3	3PK675
2.0 CRDi	D4EA	83	04/04 →		→05/06	MVB1513R6	6PK1513
					→05/06	TB714	123x28

CLARUS (K9A)

1.8 i 16V	T8	85	07/96 →		→08/01	MVB885R4	4PK885
					→08/01	TB548	154x22
					A/C(-), →08/01	MVB940R4	4PK940
					A/C(+), →08/01	MVB1110R4	4PK1110
2.0 i 16V	FE (16 V)	98	07/96 →		→08/01	MVB760R3	3PK760
					→08/01	TB280	168x25.4
					→08/01	TBK293	
					A/C(-), →08/01	MVB950R5	5PK950
					A/C(+), →08/01	MVB1073R5	5PK1073

CLARUS Estate (GC)

1.8 i 16V	T8	85	05/98 →		→08/01	MVB885R4	4PK885
					→08/01	TB548	154x22
					A/C(-), →08/01	MVB940R4	4PK940
					A/C(+), →08/01	MVB1110R4	4PK1110
2.0 i 16V	FE (16 V)	98	05/98 →		→08/01	MVB760R3	3PK760
					→08/01	TB280	168x25.4
					→08/01	TBK293	
					A/C(-), →08/01	MVB950R5	5PK950
					A/C(+), →08/01	MVB1073R5	5PK1073

JOICE

2.0		102	02/00 →		→09/03	MVB995R4	4PK995
					→09/03	TB326	65x12.7
					→09/03	TB325	153x29
					A/C(-), →09/03	SVB13675	13x675
					A/C(+), →09/03	MVB960R4	4PK960
		88	09/01 →		→09/03	MVB995R4	4PK995
					→09/03	TB326	65x12.7
					→09/03	TB325	153x29
					A/C(-), →09/03	SVB13675	13x675
					A/C(+), →09/03	MVB960R4	4PK960

K2500 (SD)

2.5 D	D4BH	69	01/03 →		→10/03	SVB13925	13x925
					→10/03	TB490	99x19
					→10/03	TB489	163x25.4
					→10/03	TBK311	
					→10/03	MVB1050R4	4PK1050

K2700 (SD)

2.7 D		59	10/99 →		→10/03	SVB13925	13x925
					→10/03	SVB13875	13x875

MAGENTIS

2.0	G4KA	106	11/05 →			MVB2585R6	6PK2585
2.0 CRDi	D4EA	103	04/06 →			MVB1513R6	6PK1513
						TB714	123x28
2.7	G6EA	138	11/05 →			MVB2050R6	6PK2050



kw



...KIA

MAGENTIS (GD)

2.0		100	05/01 →	⊗ T ☺ ☺	→09/05 →09/05 →09/05 →09/05	MVB940R4 TB739 TB708 MVB1388R5	4PK940 65x12.7 173x29 5PK1388
2.5 V6		124	05/01 →	⊗ ☺	A/C(-), →09/05 →09/05	MVB1700R6 TB707	6PK1700 207x32

OPIRUS

3.5		149	09/03 →	⊗ ☺	→09/06 →09/06	MVB1200R6 MVB906R5	6PK1200 5PK906
3.8 V6	G6DA	196	10/06 →	⊗		MVB2475R6	6PK2475

PICANTO (BA)

1.0	G4HE	45	09/05 →	☼ ⊗ ☺ ☺ ☺ ☺	A/C(-) A/C(+)	MVB673R4 MVB775R4 TB730 TBK328 MVB747R4 MVB870R4	4PK673 4PK775 101x20 4PK747 4PK870
1.1	G4HG	48	04/04 →	☼ ⊗ ☺ ☺ ☺ ☺	A/C(-) A/C(+)	MVB673R4 MVB775R4 TB730 TBK328 MVB747R4 MVB870R4	4PK673 4PK775 101x20 4PK747 4PK870
1.1 CRDi	D3FA	55	11/05 →	⊗	A/C(+)	MVB1790R5	5PK1790

PREGIO Box (TB)

2.5 Tci D	D4BH	69	09/02 →	☼ T ☺ ☺ ☺	→09/04 →09/04 →09/04 →09/04	SVB13950 TB490 TB489 TBK311 MVB1050R4	13x950 99x19 163x25.4 4PK1050
2.7 D		60	10/97 →	☼ ☺	→12/01 →12/01	SVB13925 SVB13875	13x925 13x875

PRIDE (DA)

1.1 i	B1	38	01/91 →	☼ ☺ ☺ ☺ ☺	MS, 05/91→04/94 05/91→04/94 05/91→04/94 A/C(-), 05/91→04/94 A/C(+), 05/91→04/94	SVB10888 TB289 TBK072 MVB800R4 MVB925R4	10x888 107x22 4PK800 4PK925
1.3 16V	B3	44	01/90 →	☼ ☺ ☺ ☺ ☺	MS, 05/91→05/01 05/91→05/01 05/91→05/01 A/C(-), 05/91→05/01 A/C(+), 05/91→05/01	SVB10888 TB289 TBK072 MVB800R4 MVB925R4	10x888 107x22 4PK800 4PK925
		53	01/90 →	⊗ ☺ ☺ ☺ ☺	05/91→05/01 05/91→05/01 05/91→05/01 A/C(-), 05/91→05/01 A/C(+), 05/91→05/01	SVB10888 TB289 TBK072 MVB800R4 MVB925R4	10x888 107x22 4PK800 4PK925
		47	10/96 →	☼ ☺ ☺ ☺ ☺	MS, →05/01 →05/01 →05/01 A/C(-), →05/01 A/C(+), →05/01	SVB10888 TB289 TBK072 MVB800R4 MVB925R4	10x888 107x22 4PK800 4PK925
1.3 i		51	01/90 →	☼ ☺ ☺ ☺ ☺	MS, 05/91→05/01 05/91→05/01 05/91→05/01 A/C(-), 05/91→05/01 A/C(+), 05/91→05/01	SVB10888 TB289 TBK072 MVB800R4 MVB925R4	10x888 107x22 4PK800 4PK925



kW



...KIA

PRIDE Estate

1.3		47	08/99 →		MS, →05/01	SVB10888	10x888
					→05/01	TB289	107x22
					→05/01	TBK072	
					A/C(-), →05/01	MVB800R4	4PK800
					A/C(+), →05/01	MVB925R4	4PK925

PRO CEE'D

1.4	G4FA	80	02/08 →			MVB887R4	4PK887
						TB539	113x25.4
1.6	G4FC	90	02/08 →		A/C(-)	MVB955R6	6PK955
					A/C(+)	MVB1250R6	6PK1250
		93	02/08 →		A/C(-)	MVB955R6	6PK955
					A/C(+)	MVB1250R6	6PK1250
1.6 CRDi 115	D4FB	85	02/08 →		A/C(+)	MVB1800R5	5PK1800
1.6 CRDi 90	D4FB-L	66	02/08 →		A/C(+)	MVB1800R5	5PK1800
2.0	G4GC	105	02/08 →			MVB887R4	4PK887
						TB539	113x25.4
2.0 CRDi	D4EA-F	103	02/08 →			MVB1400R6	6PK1400
						TB714	123x28

RETONA (CE)

2.0 16V		94	05/00 →		→08/03	MVB925R4	4PK925
					→08/03	SVB13900	13x900
					→08/03	TB280	168x25.4
					→08/03	SVB13775	13x775
2.0 TD		61	06/99 →		12/99→08/03	SVB131125	13x1125
					12/99→08/03	TB590	162x25.4
					12/99→08/03	SVB13850	13x850

RIO (DC_)

1.3		55	09/00 → 02/05			MVB885R4	4PK885
						TB289	107x22
						TBK072	
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB970R4	4PK970
		60	08/02 → 02/05			MVB885R4	4PK885
						TB289	107x22
						TBK072	
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB970R4	4PK970
1.5		72	09/00 → 02/05			MVB885R4	4PK885
						TB709	137x22
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB970R4	4PK970

RIO Estate (DC)

1.3		60	08/00 → 02/05			MVB885R4	4PK885
						TB289	107x22
						TBK072	
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB970R4	4PK970
		55	08/00 → 02/05			MVB885R4	4PK885
						TB289	107x22
						TBK072	
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB970R4	4PK970



kw



...KIA

...RIO Estate (DC)

1.5		72	08/00 → 02/05	 		MVB885R4 TB709 MVB850R4 MVB970R4	4PK885 137x22 4PK850 4PK970
		71	09/02 → 02/05	 	A/C(-) A/C(+) A/C(-) A/C(+)	MVB885R4 TB709 MVB850R4 MVB970R4	4PK885 137x22 4PK850 4PK970

RIO II

1.4 16V	G4EE	71	03/05 →	 		MVB810R4 MVB850R4 TB537 TBK325 SVB13655	4PK810 4PK850 105x22 13x655
1.5 CRDi	D4FA	81	03/05 →		A/C(+), MS	MVB1800R5	5PK1800
1.6 16V	G4ED	82	03/05 →	 		MVB810R4 MVB850R4 TB537 TBK325 SVB13655	4PK810 4PK850 105x22 13x655

RIO II Saloon

1.4 16V	G4EE	71	03/05 →	 		MVB810R4 MVB850R4 TB537 TBK325 SVB13655	4PK810 4PK850 105x22 13x655
1.5 CRDi	D4FA	81	03/05 →		A/C(+), MS	MVB1800R5	5PK1800
1.6 16V	G4ED	82	03/05 →	 		MVB810R4 MVB850R4 TB537 TBK325 SVB13655	4PK810 4PK850 105x22 13x655

SEPHIA (FA)

1.5 i 16V	B5	59	02/96 →	 	A/C(-), →04/99 →04/99 →04/99 →04/99 A/C(-), →04/99 A/C(+), →04/99	MVB900R4 MVB875R4 TB289 TBK072 MVB887R4 MVB1015R4	4PK900 4PK875 107x22 4PK887 4PK1015
1.6 i	B6	59	01/95 →	 	A/C(-), →05/96 →12/95 01/96 →05/96 →05/96 →05/96 A/C(-), →05/96 A/C(+), →05/96	MVB900R4 MVB885R4 MVB875R4 TB289 TBK072 MVB887R4 MVB1015R4	4PK900 4PK885 4PK875 107x22 4PK887 4PK1015
1.8 i 16V		82	01/95 →	 	03/97 →12/98 03/97 →12/98	MVB2013R6 TB548	6PK2013 154x22

SEPHIA Saloon (FA)

1.5 i 16V	B5	59	02/96 → 10/97	 	A/C(-) A/C(-) A/C(+)	MVB900R4 MVB875R4 TB289 TBK072 MVB887R4 MVB1015R4	4PK900 4PK875 107x22 4PK887 4PK1015
-----------	----	----	---------------	--------------	----------------------------	--	---



kW



KIA

...KIA

...SEPHIA Saloon (FA)

1.6 i	B6	59	09/93 →	 	A/C(-), →05/96 →12/95 01/96→05/96 →05/96 →05/96 A/C(-), →05/96 A/C(+), →05/96	MVB900R4 MVB885R4 MVB875R4 TB289 TBK072 MVB887R4 MVB1015R4	4PK900 4PK885 4PK875 107x22 4PK887 4PK1015
1.8 i 16V		82	01/95 →	 	03/97→12/98 03/97→12/98	MVB2013R6 TB548	6PK2013 154x22

SHUMA (FB)

1.5 i 16V		65	10/97 → 03/01	 	MS, 02/98→ 02/98→ 02/98→ A/C(-), 02/98→	MVB1050R4 MVB885R4 TB294 MVB887R4	4PK1050 4PK885 145x22 4PK887
1.8 i 16V		81	10/97 → 03/01	 	02/98→ 02/98→ 02/98→ A/C(-), 02/98→ A/C(+), 02/98→	MVB960R4 MVB885R4 TB548 MVB920R4 MVB1080R4	4PK960 4PK885 154x22 4PK920 4PK1080

SHUMA II (FB)

1.6		75	05/01 → 08/04	 	 A/C(-)	MVB1050R4 MVB885R4 TB709 MVB925R4	4PK1050 4PK885 137x22 4PK925
1.8		84	04/03 → 08/04	 	 A/C(-) A/C(+) 	MVB960R4 MVB885R4 TB548 MVB920R4 MVB1080R4	4PK960 4PK885 154x22 4PK920 4PK1080

SHUMA II Saloon (FB)

1.6		75	05/01 → 05/04	 	 A/C(-)	MVB1050R4 MVB885R4 TB709 MVB925R4	4PK1050 4PK885 137x22 4PK925
-----	--	----	---------------	--------------	--------------------	--	---------------------------------------

SHUMA Saloon (FB)

1.5		59	03/96 → 12/98	 	A/C(-) A/C(-) A/C(+) 	MVB900R4 MVB875R4 TB289 TBK072 MVB887R4 MVB1015R4	4PK900 4PK875 107x22 4PK887 4PK1015
1.5 i 16V		65	10/97 → 10/01	 	MS, 02/98→03/01 02/98→03/01 02/98→03/01 A/C(-), 02/98→03/01	MVB1050R4 MVB885R4 TB294 MVB887R4	4PK1050 4PK885 145x22 4PK887

SORENTO (JC)

2.4		102	08/02 →	 	→08/06 →08/06 A/C(-), →08/06 A/C(+), →08/06	MVB940R4 TB739 MVB1110R5 MVB1388R5	4PK940 65x12.7 5PK1110 5PK1388
2.5 CRDi	D4CB	103	08/02 →	 	09/06→ A/C(-), →08/06 A/C(+), →11/03 A/C(+), 12/03→08/06	MVB2265R7 MVB1730R7 MVB2271R7 MVB2265R7 MVB2265R7	7PK2265 7PK1730 7PK2271 7PK2265 7PK2265
3.5 V6		143	08/02 →	 	→08/06 →08/06 →08/06	MVB1050R4 MVB1135R5 MVB1080R4	4PK1050 5PK1135 4PK1080



kw



...KIA

SPORTAGE (JE_)

2.0 16V	G4GC	104	09/04 →			MVB855R4 4PK855 MVB887R4 4PK887 TB539 113x25.4 MVB675R3 3PK675
2.0 16V 4WD	G4GC	104	09/04 →			MVB855R4 4PK855 MVB887R4 4PK887 TB539 113x25.4 MVB675R3 3PK675
2.0 CRDi	D4EA-V	103	01/06 →		A/C(+)	MVB1513R6 6PK1513 TB714 123x28
	D4EA	83	02/05 →			MVB1513R6 6PK1513 TB714 123x28
2.0 CRDi 4WD	D4EA	83	09/04 →			MVB1513R6 6PK1513 TB714 123x28
	D4EA-F, D4EA-V	103	01/06 →		A/C(+)	MVB1513R6 6PK1513 TB714 123x28
2.7 V6 4WD	G6BA	129	09/04 →		A/C(-)	MVB1690R6 6PK1690
					A/C(+)	MVB1995R6 6PK1995
						TB707 207x32

SPORTAGE (K00)

2.0		87	10/00 → 08/03			SVB13900 13x900 MVB920R4 4PK920 TB280 168x25.4 TBK293
						SVB13775 13x775
						SVB13900 13x900 MVB920R4 4PK920 TB280 168x25.4 TBK293
						SVB13775 13x775
2.0 4WD		87	10/00 → 08/03			SVB13900 13x900 MVB920R4 4PK920 TB280 168x25.4 TBK293
						SVB13775 13x775
						SVB13900 13x900 MVB920R4 4PK920 TB280 168x25.4 TBK293
						SVB13775 13x775
2.0 i 16V	FE (16 V)	94	10/00 → 08/03			SVB13900 13x900 MVB920R4 4PK920 TB280 168x25.4 TBK293
						SVB13775 13x775
						SVB13900 13x900 MVB920R4 4PK920 TB280 168x25.4 TBK293
						SVB13775 13x775
2.0 i 16V 4WD	FE (16 V)	94	04/94 → 08/03		08/94 →	SVB13900 13x900 MVB920R4 4PK920 TB280 168x25.4 TBK293
					08/94 →	SVB13775 13x775
					08/94 →	SVB13900 13x900 MVB920R4 4PK920 TB280 168x25.4 TBK293
					08/94 →	SVB13775 13x775
2.0 i 4WD	FE	70	04/94 → 08/99		08/94 → 04/99	SVB13900 13x900 MVB920R4 4PK920 TB301 108x25.4 SVB13775 13x775
					08/94 → 04/99	SVB13775 13x775
					08/94 → 04/99	SVB13900 13x900 MVB920R4 4PK920 TB301 108x25.4 SVB13775 13x775
					08/94 → 04/99	SVB13775 13x775
2.0 TD 4WD	RF	61	10/97 → 08/03		→ 05/01	TB590 162x25.4
					→ 05/01	SVB13850 13x850

LADA

110

1.5		54	01/95 →		A/C(-), 06/96 → 09/04	MVB750R6 6PK750
					A/C(+), 06/96 → 09/04	MVB1120R5 5PK1120
					06/96 → 09/04	TB733 111x19 TBK321
					06/96 → 09/04	TBK321
VAZ-2111		57	01/95 →		A/C(-), 06/96 → 09/04	MVB750R6 6PK750
					A/C(+), 06/96 → 09/04	MVB1120R5 5PK1120
					06/96 → 09/04	TB733 111x19 TBK321
					06/96 → 09/04	TBK321
		56	10/00 →		A/C(-), → 09/04	MVB750R6 6PK750
					A/C(+), → 09/04	MVB1120R5 5PK1120
					→ 09/04	TB733 111x19 TBK321
					→ 09/04	TBK321



kW



LADA

...LADA

...110

1.5 16V	VAZ-2112	70	01/95 →		06/96 →09/04	MVB1125R6	6PK1125
					06/96 →09/04	MVB698R6	6PK698
		67	10/00 →		→09/04	MVB1125R6	6PK1125
					→09/04	MVB698R6	6PK698
					→09/04	TB734	136x25
2.0 i	C 20 XE	110	08/96 →		A/C(-), PS, →07/00	MVB1725R6	6PK1725
					→07/00	TB734	136x25

111

1.5	VAZ-2111	57	01/96 →		A/C(-), 06/96 →09/04	MVB750R6	6PK750
					A/C(+), 06/96 →09/04	MVB1120R5	5PK1120
					06/96 →09/04	TB733	111x19
					06/96 →09/04	TBK321	
		56	10/00 →		A/C(-), →09/04	MVB750R6	6PK750
					A/C(+), →09/04	MVB1120R5	5PK1120
					→09/04	TB733	111x19
					→09/04	TBK321	
1.5 16V	VAZ-2112	70	01/95 →		11/96 →09/04	MVB1125R6	6PK1125
					11/96 →09/04	MVB698R6	6PK698
					11/96 →09/04	TB734	136x25
		67	10/00 →		→09/04	MVB1125R6	6PK1125
					→09/04	MVB698R6	6PK698
					→09/04	TB734	136x25

112

1.5		54	01/95 →		MS, 06/96 →09/04	MVB750R6	6PK750
					PS, 06/96 →09/04	MVB1120R5	5PK1120
					06/96 →09/04	TB733	111x19
					06/96 →09/04	TBK321	
	VAZ-2111	57	01/95 →		MS, 06/96 →09/04	MVB750R6	6PK750
					PS, 06/96 →09/04	MVB1120R5	5PK1120
					06/96 →09/04	TB733	111x19
					06/96 →09/04	TBK321	
		56	10/00 →		MS, →09/04	MVB750R6	6PK750
					PS, →09/04	MVB1120R5	5PK1120
					→09/04	TB733	111x19
					→09/04	TBK321	
1.5 16V	VAZ-2112	70	01/95 →		MS, 06/96 →09/04	MVB750R6	6PK750
					PS, 06/96 →09/04	MVB1120R5	5PK1120
					06/96 →09/04	TB733	111x19
					06/96 →09/04	TBK321	
		67	10/00 →		02/01 →09/04	MVB1125R6	6PK1125
					02/01 →09/04	MVB698R6	6PK698
					02/01 →09/04	TB734	136x25

1200-1500 Estate

1200 (VAZ, WAS2102)	BA3 2101	44	09/73 → 08/84			SVB10940	10x940
1500 (VAZ2102)	BA3 2103	54	09/73 → 06/85		→02/85	SVB10940	10x940

1200-1600

1200 L/S (VAZ, WAS2101)	BA3 2101	44	01/70 → 06/86		→02/85	SVB10940	10x940
1300 (VAZ2101)	BA3 21011	48	05/78 → 01/87		→02/85	SVB10940	10x940
					→02/85	TB102	122x19
1300 (WAS21011)	BA3 2105	51	08/74 → 08/84			SVB10940	10x940
						TB102	122x19
1500 (WAS2103, WAS2106)	BA3 2103	55	09/72 → 08/84			SVB10940	10x940
1500 N/S (VAZ2103)	BA3 2103	55	11/75 → 10/86		→02/85	SVB10940	10x940
1600 (WAS2106)		58	09/72 → 08/84		11/78 →	SVB10940	10x940
1600 N/L (VAZ2103)	BA3 2106	57	03/79 → 10/86		→02/85	SVB10940	10x940

2170

1.6		72	12/08 →			MVB1115R6	6PK1115
-----	--	----	---------	--	--	------------------	---------



kW



...LADA

LADA

KALINA Estate (1117)

1.6		60	10/04 →		MS, →09/06	MVB887R5	5PK887
					PS, →09/06	MVB1120R5	5PK1120
					→09/06	TB733	111x19
					→09/06	TBK321	

KALINA Hatchback (1119)

1.6		60	10/04 →		MS, →09/06	MVB887R5	5PK887
					PS, →09/06	MVB1120R5	5PK1120
					→09/06	TB733	111x19
					→09/06	TBK321	
1.6 16V		66	10/04 →		A/C(-), 09/06 →	MVB750R6	6PK750
					A/C(+), 09/06 →	MVB1120R5	5PK1120
					09/06 →	TB734	136x25

KALINA Saloon (1118)

1.6		60	10/04 →		MS, →09/06	MVB887R5	5PK887
					PS, →09/06	MVB1120R5	5PK1120
					→09/06	TB733	111x19
					→09/06	TBK321	
1.6 16V		66	10/04 →		A/C(-), 09/06 →	MVB750R6	6PK750
					A/C(+), 09/06 →	MVB1120R5	5PK1120
					09/06 →	TB734	136x25

NADESCHDA (2120)

1.7	VAZ-2121.3	60	12/97 →			SVB10940	10x940
1.7 i		59	12/97 →			SVB10940	10x940

NIVA (2121)

1600	BA3 2121	56	04/80 → 12/87			SVB10940	10x940
						SVB131050	13x1050
		54	01/87 → 03/95		→12/93	SVB10940	10x940
					→12/93	SVB131050	13x1050
		56	12/76 → 05/87			SVB10940	10x940
						SVB131050	13x1050
1700 i	BA3 21214	59	06/96 →			SVB10940	10x940
1700 i 4x4		60	10/00 →			SVB10940	10x940
1900 Diesel	XUD9A	47	01/93 →		→09/00	MVB1230R4	4PK1230
					→09/00	TB175	136x25.4
					→09/00	TBK020	
	XUD9SD	55	01/99 →		→10/04	MVB1230R4	4PK1230
					→10/04	TB175	136x25.4
					→10/04	TBK020	

NIVA II (2123)

1.7		59	09/02 →			SVB10940	10x940
-----	--	----	---------	--	--	-----------------	--------

NOVA (2105, 2108, 2109)

1200 Junior/L (VAZ, WAS2105)	BA3 2101	44	09/81 →		→04/95	SVB10940	10x940
					→04/95	TB102	122x19
1300 Spezial/L (VAZ, WAS2105)	BA3 2105	48	05/81 →		→08/95	SVB10940	10x940
					→08/95	TB102	122x19
1500 S (WAS21093)		52	06/89 →		→09/04	SVB10940	10x940
1500 Special (VAZ2105, WAS21053)	BA3 2103	55	03/85 →		→09/04	SVB10940	10x940
1600 (WAS21074)	BA3 2106	56	01/88 →		→05/94	SVB10940	10x940
1700 i Classic (VAZ2107)		62	06/96 →		→10/01	SVB10940	10x940

NOVA Estate (2104)

1300	BA3 2105	48	09/85 → 12/90		10/86 →	SVB10940	10x940
					10/86 →	TB102	122x19
1500	BA3 2103	55	09/85 → 02/93			SVB10940	10x940
	BA3 2103 (KAT)	49	08/94 →		→09/04	SVB10940	10x940
1700		62	08/94 →		→10/01	SVB10940	10x940



kW



...LADA

SAMARA (2108, 2109)

1100	BA3 21081	39	02/88 → 12/94			SVB10710	10x710
					split tooth	TB232	111x19
						TB733	111x19
						TBK284	
					split tooth	TBK321	
	BA3 21081 (KAT)	43	02/96 →		→07/97	SVB10710	10x710
					→07/97	TB232	111x19
					→07/97, split tooth	TB733	111x19
					→07/97	TBK284	
					→12/99, split tooth	TBK321	
1300		46	01/88 →		Carb, →12/99	SVB10710	10x710
					Inj, →12/97	MVB700R4	4PK700
					Inj, 01/98 →12/99	MVB698R6	6PK698
					→12/99	TB232	111x19
					→12/99, split tooth	TB733	111x19
					→12/99	TBK284	
					→12/99, split tooth	TBK321	
	BA3 2108	48	01/86 → 12/94		05/86 →	SVB10710	10x710
					05/86 →	TB232	111x19
					05/86 →, split tooth	TB733	111x19
					05/86 →	TBK284	
					05/86 →, split tooth	TBK321	
	BA3 2108 (KAT)	45	09/91 →		Carb, →12/99	SVB10710	10x710
					Inj, →12/97	MVB700R4	4PK700
					Inj, 01/98 →12/99	MVB698R6	6PK698
					→12/99	TB232	111x19
					→12/99, split tooth	TB733	111x19
					→12/99	TBK284	
					→12/99, split tooth	TBK321	
	BA3 21115	50	02/96 →		→12/97	MVB700R4	4PK700
					01/98 →12/99	MVB698R6	6PK698
					→12/99	TB232	111x19
					→12/99, split tooth	TB733	111x19
					→12/99	TBK284	
					→12/99, split tooth	TBK321	
1500	BA3 21083	53	01/88 →		Carb, →12/99	SVB10710	10x710
					Inj, →12/97	MVB700R4	4PK700
					Inj, 01/98 →12/99	MVB698R6	6PK698
					→12/99	TB232	111x19
					→12/99, split tooth	TB733	111x19
					→12/99	TBK284	
					→12/99, split tooth	TBK321	
	BA3 21083 (KAT)	50	09/91 →		Carb, →12/99	SVB10710	10x710
					Inj, →12/97	MVB700R4	4PK700
					Inj, 01/98 →12/99	MVB698R6	6PK698
					→12/99	TB232	111x19
					→12/99, split tooth	TB733	111x19
					→12/99	TBK284	
					→12/99, split tooth	TBK321	
	BA3 2111	52	02/95 →		→12/97	MVB700R4	4PK700
					01/98 →12/99	MVB698R6	6PK698
					→12/99	TB232	111x19
					→12/99, split tooth	TB733	111x19
					→12/99	TBK284	
					→12/99, split tooth	TBK321	



kW



...LADA

SAMARA FORMA (21099)

1100	BA3 21081 (KAT)	39	07/91 →		→05/95	SVB10710	10x710
					→05/95	TB232	111x19
					→05/95, split tooth	TB733	111x19
					→05/95	TBK284	
1300	BA3 2108	48	05/89 → 07/97			SVB10710	10x710
					Inj	MVB700R4	4PK700
					split tooth	TB232	111x19
					split tooth	TB733	111x19
		split tooth	TBK284				
		split tooth	TBK321				
	46	05/90 →		Carb, →12/99	SVB10710	10x710	
				Inj, →12/97	MVB700R4	4PK700	
				Inj, 01/98→12/99	MVB698R6	6PK698	
				→12/99	TB232	111x19	
				→12/99, split tooth	TB733	111x19	
				→12/99	TBK284		
			→12/99, split tooth	TBK321			
			→12/99, split tooth	TBK321			
BA3 2108	45	07/91 →		Carb, →12/99	SVB10710	10x710	
				Inj, →12/97	MVB700R4	4PK700	
				Inj, 01/98→12/99	MVB698R6	6PK698	
				→12/99	TB232	111x19	
		→12/99, split tooth	TB733	111x19			
		→12/99	TBK284				
		→12/99, split tooth	TBK321				
	50	02/96 →		→12/97	MVB700R4	4PK700	
				01/98→12/99	MVB698R6	6PK698	
				→12/99	TB232	111x19	
				→12/99, split tooth	TB733	111x19	
				→12/99	TBK284		
			→12/99, split tooth	TBK321			
			→12/99, split tooth	TBK321			
			→12/99, split tooth	TBK321			
1500	BA3 21083	53	09/91 →		→12/99	SVB10710	10x710
					→12/99	TB232	111x19
					→12/99, split tooth	TB733	111x19
					→12/99	TBK284	
		→12/99, split tooth	TBK321				
	BA3 2111	52	11/94 →		Carb, →12/99	SVB10710	10x710
					Inj, →12/97	MVB700R4	4PK700
					Inj, 01/98→12/99	MVB698R6	6PK698
					→12/99	TB232	111x19
			→12/99, split tooth	TB733	111x19		
			→12/99	TBK284			
			→12/99, split tooth	TBK321			
		→12/99, split tooth	TBK321				
BA3 21083 (KAT)	50	07/91 →		→12/99	SVB10710	10x710	
				Inj, →12/97	MVB700R4	4PK700	
				Inj, 01/98→12/99	MVB698R6	6PK698	
				→12/99	TB232	111x19	
		→12/99, split tooth	TB733	111x19			
		→12/99	TBK284				
		→12/99, split tooth	TBK321				
		→12/99, split tooth	TBK321				

TOSCANA

1300 (VAZ2107)	BA3 2105	48	12/85 →		→05/92	SVB10940	10x940
1500 (VAZ2107)	BA3 2103	55	09/83 → 02/93		→05/92	TB102	122x19
					→05/92	SVB10940	10x940

LANCIA

A 112

0.9 Junior (A112B/2)	A112 A.000, A112 A5.000, A112 B2.000	29	03/81 → 06/86		→08/85	SVB10813	10x813
1.0 Abarth (A112B2/5)	A112 A2.000	51	03/78 → 02/84			SVB10800	10x800
1.0 LX	A112 B1.000	35	03/84 → 12/86		→08/85	SVB10813	10x813



kW



LANCIA

...LANCIA

DEDRA (835)

1.6 16V (835EI)	182 A4.000	76	01/96 → 07/99	 KIT	02/97 → 02/97 → 02/97 → 02/97 →	MVB960R4 4PK960 MVB938R5 5PK938 TB471 158x25.4 TBK089
1.6 i.e. (835AA)	835 A1.000	66	08/89 → 06/94	 KIT 	PS, →12/93 PS, 01/94 → A/C(-), MS A/C(-), PS A/C(+), PS →02/91 03/91 →	SVB131025 13x1025 SVB131050 13x1050 MVB915R4 4PK915 MVB925R5 5PK925 MVB960R5 5PK960 TB305 138x15 TBK027 SVB10740 10x740 SVB10690 10x690
1.6 i.e. (835AB)	835 A1.046	57	08/89 → 03/93	 KIT 	PS A/C(-), MS A/C(-), PS A/C(+), PS →02/91 03/91 →	SVB131025 13x1025 MVB915R4 4PK915 MVB925R5 5PK925 MVB960R5 5PK960 TB305 138x15 TBK027 SVB10740 10x740 SVB10690 10x690
1.6 i.e. (835AN)	835 C1.000	55	04/93 → 07/99	 KIT 	PS, →12/93 PS, 01/94 →08/97 A/C(-), MS, →08/97 A/C(-), PS, →08/97 A/C(+), PS, →08/97 →08/97 →08/97 →08/97	SVB131025 13x1025 SVB131050 13x1050 MVB915R4 4PK915 MVB925R5 5PK925 MVB960R5 5PK960 TB305 138x15 TBK027 SVB10690 10x690
1.6 LE (835EB) CAT	159 B9.000	66	07/94 → 07/99	 KIT 	→08/97 PS, →08/97 A/C(-), →08/97 A/C(-), MS, →08/97 A/C(-), PS, →08/97 A/C(+), →08/97 →08/97 →08/97 →08/97	SVB131025 13x1025 SVB131050 13x1050 MVB938R5 5PK938 MVB915R4 4PK915 MVB925R5 5PK925 MVB960R5 5PK960 TB305 138x15 TBK027 SVB10690 10x690
1.8 16V LE (835FG)	182 A2.000	83	03/96 → 07/99	 KIT 	A/C(-), →10/98 A/C(+), →10/98 →10/98 →10/98 →10/98	MVB1083R7 7PK1083 MVB1952R7 7PK1952 TB468 168x24 TBK356 MVB668R3 3PK668
1.8 GT 16V (835EH)	183 A1.000	96	03/96 → 07/99	 KIT		MVB1952R7 7PK1952 TB468 168x24 TBK356
1.8 i.e. (835AC, 835BC)	835 A2.000	80	09/89 → 06/94	 KIT 	A/C(-), →07/91 A/C(-), 08/91 → A/C(+), →07/91 A/C(+), 08/91 →	SVB13850 13x850 MVB1050R4 4PK1050 MVB1035R5 5PK1035 MVB1050R4 4PK1050 MVB1050R5 5PK1050 TB303 142x18 TBK118 TB579 97x15 A/C(-) SVB13825 13x825 A/C(+) SVB13750 13x750



kw



LANCIA

...LANCIA

...DEDRA (835)

1.8 i.e. (835AT)	835 C5.000	66	08/93 → 07/99	⚙️	→06/94	SVB13850	13x850				
				⊖	A/C(-), →06/94	MVB1035R5	5PK1035				
				⊕	A/C(+), →06/94	MVB1050R5	5PK1050				
				🔧	→06/94	TB303	142x18				
				🔧KIT	→06/94	TBK118					
				🔧, ⚙️		TB579	97x15				
				⊖	A/C(-), →06/94	SVB13825	13x825				
				⊕	A/C(+), →06/94	SVB13750	13x750				
				1.8 i.e. (835BD, 835AD)	835 A2.046	77	09/89 → 07/99	⚙️	→06/94	SVB13850	13x850
								⊖	A/C(-), →07/91	MVB1050R4	4PK1050
⊖	A/C(-), 08/91→06/94	MVB1035R5	5PK1035								
⊕	A/C(+), →07/91	MVB1050R4	4PK1050								
⊕	A/C(+), 08/91→06/94	MVB1050R5	5PK1050								
🔧	→06/94	TB303	142x18								
🔧KIT	→06/94	TBK118									
🔧, ⚙️		TB579	97x15								
⊖	A/C(-), →06/94	SVB13825	13x825								
⊕	A/C(+), →06/94	SVB13750	13x750								
1.8 i.e. (835FA)	836 A5.000	74	07/94 → 07/99	⚙️	→08/97	SVB13850	13x850				
				⊖	A/C(-), →08/97	MVB1035R5	5PK1035				
				⊖	A/C(+), →08/97	MVB1050R5	5PK1050				
				🔧	→08/97	TB303	142x18				
				🔧KIT	→08/97	TBK118					
				🔧, ⚙️		TB579	97x15				
				⊖	A/C(-), →08/97	SVB13875	13x875				
				⊕	A/C(+), →08/97	SVB13750	13x750				
				1.9 TDS (835EE, 835EF)	160 D1.000, 835 A4.000, 835 A4.046	66	04/89 → 07/99	⚙️	09/89→	MVB938R5	5PK938
								⊖	A/C(-), 07/94→,	MVB915R5	5PK915
	Eng Nr 1723044→										
⊖	A/C(-), 09/89→,	MVB906R5	5PK906								
	→ Eng Nr 1723043										
⊖	A/C(+), 09/89→,	MVB970R5	5PK970								
	→ Eng Nr 1723043										
⊕	A/C(+), 09/89→,	MVB985R5	5PK985								
	Eng Nr 1723044→										
⊕	A/C(+), 09/89→06/94,	MVB960R5	5PK960								
	→ Eng Nr 0933346										
	🔧	09/89→	TB307	173x22							
	🔧KIT	09/89→	TBK065								
	⊖	09/89→	SVB10725	10x725							
	⊕	09/89→06/94,	SVB10740	10x740							
		→ Eng Nr 1096004									
2.0 16V (835ED)	836 A3.000	102	07/94 → 07/99	⚙️	→08/98	SVB13850	13x850				
				⊖	A/C(-), →08/98	MVB1035R5	5PK1035				
				⊖	A/C(+), →08/98	MVB1050R5	5PK1050				
				🔧	→08/98	TB474	173x18				
				🔧, ⚙️		TB579	97x15				
				⊖	A/C(-), →08/98	SVB13875	13x875				
				⊕	A/C(+), →08/98	SVB13750	13x750				
				2.0 HF Integrale (835AP)	835 A7.046	124	11/90 → 07/94	⚙️		SVB13850	13x850
								⊖	A/C(-)	MVB1035R5	5PK1035
								⊖	A/C(+)	MVB1050R5	5PK1050
🔧		TB303	142x18								
🔧KIT		TBK118									
🔧, ⚙️		TB579	97x15								
⊖	A/C(-)	SVB13875	13x875								
⊕	A/C(+)	SVB13750	13x750								



kW



LANCIA

...LANCIA

...DEDRA (835)

2.0 i.e. (835AI)	835 A5.000	86	09/89 → 07/92	✱		SVB13850	13x850
				⊗	A/C(-), →07/91	MVB1050R4	4PK1050
				⊗	A/C(-), 08/91→	MVB1035R5	5PK1035
				⊗	A/C(+), →07/91	MVB1050R4	4PK1050
				⊗	A/C(+), 08/91→	MVB1050R5	5PK1050
				⊗		TB303	142x18
2.0 i.e. (835AL)	835 A5.046	83	09/89 → 07/99	⊗	→08/97	SVB13850	13x850
				⊗	A/C(-), →07/91	MVB1050R4	4PK1050
				⊗	A/C(-), 08/91→06/94	MVB1035R5	5PK1035
				⊗	A/C(-), 08/91→08/97	MVB1050R5	5PK1050
				⊗	A/C(+), →07/91	MVB1050R4	4PK1050
				⊗	A/C(+), 07/94→08/97	MVB1090R5	5PK1090
2.0 i.e. Turbo (835AR)	835 A8.046	119	04/91 → 07/99	⊗	→08/97	TB303	142x18
				⊗	→08/97	TBK118	
				⊗	→08/97	TB579	97x15
				⊗	A/C(-), →06/94	SVB13825	13x825
				⊗	A/C(-), 07/94→08/97	SVB13875	13x875
				⊗	A/C(+), →08/97	SVB13750	13x750
2.0 i.e. Turbo (835AO)	835 A7.000	121	05/90 → 07/94	✱	→06/94	SVB13850	13x850
				⊗	A/C(-), →06/94	MVB1035R5	5PK1035
				⊗	A/C(+), →06/94	MVB1050R5	5PK1050
				⊗	→06/94	TB303	142x18
				⊗	→06/94	TBK118	
				⊗	→06/94	TB579	97x15
2.0 Turbo (835AQ)	835 A8.000	130	11/90 → 06/94	✱	→06/94	SVB13875	13x875
				⊗	A/C(-), →06/94	SVB13750	13x750
				⊗	A/C(+), →06/94		
				⊗	→06/94		
				⊗	→06/94		
				⊗	→06/94		
2.0 i.e. Turbo Integrale (835A0)	835 A7.000	121	05/90 → 07/94	✱		SVB13850	13x850
				⊗	A/C(-)	MVB1035R5	5PK1035
				⊗	A/C(+)	MVB1050R5	5PK1050
				⊗		TB303	142x18
				⊗		TBK118	
				⊗		TB579	97x15
2.0 Turbo (835AQ)	835 A8.000	130	11/90 → 06/94	⊗	01/91→	SVB13875	13x875
				⊗	A/C(-)	SVB13750	13x750
				⊗	A/C(+)		
				⊗			
				⊗			
				⊗			

DEDRA SW (835)

1.6 (835EB)	159 B9.000	66	10/94 → 07/99	✱	→08/97	SVB131025	13x1025
				⊗	A/C(-), →08/97	MVB938R5	5PK938
				⊗	A/C(+), →08/97	MVB960R5	5PK960
				⊗	→08/97	TB305	138x15
				⊗	→08/97	TBK027	
				⊗	→08/97	SVB10690	10x690
1.6 16V (835EI)	182 A4.000	76	01/96 → 07/99	✱	02/97→	MVB960R4	4PK960
				⊗	02/97→	MVB938R5	5PK938
				⊗	02/97→	TB471	158x25.4
				⊗	02/97→	TBK089	
				⊗			
				⊗			
1.8 16V LE (835FG)	182 A2.000	83	03/96 → 07/99	⊗	A/C(-), →10/98	MVB1083R7	7PK1083
				⊗	A/C(+), →10/98	MVB1952R7	7PK1952
				⊗	→10/98	TB468	168x24
				⊗	→10/98	TBK356	
				⊗	→10/98	MVB668R3	3PK668
				⊗	→10/98		



kW



LANCIA

...LANCIA

...DEDRA SW (835)

1.8 GT 16V (835EH)	183 A1.000	96	03/96 → 07/99	 		MVB1952R7 TB468 TBK356	7PK1952 168x24
1.8 i.e. (835FA)	836 A5.000	74	07/94 → 07/99	 	→08/97 A/C(-), →08/97 A/C(+), →08/97 →08/97 →08/97 A/C(-), →08/97 A/C(+), →08/97	SVB13850 MVB1035R5 MVB1050R5 TB303 TBK118 TB579 SVB13875 SVB13750	13x850 5PK1035 5PK1050 142x18 97x15 13x875 13x750
1.9 TDS (835EE, 835EF)	160 D1.000, 835 A4.000	66	07/94 → 07/99	 	A/C(-), → Eng Nr 1723043 A/C(-), Eng Nr 1723044→ A/C(+), → Eng Nr 1723043 A/C(+), Eng Nr 1723044→	MVB938R5 MVB906R5 MVB915R5 MVB970R5 MVB985R5 TB307 TBK065 SVB10725	5PK938 5PK906 5PK915 5PK970 5PK985 173x22 10x725
2.0 Integrale (835ED)	836 A3.000	102	07/94 → 07/99	 	→08/98 A/C(-), →08/98 A/C(+), →08/98 →08/98 A/C(-), →08/98 A/C(+), →08/98	SVB13850 MVB1035R5 MVB1050R5 TB474 TB579 SVB13875 SVB13750	13x850 5PK1035 5PK1050 173x18 97x15 13x875 13x750
2.0 16V (835ED)	836 A3.000	102	07/94 → 07/99	 	→08/98 A/C(-), →08/98 A/C(+), →08/98 →08/98 A/C(-), →08/98 A/C(+), →08/98	SVB13850 MVB1035R5 MVB1050R5 TB474 TB579 SVB13875 SVB13750	13x850 5PK1035 5PK1050 173x18 97x15 13x875 13x750

DELTA I (831AB0)

1.1 (831AB.015)	831 B8.000	47	01/86 → 12/90	 		SVB10825 TB114	10x825 116x19
1.3		58	09/83 → 08/92	 	08/85 → 08/85 →	SVB10825 TB114	10x825 116x19
1.3 (831AB.011)	831 A2.000, 831 B.000	55	09/79 → 08/92	 	→07/85 →07/85	SVB10825 TB114	10x825 116x19
1.5 (831AB.025)	831 A1.000, 831 B1.000	63	09/79 → 12/92	 	→07/85 11/90→05/91	SVB10825 SVB10850 SVB10840 TB126	10x825 10x850 10x840 118x19
1.6 GT	831 A4.000	77	11/82 → 04/86	 	→07/85 →07/85 →07/85, → Eng Nr 488950 →07/85, Eng Nr 488951→	SVB10775 SVB101050 TB112 TB200	10x775 10x1050 144x19 143x19
1.6 GT i.e. (831AB.010)	149 C2.000	66	05/87 → 08/92	 	A/C(-), MS A/C(+), PS A/C(+)	SVB10825 SVB10940 SVB10913 TB249 SVB10813	10x825 10x940 10x913 138x18 10x813
1.6 GT i.e. (831AB.016)	831 B7.000	80	08/86 → 08/88	 	A/C(-), MS A/C(+), PS A/C(+)	SVB10825 SVB10940 SVB10913 TB249 SVB10813	10x825 10x940 10x913 138x18 10x813
1.6 HF Turbo	831 A7.000	96	10/83 → 12/86	 	→07/85 →07/85 →07/85, → Eng Nr 488950 →07/85, Eng Nr 488951→	SVB10775 SVB101050 TB112 TB200	10x775 10x1050 144x19 143x19



kW



...LANCIA

...DELTA I (831AB0)

1.6 HF Turbo (831AB.020)	831 B3.000	103	08/86 → 08/88	⊗		SVB10825	10x825
				⊗	A/C(-), MS	SVB10940	10x940
				⊗	A/C(+), PS	SVB10913	10x913
				⊗		TB249	138x18
1.6 HF Turbo (831AB.020S)	831 B7.046	97	04/87 → 03/89	⊗		SVB10813	10x813
				⊗	A/C(-), MS	SVB10825	10x825
				⊗	A/C(+), PS	SVB10940	10x940
				⊗		SVB10913	10x913
1.9 Turbo DS (831AB.021)	831 D1.000	59	10/86 → 12/89	⊗		TB249	138x18
				⊗	A/C(+)	SVB10813	10x813
				⊗		SVB10825	10x825
				⊗		SVB10940	10x940
2.0 16V HF Evo Integrale (831AB.027)	831 E5.000, 831 E5.046	155	06/93 → 01/94	⊗		TB351	126x25.4
				⊗		TB352	57x19
				⊗		SVB10813	10x813
				⊗		SVB10740	10x740
2.0 16V HF Integrale (831AB.026)	831 D5.000	144	03/89 → 09/91	⊗		MVB1345R5	5PK1345
				⊗		TB474	173x18
				⊗		TB579	97x15
				⊗		TB579	97x15
2.0 HF Integrale (831AB.019)	831 B5.000	122	11/86 → 08/88	⊗		MVB1345R5	5PK1345
				⊗		TB303	142x18
				⊗		TBK118	
				⊗		TB579	97x15
2.0 HF Integrale (831AB.024)	831 C5.000	133	10/87 → 02/89	⊗		MVB1345R5	5PK1345
				⊗		TB303	142x18
				⊗		TBK118	
				⊗		TB579	97x15
2.0 HF Integrale (831AB.024S, 831AB.028)	831 C5.046	130	12/86 → 12/92	⊗		MVB1345R5	5PK1345
				⊗		TB474	173x18
				⊗		TB579	97x15
				⊗		TB579	97x15

DELTA II (836)

1.4 i.e. (836AF, 836AH)	160 A1.046, 836 A4.000	51	10/94 → 08/99	⊗	Eng. 836A4000	SVB131050	13x1050
				⊗	A/C(-), →03/95	MVB925R5	5PK925
				⊗	A/C(-), 03/95 →	MVB938R5	5PK938
				⊗	A/C(+)	MVB960R5	5PK960
1.6 i.e. (836AD)	835 C1.000	55	06/93 → 08/99	⊗		TB305	138x15
				⊗		TBK027	
				⊗	Eng. 836A4000	SVB10690	10x690
				⊗		SVB131050	13x1050
1.6 i.e. (836AP)	182 A6.000	66	03/96 → 08/99	⊗		MVB938R5	5PK938
				⊗		MVB925R5	5PK925
				⊗		MVB960R5	5PK960
				⊗		TB305	138x15
1.6 i.e. 16V (836AO)	182 A4.000	76	01/96 → 08/99	⊗		TBK027	
				⊗		SVB10690	10x690
				⊗		MVB960R4	4PK960
				⊗		MVB938R5	5PK938
1.6 i.e. (836AP)	182 A6.000	66	03/96 → 08/99	⊗		TB471	158x25.4
				⊗		TBK089	
				⊗		MVB668R3	3PK668
				⊗		MVB668R3	3PK668
1.6 i.e. 16V (836AO)	182 A4.000	76	01/96 → 08/99	⊗		MVB960R4	4PK960
				⊗		MVB938R5	5PK938
				⊗		TB471	158x25.4
				⊗		TBK089	
1.6 i.e. (836AP)	182 A6.000	66	03/96 → 08/99	⊗		MVB668R3	3PK668
				⊗		MVB668R3	3PK668
				⊗		MVB668R3	3PK668
				⊗		MVB668R3	3PK668



kW



LANCIA

...LANCIA

...DELTA II (836)

1.8		66	02/96 → 09/99	 	A/C(-) A/C(+) 	SVB13850 MVB1035R5 MVB1050R5 TB303 TBK118 SVB13875 SVB13750	13x850 5PK1035 5PK1050 142x18 13x875 13x750
1.8 i.e. (836AE)	835 C2.000	76	06/93 → 08/99	 	11/93→ A/C(-), 11/93→ A/C(+), 11/93→ 11/93→ 11/93→ 11/93→ A/C(-), 11/93→ A/C(+), 11/93→	SVB13850 MVB1035R5 MVB1050R5 TB303 TBK118 SVB13875 SVB13750	13x850 5PK1035 5PK1050 142x18 13x875 13x750
1.8 i.e. (836AG, 836AL)	835 C4.000, 836 A6.000, 836 C4.000	66	07/94 → 08/99	 	→08/96 A/C(-), →08/96 A/C(+), →08/96 →08/96 →08/96 →08/96 A/C(-), →08/96 A/C(+), →08/96	SVB13850 MVB1035R5 MVB1050R5 TB303 TBK118 SVB13875 SVB13750	13x850 5PK1035 5PK1050 142x18 13x875 13x750
1.8 i.e. 16V (836AQ)	182 A2.000	83	03/96 → 08/99	 	A/C(-), →04/98 A/C(+), →04/98 →04/98 →04/98	MVB1083R7 MVB1952R7 TB468 TBK356	7PK1083 7PK1952 168x24
1.8 i.e. 16V GT (836AR)	183 A1.000	96	03/96 → 08/99	 	A/C(-), →04/98, → Eng Nr 1385143 A/C(-), 05/98→, Eng Nr 1385144→ A/C(+), →04/98, → Eng Nr 1385143 A/C(+), 05/98→, Eng Nr 1385144→ →04/98	MVB1083R7 MVB1080R6 MVB1952R7 MVB1980R6 TB468 TBK356	7PK1083 6PK1080 7PK1952 6PK1980 168x24
1.9 TD (836AM, 836AN)	160 D1.000, 835 A4.000	66	10/94 → 08/99	 	A/C(-), → Eng Nr 1723043 A/C(-), Eng Nr 1723044→ A/C(+), → Eng Nr 1723043 A/C(+), Eng Nr 1723044→ 	MVB938R5 MVB906R5 MVB915R5 MVB970R5 MVB985R5 TB307 TBK065 SVB10725	5PK938 5PK906 5PK915 5PK970 5PK985 173x22 10x725
2.0 16V (836AA, 836CA)	836 A3.000	102	06/93 → 08/99	 	11/93→ A/C(-), 11/93→ A/C(+), 11/93→ 11/93→ 11/93→ 11/93→ A/C(-), 11/93→ A/C(+), 11/93→	SVB13850 MVB1035R5 MVB1050R5 TB474 TB579 SVB13875 SVB13750	13x850 5PK1035 5PK1050 173x18 97x15 13x875 13x750
2.0 16V Turbo (836AB)	836 A2.000	137	06/93 → 08/99	 	11/93→ A/C(-), 11/93→ A/C(+), 11/93→ 11/93→ 11/93→ 11/93→ A/C(-), 11/93→ A/C(+), 11/93→	SVB13850 MVB1035R5 MVB1050R5 TB474 TB579 SVB13875 SVB13750	13x850 5PK1035 5PK1050 173x18 97x15 13x875 13x750



kW



...LANCIA

...DELTA II (836)

2.0 16V Turbo (836AS)	175 A4.000	142	07/96 → 08/99	⚙️ ⚙️ ⚙️ ⚙️, ⚙️ ⚙️ ⚙️	A/C(-) A/C(+) A/C(-) A/C(+)	SVB13850 MVB1035R5 MVB1050R5 TB474 TB579 SVB13875 SVB13750	13x850 5PK1035 5PK1050 173x18 97x15 13x875 13x750
-----------------------	------------	-----	---------------	--------------------------------------	--	--	---

FULVIA

1.3 S		65	09/68 → 07/75	⚙️ *	→12/73 →12/73	SVB10775 SVB10735	10x775 10x735
1.6		75	10/68 → 06/70	⚙️ *		SVB10750 SVB10735	10x750 10x735

KAPPA (838A)

2.0 16V Turbo (838AB1AA)	838 A4.000	151	02/95 → 10/01	⚙️ ⚙️ ⚙️, ⚙️ ⚙️ ⚙️	→02/98 →02/98 →02/98 →12/98 →02/98	SVB13875 MVB1100R5 TB474 TB579 SVB13750	13x875 5PK1100 173x18 97x15 13x750
2.0 20V (838AA1AA)	838 A1.000	107	10/94 → 10/01	⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB1035R6 MVB1690R6 TB462	6PK1035 6PK1690 167x24
2.0 20V (838AG1AA, 838AG11A)	838 A6.000	114	07/96 → 10/01	⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB1035R6 MVB1690R6 TB462	6PK1035 6PK1690 167x24
2.0 20V Turbo (838AM1AA)	175 A3.000	162	06/98 → 10/01	⚙️ ⚙️		MVB1690R6 TB462	6PK1690 167x24
2.4 20V (838AC1AA, 838AC11A)	838 A2.000, 838 A2.027	129	08/94 → 10/01	⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB1035R6 MVB1690R6 TB468	6PK1035 6PK1690 168x24
2.4 JTD (838AL1AA)	838 A8.000	100	06/98 → 10/01	⚙️ ⚙️ ⚙️ ⚙️KIT	A/C(-) A/C(+)	MVB1105R6 MVB1740R6 TB639 TBK104	6PK1105 6PK1740 190x24
2.4 T.DS (838AE1AA, 838AH1AA)	838 A3.000, 838 A7.000	91	08/94 → 10/01	⚙️ ⚙️ ⚙️ ⚙️ ⚙️ ⚙️KIT	A/C(-), →01/97, → Eng Nr 0597296 A/C(-), 02/97→04/98, Eng Nr 0597297→ A/C(+), →01/97, → Eng Nr 0597296 A/C(+), 02/97→04/98, Eng Nr 0597297→ →04/98 →04/98	MVB1065R6 MVB1105R6 MVB1715R6 MVB1740R6 TB608 TBK352	6PK1065 6PK1105 6PK1715 6PK1740 193x24
3.0 24V (838AD1AA, 838AD11A, 838XD1AA, 838ZD1AA)	838 B.000	150	08/94 → 10/01	⚙️ ⚙️ ⚙️ ⚙️	A/C(+)	MVB1995R6 MVB1969R7 TB531 TB532	6PK1995 7PK1969 174x28 185x28

KAPPA Coupe (838)

2.0 16V Turbo (838CB)	838 A4.000	151	11/96 → 03/01	⚙️ ⚙️ ⚙️ ⚙️, ⚙️ ⚙️ ⚙️	→02/98 →02/98 →02/98 →12/98 →02/98	SVB13875 MVB1100R5 TB474 TB579 SVB13750	13x875 5PK1100 173x18 97x15 13x750
2.0 20V	838 A6.000	114	07/96 → 03/01	⚙️ ⚙️	03/98 → 03/98 →	MVB1690R6 TB462	6PK1690 167x24
2.0 20V Turbo (838CM)	175 A3.000	162	06/98 → 03/01	⚙️ ⚙️		MVB1690R6 TB462	6PK1690 167x24
2.4 20V (838CC)	838 A2.000	129	11/96 → 03/01	⚙️ ⚙️		MVB1690R6 TB468	6PK1690 168x24






kW











...LANCIA

...KAPPA Coupe (838)




3.0 24V (838CD, 838CD11A)	838 B.000	150	11/96 → 03/01	  		MVB1969R7 MVB1995R6 TB532	7PK1969 6PK1995 185x28
---------------------------	-----------	-----	---------------	---	--	--	------------------------------





KAPPA SW (838B)



2.0 16V Turbo (838BB1AA)	838 A4.000	151	07/96 → 10/01	    	→02/98 →02/98 →02/98 →12/98 →02/98	SVB13875 MVB1100R5 TB474 TB579 SVB13750	13x875 5PK1100 173x18 97x15 13x750
--------------------------	------------	-----	---------------	---	--	--	--


2.0 20V (838BG1AA)	838 A6.000	114	07/96 → 10/01	  	A/C(-), →05/01 A/C(+), →05/01 →05/01	MVB1035R6 MVB1690R6 TB462	6PK1035 6PK1690 167x24
--------------------	------------	-----	---------------	---	--	--	------------------------------


2.0 20V Turbo (838BM1AA)	175 A3.000	162	06/98 → 10/01	 	→05/01 →05/01	MVB1690R6 TB462	6PK1690 167x24
--------------------------	------------	-----	---------------	--	------------------	----------------------------------	-------------------



2.4 20V (838BC1AA, 838BC11A)	838 A2.000	129	07/96 → 10/01	  	A/C(-) A/C(+) →05/01	MVB1035R6 MVB1690R6 TB468	6PK1035 6PK1690 168x24
------------------------------	------------	-----	---------------	---	----------------------------	--	------------------------------





2.4 JTD (838BL1AA)	838 A8.000	100	06/98 → 10/01	   	A/C(-), →05/01 A/C(+), →05/01 →05/01 →05/01	MVB1105R6 MVB1740R6 TB639 TBK104	6PK1105 6PK1740 190x24
--------------------	------------	-----	---------------	--	--	---	----------------------------------

2.4 T.DS (838BH1AA)	838 A3.000, 838 A7.000	91	07/96 → 10/01	 	Eng. 838A7000, A/C(-), →01/97, → Eng Nr 0597296 Eng. 838A7000, A/C(-), 02/97→02/98, Eng Nr 0597297→	MVB1065R6 MVB1105R6	6PK1065 6PK1105
---------------------	------------------------	----	---------------	--	--	--	------------------------






					Eng. 838A7000, A/C(+), →01/97, → Eng Nr 0597296	MVB1715R6	6PK1715
--	--	--	--	---	---	------------------	---------






					Eng. 838A7000, A/C(+), 02/97→02/98, Eng Nr 0597297→	MVB1740R6	6PK1740
--	--	--	--	---	---	------------------	---------






				 	→02/98 →02/98	TB608 TBK352	193x24
--	--	--	--	--	------------------	-------------------------------	------------

3.0 24V (838BD11A)	838 B.000	150	07/96 → 10/01	   	→05/01 →05/01 →05/01 →05/01	MVB1969R7 MVB1995R6 TB531 TB532	7PK1969 6PK1995 174x28 185x28
--------------------	-----------	-----	---------------	--	--------------------------------------	--	--

LYBRA (839AX)

1.6		76	10/00 → 10/05	    	→06/01	MVB960R4 MVB938R5 TB471 TBK089 MVB668R3	4PK960 5PK938 158x25.4 3PK668
-----	--	----	---------------	---	--------	--	--

1.6 16V (839AXA1A)	182 A4.000	76	07/99 →	    	→06/01 →09/01 →09/01 →09/01 →09/01	MVB960R4 MVB938R5 TB471 TBK089 MVB668R3	4PK960 5PK938 158x25.4 3PK668
--------------------	------------	----	---------	---	--	--	--

1.8 16V (839AXB1A, 839AXG1A)	839 A4.000, 839 A7.000, 839 A9.000	96	07/99 →	    	A/C(-), →08/02 A/C(+), →08/02 Eng. 839A9000, A/C(-), 09/02→10/05 Eng. 839A9000, A/C(+), 09/02→10/05 →10/05	MVB1080R6 MVB1980R6 MVB1065R6 MVB1960R6 TB468	6PK1080 6PK1980 6PK1065 6PK1960 168x24
------------------------------	------------------------------------	----	---------	---	--	--	--



kW



...LANCIA

...LYBRA (839AX)

1.9 JTD	937 A2.000	85	05/01 →		A/C(-), →10/05	MVB1035R6	6PK1035
					A/C(+), →10/05	MVB1833R6	6PK1833
					→10/05	TB639	190x24
					→10/05, → Eng Nr 4130907	TBK283	
					→10/05, Eng Nr 4130908→	TBK329	
1.9 JTD (839AXD1A)	AR 32302	77	07/99 → 09/00		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
					→ Eng Nr 4130907	TBK283	
					Eng Nr 4130908→	TBK329	
1.9 JTD (839AXI1A)	AR 37101	81	09/00 → 05/01		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
					→ Eng Nr 4130907	TBK283	
					Eng Nr 4130908→	TBK329	
2.0 20V (839AXC11, 839AXC1A)	182 B7.000	113	07/99 → 09/00			TB462	167x24
						MVB1137R6	6PK1137
2.0 20V (839AXH1A)	185 A8.000	110	09/00 →		→10/05	TB559	166x24
					→10/05	MVB1137R6	6PK1137
2.4 JTD	841C.000	110	05/02 →		A/C(+), →10/05	MVB1760R6	6PK1760
					→10/05	TB639	190x24
					→10/05	TBK104	
2.4 JTD (839AXE1A)	839 A5.000, AR 32501	99	07/99 → 09/00		A/C(+)	MVB1760R6	6PK1760
						TB639	190x24
						TBK104	
2.4 JTD (839AXL1A)	839 A6.000	103	09/00 → 05/02		A/C(+)	MVB1760R6	6PK1760
						TB639	190x24
						TBK104	

LYBRA SW (839BX)

1.6		76	10/00 → 10/05		→06/01	MVB960R4	4PK960
						MVB938R5	5PK938
						TB471	158x25.4
						TBK089	
						MVB668R3	3PK668
1.6 16V (839BXA1A)	182 A4.000	76	07/99 →		→06/01	MVB960R4	4PK960
					→09/01	MVB938R5	5PK938
					→09/01	TB471	158x25.4
					→09/01	TBK089	
					→09/01	MVB668R3	3PK668
1.8 16V (839BXB1A, 839BXG1A)	839 A4.000, 839 A7.000	96	07/99 →		A/C(-), →08/02	MVB1080R6	6PK1080
					A/C(+), →08/02	MVB1980R6	6PK1980
					Eng. 839A9000, A/C(-), 09/02→10/05	MVB1065R6	6PK1065
					Eng. 839A9000, A/C(+), 09/02→10/05	MVB1960R6	6PK1960
					→10/05	TB468	168x24
1.9 JTD	937 A2.000	85	05/01 →		A/C(-), →10/05	MVB1035R6	6PK1035
					A/C(+), →10/05	MVB1833R6	6PK1833
					→10/05	TB639	190x24
					→10/05, → Eng Nr 4130907	TBK283	
					→10/05, Eng Nr 4130908→	TBK329	
1.9 JTD (839BXD1A)	AR 32302	77	07/99 → 09/00		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
					→ Eng Nr 4130907	TBK283	
					Eng Nr 4130908→	TBK329	
1.9 JTD (839BXI1A)	AR 37101	81	09/00 → 05/01		A/C(-)	MVB1035R6	6PK1035
					A/C(+)	MVB1833R6	6PK1833
						TB639	190x24
					→ Eng Nr 4130907	TBK283	
					Eng Nr 4130908→	TBK329	



kW



LANCIA

...LANCIA

...LYBRA SW (839BX)

2.0 20V (839BXC11, 839BXC1A)	182 B7.000	113	07/99 → 09/00			TB462 MVB1137R6	167x24 6PK1137
2.0 20V (839BXH1A)	185 A8.000	110	09/00 →		→10/05 →10/05	TB559 MVB1137R6	166x24 6PK1137
2.4 JTD	841C.000	110	05/02 →		A/C(+), →10/05 →10/05	MVB1760R6 TB639	6PK1760 190x24
2.4 JTD (839BXE1A)	839 A5.000, AR 32501	99	10/99 → 09/00		→10/05 A/C(+)	TBK104 MVB1760R6	190x24 6PK1760
2.4 JTD (839BXL1A)	839 A6.000	103	09/00 →		→10/05 →10/05 →10/05	TBK104 MVB1760R6 TB639	190x24 6PK1760 190x24

MUSA

1.3 D Multijet	188 A9.000	51	10/04 →		A/C(-) A/C(+)	MVB1180R6 MVB1306R6	6PK1180 6PK1306
	199 A3.000	66	09/06 →		A/C(-) A/C(+)	MVB1180R6 MVB1306R6	6PK1180 6PK1306
1.4	843 A 1.000	70	10/04 →		A/C(+)	MVB1148R5	5PK1148
	350 A1.000	57	09/05 →			TB637 TBK313	124x22
1.9 D Multijet	188 B2.000	74	10/04 →		→06/06 06/06→	MVB1200R6 MVB1180R6	6PK1200 6PK1180
						TB639 TBK283	190x24

PHEDRA (179)

2.0 (179AXA11)	RFN(EW10J4)	100	09/02 →		A/C(-), →02/06 A/C(+), →02/06	MVB1190R6 MVB1708R6	6PK1190 6PK1708
					→02/06 →02/06	TB683 TBK279	153x25.4
2.0 D Multijet	RHR	100	07/06 →			MVB1215R6 TB742	6PK1215 116x25
						TBK338	
2.0 JTD	RHM	79	07/03 →			MVB1740R6 TB720	6PK1740 114x25.4
	RHK	88	06/06 →			MVB1215R6 TB742	6PK1215 116x25
						TBK338	
2.0 JTD (179AXB1A)	RHW(DW10ATED4)	80	09/02 →		→06/07 →06/07	MVB1740R6 TB720	6PK1740 114x25.4
2.2 JTD (179AXC1A)	4HW(DW12ATED4)	94	09/02 →		→07/05 →07/05 →04/04	MVB1740R6 TB678 TBK303	6PK1740 146x25.4
					05/04 →07/05	TBK355	
3.0 V6	ES9 J4S	150	09/02 →		→02/06 →02/06	MVB1580R6 TB727	6PK1580 259x32

PRISMA (831AB0)

1.3		58	01/83 → 02/92		AUTO, 08/85 →07/89 MAN, →07/89	SVB10840 SVB10825	10x840 10x825
					→07/89	TB114	116x19
1.5	831 A1.000	63	01/83 → 04/86		A/C(-), AUTO, →07/85 AUTO, 08/85→	SVB10850 SVB10840	10x850 10x840
					MAN	SVB10825	10x825
						TB126	118x19
	138 C2.048, 831 B1.048	55	09/85 → 02/92		AUTO, →07/89 MAN, →07/89	SVB10840 SVB10825	10x840 10x825
					→07/89	TB126	118x19
	831 B1.000	59	08/86 → 02/92		AUTO, →07/89 MAN, →07/89	SVB10840 SVB10825	10x840 10x825
					→07/89	TB126	118x19



kW



...LANCIA

...PRISMA (831AB0)

1.6	831 A4.000	77	01/83 → 04/86	⚙️	→10/85	SVB10775	10x775
				⚙️	→10/85	SVB101050	10x1050
831 B6.000	73	08/86 → 02/92	⚙️	⚙️	→10/85, → Eng Nr 488950	TB112	144x19
				⚙️	→10/85, Eng Nr 488951→	TB200	143x19
				⚙️	MS, →07/90	SVB10825	10x825
				⚙️	A/C(-), MS, →07/90	SVB10940	10x940
1.6 i.e.	831 B7.000	80	05/86 → 12/89	⚙️	A/C(+), PS, →07/90	SVB10913	10x913
				⚙️	→07/90	TB249	138x18
				⚙️	A/C(+), Cat(+), →07/90	SVB10813	10x813
				⚙️	A/C(-), MS	SVB10940	10x940
1.6 i.e. Super	149 C2.000	66	05/87 → 12/89	⚙️	A/C(+), PS	SVB10913	10x913
				⚙️	A/C(-), Cat(-)	SVB10825	10x825
				⚙️	A/C(+), Cat(+)	SVB10813	10x813
				⚙️	MS	SVB10825	10x825
1.9 Diesel	831 D.000	48	01/83 → 02/92	⚙️	A/C(-), MS, 08/83→07/90	SVB10913	10x913
				⚙️	A/C(-), PS, 08/83→07/90	MVB850R5	5PK850
				⚙️	A/C(+), PS, 08/83→07/90	MVB1613R6	6PK1613
				⚙️	08/83→07/90	TB351	126x25.4
				⚙️	08/83→07/90	TB352	57x19
				⚙️	08/83→07/90	SVB10740	10x740
1.9 Turbo Diesel	831 D1.000	59	05/85 → 12/89	⚙️	A/C(-), MS	MVB850R5	5PK850
				⚙️	A/C(+), PS	SVB10913	10x913
				⚙️		MVB1613R6	6PK1613
				⚙️		TB351	126x25.4
				⚙️		TB352	57x19
				⚙️		SVB10740	10x740
2.0 i.e. 4WD	831 B4.000	85	04/86 → 12/89	⚙️	11/86→07/89	MVB1345R5	5PK1345
				⚙️	11/86→07/89	TB303	142x18

THEMA (834)

8.32 (834F)	F 105 L	158	09/87 → 05/89	⚙️		MVB1245R4	4PK1245
				⚙️		TB578	96x25.4
				⚙️		MVB850R3	3PK850
8.32 (834FS)	F 105 L.046	151	10/87 → 05/92	⚙️		MVB1245R4	4PK1245
				⚙️		TB578	96x25.4
				⚙️		MVB850R3	3PK850
2000 16V (834FA)	834 F1.000	112	08/92 → 12/93	⚙️		SVB13875	13x875
				⚙️		MVB1100R4	4PK1100
				⚙️		MVB1100R5	5PK1100
				⚙️		TB474	173x18
				⚙️, ⚙️		TB579	97x15
				⚙️	A/C(-)	SVB13850	13x850
				⚙️	A/C(+)	SVB13750	13x750
				⚙️, ⚙️	A/C(-)	SVB13800	13x800
2000 16V Turbo (834AC)	834 C1.000	133	12/88 → 06/90	⚙️		SVB13875	13x875
				⚙️		MVB1100R4	4PK1100
				⚙️		MVB1100R5	5PK1100
				⚙️	→10/89	TB394	145x18
				⚙️	11/89→	TB474	173x18
				⚙️, ⚙️		TB579	97x15
				⚙️	A/C(-)	SVB13850	13x850
				⚙️	A/C(+)	SVB13750	13x750
	A/C(-)	SVB13800	13x800				



kW



LANCIA

...LANCIA

...THEMA (834)

2000 16V Turbo (834GC, 834FC)	834 F2.000	148	10/92 → 07/94	 	→12/92 A/C(-) A/C(+) A/C(-)	SVB13875 MVB1100R4 MVB1100R5 TB474 TB579 SVB13850 SVB13750 SVB13800	13x875 4PK1100 5PK1100 173x18 97x15 13x850 13x750 13x800
2000 i.e (834AB)	834 B1.000	86	09/88 → 05/92	 	→10/89 A/C(-), →10/89 →10/89 01/89→12/90 A/C(+), →10/89 A/C(-), →10/89 A/C(+), →10/89	SVB10840 SVB101090 TB303 TB579 SVB10750 SVB10825 SVB10775	10x840 10x1090 142x18 97x15 10x750 10x825 10x775
2000 i.e.	834 B.048	83	03/86 → 09/88	 	A/C(+) A/C(+) A/C(-) A/C(+)	SVB10840 SVB101090 TB303 TB579 SVB10750 SVB10825 SVB10775	10x840 10x1090 142x18 97x15 10x750 10x825 10x775
2000 i.e. (834B)	834 B.000	88	11/84 → 09/88	 	A/C(-) A/C(-), →09/85 A/C(+) A/C(-) A/C(+)	SVB10840 SVB101090 SVB101125 TB303 TB579 SVB10750 SVB10825 SVB10775	10x840 10x1090 10x1125 142x18 97x15 10x750 10x825 10x775
2000 i.e. (834BV)	834 B.146	85	09/87 → 05/92	 	A/C(-) A/C(+) A/C(-) A/C(+)	SVB13875 MVB1100R4 TB303 TBK118 TB579 SVB13850 SVB13750	13x875 4PK1100 142x18 97x15 13x850 13x750
2000 i.e. 16V (834AA)	834 B2.000	108	05/88 → 08/92	 	04/89→ 04/89→ 04/89→ 04/89→ A/C(-), 04/89→ A/C(+), 04/89→ A/C(-), 04/89→	SVB13875 MVB1100R4 TB303 TBK118 TB579 SVB13850 SVB13750 SVB13800	13x875 4PK1100 142x18 97x15 13x850 13x750 13x800
2000 i.e. 16V (834AI)	834 B2.246	104	02/89 → 05/92	 	→10/89 11/89→ A/C(-) A/C(+) A/C(-)	SVB13875 MVB1100R4 MVB1100R5 TB394 TB474 TB579 SVB13850 SVB13750 SVB13800	13x875 4PK1100 5PK1100 145x18 173x18 97x15 13x850 13x750 13x800
2000 i.e. 16V Turbo (834AL)	834 C1.246	130	04/89 → 05/92	 	A/C(-) A/C(+) A/C(-)	SVB13875 MVB1100R4 TB303 TBK118 TB579 SVB13850 SVB13750 SVB13800	13x875 4PK1100 142x18 97x15 13x850 13x750 13x800





kW



...LANCIA

...THEMA (834)

2000 i.e. Turbo (834C)	834 C.000	122	11/84 → 12/87	 		SVB10840 10x840 SVB101090 10x1090 TB303 142x18 TB579 97x15 SVB10750 10x750 SVB10825 10x825 SVB10775 10x775
2000 i.e. Turbo (834CV)	834 C.146	110	07/86 → 05/90	 		SVB13875 13x875 MVB1100R4 4PK1100 TB303 142x18 TBK118 TB579 97x15 SVB13850 13x850 SVB13750 13x750
2500 Turbo D (834D)	8144.91	74	11/84 → 09/88	 	→12/86 12/86→, → Eng Nr 752412 12/86→, Eng Nr 752413→	SVB10775 10x775 SVB10813 10x813 SVB13825 13x825 SVB10635 10x635 TB348 99x19 SVB10710 10x710 SVB10925 10x925 SVB13925 13x925
2500 Turbo DS (834AE)	8144.97	85	06/88 → 05/92	 	→11/86 11/86→	SVB13825 13x825 SVB10635 10x635 TB348 99x19 SVB13925 13x925
2500 Turbo DS (834FE, 834LE)	8144.97 Y	85	05/92 → 07/94	 		SVB13825 13x825 MVB887R5 5PK887 TB448 95x19
2850 V6 i.e. (834AD, 834CD, 834BD)	834 E.146	108	06/88 → 05/92	 	A/C(-), MAN A/C(+) electronic susp control (+)	MVB1220R7 7PK1220 MVB1715R7 7PK1715 MVB1675R7 7PK1675 SVB10690 10x690
2850 V6 i.e. (834F)	834 E.000	110	11/84 → 09/88	 	→12/86 →12/86 A/C(-), MAN A/C(+), MAN, 01/87→ 01/87→	SVB131400 13x1400 SVB131225 13x1225 MVB1220R7 7PK1220 MVB1715R7 7PK1715 MVB1675R7 7PK1675 SVB10690 10x690
3000 V6 (834GD, 834FD)	834 F.000	126	08/92 → 07/94	 	A/C(+) electronic susp control (-) electronic susp control (+)	MVB1240R7 7PK1240 TB383 134x25.4 MVB763R4 4PK763 MVB790R4 4PK790

THEMA SW (834)

2000 16V (834FA)	834 F1.000	112	05/92 → 07/94	 		SVB13875 13x875 MVB1100R4 4PK1100 MVB1100R5 5PK1100 TB474 173x18 TB579 97x15 SVB13850 13x850 SVB13750 13x750 SVB13800 13x800
2000 i.e. 16V (834AA)	834 B2.000	108	05/89 → 08/92	 	A/C(-) A/C(+) A/C(-) A/C(-) A/C(+) A/C(-)	SVB13875 13x875 MVB1100R4 4PK1100 TB303 142x18 TBK118 TB579 97x15 SVB13850 13x850 SVB13750 13x750 SVB13800 13x800



kW



...LANCIA

...THEMA SW (834)

LANCIA

2000 i.e. 16V (834AI)	834 B2.246	104	02/89 → 05/92	 	→10/89 11/89→	SVB13875 13x875 MVB1100R4 4PK1100 MVB1100R5 5PK1100 TB394 145x18 TB474 173x18 TB579 97x15 SVB13850 13x850 SVB13750 13x750 SVB13800 13x800
2000 i.e. 16V Turbo (834AC)	834 C1.000	133	12/88 → 06/90	 	→10/89 11/89→	SVB13875 13x875 MVB1100R4 4PK1100 MVB1100R5 5PK1100 TB394 145x18 TB474 173x18 TB579 97x15 SVB13850 13x850 SVB13750 13x750 SVB13800 13x800
2000 i.e. 16V Turbo (834AL)	834 C1.246	130	04/89 → 03/93	 	→09/92 →09/92 →09/92 →09/92	SVB13875 13x875 MVB1100R4 4PK1100 TB303 142x18 TBK118 TB579 97x15 SVB13850 13x850 SVB13750 13x750 SVB13800 13x800
2000 Turbo	834 C.146	110	01/89 → 03/92	 	→10/89 11/89→	SVB13875 13x875 MVB1100R4 4PK1100 MVB1100R5 5PK1100 TB303 142x18 TB394 145x18 TB474 173x18 TBK118 TB579 97x15 SVB13850 13x850 SVB13750 13x750 SVB13800 13x800
2000 Turbo 16V (834GC, 834FC)	834 F2.000	148	11/92 → 07/94	 	A/C(-) A/C(+) A/C(-)	SVB13875 13x875 MVB1100R4 4PK1100 MVB1100R5 5PK1100 TB474 173x18 TB579 97x15 SVB13850 13x850 SVB13750 13x750 SVB13800 13x800
2500 Turbo DS (834AE)	8144.97	85	06/88 → 05/92	 		SVB13825 13x825 SVB10635 10x635 TB348 99x19 SVB13925 13x925
2500 Turbo DS (834AM)	8144.97S	77	05/88 → 07/92	 		SVB13825 13x825 SVB10635 10x635 TB348 99x19 SVB13925 13x925
2500 Turbo DS (834D)	8144.91	74	03/87 → 09/90	 	→ Eng Nr 752412 Eng Nr 752413→	SVB10813 10x813 SVB13825 13x825 SVB10635 10x635 TB348 99x19 SVB10710 10x710 SVB13925 13x925
2500 Turbo DS (834FE, 834LE)	8144.97 Y	85	09/92 → 07/94	 		SVB13825 13x825 MVB887R5 5PK887 TB448 95x19



kW



...LANCIA

...THEMA SW (834)

3000 V6 (834GD, 834FD)	834 F.000	126	09/92 → 07/94		A/C(+)	MVB1240R7	7PK1240
						TB383	134x25.4
					electronic susp control (-)	MVB763R4	4PK763
					electronic susp control (+)	MVB790R4	4PK790

THESIS (841AX)

2.0 Turbo (841AXA1B03)	841E.000	136	07/02 →			MVB1690R6	6PK1690
						TB559	166x24
2.4 (841AXB1B00)	841D.000	125	07/02 →		→08/06	MVB1690R6	6PK1690
					→08/06	TB468	168x24
2.4 D Multijet	841 P.000	136	04/06 →			MVB1740R6	6PK1740
						TB790	199x24
2.4 JTD	841 G.000	129	05/03 →			MVB1740R6	6PK1740
						TB725	198x24
2.4 JTD (841AXD1B02)	841C.000	110	07/02 →		→08/05	MVB1740R6	6PK1740
					→08/05	TB639	190x24
					→08/05	TBK104	
3.0 V6 (841AXC1101)	841A.000	158	07/02 →		→07/05	MVB1995R6	6PK1995
					→07/05	TB532	185x28
3.2 V6		169	05/03 →			MVB1995R6	6PK1995
						TB532	185x28

Y (840A)

1.1 (840AE)	176 B2.000	40	11/95 → 09/03		→07/00	MVB835R4	4PK835
					A/C(-), →07/00	MVB673R4	4PK673
					A/C(+), →07/00	MVB700R4	4PK700
					→07/00, → Eng Nr 9042883	TB129	104x15
					→07/00, Eng Nr 9042884→	TB676	125x15
					→07/00, → Eng Nr 9042883	TBK006	
					→07/00, Eng Nr 9042884→	TBK314	
					→07/00	MVB915R3	3PK915
1.2 (840AA, 840AF1A)	188 A4.000, 840 A3.000	44	03/96 → 09/03		Eng. 840A3000, →12/00	MVB835R4	4PK835
					Eng. 840A3000, →12/00	MVB855R4	4PK855
					A/C(-), 08/00→,	MVB663R4	4PK663
					Eng Nr 0714686→		
					A/C(+), 01/02→	MVB1575R5	5PK1575
					A/C(+), 08/00→01/02	MVB1590R5	5PK1590
					Eng. 188A4000, A/C(-),	MVB673R4	4PK673
					→ Eng Nr 0714685		
					Eng. 840A3000, A/C(+), →12/00	MVB700R4	4PK700
					Eng. 840A3000, A/C(+), →12/00	MVB706R4	4PK706
						TB649	129x15
					→12/00, → Eng Nr 9042883	TB660	108x15
					Eng. 188A4000	TBK277	
					Eng. 840A3000, →12/00,	TBK085	
					→ Eng Nr 9042883		
					Eng. 188A4000	MVB915R3	3PK915
1.2 16V (840AD)	176 B9.000	63	04/97 → 09/03		→07/00, → Eng Nr 3200923	MVB855R4	4PK855
					→07/00, Eng Nr 3200924→	MVB835R4	4PK835
					A/C(-), →07/00	MVB673R4	4PK673
					A/C(+), →07/00	MVB700R4	4PK700
					A/C(+), →07/00	MVB706R4	4PK706
					→07/00	TB637	124x22
					→07/00	TBK313	
					→07/00	MVB915R3	3PK915
1.2 16V (840AG1A)	188 A5.000	59	10/00 → 09/03		A/C(-)	MVB673R4	4PK673
					A/C(+), → Eng Nr 616579	MVB1590R5	5PK1590
					A/C(+), Eng Nr 616580→	MVB1575R5	5PK1575
						TB637	124x22
						TBK313	
						MVB915R3	3PK915



kW



LANCIA

...LANCIA

...Y (840A)

1.4 12V (840AB)	840 A2.000	59	10/96 → 09/03	 	A/C(-), →02/98 A/C(+), →02/98 →02/98 →02/98	MVB1045R6 MVB1842R6 TB470 TBK300	6PK1045 6PK1842 134x18
1.4 12V (840AC)	840 A4.000	55	03/96 → 09/03	 	A/C(-), →02/98 A/C(+), →02/98 →02/98 →02/98	MVB1045R6 MVB1842R6 TB470 TBK300	6PK1045 6PK1842 134x18

Y10 (156)

1.0 Fire		37	03/85 → 02/90	 		SVB10675 TB129 TBK006	10x675 104x15
1.0 Fire (156AA)	156 A 2.000	33	03/85 → 06/89	 		SVB10675 TB129 TBK006	10x675 104x15
1.0 Fire (156AE) CAT	156 A2.246	33	10/87 → 02/92	 		MVB675R3 TB129 TBK006	3PK675 104x15
1.0 Fire (156B, 156AD)	156 A 2.100	32	06/85 → 06/91	 	Carb	SVB10675 TB129 TBK006	10x675 104x15
1.0 Fire (156C)		41	03/85 → 07/89	 	→09/87 →09/87	SVB101000 TB121	10x1000 117x15
1.0 Fire 4WD	156 A 2.100	32	12/86 → 02/89	 	Carb Inj	SVB10675 MVB675R3 TB129 TBK006	10x675 3PK675 104x15
		37	12/87 → 02/90	 		SVB10675 TB129 TBK006	10x675 104x15
1.0 Fire 4WD (156AE)	156 A2.246	33	12/87 → 02/92	 	Carb Inj	SVB10675 MVB675R3 TB129 TBK006	10x675 3PK675 104x15
1.0 Turbo (156D)	156 A 1.000	62	03/85 → 02/89	 		SVB101000 TB248	10x1000 118x15
1.1 Avenue (156AG)	176 B2.000	40	01/95 → 12/95	 	→08/95, → Eng Nr 5088941 →08/95, Eng Nr 5088941→ A/C(-), →08/95 A/C(+), →08/95 →08/95 →08/95	MVB810R4 MVB825R4 MVB673R4 MVB683R3 TB129 TBK006	4PK810 4PK825 4PK673 3PK683 104x15
1.1 Avenue 4WD (156AG)	176 B2.000	40	01/95 → 12/95	 	→08/95, → Eng Nr 5088941 →08/95, Eng Nr 5088941→ A/C(-), →08/95 A/C(+), →08/95 →08/95 →08/95	MVB810R4 MVB825R4 MVB673R4 MVB683R3 TB129 TBK006	4PK810 4PK825 4PK673 3PK683 104x15
1.1 i.e (156AC)	156 C.000	42	08/89 → 06/92	 	→ Eng Nr 5088941 Eng Nr 5088941→ A/C(-), 01/92→ A/C(+), 01/92→ V-belt pulley (+), →12/91 V-ribbed belt pulley (+), →12/91	MVB810R4 MVB825R4 MVB673R4 MVB683R3 SVB10675 MVB675R3	4PK810 4PK825 4PK673 3PK683 10x675 3PK675
				 		TB129 TBK006	104x15



kW



...LANCIA

...Y10 (156)

1.1 i.e 4WD (156AC)	156 C.000	42	08/89 → 06/92	 	→ Eng Nr 5088941 Eng Nr 5088941→ A/C(-), 01/92→ A/C(+), 01/92→ V-belt pulley (+), →12/91 V-ribbed belt pulley (+), →12/91	MVB810R4 MVB825R4 MVB673R4 MVB683R3 SVB10675 MVB675R3 TB129 TBK006	4PK810 4PK825 4PK673 3PK683 10x675 3PK675 104x15
1.1 i.e. Fire (156AG)	156 C.046	37	07/89 → 09/95	 	→ Eng Nr 5088941 Eng Nr 5088941→ A/C(-), 01/92→ A/C(+), 01/92→ V-belt pulley (+), →12/91 V-ribbed belt pulley (+), →12/91	MVB810R4 MVB825R4 MVB673R4 MVB683R3 SVB10675 MVB675R3 TB129 TBK006	4PK810 4PK825 4PK673 3PK683 10x675 3PK675 104x15
1.1 i.e. Fire 4WD (156AG)	156 C.046	37	09/92 → 12/95	 	→08/95, → Eng Nr 5088941 →08/95, Eng Nr 5088941→ A/C(-), →08/95 A/C(+), →08/95 →08/95 →08/95	MVB810R4 MVB825R4 MVB673R4 MVB683R3 TB129 TBK006	4PK810 4PK825 4PK673 3PK683 104x15 104x15
1.3 i.e. Fire (156AB)	156 B.000	56	11/87 → 05/93	 		SVB101000 TB247	10x1000 120x15
1.3 i.e. Fire (156AF)	146 A 5.046, 156 B.000	53	02/89 → 12/95	 	→08/95 →08/95	SVB101000 TB247	10x1000 120x15

YPSILON

1.2	188 A4.000	44	10/03 →	 	A/C(-) A/C(+) →08/04, → Eng Nr 2533528 08/04→, Eng Nr 2533529→ →08/04, → Eng Nr 2533528	MVB663R4 MVB1148R5 TB649 TB787 TBK277	4PK663 5PK1148 129x15 129x22
	188 A5.000	59	10/03 →	 	A/C(-) A/C(+) →08/04, → Eng Nr 2533528	MVB673R4 MVB1148R5 TB637 TBK313	4PK673 5PK1148 124x22
1.3 D Multijet	199 A2.000	55	09/06 →	 	A/C(-) A/C(+) →08/04, → Eng Nr 2533528	MVB1180R6 MVB1306R6	6PK1180 6PK1306
	199 A3.000	66	09/06 →			MVB1306R6	6PK1306
		77	05/07 →			MVB1306R6	6PK1306
1.4	843 A 1.000	70	10/03 →	 	A/C(-), →09/06 A/C(+), →09/06 →09/06 →09/06	MVB673R4 MVB1148R5 TB637 TBK313	4PK673 5PK1148 124x22

ZETA (220)

2.0 16V (220AL5)	RFV	97	05/98 → 07/00	 	A/C(-), 02/99→ A/C(+), 02/99→ 02/99→	MVB1165R6 MVB1600R6 TB479	6PK1165 6PK1600 136x25.4
2.0 16V (220AQ5)	RFN	100	07/00 → 09/02	 	A/C(-) A/C(+) →07/01	MVB1190R6 MVB1708R6 TB683 TBK279	6PK1190 6PK1708 153x25.4
2.0 JTD	RHZ	80	04/00 → 09/02	 	A/C(-), →07/01 A/C(+), →07/01 A/C(+), →07/01 →07/01 →07/01	MVB1469R6 MVB1740R6 MVB1755R6 TB632 TBK274	6PK1469 6PK1740 6PK1755 141x25.4



kw



LANCIA

...LANCIA

...ZETA (220)

2.0 JTD (220AN5)	RHW	80	09/99 → 09/02	⊗	A/C(-), 08/01→	MVB1469R6	6PK1469
				⊗	A/C(+), 08/01→	MVB1740R6	6PK1740
				⊗	A/C(+), 08/01→	MVB1755R6	6PK1755
					08/01→	TB720	114x25.4
2.0 Turbo (220AD5, 220CD5)	RGX	108	05/95 → 09/02	⊗	A/C(-), 02/97→12/99	MVB1165R6	6PK1165
				⊗	A/C(-), Alt. 70A, →01/97	MVB1065R6	6PK1065
				⊗	A/C(-), Alt. 80,9A, →01/97	MVB1080R6	6PK1080
				⊗	A/C(+), →01/97	MVB1660R6	6PK1660
				⊗	A/C(+), 02/97→12/99	MVB1600R6	6PK1600
					→12/99	TB419	114x17
				KIT	→12/99	TBK010	
2.1 TD (220AJ5)	P 8 C	80	05/96 → 09/99	⊗	A/C(-)	MVB1105R6	6PK1105
				⊗	A/C(+)	MVB1740R6	6PK1740
						TB320	149x25.4
				KIT		TBK035	

LAND ROVER

88/109

2.3 (LR 88 OL, LR 109 OL)	51	09/63 → 12/86	⊗	11/71→10/85	SVB101050	10x1050
			⊗	A/C(-), 11/71→10/85	SVB13750	13x750
			⊗	A/C(+), 11/71→10/85	SVB13800	13x800
				11/71→10/85	SVB10913	10x913
2.3 D (LR 88 DL, LR 109 DL)	46	09/63 → 12/86	⊗	→10/85	SVB101025	10x1025
			⊗	→10/85	SVB13750	13x750
3.5	68	01/80 → 12/83	⊗		SVB13850	13x850
			⊗	A/C(-)	SVB101225	10x1225
			⊗	A/C(+)	SVB10775	10x775
			⊗	A/C(+)	SVB131000	13x1000
			⊗	A/C(+), MS	SVB13925	13x925

88/109 Hardtop

2.3 (LR 88 OP, LR 109 OP)	51	09/63 → 12/86	⊗	11/71→10/85	SVB101050	10x1050
			⊗	A/C(-), 11/71→10/85	SVB13750	13x750
			⊗	A/C(+), 11/71→10/85	SVB13800	13x800
				11/71→10/85	SVB10913	10x913
2.3 D (LR 88 DP, LR 109 DP)	46	09/63 → 12/86	⊗	→10/85	SVB101025	10x1025
			⊗	→10/85	SVB13750	13x750

90/110 (DHMC)

2.5	62	09/85 → 07/90	⊗	A/C(-)	SVB101025	10x1025
			⊗	A/C(+)	SVB101050	10x1050
			⊗	For OE ERC4272	SVB13800	13x800
			⊗	For OE ETC5146	SVB13750	13x750
			⊗	For OE ETC5815	SVB13725	13x725
2.5 TD	63	09/86 → 07/90	⊗		SVB101025	10x1025
					TB363	128x25.4
			⊗		SVB13725	13x725
3.5 V8	100	09/83 → 07/90	⊗	06/84→	SVB13850	13x850
			⊗	A/C(-), 01/87→	SVB101215	10x1215
			⊗	A/C(-), 06/84→12/86	SVB101225	10x1225
			⊗	A/C(+), 06/84→	SVB10775	10x775
			⊗	A/C(+), 06/84→	SVB131000	13x1000
			⊗	A/C(+), MS, 06/84→	SVB13925	13x925



kW



...LAND ROVER

DEFENDER (LD)

2.5 90 TDI	11 L, 16 L, 23 L	83	09/90 →	 	Eng. 16L, 01/95 → 03/98 01/95 → 03/98, → Eng Nr 16L25164 Eng. 11L, → 12/94 Eng. 16L, 01/95 → 03/98, Eng Nr 16L25165 → → 12/94 01/95 → 03/98 Eng. 11L, → 12/94	MVB1325R4 MVB1605R7 SVB101025 MVB1580R7 TB365 TB478 SVB13725	4PK1325 7PK1605 10x1025 7PK1580 109x30 118x30 13x725
2.5 Td5 4WD		90	06/98 →	 	A/C(-), → 09/06 A/C(+), → 09/06	MVB1715R7 MVB1800R7	7PK1715 7PK1800

DEFENDER Pickup (LD_)

2.5 Td5 4WD		90	06/98 →	 	A/C(-), → 09/06 A/C(+), → 09/06	MVB1715R7 MVB1800R7	7PK1715 7PK1800
-------------	--	----	---------	------	------------------------------------	--------------------------------------	--------------------

DEFENDER Station Wagon (LD)

2.5 90,110 TDI	11 L, 16 L, 23 L	83	09/90 → 12/98	 	Eng. 16L, 01/95 → 03/98 01/95 → 03/98, → Eng Nr 16L25164 Eng. 11L, → 12/94 Eng. 16L, 01/95 → 03/98, Eng Nr 16L25165 → → 12/94 01/95 → 03/98 Eng. 11L, → 12/94	MVB1325R4 MVB1605R7 SVB101025 MVB1580R7 TB365 TB478 SVB13725	4PK1325 7PK1605 10x1025 7PK1580 109x30 118x30 13x725
2.5 Td5 4WD		90	06/98 →	 	A/C(-), → 09/06 A/C(+), → 09/06	MVB1715R7 MVB1800R7	7PK1715 7PK1800

DISCOVERY I

2.0 16 V		99	09/93 → 06/94	 	A/C(-) A/C(+) Eng. 12L Eng. 12L	MVB1369R6 MVB1755R6 TB367 SVB131350 SVB10610 TB365 SVB131025	6PK1369 6PK1755 132x23 13x1350 10x610 109x30 13x1025
2.5 TDI	12 L, 21 L	83	09/89 → 06/94	 	Eng. 12L Eng. 12L	SVB131000 SVB10675 SVB13925	13x1000 10x675 13x925
3.5 (SALLJG)	22 D	113	09/89 → 06/94	 		MVB1870R7 MVB1855R7 MVB2265R7	7PK1870 7PK1855 7PK2265
3.9 V8	35 D, 36 D	134	09/93 → 06/94	 	A/C(-), → Eng Nr 36D50529, 38D32139 A/C(-), Eng Nr 36D50530, 38D32140 → A/C(+), → Eng Nr 36D50529, 38D32139	MVB1870R7 MVB1855R7 MVB2265R7	7PK1870 7PK1855 7PK2265

DISCOVERY II (LJ, LT)

2.0 16 V		99	06/94 →	 	A/C(-), → 12/98 A/C(+), → 12/98 → 12/98	MVB1369R6 MVB1755R6 TB367	6PK1369 6PK1755 132x23
2.5 Td5		102	01/99 →	 	A/C(-), RHA (-), → 06/04 A/C(-), RHA (+), → 06/04 A/C(+), RHA (-), → 06/04 A/C(+), RHA (+), → 06/04	MVB1715R7 MVB1813R7 MVB1800R7 MVB1889R7	7PK1715 7PK1813 7PK1800 7PK1889
2.5 TDI	19 L, 22 L	90	10/95 →	 	→ 12/98 → 12/98, → Ch. MA163103 → 12/98, Ch. MA163104 → → 12/98	MVB1325R4 MVB1605R7 MVB1580R7 TB478	4PK1325 7PK1605 7PK1580 118x30
	12 L, 17 L, 19 L, 21 L	83	08/96 →	 	→ 12/98 → 12/98, → Ch. MA163103 → 12/98, Ch. MA163104 → → 12/98	MVB1325R4 MVB1605R7 MVB1580R7 TB478	4PK1325 7PK1605 7PK1580 118x30



kW



LAND ROVER

...LAND ROVER

...DISCOVERY II (LJ, LT)

3.9 V8	35 D, 36 D	134	06/94 → 11/98		A/C(-), → Eng Nr 36D50529, 38D32139	MVB1870R7	7PK1870
					A/C(-), Eng Nr 36D50530, 38D32140→	MVB1855R7	7PK1855
					A/C(+), → Eng Nr 36D50529, 38D32139	MVB2265R7	7PK2265
4.0 V8		136	11/98 →		A/C(-), RHA (-), →06/04	MVB1775R7	7PK1775
					A/C(+), RHA (+), →06/04	MVB2710R7	7PK2710

DISCOVERY III (TAA)

2.7 TD		140	10/04 →			TB814	195x29
						TB815	85x20

FREELANDER (LN)

1.8 16V	18 K4F	86	11/00 →		A/C(-), →10/06	MVB735R5	5PK735
					A/C(+), →10/06, → Ch. YA999999	MVB1188R5	5PK1188
					A/C(+), →10/06, Ch. 1A000001→	MVB1200R5	5PK1200
					Auto Tensioner, →10/06	TB640	261x26
					Manu Tensioner, →10/06	TB534	143x26
					Auto Tensioner, →10/06	TBK347	
					→10/06	MVB753R3	3PK753
1.8 i 16V		88	02/98 → 11/00		A/C(-)	MVB735R5	5PK735
					A/C(+), → Ch. YA999999	MVB1188R5	5PK1188
					A/C(+), Ch. 1A000001→	MVB1200R5	5PK1200
					Auto Tensioner	TB640	261x26
					Manu Tensioner	TB534	143x26
					Auto Tensioner	TBK347	
						MVB753R3	3PK753
2.0 DI		72	02/98 → 11/00		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1460R6	6PK1460
					Eng Nr 17N000187→	TB651	112x30
						TB650	78x24
2.0 Td4		82	11/00 →		→10/06, → Ch. 1A999999	MVB869R5	5PK869
					→10/06, Ch. 2A000001→	MVB887R5	5PK887
					→10/06	MVB2025R5	5PK2025
		80	11/01 →		→10/06, → Ch. 1A999999	MVB869R5	5PK869
					→10/06, Ch. 2A000001→	MVB887R5	5PK887
					→10/06	MVB2025R5	5PK2025
2.5 V6	25 K4F	130	11/00 →		A/C(+), →10/06	MVB1560R6	6PK1560
					→10/06	TB812	176x28
					→10/06, 2 belts	TB811	58x22

FREELANDER Soft Top

1.8 i 16V		88	02/98 →		A/C(-), →10/06	MVB735R5	5PK735
					A/C(+), →10/06, → Ch. YA999999	MVB1188R5	5PK1188
					A/C(+), →10/06, Ch. 1A000001→	MVB1200R5	5PK1200
					Auto Tensioner, →10/06	TB640	261x26
					Manu Tensioner, →10/06	TB534	143x26
					Auto Tensioner, →10/06	TBK347	
					→10/06	MVB753R3	3PK753
2.0 DI		72	02/98 →		A/C(-), →09/00	MVB1180R6	6PK1180
					A/C(+), →09/00	MVB1460R6	6PK1460
					→09/00, Eng Nr 17N000187→	TB651	112x30
					→09/00	TB650	78x24



kW



...LAND ROVER

RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN)

2.4 Diesel	11 A	78	04/86 → 12/90	☼		SVB10675	10x675	
				⊗	A/C(-), LHD	SVB131175	13x1175	
				⊗	A/C(-), RHA	SVB131200	13x1200	
				⊗	A/C(+)	SVB131000	13x1000	
2.5 TD 4x4		89	10/89 → 04/94	☼		SVB131350	13x1350	
				⊗	LHD	MVB1141R5	5PK1141	
				⊗	RHA(+)	MVB1200R5	5PK1200	
				⊗		MVB835R4	4PK835	
3.5	31 D	107	01/87 → 09/90	☼		SVB131000	13x1000	
				⊗		SVB10675	10x675	
				JP	MS	SVB13925	13x925	
		97	07/70 → 08/81	☼		SVB131000	13x1000	
				☼		SVB13850	13x850	
				⊗	A/C(-)	SVB101225	10x1225	
3.5 Vogue	11 D	93	08/81 → 09/90	☼		SVB131000	13x1000	
				☼	→09/85	SVB13850	13x850	
				⊗	A/C(-), →09/85	SVB101225	10x1225	
		24 D, 25 D	120	10/85 → 09/90	⊗	MS	SVB13925	13x925
					☼		SVB10675	10x675
					JP		SVB131000	13x1000
3.9 CAT	37 D, 38 D	127	11/88 → 07/94	☼	PS, 10/89 →	MVB2265R7	7PK2265	
				⊗	V-belt pulley (+),	SVB10675	10x675	
				⊗	10/89 → 04/92			
		42 D	149	09/92 → 07/94	⊗	V-ribbed belt pulley (+),	MVB1260R4	4PK1260
					☼	05/92 →		
					☼	10/89 →	SVB131000	13x1000
3.9 Vogue SEI	35 D, 36 D	134	11/88 → 07/94	⊗	10/89 →	SVB13925	13x925	
				☼	PS, 10/89 →	MVB2265R7	7PK2265	
				⊗	V-belt pulley (+),	SVB10675	10x675	
		40 D	149	09/92 → 07/94	⊗	10/89 → 04/92		
					⊗	V-ribbed belt pulley (+),	MVB1260R4	4PK1260
					☼	05/92 →		
4.3 Vogue LSE	40 D	149	09/92 → 07/94	☼	10/89 →	SVB131000	13x1000	
				☼	→ Ch. LA647644	MVB2265R7	7PK2265	
				⊗	Ch. MA647645 →	MVB1260R4	4PK1260	
		4.0	136	06/98 → 03/02	☼		SVB10675	10x675
					☼	→ Ch. LA647644	SVB13925	13x925
					⊗			

RANGE ROVER II (LP)

2.5 D	14 L	83	08/94 → 03/02	☼		MVB835R4	4PK835
				☼		MVB855R4	4PK855
				⊗		MVB1815R5	5PK1815
3.9	25 6T (BMW)	100	07/94 → 03/02	☼		MVB835R4	4PK835
				☼		MVB855R4	4PK855
				⊗		MVB1815R5	5PK1815
				⊗	A/C(-), → Ch. WA410481	MVB1870R7	7PK1870
4.0	42 D	140	07/94 → 03/02	⊗	A/C(+), Ch. XA410482 →	MVB2315R7	7PK2315
				⊗	A/C(+), Ch. XA410482 →	MVB2337R7	7PK2337
				⊗	A/C(-), → Ch. WA410481	MVB1870R7	7PK1870
				⊗	A/C(+), Ch. XA410482 →	MVB2315R7	7PK2315
4.0	42 D	140	07/94 → 03/02	⊗	A/C(+), Ch. XA410482 →	MVB2337R7	7PK2337
				⊗	A/C(+), Ch. XA410482 →	MVB2337R7	7PK2337



kW



LAND ROVER

...LAND ROVER

...RANGE ROVER II (LP)

4.6	46 D	165	07/94 → 03/02		A/C(-), → Ch. WA410481	MVB1870R7	7PK1870
					A/C(+), Ch. XA410482→	MVB2315R7	7PK2315
					A/C(+), Ch. XA410482→	MVB2337R7	7PK2337
		160	06/98 → 03/02		A/C(-), → Ch. WA410481	MVB1870R7	7PK1870
					A/C(+), Ch. XA410482→	MVB2315R7	7PK2315
					A/C(+), Ch. XA410482→	MVB2337R7	7PK2337

RANGE ROVER III (LM)

3.0 TD 6		130	03/02 →			MVB813R5	5PK813
4.2		291	05/05 →			MVB2271R7	7PK2271
4.4		210	03/02 →		→03/05	MVB1000R5	5PK1000
					→03/05	MVB1635R7	7PK1635
		225	05/05 →			MVB1000R5	5PK1000
						MVB1635R7	7PK1635

RANGE ROVER SPORT

2.7 TDVM		140	02/05 →			TB814	195x29
						TB815	85x20

LDV

400 Box

2.5 TD		71	11/95 →		→03/96	SVB131175	13x1175
					MS, →03/96	SVB13890	13x890
					PS, →03/96	SVB131025	13x1025

400 Bus

2.5 TD		71	11/95 →		→03/96	SVB131175	13x1175
					MS, →03/96	SVB13890	13x890
					PS, →03/96	SVB131025	13x1025

400 Flatbed / Chassis

2.5 TD		71	11/95 →		→03/96	SVB131175	13x1175
					MS, →03/96	SVB13890	13x890
					PS, →03/96	SVB131025	13x1025

CONVOY Box

2.5 DI	EN 55	56	10/98 →			TB629	130x28
						TBK334	
2.5 TDI	ET 70	74	10/98 →			TB629	130x28
						TBK334	

CONVOY Flatbed / Chassis

2.5 DI	EN 55	56	10/98 →			TB629	130x28
						TBK334	
2.5 TDI	ET 70	74	10/98 →			TB629	130x28
						TBK334	

CUB

2.3 D		53	08/98 →			TB487	145x30
-------	--	----	---------	--	--	--------------	--------

MAXUS Box

2.5 CDi		70	02/05 →		10/05→07/07	TB719	220x28
2.5 DTiC		88	10/05 → 07/07			TB719	220x28

MAXUS Bus

2.5 CDi		70	02/05 →		10/05→07/07	TB719	220x28
		88	02/05 →		10/05→07/07	TB719	220x28

SHERPA Bus (FR)

2.0	G20A	64	01/83 → 09/88		04/85→	SVB10900	10x900
					04/85→, flat teeth	TB124	104x17
					04/85→, round teeth	TB231	104x17
					04/85→, vauxhall	TB218	104x17
2.6 D	K25D	59	01/83 → 09/88		02/84→	SVB101025	10x1025



kW



LEXUS

ES (F1, F2)

250		118	12/89 → 09/91			MVB1050R6	6PK1050
						TB444	179x32
						MVB760R3	3PK760
300	3VZ-FE	138	09/91 → 12/97		→08/93	MVB1050R6	6PK1050
						TB436	191x32
					→08/93	MVB800R4	4PK800
					08/93 →	MVB875R4	4PK875

GS (GRS_, UZS_)

430	3UZ-FE	208	04/05 →			MVB2120R6	6PK2120
-----	---------------	-----	---------	--	--	------------------	---------

GS (JZS147)

300	2JZ-GE	156	03/93 → 08/97			MVB1930R6	6PK1930
						TB762	143x25.4

GS (JZS160)

300	2JZ-GE	161	10/00 → 03/05			MVB1930R6	6PK1930
						TB762	143x25.4
300 T3	2JZ-GE	163	08/97 → 10/00			MVB1930R6	6PK1930
						TB762	143x25.4
400	1UZ-FE	216	12/97 → 11/00			MVB2250R6	6PK2250
430	3UZ-FE	208	11/00 → 03/05			MVB2250R6	6PK2250

IS

220 d (ALE20)	2AD-FHV	130	10/05 →			MVB1870R7	7PK1870
---------------	----------------	-----	---------	--	--	------------------	---------

IS (GXE10)

200	1G-FE	114	04/99 →		→09/05	MVB900R4	4PK900
					→09/05	MVB1070R4	4PK1070
					→09/05	MVB887R3	3PK887
300	2JZ-GE	157	09/01 →		→09/05	MVB1930R6	6PK1930
					→09/05	TB762	143x25.4

IS SportCross

200	1G-FE	114	10/02 →		→09/05	MVB900R4	4PK900
					→09/05	MVB1070R4	4PK1070
					→09/05	MVB887R3	3PK887
300	2JZ-GE	157	10/01 →		→09/05	MVB1930R6	6PK1930
					→09/05	TB762	143x25.4

LS

460	1UR-FSE	280	04/06 →		08/06 →	MVB2100R6	6PK2100
		255	05/08 →			MVB2100R6	6PK2100

LS (FE)

430	3UZ-FE	207	10/00 →		→07/06	MVB2250R6	6PK2250
-----	---------------	-----	---------	--	--------	------------------	---------

LS (UCF10)

400	1UZ-FE	180	12/89 → 12/94			MVB2250R6	6PK2250
-----	---------------	-----	---------------	--	--	------------------	---------

LS (UCF20)

400	1UZ-FE	194	12/94 → 08/97			MVB2225R6	6PK2225
					LHD	MVB2250R6	6PK2250
		209	09/97 →		→07/00	MVB2225R6	6PK2225
		203	09/98 →		→07/00	MVB2225R6	6PK2225

RX (MCU_)

300	1MZ-FE	150	05/03 →		→01/06	MVB1035R6	6PK1035
					→01/06	TB696	211x32
					→01/06	MVB875R4	4PK875
400h	3MZ-FE	155	09/04 →		04/05 →	TB696	211x32
400h FWD		155	09/05 →			TB696	211x32

RX (XU1)

300 V6	1MZ-FE	148	10/00 → 05/03			MVB1035R6	6PK1035
						TB696	211x32
						MVB875R4	4PK875



kw



...LEXUS

SC

430	3UZ-FE	210	08/01 →	①		MVB2265R6	6PK2265
-----	--------	-----	---------	---	--	-----------	---------

MASERATI

BITURBO (70, 77)

2.24V	475	180	03/89 → 12/94	①		TB593	194x22
4.24V	475	180	04/90 → 12/94	①		TB593	194x22
222	471..	162	01/89 → 10/89	①		TB593	194x22

BITURBO Coupe

2.0	452..	136	07/85 → 04/87	①		TB593	194x22
S 2.0	454	151	12/81 → 02/87	①	01/83 →	TB593	194x22
Si 2.0	471..	151	09/87 → 12/88	①		TB593	194x22

QUATTROPORTE III

4.2		295	03/04 →	①		MVB1550R6	6PK1550
-----	--	-----	---------	---	--	-----------	---------

MAZDA

2

1.5		76	10/07 →	①		MVB1842R6	6PK1842
-----	--	----	---------	---	--	-----------	---------

2 (B2W)

1.25	FUJA	55	04/03 →	①	→06/07	TB472	117x22
				①	→05/05	TBK276	
1.4	FXJA	59	04/03 →	①	→06/07	TB472	117x22
				①	→05/05	TBK276	
1.4 CD	F6JA, F6JB	50	04/03 →	①	Eng. F6JA, A/C(-), →06/07	MVB1335R6	6PK1335
				①	Eng. F6JA, A/C(+), →06/07	MVB1708R6	6PK1708
				①	→06/07	TB720	114x25.4
				①	→06/07	TBK230	
1.6	FYJA	74	04/03 →	①	→06/07	TB472	117x22
				①	→05/05	TBK276	

3 (BK14)

1.4		59	02/04 →	①		MVB2013R6	6PK2013
		62	10/03 →	①		MVB2013R6	6PK2013
1.6		77	10/03 →	①		MVB2013R6	6PK2013
1.6 DI Turbo	Y601	80	06/04 →	①	A/C(-)	MVB795R6	6PK795
				①	A/C(+)	MVB975R6	6PK975
				①		TB724	137x25.4
				①		TBK302	
2.0		110	10/03 →	①		MVB1306R6	6PK1306
2.0 MZR-CD	RF7J	105	12/06 →	①	09/07 →	MVB1230R8	8PK1230
				①	09/07 →	TB802	150x30
2.3 MPS		191	12/06 →	①		MVB2315R6	6PK2315

3 Saloon (BK12)

1.6		77	02/04 →	①		MVB2013R6	6PK2013
1.6 DI Turbo	Y601	80	06/04 →	①	A/C(-)	MVB795R6	6PK795
				①	A/C(+)	MVB975R6	6PK975
				①		TB724	137x25.4
				①		TBK302	
2.0		110	02/04 →	①		MVB1306R6	6PK1306
2.0 MZR-CD	RF7J	105	12/06 →	①	09/07 →	MVB1230R8	8PK1230
				①	09/07 →	TB802	150x30

5 (CR19)

1.8	L823	85	03/05 →	①		MVB1306R6	6PK1306
2.0	LFF7	107	03/05 →	①		MVB1306R6	6PK1306
2.0 CD		81	03/05 →	①	A/C(-)	MVB1173R8	8PK1173
				①	A/C(+)	MVB1230R8	8PK1230
				①		TB802	150x30
	RF7J	105	06/05 →	①	A/C(-)	MVB1173R8	8PK1173
				①	A/C(+)	MVB1230R8	8PK1230
				①		TB802	150x30





kW



...MAZDA

6 (GG)

1.8	L813	88	08/02 →		03/05 →07/07	MVB2265R6	6PK2265
					A/C(-), →02/05	MVB2160R6	6PK2160
					A/C(+), →02/05	MVB2250R6	6PK2250
2.0	LF17, LF18	104	06/02 →		A/C(-), →02/05	MVB2160R6	6PK2160
					A/C(+), →02/05	MVB2250R6	6PK2250
		108	03/05 →		→07/07	MVB2265R6	6PK2265
2.0 DI	RF5C	100	06/02 →		A/C(-), 10/02 →02/05	MVB1173R8	8PK1173
					A/C(+), 10/02 →02/05	MVB1230R8	8PK1230
		89	08/02 →		10/02 →02/05	TB751	153x30
					→07/07	MVB1230R8	8PK1230
					A/C(-), →02/05	MVB1173R8	8PK1173
					→02/05	TB751	153x30
					03/05 →07/07	TB802	150x30
	RF7J	105	06/05 →		→07/07	MVB1230R8	8PK1230
					→07/07	TB802	150x30
2.3	L3C1	122	06/02 →		A/C(-), →02/05	MVB2215R6	6PK2215
					A/C(+), →02/05	MVB2300R6	6PK2300
		191	12/05 →		→07/07	MVB2315R6	6PK2315

6 (GH)

1.8 MRZ		88	08/07 →			MVB2240R6	6PK2240
2.0 MRZ		108	08/07 →			MVB2240R6	6PK2240
2.0 MRZ-CD		103	08/07 →			TB802	150x30
2.5 MRZ		125	08/07 →			MVB2280R6	6PK2280

6 Estate (GH)

1.8 MRZ	L813	88	02/08 →			MVB2240R6	6PK2240
2.0 MRZ		108	02/08 →			MVB2240R6	6PK2240
2.0 MRZ-CD		103	02/08 →			TB802	150x30
2.5 MRZ		125	02/08 →			MVB2280R6	6PK2280

6 Hatchback (GG)

1.8	L813	88	08/02 →		03/05 →07/07	MVB2265R6	6PK2265
					A/C(-), →02/05	MVB2160R6	6PK2160
					A/C(+), →02/05	MVB2250R6	6PK2250
2.0	LF17, LF18	104	08/02 →		A/C(-), →02/05	MVB2160R6	6PK2160
					A/C(+), →02/05	MVB2250R6	6PK2250
		108	03/05 →		→07/07	MVB2265R6	6PK2265
2.0 DI	RF5C	100	08/02 →		A/C(-), →02/05	MVB1173R8	8PK1173
					A/C(+), →02/05	MVB1230R8	8PK1230
					→02/05	TB751	153x30
		89	08/02 →		→07/07	MVB1230R8	8PK1230
					A/C(-), →02/05	MVB1173R8	8PK1173
					→02/05	TB751	153x30
					03/05 →07/07	TB802	150x30
	RF7J	105	06/05 →		→07/07	MVB1230R8	8PK1230
					→07/07	TB802	150x30
2.3	L3C1	122	08/02 →		A/C(-), →02/05	MVB2215R6	6PK2215
					A/C(+), →02/05	MVB2300R6	6PK2300

6 Hatchback (GH)

1.8 MRZ		88	08/07 →			MVB2240R6	6PK2240
2.0 MRZ		108	08/07 →			MVB2240R6	6PK2240
2.0 MRZ-CD		103	08/07 →			TB802	150x30
2.5 MRZ		125	08/07 →			MVB2280R6	6PK2280

6 Station Wagon (GY)

1.8	L813	88	08/02 →		03/05 →01/08	MVB2265R6	6PK2265
					A/C(-), →02/05	MVB2160R6	6PK2160
					A/C(+), →02/05	MVB2250R6	6PK2250
2.0	LF17, LF18	104	08/02 →		A/C(-), →02/05	MVB2160R6	6PK2160
					A/C(+), →02/05	MVB2250R6	6PK2250
		108	03/05 →		→01/08	MVB2265R6	6PK2265

MAZDA



kW



MAZDA

...MAZDA

...6 Station Wagon (GY)

2.0 CITD 4x4		89	10/02 → 02/05	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1173R8 MVB1230R8 TB751	8PK1173 8PK1230 153x30
		100	10/02 → 02/05	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1173R8 MVB1230R8 TB751	8PK1173 8PK1230 153x30
2.0 DI	RF5C	100	08/02 →	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), →02/05 A/C(+), →02/05 →02/05	MVB1173R8 MVB1230R8 TB751	8PK1173 8PK1230 153x30
		89	08/02 →	⊗ ⊗ ⊗ ⊗ ⊗	→01/08 A/C(-), →02/05 →02/05	MVB1230R8 MVB1173R8 TB751	8PK1230 8PK1173 153x30
	RF7J	105	06/05 →	⊗ ⊗ ⊗ ⊗ ⊗	03/05 → 01/08 →01/08 →01/08	MVB1230R8 TB802	8PK1230 150x30
2.3		122	08/02 →	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), →02/05 A/C(+), →02/05	MVB2215R6 MVB2300R6	6PK2215 6PK2300
2.3 AWD		119	11/02 →	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), →02/05 A/C(+), →02/05	MVB2215R6 MVB2300R6	6PK2215 6PK2300

121 I (DA)

1.1	B1, B116	42	10/87 → 10/90	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→ Ch. DA13-124778 Ch. DA13-124779 → → Ch. DA13-124778 Ch. DA13-124779 →	SVB10888 TB266 TB289 TBK286 TBK072	10x888 107x21.6 107x22
1.3	B3	44	10/87 → 10/90	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→ Ch. DA13-124778 Ch. DA13-124779 → → Ch. DA13-124778 Ch. DA13-124779 →	SVB10888 TB266 TB289 TBK286 TBK072	10x888 107x21.6 107x22
		40	04/89 → 10/90	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→ Ch. DA13-124778 Ch. DA13-124779 → → Ch. DA13-124778 Ch. DA13-124779 →	SVB10888 TB266 TB289 TBK286 TBK072	10x888 107x21.6 107x22

121 II (DB)

1.1		40	11/90 → 10/93	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		MVB875R4 TB289 TBK072	4PK875 107x22
1.3 16V	B3 (16V)	39	11/90 → 03/96	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	MS A/C(-) A/C(+)	MVB875R4 TB289 TBK072 MVB850R4 MVB960R4	4PK875 107x22 4PK850 4PK960
		53	11/90 → 03/96	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	MS A/C(-) A/C(+)	MVB875R4 TB289 TBK072 MVB850R4 MVB960R4	4PK875 107x22 4PK850 4PK960

121 III (JASM, JBSM)

1.25	DHF, DHG	55	03/96 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), MS, →10/02 A/C(-), PS, →10/02 A/C(+), MS, →10/02 A/C(+), PS, →10/02 →10/02 →02/97 02/97 → 10/02	MVB1180R6 MVB1755R6 MVB1775R6 MVB1930R6 TB472 TBK310 TBK276	6PK1180 6PK1755 6PK1775 6PK1930 117x22
------	-----------------	----	---------	--------------------------------------	---	--	--



kW



...MAZDA

...121 III (JASM, JBSM)

1.3		37	03/96 →	⊗	A/C(-), MS, →10/02	MVB860R6	6PK860
				⊗	A/C(-), PS, →10/02	MVB1740R6	6PK1740
				⊗	A/C(+), MS, →10/02	MVB1440R6	6PK1440
				⊗	A/C(+), PS, →10/02	MVB1904R6	6PK1904
		44	03/96 →	⊗	A/C(-), MS, →10/02	MVB860R6	6PK860
				⊗	A/C(-), PS, →10/02	MVB1740R6	6PK1740
				⊗	A/C(+), MS, →10/02	MVB1440R6	6PK1440
				⊗	A/C(+), PS, →10/02	MVB1904R6	6PK1904
1.8 D	RTJ, RTK	44	03/96 →	⊗	A/C(-), MS, →10/02	MVB887R5	5PK887
				⊗	A/C(+), PS, →10/02	MVB1141R5	5PK1141
				⊗	→10/02	TB496	116x22
				⊗	→10/97	TBK014	
				⊗	10/97→10/02	TBK121	
				⊗	→10/02	TB495	85x22
				⊗	A/C(+), →10/02	MVB675R5	5PK675

323 C IV (BG)

1.3	B3E	49	09/89 → 07/94	⊗	MS	MVB885R4	4PK885
				⊗	PS	MVB1000R4	4PK1000
				⊗		SVB13900	13x900
				⊗		TB289	107x22
				⊗		TBK072	
				⊗		MVB887R4	4PK887
1.3 16V		54	09/89 → 07/94	⊗	MS	MVB885R4	4PK885
				⊗	PS	MVB1000R4	4PK1000
				⊗		SVB13900	13x900
				⊗		TB289	107x22
				⊗		TBK072	
				⊗		MVB887R4	4PK887
1.6	B6E	62	09/89 → 06/91	⊗	MS	MVB885R4	4PK885
				⊗	PS	MVB1000R4	4PK1000
				⊗		SVB13900	13x900
				⊗		TB289	107x22
				⊗		TBK072	
				⊗		MVB887R4	4PK887
1.6 16V	B6	65	03/91 → 10/94	⊗	MS, →04/94	MVB885R4	4PK885
				⊗	PS, →04/94	MVB1000R4	4PK1000
				⊗	→04/94	SVB13900	13x900
				⊗	→04/94	TB289	107x22
				⊗	→04/94	TBK072	
				⊗	→04/94	MVB887R4	4PK887
1.7 D	PN54	41	08/89 → 07/94	⊗		SVB13900	13x900
				⊗		TB276	152x25.4
				⊗	A/C(-)	SVB13925	13x925
				⊗	A/C(+)	SVB131050	13x1050
1.8 16V	BP22, BP31	103	09/89 → 03/93	⊗		SVB13900	13x900
				⊗		TB294	145x22
				⊗		TBK342	
				⊗	A/C(-)	MVB887R4	4PK887
				⊗	A/C(+)	MVB1015R4	4PK1015
1.8 16V 4WD	BP	76	11/91 → 12/93	⊗		SVB13900	13x900
				⊗		TB294	145x22
				⊗		TBK342	
				⊗	A/C(-)	MVB887R4	4PK887
				⊗	A/C(+)	MVB1015R4	4PK1015
1.8 16V GT	BP (DOHC)	94	09/89 → 03/93	⊗		SVB13900	13x900
				⊗		TB294	145x22
				⊗		TBK342	
				⊗	A/C(-)	MVB887R4	4PK887
				⊗	A/C(+)	MVB1015R4	4PK1015

MAZDA



kw



MAZDA

...MAZDA

...323 C IV (BG)

1.8 16V Turbo 4WD		136	01/93 → 07/94	 		SVB13900 TB294 TBK342 MVB887R4	13x900 145x22 4PK887
				 	A/C(-) A/C(+)	MVB1015R4 SVB13900	4PK1015 13x900
		120	09/90 → 12/92	 		TB294 TBK342 MVB887R4	145x22 4PK887
				 	A/C(-) A/C(+)	MVB1015R4	4PK1015

323 C V (BA)

1.3 16V	B3 (16V)	54	08/94 → 09/98	 	MS, →02/96 MS, Air compressor (+), Air filter (-), →10/96	MVB875R4 MVB850R4	4PK875 4PK850
				 	PS, →10/96 PS, 02/96 →10/96, Ch. BA1...344370 →	MVB995R4 MVB1000R4	4PK995 4PK1000
				 	→10/96 →10/96	MVB885R4 TB289	4PK885 107x22
				 	→10/96 →10/96	TBK072 MVB887R4	4PK887
1.5 16V	Z5-DE	65	08/94 → 09/98	 	PS With water pump →10/97, → Ch. BA1...-605120 10/97 →, Ch. BA1...-605121 → →10/97, → Ch. BA1...-605120 10/97 →, Ch. BA1...-605121 →	MVB1000R4 MVB885R4 TB460 TB731 TBK299 TBK340	4PK1000 4PK885 125x21 123x22 4PK887
				 	A/C(-) A/C(+)	MVB887R4 MVB995R4	4PK887 4PK995
1.8 16V	BP-ZE	84	08/94 → 09/98	 		MVB885R4 TB294 TBK342 MVB887R4	4PK885 145x22 4PK887
				 	A/C(-) A/C(+), Air compressor (+), Air filter (-)	MVB995R4 MVB1000R4	4PK995 4PK1000
					A/C(+), Air compressor (+), Air filter (+)		

323 F IV (BG)

1.6	B6E	62	09/89 → 06/91	 	MS PS	MVB885R4 MVB1000R4 SVB13900 TB289 TBK072 MVB887R4	4PK885 4PK1000 13x900 107x22 4PK887
1.6 16V	B6	65	03/91 → 10/94	 	MS, →04/94 PS, →04/94 →04/94 →04/94 →04/94	MVB885R4 MVB1000R4 SVB13900 TB289 TBK072 MVB887R4	4PK885 4PK1000 13x900 107x22 4PK887
1.8 4WD		76	01/91 → 04/94	 		SVB13900 TB289 TBK072 MVB887R4	13x900 107x22 4PK887





kW



...MAZDA

...323 F IV (BG)

1.8 16V	BP	76	08/89 → 07/94			SVB13900	13x900
						TB289	107x22
						TBK072	
						MVB887R4	4PK887
	BP31	103	09/89 → 03/93		→03/91	SVB13900	13x900
					→03/91	TB294	145x22
					→03/91	TBK342	
					A/C(-), →03/91	MVB887R4	4PK887
					A/C(+), →03/91	MVB1015R4	4PK1015
1.8 16V GT	BP (DOHC)	94	08/89 → 07/94		→03/91	SVB13900	13x900
					→03/91	TB294	145x22
					→03/91	TBK342	
					A/C(-), →03/91	MVB887R4	4PK887
					A/C(+), →03/91	MVB1015R4	4PK1015

323 F V (BA)

1.5 16V	Z5-DE	65	07/94 → 09/98			MVB885R4	4PK885
					→10/97, → Ch. BA1...-605120	TB460	125x21
					10/97→, Ch. BA1...-605121→	TB731	123x22
					→10/97, → Ch. BA1...-605120	TBK299	
					10/97→, Ch. BA1...-605121→	TBK340	
					A/C(-)	MVB887R4	4PK887
					A/C(+)	MVB1000R4	4PK1000
					A/C(+)	MVB995R4	4PK995
1.8 16V	BP-ZE	84	08/94 → 09/98			MVB885R4	4PK885
						TB294	145x22
						TBK342	
					A/C(-)	MVB887R4	4PK887
					A/C(+), →06/95, → Ch. BA1...212949	MVB1000R4	4PK1000
					A/C(+), Air compressor (+), Air filter (-), 06/95→, Ch. BA1...212950→	MVB995R4	4PK995
2.0 24V	KF	106	08/94 → 09/98		A/C(-)	MVB865R5	5PK865
					A/C(+)	MVB1015R5	5PK1015
						TB399	192x30
						MVB920R4	4PK920

323 F VI (BJ)

1.4	B3 (16V)	53	01/01 → 05/04		→10/03	MVB885R4	4PK885
					→10/03	TB289	107x22
					→10/03	TBK072	
					A/C(-), →10/03	MVB887R4	4PK887
					A/C(+), →10/03	MVB1000R4	4PK1000
1.4 16V	B3 ME	54	09/98 → 01/01			MVB885R4	4PK885
						TB289	107x22
						TBK072	
					A/C(-)	MVB887R4	4PK887
					A/C(+)	MVB1000R4	4PK1000
1.5 16V		65	09/98 → 01/01		→09/00	MVB885R4	4PK885
					→09/00	TB731	123x22
					→09/00	TBK340	
					A/C(-), →09/00	MVB887R4	4PK887
					A/C(+), →09/00	MVB1000R4	4PK1000



kw



MAZDA

...MAZDA

...323 F VI (BJ)

1.6		72	01/01 → 05/04	⊗	→10/03	MVB885R4	4PK885
				☞	→10/03	TB731	123x22
70	01/01 → 05/04	70	01/01 → 05/04	☞	→10/03	TBK340	
				☺	A/C(-), →10/03	MVB887R4	4PK887
				☺	A/C(+), →10/03	MVB1000R4	4PK1000
				⊗	→10/03	MVB885R4	4PK885
				☞	→10/03	TB731	123x22
				☞	→10/03	TBK340	
1.9 16V		84	09/98 → 01/01	☺	→09/00	MVB887R4	4PK887
				☞	→09/00	MVB1000R4	4PK1000
				☞	→09/00	MVB920R4	4PK920
				☞	→09/00	TB398	133x25.4
2.0	FS7E, FS7G	96	01/01 → 05/04	☞	→09/00	TBK343	
				☞	→09/00	MVB1030R5	5PK1030
				☞	→09/00	MVB1165R5	5PK1165
				☞	→09/00	MVB920R4	4PK920
2.0 D	RF1G	52	09/98 → 05/04	☞	A/C(-)	TB371	135x25.4
				☞	A/C(+)	TBK295	
				☞	A/C(+)	MVB1030R5	5PK1030
2.0 TD	RF4F	74	01/01 → 05/04	☞	A/C(-), →09/00	MVB1165R5	5PK1165
				☞	A/C(+), →09/00	SVB10888	10x888
				☞	A/C(+), →09/00	SVB131050	13x1050
				☞	→09/00	TB541	149x24
2.0 TD	RF4F	74	01/01 → 05/04	☞	→09/00	SVB13850	13x850
				☞	A/C(-), →09/00	SVB13900	13x900
				☞	A/C(+), →09/00	SVB131050	13x1050
				☞	→09/00	TB685	153x27
2.0 TD	RF4F	74	01/01 → 05/04	☞	A/C(-), →10/03	SVB13900	13x900
				☞	A/C(+), →10/03	SVB131050	13x1050
				☞	→10/03	TB685	153x27

323 II (BD)

1.1	E1	40	11/80 → 10/85	☼	→04/85	SVB131125	13x1125
				⊗	→04/85	SVB10960	10x960
1.3	E3	44	09/81 → 10/85	☼	05/85→	SVB131125	13x1125
				⊗	05/85→	SVB10960	10x960
		50	11/80 → 10/89	☼	→03/87	SVB131125	13x1125
				⊗	→03/87	SVB10960	10x960
				☞	→04/85, → Ch. BF...-563073	TB266	107x21.6
				☞	→04/85, Ch. BF...-563074→	TB289	107x22
1.5	E5	65	03/82 → 09/86	☞	→04/85, → Ch. BF...-563073	TBK286	
				☞	→04/85, Ch. BF...-563074→	TBK072	
		55	05/81 → 12/85	☼	→04/85	SVB131125	13x1125
				⊗	→04/85	SVB10960	10x960

323 II Hatchback (BD)

1.1	E1	40	11/80 → 10/85	☼	→04/85	SVB131125	13x1125
				⊗	→04/85	SVB10960	10x960
1.3	E3	44	11/80 → 10/85	☼	→04/85	SVB131125	13x1125
				⊗	→04/85	SVB10960	10x960
		50	11/80 → 10/89	☞	→04/85, → Ch. BF...-563073	TB266	107x21.6
				☞	→04/85, Ch. BF...-563074→	TB289	107x22
				☞	→04/85, → Ch. BF...-563073	TBK286	
				☞	→04/85, Ch. BF...-563074→	TBK072	
				☼	→04/85	SVB131125	13x1125
				⊗	→04/85	SVB10960	10x960
50	11/80 → 10/89	☞	→04/85, → Ch. BF...-563073	TB266	107x21.6		
		☞	→04/85, Ch. BF...-563074→	TB289	107x22		
		☞	→04/85, → Ch. BF...-563073	TBK286			
		☞	→04/85, Ch. BF...-563074→	TBK072			



kW



...MAZDA

...323 II Hatchback (BD)

1.5	E5	55	05/81 → 07/85	☼		SVB131125	13x1125
				☼		SVB10960	10x960
		63	11/80 → 12/83	☼		SVB131125	13x1125
				☼		SVB10960	10x960
		65	03/82 → 12/85		☼	→04/85	SVB131125
	☼			→04/85	SVB10960	10x960	
59	08/82 → 04/85	☼		SVB131125	13x1125		
				☼		SVB10960	10x960

323 III (BF)

1.1		40	08/85 → 04/90	☼	→03/87	SVB131125	13x1125
				☼	→03/87	SVB10960	10x960
1.3	E3	44	08/85 → 05/89	☼	→03/87	SVB131125	13x1125
				☼	→03/87	SVB10960	10x960
1.4	B3	44	04/87 → 07/89	☼	MS	MVB887R4	4PK887
				☼	PS	MVB975R4	4PK975
				☼		SVB10888	10x888
				☼	→ Ch. BF...-563073	TB266	107x21.6
				☼	Ch. BF...-563074→	TB289	107x22
				☼	→ Ch. BF...-563073	TBK286	
				☼	Ch. BF...-563074→	TBK072	
				☼	A/C(-)	MVB875R4	4PK875
				☼		SVB131125	13x1125
				☼		SVB10960	10x960
1.5	E5	55	08/85 → 05/89	☼	→03/87	SVB131125	13x1125
				☼	→03/87	SVB10960	10x960
	B5	54	09/87 → 10/89	☼	MS, →05/89	MVB887R4	4PK887
				☼	PS, →05/89	MVB995R4	4PK995
				☼	→05/89	SVB10888	10x888
				☼	→05/89, → Ch. BF1-563073	TB266	107x21.6
				☼	→05/89, Ch. BF1-563074→	TB289	107x22
				☼	→05/89, → Ch. BF1-563073	TBK286	
				☼	→05/89, Ch. BF1-563074→	TBK072	
				☼	A/C(-), →05/89	MVB875R4	4PK875
				☼		SVB131125	13x1125
				☼		SVB10960	10x960
1.5 i	E5E3	70	08/85 → 05/89	☼	→03/87	SVB131125	13x1125
				☼	MS, 03/87→	MVB887R4	4PK887
				☼	PS, 03/87→	MVB995R4	4PK995
				☼	→03/87	SVB10960	10x960
				☼	03/87→	SVB10888	10x888
				☼	03/87→, → Ch. BF1-563073	TB266	107x21.6
				☼	03/87→, Ch. BF1-563074→	TB289	107x22
				☼	03/87→, → Ch. BF1-563073	TBK286	
				☼	03/87→, Ch. BF1-563074→	TBK072	
				☼	A/C(-), 03/87→	MVB875R4	4PK875
1.5 i Turbo	E5E2	85	08/85 → 05/89	☼	→03/87	SVB131125	13x1125
				☼	MS, 03/87→	MVB887R4	4PK887
				☼	PS, 03/87→	MVB995R4	4PK995
				☼	→03/87	SVB10960	10x960
				☼	03/87→	SVB10888	10x888
				☼	03/87→, → Ch. BF1-563073	TB266	107x21.6
				☼	03/87→, Ch. BF1-563074→	TB289	107x22
				☼	03/87→, → Ch. BF1-563073	TBK286	
				☼	03/87→, Ch. BF1-563074→	TBK072	
				☼	A/C(-), 03/87→	MVB875R4	4PK875



kw



MAZDA

...MAZDA

...323 III (BF)

1.6 GT	B6	63	11/86 → 10/89	☼	MS	SVB13950	13x950				
				☼	MS, 04/87 → 05/89	MVB887R4	4PK887				
				⊖		SVB10888	10x888				
				☼	02/89 → 05/89, Ch. BF1-563074 →	TB289	107x22				
				☼	Ch. BF1-143150 → BF1-563073	TB266	107x21.6				
				☼ KIT	04/87 → 05/89, Ch. BF1-563074 →	TBK072					
				☼ KIT	Ch. BF1-143150 → BF1-563073	TBK286					
				☼	A/C(-)	MVB875R4	4PK875				
				☼	A/C(+)	MVB975R4	4PK975				
				1.6 GT Turbo	B6	103	10/85 → 11/91	☼	MS	MVB887R4	4PK887
⊖	06/86 → 05/89	SVB10888	10x888								
☼	06/86 → 05/89,	TB397	145x21								
	→ Ch. BF1-563073										
☼	06/86 → 05/89, Ch. BF1-563074 →	TB294	145x22								
☼ KIT	06/86 → 05/89, Ch. BF1-563074 →	TBK342									
☼	A/C(-), 06/86 → 05/89	MVB875R4	4PK875								
☼	A/C(+), 06/86 → 05/89	MVB975R4	4PK975								
1.7 D	PN27	40	09/86 → 05/89					☼	MS	SVB171000	17x1000
								⊖		SVB13875	13x875
				☼		TB276	152x25.4				
				☼	A/C(+)	SVB131060	13x1060				
				☼							
	PN46	42	01/87 → 05/89	☼	MS	SVB171000	17x1000				
				⊖		SVB13875	13x875				
				☼		TB276	152x25.4				
				☼		SVB131060	13x1060				
				☼	A/C(+)						

323 III Hatchback (BF)

1.1	E1	40	09/85 → 10/89	☼	→ 03/87	SVB131125	13x1125				
				⊖	→ 03/87	SVB10960	10x960				
1.3	E3	44	09/85 → 12/87	☼	→ 03/87	SVB131125	13x1125				
				⊖	→ 03/87	SVB10960	10x960				
1.4	B3	44	09/87 → 10/89	☼	MS, → 05/89	MVB887R4	4PK887				
				☼	PS, → 05/89	MVB975R4	4PK975				
				⊖	→ 05/89	SVB10888	10x888				
				☼	→ 05/89, → Ch. BF...-563073	TB266	107x21.6				
				☼	→ 05/89, Ch. BF...-563074 →	TB289	107x22				
				☼ KIT	→ 05/89, → Ch. BF...-563073	TBK286					
				☼ KIT	→ 05/89, Ch. BF...-563074 →	TBK072					
				☼	A/C(-), → 05/89	MVB875R4	4PK875				
				1.5	E5	55	08/85 → 05/89	☼	→ 03/87	SVB131125	13x1125
								⊖	→ 03/87	SVB10960	10x960
B5	54	09/87 → 10/89	☼		MS, → 05/89	MVB887R4	4PK887				
			☼		PS, → 05/89	MVB995R4	4PK995				
			⊖		→ 05/89	SVB10888	10x888				
			☼		→ 05/89, → Ch. BF1-563073	TB266	107x21.6				
			☼		→ 05/89, Ch. BF1-563074 →	TB289	107x22				
			☼ KIT		→ 05/89, → Ch. BF1-563073	TBK286					
			☼ KIT		→ 05/89, Ch. BF1-563074 →	TBK072					
			☼		A/C(-), → 05/89	MVB875R4	4PK875				



kW



...MAZDA

...323 III Hatchback (BF)

1.5 i	E5E3	70	08/85 → 05/89	⊗	→03/87	SVB131125	13x1125				
				⊗	MS, 03/87→	MVB887R4	4PK887				
				⊗	PS, 03/87→	MVB995R4	4PK995				
				⊗	→03/87	SVB10960	10x960				
				⊗	03/87→	SVB10888	10x888				
				⊗	03/87→, → Ch. BF1-563073	TB266	107x21.6				
				⊗	03/87→, Ch. BF1-563074→	TB289	107x22				
				⊗	03/87→, → Ch. BF1-563073	TBK286					
				⊗	03/87→, Ch. BF1-563074→	TBK072					
				⊗	A/C(-), 03/87→	MVB875R4	4PK875				
1.5 i Turbo	E5E2	85	08/85 → 05/89	⊗	→03/87	SVB131125	13x1125				
				⊗	MS, 03/87→	MVB887R4	4PK887				
				⊗	PS, 03/87→	MVB995R4	4PK995				
				⊗	→03/87	SVB10960	10x960				
				⊗	03/87→	SVB10888	10x888				
				⊗	03/87→, → Ch. BF1-563073	TB266	107x21.6				
				⊗	03/87→, Ch. BF1-563074→	TB289	107x22				
				⊗	03/87→, → Ch. BF1-563073	TBK286					
				⊗	03/87→, Ch. BF1-563074→	TBK072					
				⊗	A/C(-), 03/87→	MVB875R4	4PK875				
1.6	B68	54	09/87 → 10/89	⊗	MS	SVB13950	13x950				
				⊗		SVB10888	10x888				
				⊗	A/C(+), PS	MVB975R4	4PK975				
				⊗	Ch. BF1-143150→	TB266	107x21.6				
				⊗	Ch. BF1-143150→	TBK286					
				⊗	A/C(-)	MVB875R4	4PK875				
				1.6 GT	B6	63	09/87 → 10/89	⊗	MS, →05/89	MVB887R4	4PK887
								⊗	→05/89	SVB10888	10x888
								⊗	→02/89,	TB266	107x21.6
								⊗	Ch. BF1-143150→BF1-563073		
⊗	02/89→05/89, Ch. BF1-563074→	TB289	107x22								
77	08/85 → 12/88					⊗	→05/89,	TBK286			
						⊗	Ch. BF1-143150→BF1-563073				
						⊗	→05/89, Ch. BF1-563074→	TBK072			
						⊗	A/C(-), →05/89	MVB875R4	4PK875		
						⊗	A/C(+), →05/89	MVB975R4	4PK975		
1.6 GT Turbo 4WD (BF2)		110	08/87 → 10/89	⊗	MS, →05/89	MVB887R4	4PK887				
				⊗	→05/89	SVB10888	10x888				
				⊗	→05/89, → Ch. BF1-563073	TB397	145x21				
				⊗	→05/89, Ch. BF1-563074→	TB294	145x22				
				⊗	→05/89, Ch. BF1-563074→	TBK342					
				⊗	A/C(-), →05/89	MVB875R4	4PK875				
				⊗	A/C(+), →05/89	MVB975R4	4PK975				
				1.6 GT Turbo (BF1)	B6	103	10/85 → 11/91	⊗	MS, 06/86→05/89	MVB887R4	4PK887
								⊗	06/86→05/89	SVB10888	10x888
								⊗	06/86→05/89,	TB397	145x21
⊗	→ Ch. BF1-563073										
⊗	06/86→05/89, Ch. BF1-563074→	TB294	145x22								
⊗	06/86→05/89, Ch. BF1-563074→	TBK342									
⊗	A/C(-), 06/86→05/89	MVB875R4	4PK875								
⊗	A/C(+), 06/86→05/89	MVB975R4	4PK975								



kw



MAZDA

...MAZDA

...323 III Hatchback (BF)

1.6 GT Turbo 4WD (BF2)	B6	103	10/87 → 11/91	☀ ⊖ ☺ ☺ ☺ ^{KIT} ⊕ ⊕	MS, →05/89 →05/89 →05/89, → Ch. BF1-563073 →05/89, Ch. BF1-563074→ →05/89, Ch. BF1-563074→ A/C(-), →05/89 A/C(+), →05/89	MVB887R4 SVB10888 TB397 TB294 TBK342 MVB875R4 MVB975R4	4PK887 10x888 145x21 145x22 4PK875 4PK975
1.7 D	PN27	40	04/86 → 05/89	☀ ⊖ ☺ ⊕	MS A/C(+)	SVB171000 SVB13875 TB276 SVB131060	17x1000 13x875 152x25.4 13x1060
				☀ ⊖ ☺ ⊕			
	PN46	42	01/87 → 05/89	☀ ⊖ ☺ ⊕	MS A/C(+)	SVB171000 SVB13875 TB276 SVB131060	17x1000 13x875 152x25.4 13x1060

323 III Station Wagon (BW)

1.3			44	07/86 → 04/90	☀ ☀ ☀ ⊖ ⊖ ☺ ☺ ^{KIT} ☺ ^{KIT}	→06/87 MS, 07/87→08/89 PS, 07/87→08/89 →06/87 07/87→08/89 02/89→08/89, Ch. BW...414122→ 07/87→02/89, → Ch. BW...414121 02/89→08/89, Ch. BW...414122→ 07/87→02/89, → Ch. BW...414121 A/C(-), 07/87→08/89	SVB131125 MVB887R4 MVB975R4 SVB10960 SVB10888 TB289 TB266 TBK072 TBK286	13x1125 4PK887 4PK975 10x960 10x888 107x22 107x21.6								
					⊕		MVB875R4	4PK875								
					52	01/86 → 06/87	☀ ⊖		SVB131125 SVB10960	13x1125 10x960						
					50	01/86 → 06/87	☀ ⊖		SVB131125 SVB10960	13x1125 10x960						
					1.5	B50, B53, E5		55	05/86 → 05/89	☀ ☀ ☀ ☀ ⊖ ⊖ ☺ ☺ ^{KIT} ☺ ^{KIT} ⊕ ⊕	MS, →06/87 MS, 07/87→ PS, →06/87 PS, 07/87→ →06/87 07/87→ 02/89→, Ch. BW...414122→ 07/87→, → Ch. BW...414121 02/89→, Ch. BW...414122→ 07/87→, → Ch. BW...414121 A/C(-), →06/87 A/C(-), 07/87→	SVB131125 MVB887R4 MVB1190R4 MVB975R4 SVB10960 SVB10888 TB289 TB266 TBK072 TBK286 MVB1040R4 MVB875R4	13x1125 4PK887 4PK1190 4PK975 10x960 10x888 107x22 107x21.6			
										B5, B50, B53	54	01/87 → 05/89	☀ ☀ ☀ ☀ ⊖ ⊖ ☺ ☺ ^{KIT} ☺ ^{KIT} ⊕ ⊕	MS, →06/87 MS, 07/87→ PS, →06/87 PS, 07/87→ →06/87 07/87→ 02/89→, Ch. BW...414122→ 07/87→, → Ch. BW...414121 02/89→, Ch. BW...414122→ 07/87→, → Ch. BW...414121 A/C(-), →06/87 A/C(-), 07/87→	SVB131125 MVB887R4 MVB1190R4 MVB975R4 SVB10960 SVB10888 TB289 TB266 TBK072 TBK286 MVB1040R4 MVB875R4	13x1125 4PK887 4PK1190 4PK975 10x960 10x888 107x22 107x21.6





kW



...MAZDA

...323 III Station Wagon (BW)

1.6	B65M, B6E	63	09/86 → 10/95	⊗	MS, →08/89	SVB13950	13x950				
				⊗	→08/89	SVB10888	10x888				
1.6 4x4	B65M, B6E	63	05/90 → 03/93	⊗	→02/89, → Ch. BW...414121	TB266	107x21.6				
				⊗	02/89→08/89,	TB289	107x22				
				⊗	Ch. BW...414122→						
				⊗	→02/89, → Ch. BW...414121	TBK286					
				⊗	02/89→08/89,	TBK072					
				⊗	Ch. BW...414122→						
				⊗	A/C(-), →08/89	MVB875R4	4PK875				
				⊗	A/C(+), →08/89	MVB975R4	4PK975				
				1.7 D	PN26	40	11/86 → 08/87	⊗	MS	SVB13950	13x950
								⊗	→02/89, → Ch. BW...414121	SVB10888	10x888
⊗	02/89→, Ch. BW...414122→	TB266	107x21.6								
⊗	→02/89, → Ch. BW...414121	TB289	107x22								
⊗	02/89→, Ch. BW...414122→	TBK286									
42	11/86 → 10/89	⊗	A/C(-)			TBK072					
		⊗	A/C(+)			MVB875R4	4PK875				
		⊗				MVB975R4	4PK975				
		⊗				SVB10888	10x888				
		⊗				TB289	107x22				
1.3 16V	B3 (16V)	40	11/86 → 08/87	⊗		TBK072					
				⊗		MVB875R4	4PK875				
				⊗	MS	SVB171000	17x1000				
				⊗		SVB13875	13x875				
				⊗	A/C(+)	TB276	152x25.4				
		42	11/86 → 10/89	⊗	MS	SVB131060	13x1060				
				⊗		SVB171000	17x1000				
				⊗		SVB13875	13x875				
				⊗		TB276	152x25.4				
				⊗	A/C(+)	SVB131060	13x1060				
41	10/89 → 03/93	⊗	Eng. PN54	SVB13900	13x900						
		⊗		TB276	152x25.4						
		⊗	Eng. PN54, A/C(-)	SVB13925	13x925						
		⊗	Eng. PN54, A/C(+)	SVB131050	13x1050						

323 P V (BA)

1.3 16V	B3 (16V)	54	10/96 →	⊗	MS, →10/99,	MVB870R4	4PK870
				⊗	→ Ch. BA...-344369		
				⊗	MS,	MVB850R4	4PK850
				⊗	Air compressor (+),		
				⊗	Air filter (-), →10/99,		
				⊗	Ch. BA...-344370→	MVB887R4	4PK887
				⊗	MS,		
				⊗	Air compressor (+),		
				⊗	Air filter (+), →10/99,		
				⊗	Ch. BA...-344370→		
1.3 16V	B3 (16V)	54	10/96 →	⊗	→10/99	MVB885R4	4PK885
				⊗	→10/99	TB289	107x22
				⊗	→10/99	TBK072	
				⊗	A/C(+), →10/99,	MVB1000R4	4PK1000
				⊗	→ Ch. BA...-344369		
				⊗	A/C(+),	MVB995R4	4PK995
				⊗	Air compressor (+),		
				⊗	Air filter (-), →10/99,		
⊗	Ch. BA...-344370→						



kW



MAZDA

...MAZDA

...323 P V (BA)

1.5 16V	Z5-DE	65	10/96 →		→07/01	MVB885R4	4PK885
					→10/97, → Ch. BA1...605120	TB460	125x21
					10/97→07/01,	TB731	123x22
					Ch. BA1...605121→		
					→10/97, → Ch. BA1...605120	TBK299	
					10/97→07/01,	TBK340	
					Ch. BA1...605121→		
					A/C(-), →07/01	MVB887R4	4PK887
					A/C(+),	MVB995R4	4PK995
					Air compressor (+),		
					Air filter (-), →07/01		
					A/C(+),	MVB1000R4	4PK1000
					Air compressor (+),		
					Air filter (+), →07/01		
2.0 D	RF1G	52	10/96 →		A/C(-), 03/97→10/99	SVB10888	10x888
					A/C(+), 03/97→10/99	SVB101050	10x1050
					03/97→10/99	TB541	149x24
					03/97→10/99	SVB13850	13x850

323 S IV (BG)

1.3	B383, B3E	49	09/89 → 06/91		MS	MVB885R4	4PK885
					PS	MVB1000R4	4PK1000
						SVB13900	13x900
						TB289	107x22
						TBK072	
						MVB887R4	4PK887
1.3 16V	B3 (16V)	54	04/91 → 07/94		MS	MVB885R4	4PK885
					PS	MVB1000R4	4PK1000
						SVB13900	13x900
						TB289	107x22
						TBK072	
						MVB887R4	4PK887
1.6	B6E	62	09/89 → 06/91		MS	MVB885R4	4PK885
					PS	MVB1000R4	4PK1000
						SVB13900	13x900
						TB289	107x22
						TBK072	
						MVB887R4	4PK887
1.6 16V	B6	65	08/89 → 10/94		MS, →04/94	MVB885R4	4PK885
					PS, →04/94	MVB1000R4	4PK1000
					→04/94	SVB13900	13x900
					→04/94	TB289	107x22
					→04/94	TBK072	
					→04/94	MVB887R4	4PK887
1.7 D	PN46, PN54, PN62	41	08/89 → 07/94			SVB13900	13x900
						TB276	152x25.4
					A/C(-)	SVB13925	13x925
					A/C(+)	SVB131050	13x1050
1.8 16V	BP52	76	08/89 → 07/94			SVB13900	13x900
						TB289	107x22
						TBK072	
					A/C(-)	MVB887R4	4PK887
					A/C(+)	MVB1015R4	4PK1015
1.8 16V 4WD	BP52	76	09/91 → 07/94			SVB13900	13x900
						TB289	107x22
						TBK072	
					A/C(-)	MVB887R4	4PK887
					A/C(+)	MVB1015R4	4PK1015
1.8 16V GT	BP (DOHC)	94	06/89 → 07/94			SVB13900	13x900
						TB294	145x22
						TBK342	
					A/C(-)	MVB887R4	4PK887
					A/C(+)	MVB1015R4	4PK1015



kW



MAZDA

...MAZDA

...323 S IV (BG)

1.8 16V Turbo 4WD	BP Turbo	120	01/91 → 07/94			SVB13900	13x900
						TB294	145x22
						TBK342	
					A/C(-)	MVB887R4	4PK887
					A/C(+)	MVB1015R4	4PK1015

323 S V (BA)

1.3 16V	B3 (16V)	54	08/94 → 09/98		MS, → Ch. BA...-344369	MVB870R4	4PK870
					MS,	MVB850R4	4PK850
					Air compressor (+),		
					Air filter (-),		
					Ch. BA...-344370→		
						MVB885R4	4PK885
						TB289	107x22
						TBK072	
					A/C(-)	MVB887R4	4PK887
					A/C(+), → Ch. BA...-344369	MVB1000R4	4PK1000
					A/C(+),	MVB995R4	4PK995
					Air compressor (+),		
					Air filter (+),		
					Ch. BA...-344370→		
1.5 16V	Z5-DE	65	08/94 → 09/98		PS	MVB1000R4	4PK1000
						MVB885R4	4PK885
					→10/97, → Ch. BA1...-605120	TB460	125x21
					10/97→, Ch. BA1...-605121→	TB731	123x22
					→10/97, → Ch. BA1...-605120	TBK299	
					10/97→, Ch. BA1...-605121→	TBK340	
					A/C(-)	MVB887R4	4PK887
					A/C(+)	MVB995R4	4PK995
1.6 TD	4EE1-T	60	02/95 → 09/98		→10/96	SVB131138	13x1138
					→10/96	SVB13975	13x975
					→10/96	TB413	136x25.4
					→10/96	TBK023	
					→10/96	SVB10913	10x913
1.8 16V	BP-ZE	84	08/94 → 09/98		→04/98	MVB885R4	4PK885
					→04/98	TB294	145x22
					→04/98	TBK342	
					A/C(-), →04/98	MVB887R4	4PK887
					A/C(+),	MVB1000R4	4PK1000
					Air compressor (+),		
					Air filter (+), →02/96		
					A/C(+),	MVB995R4	4PK995
					Air compressor (+),		
					Air filter (+), →04/98		
2.0 D	RF1G	52	10/96 → 09/98		A/C(-), 03/97→	SVB10888	10x888
					A/C(+), 03/97→	SVB101050	10x1050
					03/97→	TB541	149x24

323 S VI (BJ)

1.4	B3 (16V)	53	01/01 → 05/04		→10/03	MVB885R4	4PK885
					→10/03	TB289	107x22
					→10/03	TBK072	
					A/C(-), →10/03	MVB887R4	4PK887
					A/C(+), →10/03	MVB1000R4	4PK1000
1.4 16V	B3 ME	54	09/98 → 01/01			MVB885R4	4PK885
						TB289	107x22
						TBK072	
					A/C(-)	MVB887R4	4PK887
					A/C(+)	MVB1000R4	4PK1000



kw



MAZDA

...MAZDA

...323 S VI (BJ)

1.5 16V		65	09/98 → 01/01		→09/00	MVB885R4	4PK885
					→09/00	TB731	123x22
					→09/00	TBK340	
					A/C(-), →09/00	MVB887R4	4PK887
					A/C(+), →09/00	MVB1000R4	4PK1000
1.6		70	01/01 → 05/04		→10/03	MVB885R4	4PK885
					→10/03	TB731	123x22
					→10/03	TBK340	
					A/C(-), →10/03	MVB887R4	4PK887
					A/C(+), →10/03	MVB1000R4	4PK1000
		72	01/01 → 05/04		→10/03	MVB885R4	4PK885
					→10/03	TB731	123x22
					→10/03	TBK340	
					A/C(-), →10/03	MVB887R4	4PK887
					A/C(+), →10/03	MVB1000R4	4PK1000
1.9 16V		84	09/98 → 05/04			MVB920R4	4PK920
						TB398	133x25.4
						TBK343	
					A/C(-)	MVB1030R5	5PK1030
					A/C(+)	MVB1165R5	5PK1165
2.0	FS7E, FS7G	96	01/01 → 05/04			MVB920R4	4PK920
						TB371	135x25.4
						TBK295	
					A/C(-)	MVB1030R5	5PK1030
					A/C(+)	MVB1165R5	5PK1165
2.0 D		52	09/98 → 05/04		A/C(-), →09/00	SVB10888	10x888
					A/C(+), →09/00	SVB131050	13x1050
					→09/00	TB541	149x24
					→09/00	SVB13850	13x850
2.0 TD		66	09/98 → 05/04		A/C(-), →09/00	SVB13900	13x900
					A/C(+), →09/00	SVB131050	13x1050
					→09/00	TB685	153x27

626 II (GC)

1.6	F6	59	11/82 → 06/87		MS, 08/85 →	MVB950R5	5PK950
					PS, 08/85 →	MVB1050R5	5PK1050
					A/C(-), MS, →07/85	MVB810R4	4PK810
					A/C(-), MS, 08/85 →	MVB870R4	4PK870
					A/C(-), PS, →07/85	MVB975R5	5PK975
					A/C(-), PS, 08/85 →	MVB1015R5	5PK1015
					A/C(+), MS, 08/85 →	MVB648R4	4PK648
					→07/85, → Ch. 558597	TB169	106x19
					→07/85, Ch. 558598 →	TB212	106x19
					08/85 →	TB260	106x22
2.0	FE	74	03/83 → 09/87		MS, 08/85 →	MVB950R5	5PK950
					PS, 08/85 →	MVB1050R5	5PK1050
					08/87 →	MVB760R3	3PK760
					A/C(-), MS, →07/85	MVB810R4	4PK810
					A/C(-), MS, 08/85 →	MVB870R4	4PK870
					A/C(-), PS, →07/85	MVB975R5	5PK975
					A/C(+), 08/85 →	MVB648R4	4PK648
					→07/85, → Ch. 607986	TB164	109x19
					→07/85, Ch. 607987 →	TB211	109x19
					08/85 →	TB264	109x22
					A/C(-), 08/85 →	MVB1015R5	5PK1015
					A/C(+), 08/87 →	MVB1060R5	5PK1060
		88	01/86 → 09/87		MS	MVB950R5	5PK950
					PS	MVB1050R5	5PK1050
					A/C(-), MS	MVB870R4	4PK870
					A/C(-), PS	MVB1015R5	5PK1015
					A/C(+)	MVB648R4	4PK648
						TB264	109x22





kW



...MAZDA

...626 II (GC)

...2.0		68	11/86 → 09/87		MS PS A/C(-), MS A/C(-), PS A/C(+)	MVB950R5 MVB1050R5 MVB870R4 MVB1015R5 MVB648R4 TB264	5PK950 5PK1050 4PK870 5PK1015 4PK648 109x22
2.0 D	RF46	46	01/83 → 06/87		PS A/C(+), MS	SVB131050 SVB13925 TB395 TB396	13x1050 13x925 148x25.4 78x19

626 II Hatchback (GC)

1.6	F6	59	03/83 → 09/87		MS, 08/85 → PS, 08/85 → A/C(-), MS, →07/85 A/C(-), MS, 08/85 → A/C(-), PS, →07/85 A/C(-), PS, 08/85 → A/C(+), MS, 08/85 → →07/85, → Ch. 558597 →07/85, Ch. 558598 → 08/85 →	MVB950R5 MVB1050R5 MVB810R4 MVB870R4 MVB975R5 MVB1015R5 MVB648R4 TB169 TB212 TB260	5PK950 5PK1050 4PK810 4PK870 5PK975 5PK1015 4PK648 106x19 106x19 106x22
		55	03/83 → 09/87		MS, 08/85 → PS, 08/85 → A/C(-), MS, →07/85 A/C(-), MS, 08/85 → A/C(-), PS, →07/85 A/C(-), PS, 08/85 → A/C(+), MS, 08/85 → →07/85, → Ch. 558597 →07/85, Ch. 558598 → 08/85 →	MVB950R5 MVB1050R5 MVB810R4 MVB870R4 MVB975R5 MVB1015R5 MVB648R4 TB169 TB212 TB260	5PK950 5PK1050 4PK810 4PK870 5PK975 5PK1015 4PK648 106x19 106x19 106x22
2.0	FE	74	03/83 → 09/87		MS, 08/85 → PS, 08/85 → 08/87 → A/C(-), MS, →07/85 A/C(-), MS, 08/85 → A/C(-), PS, →07/85 A/C(+), 08/85 → →07/85, → Ch. 607986 →07/85, Ch. 607987 → 08/85 → 08/87 → 08/87 → A/C(-), 08/85 → A/C(+), 08/87 →	MVB950R5 MVB1050R5 MVB760R3 MVB810R4 MVB870R4 MVB975R5 MVB648R4 TB164 TB211 TB264 TB301 MVB1015R5 MVB1060R5	5PK950 5PK1050 3PK760 4PK810 4PK870 5PK975 4PK648 109x19 109x19 109x22 108x25.4 5PK1015 5PK1060
		88	01/86 → 09/87		MS PS A/C(-), MS A/C(-), PS A/C(+)	MVB950R5 MVB1050R5 MVB870R4 MVB1015R5 MVB648R4 TB264	5PK950 5PK1050 4PK870 5PK1015 4PK648 109x22
		68	01/85 → 09/87		MS, 08/85 → PS, 08/85 → A/C(-), MS, 08/85 → A/C(-), PS, 08/85 → A/C(+), 08/85 → 08/85 →	MVB950R5 MVB1050R5 MVB870R4 MVB1015R5 MVB648R4 TB264	5PK950 5PK1050 4PK870 5PK1015 4PK648 109x22
2.0 D	RF46	46	03/84 → 06/87		PS A/C(+), MS	SVB131050 SVB13925 TB395 TB396	13x1050 13x925 148x25.4 78x19



kW



MAZDA

...MAZDA

626 III (GD)

1.6		60	06/87 → 05/92		MS, →07/87 PS, →07/87 A/C(-), MS, →07/87 A/C(-), PS, →07/87 A/C(+), MS, →07/87 →07/87	MVB950R5 MVB1050R5 MVB870R4 MVB1015R5 MVB648R4 TB260	5PK950 5PK1050 4PK870 5PK1015 4PK648 106x22
1.8	F8	65	11/87 → 05/92		MS, →07/91 →07/91 →07/91 A/C(-), →07/91 A/C(+), →07/91	MVB950R5 MVB760R3 TB282 MVB1015R5 MVB1060R5	5PK950 3PK760 104x25.4 5PK1015 5PK1060
2.0	FE	66	09/87 → 10/90		MS A/C(-) A/C(+)	MVB950R5 MVB760R3 TB301 MVB1015R5 MVB1060R5	5PK950 3PK760 108x25.4 5PK1015 5PK1060
2.0 12V	FE (12V)	79	09/87 → 05/92		MS, →07/91 →07/91 →07/91 A/C(-), →07/91 A/C(+), →07/91	MVB950R5 MVB760R3 TB301 MVB1015R5 MVB1060R5	5PK950 3PK760 108x25.4 5PK1015 5PK1060
2.0 16V	FE Kat. (16V)	103	11/87 → 05/92		MS, →07/91 →07/91 →07/91 →07/91 A/C(-), →07/91 A/C(+), →07/91	MVB950R5 MVB760R3 TB280 TBK293 MVB1015R5 MVB1060R5	5PK950 3PK760 168x25.4 5PK1015 5PK1060
		109	07/87 → 09/89		MS A/C(-) A/C(+)	MVB950R5 MVB760R3 TB280 TBK293 MVB1015R5 MVB1060R5	5PK950 3PK760 168x25.4 5PK1015 5PK1060
2.0 D	RF-N	44	07/87 → 07/91		Ch. GD-567183 → MS	SVB13900 TB382 SVB13850 SVB13710	13x900 162x30 13x850 13x710
2.2 12V	F2	85	11/87 → 07/91		MS A/C(-) A/C(+)	MVB950R5 MVB760R3 TB358 MVB1015R5 MVB1060R5	5PK950 3PK760 110x25.4 5PK1015 5PK1060

626 III Coupe (GD)

1.6		60	06/87 → 05/92		MS, →07/87 PS, →07/87 A/C(-), MS, →07/87 A/C(-), PS, →07/87 A/C(+), MS, →07/87 →07/87	MVB950R5 MVB1050R5 MVB870R4 MVB1015R5 MVB648R4 TB260	5PK950 5PK1050 4PK870 5PK1015 4PK648 106x22
1.8	F8	65	09/87 → 08/91		MS A/C(-) A/C(+)	MVB950R5 MVB760R3 TB282 MVB1015R5 MVB1060R5	5PK950 3PK760 104x25.4 5PK1015 5PK1060
2.0	FE	66	09/87 → 10/90		MS A/C(-) A/C(+)	MVB950R5 MVB760R3 TB301 MVB1015R5 MVB1060R5	5PK950 3PK760 108x25.4 5PK1015 5PK1060



kW



MAZDA

...MAZDA

...626 III Coupe (GD)

2.0 12V	FE (12V)	79	09/87 → 12/88	 	MS	MVB950R5 MVB760R3 TB301 MVB1015R5 MVB1060R5	5PK950 3PK760 108x25.4 5PK1015 5PK1060
2.0 16V	FE Kat. (16V)	103	12/87 → 10/90	 	MS	MVB950R5 MVB760R3 TB280 TBK293 MVB1015R5 MVB1060R5	5PK950 3PK760 168x25.4 5PK1015 5PK1060
		109	06/87 → 09/89	 	MS	MVB950R5 MVB760R3 TB280 TBK293 MVB1015R5 MVB1060R5	5PK950 3PK760 168x25.4 5PK1015 5PK1060
2.2 12V	F2	85	04/88 → 12/91	 	MS, →07/91 →07/91 →07/91	MVB950R5 MVB760R3 TB358	5PK950 3PK760 110x25.4
				 	A/C(-), →07/91 A/C(+), →07/91	MVB1015R5 MVB1060R5	5PK1015 5PK1060

626 III Hatchback (GD)

1.6		60	06/87 → 05/92	 	MS, →07/87 PS, →07/87 A/C(-), MS, →07/87 A/C(-), PS, →07/87 A/C(+), MS, →07/87 →07/87	MVB950R5 MVB1050R5 MVB870R4 MVB1015R5 MVB648R4 TB260	5PK950 5PK1050 4PK870 5PK1015 4PK648 106x22
				 	→07/91 →07/91 A/C(-), →07/91 A/C(+), →07/91	MVB950R5 MVB760R3 TB282 MVB1015R5 MVB1060R5	5PK950 3PK760 104x25.4 5PK1015 5PK1060
1.8	F8	65	11/87 → 05/92	 	MS, →07/91 →07/91 →07/91	MVB950R5 MVB760R3 TB282	5PK950 3PK760 104x25.4
				 	→07/91 →07/91 A/C(-), →07/91 A/C(+), →07/91	MVB1015R5 MVB1060R5	5PK1015 5PK1060
		69	11/87 → 05/92	 	MS, →07/91 →07/91 →07/91	MVB950R5 MVB760R3 TB282	5PK950 3PK760 104x25.4
				 	A/C(-), →07/91 A/C(+), →07/91	MVB1015R5 MVB1060R5	5PK1015 5PK1060
2.0	FE	66	09/87 → 10/90	 	MS	MVB950R5 MVB760R3 TB301	5PK950 3PK760 108x25.4
				 	A/C(-) A/C(+)	MVB1015R5 MVB1060R5	5PK1015 5PK1060
2.0 4x4		110	08/89 → 07/91	 	MS	MVB950R5 MVB760R3 TB280 TBK293	5PK950 3PK760 168x25.4
2.0 12V	FE (12V)	79	11/87 → 05/92	 	MS, →07/91 →07/91 →07/91	MVB950R5 MVB760R3 TB301	5PK950 3PK760 108x25.4
				 	A/C(-), →07/91 A/C(+), →07/91	MVB1015R5 MVB1060R5	5PK1015 5PK1060



kW



...MAZDA

...626 III Hatchback (GD)

2.0 16V	FE Kat. (16V)	103	11/87 → 10/90		MS	MVB950R5	5PK950
						MVB760R3	3PK760
						TB280	168x25.4
						TBK293	
					A/C(-)	MVB1015R5	5PK1015
					A/C(+)	MVB1060R5	5PK1060
		109	06/87 → 08/89		MS	MVB950R5	5PK950
						MVB760R3	3PK760
						TB280	168x25.4
						TBK293	
					A/C(-)	MVB1015R5	5PK1015
					A/C(+)	MVB1060R5	5PK1060
2.0 D	RF-N	44	07/87 → 07/91		Ch. GD-567183 →	SVB13900	13x900
						TB382	162x30
						SVB13850	13x850
					MS	SVB13710	13x710
2.2 12V	F2	85	06/88 → 04/92		MS, →07/91	MVB950R5	5PK950
					→07/91	MVB760R3	3PK760
					→07/91	TB358	110x25.4
					A/C(-), →07/91	MVB1015R5	5PK1015
					A/C(+), →07/91	MVB1060R5	5PK1060

626 III Station Wagon (GV)

1.8	F8	65	01/88 → 03/92		MS	MVB950R5	5PK950
						MVB760R3	3PK760
						TB282	104x25.4
					A/C(-)	MVB1015R5	5PK1015
					A/C(+)	MVB1060R5	5PK1060
2.0	FE	66	10/88 → 09/97		MS	MVB950R5	5PK950
						MVB760R3	3PK760
					DOHC	TB280	168x25.4
					SOHC/OHC	TB301	108x25.4
					A/C(-)	MVB1015R5	5PK1015
					A/C(+)	MVB1060R5	5PK1060
2.0 12V	FE (12V)	81	09/87 → 01/90		MS, 03/88 →	MVB950R5	5PK950
					03/88 →	MVB760R3	3PK760
					03/88 →	TB301	108x25.4
					A/C(-), 03/88 →	MVB1015R5	5PK1015
					A/C(+), 03/88 →	MVB1060R5	5PK1060
2.0 16V	FE Kat. (16V)	103	01/88 → 03/92		MS	MVB950R5	5PK950
						MVB760R3	3PK760
						TB280	168x25.4
						TBK293	
					A/C(-)	MVB1015R5	5PK1015
					A/C(+)	MVB1060R5	5PK1060
2.0 D	RF-N	44	09/88 → 07/91		→ Ch. GV1-204490	SVB13925	13x925
						SVB13900	13x900
						TB382	162x30
						SVB13850	13x850
					MS	SVB13710	13x710
		60	11/94 → 09/97			MVB688R5	5PK688
						SVB13925	13x925
						TB382	162x30
						SVB13850	13x850
2.0 D Complex	RF-CX	55	05/93 → 11/96			MVB688R5	5PK688
						SVB13925	13x925
						TB382	162x30
						SVB13850	13x850



kW



MAZDA

...MAZDA

...626 III Station Wagon (GV)

2.0 i		110	11/94 → 09/97		MS	MVB950R5 MVB760R3 TB280 TBK293	5PK950 3PK760 168x25.4
					A/C(-) A/C(+)	MVB1015R5 MVB1060R5	5PK1015 5PK1060
2.2 12V	F2	85	03/89 → 11/96		MS PS	MVB950R5 MVB1060R5 MVB760R3 TB358	5PK950 5PK1060 3PK760 110x25.4
					A/C(-), →03/92	MVB1015R5	5PK1015
2.2 12V 4WD	F2, F2L1	85	05/91 → 11/92		MS PS	MVB950R5 MVB1060R5 MVB760R3 TB358	5PK950 5PK1060 3PK760 110x25.4
					A/C(-), →03/92	MVB1015R5	5PK1015

626 IV (GE)

1.8 i	FP	77	01/92 → 04/97			MVB920R4 TB398 TBK343	4PK920 133x25.4
					A/C(-) A/C(+)	MVB1030R5 MVB1148R5	5PK1030 5PK1148
		66	08/94 → 04/97			MVB920R4 TB398 TBK343	4PK920 133x25.4
					A/C(-) A/C(+)	MVB1030R5 MVB1148R5	5PK1030 5PK1148
2.0 D GLX Complex	RF OHC	55	10/92 → 04/97			MVB688R5 SVB13925 TB382 SVB13850	5PK688 13x925 162x30 13x850
2.0 i	FS	85	01/92 → 04/97			MVB920R4 TB371 TBK295	4PK920 135x25.4
					A/C(-) A/C(+)	MVB1030R5 MVB1165R5	5PK1030 5PK1165
2.0 i 4WD	FS	85	04/92 → 04/97			MVB920R4 TB371 TBK295	4PK920 135x25.4
					A/C(-) A/C(+)	MVB1030R5 MVB1165R5	5PK1030 5PK1165

626 IV Hatchback (GE)

1.8	FP	77	08/91 → 04/97			MVB920R4 TB398 TBK343	4PK920 133x25.4
					A/C(-) A/C(+)	MVB1030R5 MVB1148R5	5PK1030 5PK1148
		66	08/94 → 04/97			MVB920R4 TB398 TBK343	4PK920 133x25.4
					A/C(-) A/C(+)	MVB1030R5 MVB1148R5	5PK1030 5PK1148
2.0 D GLX Complex	RF OHC	55	01/93 → 04/97			MVB688R5 SVB13925 TB382 SVB13850	5PK688 13x925 162x30 13x850
2.0 i	FS	85	08/91 → 04/97			MVB920R4 TB371 TBK295	4PK920 135x25.4
					A/C(-) A/C(+)	MVB1030R5 MVB1165R5	5PK1030 5PK1165



kw



MAZDA

...MAZDA

...626 IV Hatchback (GE)

2.0 i 4WD	FS	85	04/92 → 04/97	 		MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4 5PK1030 5PK1165
2.5 24V	KL	121	01/92 → 04/97	 	A/C(-) A/C(+)	MVB865R5 MVB1015R5 TB399 MVB920R4	5PK865 5PK1015 192x30 4PK920
		120	08/94 → 04/97	 	A/C(-) A/C(+)	MVB865R5 MVB1015R5 TB399 MVB920R4	5PK865 5PK1015 192x30 4PK920

626 V (GF)

1.8		66	05/97 → 12/99	 		MVB920R4 TB398 TBK343 MVB1030R5 MVB1165R5	4PK920 133x25.4 5PK1030 5PK1165
	FP9A	74	12/99 → 10/02	 	→04/02 →04/02 →04/02	MVB920R4 TB398 TBK343 MVB1030R5 MVB1165R5	4PK920 133x25.4 5PK1030 5PK1165
2.0	FS	85	05/97 → 10/02	 	→04/02 →04/02 →04/02	MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4 5PK1030 5PK1165
	FS2C	100	04/98 → 10/02	 	→04/02 →04/02 →04/02	MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4 5PK1030 5PK1165
2.0 DITD	RF3F	66	04/98 → 10/02	 	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27
2.0 TD		81	10/00 → 10/02	 	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27
2.0 Turbo DI		74	04/98 → 10/02	 	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27

626 V Hatchback (GF)

1.8		66	05/97 → 12/99	 		MVB920R4 TB398 TBK343 MVB1030R5 MVB1165R5	4PK920 133x25.4 5PK1030 5PK1165
		74	12/99 → 10/02	 	→04/02 →04/02 →04/02	MVB920R4 TB398 TBK343 MVB1030R5 MVB1165R5	4PK920 133x25.4 5PK1030 5PK1165
2.0	FS	85	05/97 → 10/02	 	→04/02 →04/02 →04/02	MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4 5PK1030 5PK1165



kW



...MAZDA

...626 V Hatchback (GF)

2.0 DITD	RF3F	66	04/98 → 10/02	 	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27
2.0 H.P.	FS2C	100	02/98 → 10/02	 KIT 	→04/02 →04/02 →04/02 A/C(-), →04/02 A/C(+), →04/02	MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4 5PK1030 5PK1165
2.0 TD		81	10/00 → 10/02	 	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27
2.0 Turbo DI		74	04/98 → 10/02	 	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27

626 V Station Wagon (GW)

1.8		66	02/98 → 01/00	 KIT 	A/C(-) A/C(+)	MVB920R4 TB398 TBK343 MVB1030R5 MVB1165R5	4PK920 133x25.4 5PK1030 5PK1165
	FP9A	74	01/00 → 10/02	 KIT 	A/C(-) A/C(+)	MVB920R4 TB398 TBK343 MVB1030R5 MVB1165R5	4PK920 133x25.4 5PK1030 5PK1165
2.0	FS	85	02/98 → 10/02	 KIT 	A/C(-) A/C(+)	MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4 5PK1030 5PK1165
2.0 DITD	RF3F	66	09/99 → 10/02	 	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27
2.0 H.P.	FS2C	100	02/98 → 10/02	 KIT 	A/C(-) A/C(+)	MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4 5PK1030 5PK1165
2.0 TD		81	10/00 → 10/02	 	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27
2.0 Turbo DI	RF4F	74	04/98 → 10/02	 	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27

929 I (LA)

2.0	M, MA	66	05/79 → 07/86	 	→10/83 →10/83 →10/83 →10/83	SVB13900 SVB131000 SVB13950 SVB13875	13x900 13x1000 13x950 13x875
-----	-------	----	---------------	--------------	--------------------------------------	---	---------------------------------------

929 II (HB)

2.0	HEE, MA	66	05/82 → 03/84	 	→10/83 →10/83 →10/83 →10/83	SVB13900 SVB131000 SVB13950 SVB13875	13x900 13x1000 13x950 13x875
	FE	74	03/84 → 07/87	 	→11/86 →11/86 →11/86, → Eng Nr 520709 →11/86, Eng Nr 520710→ →11/86	SVB13900 SVB13750 TB164 TB211 SVB13850	13x900 13x750 109x19 109x19 13x850



kw



MAZDA

...MAZDA

...929 II (HB)

2.0 i GLX	FE	88	10/84 → 07/87	☼ ⊖ ☼ ☼ ⊕	→11/86 →11/86 →11/86, → Eng Nr 520709 →11/86, Eng Nr 520710→ →11/86	SVB13900 SVB13750 TB164 TB211 SVB13850	13x900 13x750 109x19 109x19 13x850
-----------	----	----	---------------	-----------------------	---	---	--

929 II Coupe (HB)

2.0	HEE, MA	66	05/82 → 03/84	☼ ⊖ ⊖ ⊕	→10/83 →10/83 →10/83 →10/83	SVB13900 SVB131000 SVB13950 SVB13875	13x900 13x1000 13x950 13x875
	FE	74	03/84 → 07/87	☼ ⊖ ☼ ☼ ⊕	→11/86 →11/86 →11/86, → Eng Nr 520709 →11/86, Eng Nr 520710→ →11/86	SVB13900 SVB13750 TB164 TB211 SVB13850	13x900 13x750 109x19 109x19 13x850
2.0 i	FE	88	10/84 → 07/87	☼ ⊖ ☼ ☼ ⊕	→11/86 →11/86 →11/86, → Eng Nr 520709 →11/86, Eng Nr 520710→ →11/86	SVB13900 SVB13750 TB164 TB211 SVB13850	13x900 13x750 109x19 109x19 13x850

929 II Station Wagon (HV)

2.0	HEE, MA	66	01/83 → 12/87	☼ ⊖ ⊖ ☼ ☼ ⊕	→ Eng Nr 520709 →11/86, Eng Nr 520710→ 12/86→	SVB13900 SVB131000 SVB13950 TB164 TB211 TB301 SVB13875	13x900 13x1000 13x950 109x19 109x19 108x25.4 13x875
-----	---------	----	---------------	----------------------------	---	---	---

929 III (HC)

2.0	FE, FEFA	85	06/87 → 12/88	☼ ⊖ ☼ ⊕		SVB13950 SVB131025 TB301 SVB13825	13x950 13x1025 108x25.4 13x825
2.2 12V	F2, F21, F2E	85	01/88 → 04/89	☼ ⊖ ☼ ⊕		SVB13950 SVB131025 TB358 SVB13825	13x950 13x1025 110x25.4 13x825
	F2-C	94	04/89 → 06/91	☼ ⊖ ☼ ⊕		SVB13950 SVB131025 TB358 SVB13825	13x950 13x1025 110x25.4 13x825
2.2 i	F2-EGI	100	05/87 → 12/88	☼ ⊖ ☼ ⊕		SVB13950 SVB131025 TB358 SVB13825	13x950 13x1025 110x25.4 13x825
3.0	JE3	125	01/88 → 12/89	☼ ⊖ ☼ ⊕	MS	SVB131000 SVB131025 TB517 SVB13950	13x1000 13x1025 173x30 13x950
	JE	140	06/87 → 06/91	☼ ⊖ ☼ ⊕	MS	SVB131000 SVB131025 TB517 SVB13950	13x1000 13x1025 173x30 13x950
	JE3	123	01/90 → 06/91	☼ ⊖ ☼ ⊕	MS	SVB131000 SVB131025 TB517 SVB13950	13x1000 13x1025 173x30 13x950

B-SERIE (UD)

1.8	H816, H817	62	10/81 → 08/85	⊖ ⊕	→12/84 →12/84	SVB131025 SVB13975	13x1025 13x975
-----	------------	----	---------------	--------	------------------	-------------------------------------	-------------------





kW



...MAZDA

B-SERIE (UF)

2.0		62	01/85 → 12/91		→11/89	SVB13975	13x975
					11/89 →	SVB131000	13x1000
					→ Ch. 505517	TB211	109x19
					Ch. 505518 →	TB264	109x22
					→11/89	SVB13725	13x725
					11/89 →	SVB13850	13x850
65	01/85 → 03/96		→11/89	SVB13975	13x975		
			11/89 → 09/94	SVB131000	13x1000		
			→09/94	TB264	109x22		
			→09/94, → Ch. 505517	TB211	109x19		
			→09/94	SVB13850	13x850		
			→11/89	SVB13725	13x725		
2.2	F2L8	68	08/91 → 12/96		→03/96	SVB131000	13x1000
					→03/96	SVB13950	13x950
					→03/96	TB358	110x25.4
					→03/96	SVB13825	13x825
2.2 D	R290	47	01/85 → 03/96			SVB131125	13x1125
						TB271	164x25.4
						SVB13850	13x850
2.5 D 4WD		57	09/98 → 06/99		02/99 →, → Ch. 425318	SVB131000	13x1000
					A/C(+), 02/99 →	SVB131100	13x1100
					02/99 →	TB536	101x30
		63	02/96 → 06/99		→01/99	SVB131100	13x1100
					→01/99	TB536	101x30

B-SERIE (UN)

2.2 4WD	R5A2	60	02/99 →		→08/02	SVB13950	13x950
					→08/02	TB358	110x25.4
					→08/02	SVB13825	13x825
2.2 8V 4WD	JL22	68	06/99 →		→08/02	SVB13950	13x950
					→08/02	TB358	110x25.4
					→08/02	SVB13825	13x825
2.5 D	MD25NA	57	06/99 →		→05/06, → Ch. 425318	SVB131000	13x1000
					05/06 → 07/06, Ch. 425319 →	SVB13975	13x975
					A/C(+), →07/06	SVB131100	13x1100
	WLE7	62	12/02 →		→07/06	TB536	101x30
					→05/06, → Ch. 425318	SVB131000	13x1000
					05/06 → 07/06, Ch. 425319 →	SVB13975	13x975
2.5 D 4WD	MD25NA	57	06/99 →		A/C(+), →07/06	SVB131100	13x1100
					→07/06	TB536	101x30
					→05/06, → Ch. 425318	SVB131000	13x1000
	WLE7	62	12/02 →		05/06 → 07/06, Ch. 425319 →	SVB13975	13x975
					A/C(+), →07/06	SVB131100	13x1100
					→07/06	TB536	101x30
2.5 TD 4WD	MD25TI	80	06/99 →		→05/06, → Ch. 425318	SVB131000	13x1000
					05/06 → 07/06, Ch. 425319 →	SVB13975	13x975
					A/C(+), →07/06	SVB131100	13x1100
	JK26	90	06/99 →		→07/06	TB536	101x30
					→07/02	SVB131175	13x1175
					→07/02	SVB131060	13x1060
					→07/02	SVB13950	13x950

BT-50

2.5 CD 4WD		105	12/06 →			SVB13975	13x975
						SVB131100	13x1100



kw



MAZDA

...MAZDA

CX-7

MZR DISI Turbo	190	10/07 →	⊗	AUTO	MVB2280R6	6PK2280
			⊗	MAN	MVB2315R6	6PK2315

DEMIO (DW)

1.3 16V	46	08/98 →	⊗	→10/02	MVB885R4	4PK885
			⊗	→10/02	TB289	107x22
			⊗	→10/02	TBK072	
			⊗	A/C(+), →10/02	MVB875R4	4PK875
B3 (16V)	53	08/98 → 04/00	⊗		MVB885R4	4PK885
			⊗		TB289	107x22
			⊗		TBK072	
			⊗	A/C(-)	MVB850R4	4PK850
			⊗	A/C(+)	MVB960R4	4PK960
1.5 16V	55	04/00 →	⊗	→10/02	TB289	107x22
			⊗	→10/02	TBK072	
			⊗	A/C(+), →10/02	MVB875R4	4PK875

E 2000,2200 Box (SR2)

2.0	FE60, FE61	60	03/91 → 05/94	⊗		SVB131000	13x1000
				⊗		SVB13950	13x950
				⊗		TB301	108x25.4
				⊗		SVB13775	13x775
	FE	70	06/94 →	⊗	→03/97	SVB131000	13x1000
				⊗	→08/99	SVB13950	13x950
				⊗	09/99→09/04	MVB925R4	4PK925
				⊗	→09/04	TB301	108x25.4
				⊗	→08/99	SVB13775	13x775
				⊗	09/99→09/04	MVB975R4	4PK975
	FE18, FE58	63	05/85 → 04/89	⊗		SVB13950	13x950
				⊗		SVB131000	13x1000
				⊗	→10/87, → Ch. SDX081-500010	TB164	109x19
				⊗	→10/87,	TB211	109x19
					Ch.		
					SDX081-500011→SDX081-500065		
				⊗	→10/87, Ch. SDX081-500066→	TB264	109x22
				⊗	11/87→	TB301	108x25.4
				⊗		SVB13775	13x775
2.0 4x4		71	04/97 → 08/99	⊗		SVB13950	13x950
				⊗		TB301	108x25.4
				⊗		SVB13825	13x825
		63	11/87 → 09/89	⊗		SVB131000	13x1000
				⊗		SVB13950	13x950
				⊗		TB301	108x25.4
				⊗		SVB13825	13x825
		65	01/88 → 07/91	⊗		SVB131000	13x1000
				⊗		SVB13950	13x950
				⊗		TB301	108x25.4
				⊗		SVB13825	13x825
2.2 D	R203, R207	46	05/85 → 02/88	⊗		SVB13900	13x900
				⊗	→ Ch. SD1.32-705777	SVB131125	13x1125
				⊗	11/87→, Ch. SR1H32-726219→	SVB131175	13x1175
				⊗		TB271	164x25.4
				⊗	11/87→	SVB13875	13x875
		47	03/91 →	⊗	→03/97	SVB13900	13x900
				⊗	→03/97, → Ch. SD1.32-705777	SVB131125	13x1125
				⊗	→03/97, Ch. SR1H32-726219→	SVB131175	13x1175
				⊗	→03/97	TB271	164x25.4
				⊗	→03/97	SVB13875	13x875
	R2	52	02/97 → 08/02	⊗		SVB131175	13x1175
				⊗		TB590	162x25.4
				⊗	→08/99	SVB13875	13x875
				⊗	09/99→	SVB13900	13x900





kW



MAZDA

...MAZDA

...E 2000,2200 Box (SR2)

2.2 D 4WD	R203, R207	47	03/91 →	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→03/97 →03/97, → Ch. SD1.32-705777 →03/97, Ch. SR1H32-726219→ →03/97 →03/97	SVB13900 SVB131125 SVB131175 TB271 SVB13950	13x900 13x1125 13x1175 164x25.4 13x950
	R2	52	02/97 →	⚙️ ⚙️ ⚙️	→08/99 →08/99 →08/99	SVB131175 TB590 SVB13925	13x1175 162x25.4 13x925

E 2000,2200 Bus (SR1)

2.0	FE18, FEV4	63	11/84 → 02/88	⚙️ ⚙️ ⚙️ ⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→10/87, → Ch. SRY0E1-502732 →10/87, Ch. SDX081-500011→SDX081-500065 →10/87, Ch. SRY0E1-516782→ 11/87→	SVB13950 SVB131000 TB164 TB211 TB264 TB301 SVB13775	13x950 13x1000 109x19 109x19 109x22 108x25.4 13x775
2.0 4WD	FEBN	60	10/88 → 09/89	⚙️ ⚙️ ⚙️ ⚙️		SVB131000 SVB13950 TB301 SVB13825	13x1000 13x950 108x25.4 13x825
2.2 D	R207	46	01/84 → 02/88	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→ Ch. SD1.32-705777 11/87→, Ch. SR1H32-726219→ 11/87→	SVB13900 SVB131125 SVB131175 TB271 SVB13875	13x900 13x1125 13x1175 164x25.4 13x875

FESTIVA

1.1		40	04/89 → 10/90	⚙️ ⚙️ ⚙️ ⚙️	Ch. 100001→200000 Ch. 200001→350000 A/C(-) A/C(+)	SVB10888 TB266 TB289 MVB800R4 MVB950R4	10x888 107x21.6 107x22 4PK800 4PK950
-----	--	----	---------------	----------------------	--	---	--

MPV I (LV)

2.5 TD		85	05/96 → 09/99	⚙️ ⚙️ ⚙️	→05/99 →05/99 →05/99	SVB131000 SVB131100 TB536	13x1000 13x1100 101x30
3.0 i V6	JE94	113	03/95 → 09/99	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→05/99 →05/99 →05/99 →05/99	SVB131000 SVB131025 TB517 SVB13950 SVB131000	13x1000 13x1025 173x30 13x950 13x1000
		109	05/96 → 09/99	⚙️ ⚙️ ⚙️ ⚙️	→05/99 →05/99 →05/99 →05/99	SVB131025 TB517 SVB13950	13x1025 173x30 13x950

MPV II (LW)

2.0	FS-DS	90	09/99 → 08/00	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	A/C(+)	MVB925R4 TB371 TBK295 MVB1165R5	4PK925 135x25.4 5PK1165
	FS	88	08/00 → 07/02	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→02/02 →02/02 →02/02 A/C(+), →02/02	MVB925R4 TB371 TBK295 MVB1165R5	4PK925 135x25.4 5PK1165
2.0 DI	RF5C	100	07/02 →	⚙️ ⚙️	→10/05 →10/05	MVB1230R8 TB751	8PK1230 153x30
2.3		104	07/02 →	⚙️		MVB2280R6	6PK2280
2.5 V6	GY-DE	125	09/99 → 03/02	⚙️ ⚙️		MVB2100R6 MVB683R3	6PK2100 3PK683
3.0 V6		147	03/02 →	⚙️ ⚙️	10/02→10/05 10/02→08/03	MVB2080R6 MVB683R3	6PK2080 3PK683



kW



MAZDA

...MAZDA

MX-3 (EC)

1.6 i	B69	65	07/91 →		→10/93	MVB1000R4	4PK1000
					→10/93	MVB885R4	4PK885
					→10/93	TB289	107x22
					→10/93	TBK072	
					→10/93	MVB887R4	4PK887
	B6D	79	01/94 →		→12/98	MVB1015R4	4PK1015
					→12/98	MVB885R4	4PK885
					→12/98	TB294	145x22
					→12/98	TBK342	
					→12/98	MVB887R4	4PK887
1.8 i V6	K819	98	01/92 → 01/94		A/C(-)	MVB865R5	5PK865
					A/C(+)	MVB1015R5	5PK1015
						TB399	192x30
						MVB920R4	4PK920
						MVB865R5	5PK865
	K838	95	01/94 →		A/C(-), →12/98	MVB865R5	5PK865
					A/C(+), →12/98	MVB1015R5	5PK1015
					→12/98	TB399	192x30
					→12/98	MVB920R4	4PK920
					→12/98	MVB865R5	5PK865

MX-5 I (NA)

1.6	B64F	85	05/90 → 01/94			SVB13900	13x900
						TB294	145x22
						TBK342	
					A/C(-)	MVB855R4	4PK855
					A/C(+)	MVB960R4	4PK960
		66	01/95 → 04/98		→12/97	SVB13900	13x900
					→12/97	TB294	145x22
					→12/97	TBK342	
					A/C(-), →12/97	MVB855R4	4PK855
					A/C(+), →12/97	MVB960R4	4PK960
1.8	BPF1	96	02/94 → 04/98		→12/97	MVB885R4	4PK885
					→12/97	TB294	145x22
					→12/97	TBK342	
					→12/97	MVB855R4	4PK855
					→12/97	MVB855R4	4PK855

MX-5 II (NB)

1.6 16V		81	05/98 → 10/05			MVB885R4	4PK885	
						TB294	145x22	
						TBK342		
					A/C(-)	MVB860R4	4PK860	
					A/C(+)	MVB950R4	4PK950	
	1.8		103	01/98 → 07/02			MVB885R4	4PK885
							TB294	145x22
							TBK342	
						A/C(-)	MVB860R4	4PK860
						A/C(+)	MVB950R4	4PK950
1.8 16V	BP-ZE	103	05/98 → 10/05		08/00 →	MVB885R4	4PK885	
					08/00 →	TB294	145x22	
					08/00 →	TBK342		
					A/C(-), 08/00 →	MVB860R4	4PK860	
					A/C(+), 08/00 →	MVB950R4	4PK950	
	1.9 16V		107	11/00 → 10/05			MVB885R4	4PK885
							TB294	145x22
							TBK342	
						A/C(-)	MVB860R4	4PK860
						A/C(+)	MVB950R4	4PK950
			102	11/00 → 10/05			MVB885R4	4PK885
							TB294	145x22
							TBK342	
						A/C(-)	MVB860R4	4PK860
						A/C(+)	MVB950R4	4PK950



kW



MAZDA

...MAZDA

MX-5 III (NC)

1.8		93	03/05 →	⊗ ⊗ ⊗	A/C(-), 11/05 → A/C(+), 11/05 →	MVB2160R6 MVB2250R6	6PK2160 6PK2250
2.0		118	03/05 →	⊗ ⊗	A/C(-), 11/05 → A/C(+), 11/05 →	MVB2160R6 MVB2250R6	6PK2160 6PK2250

MX-6 (GE6)

2.0	FS	85	02/92 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	02/93 → 02/97 02/93 → 02/97 02/93 → 02/97 A/C(-), 02/93 → 02/97 A/C(+), 02/93 → 02/97	MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4
2.5 24V	KL	121	02/92 →	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), 02/93 → 02/97 A/C(+), 02/93 → 02/97 02/93 → 02/97 02/93 → 02/97	MVB865R5 MVB1015R5 TB399 MVB920R4	5PK865 5PK1015 192x30 4PK920
2.5 i 24V	KL	120	08/94 →	⊗ ⊗ ⊗ ⊗	A/C(-), → 02/97 A/C(+), → 02/97 → 02/97 → 02/97	MVB865R5 MVB1015R5 TB399 MVB920R4	5PK865 5PK1015 192x30 4PK920

PREMACY (CP)

1.8	FP	74	07/99 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→ 06/05 → 06/05 → 06/05 A/C(-), → 06/05 A/C(+), → 06/05	MVB920R4 TB398 TBK343 MVB1030R5 MVB1165R5	4PK920 133x25.4
1.9	FP	84	07/99 →	⊗ ⊗ ⊗ ⊗ ⊗	→ 06/05 → 06/05 → 06/05 A/C(-), → 06/05 A/C(+), → 06/05	MVB920R4 TB398 TBK343 MVB1030R5 MVB1165R5	4PK920 133x25.4
2.0	FS7E, FS7G	96	11/01 →	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB920R4 TB371 TBK295 MVB1030R5 MVB1165R5	4PK920 135x25.4
2.0 TD	RF3F	66	10/99 → 07/00	⊗ ⊗ ⊗	A/C(-) A/C(+)	SVB13900 SVB131050 TB685	13x900 13x1050 153x27
	RF4F	74	07/00 →	⊗ ⊗ ⊗	A/C(-), → 06/05 A/C(+), → 06/05 → 06/05	SVB13900 SVB131050 TB685	13x900 13x1050 153x27

RX 7 I (SA)

Wankel	12AN2	77	05/79 → 05/81	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		SVB10888 SVB131050 SVB10800 SVB10888 SVB131075 SVB10790 SVB13800 SVB10888 SVB131075 SVB10790 SVB13800	10x888 13x1050 10x800 10x888 13x1075 10x790 13x800 10x888 13x1075 10x790 13x800
		85	01/81 → 03/84	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	11/81 → 11/81 → 11/81 → 11/81 → → 10/85 → 10/85 → 10/85 → 10/85	SVB10888 SVB131075 SVB10790 SVB13800 SVB10888 SVB131075 SVB10790 SVB13800	10x888 13x1075 10x790 13x800 10x888 13x1075 10x790 13x800



kw



...MAZDA

RX 7 II (FC)

Turbo	RE13B	147	03/89 → 12/91	⊗		SVB10960	10x960
				⊗		SVB13975	13x975
				⊗		SVB10800	10x800
				⊗		SVB131050	13x1050
				⊗		SVB10900	10x900
		133	06/87 → 11/89	⊗	→03/89	SVB10975	10x975
				⊗	→03/89, Turbo	SVB10960	10x960
				⊗	03/89 →	SVB13975	13x975
				⊗	→03/89	SVB10790	10x790
				⊗	03/89 →	SVB10800	10x800
Wankel	RE13B	110	11/85 → 04/89	⊗		SVB10900	10x900
				⊗		SVB10975	10x975
				⊗		SVB10960	10x960
				⊗		SVB13975	13x975
				⊗		SVB10790	10x790
		110	11/85 → 04/89	⊗	03/89 →	SVB10800	10x800
				⊗		SVB131050	13x1050
				⊗		SVB10900	10x900
				⊗		SVB10975	10x975
				⊗		SVB10960	10x960

RX 7 III (FD)

Wankel Twin Turbo	RE13B	176	07/92 →	⊗	→02/96	MVB1360R5	5PK1360
				⊗	A/C(-), →02/96	MVB925R6	6PK925
				⊗	A/C(+), →02/96	MVB1045R6	6PK1045

RX 8 (SE17)

2.6		170	10/03 →	⊗		MVB775R4	4PK775
				⊗		MVB825R5	5PK825
		141	10/03 →	⊗		MVB775R4	4PK775
				⊗		MVB825R5	5PK825

TRIBUTE (EP)

2.0		91	03/00 →	⊗	A/C(-), 01/01 → 11/03	MVB1980R6	6PK1980
				⊗	A/C(+), 01/01 → 11/03	MVB2100R6	6PK2100
				⊗	01/01 → 11/03	TB633	129x25.4
2.0 4WD		91	03/00 →	⊗	A/C(-), 01/01 → 11/03	MVB1980R6	6PK1980
				⊗	A/C(+), 01/01 → 11/03	MVB2100R6	6PK2100
				⊗	01/01 → 11/03	TB633	129x25.4
3.0 V6 24V 4WD		145	03/00 →	⊗	01/01 → 11/03	MVB2080R6	6PK2080
				⊗	01/01 → 08/03	MVB683R3	3PK683

XEDOS 6 (CA)

1.6 16V	B6	79	06/94 →	⊗	→10/99	MVB885R4	4PK885	
				⊗	→10/99	TB294	145x22	
				⊗	→10/99	TBK342		
				⊗	A/C(-), →10/99	MVB887R4	4PK887	
				⊗	A/C(+), →10/99	MVB1000R4	4PK1000	
	B69	83	08/92 → 05/94		⊗		MVB885R4	4PK885
					⊗		TB294	145x22
					⊗		TBK342	
					⊗	A/C(-)	MVB887R4	4PK887
					⊗	A/C(+)	MVB1000R4	4PK1000
2.0 V6	KF1	106	01/92 → 05/94	⊗	A/C(-)	MVB865R5	5PK865	
				⊗	A/C(+)	MVB1015R5	5PK1015	
				⊗		TB399	192x30	
				⊗		MVB920R4	4PK920	
				⊗		MVB865R5	5PK865	
	103	06/94 →			⊗	A/C(-), →10/99	MVB1015R5	5PK1015
					⊗	A/C(+), →10/99	MVB1015R5	5PK1015
					⊗	→10/99	TB399	192x30
					⊗	→10/99	MVB920R4	4PK920



kW



...MAZDA

XEDOS 9 (TA)

2.0 24V	KF	105	08/93 → 01/00	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+) A/C(+)	MVB865R5 MVB1000R5 MVB1015R5 TB399 MVB920R4	5PK865 5PK1000 5PK1015 192x30 4PK920
2.3 24V	KJ-ZEM	155	02/95 → 01/00	⊗		MVB1605R7	7PK1605
2.5 24V	KL	123	07/93 → 07/00	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+) A/C(+)	MVB865R5 MVB1000R5 MVB1015R5 TB399 MVB920R4	5PK865 5PK1000 5PK1015 192x30 4PK920
2.5 V6	KL	120	07/00 →	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), →12/02 A/C(-), →12/02 A/C(+), →12/02 →12/02 →12/02 →12/02	MVB1000R5 MVB865R5 MVB1015R5 TB399 MVB905R4 MVB920R4	5PK1000 5PK865 5PK1015 192x30 4PK905 4PK920

MERCEDES-BENZ

/8 (W114)

230.6 (114.015)	M 180.954	88	01/68 → 11/76	⊗ ⊗ ⊗ ⊗	01/69 → 12/73 →12/68 01/69 → 12/73	SVB131325 SVB10940 SVB10925 SVB13825	13x1325 10x940 10x925 13x825
250	M 114.920	96	07/68 → 08/72	⊗ ⊗ ⊗ ⊗	→12/68 01/69 → 06/70	SVB131325 SVB10925 SVB10940 SVB13825	13x1325 10x925 10x940 13x825
250 (114.010)	M 114.920	85	01/68 → 08/72	⊗ ⊗ ⊗ ⊗	→12/68 01/69 → 06/70	SVB131325 SVB10925 SVB10940 SVB13825	13x1325 10x925 10x940 13x825
250 2.8 (114.023)	M 130.923	96	06/72 → 11/76	⊗ ⊗	→04/76 →04/76	SVB131350 SVB13825	13x1350 13x825
280 (114.060)	M 110.921	118	06/72 → 11/76	⊗ ⊗ ⊗		SVB131300 SVB10960 SVB13780	13x1300 10x960 13x780
280 E (114.062)	M 110.981	136	06/72 → 11/76	⊗ ⊗ ⊗		SVB131300 SVB10960 SVB13780	13x1300 10x960 13x780

/8 (W115)

200	M 115.923, M 115.926	70	01/68 → 01/77	⊗ ⊗ ⊗ ⊗	→01/76 →12/68 01/69 → 01/76 →01/76	SVB131375 SVB10925 SVB10940 SVB13750	13x1375 10x925 10x940 13x750
200 (115.015)	M 115.923, M 115.926	63	01/68 → 01/77	⊗ ⊗ ⊗ ⊗	→01/76 →12/68 01/69 → 01/76 →01/76	SVB131375 SVB10925 SVB10940 SVB13750	13x1375 10x925 10x940 13x750
200 D (115.115)	OM 615.913	40	01/68 → 01/77	⊗	→01/76	SVB10940	10x940
220 (115.010)	M 115.924	66	01/68 → 07/73	⊗ ⊗ ⊗ ⊗	06/68 → 01/69 → 06/68 → 12/68 06/68 →	SVB131375 SVB10940 SVB10925 SVB13750	13x1375 10x940 10x925 13x750
	M 115.920	77	01/68 → 07/73	⊗ ⊗ ⊗ ⊗	06/68 → 01/69 → 06/68 → 12/68 06/68 →	SVB131375 SVB10940 SVB10925 SVB13750	13x1375 10x940 10x925 13x750



kW



MERCEDÉS-BENZ

...MERCEDÉS-BENZ

.../8 (W115)

220 D (115.110)	OM 615.912	44	01/68 → 01/77	☼ ⊖ ⊖ ⊖ ⊖	→01/76 →12/68 01/69→01/76 →01/76	SVB131375 SVB10925 SVB10940 SVB13750	13x1375 10x925 10x940 13x750
230.4 (115.017)	M 115.951	81	08/73 → 12/76	⊖ ⊖	→01/76 →01/76	SVB10940 SVB13750	10x940 13x750
240 D (115.117)	OM 616.916	48	08/73 → 01/77	⊖ ⊖		SVB10960 SVB13750	10x960 13x750
240 D 3.0 (115.114)	OM 617.910	59	08/74 → 11/76	⊖	→01/76	SVB10975	10x975

/8 Coupe (W114)

250 C (114.021)	M 114.920	96	04/69 → 06/72	☼ ⊖ ⊖	→12/70	SVB131325 SVB10940 SVB13825	13x1325 10x940 13x825
250 C 2.8 (114.023)	M 130.923	96	06/72 → 11/76	☼ ⊖	→04/76 →04/76	SVB131350 SVB13825	13x1350 13x825
250 CE (114.022)	M 114.980	110	04/69 → 04/72	☼ ⊖ ⊖	→12/70	SVB131325 SVB10940 SVB13825	13x1325 10x940 13x825
280 C (114.073)	M 110.921	118	06/72 → 02/77	☼ ⊖ ⊖	→10/76 →10/76 →10/76	SVB131300 SVB10960 SVB13780	13x1300 10x960 13x780
280 CE (114.072)	M 110.981	136	06/72 → 01/77	☼ ⊖ ⊖		SVB131300 SVB10960 SVB13780	13x1300 10x960 13x780

100 Box (631)

D (631.332, 631.342)	OM 616.963	53	02/88 → 05/92	⊖ ⊖ ⊖		SVB131015 SVB13655 SVB13710	13x1015 13x655 13x710
		55	12/90 → 02/96	⊖ ⊖ ⊖		SVB131015 SVB13655 SVB13710	13x1015 13x655 13x710

100 Bus (631)

D	OM 616	41	12/90 → 12/94	⊖ ⊖ ⊖	For OE 0089972392 For Oe 0089976692	SVB131015 SVB13655 SVB13710	13x1015 13x655 13x710
D (631.333, 631.343, 631.334, 631.344)	OM 616.963	53	02/88 → 05/92	⊖ ⊖ ⊖	For OE 0089972392 For Oe 0089976692	SVB131015 SVB13655 SVB13710	13x1015 13x655 13x710
	OM 616, OM 616.963	55	12/90 → 02/96	⊖ ⊖ ⊖	For OE 0089972392 For Oe 0089976692	SVB131015 SVB13655 SVB13710	13x1015 13x655 13x710

100 Flatbed / Chassis (631)

D (631.340)	OM 616.963	55	12/90 → 02/96	⊖ ⊖ ⊖		SVB131015 SVB13655 SVB13710	13x1015 13x655 13x710
		53	02/88 → 05/92	⊖ ⊖ ⊖		SVB131015 SVB13655 SVB13710	13x1015 13x655 13x710

190 (W201)

2.0 (201.022)	M 102.921	66	10/82 → 10/84	☼ ⊖ ⊖ ⊖ ⊖	A/C(-), MS, 09/84→ A/C(-), PS, 09/84→ A/C(+), PS, 09/84→	SVB13875 SVB101000 MVB1015R6 MVB1885R6 MVB1980R6 SVB13750	13x875 10x1000 6PK1015 6PK1885 6PK1980 13x750
---------------	-----------	----	---------------	-----------------------	--	--	--



kW



...MERCEDES-BENZ

...190 (W201)

2.0 (201.023)	M 102.924	75	01/86 → 05/90	⊗	A/C(-), MS	MVB1015R6	6PK1015
				⊗	A/C(-), PS	MVB1885R6	6PK1885
				⊗	A/C(+), PS	MVB1980R6	6PK1980
		77	09/84 → 05/90	⊗	A/C(-), MS	MVB1015R6	6PK1015
				⊗	A/C(-), PS	MVB1885R6	6PK1885
				⊗	A/C(+), PS	MVB1980R6	6PK1980
D 2.0 (201.122)	OM 601.911	53	08/83 → 08/89	⊗	A/C(-), MS	MVB1015R6	6PK1015
				⊗	A/C(-), PS	MVB2050R6	6PK2050
				⊗	A/C(+), PS	MVB2120R6	6PK2120
		55	08/89 → 08/93	⊗	A/C(-), MS	MVB1015R6	6PK1015
				⊗	A/C(-), PS	MVB2050R6	6PK2050
				⊗	A/C(+), PS	MVB2120R6	6PK2120
D 2.5 (201.126)	OM 602.911	66	04/85 → 08/93	⊗	A/C(-)	MVB2030R6	6PK2030
				⊗	A/C(+)	MVB2100R6	6PK2100
				⊗	A/C(-)	MVB2030R6	6PK2030
		69	08/89 → 08/93	⊗	A/C(+)	MVB2100R6	6PK2100
				⊗	A/C(-)	MVB2030R6	6PK2030
				⊗	A/C(+)	MVB2100R6	6PK2100
E 1.8 (201.018)	M 102.910	80	04/90 → 08/93	⊗	A/C(-)	MVB1885R6	6PK1885
E 2.0	M 102.962	87	01/85 → 08/93	⊗	A/C(-), MS	MVB1015R6	6PK1015
				⊗	A/C(-), PS	MVB1885R6	6PK1885
				⊗	A/C(+), PS	MVB1980R6	6PK1980
		93	10/82 → 06/93	⊗	→08/84	SVB13875	13x875
				⊗	→08/84	SVB101000	10x1000
				⊗	A/C(-), MS, 09/84 →	MVB1015R6	6PK1015
				⊗	A/C(-), PS, 09/84 →	MVB1885R6	6PK1885
				⊗	A/C(+), PS, 09/84 →	MVB1980R6	6PK1980
				⊗	→08/84	SVB13750	13x750
E 2.0 (201.024)	M 102.961, M 102.962	83	02/85 → 12/86	⊗	A/C(-), MS	MVB1015R6	6PK1015
				⊗	A/C(-), PS	MVB1885R6	6PK1885
				⊗	A/C(+), PS	MVB1980R6	6PK1980
	M 102.962	85	02/85 → 12/86	⊗	A/C(-), MS	MVB1015R6	6PK1015
				⊗	A/C(-), PS	MVB1885R6	6PK1885
				⊗	A/C(+), PS	MVB1980R6	6PK1980
	M 102.961, M 102.962	90	10/82 → 06/93	⊗	→08/84	SVB13875	13x875
				⊗	→08/84	SVB101000	10x1000
				⊗	A/C(-), MS, 09/84 →	MVB1015R6	6PK1015
				⊗	A/C(-), PS, 09/84 →	MVB1885R6	6PK1885
				⊗	A/C(+), PS, 09/84 →	MVB1980R6	6PK1980
				⊗	→08/84	SVB13750	13x750
E 2.3	M 102.985	97	09/86 → 08/91	⊗	A/C(-), PS	MVB1885R6	6PK1885
				⊗	A/C(+), PS	MVB1980R6	6PK1980
				⊗	A/C(-), PS	MVB1885R6	6PK1885
E 2.3 (201.028)	M 102.985	100	10/86 → 08/93	⊗	A/C(+), PS	MVB1980R6	6PK1980
E 2.3-16	M 102.983	125	09/85 → 12/87	⊗	A/C(-)	MVB1885R6	6PK1885
				⊗	A/C(+)	MVB1980R6	6PK1980
				⊗	A/C(-)	MVB1885R6	6PK1885
		130	09/85 → 08/88	⊗	A/C(-)	MVB1885R6	6PK1885
				⊗	A/C(+)	MVB1980R6	6PK1980
				⊗	A/C(-)	MVB1885R6	6PK1885
E 2.3-16 (201.034)	M 102.983	136	04/84 → 01/87	⊗	A/C(-)	MVB1885R6	6PK1885
				⊗	A/C(+)	MVB1980R6	6PK1980
				⊗	A/C(-)	MVB1885R6	6PK1885
E 2.5-16	M 102.991	143	03/89 → 08/93	⊗	A/C(-)	MVB1885R6	6PK1885
				⊗	A/C(+)	MVB1980R6	6PK1980
				⊗	A/C(-)	MVB1885R6	6PK1885
	M 102.990	150	09/88 → 08/93	⊗	A/C(-)	MVB1885R6	6PK1885
				⊗	A/C(+)	MVB1980R6	6PK1980
				⊗	A/C(-)	MVB1885R6	6PK1885
E 2.6	M 103.942	122	09/86 → 12/89	⊗	A/C(-), 03/87 →	MVB2170R6	6PK2170
				⊗	A/C(+), Cat(-), 03/87 →	MVB2265R6	6PK2265
				⊗	A/C(+), Cat(+), 03/87 →	MVB2415R6	6PK2415
E 2.6 (201.029)	M 103.942	118	09/86 → 08/93	⊗	A/C(-), 03/87 →	MVB2170R6	6PK2170
				⊗	A/C(+), Cat(-), 03/87 →	MVB2265R6	6PK2265
				⊗	A/C(+), Cat(+), 03/87 →	MVB2415R6	6PK2415
E Evolution II 2.5	M 102.992	173	05/90 → 08/93	⊗	A/C(-)	MVB1855R6	6PK1855
				⊗	A/C(+)	MVB1950R6	6PK1950



kw



...MERCEDDES-BENZ

...190 (W201)

Turbo-D 2.5 (201.128)	OM 602.961	90	02/88 → 08/93	⊗	A/C(-)	MVB2030R6	6PK2030
				⊗	A/C(+)	MVB2100R6	6PK2100
		93	02/88 → 08/93	⊗	A/C(-)	MVB2030R6	6PK2030
				⊗	A/C(+)	MVB2100R6	6PK2100

A-CLASS (W168)

A 140 (168.031)	M 166.960	60	01/01 → 08/04	⊗	A/C(-)	MVB1285R5	5PK1285
				⊗	A/C(+)	MVB1750R5	5PK1750
A 140 (168.031, 168.131)	M 166.940	60	07/97 → 08/04	⊗	A/C(-)	MVB1285R5	5PK1285
				⊗	A/C(+)	MVB1750R5	5PK1750
A 160 (168.033, 168.133)	M 166.960	75	07/97 → 08/04	⊗	A/C(-)	MVB1285R5	5PK1285
				⊗	A/C(+)	MVB1750R5	5PK1750
A 160 CDI (168.006)	OM 668.940	55	02/01 → 08/04	⊗	A/C(-)	MVB1263R5	5PK1263
				⊗	A/C(+)	MVB1725R5	5PK1725
A 160 CDI (168.007)	OM 668.941	44	07/98 → 02/01	⊗	A/C(-)	MVB1270R5	5PK1270
				⊗	A/C(+)	MVB1725R5	5PK1725
A 170 CDI (168.008)	OM 668.940	66	07/98 → 02/01	⊗	A/C(-)	MVB1270R5	5PK1270
				⊗	A/C(+)	MVB1725R5	5PK1725
A 170 CDI (168.009, 168.109)	OM 668.942	70	02/01 → 08/04	⊗	A/C(-)	MVB1263R5	5PK1263
				⊗	A/C(+)	MVB1725R5	5PK1725
A 190 (168.032, 168.132)	M 166.990	92	03/99 → 08/04	⊗	A/C(-)	MVB1285R5	5PK1285
				⊗	A/C(+)	MVB1750R5	5PK1750
A 210 (168.035, 168.135)	M 166.995	103	03/02 → 08/04	⊗	A/C(-)	MVB1285R5	5PK1285
				⊗	A/C(+)	MVB1750R5	5PK1750

A-CLASS (W169)

A 150 (169.031, 169.331)	M 266.920	70	09/04 →	⊗	A/C(-)	MVB1300R5	5PK1300
				⊗	A/C(+)	MVB1765R5	5PK1765
A 160 CDI (169.006, 169.306)	OM 640.942	60	09/04 →	⊗		MVB1745R5	5PK1745
A 170 (169.032, 169.332)	M 266.940	85	09/04 →	⊗		MVB1765R5	5PK1765
A 180 CDI (169.007, 169.307)	OM 640.940	80	09/04 →	⊗		MVB1745R5	5PK1745
A 200 (169.033, 169.333)	M 266.960	100	09/04 →	⊗	A/C(-)	MVB1300R5	5PK1300
				⊗	A/C(+)	MVB1765R5	5PK1765
A 200 CDI (169.008, 169.308)	OM 640.941	103	09/04 →	⊗	A/C(+)	MVB1745R5	5PK1745
A 200 TURBO (169.034, 169.334)	M 266.980	142	09/05 →	⊗	A/C(-)	MVB1300R5	5PK1300
				⊗	A/C(+)	MVB1765R5	5PK1765

B-CLASS (W245)

B 150 (245.231)	M 266.920	70	03/05 →	⊗	A/C(-)	MVB1300R5	5PK1300
				⊗	A/C(+)	MVB1765R5	5PK1765
B 170 (245.232)	M 266.940	85	03/05 →	⊗	A/C(-)	MVB1300R5	5PK1300
				⊗	A/C(+)	MVB1765R5	5PK1765
B 180 CDI (245.207)	OM 640.940	80	03/05 →	⊗	A/C(+)	MVB1745R5	5PK1745
B 200 (245.233)	M 266.960	100	03/05 →	⊗	A/C(-)	MVB1300R5	5PK1300
				⊗	A/C(+)	MVB1765R5	5PK1765
B 200 CDI (245.208)	OM 640.941	103	03/05 →	⊗	A/C(+)	MVB1745R5	5PK1745
B 200 TURBO (245.234)	M 266.980	142	03/05 →	⊗	A/C(-)	MVB1300R5	5PK1300
				⊗	A/C(+)	MVB1765R5	5PK1765

C CLASS (W204)

C 63 AMG	M 156.985	336	02/08 →	⊗		MVB2350R6	6PK2350
C 180 Kompressor (204.046)	M 271.952	115	01/07 →	⊗		MVB2418R7	7PK2418
C 200 CDI (204.007)	OM 646.811	100	01/07 →	⊗		MVB2265R6	6PK2265
C 200 Kompressor (204.041)	M 271.950	135	01/07 →	⊗	A/C(-)	MVB2315R7	7PK2315
				⊗	A/C(+)	MVB2418R7	7PK2418
C 220 CDI (204.008)	OM 646.811	125	01/07 →	⊗	A/C(-)	MVB2190R6	6PK2190
				⊗	A/C(+)	MVB2265R6	6PK2265
C 230 (204.052)	M 272.921	150	01/07 →	⊗		MVB2403R6	6PK2403
C 230 4-matic (204.085)		150	07/07 →	⊗		MVB2403R6	6PK2403
C 280 (204.054)	M 272.947	170	01/07 →	⊗		MVB2403R6	6PK2403
C 280 4-matic (204.081)	M 272.947	170	07/07 →	⊗		MVB2403R6	6PK2403
C 320 CDI (204.022)	OM 642.960	165	01/07 →	⊗		MVB2035R7	7PK2035
C 320 CDI 4-matic (204.089)	OM 642.961	165	07/07 →	⊗		MVB2035R7	7PK2035
C 350 (204.056)	M 272.962	200	01/07 →	⊗		MVB2403R6	6PK2403
C 350 4-matic (204.087)		200	07/07 →	⊗		MVB2403R6	6PK2403



kW



...MERCEDES-BENZ

C CLASS T-Model (S204)

C 63 AMG	M 156.985	336	02/08 →	⊗		MVB2350R6	6PK2350
C 180 Kompressor	M 271.952	115	08/07 →	⊗		MVB2418R7	7PK2418
C 200 CDI	OM 646.811	100	08/07 →	⊗	A/C(+)	MVB2265R6	6PK2265
C 200 Kompressor	M 271.950	135	08/07 →	⊗	A/C(-)	MVB2315R7	7PK2315
					A/C(+)	MVB2418R7	7PK2418
C 220 CDI	OM 646.811	125	08/07 →	⊗	A/C(-)	MVB2190R6	6PK2190
					A/C(+)	MVB2265R6	6PK2265
C 230		150	08/07 →	⊗		MVB2403R6	6PK2403
C 280	M 272.947	170	08/07 →	⊗		MVB2403R6	6PK2403
C 320 CDI	OM 642.960	165	08/07 →	⊗		MVB2035R7	7PK2035
C 320 CDI 4-matic	OM 642.961	165	08/07 →	⊗		MVB2035R7	7PK2035
C 350		200	08/07 →	⊗		MVB2403R6	6PK2403

CABRIOLET (A124)

300 CE-24 (124.061)	M 104.980	162	04/92 → 06/93	⊗	A/C(-), MAN, Cat(-), → Eng Nr 009076	MVB2205R6	6PK2205
					A/C(-), MAN, Cat(-), Eng Nr 009077 →	MVB2170R6	6PK2170
					A/C(-), MAN, Cat(+), → Eng Nr 009076	MVB2350R6	6PK2350
					A/C(-), MAN, Cat(+), Eng Nr 009077 →	MVB2325R6	6PK2325
					A/C(+), AUTO, Cat(+), Eng Nr 042811 →	MVB2415R6	6PK2415
					A/C(+), MAN, Cat(-), → Eng Nr 009076	MVB2280R6	6PK2280
					A/C(+), MAN, Cat(-), Eng Nr 009077 →	MVB2265R6	6PK2265
					A/C(+), MAN, Cat(+), → Eng Nr 009076	MVB2450R6	6PK2450

C-CLASS (W202)

C 43 AMG (202.033)	M 113.944	225	08/97 → 05/00	⊗		MVB2390R6	6PK2390
C 180 (202.018)	M 111.920, M 111.921	90	03/93 → 05/00	⊗	A/C(-), →12/95	MVB2040R6	6PK2040
					A/C(-), RHA (-), 01/96 →	MVB2050R6	6PK2050
					A/C(+), RHA (-), 01/96 →	MVB2153R6	6PK2153
					A/C(+), RHA (+)	MVB2135R6	6PK2135
					A/C(-), →12/95	MVB2040R6	6PK2040
					A/C(-), RHA (-), 01/96 →	MVB2050R6	6PK2050
C 200 (202.020)	M 111.941, M 111.945	100	01/94 → 05/00	⊗	A/C(+), RHA (-), 01/96 →	MVB2153R6	6PK2153
					A/C(+), RHA (+)	MVB2135R6	6PK2135
					Eng. M111945, A/C(-), RHA (-), 01/96 →	MVB2050R6	6PK2050
					Eng. M111945, A/C(+), RHA (+)	MVB2040R6	6PK2040
C 200 CDI (202.134)	OM 611.960	75	03/98 → 05/00	⊗	Eng. M111945, A/C(+), RHA (-), 01/96 →	MVB2153R6	6PK2153
					Eng. M111945, A/C(+), RHA (+)	MVB2135R6	6PK2135
					A/C(-), RHA (-)	MVB2190R6	6PK2190
					A/C(-), RHA (+)	MVB2160R6	6PK2160
C 200 D (202.120)	OM 601.913	55	03/93 → 05/00	⊗	A/C(+), RHA (-)	MVB2271R6	6PK2271
					A/C(+), RHA (+)	MVB2240R6	6PK2240
					A/C(-), →06/95	MVB2050R6	6PK2050
C 200 D (202.122)	OM 604.915	65	10/96 → 05/00	⊗	A/C(+), →06/95	MVB2120R6	6PK2120
					A/C(-)	MVB2050R6	6PK2050
				⊗	A/C(+)	MVB2120R6	6PK2120



kW



MERCEDDES-BENZ

...MERCEDDES-BENZ

...C-CLASS (W202)

C 200 Kompressor (202.025)	M 111.944	132	10/95 → 05/00	☼		MVB1325R6	6PK1325				
				⊗	A/C(-), RHA (-)	MVB1775R6	6PK1775				
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760				
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875				
		141	11/96 → 05/00	☼		MVB1865R6	6PK1865				
				⊗	A/C(+), RHA (+)	MVB1325R6	6PK1325				
				⊗	A/C(-), RHA (-)	MVB1775R6	6PK1775				
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760				
C 220 (202.022)	M 111.961	110	03/93 → 05/00	⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875				
				⊗	A/C(+), RHA (+)	MVB1865R6	6PK1865				
				⊗	A/C(-), →12/95	MVB2040R6	6PK2040				
				⊗	A/C(-), RHA (-), 01/96 → 02/96	MVB2050R6	6PK2050				
C 220 CDI (202.133)	OM 611.960	92	09/97 → 05/00	⊗	A/C(+), RHA (-), 01/96 → 02/96	MVB2153R6	6PK2153				
				⊗	A/C(+), RHA (+), →02/96	MVB2135R6	6PK2135				
				⊗	A/C(-), RHA (-)	MVB2190R6	6PK2190				
				⊗	A/C(-), RHA (+)	MVB2160R6	6PK2160				
C 220 D (202.121)	OM 604.910	70	08/93 → 05/00	⊗	A/C(+), RHA (-)	MVB2271R6	6PK2271				
				⊗	A/C(+), RHA (+)	MVB2240R6	6PK2240				
				⊗	A/C(-), →06/98	MVB2050R6	6PK2050				
C 230 (202.023)	M 111.974	110	06/96 → 06/97	⊗	A/C(+), →06/98	MVB2120R6	6PK2120				
				⊗	A/C(-)	MVB2040R6	6PK2040				
				⊗	A/C(+), RHA (-)	MVB2153R6	6PK2153				
C 230 Kompressor (202.024)	M 111.975	142	10/95 → 05/00	⊗	A/C(+), RHA (+)	MVB2135R6	6PK2135				
				☼		MVB1325R6	6PK1325				
				☼	A/C(-), RHA (-)	MVB1775R6	6PK1775				
				☼	A/C(-), RHA (+)	MVB1760R6	6PK1760				
C 240 (202.026)	M 112.910	125	06/97 → 05/00	☼	A/C(+), RHA (-)	MVB1875R6	6PK1875				
				☼	A/C(+), RHA (+)	MVB1865R6	6PK1865				
C 240 D (202.125)	OM 605.910	83	05/93 → 05/00	⊗	A/C(+)	MVB2390R6	6PK2390				
				⊗	A/C(-), →08/95	MVB2080R6	6PK2080				
C 250 Turbo-D (202.128)	OM 605.960	110	10/95 → 05/00	⊗	A/C(+), →08/95	MVB2153R6	6PK2153				
				⊗	A/C(-)	MVB2080R6	6PK2080				
				⊗	A/C(+)	MVB2153R6	6PK2153				
C 280 (202.028)	M 104.941	142	05/93 → 05/00	⊗	A/C(-), AUTO, →10/97, → Eng Nr 034966	MVB2080R6	6PK2080				
				⊗	A/C(-), AUTO, RHA (-), →10/97, Eng Nr 034967 → 075764	MVB2135R6	6PK2135				
				⊗	A/C(-), AUTO, RHA (-), →10/97, Eng Nr 075765 →	MVB2120R6	6PK2120				
				⊗	A/C(-), MAN, RHA (+), →10/97, Eng Nr 004059 → 006600	MVB2125R6	6PK2125				
				⊗	A/C(-), MAN, RHA (+), →10/97, Eng Nr 006601 →	MVB2100R6	6PK2100				
				⊗	A/C(+), AUTO, →10/97, → Eng Nr 034966	MVB2170R6	6PK2170				
				⊗	A/C(+), AUTO, RHA (-), →10/97, Eng Nr 034967 → 075764	MVB2250R6	6PK2250				
				⊗	A/C(+), AUTO, RHA (+), →10/97, Eng Nr 075765 →	MVB2205R6	6PK2205				
				⊗	A/C(+), MAN, RHA (+), →10/97, Eng Nr 004059 → 006600	MVB2225R6	6PK2225				
				⊗	A/C(+)	MVB2390R6	6PK2390				
				C 280 (202.029)	M 112.920	145	06/97 → 05/00	⊗	A/C(+)	MVB2390R6	6PK2390



kW



...MERCEDES-BENZ

C-CLASS (W203)

C 30 CDI AMG (203.018)	OM 612.990	170	01/03 →	⊗	→01/08	MVB2250R6	6PK2250
C 55 AMG (203.076)	M 113.988	270	02/04 →	⊗	→11/07	MVB2380R6	6PK2380
C 180 (203.035)	M 111.951	95	10/00 → 05/02	⊗	A/C(-), RHA (-)	MVB2030R6	6PK2030
				⊗	A/C(-), RHA (+)	MVB2020R6	6PK2020
				⊗	A/C(+), RHA (-)	MVB2135R6	6PK2135
				⊗	A/C(+), RHA (+)	MVB2125R6	6PK2125
C 180 Kompressor (203.046)	M 271.946	105	05/02 →	⊗	A/C(-)	MVB2315R7	7PK2315
				⊗	A/C(+)	MVB2418R7	7PK2418
C 200 CDI (203.004)	OM 611.962	85	09/00 →	⊗	A/C(-), →07/03	MVB2190R6	6PK2190
C 200 CDI (203.007)	OM 646.962	90	04/03 →	⊗	A/C(+), →07/03	MVB2265R6	6PK2265
				⊗	A/C(-), →01/08	MVB2190R6	6PK2190
C 200 CGI Kompressor (203.043)	M 271.942	125	07/03 →	⊗	A/C(+), →01/08	MVB2265R6	6PK2265
				⊗	A/C(-), →04/05	MVB2315R7	7PK2315
C 200 Kompressor (203.042)	M 271.940	120	05/02 →	⊗	A/C(+), →04/05	MVB2418R7	7PK2418
				⊗	A/C(-), →11/07	MVB2315R7	7PK2315
C 200 Kompressor (203.045)	M 111.955	120	05/00 → 05/02	⊗	A/C(+), →11/07	MVB2418R7	7PK2418
				⊗	A/C(-), RHA (-)	MVB1352R6	6PK1352
				⊗	A/C(-), RHA (+)	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760
C 220 CDI (203.006)	OM 611.962	105	05/00 →	⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+)	MVB1865R6	6PK1865
C 220 CDI (203.008)	OM 646.963	110	02/04 →	⊗	A/C(-), →09/03	MVB2190R6	6PK2190
				⊗	A/C(+), →09/03	MVB2265R6	6PK2265
C 220 CDI (203.008)	OM 646.963	110	02/04 →	⊗	A/C(-), →08/05	MVB2190R6	6PK2190
C 230 (203.052)	M 272.920	150	01/05 →	⊗	A/C(+), →08/05	MVB2265R6	6PK2265
				⊗	A/C(+), →08/05	MVB2265R6	6PK2265
C 230 Kompressor (203.040)	M 271.948	141	02/04 →	⊗	→01/08	MVB2403R6	6PK2403
C 240 (203.061)	M 112.912	125	05/00 →	⊗	A/C(-), →08/05	MVB2315R7	7PK2315
				⊗	A/C(+), →08/05	MVB2418R7	7PK2418
				⊗	A/C(-), →07/05	MVB2315R6	6PK2315
C 240 4-matic (203.081)	M 112.916	125	07/02 →	⊗	A/C(+), →02/03, → Ch. F410068	MVB2390R6	6PK2390
				⊗	A/C(+), 03/03→07/05, Ch. F410069→	MVB2380R6	6PK2380
				⊗	→04/03, → Ch. R108312	MVB2390R6	6PK2390
C 270 CDI (203.016)	OM 612.962	125	12/00 →	⊗	03/03→07/05, Ch. R108313→	MVB2380R6	6PK2380
				⊗	A/C(-), →12/04	MVB2190R6	6PK2190
C 280 (203.054)	M 272.940	170	01/05 →	⊗	A/C(+), →12/04	MVB2265R6	6PK2265
C 280 4-matic (203.092)	M 272.941	170	01/05 →	⊗	→11/07	MVB2403R6	6PK2403
C 320 (203.064)	M 112.946	160	05/00 →	⊗	→04/03, → Ch. R108312	MVB2390R6	6PK2390
				⊗	02/03→08/05, Ch. R108313→	MVB2380R6	6PK2380
C 320 4-matic (203.084)	M 112.953	160	07/02 →	⊗	→04/03, → Ch. R108312	MVB2390R6	6PK2390
				⊗	03/03→07/05, Ch. R108313→	MVB2380R6	6PK2380
C 320 CDI (203.020)	OM 642.910	165	01/05 →	⊗	→11/07	MVB2035R7	7PK2035
C 350 (203.056)	M 272.960	200	01/05 →	⊗		MVB2403R6	6PK2403
C 350 4-matic (203.087)	M 272.970	200	01/05 →	⊗		MVB2403R6	6PK2403

C-CLASS Coupe (CL203)

C 30 CDI AMG (203.718)	OM 612.990	170	09/02 →	⊗	→01/08	MVB2250R6	6PK2250
C 160 Kompressor (203.730)	M 271.921	90	05/02 →	⊗	A/C(-), →07/06	MVB2315R7	7PK2315
				⊗	A/C(+), →07/06	MVB2418R7	7PK2418
C 180 (203.735)	M 111.951	95	03/01 → 05/02	⊗	A/C(-), RHA (-)	MVB2030R6	6PK2030
				⊗	A/C(-), RHA (+)	MVB2020R6	6PK2020
				⊗	A/C(+), RHA (-)	MVB2135R6	6PK2135
				⊗	A/C(+), RHA (+)	MVB2125R6	6PK2125
C 180 Kompressor (203.746)	M 271.946	105	05/02 →	⊗	A/C(-)	MVB2315R7	7PK2315
				⊗	A/C(+)	MVB2418R7	7PK2418
C 200 CDI (203.707)	OM 646.962	90	07/03 →	⊗	A/C(-), →01/08	MVB2190R6	6PK2190
				⊗	A/C(+), →01/08	MVB2265R6	6PK2265
C 200 CGI Kompressor (203.743)	M 271.942	125	07/03 →	⊗	A/C(-), →04/05	MVB2315R7	7PK2315
				⊗	A/C(+), →04/05	MVB2418R7	7PK2418



kw



MERCEDES-BENZ

...MERCEDES-BENZ

...C-CLASS Coupe (CL203)

C 200 Kompressor (203.742)	M 271.940	120	05/02 →	⌚	A/C(-), →11/07	MVB2315R7	7PK2315
				⌚	A/C(+), →11/07	MVB2418R7	7PK2418
C 200 Kompressor (203.745)	M 111.955	120	03/01 → 05/02	⚙	A/C(-), RHA (-)	MVB1352R6	6PK1352
				⌚	A/C(-), RHA (+)	MVB1775R6	6PK1775
				⌚	A/C(+), RHA (-)	MVB1760R6	6PK1760
				⌚	A/C(+), RHA (+)	MVB1875R6	6PK1875
				⌚	A/C(+), RHA (+)	MVB1865R6	6PK1865
C 220 CDI (203.706)	OM 611.962	105	03/01 →	⌚	A/C(-), →09/03	MVB2190R6	6PK2190
				⌚	A/C(+), →09/03	MVB2265R6	6PK2265
C 220 CDI (203.708)	OM 646.963	110	02/04 →	⌚	A/C(-), →08/05	MVB2190R6	6PK2190
				⌚	A/C(+), →08/05	MVB2265R6	6PK2265
C 230 (203.752)	M 272.920	150	01/05 →	⌚	→01/08	MVB2403R6	6PK2403
C 230 Kompressor (203.740)	M 271.948	141	05/02 →	⌚	A/C(-), →08/05	MVB2315R7	7PK2315
				⌚	A/C(+), →08/05	MVB2418R7	7PK2418
C 230 Kompressor (203.747)	M 111.981	145	03/01 → 05/02	⌚	A/C(-), RHA (-)	MVB1352R6	6PK1352
				⌚	A/C(-), RHA (+)	MVB1775R6	6PK1775
				⌚	A/C(+), RHA (-)	MVB1760R6	6PK1760
				⌚	A/C(+), RHA (+)	MVB1875R6	6PK1875
				⌚	A/C(+), RHA (+)	MVB1865R6	6PK1865
C 320 (203.764)	M 112.946	160	09/02 →	⌚	→04/03, → Ch. R108312	MVB2390R6	6PK2390
				⌚	02/03 →08/05, Ch. R108313 →	MVB2380R6	6PK2380
C 350 (203.756)	M 272.960	200	01/05 →	⌚		MVB2403R6	6PK2403

C-CLASS Estate (S202)

C 43 AMG (202.093)	M 113.944	225	08/97 → 03/01	⌚	→10/00	MVB2390R6	6PK2390
C 180 T (202.078)	M 111.920, M 111.921	90	06/96 → 09/00	⌚	A/C(-), RHA (-)	MVB2050R6	6PK2050
				⌚	A/C(+), RHA (-)	MVB2153R6	6PK2153
				⌚	A/C(+), RHA (+)	MVB2135R6	6PK2135
C 180 T (202.081)	M 111.952	95	09/00 → 03/01	⌚	A/C(-), RHA (-), →10/00	MVB2030R6	6PK2030
				⌚	A/C(-), RHA (+), →10/00	MVB2020R6	6PK2020
				⌚	A/C(+), RHA (-), →10/00	MVB2135R6	6PK2135
				⌚	A/C(+), RHA (+), →10/00	MVB2125R6	6PK2125
C 200 T (202.080)	M 111.941, M 111.945	100	06/96 → 03/01	⌚	A/C(-), RHA (+), 08/97 →10/00	MVB2040R6	6PK2040
				⌚	A/C(+), RHA (-), →10/00	MVB2153R6	6PK2153
				⌚	Eng. M111945, A/C(-), RHA (-), →10/00	MVB2050R6	6PK2050
				⌚	Eng. M111945, A/C(+), RHA (+), →10/00	MVB2135R6	6PK2135
C 200 T CDI (202.194)	OM 611.960	75	03/98 → 03/01	⌚	A/C(-), RHA (-), →10/00	MVB2190R6	6PK2190
				⌚	A/C(-), RHA (+), →10/00	MVB2160R6	6PK2160
				⌚	A/C(+), RHA (-), →10/00	MVB2271R6	6PK2271
				⌚	A/C(+), RHA (+), →10/00	MVB2240R6	6PK2240
C 200 T D (202.180)	OM 604.915	65	10/96 → 03/01	⌚	A/C(-), →05/00	MVB2050R6	6PK2050
				⌚	A/C(+), →05/00	MVB2120R6	6PK2120
C 200 T Kompressor (202.087)	M 111.956	120	09/00 → 03/01	⚙	→10/00	MVB1352R6	6PK1352
				⌚	A/C(-), RHA (-), →10/00	MVB1775R6	6PK1775
				⌚	A/C(-), RHA (+), →10/00	MVB1760R6	6PK1760
				⌚	A/C(+), RHA (-), →10/00	MVB1875R6	6PK1875
				⌚	A/C(+), RHA (+), →10/00	MVB1865R6	6PK1865
C 200 T Kompressor (202.082)	M 111.944	141	11/96 → 03/01	⚙	→10/00	MVB1325R6	6PK1325
				⌚	A/C(-), RHA (-), →10/00	MVB1775R6	6PK1775
				⌚	A/C(-), RHA (+), →10/00	MVB1760R6	6PK1760
				⌚	A/C(+), RHA (-), →10/00	MVB1875R6	6PK1875
				⌚	A/C(+), RHA (+), →10/00	MVB1865R6	6PK1865
C 220 T CDI (202.193)	OM 611.960	92	09/97 → 03/01	⌚	A/C(-), RHA (-), →10/00	MVB2190R6	6PK2190
				⌚	A/C(-), RHA (+), →10/00	MVB2160R6	6PK2160
				⌚	A/C(+), RHA (-), →10/00	MVB2271R6	6PK2271
				⌚	A/C(+), RHA (+), →10/00	MVB2240R6	6PK2240
C 220 T D (202.182)	OM 604.910	70	06/96 → 09/98	⌚	A/C(-)	MVB2050R6	6PK2050
				⌚	A/C(+)	MVB2120R6	6PK2120
C 230 T (202.083)	M 111.974	110	06/96 → 06/98	⌚	A/C(-)	MVB2040R6	6PK2040
				⌚	A/C(+), RHA (-)	MVB2153R6	6PK2153
				⌚	A/C(+), RHA (+)	MVB2135R6	6PK2135



kW



...MERCEDES-BENZ

...C-CLASS Estate (S202)

C 230 T Kompressor (202.085)	M 111.975	142	06/97 → 09/00	⊗	→05/00	MVB1325R6	6PK1325
				⊗	A/C(-), RHA (-), →05/00	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+), →05/00	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-), →05/00	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+), →05/00	MVB1865R6	6PK1865
C 240 T (202.086)	M 112.910	125	06/97 → 09/00	⊗	A/C(+)	MVB2390R6	6PK2390
C 240 T (202.088)	M 112.915	125	09/00 → 03/01	⊗	A/C(-), →10/00	MVB2315R6	6PK2315
				⊗	A/C(+), →10/00	MVB2390R6	6PK2390
C 250 T Turbo-D (202.188)	OM 605.960	110	06/96 → 03/01	⊗	A/C(-), →10/00	MVB2080R6	6PK2080
				⊗	A/C(+), →10/00	MVB2153R6	6PK2153
C 280 T (202.089)	M 112.920	145	06/97 → 03/01	⊗	A/C(+), →10/00	MVB2390R6	6PK2390

C-CLASS T-Model (S203)

C 30 CDI AMG (203.218)	OM 612.990	170	01/03 →	⊗	→01/08	MVB2250R6	6PK2250
C 55 AMG (203.276)	M 113.988	270	02/04 →	⊗	→11/07	MVB2380R6	6PK2380
C 180 (203.235)	M 111.951	95	03/01 → 05/02	⊗	A/C(-), RHA (-)	MVB2030R6	6PK2030
				⊗	A/C(-), RHA (+)	MVB2020R6	6PK2020
				⊗	A/C(+), RHA (-)	MVB2135R6	6PK2135
				⊗	A/C(+), RHA (+)	MVB2125R6	6PK2125
C 180 Kompressor (203.246)	M 271.946	105	05/02 →	⊗	A/C(-)	MVB2315R7	7PK2315
				⊗	A/C(+)	MVB2418R7	7PK2418
C 200 CDI (203.204)	OM 611.962	85	03/01 →	⊗	A/C(-), →07/03	MVB2190R6	6PK2190
				⊗	A/C(+), →07/03	MVB2265R6	6PK2265
C 200 CDI (203.207)	OM 646.962	90	04/03 →	⊗	A/C(-), →01/08	MVB2190R6	6PK2190
				⊗	A/C(+), →01/08	MVB2265R6	6PK2265
C 200 CGI Kompressor (203.243)	M 271.942	125	07/03 →	⊗	A/C(-), →04/05	MVB2315R7	7PK2315
				⊗	A/C(+), →04/05	MVB2418R7	7PK2418
C 200 Kompressor (203.242)	M 271.940	120	05/02 →	⊗	A/C(-), →11/07	MVB2315R7	7PK2315
				⊗	A/C(+), →11/07	MVB2418R7	7PK2418
C 200 Kompressor (203.245)	M 111.955	120	03/01 → 05/02	⊗		MVB1352R6	6PK1352
				⊗	A/C(-), RHA (-)	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+)	MVB1865R6	6PK1865
C 220 CDI (203.206)	OM 611.962	105	03/01 →	⊗	A/C(-), →09/03	MVB2190R6	6PK2190
				⊗	A/C(+), →09/03	MVB2265R6	6PK2265
C 220 CDI (203.208)	OM 646.963	110	02/04 →	⊗	A/C(-), →08/05	MVB2190R6	6PK2190
				⊗	A/C(+), →08/05	MVB2265R6	6PK2265
C 230 (203.252)	M 272.920	150	01/05 →	⊗	→01/08	MVB2403R6	6PK2403
C 230 Kompressor (203.240)	M 271.948	141	02/04 →	⊗	A/C(-), →08/05	MVB2315R7	7PK2315
				⊗	A/C(+), →08/05	MVB2418R7	7PK2418
C 240 (203.261)	M 112.912	125	03/01 →	⊗	A/C(-), →07/05	MVB2315R6	6PK2315
				⊗	A/C(+), →02/03, → Ch. F410068	MVB2390R6	6PK2390
				⊗	A/C(+), 03/03→07/05, Ch. F410069→	MVB2380R6	6PK2380
C 240 4-matic (203.281)	M 112.916	125	07/02 →	⊗	→04/03, → Ch. R108312	MVB2390R6	6PK2390
				⊗	03/03→07/05, Ch. R108313→	MVB2380R6	6PK2380
C 270 CDI (203.216)	OM 612.962	125	03/01 →	⊗	A/C(-), →12/04	MVB2190R6	6PK2190
				⊗	A/C(+), →12/04	MVB2265R6	6PK2265
C 280 (203.254)	M 272.940	170	01/05 →	⊗	→11/07	MVB2403R6	6PK2403
C 280 4-matic (203.292)	M 272.941	170	01/05 →	⊗		MVB2403R6	6PK2403
C 320 (203.264)	M 112.946	160	03/01 →	⊗	→04/03, → Ch. R108312	MVB2390R6	6PK2390
				⊗	02/03→08/05, Ch. R108313→	MVB2380R6	6PK2380
C 320 4-matic (203.284)	M 112.953	160	07/02 →	⊗	→04/03, → Ch. R108312	MVB2390R6	6PK2390
				⊗	03/03→07/05, Ch. R108313→	MVB2380R6	6PK2380
C 320 CDI (203.220)	OM 642.910	165	06/05 →	⊗	→11/07	MVB2035R7	7PK2035
C 350 (203.256)	M 272.960	200	01/05 →	⊗		MVB2403R6	6PK2403
C 350 4-matic (203.287)	M 272.970	200	01/05 →	⊗		MVB2403R6	6PK2403



kw



MERCEDÉS-BENZ

...MERCEDÉS-BENZ

CLK (C208)

200 (208.335)	M 111.941, M 111.945	100	06/97 → 06/02	⊗	Eng. M111945, A/C(-), RHA (-), →05/00	MVB2050R6	6PK2050
				⊗	Eng. M111945, A/C(-), RHA (+), →05/00	MVB2040R6	6PK2040
				⊗	Eng. M111945, A/C(+), RHA (-), →05/00	MVB2153R6	6PK2153
				⊗	Eng. M111945, A/C(+), RHA (+), →05/00	MVB2135R6	6PK2135
200 Kompressor (208.344)	M 111.956	120	06/00 → 06/02	⊗		MVB1352R6	6PK1352
				⊗	A/C(-), RHA (-)	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+)	MVB1865R6	6PK1865
200 Kompressor (208.345)	M 111.944	141	06/97 → 06/00	⊗		MVB1325R6	6PK1325
				⊗	A/C(-), RHA (-)	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+)	MVB1865R6	6PK1865
230 Kompressor (208.347)	M 111.973, M 111.975	142	06/97 → 06/00	⊗	Eng. M111975	MVB1325R6	6PK1325
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	Eng. M111975, A/C(-), RHA (-)	MVB1775R6	6PK1775
				⊗	Eng. M111975, A/C(-), RHA (+)	MVB1760R6	6PK1760
				⊗	Eng. M111975, A/C(+), RHA (+)	MVB1865R6	6PK1865
230 Kompressor (208.348)	M 111.982	145	06/00 → 06/02	⊗		MVB1352R6	6PK1352
				⊗	A/C(-), RHA (-)	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+)	MVB1865R6	6PK1865
320 (208.365)	M 112.940	160	06/97 → 06/02	⊗		MVB2390R6	6PK2390
430 (208.370)	M 113.943	205	07/98 → 06/02	⊗		MVB2390R6	6PK2390

CLK (C209)

55 AMG (209.376)	M 113.987	270	09/02 →	⊗	→05/06	MVB2380R6	6PK2380
63 AMG (209.377)	M 156.982	354	04/06 →	⊗		MVB2373R6	6PK2373
200 CGI (209.343)	M 271.942	125	07/03 →	⊗	→07/05	MVB2418R7	7PK2418
200 Kompressor		135	10/06 →	⊗	05/07 →	MVB2418R7	7PK2418
200 Kompressor (209.342)	M 271.940	120	09/02 →	⊗	→07/07	MVB2418R7	7PK2418
220 CDI (209.308)	OM 646.963	110	01/05 →	⊗	A/C(-), 05/05 →	MVB2190R6	6PK2190
				⊗	A/C(+), 05/05 →	MVB2265R6	6PK2265
240 (209.361)	M 112.912	125	06/02 →	⊗	A/C(-), →07/05	MVB2315R6	6PK2315
				⊗	A/C(+), →03/03, → Ch. F050740, T001363	MVB2390R6	6PK2390
				⊗	A/C(+), 03/03 → 07/05, Ch. F050741, T001364 →	MVB2380R6	6PK2380
270 CDI (209.316)	OM 612.962, OM 612.967	125	10/02 →	⊗	→07/05	MVB2265R6	6PK2265
280 (209.354)	M 272.940	170	01/05 →	⊗		MVB2403R6	6PK2403
320 (209.365)	M 112.955	160	06/02 →	⊗	→03/03, → Ch. F050740, T001363	MVB2390R6	6PK2390
				⊗	03/03 → 07/05, Ch. F050741, T001364 →	MVB2380R6	6PK2380
320 CDI (209.320)	OM 642.910	165	01/05 →	⊗		MVB2035R7	7PK2035
350 (209.356)	M 272.960	200	01/05 →	⊗		MVB2403R6	6PK2403
500	M 273.965	285	06/06 →	⊗		MVB2403R6	6PK2403
500 (209.375)	M 113.968	225	06/02 →	⊗	→05/06	MVB2380R6	6PK2380



kW



...MERCEDES-BENZ

CLK Convertible (A208)

200 (208.435)	M 111.941, M 111.945	100	03/98 → 03/02	⊗	Eng. M111945, A/C(-), RHA (-), →05/00	MVB2050R6	6PK2050
				⊗	Eng. M111945, A/C(-), RHA (+), →05/00	MVB2040R6	6PK2040
				⊗	Eng. M111945, A/C(+), RHA (-), →05/00	MVB2153R6	6PK2153
				⊗	Eng. M111945, A/C(+), RHA (+), →05/00	MVB2135R6	6PK2135
200 Kompressor (208.444)	M 111.956	120	06/00 → 03/02	⊗		MVB1352R6	6PK1352
				⊗	A/C(-), RHA (-)	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+)	MVB1865R6	6PK1865
200 Kompressor (208.445)	M 111.944	141	03/98 → 06/00	⊗		MVB1325R6	6PK1325
				⊗	A/C(-), RHA (-)	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+)	MVB1865R6	6PK1865
230 Kompressor (208.447)	M 111.973, M 111.975	142	03/98 → 06/00	⊗	Eng. M111975	MVB1325R6	6PK1325
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	Eng. M111975, A/C(-), RHA (-)	MVB1775R6	6PK1775
				⊗	Eng. M111975, A/C(-), RHA (+)	MVB1760R6	6PK1760
				⊗	Eng. M111975, A/C(+), RHA (+)	MVB1865R6	6PK1865
230 Kompressor (208.448)	M 111.982	145	06/00 → 03/02	⊗		MVB1352R6	6PK1352
				⊗	A/C(-), RHA (-)	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+)	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-)	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+)	MVB1865R6	6PK1865
320 (208.465)	M 112.940	160	03/98 → 03/02	⊗		MVB2390R6	6PK2390
430 (208.470)	M 113.943	205	09/98 → 03/02	⊗		MVB2390R6	6PK2390

CLK Convertible (A209)

55 AMG (209.476)	M 113.987	270	02/03 →	⊗	→05/06	MVB2380R6	6PK2380
63 AMG (209.477)	M 156.982	354	04/06 →	⊗		MVB2373R6	6PK2373
200 CGI (209.443)	M 271.942	125	07/03 →	⊗	→07/05	MVB2418R7	7PK2418
200 Kompressor		135	10/06 →	⊗	05/07 →	MVB2418R7	7PK2418
200 Kompressor (209.442)	M 271.940	120	02/03 →	⊗	→07/07	MVB2418R7	7PK2418
240 (209.461)	M 112.912	125	02/03 →	⊗	A/C(-), →07/05	MVB2315R6	6PK2315
				⊗	A/C(+), →03/03, → Ch. F050740, T001363	MVB2390R6	6PK2390
				⊗	A/C(+), →07/05, Ch. F050741, T001364 →	MVB2380R6	6PK2380
280 (209.454)	M 272.940	170	01/05 →	⊗		MVB2403R6	6PK2403
320 (209.465)	M 112.955	160	02/03 →	⊗	→03/03, → Ch. F050740, T001363	MVB2390R6	6PK2390
				⊗	→07/05, Ch. F050741, T001364 →	MVB2380R6	6PK2380
320 CDI	OM 642.910	165	03/05 →	⊗		MVB2035R7	7PK2035
350 (209.456)	M 272.960	200	01/05 →	⊗		MVB2403R6	6PK2403
500		285	06/06 →	⊗		MVB2403R6	6PK2403
500 (209.475)	M 113.968	225	02/03 →	⊗	→05/06	MVB2380R6	6PK2380

CLS (C219)

320 CDI (219.322)	OM 642.910	165	01/05 →	⊗		MVB2035R7	7PK2035
350 (219.356)	M 272.964	200	10/04 →	⊗	→03/06	MVB2403R6	6PK2403
350 (219.357)	M 272.985	215	04/06 →	⊗		MVB2403R6	6PK2403
500	M 273.960	285	04/06 →	⊗		MVB2403R6	6PK2403
500 (219.375)	M 113.967	225	10/04 →	⊗	→03/06	MVB2380R6	6PK2380
CLS 55 AMG (219.376)	M 113.990	350	01/05 →	⊗		MVB2450R6	6PK2450
CLS 63 AMG	M 156.983	378	04/06 →	⊗		MVB2350R6	6PK2350



kW


...MERCEDES-BENZ
COUPE (C123)

230 C (123.043)	M 115.954	80	05/77 → 04/80	Ⓢ	→ Eng Nr 063338	SVB10940	10x940	
				Ⓢ		Eng Nr 063339 →	SVB10960	10x960
230 CE (123.243)	M 102.980	100	04/80 → 12/85	Ⓢ		SVB13750	13x750	
				Ⓢ		SVB13875	13x875	
				Ⓢ		SVB101000	10x1000	
280 C (123.050)	M 110.923	115	03/77 → 03/80	Ⓢ	→07/79	SVB131275	13x1275	
				Ⓢ		AUTO, →07/79, Eng Nr 018194 →	SVB10925	10x925
				Ⓢ		AUTO, →07/79, Eng Nr 018195 →	SVB10975	10x975
				Ⓢ		→07/79	SVB13825	13x825
				Ⓢ			SVB10925	10x925
280 CE	M 110.988	130	09/77 → 08/79	Ⓢ		SVB13825	13x825	
				Ⓢ		SVB13825	13x825	
				Ⓢ		SVB131275	13x1275	
		136	03/77 → 11/85	Ⓢ	→02/85	SVB10925	10x925	
				Ⓢ	AUTO, → Eng Nr 076808	SVB10975	10x975	
				Ⓢ	AUTO, →02/85, Eng Nr 076809 →	SVB13825	13x825	

COUPE (C124)

220 CE (124.042)	M 111.960	110	10/92 → 05/93	Ⓢ	A/C(-)	MVB2040R6	6PK2040				
				Ⓢ	A/C(+)	MVB2135R6	6PK2135				
230 CE (124.043)	M 102.982	100	03/87 → 12/92	Ⓢ	A/C(-)	MVB1885R6	6PK1885				
				Ⓢ	A/C(+)	MVB1980R6	6PK1980				
		97	03/87 → 12/92	Ⓢ	A/C(-)	MVB1885R6	6PK1885				
				Ⓢ	A/C(+)	MVB1980R6	6PK1980				
230 CE (124.043) CAT	M 102.982	97	06/89 → 12/92	Ⓢ	A/C(-)	MVB1885R6	6PK1885				
				Ⓢ	A/C(+)	MVB1980R6	6PK1980				
300 CE	M 103.983	138	03/87 → 12/89	Ⓢ	A/C(-)	MVB2170R6	6PK2170				
				Ⓢ	A/C(+), Cat(-)	MVB2265R6	6PK2265				
				Ⓢ	A/C(+), Cat(+)	MVB2415R6	6PK2415				
300 CE (124.050)	M 103.983	132	03/87 → 05/93	Ⓢ	A/C(-)	MVB2170R6	6PK2170				
				Ⓢ	A/C(+), Cat(-)	MVB2265R6	6PK2265				
				Ⓢ	A/C(+), Cat(+)	MVB2415R6	6PK2415				
				Ⓢ		MVB2170R6	6PK2170				
300 CE-24 (124.051)	M 104.980	162	09/89 → 12/92	Ⓢ	A/C(-), AUTO, Cat(-), Eng Nr 042811 →	MVB2170R6	6PK2170				
				Ⓢ	A/C(-), MAN, Cat(-), → Eng Nr 009076	MVB2205R6	6PK2205				
				Ⓢ	A/C(-), MAN, Cat(+), → Eng Nr 009076	MVB2350R6	6PK2350				
				Ⓢ	A/C(-), MAN, Cat(+), Eng Nr 009077 →	MVB2325R6	6PK2325				
				Ⓢ	A/C(+), AUTO, Cat(+), Eng Nr 042811 →	MVB2415R6	6PK2415				
				Ⓢ	A/C(+), MAN, Cat(-), → Eng Nr 009076	MVB2280R6	6PK2280				
				Ⓢ	A/C(+), MAN, Cat(-), Eng Nr 009077 →	MVB2265R6	6PK2265				
				Ⓢ	A/C(+), MAN, Cat(+), → Eng Nr 009076	MVB2450R6	6PK2450				
				320 CE (124.052)	M 104.992	162	10/92 → 05/93	Ⓢ	A/C(-), AUTO, → Eng Nr 072236	MVB2325R6	6PK2325
								Ⓢ	A/C(-), AUTO, Eng Nr 072237 →	MVB2380R6	6PK2380
Ⓢ	A/C(+), AUTO, → Eng Nr 072236	MVB2415R6	6PK2415								
Ⓢ	A/C(+), AUTO, Eng Nr 072237 →	MVB2475R6	6PK2475								

E-CLASS (W124)

E 200 (124.019)	M 111.940	100	06/93 → 06/95	Ⓢ	A/C(-)	MVB2040R6	6PK2040
				Ⓢ	A/C(+)	MVB2135R6	6PK2135
E 200 D (124.120)	OM 601.912	55	06/93 → 06/95	Ⓢ	A/C(-)	MVB2050R6	6PK2050
				Ⓢ	A/C(+)	MVB2120R6	6PK2120
E 220 (124.022)	M 111.960	110	06/93 → 06/95	Ⓢ	A/C(-)	MVB2040R6	6PK2040
				Ⓢ	A/C(+)	MVB2135R6	6PK2135
E 250 D (124.126, 124.129)	OM 605.911	83	07/93 → 06/95	Ⓢ	A/C(-)	MVB2080R6	6PK2080
				Ⓢ	A/C(+)	MVB2135R6	6PK2135



kW



...MERCEDES-BENZ

...E-CLASS (W124)

E 250 Turbo-D (124.128)	OM 602.962	93	06/93 → 06/95	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2135R6	6PK2135
E 280 (124.028)	M 104.942	145	06/93 → 06/95	⊗	A/C(-), AUTO, → Eng Nr 048696	MVB2325R6	6PK2325
				⊗	A/C(-), AUTO, Eng Nr 048697→	MVB2380R6	6PK2380
				⊗	A/C(+), AUTO, → Eng Nr 048696	MVB2415R6	6PK2415
				⊗	A/C(+), MAN, Eng Nr 005790→	MVB2475R6	6PK2475
E 280 long (124.029)	M 104.942	142	06/93 → 06/95	⊗	A/C(-), AUTO, → Eng Nr 048696	MVB2325R6	6PK2325
				⊗	A/C(-), AUTO, Eng Nr 048697→	MVB2380R6	6PK2380
				⊗	A/C(+), AUTO, → Eng Nr 048696	MVB2415R6	6PK2415
				⊗	A/C(+), MAN, Eng Nr 005790→	MVB2475R6	6PK2475
E 300 4-matic (124.230)	M 103.985	132	06/93 → 06/95	⊗	A/C(-)	MVB2170R6	6PK2170
				⊗	A/C(+), Cat(-)	MVB2250R6	6PK2250
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415
E 300 D (124.131)	OM 606.910	100	07/93 → 06/95	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2153R6	6PK2153
E 300 Turbo-D (124.133)	OM 603.960	108	06/93 → 06/95	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2153R6	6PK2153
E 300 Turbo-D 4-matic (124.333)	OM 603.963	108	06/93 → 06/95	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2153R6	6PK2153
E 320 (124.032)	M 104.992	162	06/93 → 06/95	⊗	A/C(-), AUTO, → Eng Nr 072236	MVB2325R6	6PK2325
				⊗	A/C(-), AUTO, Eng Nr 072237→102820	MVB2380R6	6PK2380
				⊗	A/C(-), AUTO, Eng Nr 102821→	MVB2350R6	6PK2350
				⊗	A/C(+), AUTO, Eng Nr 102821→	MVB2450R6	6PK2450
				⊗	A/C(+), MAN, → Eng Nr 004356	MVB2415R6	6PK2415
				⊗	A/C(+), MAN, Eng Nr 004357→005602	MVB2475R6	6PK2475
E 420 (124.034)	M 119.975	205	06/93 → 06/95	⊗	A/C(-)	MVB2460R6	6PK2460
				⊗	A/C(+)	MVB2540R6	6PK2540
E 500 (124.036)	M 119.974	235	06/93 → 06/95	⊗	AUTO, → Eng Nr 005781	MVB2460R8	8PK2460
				⊗	AUTO, Eng Nr 005782→	MVB2540R6	6PK2540

E-CLASS (W210)

E 50 AMG (210.072)	M 119.985 (AMG 5.0)	255	02/96 → 08/97	⊗	A/C(+), 09/96→	MVB2510R6	6PK2510
E 55 AMG (210.074)	M 113.980	260	08/97 → 03/02	⊗		MVB2390R6	6PK2390
E 55 AMG 4-matic (210.083)	M 113.980	260	03/01 → 03/02	⊗		MVB2390R6	6PK2390
E 200 (210.035)	M 111.942	100	06/95 → 08/00	⊗	A/C(-), RHA (-)	MVB2050R6	6PK2050
				⊗	A/C(-), RHA (+)	MVB2040R6	6PK2040
				⊗	A/C(+)	MVB2153R6	6PK2153
E 200 CDI (210.007)	OM 611.961	75	06/98 → 03/02	⊗	A/C(-)	MVB2190R6	6PK2190
		85	07/99 → 03/02	⊗	A/C(+)	MVB2271R6	6PK2271
				⊗	A/C(-)	MVB2190R6	6PK2190
				⊗	A/C(+)	MVB2271R6	6PK2271
E 200 D (210.003)	OM 604.917	65	01/96 → 03/02	⊗	A/C(-), →07/00	MVB2050R6	6PK2050
				⊗	A/C(+), →07/00	MVB2120R6	6PK2120
E 200 Kompressor (210.045)	M 111.947	137	06/97 → 03/02	⊗	→07/00	MVB1325R6	6PK1325
				⊗	A/C(-), RHA (-), →07/00	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+), →07/00	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-), →07/00	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+), →07/00	MVB1865R6	6PK1865
E 200 Kompressor (210.048)	M 111.957	120	08/00 → 03/02	⊗		MVB1352R6	6PK1352
				⊗		MVB1875R6	6PK1875
E 220 CDI (210.006)	OM 611.961	92	06/98 → 07/99	⊗	A/C(-)	MVB2190R6	6PK2190
				⊗	A/C(+)	MVB2271R6	6PK2271
		105	07/99 → 03/02	⊗	A/C(-)	MVB2190R6	6PK2190
				⊗	A/C(+)	MVB2271R6	6PK2271
E 220 D	OM 604.912	55	05/96 → 03/02	⊗	A/C(-), →05/98	MVB2040R6	6PK2040
				⊗	A/C(+), →05/98	MVB2120R6	6PK2120
E 220 D (210.004)	OM 604.912	70	06/95 → 07/99	⊗	A/C(-), →05/98	MVB2040R6	6PK2040
				⊗	A/C(+), →05/98	MVB2120R6	6PK2120
E 230 (210.037)	M 111.970	110	06/95 → 06/97	⊗	A/C(-)	MVB2040R6	6PK2040
				⊗	A/C(+)	MVB2153R6	6PK2153



kw



MERCEDES-BENZ

...MERCEDES-BENZ

...E-CLASS (W210)

E 240 (210.061)	M 112.911	125	06/97 → 08/00	⊗	A/C(-)	MVB2315R6	6PK2315
				⊗	A/C(+)	MVB2390R6	6PK2390
E 240 (210.062)	M 112.914	125	08/00 → 03/02	⊗		MVB2390R6	6PK2390
E 250 D (210.010)	OM 605.912	83	06/95 → 07/99	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2135R6	6PK2135
E 250 Turbo-D (210.015)	OM 605.962	110	06/97 → 07/99	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2135R6	6PK2135
E 270 CDI (210.016)	OM 612.961	125	07/99 → 03/02	⊗		MVB2271R6	6PK2271
E 280 (210.053)	M 104.945	142	01/96 → 06/97	⊗	A/C(-)	MVB2120R6	6PK2120
				⊗	A/C(-), →03/96	MVB2135R6	6PK2135
				⊗	A/C(+)	MVB2225R6	6PK2225
				⊗	A/C(+), →03/96	MVB2250R6	6PK2250
E 280 (210.063)	M 112.921	150	12/96 → 03/02	⊗	A/C(-), 04/97 →	MVB2315R6	6PK2315
				⊗	A/C(+), 04/97 →	MVB2390R6	6PK2390
E 280 4-matic (210.081)	M 112.921	150	12/96 → 03/02	⊗	A/C(-), 04/97 →	MVB2315R6	6PK2315
				⊗	A/C(+), 04/97 →	MVB2390R6	6PK2390
E 290 Turbo-D (210.017)	OM 602.982	95	03/96 → 07/99	⊗	A/C(-)	MVB2100R6	6PK2100
				⊗	A/C(+)	MVB2135R6	6PK2135
E 300 D (210.020)	OM 606.912	100	06/95 → 06/97	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2135R6	6PK2135
E 300 Turbo-D (210.025)	OM 606.962	130	12/96 → 07/99	⊗	A/C(-)	MVB2063R6	6PK2063
				⊗	A/C(+)	MVB2125R6	6PK2125
E 320 (210.055)	M 104.992	162	06/95 → 06/97	⊗	A/C(-), AUTO, →07/96, → Eng Nr 072236	MVB2325R6	6PK2325
				⊗	A/C(-), AUTO, →07/96, Eng Nr 072237 →102820	MVB2380R6	6PK2380
				⊗	A/C(-), MAN, →07/96, Eng Nr 005603 →	MVB2350R6	6PK2350
				⊗	A/C(+), AUTO, →07/96, Eng Nr 072237 →102820	MVB2475R6	6PK2475
				⊗	A/C(+), AUTO, →07/96, Eng Nr 102821 →	MVB2450R6	6PK2450
				⊗	A/C(+), MAN, →07/96, → Eng Nr 004356	MVB2415R6	6PK2415
E 320 (210.065)	M 112.941	165	06/97 → 03/02	⊗		MVB2390R6	6PK2390
E 320 4-matic (210.082)	M 112.941	165	06/97 → 03/02	⊗		MVB2390R6	6PK2390
E 320 CDI (210.026)	OM 613.961	145	07/99 → 03/02	⊗		MVB2271R6	6PK2271
E 420 (210.072)	M 119.985	205	01/96 → 06/97	⊗	A/C(+)	MVB2510R6	6PK2510
E 430 (210.070)	M 113.940	205	06/97 → 03/02	⊗		MVB2390R6	6PK2390
E 430 4-matic (210.083)	M 113.940	205	05/99 → 03/02	⊗		MVB2390R6	6PK2390

E-CLASS (W211)

E 55 AMG Kompressor (211.076)	M 113.990	350	10/02 →	⊗	→07/06	MVB2450R6	6PK2450
E 63 AMG (211.077)	M 156.983	378	03/06 →	⊗	08/06 →	MVB2373R6	6PK2373
E 200 CDI (211.004)	OM 646.951	75	07/02 →	⊗	11/02 →07/06	MVB2265R6	6PK2265
		90	07/02 →	⊗	11/02 →07/06	MVB2265R6	6PK2265
E 200 CDI (211.007)	OM 646.820	100	04/06 →	⊗		MVB2265R6	6PK2265
E 200 CGI	M 271.946	125	11/02 →	⊗	→07/06	MVB2315R7	7PK2315
E 200 Kompressor (211.041)		135	04/06 →	⊗		MVB2418R7	7PK2418
E 200 Kompressor (211.042)	M 271.941	120	11/02 →	⊗	→07/06	MVB2315R7	7PK2315
				⊗	02/04 →	MVB2418R7	7PK2418
E 220 CDI (211.006)	OM 646.961	110	03/02 →	⊗	→07/03, → Ch. A348117, X109211	MVB2250R6	6PK2250
				⊗	07/03 →07/06, Ch. A348118, X109212 →	MVB2265R6	6PK2265
		100	03/02 →	⊗	11/05 →	MVB2265R6	6PK2265
E 220 CDI (211.008)	OM 646.821	125	04/06 →	⊗	Ch. A348118, X109212 →	MVB2265R6	6PK2265
E 230		150	09/07 →	⊗		MVB2403R6	6PK2403
E 240 (211.061)	M 112.913, M 112.917	130	03/02 →	⊗	→11/02, → Ch. X095168	MVB2390R6	6PK2390
				⊗	09/02 →07/05, Ch. X095169 →	MVB2380R6	6PK2380
E 240 4-matic (211.080)	M 112.917	130	03/03 →	⊗	→07/05, Ch. X095169 →	MVB2380R6	6PK2380



kW



...MERCEDES-BENZ

...E-CLASS (W211)

E 270 CDI (211.016)	OM 647.961	130	03/02 →	⊗	→07/03, → Ch. A348118, X109212	MVB2265R6	6PK2265
				⊗	07/03→07/05, Ch. A348119, X109213→	MVB2240R6	6PK2240
E 280 (211.054)	M 272.943	170	03/05 →	⊗		MVB2403R6	6PK2403
E 280 4-matic (211.092)	M 272.943	170	01/06 →	⊗		MVB2403R6	6PK2403
E 280 CDI (211.020)	OM 642.920	140	03/05 →	⊗		MVB2035R7	7PK2035
E 280 CDI 4-matic	OM 642.921	140	03/05 →	⊗		MVB2035R7	7PK2035
E 320 (211.065)	M 112.949	165	03/02 →	⊗	→11/02, → Ch. X095168	MVB2390R6	6PK2390
				⊗	09/02→07/04, Ch. X095169→	MVB2380R6	6PK2380
E 320 4-matic (211.082)	M 112.954	165	03/03 →	⊗	→07/04, Ch. A135822→	MVB2380R6	6PK2380
E 320 CDI (211.022)	OM 642.920	165	03/05 →	⊗		MVB2035R7	7PK2035
E 320 CDI (211.026)	OM 648.961	150	11/02 →	⊗	→07/05, → Ch. A135822, X097253	MVB2265R6	6PK2265
				⊗	→07/05, Ch. A135823, X097254→	MVB2380R6	6PK2380
E 320 CDI 4-matic	OM 642.910	165	03/05 →	⊗		MVB2035R7	7PK2035
E 350 (211.056)	M 272.964	200	03/05 →	⊗		MVB2403R6	6PK2403
E 350 4-matic (211.087)	M 272.964, M 272.972	200	03/05 →	⊗		MVB2403R6	6PK2403
E 350 CGI	M 272.985	215	09/07 →	⊗		MVB2403R6	6PK2403
E 400 CDI (211.028)	OM 628.961	191	02/03 →	⊗	→07/05	MVB2271R7	7PK2271
E 500 (211.070)	M 113.967	225	03/02 →	⊗	→11/02, → Ch. X095168	MVB2390R6	6PK2390
				⊗	09/02→06/05, Ch. X095169→	MVB2380R6	6PK2380
E 500 (211.072)	M 273.960	285	04/06 →	⊗		MVB2403R6	6PK2403
E 500 4-matic (211.083)	M 113.969	225	10/03 →	⊗	→06/05, Ch. X095169→	MVB2380R6	6PK2380
E 500 4-matic (211.090)	M 273.962	285	04/06 →	⊗		MVB2403R6	6PK2403
E200 NGT	M 271.941	120	03/04 →	⊗	→07/06	MVB2315R7	7PK2315

E-CLASS Convertible (A124)

E 200 (124.060)	M 111.940	100	06/93 → 03/98	⊗	A/C(-), →07/96	MVB2040R6	6PK2040
				⊗	A/C(+), →07/96	MVB2135R6	6PK2135
E 220 (124.062)	M 111.960	110	06/93 → 03/98	⊗	A/C(-), →07/96	MVB2040R6	6PK2040
				⊗	A/C(+), →07/96	MVB2135R6	6PK2135
E 320 (124.066)	M 104.992, M 104.995	162	06/93 → 03/98	⊗	Eng. M104992, A/C(-), AUTO, →07/96, → Eng Nr 072236	MVB2325R6	6PK2325
				⊗	Eng. M104992, A/C(-), AUTO, →07/96, Eng Nr 102821→	MVB2350R6	6PK2350
				⊗	Eng. M104992, A/C(-), MAN, →07/96, Eng Nr 004357→005602	MVB2380R6	6PK2380
				⊗	Eng. M104992, A/C(+), AUTO, →07/96, → Eng Nr 072236	MVB2415R6	6PK2415
				⊗	Eng. M104992, A/C(+), AUTO, →07/96, Eng Nr 102821→	MVB2450R6	6PK2450
				⊗	Eng. M104992, A/C(+), AUTO, →07/96, Eng Nr 072237→102820	MVB2475R6	6PK2475

E-CLASS Coupe (C124)

E 200 (124.040)	M 111.940	100	06/93 → 06/97	⊗	A/C(-), →07/96	MVB2040R6	6PK2040
				⊗	A/C(+), →07/96	MVB2135R6	6PK2135
E 220 (124.042)	M 111.960	110	06/93 → 06/97	⊗	A/C(-), →07/96	MVB2040R6	6PK2040
				⊗	A/C(+), →07/96	MVB2135R6	6PK2135



kW


...MERCEDES-BENZ
...E-CLASS Coupe (C124)

E 320 (124.052)	M 104.992	162	06/93 → 06/97	①	A/C(-), AUTO, →07/96, Eng Nr 102821→	MVB2350R6	6PK2350
				②	A/C(-), MAN, →07/96, → Eng Nr 004356	MVB2325R6	6PK2325
				③	A/C(-), MAN, →07/96, Eng Nr 004357→005602	MVB2380R6	6PK2380
				④	A/C(+), AUTO, →07/96, → Eng Nr 072236	MVB2415R6	6PK2415
				⑤	A/C(+), AUTO, →07/96, Eng Nr 072237→102820	MVB2475R6	6PK2475
				⑥	A/C(+), AUTO, →07/96, Eng Nr 102821→	MVB2450R6	6PK2450

E-CLASS Estate (S124)

E 200 T (124.079)	M 111.940	100	06/93 → 06/96	①	A/C(-)	MVB2040R6	6PK2040
				②	A/C(+)	MVB2135R6	6PK2135
E 220 T (124.082)	M 111.960	110	06/93 → 06/96	③	A/C(-)	MVB2040R6	6PK2040
				④	A/C(+)	MVB2135R6	6PK2135
E 250 T D (124.186)	OM 605.911	83	06/93 → 06/96	⑤	A/C(-), →01/96	MVB2080R6	6PK2080
				⑥	A/C(+), →01/96	MVB2135R6	6PK2135
E 250 Turbo D	OM 602.962	93	06/93 → 06/96	⑦	A/C(-), →01/96	MVB2030R6	6PK2030
				⑧	A/C(+), →01/96	MVB2100R6	6PK2100
E 280 T (124.088)	M 104.942	142	06/93 → 06/96	⑨	A/C(-), AUTO, →01/96, → Eng Nr 048696	MVB2325R6	6PK2325
				⑩	A/C(-), AUTO, →01/96, Eng Nr 048697→	MVB2380R6	6PK2380
				⑪	A/C(+), AUTO, →01/96, → Eng Nr 048696	MVB2415R6	6PK2415
				⑫	A/C(+), MAN, →01/96, Eng Nr 005790→	MVB2475R6	6PK2475
E 280 T (124.088)	M 104.942	145	06/93 → 06/96	⑬	A/C(-), AUTO, →01/96, → Eng Nr 048696	MVB2325R6	6PK2325
				⑭	A/C(-), AUTO, →01/96, Eng Nr 048697→	MVB2380R6	6PK2380
				⑮	A/C(+), AUTO, →01/96, → Eng Nr 048696	MVB2415R6	6PK2415
				⑯	A/C(+), MAN, →01/96, Eng Nr 005790→	MVB2475R6	6PK2475
E 300 T 4-matic (124.290)	M 103.985	132	06/93 → 06/96	⑰	A/C(-), →01/96	MVB2170R6	6PK2170
				⑱	A/C(+), Cat(-), →01/96	MVB2250R6	6PK2250
				⑲	A/C(+), Cat(+), →01/96	MVB2415R6	6PK2415
E 300 T D (124.191)	OM 606.910	100	06/93 → 06/96	⑳	A/C(-), →01/96	MVB2080R6	6PK2080
				㉑	A/C(+), →01/96	MVB2153R6	6PK2153
E 300 T Turbo-D (124.193)	OM 603.960	108	06/93 → 06/96	㉒	A/C(-), →01/96	MVB2080R6	6PK2080
				㉓	A/C(+), →01/96	MVB2153R6	6PK2153
E 300 T Turbo-D 4-matic (124.393)	OM 603.963	108	06/93 → 06/96	㉔	A/C(-), →01/96	MVB2080R6	6PK2080
				㉕	A/C(+), →01/96	MVB2153R6	6PK2153
E 320 T (124.092)	M 104.992	162	06/93 → 06/96	㉖	A/C(-), AUTO, Eng Nr 072237→102820	MVB2380R6	6PK2380
				㉗	A/C(-), MAN, → Eng Nr 004356	MVB2325R6	6PK2325
				㉘	A/C(-), MAN, Eng Nr 005603→	MVB2350R6	6PK2350
				㉙	A/C(+), AUTO, → Eng Nr 072236	MVB2415R6	6PK2415
				㉚	A/C(+), AUTO, Eng Nr 102821→	MVB2450R6	6PK2450
				㉛	A/C(+), MAN, Eng Nr 004357→005602	MVB2475R6	6PK2475

E-CLASS Estate (S210)

E 55 T AMG (210.274)	M 113.980	260	08/97 → 03/03	①		MVB2390R6	6PK2390
E 55 T AMG 4-matic (210.283)	M 113.980	260	03/01 → 03/03	②		MVB2390R6	6PK2390
E 200 T (210.235)	M 111.942	100	06/96 → 08/00	③	A/C(-), RHA (-)	MVB2050R6	6PK2050
				④	A/C(-), RHA (+)	MVB2040R6	6PK2040
				⑤	A/C(+)	MVB2153R6	6PK2153



kW



...MERCEDES-BENZ

...E-CLASS Estate (S210)

E 200 T Kompressor (210.245)	M 111.947	137	06/97 → 03/03	⊗	→07/00	MVB1325R6	6PK1325
				⊗	A/C(-), RHA (-), →07/00	MVB1775R6	6PK1775
				⊗	A/C(-), RHA (+), →07/00	MVB1760R6	6PK1760
				⊗	A/C(+), RHA (-), →07/00	MVB1875R6	6PK1875
				⊗	A/C(+), RHA (+), →07/00	MVB1865R6	6PK1865
E 200 T Kompressor (210.248)	M 111.957	120	08/00 → 03/03	⊗		MVB1352R6	6PK1352
				⊗		MVB1875R6	6PK1875
E 220 T CDI (210.206)	OM 611.961	92	06/98 → 07/99	⊗	A/C(-)	MVB2190R6	6PK2190
		105	07/99 → 03/03	⊗	A/C(+)	MVB2271R6	6PK2271
				⊗	A/C(-)	MVB2190R6	6PK2190
				⊗	A/C(+)	MVB2271R6	6PK2271
E 230 T (210.237)	M 111.970	110	06/96 → 06/97	⊗	A/C(-)	MVB2040R6	6PK2040
				⊗	A/C(+)	MVB2153R6	6PK2153
E 240 T (210.261)	M 112.911	125	06/97 → 03/03	⊗	A/C(-)	MVB2315R6	6PK2315
				⊗	A/C(+)	MVB2390R6	6PK2390
E 240 T (210.262)	M 112.914	125	08/00 → 03/03	⊗		MVB2390R6	6PK2390
E 250 T D (210.210)	OM 605.912	83	06/96 → 07/99	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2135R6	6PK2135
E 250 T Turbo-D (210.215)	OM 605.962	110	06/97 → 07/99	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2135R6	6PK2135
E 270 T CDI (210.216)	OM 612.961	125	07/99 → 03/03	⊗		MVB2271R6	6PK2271
E 280 T (210.263)	M 112.921	150	12/96 → 03/03	⊗	A/C(-), 04/97 →	MVB2315R6	6PK2315
				⊗	A/C(+), 04/97 →	MVB2390R6	6PK2390
E 280 T 4-matic (210.281)	M 112.921	150	12/96 → 03/03	⊗	A/C(-), 04/97 →	MVB2315R6	6PK2315
				⊗	A/C(+), 04/97 →	MVB2390R6	6PK2390
E 290 T Turbo-D (210.217)	OM 602.982	95	06/96 → 07/99	⊗	A/C(-)	MVB2100R6	6PK2100
				⊗	A/C(+)	MVB2135R6	6PK2135
E 300 T Turbo-D (210.225)	OM 606.962	130	12/96 → 07/99	⊗	A/C(-)	MVB2063R6	6PK2063
				⊗	A/C(+)	MVB2125R6	6PK2125
E 320 T (210.265)	M 112.941	165	12/96 → 03/03	⊗		MVB2390R6	6PK2390
E 320 T 4-matic (210.282)	M 112.941	165	12/96 → 03/03	⊗		MVB2390R6	6PK2390
E 320 T CDI (210.226)	OM 613.961	145	07/99 → 03/03	⊗		MVB2271R6	6PK2271
E 420 T (210.272)	M 119.985	205	06/96 → 06/97	⊗	A/C(+)	MVB2510R6	6PK2510
E 430 T (210.270)	M 113.940	205	06/97 → 03/03	⊗		MVB2390R6	6PK2390
E 430 T 4-matic (210.283)	M 113.940	205	05/99 → 03/03	⊗		MVB2390R6	6PK2390

E-CLASS T-Model (S211)

E 55 T AMG Kompressor (211.276)	M 113.990	350	07/03 →	⊗	→07/06	MVB2450R6	6PK2450
E 63 AMG (211.277)	M 156.983	378	03/06 →	⊗	08/06 →	MVB2373R6	6PK2373
E 200 CDI (211.207)	OM 646.821	100	04/06 →	⊗		MVB2265R6	6PK2265
E 200 Kompressor (211.241)		135	04/06 →	⊗		MVB2418R7	7PK2418
E 200 T Kompressor (211.242)	M 271.941	120	03/03 →	⊗	→07/06	MVB2315R7	7PK2315
E 220 CDI (211.206)	OM 646.961	100	03/03 →	⊗	11/05 →	MVB2265R6	6PK2265
E 220 T CDI (211.206)	OM 646.961	110	03/03 →	⊗	→07/03, → Ch. A348117, X109211	MVB2240R6	6PK2240
				⊗	07/03 → 07/05, Ch. A348118, X109212 →	MVB2265R6	6PK2265
E 220 T CDI (211.208)	OM 646.821	125	04/06 →	⊗	Ch. A348118, X109212 →	MVB2265R6	6PK2265
E 240 T (211.261)	M 112.913	130	03/03 →	⊗	→07/05, Ch. X095169 →	MVB2380R6	6PK2380
E 240 T 4-matic (211.280)	M 112.917	130	07/03 →	⊗	→07/05, Ch. X095169 →	MVB2380R6	6PK2380
E 270 T CDI (211.216)	OM 647.961	130	03/03 →	⊗	→07/03, → Ch. A348118, X109212	MVB2265R6	6PK2265
				⊗	07/03 → 07/05, Ch. A348119, X109213 →	MVB2240R6	6PK2240
E 280 T (211.254)	M 272.943	170	03/05 →	⊗		MVB2403R6	6PK2403
E 280 T 4-matic (211.292)	M 272.943	170	03/05 →	⊗		MVB2403R6	6PK2403
E 280 T CDI (211.220)	OM 642.920	140	03/05 →	⊗		MVB2035R7	7PK2035
E 280 T CDI (211.223)	OM 648.961	130	05/04 →	⊗	→07/05	MVB2265R6	6PK2265
E 280 T CDI 4-matic	OM 642.921	140	03/05 →	⊗		MVB2035R7	7PK2035
E 320 T (211.265)	M 112.949	165	03/03 →	⊗	→07/04, Ch. A135822 →	MVB2380R6	6PK2380
E 320 T 4-matic (211.282)	M 112.954	165	07/03 →	⊗	→07/04, Ch. X095169 →	MVB2380R6	6PK2380
E 320 T CDI (211.222)	OM 642.920	165	03/05 →	⊗		MVB2035R7	7PK2035



kW


...MERCEDES-BENZ
...E-CLASS T-Model (S211)

E 320 T CDI (211.226)	OM 648.961	150	03/03 →	⊗	→07/05, → Ch. A135822, X097253	MVB2265R6	6PK2265
				⊗	→07/05, Ch. A135823, X097254→	MVB2380R6	6PK2380
E 320 T CDI 4-matic	OM 642.920	165	03/05 →	⊗		MVB2035R7	7PK2035
E 350 T (211.256)	M 272.964, M 272.972	200	03/05 →	⊗		MVB2403R6	6PK2403
E 350 T 4-matic (211.287)	M 272.964, M 272.972	200	03/05 →	⊗		MVB2403R6	6PK2403
E 500 T (211.270)	M 113.967	225	10/03 →	⊗	→06/05, Ch. X095169→	MVB2380R6	6PK2380
E 500 T (211.272)	M 273.960	285	04/06 →	⊗		MVB2403R6	6PK2403
E 500 T 4-matic (211.283)	M 113.969	225	10/03 →	⊗	→06/05, Ch. X095169→	MVB2380R6	6PK2380
E 500 T 4-matic (211.290)		285	04/06 →	⊗		MVB2403R6	6PK2403

G-CLASS (W460)

230 G (460,2)	M 115.973	66	03/79 → 07/93	⊗	→08/89	SVB131350	13x1350
				⊗	→08/89, → Eng Nr 2762	SVB10960	10x960
				⊗	→08/89, Eng Nr 2763→	SVB10940	10x940
				⊗	→08/89	SVB13950	13x950
	75	02/80 → 07/87	⊗	→08/89	SVB13975	13x975	
			⊗		SVB131350	13x1350	
			⊗	→ Eng Nr 2762	SVB10960	10x960	
			⊗	Eng Nr 2763→	SVB10940	10x940	
230 GE (460,2)	M 102.979, M 102.987	90	05/87 → 08/92	⊗		SVB13950	13x950
				⊗		SVB13975	13x975
				⊗		SVB13750	13x750
230 GE (460,2)	M 102.981, M 102.987	92	04/82 → 08/92	⊗		SVB13875	13x875
				⊗		SVB101000	10x1000
				⊗		SVB13750	13x750
240 GD (460,3)	OM 616.936	53	03/79 → 08/87	⊗		SVB131350	13x1350
250 GD (460,3)	OM 602.930	62	10/87 → 12/92	⊗	→ Eng Nr 000007	SVB10960	10x960
				⊗	Eng Nr 000008→	SVB131025	13x1025
250 GD (460,3)	OM 602.930	68	12/88 → 08/92	⊗	A/C(-)	MVB2050R6	6PK2050
				⊗	A/C(+)	MVB2120R6	6PK2120
280 GE (460,2)	M 110.994	110	08/84 → 08/89	⊗	A/C(-)	MVB2050R6	6PK2050
				⊗	A/C(+)	MVB2120R6	6PK2120
280 GE (460,2)	M 110.994	110	08/84 → 08/89	⊗		SVB131275	13x1275
				⊗	LHD	SVB10960	10x960
				⊗	RHA(+)	SVB10940	10x940
				⊗		SVB131000	13x1000
	115	11/79 → 08/89	⊗		SVB131275	13x1275	
			⊗	LHD	SVB10960	10x960	
			⊗	RHA(+)	SVB10940	10x940	
			⊗		SVB131000	13x1000	
300 GD (460,3)	OM 617.931	65	12/79 → 12/91	⊗	→08/89	SVB131350	13x1350
				⊗	→ Eng Nr 000090	SVB131025	13x1025
				⊗	09/89→, Eng Nr 000091→	SVB131015	13x1015
				⊗		SVB131150	13x1150
300 GD (460,3)	OM 603.912	83	03/79 → 07/93	⊗	A/C(-), 08/89→	MVB2050R6	6PK2050
				⊗	A/C(+), 08/89→	MVB2120R6	6PK2120

G-CLASS (W461)

230 GE (461)	M 102.996, M 102.997	92	06/93 →	⊗	→07/00	SVB13875	13x875	
				⊗	→07/00	SVB101000	10x1000	
				⊗	Eng. M102996, A/C(-), PS,	MVB1855R6	6PK1855	
				⊗	→07/00			
	230 GE (461.238, 461.239)	M 102.979	90	02/93 →	⊗	Eng. M102996, A/C(+), →07/00	MVB2250R6	6PK2250
					⊗	→07/00	SVB13750	13x750
					⊗	→07/00	SVB13875	13x875
					⊗	→07/00	SVB101000	10x1000
230 GE (461.238, 461.239)	M 102.979	90	02/93 →	⊗	A/C(-), PS, →07/96	MVB1855R6	6PK1855	
				⊗	A/C(+), 07/93→07/96	MVB2250R6	6PK2250	
				⊗	→07/00	SVB13750	13x750	
				⊗				



kW


...MERCEDES-BENZ
...G-CLASS (W461)

250 GD (461)	OM 602.939	68	02/90 →	⊗ ⊗ ⊗	A/C(-), →07/96 A/C(+), →07/96	MVB2050R6 MVB2120R6	6PK2050 6PK2120
290 GD/G 290 D (461.337, 461.338)	OM 602.942	70	04/92 →	⊗ ⊗ ⊗ ⊗	A/C(-), 06/93→07/00, → Ch. 000159 A/C(-), 06/93→07/00, Ch. 000160→ A/C(+), 06/93→07/00, → Ch. 000159 A/C(+), 06/93→07/00, Ch. 000160→	MVB2030R6 MVB2080R6 MVB2100R6 MVB2153R6	6PK2030 6PK2080 6PK2100 6PK2153
G 290 TD (461.335, 461.336)	OM 602.983	88	07/97 →	⊗ ⊗	A/C(-), →07/01 A/C(+), →07/01	MVB2080R6 MVB2153R6	6PK2080 6PK2153

G-CLASS (W463)

230 GE (463.224, 463.225)	M 102.989	93	06/90 → 06/93	⊗ ⊗	A/C(-), PS A/C(+)	MVB1855R6 MVB2250R6	6PK1855 6PK2250
250 GD (463)	OM 602.931	69	06/90 →	⊗ ⊗	A/C(-), →07/96 A/C(+), →07/96	MVB2050R6 MVB2120R6	6PK2050 6PK2120
300 GD (463.327, 463.328)	OM 603.931	83	09/89 →	⊗ ⊗	A/C(-), →08/97 A/C(+), →08/97	MVB2050R6 MVB2120R6	6PK2050 6PK2120
300 GE (463)	M 103.987	128	06/90 →	⊗ ⊗ ⊗	A/C(-), AUTO, 05/93→08/97 A/C(-), MAN, 05/93→08/97 A/C(+), 05/93→08/97	MVB2265R6 MVB2170R6 MVB2350R6	6PK2265 6PK2170 6PK2350
300 GE (463.227, 463.228)	M 103.987	125	06/90 →	⊗ ⊗ ⊗	A/C(-), AUTO, →08/97 A/C(-), MAN, →08/97 A/C(+), →08/97	MVB2265R6 MVB2170R6 MVB2350R6	6PK2265 6PK2170 6PK2350
350 G Turbo D (463.320, 463.321)	OM 603.972	100	09/91 →	⊗ ⊗ ⊗ ⊗	A/C(-), →08/97, → Eng Nr 002097 A/C(-), →08/97, Eng Nr 002098→ A/C(+), →08/97, → Eng Nr 002097 A/C(+), →08/97, Eng Nr 002098→	MVB2030R6 MVB2080R6 MVB2100R6 MVB2153R6	6PK2030 6PK2080 6PK2100 6PK2153
G 36 AMG		200	01/95 →	⊗ ⊗ ⊗ ⊗	A/C(-), →07/98, → Eng Nr 002383 A/C(-), →07/98, Eng Nr 002384→ A/C(+), →07/98, → Eng Nr 002383 A/C(+), →07/98, Eng Nr 002384→	MVB2135R6 MVB2120R6 MVB2415R6 MVB2380R6	6PK2135 6PK2120 6PK2415 6PK2380
G 55 AMG	M 113.993	350	06/04 →	⊗	→07/06	MVB2450R6	6PK2450
G 55 AMG (463.243, 463.246)	M 113.982	260	04/99 →	⊗ ⊗	09/99→, → Ch. 144225 09/99→, Ch. 144226→	MVB2390R6 MVB2380R6	6PK2390 6PK2380
G 270 CDI (463.322, 463.323)	OM 612.966	115	10/01 →	⊗	→07/03, Ch. X127404→	MVB2250R6	6PK2250
G 300 TD (463.330, 463.331)	OM 606.964	130	08/96 →	⊗ ⊗	A/C(-), →07/00 A/C(+), →07/00	MVB2080R6 MVB2153R6	6PK2080 6PK2153
G 320 (463.232, 463.233)	M 112.945	158	07/97 →	⊗ ⊗ ⊗	→08/04, Ch. 144226→ A/C(-), →08/04 A/C(+), →08/04, → Ch. 144225	MVB2380R6 MVB2315R6 MVB2390R6	6PK2380 6PK2315 6PK2390
G 320 CDI	OM 642.970	165	09/06 →	⊗		MVB2040R8	8PK2040
G 400 CDI (463.332, 463.333)	OM 628.962	184	12/00 →	⊗	→07/06, → Ch. 144225	MVB2271R7	7PK2271
G 500 (463.247, 463.248, 463.249)	M 113.962	218	04/98 →	⊗ ⊗	→07/06, → Ch. 144225 →07/06, Ch. 144226→	MVB2390R6 MVB2380R6	6PK2390 6PK2380

G-CLASS Cabrio (W463)

230 GE (463.204)	M 102.989	93	06/90 → 02/93	⊗ ⊗ ⊗ ⊗		SVB13875 SVB101000 MVB1855R6 SVB13750	13x875 10x1000 6PK1855 13x750
300 GD (463.307)	OM 603.931	83	12/90 → 09/97	⊗ ⊗	A/C(-) A/C(+)	MVB2050R6 MVB2120R6	6PK2050 6PK2120



kW


...MERCEDES-BENZ
...G-CLASS Cabrio (W463)

300 GE (463.207)	M 103.987	125	09/89 → 09/97	⊗ ⊗ ⊗	A/C(-), AUTO A/C(-), MAN A/C(+)	MVB2265R6 MVB2170R6 MVB2350R6	6PK2265 6PK2170 6PK2350
350 G Turbo-D (463.300)	OM 603.972	100	09/91 → 09/97	⊗ ⊗ ⊗ ⊗	A/C(-), → Eng Nr 002097 A/C(-), Eng Nr 002098 → A/C(+), → Eng Nr 002097 A/C(+), Eng Nr 002098 →	MVB2030R6 MVB2080R6 MVB2100R6 MVB2153R6	6PK2030 6PK2080 6PK2100 6PK2153
G 300 TD (463.308)	OM 606.964	130	09/96 →	⊗ ⊗	A/C(-), →07/00 A/C(+), →07/00	MVB2080R6 MVB2153R6	6PK2080 6PK2153
G 320 (463.209)	M 112.945	158	11/97 →	⊗ ⊗ ⊗	→08/04, Ch. 144226 → A/C(-), →08/04 A/C(+), →08/04, → Ch. 144225	MVB2380R6 MVB2315R6 MVB2390R6	6PK2380 6PK2315 6PK2390
G 400 CDI (463.309)	OM 628.962	184	12/00 →	⊗	→07/06, → Ch. 144225	MVB2271R7	7PK2271
G 500 (463)	M 113.962	218	04/98 →	⊗ ⊗	→07/06, → Ch. 144225 →07/06, Ch. 144226 →	MVB2390R6 MVB2380R6	6PK2390 6PK2380

GL-CLASS (X164)

GL 320 CDI (164.822)	OM 642.822	165	09/06 →	⊗ ⊗	06/08 →	MVB2040R8 MVB2035R7	8PK2040 7PK2035
GL 450	M 273.923	250	09/06 →	⊗		MVB2403R6	6PK2403
GL 500 (164.886)	M 273.963	285	09/06 →	⊗		MVB2403R6	6PK2403

KOMBI Estate (S123)

200 T	M 102.920	80	11/80 → 11/85	⊗ ⊗ ⊗	→02/85 →02/85 →02/85	SVB13875 SVB101000 SVB13750	13x875 10x1000 13x750
200 T (123.280)	M 102.939	74	11/80 → 11/85	⊗ ⊗ ⊗	→02/85 →02/85 →02/85	SVB13875 SVB101000 SVB13750	13x875 10x1000 13x750
230 T (123.083)	M 115.954	80	09/77 → 03/80	⊗ ⊗ ⊗	→ Eng Nr 063338 Eng Nr 063339 →	SVB10940 SVB10960 SVB13750	10x940 10x960 13x750
230 TE (123.283)	M 102.980	100	04/80 → 11/85	⊗ ⊗ ⊗		SVB13875 SVB101000 SVB13750	13x875 10x1000 13x750
240 T D	OM 616.912	48	09/77 → 02/79	⊗ ⊗ ⊗ ⊗	→ Eng Nr 912086378 Eng Nr 912086379 →	SVB131375 SVB10960 SVB131025 SVB131150	13x1375 10x960 13x1025 13x1150
240 T D (123.183)	OM 616.912	53	03/79 → 12/85	⊗ ⊗ ⊗ ⊗	→02/85 →02/85, → Eng Nr 912086378 →02/85, Eng Nr 912086379 → →02/85	SVB131375 SVB10960 SVB131025 SVB131150	13x1375 10x960 13x1025 13x1150
250 T (123.086)	M 123.921	95	05/78 → 10/79	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	SVB131275 SVB10925 SVB10960 SVB13825	13x1275 10x925 10x960 13x825
		103	05/78 → 08/82	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	SVB131275 SVB10925 SVB10960 SVB13825	13x1275 10x925 10x960 13x825
280 TE (123.093)	M 110.988	136	09/77 → 11/85	⊗ ⊗ ⊗ ⊗	→02/85 AUTO, →02/85, → Eng Nr 076808 AUTO, →02/85, Eng Nr 076809 →	SVB131275 SVB10925 SVB10975 SVB13825	13x1275 10x925 10x975 13x825
300 T D (123.190)	OM 617.912	59	09/77 → 10/85	⊗ ⊗ ⊗ ⊗	→02/85 →02/85 →02/85 →02/85	SVB13925 SVB101025 SVB131150 SVB13925	13x925 10x1025 13x1150 13x925
		65	03/79 → 11/85	⊗ ⊗ ⊗	→02/85 →02/85 →02/85	SVB13925 SVB101025 SVB131150	13x925 10x1025 13x1150



kW


...MERCEDES-BENZ
...KOMBI Estate (S123)

300 T Turbo-D (123.193)	OM 617.952	92	10/80 → 11/85	⚙ ⚙ ⚙	→02/85 →02/85 →02/85	SVB13925 SVB131025 SVB131150	13x925 13x1025 13x1150
-------------------------	------------	----	---------------	-------------	----------------------------	------------------------------------	------------------------------

KOMBI Estate (S124)

200 T (124.080)	M 102.922	77	01/86 → 05/90	⚙ ⚙ ⚙	A/C(-) A/C(+) A/C(-)	MVB1885R6 MVB1980R6 MVB1885R6	6PK1885 6PK1980 6PK1885
		80	09/85 → 08/89	⚙ ⚙	A/C(-) A/C(+)	MVB1885R6 MVB1980R6	6PK1885 6PK1980
200 T D (124.180)	OM 601.912	53	09/85 → 08/91	⚙ ⚙	A/C(-) A/C(+)	MVB2050R6 MVB2120R6	6PK2050 6PK2120
		55	09/88 → 08/91	⚙ ⚙	A/C(-) A/C(+)	MVB2050R6 MVB2120R6	6PK2050 6PK2120
200 TE	M 102.962	90	09/88 → 12/89	⚙ ⚙	A/C(-) A/C(+)	MVB1885R6 MVB1980R6	6PK1885 6PK1980
200 TE (124.079)	M 111.940	100	10/92 → 06/93	⚙ ⚙	A/C(-) A/C(+)	MVB2040R6 MVB2135R6	6PK2040 6PK2135
200 TE (124.081)	M 102.963	87	09/88 → 08/92	⚙ ⚙	A/C(-) A/C(+)	MVB1885R6 MVB1980R6	6PK1885 6PK1980
220 TE (124.082)	M 111.960	110	10/92 → 05/93	⚙ ⚙	A/C(-) A/C(+)	MVB2040R6 MVB2135R6	6PK2040 6PK2135
230 TE (124.083)	M 102.982	100	09/85 → 08/92	⚙ ⚙	A/C(-) A/C(+)	MVB1885R6 MVB1980R6	6PK1885 6PK1980
		97	09/85 → 08/92	⚙ ⚙	A/C(-) A/C(+)	MVB1885R6 MVB1980R6	6PK1885 6PK1980
230 TE (124.083) CAT	M 102.982	97	06/89 → 08/92	⚙ ⚙	A/C(-) A/C(+)	MVB1885R6 MVB1980R6	6PK1885 6PK1980
250 T D (124.185)	OM 602.912	66	09/85 → 06/93	⚙ ⚙	A/C(-) A/C(+)	MVB2030R6 MVB2100R6	6PK2030 6PK2100
		69	01/89 → 06/93	⚙ ⚙	A/C(-) A/C(+)	MVB2030R6 MVB2100R6	6PK2030 6PK2100
250 TD Turbo (124.128)	OM 602.962	93	03/88 → 07/93	⚙ ⚙	A/C(-) A/C(+)	MVB2030R6 MVB2100R6	6PK2030 6PK2100
260 TE FGST.	M 103.940	118	09/89 → 08/92	⚙ ⚙ ⚙	A/C(-) A/C(+), Cat(-) A/C(+), Cat(+)	MVB2170R6 MVB2265R6 MVB2415R6	6PK2170 6PK2265 6PK2415
		122	09/85 → 12/89	⚙ ⚙ ⚙	A/C(-) A/C(+), Cat(-) A/C(+), Cat(+)	MVB2170R6 MVB2265R6 MVB2415R6	6PK2170 6PK2265 6PK2415
280 TE (124.088)	M 104.942	145	10/92 → 06/93	⚙ ⚙ ⚙ ⚙	A/C(-), AUTO, → Eng Nr 048696 A/C(-), AUTO, Eng Nr 048697→ A/C(+), AUTO, → Eng Nr 048696 A/C(+), AUTO, Eng Nr 048697→	MVB2325R6 MVB2380R6 MVB2415R6 MVB2475R6	6PK2325 6PK2380 6PK2415 6PK2475
300 T D (124.190)	OM 603.912	80	09/86 → 06/93	⚙ ⚙	A/C(-) A/C(+)	MVB2080R6 MVB2153R6	6PK2080 6PK2153
		81	01/89 → 06/93	⚙ ⚙	A/C(-) A/C(+)	MVB2080R6 MVB2153R6	6PK2080 6PK2153
		83	01/89 → 06/93	⚙ ⚙	A/C(-) A/C(+)	MVB2080R6 MVB2153R6	6PK2080 6PK2153
300 T Turbo-D	OM 603.963	105	09/86 → 01/89	⚙ ⚙	A/C(-) A/C(+)	MVB2080R6 MVB2153R6	6PK2080 6PK2153
300 T Turbo-D (124.193)	OM 603.960	108	01/89 → 06/93	⚙ ⚙	A/C(-) A/C(+)	MVB2080R6 MVB2153R6	6PK2080 6PK2153
300 T Turbo-D 4-matic (124.393)	OM 603.963	105	09/86 → 01/89	⚙ ⚙	A/C(-) A/C(+)	MVB2080R6 MVB2153R6	6PK2080 6PK2153
	OM 603.960	108	01/89 → 06/93	⚙ ⚙	A/C(-) A/C(+)	MVB2080R6 MVB2153R6	6PK2080 6PK2153
300 TE (124.090)	M 103.983	132	01/86 → 08/92	⚙ ⚙ ⚙	A/C(-) A/C(+), Cat(-) A/C(+), Cat(+)	MVB2170R6 MVB2265R6 MVB2415R6	6PK2170 6PK2265 6PK2415
		138	01/86 → 12/89	⚙ ⚙ ⚙	A/C(-) A/C(+), Cat(-) A/C(+), Cat(+)	MVB2170R6 MVB2265R6 MVB2415R6	6PK2170 6PK2265 6PK2415



kw



MERCEDDES-BENZ

...MERCEDDES-BENZ

...KOMBI Estate (S124)

300 TE 4-matic (124.290)	M 103.985	132	09/86 → 06/93	⊗	A/C(-)	MVB2170R6	6PK2170
				⊗	A/C(+), Cat(-)	MVB2265R6	6PK2265
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415
	M 103.983	138	09/86 → 12/89	⊗	A/C(-)	MVB2170R6	6PK2170
				⊗	A/C(+), Cat(-)	MVB2265R6	6PK2265
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415
300 TE-24 (124.091)	M 104.980	162	09/89 → 08/92	⊗	A/C(-), AUTO, Cat(-), Eng Nr 042811→	MVB2170R6	6PK2170
				⊗	A/C(-), MAN, Cat(-), → Eng Nr 009076	MVB2205R6	6PK2205
				⊗	A/C(-), MAN, Cat(+), → Eng Nr 009076	MVB2350R6	6PK2350
				⊗	A/C(-), MAN, Cat(+), Eng Nr 009077→	MVB2325R6	6PK2325
				⊗	A/C(+), AUTO, Cat(-), Eng Nr 042811→	MVB2265R6	6PK2265
				⊗	A/C(+), AUTO, Cat(+), Eng Nr 042811→	MVB2415R6	6PK2415
				⊗	A/C(+), MAN, Cat(-), → Eng Nr 009076	MVB2280R6	6PK2280
				⊗	A/C(+), MAN, Cat(+), → Eng Nr 009076	MVB2450R6	6PK2450
320 TE (124.092)	M 104.992	162	10/92 → 06/93	⊗	A/C(-), AUTO, Eng Nr 072237→	MVB2380R6	6PK2380
				⊗	A/C(-), MAN, → Eng Nr 004356	MVB2325R6	6PK2325
				⊗	A/C(+), AUTO, → Eng Nr 072236	MVB2415R6	6PK2415
				⊗	A/C(+), AUTO, Eng Nr 072237→	MVB2475R6	6PK2475

M-CLASS (W163)

ML 55 AMG (163.174)	M 113.981	255	02/00 → 06/05	⊗		MVB2390R6	6PK2390
ML 230 (163.136)	M 111.977	110	02/98 → 06/05	⊗	A/C(-), →08/00	MVB2050R6	6PK2050
				⊗	A/C(+), →08/00	MVB2153R6	6PK2153
ML 270 CDI (163.113)	OM 612.963	120	12/99 → 06/05	⊗		MVB2271R6	6PK2271
ML 320 (163.154)	M 112.942	160	02/98 → 08/02	⊗	A/C(-)	MVB2315R6	6PK2315
				⊗	A/C(+)	MVB2390R6	6PK2390
ML 350	M 112.970	173	02/03 → 06/05	⊗	→ Eng Nr A429265, X778320	MVB2390R6	6PK2390
				⊗	Eng Nr A429266→	MVB2373R6	6PK2373
ML 350 (163.157)	M 112.970	180	08/02 → 06/05	⊗	→ Eng Nr A429265, X778320	MVB2390R6	6PK2390
				⊗	Eng Nr A429266→	MVB2373R6	6PK2373
ML 400 CDI (163.128)	OM 628.963	184	09/01 → 06/05	⊗		MVB2271R7	7PK2271
ML 430 (163.172)	M 113.942	200	02/98 → 06/05	⊗	11/98→08/02	MVB2390R6	6PK2390
ML 500 (163.175)	M 113.964, M 113.965	215	09/01 → 06/05	⊗	Eng. M113965,	MVB2390R6	6PK2390
				⊗	→ Eng Nr A429265, X778320		
				⊗	Eng. M113965, Eng Nr A429266→	MVB2373R6	6PK2373

M-CLASS (W164)

ML 63 AMG 4-matic (164.177)	M 156.980	375	01/06 →	⊗		MVB2373R6	6PK2373
ML 280 CDI 4-matic (164.120)	OM 642.940	140	07/05 →	⊗		MVB2040R8	8PK2040
ML 320 CDI 4-matic (164.122)	OM 642.940	165	07/05 →	⊗		MVB2040R8	8PK2040
ML 350 4-matic (164.186)	M 272.962, M 272.967	200	07/05 →	⊗		MVB2403R6	6PK2403
ML 500 4-matic	M 273.963	285	12/07 →	⊗		MVB2403R6	6PK2403
ML 500 4-matic (164.175)	M 113.964	225	07/05 →	⊗	→07/07	MVB2380R6	6PK2380

R-CLASS (W251)

R 63 AMG (251.077, 251.177)	M 156.980	375	02/06 →	⊗		MVB2373R6	6PK2373
R 280 (251.054)	M 272.945	170	01/07 →	⊗		MVB2403R6	6PK2403
R 280 CDI (251.026, 251.126)	OM 642.950	140	05/06 →	⊗	→02/08, → Ch. A080334	MVB2040R8	8PK2040
				⊗	02/08→, Ch. A080335→	MVB2035R7	7PK2035
R 280 CDI 4-matic (251.020)	OM 642.950	140	05/06 →	⊗	→02/08, → Ch. A080334	MVB2040R8	8PK2040
				⊗	02/08→, Ch. A080335→	MVB2035R7	7PK2035
R 320 CDI 4-matic (251.022, 251.122)	OM 642.950	165	01/06 →	⊗		MVB2040R8	8PK2040
R 350 (251.056, 251.156)	M 272.967	200	01/07 →	⊗		MVB2403R6	6PK2403
R 350 4-matic (251.065)	M 272.967	200	01/06 →	⊗		MVB2403R6	6PK2403





kW



...MERCEDES-BENZ

...R-CLASS (W251)

R 500 4-matic (251.072, 251.172)	M 273.963	285	01/07 →	⊗	05/07 →	MVB2380R6	6PK2380
R 500 4-matic (251.075, 251.175)	M 113.971	225	01/06 →	⊗		MVB2380R6	6PK2380

Saloon (W123)

200	M 115.938, M 115.939	62	02/76 → 08/80	⊗ ⊗ ⊗ ⊗	Eng. M115939, →02/79 Eng. M115939, →02/79, → Eng Nr 007563 Eng. M115939, →02/79, Eng Nr 007564 → Eng. M115939, →02/79	SVB131375 SVB10940 SVB10960 SVB13750	13x1375 10x940 10x960 13x750
	M 102.939	74	06/80 → 11/85	⊗ ⊗ ⊗	→02/85 →02/85 →02/85	SVB13875 SVB101000 SVB13750	13x875 10x1000 13x750
200 (123.020)	M 115.938, M 115.939	69	02/76 → 08/80	⊗ ⊗ ⊗ ⊗	Eng. M115938 Eng. M115938, → Eng Nr 053135 Eng. M115938, Eng Nr 053136 → Eng. M115938	SVB131375 SVB10940 SVB10960 SVB13750	13x1375 10x940 10x960 13x750
200 (123.220)	M 102.920	80	06/80 → 11/85	⊗ ⊗ ⊗	→02/85 →02/85 →02/85	SVB13875 SVB101000 SVB13750	13x875 10x1000 13x750
200 D	OM 615.940	44	03/79 → 11/85	⊗ ⊗ ⊗ ⊗	→02/85 →02/85, → Eng Nr 142197 →02/85, Eng Nr 142198 → →02/85	SVB131350 SVB10940 SVB131025 SVB131150	13x1350 10x940 13x1025 13x1150
200 D (123.120)	OM 615.940	40	07/76 → 02/79	⊗ ⊗ ⊗ ⊗	→ Eng Nr 142197 Eng Nr 142198 →	SVB131350 SVB10940 SVB131025 SVB131150	13x1350 10x940 13x1025 13x1150
220 D	OM 615.941	49	01/77 → 03/79	⊗ ⊗		SVB10940 SVB13750	10x940 13x750
220 D (123.126)	OM 615.941	44	01/76 → 02/79	⊗ ⊗		SVB10940 SVB13750	10x940 13x750
230 (123.023)	M 115.954	80	02/76 → 03/81	⊗ ⊗ ⊗	→ Eng Nr 063338 Eng Nr 063339 →	SVB10940 SVB10960 SVB13750	10x940 10x960 13x750
230 E (123.223)	M 102.980	100	04/80 → 12/85	⊗ ⊗ ⊗		SVB13875 SVB101000 SVB13750	13x875 10x1000 13x750
240 D (123.123)	OM 616.912	53	03/79 → 11/85	⊗ ⊗ ⊗ ⊗ ⊗	→02/85 →02/85, → Eng Nr 912086378 →02/85, Eng Nr 912086379 → →02/85	SVB131375 SVB10960 SVB131025 SVB131150	13x1375 10x960 13x1025 13x1150
		48	02/76 → 02/79	⊗ ⊗ ⊗ ⊗	→ Eng Nr 912086378 Eng Nr 912086379 →	SVB131375 SVB10960 SVB131025 SVB131150	13x1375 10x960 13x1025 13x1150
250 (123.026)	M 123.921	103	10/79 → 07/85	⊗ ⊗ ⊗ ⊗	→02/85 A/C(-), →02/85 A/C(+), →02/85 →02/85	SVB131275 SVB10925 SVB10960 SVB13825	13x1275 10x925 10x960 13x825
280 E (123.033)	M 110.984, M 110.988	136	02/76 → 11/85	⊗ ⊗ ⊗ ⊗	Eng. M110984, →02/85 Eng. M110984, AUTO, →02/85, → Eng Nr 076808 Eng. M110984, AUTO, →02/85, Eng Nr 076809 → Eng. M110984, →02/85	SVB131275 SVB10925 SVB10975 SVB13825	13x1275 10x925 10x975 13x825



kW



MERCEDDES-BENZ

...MERCEDDES-BENZ

...Saloon (W123)

300 D (123.130)	OM 617.912	59	02/76 → 07/80	☼	10/76→, For OE 0049973392	SVB131350	13x1350
				☼	10/76→, For OE 0049974092	SVB131375	13x1375
				Ⓢ	AUTO, 10/76→,	SVB10960	10x960
				Ⓢ	→ Eng Nr 0067785		
				Ⓢ	MAN, 10/76→,	SVB10975	10x975
				Ⓢ	→ Eng Nr 0073575		
		65	03/79 → 11/85	Ⓢ	MAN, 10/76→, Eng Nr 0073576→	SVB131025	13x1025
				Ⓢ	10/76→	SVB131150	13x1150
				☼	→02/85, For OE 0049973392	SVB131350	13x1350
				☼	→02/85, For OE 0049974092	SVB131375	13x1375
				Ⓢ	AUTO, →02/85,	SVB10960	10x960
				Ⓢ	→ Eng Nr 0067785		
300 Turbo-D (123.133)	OM 617.952	92	08/81 → 07/85	Ⓢ	MAN, →02/85,	SVB10975	10x975
				Ⓢ	→ Eng Nr 0073575		
				Ⓢ	MAN, →02/85, Eng Nr 0073576→	SVB131025	13x1025
				Ⓢ	→02/85	SVB131150	13x1150
				☼	→02/85	SVB13925	13x925
				Ⓢ	→02/85	SVB131025	13x1025
			Ⓢ	→02/85	SVB131150	13x1150	

Saloon (W124)

200	M 102.922	77	01/86 → 05/90	Ⓢ	A/C(-)	MVB1885R6	6PK1885
				Ⓢ	A/C(+)	MVB1980R6	6PK1980
200 (124.020)	M 102.922	75	01/86 → 05/90	Ⓢ	A/C(-)	MVB1885R6	6PK1885
				Ⓢ	A/C(+)	MVB1980R6	6PK1980
		80	12/85 → 05/90	Ⓢ	A/C(-)	MVB1885R6	6PK1885
				Ⓢ	A/C(+)	MVB1980R6	6PK1980
200 D (124.120)	OM 601.912	53	12/84 → 08/89	Ⓢ	A/C(-)	MVB2050R6	6PK2050
				Ⓢ	A/C(+)	MVB2120R6	6PK2120
		55	08/89 → 06/93	Ⓢ	A/C(-)	MVB2050R6	6PK2050
				Ⓢ	A/C(+)	MVB2120R6	6PK2120
200 E (124.019)	M 111.940	100	10/92 → 06/93	Ⓢ	A/C(-)	MVB2040R6	6PK2040
				Ⓢ	A/C(+)	MVB2135R6	6PK2135
200 E (124.021)	M 102.963	87	09/88 → 08/92	Ⓢ	A/C(-)	MVB1885R6	6PK1885
				Ⓢ	A/C(+)	MVB1980R6	6PK1980
		90	09/88 → 12/89	Ⓢ	A/C(-)	MVB1885R6	6PK1885
				Ⓢ	A/C(+)	MVB1980R6	6PK1980
220 E (124.022)	M 111.960	110	10/92 → 06/93	Ⓢ	A/C(-)	MVB2040R6	6PK2040
				Ⓢ	A/C(+)	MVB2135R6	6PK2135
230 E (124.023)	M 102.982	97	12/84 → 03/92	☼	→08/89	SVB13875	13x875
				Ⓢ	→08/89	SVB101000	10x1000
				Ⓢ	A/C(-)	MVB1885R6	6PK1885
				Ⓢ	A/C(+)	MVB1980R6	6PK1980
				Ⓢ	→08/89	SVB13750	13x750
				Ⓢ	→08/89	SVB13875	13x875
		100	01/85 → 06/93	Ⓢ	→08/89	SVB101000	10x1000
				Ⓢ	A/C(-)	MVB1885R6	6PK1885
				Ⓢ	A/C(+)	MVB1980R6	6PK1980
				Ⓢ	→08/89	SVB13750	13x750
230 E (124.023) CAT	M 102.982	97	06/89 → 06/93	Ⓢ	A/C(-)	MVB1885R6	6PK1885
				Ⓢ	A/C(+)	MVB1980R6	6PK1980
250 D (124.125)	OM 602.912	66	04/85 → 06/93	Ⓢ	A/C(-)	MVB2030R6	6PK2030
				Ⓢ	A/C(+)	MVB2100R6	6PK2100
		69	01/89 → 06/93	Ⓢ	A/C(-)	MVB2030R6	6PK2030
				Ⓢ	A/C(+)	MVB2100R6	6PK2100
250 Turbo-D (124.128)	OM 602.962	93	09/88 → 06/93	Ⓢ	A/C(-)	MVB2030R6	6PK2030
				Ⓢ	A/C(+)	MVB2100R6	6PK2100
260 E (124.026)	M 103.940	118	09/85 → 08/92	Ⓢ	A/C(-)	MVB2170R6	6PK2170
				Ⓢ	A/C(+), Cat(-)	MVB2265R6	6PK2265
				Ⓢ	A/C(+), Cat(+)	MVB2415R6	6PK2415
		122	09/85 → 12/89	Ⓢ	A/C(-)	MVB2170R6	6PK2170
				Ⓢ	A/C(+), Cat(-)	MVB2265R6	6PK2265
				Ⓢ	A/C(+), Cat(+)	MVB2415R6	6PK2415



kW



...MERCEDES-BENZ

...Saloon (W124)

260 E 4-matic (124.226)	M 103.943	118	09/86 → 08/92	⊗	A/C(-)	MVB2170R6	6PK2170				
				⊗	A/C(+), Cat(-)	MVB2265R6	6PK2265				
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415				
	M 103.940	122	12/86 → 12/89	⊗	A/C(-)	MVB2170R6	6PK2170				
				⊗	A/C(+), Cat(-)	MVB2265R6	6PK2265				
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415				
280 E (124.028)	M 104.942	145	10/92 → 06/93	⊗	A/C(-), AUTO, → Eng Nr 048696	MVB2325R6	6PK2325				
				⊗	A/C(-), AUTO, Eng Nr 048697→	MVB2380R6	6PK2380				
				⊗	A/C(+), AUTO, → Eng Nr 048696	MVB2415R6	6PK2415				
				⊗	A/C(+), AUTO, Eng Nr 048697→	MVB2475R6	6PK2475				
300 D (124.130)	OM 603.912	80	12/84 → 08/89	⊗	A/C(-)	MVB2080R6	6PK2080				
				⊗	A/C(+)	MVB2145R6	6PK2145				
				⊗	A/C(+)	MVB2153R6	6PK2153				
				⊗	A/C(-)	MVB2080R6	6PK2080				
		81	06/90 → 06/93	⊗	A/C(+)	MVB2145R6	6PK2145				
				⊗	A/C(+)	MVB2153R6	6PK2153				
		83	08/89 → 06/93	⊗	A/C(-)	MVB2080R6	6PK2080				
				⊗	A/C(+)	MVB2145R6	6PK2145				
		300 D 4-matic (124.330)	OM 603.913	80	09/86 → 08/92	⊗	A/C(-)	MVB2080R6	6PK2080		
						⊗	A/C(+)	MVB2145R6	6PK2145		
83	08/89 → 06/93			⊗	A/C(+)	MVB2153R6	6PK2153				
				⊗	A/C(-)	MVB2080R6	6PK2080				
300 E	M 103.980	138	01/85 → 12/85	⊗	A/C(-), 09/85→	MVB2170R6	6PK2170				
				⊗	A/C(+), Cat(-), 09/85→	MVB2265R6	6PK2265				
				⊗	A/C(+), Cat(+), 09/85→	MVB2415R6	6PK2415				
		M 103.983	138	06/85 → 08/92	⊗	A/C(-)	MVB2170R6	6PK2170			
⊗					A/C(+), Cat(-)	MVB2265R6	6PK2265				
⊗					A/C(+), Cat(+)	MVB2415R6	6PK2415				
300 E (124.030)	M 103.983	132	08/85 → 08/92	⊗	A/C(-)	MVB2170R6	6PK2170				
				⊗	A/C(+), Cat(-)	MVB2265R6	6PK2265				
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415				
300 E 4-matic	M 103.983	138	09/86 → 02/92	⊗	A/C(-)	MVB2170R6	6PK2170				
				⊗	A/C(+), Cat(-)	MVB2265R6	6PK2265				
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415				
300 E 4-matic (124.230)	M 103.985	132	09/86 → 06/93	⊗	A/C(-)	MVB2170R6	6PK2170				
				⊗	A/C(+), Cat(-)	MVB2265R6	6PK2265				
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415				
300 E-24 (124.031)	M 104.980	162	09/88 → 08/92	⊗	A/C(-), AUTO, Cat(-), 08/89→, Eng Nr 042811→	MVB2170R6	6PK2170				
				⊗	A/C(-), MAN, Cat(-), 08/89→, → Eng Nr 009076	MVB2205R6	6PK2205				
				⊗	A/C(-), MAN, Cat(+), 08/89→, → Eng Nr 009076	MVB2350R6	6PK2350				
				⊗	A/C(-), MAN, Cat(+), 08/89→, Eng Nr 009077→	MVB2325R6	6PK2325				
				⊗	A/C(+), AUTO, Cat(-), 08/89→, Eng Nr 042811→	MVB2265R6	6PK2265				
				⊗	A/C(+), AUTO, Cat(+), 08/89→, Eng Nr 042811→	MVB2415R6	6PK2415				
				⊗	A/C(+), MAN, Cat(-), 08/89→, → Eng Nr 009076	MVB2280R6	6PK2280				
				⊗	A/C(+), MAN, Cat(+), 08/89→, → Eng Nr 009076	MVB2450R6	6PK2450				
				300 Turbo-D (124.133)	OM 603.960	108	09/88 → 06/93	⊗	A/C(-)	MVB2080R6	6PK2080
								⊗	A/C(+)	MVB2153R6	6PK2153
					OM 603.960, OM 603.963	105	09/86 → 09/88	⊗	A/C(-)	MVB2080R6	6PK2080
⊗	A/C(+)	MVB2153R6	6PK2153								
300 Turbo-D 4-matic (124.333)	OM 603.963	108	01/88 → 06/93	⊗	A/C(-)	MVB2080R6	6PK2080				
				⊗	A/C(+)	MVB2153R6	6PK2153				



kw



MERCEDÉS-BENZ

...MERCEDÉS-BENZ

...Saloon (W124)

320 E (124.032)	M 104.992	162	10/92 → 06/93	⊗	A/C(-), AUTO, Eng Nr 072237→	MVB2380R6	6PK2380
				⊗	A/C(-), MAN, → Eng Nr 004356	MVB2325R6	6PK2325
				⊗	A/C(+), AUTO, → Eng Nr 072236	MVB2415R6	6PK2415
				⊗	A/C(+), AUTO, Eng Nr 072237→	MVB2475R6	6PK2475
400 E 4.2 (124.034)	M 119.975	205	10/92 → 06/93	⊗		MVB2540R6	6PK2540
500 E (124.036)	M 119.974	240	01/91 → 06/93	⊗	AUTO, → Eng Nr 005781	MVB2460R8	8PK2460
				⊗	AUTO, Eng Nr 005782→	MVB2540R6	6PK2540

S-CLASS (W116)

4.5		143	08/72 → 07/75	⊗		SVB13850	13x850
				⊗		SVB101000	10x1000
				⊗		SVB101150	10x1150
280 S (116.020)	M 110.922	115	08/72 → 07/80	⊗		SVB131300	13x1300
				⊗		SVB10960	10x960
				⊗	AUTO, → Eng Nr 41885	SVB13780	13x780
				⊗	AUTO, Eng Nr 41886→	SVB13825	13x825
		118	08/72 → 07/80	⊗		SVB131300	13x1300
				⊗		SVB10960	10x960
				⊗	AUTO, → Eng Nr 41885	SVB13780	13x780
				⊗	AUTO, Eng Nr 41886→	SVB13825	13x825
280 SE,SEL (116.024)	M 110.985	130	08/72 → 07/80	⊗	→07/75	SVB131300	13x1300
				⊗	08/75→	SVB131025	13x1025
				⊗		SVB10960	10x960
				⊗	→07/75	SVB13780	13x780
				⊗	08/75→	SVB13825	13x825
350 SE,SEL (116.028, 116.029)	M 116.985	143	03/76 → 03/80	⊗		SVB13850	13x850
				⊗		SVB10913	10x913
				⊗		SVB101200	10x1200
	M 116.983	147	08/72 → 02/76	⊗	→07/75	SVB13850	13x850
				⊗	AUTO, →07/75,	SVB10950	10x950
				⊗	→ Eng Nr 015765		
				⊗	MAN, →07/75, Eng Nr 005551→	SVB10913	10x913
				⊗	AUTO, →07/75,	SVB101175	10x1175
				⊗	→ Eng Nr 016546		
				⊗	AUTO, →07/75, Eng Nr 016547→	SVB101200	10x1200
	M 116.985	151	03/76 → 03/80	⊗		SVB13850	13x850
				⊗		SVB10913	10x913
				⊗		SVB101200	10x1200
450 SE,SEL (116.032)	M 117.983, M 117.986	165	01/73 → 04/80	⊗		SVB13850	13x850
				⊗	Eng. M117993, → Eng Nr 29566	SVB101000	10x1000
				⊗	Eng. M117993, Eng Nr 29567→	SVB10975	10x975
				⊗	Eng. M117993, → Eng Nr 43418	SVB101150	10x1150
				⊗	Eng. M117993, Eng Nr 43419→	SVB101200	10x1200
450 SEL 6.9 (116.036)	M 100.985	210	07/75 → 03/80	⊗	→ Eng Nr 869	SVB131025	13x1025
				⊗	Eng Nr 870→	SVB131000	13x1000
				⊗		SVB101175	10x1175
				⊗		SVB131200	13x1200

S-CLASS (W126)

260 SE (126.020)	M 103.941	118	09/85 → 06/91	⊗	A/C(-), →08/89	MVB2170R6	6PK2170
				⊗	A/C(+), →08/89	MVB2265R6	6PK2265
280 S (126.021)	M 110.924, M 110.926	115	12/79 → 07/85	⊗	Eng. M110924, 08/80→	SVB131275	13x1275
				⊗	Eng. M110924, AUTO, 08/80→,	SVB10925	10x925
				⊗	→ Eng Nr 001101		
				⊗	Eng. M110924, AUTO, 08/80→,	SVB10975	10x975
				⊗	Eng Nr 001102→		
				⊗	Eng. M110924, 08/80→	SVB13825	13x825
280 SE,SEL (126.022, 126.023)	M 110.987, M 110.989	136	10/79 → 07/85	⊗	Eng. M110987, 08/80→	SVB131275	13x1275
				⊗	Eng. M110987, AUTO, 08/80→,	SVB10925	10x925
				⊗	→ Eng Nr 003695		
				⊗	Eng. M110987, AUTO, 08/80→,	SVB10975	10x975
				⊗	Eng Nr 003696→		
				⊗	Eng. M110987, 08/80→	SVB13825	13x825



kW



...MERCEDES-BENZ

...S-CLASS (W126)

300 SE,SEL (126.024, 126.025)	M 103.981	132	01/86 → 06/91	⊗	A/C(-)	MVB2170R6	6PK2170
				⊗	A/C(+), Cat(-)	MVB2265R6	6PK2265
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415
		138	09/85 → 12/89	⊗	A/C(-)	MVB2170R6	6PK2170
				⊗	A/C(+), Cat(-)	MVB2265R6	6PK2265
				⊗	A/C(+), Cat(+)	MVB2415R6	6PK2415
380 SE,SEL (126.032)	M 116.961	160	12/85 → 12/86	⊗	→08/86	SVB13875	13x875
				⊗	→08/86	SVB10925	10x925
				⊗	→08/86	SVB101140	10x1140
	M 116.963	150	12/79 → 08/85	⊗	08/81→08/84	SVB13875	13x875
				⊗	08/81→08/84	SVB10990	10x990
				⊗	08/81→08/84	SVB101100	10x1100
420 SE,SEL	M 116.965	165	10/85 → 06/91	⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB10990	10x990
		170	10/85 → 12/87	⊗		SVB101100	10x1100
				⊗		SVB10750	10x750
				⊗		SVB13950	13x950
420 SE,SEL (126.034)	M 116.965	150	10/85 → 06/91	⊗		SVB10990	10x990
				⊗		SVB101100	10x1100
				⊗		SVB10750	10x750
		160	10/85 → 12/87	⊗		SVB13950	13x950
				⊗		SVB10990	10x990
				⊗		SVB101100	10x1100
500 SE,SEL	M 117.965	185	09/87 → 06/91	⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100
		195	09/87 → 06/91	⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100
500 SE,SEL (126.036)	M 117.965	164	09/85 → 06/91	⊗		SVB101000	10x1000
				⊗		SVB13950	13x950
				⊗		SVB101100	10x1100
	M 117.961, M 117.963	170	12/79 → 08/85	⊗	Eng. M117961, 08/80→	SVB10750	10x750
				⊗	Eng. M117961, 08/80→, → Eng Nr 006692	SVB13900	13x900
				⊗	Eng. M117961, 08/80→, Eng Nr 006693→	SVB13925	13x925
				⊗	Eng. M117961, 08/80→, → Eng Nr 002392	SVB101000	10x1000
				⊗	Eng. M117961, 08/80→, Eng Nr 002393→	SVB10960	10x960
				⊗	Eng. M117961, 08/80→	SVB101100	10x1100
		177	12/79 → 08/85	⊗	Eng. M117963, 08/80→	SVB10750	10x750
				⊗	08/80→, Eng Nr 006693→	SVB13925	13x925
				⊗	Eng. M117963, 08/80→, → Eng Nr 006692	SVB13900	13x900
				⊗	Eng. M117963, 08/80→	SVB101000	10x1000
				⊗	Eng. M117963, 08/80→	SVB101100	10x1100
				⊗		SVB101000	10x1000
500 SE,SEL CAT	M 117.965	185	06/89 → 06/91	⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100



kW



MERCEDÉS-BENZ

...MERCEDÉS-BENZ

...S-CLASS (W126)

560 SE,SEL	M 117.968	205	08/87 → 06/91	⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100
		220	10/85 → 06/91	⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100
560 SE,SEL (126.038)	M 117.968	178	10/85 → 06/91	⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100
		200	10/85 → 12/87	⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100

S-CLASS (W140)

300 SE 2.8 (140.028)	M 104.944	145	01/93 → 10/98	⊗	A/C(-), →05/93	MVB2325R6	6PK2325
				⊗	A/C(+), →05/93, → Eng Nr 007447	MVB2450R6	6PK2450
				⊗	A/C(+), AUTO, →05/93, Eng Nr 007448→016164	MVB2225R6	6PK2225
				⊗	A/C(+), AUTO, →05/93, Eng Nr 016165→	MVB2205R6	6PK2205
300 SE,SEL/S320 (140.032, 140.033)	M 104.990, M 104.994	170	03/91 → 10/98	⊗	Eng. M104990, A/C(-)	MVB2338R8	8PK2338
				⊗	Eng. M104990, A/C(+)	MVB2440R8	8PK2440
400 SE,SEL/S420 (140.042, 140.043)	M 119.971	210	02/91 → 10/98	⊗	06/91→06/93	MVB2540R6	6PK2540
				⊗	AUTO, 06/91→06/93, → Eng Nr 011682	MVB2460R8	8PK2460
500 SE,SEL (140.050, 140.051)	M 119.970	240	02/91 → 10/98	⊗	AUTO, 06/93→, → Eng Nr 026390	MVB2460R8	8PK2460
				⊗	AUTO, 06/93→, Eng Nr 026391→	MVB2540R6	6PK2540
S 280 (140.028)	M 104.944	142	02/93 → 10/98	⊗	A/C(-), 06/93→	MVB2325R6	6PK2325
				⊗	A/C(+), 06/93→, → Eng Nr 007447	MVB2450R6	6PK2450
				⊗	A/C(+), AUTO, 06/93→, Eng Nr 007448→016164	MVB2225R6	6PK2225
				⊗	A/C(+), AUTO, 06/93→, Eng Nr 016165→	MVB2205R6	6PK2205
S 300 Turbo-D (140.135)	OM 606.961	130	05/96 → 10/98	⊗	A/C(+), 09/96→	MVB2135R6	6PK2135
S 350 Turbo-D (140.134)	OM 603.971	110	01/93 → 10/98	⊗	A/C(-), 06/93→08/96	MVB2080R6	6PK2080
				⊗	A/C(+), 04/95→08/96	MVB2135R6	6PK2135
				⊗	A/C(+), 06/93→04/95	MVB2145R6	6PK2145
S 420 (140.042)	M 119.971	205	01/93 → 10/98	⊗	06/93→	MVB2510R6	6PK2510
S 500 (140.050, 140.051)	M 119.970, M 119.980	235	01/93 → 10/98	⊗	A/C(+), 10/95→	MVB2540R6	6PK2540
				⊗	Eng. M119970, A/C(-), →05/93	MVB2510R6	6PK2510
				⊗	Eng. M119970, A/C(-), AUTO, →05/93, → Eng Nr 026390	MVB2460R6	6PK2460
				⊗		MVB2460R8	8PK2460
S 600 (140.056, 140.057)	M 120.980, M 120.982	290	01/93 → 10/98	⊗	Eng. M120982, 10/95→	MVB2540R6	6PK2540
				⊗	Eng. M120982, 10/95→	MVB2585R6	6PK2585

S-CLASS (W220)

S 55 AMG (220.073, 220.173)	M 113.986	265	04/99 → 08/05	⊗	09/99→08/02, → Ch. A322759	MVB2390R6	6PK2390
				⊗	09/99→08/02, Ch. A322760→	MVB2380R6	6PK2380
S 55 AMG Kompressor (220.074, 220.174)	M 113.991	368	06/02 → 08/05	⊗		MVB2460R6	6PK2460
S 65 AMG (220.179)	M 275.980	450	03/04 → 08/05	⊗		MVB2337R7	7PK2337
S 280 (220.063, 220.163)	M 112.922	150	10/98 → 08/05	⊗	01/01→, Ch. A190250→	MVB2373R6	6PK2373
				⊗	02/99→09/02, → Ch. A322759	MVB2390R6	6PK2390
				⊗	09/02→, Ch. A322760→	MVB2380R6	6PK2380



kW



...MERCEDES-BENZ

...S-CLASS (W220)

S 320 (220.065, 220.165)	M 112.944	165	10/98 → 08/05	⊗	02/99 → 08/02, → Ch. 190249	MVB2390R6	6PK2390
				⊗	02/99 → 08/02, Ch. 190250 →	MVB2373R6	6PK2373
S 320 CDI (220.025, 220.125)	OM 648.960	150	09/02 → 08/05	⊗		MVB2265R6	6PK2265
S 320 CDI (220.026, 220.126)	OM 613.960	145	08/99 → 09/02	⊗		MVB2265R6	6PK2265
S 350 (220.067, 220.167)	M 112.972	180	09/02 → 08/05	⊗	Ch. A190250 →	MVB2373R6	6PK2373
				⊗	Ch. A322760 →	MVB2380R6	6PK2380
S 350 4-matic (220.087, 220.187)	M 112.975	180	06/03 → 08/05	⊗	Ch. A190250 →	MVB2373R6	6PK2373
				⊗	Ch. A322760 →	MVB2380R6	6PK2380
S 400 CDI (220.028, 220.128)	OM 628.960	184	06/00 → 08/05	⊗		MVB2271R7	7PK2271
		191	06/03 → 08/05	⊗		MVB2271R7	7PK2271
S 430 (220.070, 220.170)	M 113.941	205	10/98 → 08/05	⊗	→ 09/02, → Ch. A322759	MVB2390R6	6PK2390
				⊗	10/02 →, Ch. A322760 →	MVB2380R6	6PK2380
S 430 4-matic (220.083, 220.183)	M 113.948	205	09/02 → 08/05	⊗		MVB2380R6	6PK2380
S 500 (220.075, 220.175, 220.875)	M 113.960	225	10/98 → 08/05	⊗	07/00 → 09/02, → Ch. A322759	MVB2390R6	6PK2390
				⊗	10/02 →, Ch. A322760 →	MVB2380R6	6PK2380
S 500 4-matic (220.084, 220.184)	M 113.966	225	09/02 → 08/05	⊗		MVB2380R6	6PK2380
S 600 (220.176)	M 275.950	368	09/02 → 08/05	⊗		MVB2337R7	7PK2337

S-CLASS (W221)

S 63 AMG	M 156.984	386	10/06 →	⊗		MVB2350R6	6PK2350
S 65 AMG	M 275.982	450	12/05 →	⊗		MVB2365R7	7PK2365
S 320 CDI (221.022)	OM 642.930	173	12/05 →	⊗		MVB2040R8	8PK2040
S 320 CDI 4-matic	OM 642.930	173	10/06 →	⊗		MVB2040R8	8PK2040
S 350 (221.056, 221.156)	M 272.965	200	10/05 →	⊗	09/06 →	MVB2403R6	6PK2403
S 450	M 273.923	250	12/05 →	⊗		MVB2403R6	6PK2403
S 450 4-matic		250	12/05 →	⊗		MVB2403R6	6PK2403
S 500 (221.071, 221.171)	M 273.961	285	10/05 →	⊗		MVB2403R6	6PK2403
S 500 4-matic	M 273.961	285	10/05 →	⊗		MVB2403R6	6PK2403

S-CLASS Coupe (C126)

380 SEC (126.043)	M 116.963	150	10/81 → 07/85	⊗		SVB13875	13x875
				⊗		SVB10990	10x990
				⊗		SVB101100	10x1100
420 SEC (126.046)	M 116.965	150	10/85 → 06/91	⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB10990	10x990
		160	10/85 → 12/87	⊗		SVB101100	10x1100
				⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB10990	10x990
		165	10/85 → 06/91	⊗		SVB101100	10x1100
				⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB10990	10x990
				⊗		SVB101100	10x1100
500 SEC	M 117.965	195	09/85 → 06/91	⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100
500 SEC (126.044)	M 117.965	164	10/85 → 06/91	⊗		SVB101000	10x1000
				⊗		SVB13950	13x950
				⊗		SVB101100	10x1100
	M 117.963	170	10/81 → 08/85	⊗		SVB10750	10x750
				⊗		SVB13925	13x925
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100
	M 117.965	180	09/85 → 06/91	⊗		SVB101000	10x1000
				⊗		SVB13950	13x950
				⊗		SVB101100	10x1100
		185	08/87 → 06/91	⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100



kw



MERCEDES-BENZ

...MERCEDES-BENZ

...S-CLASS Coupe (C126)

500 SEC CAT	M 117.965	185	06/89 → 06/91	⊗ ⊗ ⊗ ⊗		SVB13950	13x950
						SVB101000	10x1000
						SVB101100	10x1100
560 SEC (126.045)	M 117.968	178	10/85 → 06/91	⊗ ⊗ ⊗ ⊗ ⊗ ⊗		SVB10750	10x750
						SVB13950	13x950
						SVB101000	10x1000
						SVB101100	10x1100
		200	10/85 → 12/87	⊗ ⊗ ⊗ ⊗ ⊗		SVB10750	10x750
						SVB13950	13x950
						SVB101000	10x1000
						SVB101100	10x1100
		205	10/85 → 06/91	⊗ ⊗ ⊗ ⊗ ⊗		SVB10750	10x750
						SVB13950	13x950
						SVB101000	10x1000
						SVB101100	10x1100
		220	10/85 → 12/89	⊗ ⊗ ⊗ ⊗ ⊗		SVB10750	10x750
						SVB13950	13x950
						SVB101000	10x1000
						SVB101100	10x1100

S-CLASS Coupe (C140)

SEC/CL 420 (140.063)	M 119.971, M 119.981	205	10/94 → 02/99	⊗ ⊗ ⊗ ⊗	→08/98 07/96→ Eng. M111971, 07/96→ Eng. M111971, 07/96→	MVB2510R6	6PK2510
						MVB2460R8	8PK2460
						MVB2460R6	6PK2460
						MVB2540R6	6PK2540
SEC/CL 500 (140.070)	M 119.970	235	10/92 → 02/99	⊗ ⊗ ⊗		MVB2460R6	6PK2460
						MVB2460R8	8PK2460
						MVB2540R6	6PK2540

S-CLASS Coupe (C215)

CL 55 AMG (215.373)	M 113.986	265	10/99 → 03/06	⊗	04/00→07/02	MVB2390R6	6PK2390
CL 55 AMG Kompressor (215.374)	M 113.991	368	06/02 → 03/06	⊗		MVB2460R6	6PK2460
CL 65 AMG (215.379)	M 275.980	450	09/03 → 03/06	⊗		MVB2337R7	7PK2337
CL 500 (215.375)	M 113.960	225	03/99 → 03/06	⊗ ⊗	09/99→09/02, → Ch. A032309 10/02→07/03, Ch. A032310→	MVB2390R6	6PK2390
						MVB2380R6	6PK2380
CL 600 (215.376)	M 275.950	368	09/02 → 03/06	⊗		MVB2337R7	7PK2337

S-CLASS Coupe (C216)

CL 63 AMG (216.377)	M 156.984	386	10/06 →	⊗		MVB2350R6	6PK2350
CL 65 AMG (216.379)	M 275.982	450	10/06 →	⊗		MVB2337R7	7PK2337
CL 500 (216.371)	M 273.961	285	06/06 →	⊗		MVB2403R6	6PK2403
CL 600 (216.376)	M 275.953	380	05/06 →	⊗		MVB2365R7	7PK2365

SL (R107)

280 SL (107.042)	M 110.982, M 110.986, M 110.990	136	08/74 → 07/85	⊗ ⊗ ⊗ ⊗ ⊗		SVB131275	13x1275
						SVB10960	10x960
						SVB13780	13x780
						SVB13825	13x825
300 SL (107.041)	M 103.982	132	09/85 → 08/89	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+) A/C(-) A/C(+)	MVB2170R6	6PK2170
		138	09/85 → 08/89			MVB2265R6	6PK2265
						MVB2170R6	6PK2170
						MVB2265R6	6PK2265
350 SL (107.043)	M 116.982, M 116.984	143	05/71 → 02/80	⊗ ⊗ ⊗ ⊗	08/75→ Eng. M116985, 08/75→ Eng. M116985, 08/75→	SVB13850	13x850
						SVB10913	10x913
						SVB101200	10x1200
380 SL (107.045)	M 116.960	160	09/80 → 08/81	⊗ ⊗ ⊗ ⊗		SVB13875	13x875
						SVB10925	10x925
						SVB101150	10x1150
	M 116.962	150	09/80 → 08/85	⊗ ⊗ ⊗ ⊗	08/81→08/84 08/81→08/84 08/81→08/84	SVB13875	13x875
						SVB10990	10x990
						SVB101100	10x1100



kW



...MERCEDES-BENZ

...SL (R107)

420 SL (107.047)	M 116.964	150	01/86 → 08/89	⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB10990	10x990
				⊗		SVB101100	10x1100
		160	01/86 → 08/89	⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB10990	10x990
				⊗		SVB101100	10x1100
450 SL (107.044)	M 117.982, M 117.985	160	09/75 → 10/80	⊗		SVB101000	10x1000
		165	10/72 → 10/80	⊗		SVB101000	10x1000
500 SL (107.046)	M 117.964	164	01/86 → 08/89	⊗		SVB10750	10x750
				⊗		SVB13950	13x950
				⊗		SVB101000	10x1000
				⊗		SVB101100	10x1100
				⊗		SVB10750	10x750
				⊗		SVB13875	13x875
	M 117.960	170	05/80 → 12/85	⊗	→07/85	SVB13900	13x900
				⊗	→07/85	SVB101000	10x1000
				⊗	→07/85, → Eng Nr 001681	SVB10960	10x960
				⊗	→07/85, Eng Nr 001682→	SVB101150	10x1150
				⊗	→07/85, → Eng Nr 001320	SVB101100	10x1100
				⊗	→07/85, Eng Nr 001321→	SVB10750	10x750
	177	05/80 → 12/81	⊗		SVB13875	13x875	
			⊗		SVB13900	13x900	
			⊗	09/81→	SVB13925	13x925	
			⊗		SVB101000	10x1000	
			⊗	Eng Nr 001682→	SVB10960	10x960	
			⊗	→ Eng Nr 001320	SVB101100	10x1100	
M 117.960, M 117.964	180	01/86 → 08/89	⊗	Eng. M117964	SVB10750	10x750	
			⊗	Eng. M117964	SVB13950	13x950	
			⊗	Eng. M117964	SVB101000	10x1000	
			⊗	Eng. M117964	SVB101100	10x1100	

SL (R129)

280 (129.058)	M 104.943	142	08/93 → 10/01	⊗	A/C(-), AUTO, →05/98, → Eng Nr 003620	MVB2325R6	6PK2325
				⊗	A/C(-), AUTO, →05/98, Eng Nr 006117→	MVB2125R6	6PK2125
				⊗	A/C(+), AUTO, →05/98, → Eng Nr 003620	MVB2415R6	6PK2415
				⊗	A/C(+), AUTO, →05/98, Eng Nr 003621→006116	MVB2225R6	6PK2225
				⊗	A/C(+), AUTO, →05/98, Eng Nr 006117→	MVB2205R6	6PK2205
280 (129.059)	M 112.923, M 112.925	150	05/98 → 10/01	⊗		MVB2390R6	6PK2390
300 SL (129.060)	M 103.984	140	03/89 → 08/93	⊗	A/C(-), Cat(-), 09/89→	MVB2170R6	6PK2170
				⊗	A/C(-), Cat(+), 09/89→	MVB2325R6	6PK2325
				⊗	A/C(+), Cat(-), 09/89→	MVB2265R6	6PK2265
				⊗	A/C(+), Cat(+), 09/89→	MVB2415R6	6PK2415



kw



MERCEDDES-BENZ

...MERCEDDES-BENZ

...SL (R129)

300 SL-24 (129.061)	M 104.981	170	03/89 → 07/93	⊗	A/C(-), AUTO, Cat(-), 09/89 →, → Eng Nr 014273	MVB2205R6	6PK2205
				⊗	A/C(-), AUTO, Cat(-), 09/89 →, Eng Nr 014274 →	MVB2170R6	6PK2170
				⊗	A/C(-), AUTO, Cat(+), 09/89 →, → Eng Nr 014273	MVB2350R6	6PK2350
				⊗	A/C(-), MAN, Cat(+), 09/89 →, Eng Nr 001591 →	MVB2325R6	6PK2325
				⊗	A/C(+), AUTO, Cat(-), 09/89 →, → Eng Nr 014273	MVB2280R6	6PK2280
				⊗	A/C(+), AUTO, Cat(-), 09/89 →, Eng Nr 014274 →	MVB2265R6	6PK2265
				⊗	A/C(+), AUTO, Cat(+), 09/89 →, → Eng Nr 014273	MVB2450R6	6PK2450
				⊗	A/C(+), AUTO, Cat(+), 09/89 →, Eng Nr 014274 →	MVB2415R6	6PK2415
320 (129.063)	M 104.991	170	09/93 → 10/01	⊗	A/C(-), →05/98, → Eng Nr 009985	MVB2325R6	6PK2325
				⊗	A/C(-), →05/98, Eng Nr 009986 →	MVB2125R6	6PK2125
				⊗	A/C(+), →05/98, → Eng Nr 009985	MVB2415R6	6PK2415
				⊗	A/C(+), →05/98, Eng Nr 009986 →020513	MVB2225R6	6PK2225
				⊗	A/C(+), →05/98, Eng Nr 020514 →	MVB2205R6	6PK2205
320 (129.064)	M 112.943	165	05/98 → 10/01	⊗		MVB2390R6	6PK2390
500 (129.067)	M 119.972, M 119.982	235	09/92 → 10/01	⊗	A/C(-), 06/93 →05/98	MVB2460R6	6PK2460
				⊗	A/C(+), →05/98	MVB2540R6	6PK2540
				⊗	Cat(-), →05/93	MVB2170R6	6PK2170
500 (129.068)	M 113.961	225	05/98 → 10/01	⊗		MVB2390R6	6PK2390
500 SL (129.066)	M 119.960, M 119.972	240	09/89 → 08/92	⊗	Cat(-)	MVB2170R6	6PK2170
				⊗	Cat(+)	MVB2540R6	6PK2540
600 (129.076)	M 120.981, M 120.983	290	07/92 → 10/01	⊗		MVB2585R6	6PK2585

SL (R230)

55 AMG		380	03/06 →	⊗		MVB2460R6	6PK2460
55 AMG (230.474)	M 113.992	350	10/01 → 06/02	⊗		MVB2460R6	6PK2460
55 AMG Kompressor (230.474)	M 113.992	368	06/02 →	⊗	→07/05	MVB2460R6	6PK2460
63AMG	M 156.981	386	03/08 →	⊗		MVB2350R6	6PK2350
65 AMG (230.479)	M 275.981	450	03/04 →	⊗		MVB2337R7	7PK2337
280	M 272.949	170	03/08 →	⊗		MVB2403R6	6PK2403
350	M 272.966	200	03/06 →	⊗		MVB2403R6	6PK2403
	M 272.968	232	04/08 →	⊗		MVB2403R6	6PK2403
350 (230.467)	M 112.973	180	03/03 →	⊗	→07/05	MVB2380R6	6PK2380
500	M 273.965	285	03/06 →	⊗		MVB2403R6	6PK2403
500 (230.475)	M 113.963	225	10/01 →	⊗	→07/02, → Ch. F025508	MVB2390R6	6PK2390
				⊗	07/02 →07/05, Ch. F025509 →	MVB2380R6	6PK2380
600 (230.476)	M 275.951	368	04/03 →	⊗	→07/05	MVB2337R7	7PK2337

SL Coupe (C107)

280 SLC (107.022)	M 110.982, M 110.986, M 110.990	136	08/74 → 09/81	⊗ * ⊗ ⊗		SVB131275	13x1275
						SVB10960	10x960
						SVB13780	13x780
						SVB13825	13x825



kW



...MERCEDES-BENZ

...SL Coupe (C107)

350 SLC (107.023)	M 116.982, M 116.984	143	03/76 → 02/80	⊗ ⊗ ⊗ ⊗	Eng. M116985	SVB13850	13x850
		147	01/72 → 02/76	⊗ ⊗ ⊗ ⊗	Eng. M116985 08/72 → 07/75 Eng. M116982, AUTO, 08/72 → 07/75, → Eng Nr 015765 Eng. M116982, MAN, 08/72 → 07/75, Eng Nr 005551 → Eng. M116982, AUTO, 08/72 → 07/75, → Eng Nr 016546 Eng. M116982, AUTO, 08/72 → 07/75, Eng Nr 016547 →	SVB10913 SVB101200 SVB13850 SVB10950 SVB10913 SVB101175 SVB101200	10x913 10x1200 13x850 10x950 10x913 10x1175 10x1200
380 SLC (107.025)	M 116.960	160	07/80 → 08/81	⊗ ⊗ ⊗ ⊗ ⊗		SVB13875 SVB10925 SVB10990 SVB101100 SVB101150	13x875 10x925 10x990 10x1100 10x1150
450 SLC (107.024)	M 117.982, M 117.985	160	09/75 → 08/79	⊗		SVB101000	10x1000
		165	01/73 → 11/75	⊗		SVB101000	10x1000
450 SLC 5.0 (107.026)	M 117.960	177	06/78 → 02/80	⊗ ⊗ ⊗	→ Eng Nr 960001320 Eng Nr 960001321 →	SVB101000 SVB101150 SVB101100	10x1000 10x1150 10x1100

SLK (R170)

200 (170.435)	M 111.946	100	09/96 → 03/00	⊗ ⊗	A/C(-), →09/99 A/C(+), →09/99	MVB2050R6 MVB2153R6	6PK2050 6PK2153
200 Kompressor (170.444)	M 111.958	120	03/00 → 04/04	⊗ ⊗ ⊗	→09/03 A/C(-), →09/03 A/C(+), →09/03	MVB1352R6 MVB1775R6 MVB1875R6	6PK1352 6PK1775 6PK1875
200 Kompressor (170.445)	M 111.943	141	10/96 → 03/00	⊗ ⊗ ⊗	10/99 → A/C(-), 10/99 → A/C(+), 10/99 →	MVB1325R6 MVB1775R6 MVB1875R6	6PK1325 6PK1775 6PK1875
230 Kompressor (170.447)	M 111.973	142	09/96 → 03/00	⊗ ⊗ ⊗	→09/99 A/C(-), →09/99 A/C(+), →09/99	MVB1325R6 MVB1775R6 MVB1875R6	6PK1325 6PK1775 6PK1875
230 Kompressor (170.449)	M 111.983	145	03/00 → 04/04	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1352R6 MVB1775R6 MVB1875R6	6PK1352 6PK1775 6PK1875
320 (170.465)	M 112.947	160	03/00 → 04/04	⊗		MVB2390R6	6PK2390

SLK (R171)

55 AMG (171.473)	M 113.989	265	06/04 →	⊗		MVB2380R6	6PK2380
200 Kompressor (171.442)	M 271.944	120	03/04 →	⊗ ⊗	A/C(-) A/C(+)	MVB2315R7 MVB2418R7	7PK2315 7PK2418
200 Kompressor (171.445)	M 271.954	135	01/08 →	⊗ ⊗	A/C(-) A/C(+)	MVB2315R7 MVB2418R7	7PK2315 7PK2418
280 (171.454)	M 272.942	170	01/05 →	⊗	05/05 →	MVB2403R6	6PK2403
350 (171.456)	M 272.963	200	06/04 →	⊗		MVB2403R6	6PK2403
350 (171.458)	M 272.969	224	01/08 →	⊗		MVB2403R6	6PK2403

SPRINTER 2-t Box (901, 902)

208 CDI	OM 611.987	60	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. 220797 A/C(-), Ch. 220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
208 D	OM 601.943	58	02/95 → 04/00	⊗ ⊗	A/C(-), →12/99 A/C(+), →12/99	MVB2020R6 MVB2100R6	6PK2020 6PK2100
		60	10/96 → 04/00	⊗ ⊗	A/C(-), →12/99 A/C(+), →12/99	MVB2020R6 MVB2100R6	6PK2020 6PK2100
210 D	OM 602.980	75	01/97 → 04/00	⊗ ⊗	A/C(-), →08/98 A/C(+), →08/98	MVB2080R6 MVB2135R6	6PK2080 6PK2135



kw



MERCEDÉS-BENZ

...MERCEDÉS-BENZ

...SPRINTER 2-t Box (901, 902)

211 CDI	OM 611.981	80	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
212 D	OM 602.980	90	02/95 → 04/00	⊗ ⊗	A/C(-) A/C(+)	MVB2080R6 MVB2135R6	6PK2080 6PK2135
213 CDI	OM 611.981	95	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
214	M 111.979, M 111.984	105	02/95 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, → Eng Nr 000441 A/C(-), AUTO, Eng Nr 000442 → A/C(+), MAN, → Eng Nr 002028 A/C(+), MAN, Eng Nr 002029 →	MVB2100R6 MVB2120R6 MVB2205R6 MVB2215R6	6PK2100 6PK2120 6PK2205 6PK2215
214 NGT	M 111.984	92	04/00 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, → Eng Nr 000441 A/C(-), AUTO, Eng Nr 000442 → A/C(+), AUTO, → Eng Nr 000441 A/C(+), AUTO, Eng Nr 000442 →	MVB2100R6 MVB2120R6 MVB2205R6 MVB2215R6	6PK2100 6PK2120 6PK2205 6PK2215
216 CDI	OM 612.981	115	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271

SPRINTER 2-t Bus (901, 902)

208 CDI	OM 611.987	60	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. 220797 A/C(-), Ch. 220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
208 D	OM 601.943	58	02/95 → 04/00	⊗ ⊗	A/C(-), →12/99 A/C(+), →12/99	MVB2020R6 MVB2100R6	6PK2020 6PK2100
210 D	OM 602.980	75	03/97 → 04/00	⊗ ⊗	A/C(-), →08/98 A/C(+), →08/98	MVB2080R6 MVB2135R6	6PK2080 6PK2135
211 CDI	OM 611.981	80	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
212 D	OM 602.980	90	02/95 → 04/00	⊗ ⊗	A/C(-) A/C(+)	MVB2080R6 MVB2135R6	6PK2080 6PK2135
213 CDI	OM 611.981	95	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
214	M 111.979, M 111.984	105	02/95 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, → Eng Nr 000441 A/C(-), AUTO, Eng Nr 000442 → A/C(+), AUTO, Eng Nr 000442 → A/C(+), MAN, → Eng Nr 002028	MVB2100R6 MVB2120R6 MVB2215R6 MVB2205R6	6PK2100 6PK2120 6PK2215 6PK2205
214 NGT	M 111.984	92	04/00 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, → Eng Nr 000441 A/C(-), AUTO, Eng Nr 000442 → A/C(+), AUTO, → Eng Nr 000441 A/C(+), AUTO, Eng Nr 000442 →	MVB2100R6 MVB2120R6 MVB2205R6 MVB2215R6	6PK2100 6PK2120 6PK2205 6PK2215
216 CDI	OM 612.981	115	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271

SPRINTER 2-t Flatbed / Chassis (901, 902)

208 CDI	OM 611.987	60	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. 220797 A/C(-), Ch. 220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
208 D	OM 601.943	58	01/95 → 04/00	⊗ ⊗	A/C(-), →12/99 A/C(+), →12/99	MVB2020R6 MVB2100R6	6PK2020 6PK2100
		60	09/96 → 04/00	⊗ ⊗	A/C(-), →12/99 A/C(+), →12/99	MVB2020R6 MVB2100R6	6PK2020 6PK2100
210 D	OM 602.980	75	01/97 → 04/00	⊗ ⊗	A/C(-), →08/98 A/C(+), →08/98	MVB2080R6 MVB2135R6	6PK2080 6PK2135
211 CDI	OM 611.981	80	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
212 D	OM 602.980	90	02/95 → 04/00	⊗ ⊗	A/C(-) A/C(+)	MVB2080R6 MVB2135R6	6PK2080 6PK2135





kW



...MERCEDES-BENZ

...SPRINTER 2-t Flatbed / Chassis (901, 902)

213 CDI	OM 611.981	95	04/00 → 05/06		A/C(-), → Ch. R220797	MVB2190R6	6PK2190
					A/C(-), Ch. R220798 →	MVB2265R6	6PK2265
					A/C(+)	MVB2271R6	6PK2271
214	M 111.979, M 111.984	105	02/95 → 05/06		A/C(-), AUTO, → Eng Nr 000441	MVB2100R6	6PK2100
					A/C(-), AUTO, Eng Nr 000442 →	MVB2120R6	6PK2120
					A/C(+), MAN, → Eng Nr 002028	MVB2205R6	6PK2205
					A/C(+), MAN, Eng Nr 002029 →	MVB2215R6	6PK2215
214 NGT		92	04/00 → 05/06		A/C(-), AUTO, → Eng Nr 000441	MVB2100R6	6PK2100
					A/C(-), AUTO, Eng Nr 000442 →	MVB2120R6	6PK2120
					A/C(+), AUTO, → Eng Nr 000441	MVB2205R6	6PK2205
					A/C(+), AUTO, Eng Nr 000442 →	MVB2215R6	6PK2215
216 CDI	OM 612.981	115	04/00 → 05/06		A/C(-), → Ch. R220797	MVB2190R6	6PK2190
					A/C(-), Ch. R220798 →	MVB2265R6	6PK2265
					A/C(+)	MVB2271R6	6PK2271

SPRINTER 3,5 Flatbed / Chassis (906)

309 CDI		65	06/06 →		eng. PTO shaft (-)	MVB2265R6	6PK2265
					eng. PTO shaft (+)	MVB2280R6	6PK2280
311 CDI		80	06/06 →		A/C(-)	MVB2265R6	6PK2265
					A/C(+)	MVB2280R6	6PK2280
315 CDI		110	06/06 →			MVB2265R6	6PK2265
318 CDI		135	06/06 →		eng. PTO shaft (-)	MVB2035R7	7PK2035
324		190	06/06 →			MVB2403R6	6PK2403

SPRINTER 3,5-t Box (906)

309 CDI		65	06/06 →		eng. PTO shaft (-)	MVB2265R6	6PK2265
					eng. PTO shaft (+)	MVB2280R6	6PK2280
311 CDI		80	06/06 →		A/C(-)	MVB2265R6	6PK2265
					A/C(+)	MVB2280R6	6PK2280
315 CDI		110	06/06 →			MVB2265R6	6PK2265
318 CDI		135	06/06 →		eng. PTO shaft (-)	MVB2035R7	7PK2035
324		190	06/06 →			MVB2403R6	6PK2403

SPRINTER 3,5-t Bus (906)

311 CDI		80	06/06 →		A/C(-)	MVB2265R6	6PK2265
					A/C(+)	MVB2280R6	6PK2280
315 CDI		110	06/06 →			MVB2265R6	6PK2265
324		190	06/06 →			MVB2403R6	6PK2403

SPRINTER 3-t Box (903)

308 CDI	OM 611.987	60	04/00 → 05/06		A/C(-), → Ch. 220797	MVB2190R6	6PK2190
					A/C(-), Ch. 220798 →	MVB2265R6	6PK2265
					A/C(+)	MVB2271R6	6PK2271
308 D 2.3	OM 601.943	58	02/95 → 04/00		A/C(-), →12/99	MVB2020R6	6PK2020
					A/C(+), →12/99	MVB2100R6	6PK2100
		60	02/95 → 04/00		A/C(-), →12/99	MVB2020R6	6PK2020
					A/C(+), →12/99	MVB2100R6	6PK2100
310 D 2.9	OM 602.980	75	02/95 → 04/00		A/C(-), 01/97 →	MVB2080R6	6PK2080
					A/C(+), 01/97 →	MVB2135R6	6PK2135
311 CDI	OM 611.981	80	04/00 → 05/06		A/C(-), → Ch. R220797	MVB2190R6	6PK2190
					A/C(-), Ch. R220798 →	MVB2265R6	6PK2265
					A/C(+)	MVB2271R6	6PK2271
311 CDI 4x4	OM 611.981	80	08/02 → 05/06		A/C(-), → Ch. R220797	MVB2190R6	6PK2190
					A/C(-), Ch. R220798 →	MVB2265R6	6PK2265
					A/C(+)	MVB2271R6	6PK2271
312 D 2.9	OM 602.980	90	02/95 → 04/00		A/C(-)	MVB2080R6	6PK2080
					A/C(+)	MVB2135R6	6PK2135
					A/C(+), →04/95	MVB2145R6	6PK2145
312 D 2.9 4x4	OM 602.980	90	05/97 → 08/02		A/C(-), →07/01	MVB2080R6	6PK2080
					A/C(+), →07/01	MVB2135R6	6PK2135
313 CDI	OM 611.981	95	04/00 → 05/06		A/C(-), → Ch. R220797	MVB2190R6	6PK2190
					A/C(-), Ch. R220798 →	MVB2265R6	6PK2265
					A/C(+)	MVB2271R6	6PK2271



kw



MERCEDÉS-BENZ

...MERCEDÉS-BENZ

...SPRINTER 3-t Box (903)

313 CDI 4x4	OM 611.981	95	08/02 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
314	M 111.979, M 111.984	105	02/95 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, → Eng Nr 000441 A/C(-), AUTO, Eng Nr 000442 → A/C(+), AUTO, Eng Nr 000442 → A/C(+), MAN, → Eng Nr 002028	MVB2100R6 MVB2120R6 MVB2215R6 MVB2205R6	6PK2100 6PK2120 6PK2215 6PK2205
314 4x4	M 111.979, M 111.984	105	08/02 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, Eng Nr 000442 → A/C(-), MAN, → Eng Nr 002028 A/C(+), AUTO, Eng Nr 000442 → A/C(+), MAN, → Eng Nr 002028	MVB2120R6 MVB2100R6 MVB2215R6 MVB2205R6	6PK2120 6PK2100 6PK2215 6PK2205
314 NGT		92	04/00 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, → Eng Nr 000441 A/C(-), AUTO, Eng Nr 000442 → A/C(+), AUTO, → Eng Nr 000441 A/C(+), AUTO, Eng Nr 000442 →	MVB2100R6 MVB2120R6 MVB2205R6 MVB2215R6	6PK2100 6PK2120 6PK2205 6PK2215
316 CDI	OM 612.981	115	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
316 CDI 4x4	OM 612.981	115	08/02 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271

SPRINTER 3-t Box (906)

209 CDI		65	06/06 →	⊗ ⊗	A/C(-) A/C(+)	MVB2265R6 MVB2280R6	6PK2265 6PK2280
211 CDI		80	06/06 →	⊗ ⊗	A/C(-) A/C(+)	MVB2265R6 MVB2280R6	6PK2265 6PK2280
213 CDI		95	06/06 →	⊗ ⊗	A/C(-) A/C(+)	MVB2265R6 MVB2280R6	6PK2265 6PK2280
215 CDI		110	06/06 →	⊗		MVB2265R6	6PK2265
218 CDI		135	06/06 →	⊗	eng. PTO shaft (-)	MVB2035R7	7PK2035
224		190	06/06 →	⊗		MVB2403R6	6PK2403

SPRINTER 3-t Bus (903)

308 CDI	OM 611.987	60	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. 220797 A/C(-), Ch. 220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
308 D	OM 601.943	58	02/95 → 04/00	⊗ ⊗	A/C(-), →12/99 A/C(+), →12/99	MVB2020R6 MVB2100R6	6PK2020 6PK2100
310 D 4x4	OM 602.980	75	05/97 → 08/02	⊗ ⊗	A/C(-), →08/00 A/C(+), →08/00	MVB2080R6 MVB2135R6	6PK2080 6PK2135
311 CDI	OM 611.981	80	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
311 CDI 4x4	OM 611.981	80	08/02 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
312 D 2.9	OM 602.980	90	02/95 → 04/00	⊗ ⊗ ⊗	A/C(-) A/C(+) A/C(+), →04/95	MVB2080R6 MVB2135R6 MVB2145R6	6PK2080 6PK2135 6PK2145
312 D 2.9 4x4	OM 602.980	90	05/97 → 08/02	⊗ ⊗	A/C(-), →07/01 A/C(+), →07/01	MVB2080R6 MVB2135R6	6PK2080 6PK2135
313 CDI	OM 611.981	95	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
313 CDI 4x4	OM 611.981	95	08/02 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
314	M 111.979, M 111.984	105	02/95 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, → Eng Nr 000441 A/C(-), AUTO, Eng Nr 000442 → A/C(+), MAN, → Eng Nr 002028 A/C(+), MAN, Eng Nr 002029 →	MVB2100R6 MVB2120R6 MVB2205R6 MVB2215R6	6PK2100 6PK2120 6PK2205 6PK2215





kW



...MERCEDES-BENZ

...SPRINTER 3-t Bus (903)

314 4x4	M 111.979, M 111.984	105	08/02 → 05/06	⊗	A/C(-), AUTO, → Eng Nr 000441	MVB2100R6	6PK2100
				⊗	A/C(-), AUTO, Eng Nr 000442→	MVB2120R6	6PK2120
				⊗	A/C(+), AUTO, Eng Nr 000442→	MVB2215R6	6PK2215
				⊗	A/C(+), MAN, → Eng Nr 002028	MVB2205R6	6PK2205
314 NGT	M 111.984	92	04/00 → 05/06	⊗	A/C(-), AUTO, → Eng Nr 000441	MVB2100R6	6PK2100
				⊗	A/C(-), AUTO, Eng Nr 000442→	MVB2120R6	6PK2120
				⊗	A/C(+), AUTO, → Eng Nr 000441	MVB2205R6	6PK2205
				⊗	A/C(+), AUTO, Eng Nr 000442→	MVB2215R6	6PK2215
316 CDI	OM 612.981	115	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
316 CDI 4x4	OM 612.981	115	08/02 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271

SPRINTER 3-t Bus (906)

211 CDI	OM 646.985	80	06/06 →	⊗	A/C(-)	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2280R6	6PK2280
215 CDI		110	06/06 →	⊗		MVB2265R6	6PK2265
224		190	06/06 →	⊗		MVB2403R6	6PK2403

SPRINTER 3-t Flatbed / Chassis (903)

308 CDI	OM 611.987	60	04/00 → 05/06	⊗	A/C(-), → Ch. 220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. 220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
308 D 2.3	OM 601.943	58	02/95 → 04/00	⊗	A/C(-), →12/99	MVB2020R6	6PK2020
		60	11/96 → 04/00	⊗	A/C(+), →12/99	MVB2100R6	6PK2100
				⊗	A/C(-), →12/99	MVB2020R6	6PK2020
				⊗	A/C(+), →12/99	MVB2100R6	6PK2100
310 D 2.9	OM 602.980	75	01/97 → 04/00	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2135R6	6PK2135
311 CDI	OM 611.981	80	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
311 CDI 4x4	OM 611.981	80	08/02 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
312 D 2.9	OM 602.980	90	02/95 → 04/00	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2135R6	6PK2135
				⊗	A/C(+), →04/95	MVB2145R6	6PK2145
313 CDI	OM 611.981	95	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
313 CDI 4x4	OM 611.981	95	08/02 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
314	M 111.979, M 111.984	105	02/95 → 05/06	⊗	A/C(-), AUTO, → Eng Nr 000441	MVB2100R6	6PK2100
				⊗	A/C(-), AUTO, Eng Nr 000442→	MVB2120R6	6PK2120
				⊗	A/C(+), MAN, → Eng Nr 002028	MVB2205R6	6PK2205
				⊗	A/C(+), MAN, Eng Nr 002029→	MVB2215R6	6PK2215
314 4x4	M 111.979, M 111.984	105	08/02 → 05/06	⊗	A/C(-), AUTO, → Eng Nr 000441	MVB2100R6	6PK2100
				⊗	A/C(-), AUTO, Eng Nr 000442→	MVB2120R6	6PK2120
				⊗	A/C(+), AUTO, Eng Nr 000442→	MVB2215R6	6PK2215
				⊗	A/C(+), MAN, → Eng Nr 002028	MVB2205R6	6PK2205
314 NGT		92	04/00 → 05/06	⊗	A/C(-), AUTO, → Eng Nr 000441	MVB2100R6	6PK2100
				⊗	A/C(-), AUTO, Eng Nr 000442→	MVB2120R6	6PK2120
				⊗	A/C(+), AUTO, → Eng Nr 000441	MVB2205R6	6PK2205
				⊗	A/C(+), AUTO, Eng Nr 000442→	MVB2215R6	6PK2215
316 CDI	OM 612.981	115	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271



kw



MERCEDDES-BENZ

...MERCEDDES-BENZ

...SPRINTER 3-t Flatbed / Chassis (903)

316 CDI 4x4	OM 612.981	115	08/02 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271

SPRINTER 3-t Flatbed / Chassis (906)

209 CDI		65	06/06 →	⊗	eng. PTO shaft (-)	MVB2265R6	6PK2265
				⊗	eng. PTO shaft (+)	MVB2280R6	6PK2280
211 CDI		80	06/06 →	⊗	A/C(-)	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2280R6	6PK2280
213 CDI		95	06/06 →	⊗	A/C(-)	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2280R6	6PK2280
215 CDI		110	06/06 →	⊗		MVB2265R6	6PK2265
218 CDI		135	06/06 →	⊗	eng. PTO shaft (-)	MVB2035R7	7PK2035
224		190	06/06 →	⊗		MVB2403R6	6PK2403

SPRINTER 4-t Box (904)

408 CDI	OM 611.987	60	04/00 → 05/06	⊗	A/C(-), → Ch. 220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. 220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
408 D	OM 601.943	58	02/96 → 05/06	⊗	A/C(-), →12/99	MVB2020R6	6PK2020
				⊗	A/C(+), →12/99	MVB2100R6	6PK2100
410 D	OM 602.980	75	02/96 → 05/06	⊗	A/C(-), 01/97→07/01	MVB2080R6	6PK2080
				⊗	A/C(+), 01/97→07/01	MVB2135R6	6PK2135
410 D 4x4	OM 602.980	75	05/97 → 05/06	⊗	A/C(-), →07/01	MVB2080R6	6PK2080
				⊗	A/C(+), →07/01	MVB2135R6	6PK2135
411 CDI	OM 611.981	80	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
411 CDI 4x4	OM 611.981	80	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
412 D	OM 602.980	85	02/96 → 05/06	⊗	A/C(-), →07/01	MVB2080R6	6PK2080
				⊗	A/C(+), →07/01	MVB2135R6	6PK2135
		90	02/96 → 05/06	⊗	A/C(-), →07/01	MVB2080R6	6PK2080
				⊗	A/C(+), →07/01	MVB2135R6	6PK2135
412 D 4x4	OM 602.980	85	05/97 → 05/06	⊗	A/C(-), →07/01	MVB2080R6	6PK2080
				⊗	A/C(+), →07/01	MVB2135R6	6PK2135
		90	05/97 → 05/06	⊗	A/C(-), →07/01	MVB2080R6	6PK2080
				⊗	A/C(+), →07/01	MVB2135R6	6PK2135
413 CDI	OM 611.981	95	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
413 CDI 4x4	OM 611.981	95	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
414	M 111.979, M 111.984	105	02/96 → 05/06	⊗	A/C(-), AUTO, → Eng Nr 000441	MVB2100R6	6PK2100
				⊗	A/C(-), AUTO, Eng Nr 000442→	MVB2120R6	6PK2120
				⊗	A/C(+), MAN, → Eng Nr 002028	MVB2205R6	6PK2205
				⊗	A/C(+), MAN, Eng Nr 002029→	MVB2215R6	6PK2215
414 4x4	M 111.979, M 111.984	105	05/97 → 05/06	⊗	A/C(-), MAN, → Eng Nr 002028	MVB2100R6	6PK2100
				⊗	A/C(-), MAN, Eng Nr 002029→	MVB2120R6	6PK2120
				⊗	A/C(+), MAN, → Eng Nr 002028	MVB2205R6	6PK2205
				⊗	A/C(+), MAN, Eng Nr 002029→	MVB2215R6	6PK2215
416 CDI	OM 612.981	115	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271
416 CDI 4x4	OM 612.981	115	04/00 → 05/06	⊗	A/C(-), → Ch. R220797	MVB2190R6	6PK2190
				⊗	A/C(-), Ch. R220798→	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2271R6	6PK2271



kW



...MERCEDES-BENZ

SPRINTER 4-t Bus (904)

411 CDI	OM 611.981	80	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
413 CDI	OM 611.981	95	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
414	M 111.979, M 111.984	105	02/96 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, → Eng Nr 000441 A/C(-), MAN, Eng Nr 002029 → A/C(+), AUTO, Eng Nr 000442 → A/C(+), MAN, → Eng Nr 002028	MVB2100R6 MVB2120R6 MVB2215R6 MVB2205R6	6PK2100 6PK2120 6PK2215 6PK2205
416 CDI	OM 612.981	115	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271

SPRINTER 4-t Flatbed / Chassis (904)

408 CDI	OM 611.987	60	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. 220797 A/C(-), Ch. 220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
408 D	OM 601.943	58	02/96 → 05/06	⊗ ⊗	A/C(-), →12/99 A/C(+), →12/99	MVB2020R6 MVB2100R6	6PK2020 6PK2100
410 D	OM 602.980	75	02/96 → 05/06	⊗ ⊗	A/C(-), 01/97 →07/01 A/C(+), 01/97 →07/01	MVB2080R6 MVB2135R6	6PK2080 6PK2135
410 D 4x4	OM 602.980	75	05/97 → 05/06	⊗ ⊗	A/C(-), →07/01 A/C(+), →07/01	MVB2080R6 MVB2135R6	6PK2080 6PK2135
411 CDI	OM 611.981	80	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
411 CDI 4x4	OM 611.981	80	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
412 D	OM 602.980	85	02/96 → 05/06	⊗ ⊗	A/C(-), →07/01 A/C(+), →07/01	MVB2080R6 MVB2135R6	6PK2080 6PK2135
412 D 4x4	OM 602.980	85	02/96 → 05/06	⊗ ⊗	A/C(-), →07/01 A/C(+), →07/01	MVB2080R6 MVB2135R6	6PK2080 6PK2135
		90	02/96 → 05/06	⊗ ⊗	A/C(-), →07/01 A/C(+), →07/01	MVB2080R6 MVB2135R6	6PK2080 6PK2135
412 D 4x4	OM 602.980	85	05/97 → 05/06	⊗ ⊗ ⊗	A/C(-), →07/01 A/C(+), →07/01 A/C(-), →07/01	MVB2080R6 MVB2135R6 MVB2080R6	6PK2080 6PK2135 6PK2080
413 CDI	OM 611.981	95	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
413 CDI 4x4	OM 611.981	95	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
414	M 111.979, M 111.984	105	02/96 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, Eng Nr 000442 → A/C(-), MAN, → Eng Nr 002028 A/C(+), AUTO, Eng Nr 000442 → A/C(+), MAN, → Eng Nr 002028	MVB2120R6 MVB2100R6 MVB2215R6 MVB2205R6	6PK2120 6PK2100 6PK2215 6PK2205
414 4x4	M 111.979, M 111.984	105	05/97 → 05/06	⊗ ⊗ ⊗ ⊗	A/C(-), AUTO, Eng Nr 000442 → A/C(-), MAN, → Eng Nr 002028 A/C(+), MAN, → Eng Nr 002028 A/C(+), MAN, Eng Nr 002029 →	MVB2120R6 MVB2100R6 MVB2205R6 MVB2215R6	6PK2120 6PK2100 6PK2205 6PK2215
416 CDI	OM 612.981	115	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271
416 CDI 4x4	OM 612.981	115	04/00 → 05/06	⊗ ⊗ ⊗	A/C(-), → Ch. R220797 A/C(-), Ch. R220798 → A/C(+)	MVB2190R6 MVB2265R6 MVB2271R6	6PK2190 6PK2265 6PK2271



kW



MERCEDÉS-BENZ

...MERCEDÉS-BENZ

SPRINTER 5-t Box (906)

509 CDI		65	06/06 →	⊗	eng. PTO shaft (-)	MVB2265R6	6PK2265
				⊗	eng. PTO shaft (+)	MVB2280R6	6PK2280
511 CDI		80	06/06 →	⊗	A/C(-)	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2280R6	6PK2280
515 CDI		110	06/06 →	⊗		MVB2265R6	6PK2265
518 CDI		135	06/06 →	⊗	eng. PTO shaft (-)	MVB2035R7	7PK2035

SPRINTER 5-t Flatbed / Chassis (906)

509 CDI		65	06/06 →	⊗	eng. PTO shaft (-)	MVB2265R6	6PK2265
				⊗	eng. PTO shaft (+)	MVB2280R6	6PK2280
511 CDI		80	06/06 →	⊗	A/C(-)	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2280R6	6PK2280
515 CDI		110	06/06 →	⊗		MVB2265R6	6PK2265
518 CDI		135	06/06 →	⊗	eng. PTO shaft (-)	MVB2035R7	7PK2035

T1 Box (601)

207 D 2.4	OM 616.937, OM 616.939	53	06/82 → 01/90	⊗	→08/89, → Eng Nr 025904-917	SVB10960	10x960
				⊗	→08/89, Eng Nr 040553-935→	SVB131025	13x1025
208 D 2.3	OM 601.940	58	11/88 → 02/96	⊗	A/C(-), MS, →04/95, → Eng Nr 253306	MVB1015R6	6PK1015
				⊗	A/C(-), MS, →04/95, Eng Nr 253307→	MVB1000R6	6PK1000
				⊗	A/C(-), PS, →04/95, → Eng Nr 253306	MVB1995R6	6PK1995
				⊗	A/C(-), PS, →04/95, Eng Nr 253307→	MVB1980R6	6PK1980
				⊗	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, →04/95, Eng Nr 253307→	MVB2020R6	6PK2020
				⊗	A/C(+), PS, →04/95	MVB2080R6	6PK2080
				⊗	A/C(-), MS, →04/95, → Eng Nr 253306	MVB1015R6	6PK1015
				⊗	A/C(-), MS, →04/95, Eng Nr 253307→	MVB1000R6	6PK1000
				⊗	A/C(-), PS, →04/95, → Eng Nr 253306	MVB1995R6	6PK1995
				⊗	A/C(-), PS, →04/95, Eng Nr 253307→	MVB1980R6	6PK1980
				⊗	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
⊗	A/C(+), MS, →04/95, Eng Nr 253307→	MVB2020R6	6PK2020				
⊗	A/C(+), PS, →04/95	MVB2080R6	6PK2080				
209 D 2.9	OM 617.913	65	12/82 → 01/90	⊗	→08/89	SVB131000	13x1000
210 2.3	M 102.945	77	05/89 → 02/96	⊗	A/C(-), MS, V-ribbed belt pulley (+), →04/95		
				⊗	A/C(-), PS, V-ribbed belt pulley (+), →04/95	MVB1885R6	6PK1885
				⊗	A/C(+), PS, V-ribbed belt pulley (+), →04/95	MVB1980R6	6PK1980
				⊗	V-belt pulley (+), →04/95	SVB101000	10x1000



kW



...MERCEDES-BENZ

...T1 Box (601)

...210 2.3	M 102.942, M 102.946	70	07/82 → 02/96	⊗	A/C(-), MS, V-ribbed belt pulley (+), →04/95	MVB1015R6	6PK1015
				⊗	A/C(-), PS, V-ribbed belt pulley (+), →04/95	MVB1885R6	6PK1885
				⊗	A/C(+), PS, V-ribbed belt pulley (+), →04/95	MVB1980R6	6PK1980
				⊗	V-belt pulley (+), →04/95	SVB101000	10x1000
210 D 2.8	OM 602.940	70	10/88 → 02/96	⊗	A/C(-), MS, 09/89 → 04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				⊗	A/C(-), MS, 09/89 → 04/95, Eng Nr 253308 →	MVB1000R6	6PK1000
				⊗	A/C(-), PS, 09/89 → 04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				⊗	A/C(-), PS, 09/89 → 04/95, Eng Nr 253308 →	MVB1980R6	6PK1980
				⊗	A/C(+), MS, 09/89 → 04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, 09/89 → 04/95, Eng Nr 253307 →	MVB2020R6	6PK2020
		72	10/88 → 02/96	⊗	A/C(+), PS, 09/89 → 04/95	MVB2080R6	6PK2080
				⊗	A/C(-), MS, 09/89 → 04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				⊗	A/C(-), MS, 09/89 → 04/95, Eng Nr 253308 →	MVB1000R6	6PK1000
				⊗	A/C(-), PS, 09/89 → 04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				⊗	A/C(-), PS, 09/89 → 04/95, Eng Nr 253308 →	MVB1980R6	6PK1980
				⊗	A/C(+), MS, 09/89 → 04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, 09/89 → 04/95, Eng Nr 253307 →	MVB2020R6	6PK2020
				⊗	A/C(+), PS, 09/89 → 04/95	MVB2080R6	6PK2080

T1 Box (602)

307 D 2.4	OM 616.937, OM 616.939	53	10/82 → 01/90	⊗	→08/89, → Eng Nr 040553-934	SVB10960	10x960
				⊗	→08/89, Eng Nr 040553-935 →	SVB131025	13x1025



kW



MERCEDDES-BENZ

...MERCEDDES-BENZ

...T1 Box (602)

308 D 2.3	OM 601.940	58	11/88 → 02/96	①	A/C(-), MS, →04/95, → Eng Nr 253306	MVB1015R6	6PK1015		
				②	A/C(-), MS, →04/95, Eng Nr 253307 →	MVB1000R6	6PK1000		
				③	A/C(-), PS, →04/95, → Eng Nr 253306	MVB1995R6	6PK1995		
				④	A/C(-), PS, →04/95, Eng Nr 253307 →	MVB1980R6	6PK1980		
				⑤	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030		
				⑥	A/C(+), MS, →04/95, Eng Nr 253307 →	MVB2020R6	6PK2020		
		60	06/89 → 02/96	⑦	A/C(+), PS, →04/95	MVB2080R6	6PK2080		
				⑧	A/C(-), MS, →04/95, → Eng Nr 253306	MVB1015R6	6PK1015		
				⑨	A/C(-), MS, →04/95, Eng Nr 253307 →	MVB1000R6	6PK1000		
				⑩	A/C(-), PS, →04/95, → Eng Nr 253306	MVB1995R6	6PK1995		
				⑪	A/C(-), PS, →04/95, Eng Nr 253307 →	MVB1980R6	6PK1980		
				⑫	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030		
309 D 3.0	OM 617.913	65	10/82 → 01/90	⑬	A/C(+), MS, →04/95, Eng Nr 253307 →	MVB2020R6	6PK2020		
				⑭	A/C(+), PS, →04/95	MVB2080R6	6PK2080		
310 D 2.9	OM 602.940	72	06/89 → 02/96	⑮	A/C(-), MS, →04/95, → Eng Nr 253307	MVB1015R6	6PK1015		
				⑯	A/C(-), MS, →04/95, Eng Nr 253308 →	MVB1000R6	6PK1000		
				⑰	A/C(-), PS, →04/95, → Eng Nr 253307	MVB1995R6	6PK1995		
				⑱	A/C(-), PS, →04/95, Eng Nr 253308 →	MVB1980R6	6PK1980		
				⑲	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030		
				⑳	A/C(+), MS, →04/95, Eng Nr 253307 →	MVB2020R6	6PK2020		
				70	06/89 → 02/96	㉑	A/C(+), PS, →04/95	MVB2080R6	6PK2080
						㉒	A/C(-), MS, →04/95, → Eng Nr 253307	MVB1015R6	6PK1015
						㉓	A/C(-), MS, →04/95, Eng Nr 253308 →	MVB1000R6	6PK1000
						㉔	A/C(-), PS, →04/95, → Eng Nr 253307	MVB1995R6	6PK1995
						㉕	A/C(-), PS, →04/95, Eng Nr 253308 →	MVB1980R6	6PK1980
						㉖	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				㉗	A/C(+), MS, →04/95, Eng Nr 253307 →	MVB2020R6	6PK2020		
				㉘	A/C(+), PS, →04/95	MVB2080R6	6PK2080		



kW



...MERCEDES-BENZ

T1 Bus (601)

207 D 2.4	OM 616.917, OM 616.934	48	05/77 → 12/82	⊗	→ Eng Nr 040553-934	SVB10960	10x960			
				⊗	Eng Nr 040553-935 →	SVB131025	13x1025			
		53	07/82 → 01/90	⊗	→08/89, → Eng Nr 040553-934	SVB10960	10x960			
				⊗	→08/89, Eng Nr 040553-935 →	SVB131025	13x1025			
208 2.3	M 115.955, M 115.972	63	05/77 → 12/82	⊗		SVB10940	10x940			
208 D 2.3	OM 601.940	58	10/88 → 02/96	⊗	A/C(-), MS, →04/95,	MVB1015R6	6PK1015			
					→ Eng Nr 253306					
				⊗	A/C(-), MS, →04/95,	MVB1000R6	6PK1000			
					Eng Nr 253307 →					
				⊗	A/C(-), PS, →04/95,	MVB1995R6	6PK1995			
					→ Eng Nr 253306					
				⊗	A/C(-), PS, →04/95,	MVB1980R6	6PK1980			
					Eng Nr 253307 →					
				⊗	A/C(+), MS, →04/95,	MVB2030R6	6PK2030			
					→ Eng Nr 253306					
				⊗	A/C(+), MS, →04/95,	MVB2020R6	6PK2020			
					Eng Nr 253307 →					
				⊗	A/C(+), PS, →04/95	MVB2080R6	6PK2080			
					60	10/88 → 02/96	⊗	A/C(-), MS, →04/95,	MVB1015R6	6PK1015
							⊗	→ Eng Nr 253306		
							⊗	A/C(-), MS, →04/95,	MVB1000R6	6PK1000
			⊗	Eng Nr 253307 →						
			⊗	A/C(-), PS, →04/95,	MVB1995R6	6PK1995				
			⊗	→ Eng Nr 253306						
			⊗	A/C(-), PS, →04/95,	MVB1980R6	6PK1980				
			⊗	Eng Nr 253307 →						
			⊗	A/C(+), MS, →04/95,	MVB2030R6	6PK2030				
			⊗	→ Eng Nr 253306						
			⊗	A/C(+), MS, →04/95,	MVB2020R6	6PK2020				
			⊗	Eng Nr 253307 →						
			⊗	A/C(+), PS, →04/95	MVB2080R6	6PK2080				
209 D 2.9	OM 617.913	65	12/82 → 01/90	⊗	→08/89	SVB131000	13x1000			
210 2.3	M 102.942	70	07/82 → 01/90	⊗	A/C(-), MS,	MVB1015R6	6PK1015			
					V-ribbed belt pulley (+)					
				⊗	A/C(-), PS,	MVB1885R6	6PK1885			
					V-ribbed belt pulley (+)					
				⊗	A/C(+), PS,	MVB1980R6	6PK1980			
					V-ribbed belt pulley (+)					
				⊗	V-belt pulley (+)	SVB101000	10x1000			
					M 102.945	77	05/89 → 02/96	⊗	A/C(-),	MVB1015R6
			⊗	MS, V-ribbed belt pulley (+),						
			⊗	→04/95						
			⊗	A/C(+),	MVB1885R6	6PK1885				
			⊗	MS, V-ribbed belt pulley (+),						
			⊗	→04/95						
			⊗	A/C(+),	MVB1980R6	6PK1980				
			⊗	PS, V-ribbed belt pulley (+),						
			⊗	→04/95						
			⊗	V-belt pulley (+), →04/95	SVB101000	10x1000				



kw



MERCEDDES-BENZ

...MERCEDDES-BENZ

...T1 Bus (601)

210 D 2.8	OM 602.940	70	11/88 → 02/96	①	A/C(-), MS, 09/89→04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				②	A/C(-), MS, 09/89→04/95, Eng Nr 253308→	MVB1000R6	6PK1000
				③	A/C(-), PS, 09/89→04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				④	A/C(-), PS, 09/89→04/95, Eng Nr 253308→	MVB1980R6	6PK1980
				⑤	A/C(+), MS, 09/89→04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⑥	A/C(+), MS, 09/89→04/95, Eng Nr 253307→	MVB2020R6	6PK2020
		72	11/88 → 02/96	⑦	A/C(+), MS, 09/89→04/95	MVB2080R6	6PK2080
				⑧	A/C(-), MS, 09/89→04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				⑨	A/C(-), MS, 09/89→04/95, Eng Nr 253308→	MVB1000R6	6PK1000
				⑩	A/C(-), PS, 09/89→04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				⑪	A/C(-), PS, 09/89→04/95, Eng Nr 253308→	MVB1980R6	6PK1980
				⑫	A/C(+), MS, 09/89→04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⑬	A/C(+), MS, 09/89→04/95, Eng Nr 253307→	MVB2020R6	6PK2020
				⑭	A/C(+), PS, 09/89→04/95	MVB2080R6	6PK2080

T1 Bus (602)

308 D 2.3	OM 601.940	60	06/89 → 02/96	①	A/C(-), MS, →04/95, → Eng Nr 253306	MVB1015R6	6PK1015
				②	A/C(-), MS, →04/95, Eng Nr 253307→	MVB1000R6	6PK1000
				③	A/C(-), PS, →04/95, → Eng Nr 253306	MVB1995R6	6PK1995
				④	A/C(-), PS, →04/95, Eng Nr 253307→	MVB1980R6	6PK1980
				⑤	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⑥	A/C(+), MS, →04/95, Eng Nr 253307→	MVB2020R6	6PK2020
		58	05/90 → 02/96	⑦	A/C(+), PS, →04/95	MVB2080R6	6PK2080
				⑧	A/C(-), MS, →04/95, → Eng Nr 253306	MVB1015R6	6PK1015
				⑨	A/C(-), MS, →04/95, Eng Nr 253307→	MVB1000R6	6PK1000
				⑩	A/C(-), PS, →04/95, → Eng Nr 253306	MVB1995R6	6PK1995
				⑪	A/C(-), PS, →04/95, Eng Nr 253307→	MVB1980R6	6PK1980
				⑫	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⑬	A/C(+), MS, →04/95, Eng Nr 253307→	MVB2020R6	6PK2020
				⑭	A/C(+), PS, →04/95	MVB2080R6	6PK2080



kW



...MERCEDES-BENZ

...T1 Bus (602)

310 D 2.9	OM 602.940	70	06/89 → 02/96	⊗	A/C(-), MS, →04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				⊗	A/C(-), MS, →04/95, Eng Nr 253308→	MVB1000R6	6PK1000
				⊗	A/C(-), PS, →04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				⊗	A/C(-), PS, →04/95, Eng Nr 253308→	MVB1980R6	6PK1980
				⊗	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, →04/95, Eng Nr 253307→	MVB2020R6	6PK2020
		72	06/90 → 02/96	⊗	A/C(+), PS, →04/95	MVB2080R6	6PK2080
				⊗	A/C(-), MS, →04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				⊗	A/C(-), MS, →04/95, Eng Nr 253308→	MVB1000R6	6PK1000
				⊗	A/C(-), PS, →04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				⊗	A/C(-), PS, →04/95, Eng Nr 253308→	MVB1980R6	6PK1980
				⊗	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, →04/95, Eng Nr 253307→	MVB2020R6	6PK2020
				⊗	A/C(+), PS, →04/95	MVB2080R6	6PK2080

T1 Flatbed / Chassis (601)

207 D 2.4	OM 616.917	48	04/77 → 12/82	⊗	08/77→, → Eng Nr 040553-934	SVB10960	10x960
				⊗	08/77→, Eng Nr 040553-935→	SVB131025	13x1025
	OM 616.937	53	12/77 → 10/89	⊗	→ Eng Nr 040553-934	SVB10960	10x960
				⊗	Eng Nr 040553-935→	SVB131025	13x1025
208 D 2.3	OM 601.940	60	06/89 → 02/96	⊗	A/C(-), MS, →04/95, → Eng Nr 253306	MVB1015R6	6PK1015
				⊗	A/C(-), MS, →04/95, Eng Nr 253307→	MVB1000R6	6PK1000
				⊗	A/C(-), PS, →04/95, → Eng Nr 253306	MVB1995R6	6PK1995
				⊗	A/C(-), PS, →04/95, Eng Nr 253307→	MVB1980R6	6PK1980
				⊗	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, →04/95, Eng Nr 253307→	MVB2020R6	6PK2020
				⊗	A/C(+), PS, →04/95	MVB2080R6	6PK2080
		58	11/88 → 02/96	⊗	A/C(-), MS, →04/95, → Eng Nr 253306	MVB1015R6	6PK1015
				⊗	A/C(-), MS, →04/95, Eng Nr 253307→	MVB1000R6	6PK1000
				⊗	A/C(-), PS, →04/95, → Eng Nr 253306	MVB1995R6	6PK1995
				⊗	A/C(-), PS, →04/95, Eng Nr 253307→	MVB1980R6	6PK1980
				⊗	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, →04/95, Eng Nr 253307→	MVB2020R6	6PK2020
				⊗	A/C(+), PS, →04/95	MVB2080R6	6PK2080
209 D 2.9	OM 617.913	65	12/82 → 01/90	⊗	→08/89	SVB131000	13x1000



kW



MERCEDÉS-BENZ

...MERCEDÉS-BENZ

...T1 Flatbed / Chassis (601)

210 D 2.3	M 102.942	70	04/77 → 10/89	⊗	A/C(-), MS, V-ribbed belt pulley (+), 08/81 →	MVB1015R6	6PK1015
				⊗	A/C(-), PS, V-ribbed belt pulley (+), 08/81 →	MVB1885R6	6PK1885
				⊗	A/C(+), PS, V-ribbed belt pulley (+), 08/81 →	MVB1980R6	6PK1980
				⊗	V-belt pulley (+), 08/81 →	SVB101000	10x1000
	M 115.955	63	04/77 → 10/89	⊗	08/77 →	SVB10940	10x940
210 D 2.8	OM 602.940	72	11/88 → 02/96	⊗	A/C(-), MS, 09/89 → 04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				⊗	A/C(-), MS, 09/89 → 04/95, Eng Nr 253308 →	MVB1000R6	6PK1000
				⊗	A/C(-), PS, 09/89 → 04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				⊗	A/C(-), PS, 09/89 → 04/95, Eng Nr 253308 →	MVB1980R6	6PK1980
				⊗	A/C(+), MS, 09/89 → 04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, 09/89 → 04/95, Eng Nr 253307 →	MVB2020R6	6PK2020
				⊗	A/C(+), PS, 09/89 → 04/95	MVB2080R6	6PK2080
210 D 2.9	OM 602.940	70	11/88 → 02/96	⊗	A/C(-), MS, 09/89 → 04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				⊗	A/C(-), MS, 09/89 → 04/95, Eng Nr 253308 →	MVB1000R6	6PK1000
				⊗	A/C(-), PS, 09/89 → 04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				⊗	A/C(-), PS, 09/89 → 04/95, Eng Nr 253308 →	MVB1980R6	6PK1980
				⊗	A/C(+), MS, 09/89 → 04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, 09/89 → 04/95, Eng Nr 253307 →	MVB2020R6	6PK2020
				⊗	A/C(+), PS, 09/89 → 04/95	MVB2080R6	6PK2080

T1 Flatbed / Chassis (602)

307 D 2.4	OM 616.937	48	04/77 → 01/83	⊗	→ Eng Nr 025904-917	SVB10960	10x960
				⊗	Eng Nr 040553-935 →	SVB131025	13x1025
	OM 616.937, OM 616.939	53	06/82 → 01/90	⊗	→ 08/89, → Eng Nr 040553-934	SVB10960	10x960
				⊗	→ 08/89, Eng Nr 040553-935 →	SVB131025	13x1025
308 D 2.3	OM 601.940	58	06/89 → 02/96	⊗	A/C(-), MS, → 04/95, → Eng Nr 253306	MVB1015R6	6PK1015
				⊗	A/C(-), MS, → 04/95, Eng Nr 253307 →	MVB1000R6	6PK1000
				⊗	A/C(-), PS, → 04/95, → Eng Nr 253306	MVB1995R6	6PK1995
				⊗	A/C(-), PS, → 04/95, Eng Nr 253307 →	MVB1980R6	6PK1980
				⊗	A/C(+), MS, → 04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, → 04/95, Eng Nr 253307 →	MVB2020R6	6PK2020
				⊗	A/C(+), PS, → 04/95	MVB2080R6	6PK2080



kW



...MERCEDES-BENZ

...T1 Flatbed / Chassis (602)

...308 D 2.3		60	06/89 → 02/96	⊗	A/C(-), MS, →04/95, → Eng Nr 253306	MVB1015R6	6PK1015
				⊗	A/C(-), MS, →04/95, Eng Nr 253307 →	MVB1000R6	6PK1000
				⊗	A/C(-), PS, →04/95, → Eng Nr 253306	MVB1995R6	6PK1995
				⊗	A/C(-), PS, →04/95, Eng Nr 253307 →	MVB1980R6	6PK1980
				⊗	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, →04/95, Eng Nr 253307 →	MVB2020R6	6PK2020
				⊗	A/C(+), PS, →04/95, →08/89	MVB2080R6	6PK2080
309 D 3.0	OM 617.913	65	10/82 → 01/90	⊗	→08/89	SVB131000	13x1000
310 D 2.9	OM 602.940	70	06/89 → 02/96	⊗	A/C(-), MS, →04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				⊗	A/C(-), MS, →04/95, Eng Nr 253308 →	MVB1000R6	6PK1000
				⊗	A/C(-), PS, →04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				⊗	A/C(-), PS, →04/95, Eng Nr 253308 →	MVB1980R6	6PK1980
				⊗	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, →04/95, Eng Nr 253307 →	MVB2020R6	6PK2020
				⊗	A/C(+), PS, →04/95, → Eng Nr 253307	MVB2080R6	6PK2080
		72	06/89 → 02/96	⊗	A/C(-), MS, →04/95, → Eng Nr 253307	MVB1015R6	6PK1015
				⊗	A/C(-), MS, →04/95, Eng Nr 253308 →	MVB1000R6	6PK1000
				⊗	A/C(-), PS, →04/95, → Eng Nr 253307	MVB1995R6	6PK1995
				⊗	A/C(-), PS, →04/95, Eng Nr 253308 →	MVB1980R6	6PK1980
				⊗	A/C(+), MS, →04/95, → Eng Nr 253306	MVB2030R6	6PK2030
				⊗	A/C(+), MS, →04/95, Eng Nr 253307 →	MVB2020R6	6PK2020
				⊗	A/C(+), PS, →04/95, → Eng Nr 253307	MVB2080R6	6PK2080

VANEO (414)

1.6 (414.700)	M 166.961	75	02/02 →	⊗	A/C(-)	MVB1285R5	5PK1285
				⊗	A/C(+)	MVB1750R5	5PK1750
		60	02/02 →	⊗	A/C(-)	MVB1285R5	5PK1285
				⊗	A/C(+)	MVB1750R5	5PK1750
1.7 CDI (414.700)	OM 668.914	55	02/02 →	⊗	A/C(-)	MVB1263R5	5PK1263
				⊗	A/C(+)	MVB1725R5	5PK1725
		67	02/02 →	⊗	A/C(-)	MVB1263R5	5PK1263
				⊗	A/C(+)	MVB1725R5	5PK1725
1.9 (414.700)	M 166.991	92	02/02 →	⊗	A/C(-)	MVB1285R5	5PK1285
				⊗	A/C(+)	MVB1750R5	5PK1750

V-CLASS (638/2)

V 200 (638.214)	M 111.948	95	02/97 → 07/03	⊗	A/C(-)	MVB2100R6	6PK2100
				⊗	A/C(+)	MVB2205R6	6PK2205
V 200 CDI (638.294)	OM 611.980	75	03/99 → 07/03	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2160R6	6PK2160
V 220 CDI (638.294)	OM 611.980	90	03/99 → 07/03	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2160R6	6PK2160
V 230 (638.234)	M 111.978	105	10/96 → 07/03	⊗	A/C(-), →03/99	MVB2100R6	6PK2100
				⊗	A/C(+), →03/99	MVB2205R6	6PK2205



kW



MERCEDDES-BENZ

...MERCEDDES-BENZ

...V-CLASS (638/2)

V 230 TD (638.274)	OM 601.970	72	09/96 → 07/03	①	A/C(-), →02/99	MVB2020R6	6PK2020
				②	A/C(+), →02/99	MVB2100R6	6PK2100
V 280 (638.244)	M 104.900	128	08/97 → 07/03	①	A/C(-)	MVB1285R7	7PK1285
				②	A/C(+)	MVB1360R7D	7DPK1360

VIANO (W639)

3.0 CDI		150	03/06 →	①		MVB2035R7	7PK2035
3.2	M 112.951	140	09/03 →	①	A/C(-)	MVB2315R6	6PK2315
				②	A/C(+)	MVB2373R6	6PK2373
		160	09/03 →	①	A/C(-)	MVB2315R6	6PK2315
				②	A/C(+)	MVB2373R6	6PK2373
CDI 2.2	OM 646.982	110	09/03 →	①		MVB2265R6	6PK2265
				②	Rigid PTO (+), →04/05, → Ch. 158569	MVB2271R6	6PK2271
				①②	Rigid PTO (+), 04/05→, Ch. 158570→	MVB2280R6	6PK2280
		80	09/03 →	①		MVB2265R6	6PK2265
				②	Rigid PTO (+), →04/05, → Ch. 158569	MVB2271R6	6PK2271
				①②	Rigid PTO (+), 04/05→, Ch. 158570→	MVB2280R6	6PK2280
CDI 2.2 4-matic	OM 646.982	80	07/05 →	①		MVB2265R6	6PK2265
				②	Rigid PTO (+), Ch. 158570→	MVB2280R6	6PK2280
		110	07/05 →	①		MVB2265R6	6PK2265
				②	Rigid PTO (+), Ch. 158570→	MVB2280R6	6PK2280

VITO Box (638)

108 D 2.3 (638.064)	OM 601.942	58	03/97 → 07/03	①	A/C(-), →02/99	MVB1995R6	6PK1995
				②	A/C(+), →02/99	MVB2080R6	6PK2080
110 CDI 2.2	OM 611LA (75 kW CDI)	75	03/99 → 07/03	①	A/C(-)	MVB2080R6	6PK2080
				②	A/C(+)	MVB2160R6	6PK2160
110 D 2.3 (638.074)	OM 601.970	72	03/97 → 07/03	①	A/C(-), →02/99	MVB2020R6	6PK2020
				②	A/C(+), →02/99	MVB2100R6	6PK2100
112 CDI 2.2	OM 611.980	90	03/99 → 07/03	①	A/C(-)	MVB2080R6	6PK2080
				②	A/C(+)	MVB2160R6	6PK2160
113 2.0 (638.014)	M 111.948	95	03/97 → 07/03	①	A/C(-)	MVB2100R6	6PK2100
				②	A/C(+)	MVB2205R6	6PK2205
114 2.3 (638.034)	M 111.978	105	03/97 → 07/03	①	A/C(-)	MVB2100R6	6PK2100
				②	A/C(+)	MVB2205R6	6PK2205

VITO Box (W639)

109 CDI 2.2	OM 646.983	65	09/03 →	①	eng. PTO shaft (-)	MVB2265R6	6PK2265
				②	eng. PTO shaft (+), →04/05, → Ch. 158569	MVB2271R6	6PK2271
				③	eng. PTO shaft (+), 05/05→, Ch. 158570→	MVB2280R6	6PK2280
111 CDI 2.2	OM 646.982	80	09/03 →	①	eng. PTO shaft (-)	MVB2265R6	6PK2265
				②	eng. PTO shaft (+), →04/05, → Ch. 158569	MVB2271R6	6PK2271
				③	eng. PTO shaft (+), 05/05→, Ch. 158570→	MVB2280R6	6PK2280
		85	09/07 →	①	eng. PTO shaft (-)	MVB2265R6	6PK2265
				②	eng. PTO shaft (+), Ch. 158570→	MVB2280R6	6PK2280
115 CDI 2.2	OM 646.982	110	09/03 →	①		MVB2265R6	6PK2265
115 CDI 2.2 4x4		110	09/07 →	①		MVB2265R6	6PK2265
119 3.2	M 112.951	140	09/03 →	①	→07/08	MVB2373R6	6PK2373
120 CDI		150	09/07 →	①		MVB2035R7	7PK2035
122 3.2	M 112.951	160	09/03 →	①	→09/04	MVB2373R6	6PK2373



kW



...MERCEDES-BENZ

VITO Bus (638)

108 CDI 2.2	OM 611A (60 kW CDI)	60	03/99 → 07/03	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2160R6	6PK2160
108 D 2.3 (638.164)	OM 601.942	58	02/96 → 07/03	⊗	A/C(-), →02/99	MVB1995R6	6PK1995
				⊗	A/C(+), →02/99	MVB2080R6	6PK2080
110 CDI 2.2	OM 611LA (75 kW CDI)	75	03/99 → 07/03	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2160R6	6PK2160
110 TD 2.3 (638.174)	OM 601.970	72	02/96 → 07/03	⊗	A/C(-), →02/99	MVB2020R6	6PK2020
				⊗	A/C(+), →02/99	MVB2100R6	6PK2100
112 CDI 2.2	OM 611.980	90	03/99 → 07/03	⊗	A/C(-)	MVB2080R6	6PK2080
				⊗	A/C(+)	MVB2160R6	6PK2160
113 2.0 (638.114)	M 111.948	95	02/96 → 07/03	⊗	A/C(-)	MVB2100R6	6PK2100
				⊗	A/C(+)	MVB2205R6	6PK2205
114 2.3 (638.134)	M 111.978	105	12/96 → 07/03	⊗	A/C(-)	MVB2100R6	6PK2100
				⊗	A/C(+)	MVB2205R6	6PK2205

VITO Bus (W639)

109 CDI 2.2	OM 646.983	65	09/03 →	⊗	eng. PTO shaft (-)	MVB2265R6	6PK2265
				⊗	eng. PTO shaft (+), →04/05, → Ch. 158569	MVB2271R6	6PK2271
				⊗	eng. PTO shaft (+), 05/05→, Ch. 158570→	MVB2280R6	6PK2280
		70	09/06 →	⊗	A/C(-)	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2280R6	6PK2280
				⊗	A/C(-)	MVB2265R6	6PK2265
	OM 646.981	70	09/07 →	⊗	A/C(+)	MVB2280R6	6PK2280
				⊗	A/C(-)	MVB2265R6	6PK2265
				⊗	A/C(+)	MVB2280R6	6PK2280
111 CDI 2.2	OM 646.982	80	09/03 →	⊗	eng. PTO shaft (-)	MVB2265R6	6PK2265
				⊗	eng. PTO shaft (+), →04/05, → Ch. 158569	MVB2271R6	6PK2271
				⊗	eng. PTO shaft (+), 05/05→, Ch. 158570→	MVB2280R6	6PK2280
		85	09/07 →	⊗	eng. PTO shaft (-)	MVB2265R6	6PK2265
				⊗	eng. PTO shaft (+), Ch. 158570→	MVB2280R6	6PK2280
				⊗	eng. PTO shaft (-)	MVB2265R6	6PK2265
111 CDI 2.2 4x4	OM 646.982	80	09/07 →	⊗	eng. PTO shaft (+),	MVB2280R6	6PK2280
				⊗	eng. PTO shaft (-)	MVB2265R6	6PK2265
				⊗	eng. PTO shaft (+), Ch. 158570→	MVB2280R6	6PK2280
115 CDI 2.2	OM 646.982	110	09/03 →	⊗	eng. PTO shaft (-)	MVB2265R6	6PK2265
115 CDI 2.2 4x4		110	09/07 →	⊗	eng. PTO shaft (+),	MVB2280R6	6PK2280
119	M 112.951	140	09/03 →	⊗	→07/08	MVB2373R6	6PK2373
120 CDI		150	09/07 →	⊗		MVB2035R7	7PK2035
122	M 112.951	160	09/03 →	⊗	→09/04	MVB2373R6	6PK2373
123	M 112.976	170	06/04 →	⊗	→09/04, → Ch. 096543	MVB2373R6	6PK2373

METROCAB

TAXI

2.5 D		52	01/91 →	⊗	→09/00	MVB1520R4	4PK1520
				⊗	→07/91	TB223	130x25.4
				⊗	08/91→08/97	TB370	130x25.4
				⊗	09/97→09/00	TB629	130x28
				⊗	→09/00	SVB131025	13x1025

MG

MAESTRO

2.0 EFi		86	10/84 → 09/90	⊗	→12/86	SVB10950	10x950
				⊗	01/87→09/89	MVB887R4	4PK887
				⊗	→12/86	TB124	104x17
				⊗	01/86→09/89	TB231	104x17
				⊗	→12/86	SVB10700	10x700
				⊗	01/87→09/89	SVB10750	10x750



kW



...MG

...MAESTRO

2.0 Turbo		112	10/88 → 09/90		→09/89	MVB887R4	4PK887
					→09/89	TB231	104x17
					→09/89	SVB10750	10x750
1600		76	03/83 → 09/84			SVB10940	10x940

METRO

1300		54	05/82 → 09/90		09/82 → 09/89	SVB10825	10x825
Turbo		69	10/82 → 09/90		→09/89	SVB10825	10x825

MG TF

115	16 K4F	85	03/02 →		A/C(-), →10/05	MVB735R5	5PK735
					A/C(+), →10/05	MVB1200R5	5PK1200
					→10/05	TB640	261x26
					→10/05	TBK347	
120	18 K4F	88	03/02 →		A/C(-), →10/05	MVB735R5	5PK735
					A/C(+), →10/05	MVB1200R5	5PK1200
					Auto Tensioner, →10/05	TB640	261x26
					Manu Tensioner, →10/05	TB295	143x23
					Auto Tensioner, →10/05	TBK347	
					Manu Tensioner, →10/05	TBK071	
135	18 K4F	100	03/02 →		A/C(-), →10/05	MVB735R5	5PK735
					A/C(+), →10/05	MVB1200R5	5PK1200
					→10/05	TB534	143x26
					→10/05	TB547	68x23
160	18 K4K	118	03/02 →		A/C(-), →10/05	MVB735R5	5PK735
					A/C(+), →10/05	MVB1200R5	5PK1200
					→10/05	TB534	143x26
					→10/05	TB547	68x23

MG ZR

105	14 K4F	76	06/01 →		A/C(-), →10/05	MVB735R5	5PK735
					A/C(+), →10/05,	MVB1148R5	5PK1148
					→ Ch. YD471564		
					A/C(+), →10/05,	MVB1165R5	5PK1165
					Ch. YD471565 →		
					Auto Tensioner, →10/05	TB640	261x26
					Manu Tensioner, →10/05	TB295	143x23
					Auto Tensioner, →10/05	TBK347	
					Manu Tensioner, →10/05	TBK071	
					→10/05	MVB753R3	3PK753
120	18 K4F	86	06/01 →		A/C(-), →09/03	MVB735R5	5PK735
					A/C(+), →09/03,	MVB1148R5	5PK1148
					→ Ch. YD471564		
					A/C(+), →09/03,	MVB1165R5	5PK1165
					Ch. YD471565 →		
					Auto Tensioner,	TB640	261x26
					→09/03, Eng Nr 66148134,		
					67665463 →	TB295	143x23
					Manu Tensioner,	TBK347	
					→09/03, → Eng Nr 66148133,		
	67665462	TBK071					
	Auto Tensioner,						
	→09/03, Eng Nr 66148134,						
	67665463 →	TBK071					
	Manu Tensioner,						
	→09/03, → Eng Nr 66148133,						
	67665462	MVB753R3	3PK753				
	→09/03						



kW



...MG

...MG ZR

160	18 K4K	118	06/01 →		A/C(-), →10/05	MVB735R5	5PK735
					A/C(+), →10/05, → Ch. YD471564	MVB1148R5	5PK1148
					A/C(+), →10/05, Ch. YD471565 →	MVB1165R5	5PK1165
					→10/05	TB534	143x26
					→10/05	TB547	68x23
					→10/05	MVB753R3	3PK753
Turbodiesel		74	06/01 →		A/C(-), →10/05	MVB1180R6	6PK1180
					A/C(+), →10/05	MVB1460R6	6PK1460
					→10/05, → Ch. YD471564	TB477	112x28
					→10/05, Ch. YD471565 →	TB651	112x30
					→10/05, → Ch. YD471564	TB513	78x22
					→10/05, Ch. YD471565 →	TB650	78x24

MG ZS

2.0 TD		74	01/04 →		A/C(-), →10/05	MVB1180R6	6PK1180
					A/C(+), →10/05	MVB1460R6	6PK1460
					→10/05, → Ch. YD471063	TB477	112x28
					→10/05, Ch. YD471064 →	TB651	112x30
					→10/05, → Ch. YD471063	TB513	78x22
					→10/05, Ch. YD471064 →	TB650	78x24
		83	01/04 →		A/C(-), →10/05	MVB1180R6	6PK1180
					A/C(+), →10/05	MVB1460R6	6PK1460
					→10/05, → Ch. YD471063	TB477	112x28
					→10/05, Ch. YD471064 →	TB651	112x30
					→10/05, → Ch. YD471063	TB513	78x22
					→10/05, Ch. YD471064 →	TB650	78x24
120	18 K4F	86	07/01 →		A/C(-), →10/05	MVB735R5	5PK735
					A/C(+), AUTO, Auto Tensioner, →10/05, Ch. YD471064 →	MVB1200R5	5PK1200
					A/C(+), AUTO, Manu Tensioner, →10/05, → Ch. YD471063	MVB1148R5	5PK1148
					A/C(+), MAN, →10/05	MVB1165R5	5PK1165
					→10/05	TB640	261x26
					→10/05	TBK347	
					→10/05	MVB753R3	3PK753
180		130	07/01 →		A/C(+), →10/05	MVB1560R6	6PK1560
					→10/05	TB812	176x28
					→10/05, 2 belts	TB811	58x22

MG ZS Hatchback

1.6		82	11/01 → 10/05		A/C(-), MAN	MVB735R5	5PK735
					A/C(+), MAN, → Ch. YD471063	MVB1148R5	5PK1148
					A/C(+), MAN, Ch. YD471064 →	MVB1200R5	5PK1200
					Auto Tensioner, Eng Nr 654923, 655077 →	TB640	261x26
					Manu Tensioner, → Eng Nr 654922,655076	TB295	143x23
					Auto Tensioner, Eng Nr 654923, 655077 →	TBK347	
					Manu Tensioner, → Eng Nr 654922,655076	TBK071	
						MVB753R3	3PK753



kw



...MG

...MG ZS Hatchback

2.0 TD		74	01/04 →		A/C(-), →10/05	MVB1180R6	6PK1180			
					A/C(+), →10/05	MVB1460R6	6PK1460			
					→10/05, → Ch. YD471063	TB477	112x28			
					→10/05, Ch. YD471064→	TB651	112x30			
					→10/05, → Ch. YD471063	TB513	78x22			
					→10/05, Ch. YD471064→	TB650	78x24			
					83	01/04 →		A/C(-), →10/05	MVB1180R6	6PK1180
								A/C(+), →10/05	MVB1460R6	6PK1460
								→10/05, → Ch. YD471063	TB477	112x28
								→10/05, Ch. YD471064→	TB651	112x30
								→10/05, → Ch. YD471063	TB513	78x22
								→10/05, Ch. YD471064→	TB650	78x24
120	18 K4F	86	07/01 →		A/C(-), →10/05	MVB735R5	5PK735			
						A/C(+),	MVB1200R5	5PK1200		
						AUTO, Auto Tensioner, →10/05, Ch. YD471064→				
						A/C(+),	MVB1148R5	5PK1148		
						AUTO, Manu Tensioner, →10/05, → Ch. YD471063				
						A/C(+), MAN, →10/05	MVB1165R5	5PK1165		
						→10/05	TB640	261x26		
180	25 K4F	130	07/01 →		→10/05	TBK347				
						→10/05	MVB753R3	3PK753		
						A/C(+), →10/05	MVB1560R6	6PK1560		
						→10/05	TB812	176x28		
			→10/05, 2 belts	TB811	58x22					

MG ZT

1.8 16V	18 K4F	88	01/03 →		A/C(-), →10/05	MVB735R5	5PK735	
						A/C(+), →10/05	MVB1200R5	5PK1200
						→10/05	TB640	261x26
						→10/05	TBK347	
1.8 T 16V					→10/05	MVB735R3	3PK735	
						A/C(-), →10/05	MVB735R5	5PK735
						A/C(+), →10/05	MVB1200R5	5PK1200
						→10/05	TB640	261x26
2.0 CDTi	204D2	96	11/02 →		→10/05	MVB735R3	3PK735	
						→10/05	MVB869R5	5PK869
						→10/05	MVB2025R5	5PK2025
						→10/05	MVB869R5	5PK869
160	25 K4F	118	06/01 →		→10/05	MVB2025R5	5PK2025	
						A/C(+), 04/02→10/05	MVB1560R6	6PK1560
						04/02→10/05	TB812	176x28
						04/02→10/05, 2 belts	TB811	58x22
180	25 K4F	130	01/03 →		A/C(+), →10/05	MVB1560R6	6PK1560	
						→10/05	TB812	176x28
						→10/05, 2 belts	TB811	58x22
						→10/05, 2 belts	TB811	58x22
190	25 K4F	140	06/01 →		A/C(+), →10/05	MVB1560R6	6PK1560	
						→10/05	TB812	176x28
						→10/05, 2 belts	TB811	58x22
						→10/05, 2 belts	TB811	58x22

MG ZT- T

1.8 16V	18 K4F	88	01/03 →		A/C(-), →10/05	MVB735R5	5PK735	
						A/C(+), →10/05	MVB1200R5	5PK1200
						→10/05	TB640	261x26
						→10/05	TBK347	
1.8 T 16V					→10/05	MVB735R3	3PK735	
						A/C(-), →10/05	MVB735R5	5PK735
						A/C(+), →10/05	MVB1200R5	5PK1200
						→10/05	TB640	261x26
			→10/05	TBK347				
			→10/05	MVB735R3	3PK735			



kW



MINI

...MG

...MG ZT- T

2.0 CDTi	204D2	96	11/02 →		→10/05	MVB869R5	5PK869
		85	06/02 → 09/03		→10/05	MVB2025R5	5PK2025
160	25 K4F	118	10/01 →		A/C(+), 04/02 → 10/05	MVB1560R6	6PK1560
					04/02 → 10/05	TB812	176x28
180	25 K4F	130	01/03 →		04/02 → 10/05, 2 belts	TB811	58x22
					A/C(+), →10/05	MVB1560R6	6PK1560
190	25 K4F	140	10/01 →		→10/05	TB812	176x28
					→10/05, 2 belts	TB811	58x22
190	25 K4F	140	10/01 →		A/C(+), →10/05	MVB1560R6	6PK1560
					→10/05	TB812	176x28
190	25 K4F	140	10/01 →		→10/05, 2 belts	TB811	58x22
					A/C(+), →10/05	MVB1560R6	6PK1560

MGF (RD)

1.8 i VVC		118	10/01 → 03/02		A/C(-)	MVB735R5	5PK735
					A/C(+)	MVB1200R5	5PK1200
1.6	16 K4F	82	02/00 → 03/02		Vehicle front	TB547	68x23
					A/C(-), 09/00 →	TB534	143x26
1.6	16 K4F	82	02/00 → 03/02		A/C(+), 09/00 →	MVB735R5	5PK735
					09/00 →	MVB1200R5	5PK1200
1.8 i 16V	18 K4F	88	03/95 → 03/02		09/00 →	TB640	261x26
					09/00 →	TBK347	
1.8 i 16V	18 K4F	88	03/95 → 03/02		A/C(-)	MVB735R5	5PK735
					A/C(+)	MVB1200R5	5PK1200
1.8 i 16V	18 K4F	88	03/95 → 03/02		Auto Tensioner, 09/98 →	TB640	261x26
					Manu Tensioner, →08/98	TB295	143x23
1.8 i 16V	18 K4F	88	03/95 → 03/02		Auto Tensioner, 09/98 →	TBK347	
					Manu Tensioner, →08/98	TBK071	
1.8 i VVC	18 K4K (VVC)	107	03/95 → 03/02		A/C(-)	MVB735R5	5PK735
					A/C(+)	MVB1200R5	5PK1200
1.8 i VVC	18 K4K (VVC)	107	03/95 → 03/02		Vehicle front	TB547	68x23
					Vehicle front	TB534	143x26

MONTEGO

2.0 EFI		86	04/84 → 09/90		10/84 → 07/89	SVB10950	10x950
					01/87 → 07/89	TB231	104x17
2.0 EFI		86	04/84 → 09/90		10/84 → 12/86	TB124	104x17
					01/87 → 07/89	SVB10750	10x750
2.0 Turbo	20 HT	110	10/84 → 09/90		10/84 → 12/86	SVB10700	10x700
					→07/89	MVB887R4	4PK887
2.0 Turbo	20 HT	110	10/84 → 09/90		→12/86	TB124	104x17
					01/87 → 07/89	TB231	104x17
2.0 Turbo	20 HT	110	10/84 → 09/90		→12/86	SVB10700	10x700
					01/87 → 07/89	SVB10750	10x750

MINI

MINI

1.4		55	04/03 → 10/06		A/C(-), →07/04	MVB890R6	6PK890
					A/C(-), 07/04 →	MVB870R6	6PK870
1.6 S Works		147	11/03 → 06/05		A/C(+)	MVB1050R6	6PK1050
					A/C(+), →10/06,	MVB1370R6	6PK1370
Cooper	W10B16A	85	06/01 →		Hot climates (-)	MVB890R6	6PK890
					A/C(-), →07/04	MVB870R6	6PK870
Cooper	W10B16A	85	06/01 →		A/C(-), 07/04 → 10/06	MVB1050R6	6PK1050
					A/C(+), →10/06,	MVB1050R6	6PK1050
Cooper	W10B16A	85	06/01 →		Hot climates (+)	MVB1035R6	6PK1035
					A/C(+), →10/06,	MVB1035R6	6PK1035
Cooper D	N12B16A	88	10/06 →		Hot climates (+)	MVB906R6	6PK906
					A/C(+)	MVB906R6	6PK906
Cooper D		80	03/07 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975



kw



...MINI

...MINI

Cooper S	W11B16A	120	03/02 →	☼	→10/06	MVB1050R6	6PK1050
				⊗	→10/06	MVB1388R6	6PK1388
		125	07/04 →	☼	→10/06	MVB1050R6	6PK1050
				⊗	→10/06	MVB1388R6	6PK1388
		128	10/06 →	⊗	A/C(+)	MVB906R6	6PK906
One	W10B16A	66	06/01 →	⊗	A/C(-), →07/04	MVB890R6	6PK890
				⊗	A/C(-), 07/04→10/06	MVB870R6	6PK870
				⊗	A/C(+), →10/06,	MVB1050R6	6PK1050
				⊗	Hot climates (-)		
				⊗	A/C(+), →10/06,	MVB1035R6	6PK1035
				⊗	Hot climates (+)		
		70	03/07 →	⊗	A/C(+)	MVB906R6	6PK906
One D	1ND	55	06/03 →	⊗	A/C(-), →10/06	MVB935R7	7PK935
				⊗	A/C(+), →10/06	MVB1180R7	7PK1180
		65	06/03 →	⊗	A/C(-), →10/06	MVB935R7	7PK935
				⊗	A/C(+), →10/06	MVB1180R7	7PK1180
Works	W11B16A	155	11/03 →	⊗	07/05→	MVB1370R6	6PK1370

MINI CLUBMAN

1.6		120	10/07 →	⊗	A/C(+)	MVB906R6	6PK906
		128	10/07 →	⊗	A/C(+)	MVB906R6	6PK906
		88	10/07 →	⊗	A/C(+)	MVB906R6	6PK906
1.6 D	9HZ (DV6TED4)	80	10/07 →	⊗	A/C(-)	MVB795R6	6PK795
				⊗	A/C(+)	MVB975R6	6PK975

MINI Convertible

Cooper	W10B16A	85	07/04 →	⊗	A/C(-)	MVB870R6	6PK870
				⊗	A/C(+), Hot climates (-)	MVB1050R6	6PK1050
				⊗	A/C(+), Hot climates (+)	MVB1035R6	6PK1035
Cooper S	W11B16A	125	07/04 →	⊗		MVB1388R6	6PK1388
One	W10B16A	66	07/04 →	⊗	A/C(-), →10/06	MVB870R6	6PK870
				⊗	A/C(+), →10/06	MVB1035R6	6PK1035
Works	W11B16A	155	07/04 →	⊗	07/05→	MVB1370R6	6PK1370

MINI-MOKE

1.0		29	01/87 →	⊗	AUTO, →04/90	SVB10813	10x813
				⊗	MAN, →04/90	SVB10840	10x840

MITSUBISHI

3000 GT (Z16A)

3.0 i 24V 4x4	6G72	210	06/92 → 08/99	⊗	V-ribbed belt pulley (+)	MVB1150R6	6PK1150
						TB403	257x32
				⊗		MVB920R4	4PK920
				⊗	V-belt pulley (+)	SVB13925	13x925

AIRTREK

2.4		118	03/03 → 09/06	⊗	A/C(+)	MVB1885R6	6PK1885
				⊗		TB326	65x12.7

CARISMA (DA_)

1.6	4 G 92	66	07/95 → 06/06	⊗	→10/05	MVB775R4	4PK775		
					→10/05	TB492	111x29		
				⊗	A/C(-), →10/05	MVB1090R5	5PK1090		
				⊗	A/C(+), →09/96	MVB1330R5	5PK1330		
				⊗	A/C(+), 10/96→10/05	MVB1345R5	5PK1345		
				73	05/97 → 06/06	⊗	→10/05	MVB775R4	4PK775
							→10/05	TB492	111x29
						⊗	A/C(-), →10/05	MVB1090R5	5PK1090
				⊗	A/C(+), →10/05	MVB1345R5	5PK1345		



kW



...MITSUBISHI

...CARISMA (DA_)

...1.6		70	12/98 → 06/06		→10/05	MVB775R4	4PK775
					→10/05	TB492	111x29
76	09/00 → 06/06	76	09/00 → 06/06		A/C(-), →10/05	MVB1090R5	5PK1090
					A/C(+), →10/05	MVB1345R5	5PK1345
					→10/05	MVB775R4	4PK775
					→10/05	TB492	111x29
1.8	4G93	85	07/95 → 06/06		A/C(-), →10/05	MVB1090R5	5PK1090
					A/C(+), →10/05	MVB1345R5	5PK1345
					→10/97	MVB775R4	4PK775
					→10/97	TB493	116x29
1.8 16V	4G93	103	07/95 → 06/06		A/C(-), →09/96	MVB1330R5	5PK1330
					A/C(+), 10/96→10/97	MVB1345R5	5PK1345
					→10/97	MVB775R4	4PK775
					→10/97	TB684	154x29
1.8 16V GDI	4G93	92	09/97 → 06/06		A/C(-), →10/97	MVB1090R5	5PK1090
					A/C(+), →09/96	MVB1330R5	5PK1330
					A/C(+), 10/96→10/97	MVB1345R5	5PK1345
					→10/05	MVB775R4	4PK775
1.8 GDI	4G93	90	10/00 → 06/06		→10/05	TB684	154x29
					→10/05	MVB775R4	4PK775
					A/C(-), →10/05	MVB1090R5	5PK1090
					A/C(+), →10/05	MVB1330R5	5PK1330
1.9 DI-D	F9Q1	75	09/00 → 06/06		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
	F9Q2	85	09/00 → 06/06		A/C(-)	TB653	132x26
					A/C(+)	TBK275	
1.9 TD	F8QT	66	10/96 → 09/00		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB653	132x26
						TBK275	
1.3		55	09/00 → 10/04		A/C(-)	MVB1137R6	6PK1137
					A/C(+)	MVB1642R6	6PK1642
					Eng Nr C003535→	TB545	153x25.4

CARISMA Saloon (DA_)

1.3		55	09/00 → 10/04			MVB865R5	5PK865
						TB786	109x25
1.6	4 G 92	66	09/96 → 06/06		A/C(-)	MVB960R5	5PK960
					A/C(+)	MVB1060R5	5PK1060
					→10/05	MVB775R4	4PK775
					→10/05	TB492	111x29
73	05/97 → 06/06	73	05/97 → 06/06		A/C(-), →10/05	MVB1090R5	5PK1090
					A/C(+), →10/05	MVB1345R5	5PK1345
					→10/05	MVB775R4	4PK775
					→10/05	TB492	111x29
70	12/98 → 06/06	70	12/98 → 06/06		A/C(-), →10/05	MVB1090R5	5PK1090
					A/C(+), →10/05	MVB1345R5	5PK1345
					→10/05	MVB775R4	4PK775
					→10/05	TB492	111x29
76	09/00 → 06/06	76	09/00 → 06/06		A/C(-), →10/05	MVB1090R5	5PK1090
					A/C(+), →10/05	MVB1345R5	5PK1345
					→10/05	MVB775R4	4PK775
					→10/05	TB492	111x29
1.8	4G93	85	09/96 → 06/06		A/C(-), →10/05	MVB1090R5	5PK1090
					A/C(+), →10/05	MVB1345R5	5PK1345
					→10/97	MVB775R4	4PK775
					→10/97	TB493	116x29
1.8		85	09/96 → 06/06		A/C(-), →10/97	MVB1090R5	5PK1090
					A/C(+), →10/97	MVB1345R5	5PK1345



kW



MITSUBISHI

...MITSUBISHI

...CARISMA Saloon (DA_)

1.8 16V GDI	4G93	92	09/97 → 06/06	⊗	→10/05	MVB775R4	4PK775
				☺	→10/05	TB684	154x29
				☺	A/C(-), →10/05	MVB1090R5	5PK1090
1.8 GDI		90	10/00 → 06/06	☺	A/C(+), →10/05	MVB1330R5	5PK1330
				⊗	→10/05	MVB775R4	4PK775
				☺	→10/05	TB684	154x29
1.9 DI-D	F9Q1	75	09/00 → 06/06	☺	A/C(-)	MVB1120R5	5PK1120
				⊗	A/C(+)	MVB1795R6	6PK1795
				☺		TB653	132x26
1.9 DI-D	F9Q2	85	09/00 → 06/06	☺		TBK275	
				⊗	A/C(-)	MVB1120R5	5PK1120
				☺	A/C(+)	MVB1795R6	6PK1795
1.9 TD	F8QT	66	10/96 → 09/00	☺		TB653	132x26
				⊗		TBK275	
				☺	Eng Nr C003535 →	MVB1137R6	6PK1137
1.9 TD				☺		MVB1642R6	6PK1642
				⊗		TB545	153x25.4
				☺			

COLT II (C1_A)

1.2 EL.GL (C15A)	4G16	40	02/84 → 09/86	⊗		MVB870R4	4PK870
				☺		TB160	92x19
				☺		SVB13625	13x625
1.2 EL.GL (C15A)		44	09/86 → 04/88	⊗		MVB870R4	4PK870
				☺	→05/87	TB160	92x19
				☺	06/87 →	TB518	92x19
1.5 GLX (C12A)	G15B	51	09/85 → 04/88	☺	06/87 →	TBK291	
				☺	06/87 →	SVB13625	13x625
				☺		MVB870R4	4PK870
1.5 GLX (C12A)	4 G 15	55	09/84 → 04/88	⊗	→05/87	TB160	92x19
				☺	06/87 →	TB518	92x19
				☺	06/87 →	TBK291	
1.6 Turbo ECi (C13A)	4 G 32 T/C	92	02/84 → 04/88	⊗		MVB940R4	4PK940
				☺		TB360	120x19
				☺		SVB13625	13x625
1.6 Turbo ECi (C13A)		77	07/86 → 04/88	⊗		MVB940R4	4PK940
				☺		TB360	120x19
				☺		SVB13625	13x625
1.8 GL Diesel (C14A)	4 D 65	43	02/84 → 09/86	⊗		SVB131000	13x1000
				☺		TB302	55x12.7
				☺		TB267	157x32
1.8 GL Diesel (C14A)		44	09/86 → 04/88	☺	bal. shaft	TBK060	
				☺		SVB13675	13x675
				☺		SVB131000	13x1000
1.8 GL Diesel (C14A)				☺		TB302	55x12.7
				☺		TB267	157x32
				☺	bal. shaft	TBK060	
1.8 GL Diesel (C14A)				☺		SVB13625	13x625
				☺			
				☺			

COLT III (C5_A)

1.3 12V (C51A)	4 G 13 (12V)	55	04/88 → 05/92	⊗	→11/91	MVB870R4	4PK870
				☺	→11/91	MVB875R4	4PK875
				☺	→05/90	TB518	92x19
1.3 12V (C51A)				☺	06/90 → 11/91	TB366	92x22
				☺	→11/91	SVB13625	13x625
				☺		MVB875R4	4PK875
1.5 (C52A) CAT	4 G 15	66	07/90 → 05/92	⊗	Cat(+)	TB366	92x22
				☺		SVB13625	13x625
				☺			



kW



...MITSUBISHI

...COLT III (C5_A)

1.5 GLXi (C52A)	4 G 15	62	04/88 → 05/92	⊗	Cat(-)	MVB870R4	4PK870
				⊗	Cat(+)	MVB875R4	4PK875
				☺	→05/90	TB518	92x19
				☺	06/90→	TB366	92x22
1.6 GTi 16V (C53A)	4G61	91	04/88 → 05/90	⊗		MVB975R4	4PK975
				☺		TB402	151x29
				☺		SVB13625	13x625
1.8 Diesel GLX (C54A)	4 D 65	44	04/88 → 05/92	⊗	→11/91	SVB131000	13x1000
				☺	→11/91	TB302	55x12.7
				☺	→11/91	TB267	157x32
				☺	→11/91, KIT	TBK060	
				☺	→11/91	SVB13655	13x655
1.8 GTi 16V (C58A) CAT	4G67	100	06/90 → 05/92	⊗	→11/91	MVB995R4	4PK995
				☺	→11/91	TB326	65x12.7
				☺	→11/91	TB325	153x29
				☺	→11/91	SVB13675	13x675

COLT IV (CA_A)

1.3 GLi 12V (CA1A)	4 G 13 (BJ92-..., 12V)	55	04/92 → 04/96	☼		SVB13800	13x800
				⊗		MVB875R4	4PK875
				☺		TB366	92x22
1.6		66	02/94 → 04/96	⊗	→11/93	SVB13610	13x610
				☺	12/93→	MVB588R4	4PK588
				⊗	09/95→	MVB775R4	4PK775
				☺	09/95→	TB492	111x29
1.6 GLXi 16V (CA4A)	4 G 92	83	04/92 → 04/96	☺	A/C(-), 09/95→	MVB1090R5	5PK1090
				☺	A/C(+), 09/95→	MVB1300R5	5PK1300
				☺	A/C(+), 09/95→	MVB1330R5	5PK1330
				☼	MS, →11/93	MVB850R5	5PK850
				☼	MS, 12/93→	MVB875R5	5PK875
1.8 GTi 16V (CA5A)	4G93	103	04/92 → 04/96	☼	PS, →11/93	MVB1110R5	5PK1110
				☼	PS, 12/93→	MVB1120R5	5PK1120
				⊗		MVB775R4	4PK775
				☺		TB379	117x29
				☺		MVB950R5	5PK950
1.8 GTi 16V (CA5A)	4G93	103	04/92 → 04/96	☼	MS, →11/93	MVB850R5	5PK850
				☼	MS, 12/93→	MVB875R5	5PK875
				☼	PS, →11/93	MVB1110R5	5PK1110
				☼	PS, 12/93→	MVB1120R5	5PK1120
				⊗		MVB763R4	4PK763
				☺		TB380	156x29
				☺		MVB950R5	5PK950

COLT V (CJ_A)

1300	4 G 13 (16 V)	60	09/00 → 07/05	⊗	08/01→05/04	MVB865R5	5PK865
				☺	08/01→05/04	TB786	109x25
				☺	08/01→05/04	MVB1060R5	5PK1060
1300 GL, GLX (CJ1A)	4 G 13 (12V)	55	05/96 → 09/00	⊗		MVB865R5	5PK865
				☺	→05/00	TB491	107x25.4
				☺	06/00→	TB786	109x25
				☺	A/C(-)	MVB950R5	5PK950
				☺	A/C(+)	MVB1073R5	5PK1073
1600		76	09/00 → 07/05	⊗	→05/04	MVB775R4	4PK775
				☺	→05/04	TB492	111x29
				☺	A/C(-), →05/04	MVB1090R5	5PK1090
				☺	A/C(+), →05/04	MVB1300R5	5PK1300
				☺	A/C(+), →05/04	MVB1330R5	5PK1330
1600 GLX (CJ4A)		66	05/96 → 09/00	⊗		MVB775R4	4PK775
				☺		TB492	111x29
				☺	A/C(-)	MVB1090R5	5PK1090
				☺	A/C(+)	MVB1300R5	5PK1300
				☺	A/C(+)	MVB1330R5	5PK1330



kw



MITSUBISHI

...MITSUBISHI

COLT VI

1.1	3A91	55	10/04 →	⊗ ⊗	A/C(-) A/C(+)	MVB915R5 MVB1225R5	5PK915 5PK1225
1.3	4A90	70	06/04 →	⊗ ⊗	A/C(-) A/C(+)	MVB915R5 MVB1225R5	5PK915 5PK1225
1.5	4A91	80	06/04 →	⊗ ⊗	A/C(-) A/C(+)	MVB915R5 MVB1225R5	5PK915 5PK1225
1.5 CZT	4G15T	110	03/05 →	⊗ ⊗		MVB800R4 MVB906R5	4PK800 5PK906
1.5 DI-D		50	08/04 →	⊗	03/05 →	MVB1790R5	5PK1790
	OM639	70	08/04 →	⊗		MVB1790R5	5PK1790

ECLIPSE I (D2_A)

2.0 i 16V (D22A)	4 G 63	110	04/91 → 11/95	⊗ ⊗ T ⊗ ⊗	→03/94 →03/94 →03/94 →03/94 →03/94	MVB920R4 MVB995R4 TB326 TB325 SVB13675	4PK920 4PK995 65x12.7 153x29 13x675
------------------	--------	-----	---------------	-----------------------	--	--	---

ECLIPSE II (D3_)

2000 GT 16V		157	12/95 → 04/99	⊗ ⊗ T ⊗ ⊗		MVB940R4 MVB975R4 TB326 TB325 MVB700R4	4PK940 4PK975 65x12.7 153x29 4PK700
-------------	--	-----	---------------	-----------------------	--	--	---

GALANT III (E1_A)

1.6 GLX (E11A)	4G32	55	06/84 → 12/87	⊗ T ⊗ ⊗		MVB940R4 TB302 TB213 SVB13625	4PK940 55x12.7 122x19 13x625
1.8 Turbo-D (E14A)	4 D 65 T	60	06/84 → 12/87	⊗ T ⊗ ⊗ ⊗ ⊗	LHD bal. shaft	SVB131000 TB302 TB267 TBK060 SVB13675	13x1000 55x12.7 157x32 13x675
2.0 GLS (E15A)	G63B	66	06/86 → 12/87	⊗ ⊗ ⊗ T ⊗ ⊗	AUTO MAN	SVB13925 MVB985R4 MVB975R4 TB302 TB213 SVB13655	13x925 4PK985 4PK975 55x12.7 122x19 13x655
	4G63	75	06/84 → 12/87	⊗ ⊗ ⊗ T ⊗ ⊗	AUTO MAN	SVB13925 MVB985R4 MVB975R4 TB302 TB213 SVB13655	13x925 4PK985 4PK975 55x12.7 122x19 13x655
2.0 Turbo ECi (E15A)	4 G 63 T	110	06/84 → 05/85	⊗ ⊗ ⊗ T ⊗ ⊗	AUTO MAN	SVB13925 MVB985R4 MVB975R4 TB302 TB213 SVB13655	13x925 4PK985 4PK975 55x12.7 122x19 13x655
2.4 GLS (E16A)	G64B	82	07/85 → 12/87	⊗ T ⊗ ⊗ ⊗ ⊗ ⊗	05/87 → bal. shaft	MVB975R4 TB302 TB356 TBK292 TBK060 SVB13655	4PK975 55x12.7 123x19 13x655



kW



...MITSUBISHI

GALANT IV (E3_A)

1.8 (E32A)	4G37	66	11/88 → 10/92	 		SVB13875 SVB13900 MVB940R4 TB302 TB213 SVB13625	13x875 13x900 4PK940 55x12.7 122x19 13x625
1.8 Turbo-D (E34A)	4 D 65 T	55	11/88 → 10/92	 	AUTO MAN bal. shaft	SVB131025 SVB131000 TB302 TB267 TBK060 SVB13655	13x1025 13x1000 55x12.7 157x32 13x655
2.0 (E33A)	4G63	80	04/89 → 10/92	 	→04/92 05/92 → →04/92, bal. shaft	MVB920R4 MVB985R4 MVB995R4 TB302 TB326 TB400 TBK060 SVB13625	4PK920 4PK985 4PK995 55x12.7 65x12.7 122x24 13x625
2.0 4x4 (E38A, E39A)	4G63	80	04/89 → 10/92	 	→04/92 05/92 → →04/92, bal. shaft	MVB985R4 MVB995R4 TB302 TB326 TB400 TBK060 SVB13625	4PK985 4PK995 55x12.7 65x12.7 122x24 13x625
2.0 GTI 16V (E33A)	4 G 63	106	11/88 → 10/92	 		MVB920R4 MVB985R4 MVB995R4 TB326 TB325 SVB13675	4PK920 4PK985 4PK995 65x12.7 153x29 13x675
		107	11/88 → 10/92	 		MVB920R4 MVB985R4 MVB995R4 TB326 TB325 SVB13675	4PK920 4PK985 4PK995 65x12.7 153x29 13x675
2.0 GTI 16V 4x4 (E39A)	4 G 63	106	07/89 → 12/92	 		MVB920R4 MVB985R4 MVB995R4 TB326 TB325 SVB13675	4PK920 4PK985 4PK995 65x12.7 153x29 13x675

GALANT IV Saloon (E3_A)

1.8 (E32A)	4G37	63	11/87 → 08/90	 		SVB13875 SVB13900 MVB940R4 TB302 TB213 SVB13625	13x875 13x900 4PK940 55x12.7 122x19 13x625
		66	11/87 → 10/92	 		SVB13875 SVB13900 MVB940R4 TB302 TB213 SVB13625	13x875 13x900 4PK940 55x12.7 122x19 13x625



kw



MITSUBISHI

...MITSUBISHI

...GALANT IV Saloon (E3_A)

1.8 Turbo-D (E34A)	4 D 65 T	55	12/87 → 10/92	⊗	AUTO	SVB131025	13x1025
				⊗	MAN	SVB131000	13x1000
				⊗		TB302	55x12.7
				⊗		TB267	157x32
				⊗	bal. shaft	TBK060	
2.0 (E33A)	4G63	80	11/87 → 10/92	⊗		SVB13655	13x655
				⊗		MVB920R4	4PK920
				⊗		MVB985R4	4PK985
				⊗		MVB995R4	4PK995
				⊗	→04/92	TB302	55x12.7
2.0 4x4 (E38A)	4G63	80	12/88 → 10/92	⊗	05/92→	TB326	65x12.7
				⊗		TB400	122x24
				⊗		TBK060	
				⊗	→04/92, bal. shaft	SVB13625	13x625
				⊗		MVB985R4	4PK985
2.0 GTi 16V	4 G 63	107	11/88 → 10/92	⊗		MVB995R4	4PK995
				⊗	→04/92	TB302	55x12.7
				⊗	05/92→	TB326	65x12.7
				⊗		TB400	122x24
				⊗	→04/92, bal. shaft	TBK060	
2.0 GTi 16V (E33A)	4 G 63	106	11/87 → 10/92	⊗		SVB13625	13x625
				⊗		MVB920R4	4PK920
				⊗		MVB985R4	4PK985
				⊗		MVB995R4	4PK995
				⊗		TB326	65x12.7
2.0 GTi 16V 4x4	4 G 63	106	06/88 → 10/92	⊗		TB325	153x29
				⊗		SVB13675	13x675
				⊗		MVB920R4	4PK920
				⊗		MVB985R4	4PK985
				⊗		MVB995R4	4PK995
2.0 GTi 16V 4x4 CAT	4 G 63	110	09/91 → 10/92	⊗		TB326	65x12.7
				⊗		TB325	153x29
				⊗		SVB13675	13x675
				⊗		MVB920R4	4PK920
				⊗		MVB985R4	4PK985

GALANT V (E5_A, E7_A, E8_A)

1.8 (E52A)	4G93	85	02/94 → 08/96	⊗		MVB775R4	4PK775
				⊗		TB381	121x29
				⊗	A/C(-)	MVB950R5	5PK950
1.8 GLSi (E52A)	4G93	93	11/92 → 08/96	⊗	A/C(+)	MVB1110R5	5PK1110
				⊗		MVB775R4	4PK775
				⊗		TB381	121x29
2.0 GLSi (E55A)	4G63	101	11/92 → 08/96	⊗	A/C(-)	MVB950R5	5PK950
				⊗	A/C(+)	MVB1110R5	5PK1110
				⊗		MVB950R4	4PK950
				⊗		MVB985R4	4PK985
				⊗		TB326	65x12.7
				⊗		TB406	123x29
				⊗		MVB700R4	4PK700



kW



...MITSUBISHI

...GALANT V (E5_A, E7_A, E8_A)

2.0 GLSI 4x4 (E75A)	4G63	101	11/92 → 08/96			MVB950R4 4PK950 MVB985R4 4PK985 TB326 65x12.7 TB406 123x29 MVB700R4 4PK700
2.0 GLSTD (E57A)	4 D 68 T	66	11/92 → 08/96			SVB13950 13x950 SVB131025 13x1025 TB326 65x12.7 TB671 158x32 MVB640R4 4PK640
2.0 V6-24 (E54A)	6A12	110	11/92 → 08/96			MVB1060R5 5PK1060 MVB950R4 4PK950 MVB925R5 5PK925
2.5		125	11/92 → 09/96		A/C(-) A/C(+)	MVB1065R6 6PK1065 MVB1150R6 6PK1150 TB403 257x32 MVB920R4 4PK920
2.5 V6-24 4x4 (E88A)	6G73	125	11/92 → 08/96		A/C(-) A/C(+)	MVB1065R6 6PK1065 MVB1150R6 6PK1150 TB403 257x32 MVB920R4 4PK920

GALANT V Saloon (E5_A, E7_A, E8_A)

1.8 (E52A)	4G93	85	02/94 → 08/96		A/C(-) A/C(+)	MVB775R4 4PK775 TB381 121x29 MVB950R5 5PK950 MVB1110R5 5PK1110
1.8 GLSI (E52A)	4G93	93	11/92 → 08/96		A/C(-) A/C(+)	MVB775R4 4PK775 TB381 121x29 MVB950R5 5PK950 MVB1110R5 5PK1110
2.0 GLSI (E55A)	4G63	101	11/92 → 08/96			MVB950R4 4PK950 MVB985R4 4PK985 TB326 65x12.7 TB406 123x29 MVB700R4 4PK700
2.0 GLSI 4x4 (E75A)	4G63	101	11/92 → 08/96			MVB950R4 4PK950 MVB985R4 4PK985 TB326 65x12.7 TB406 123x29 MVB700R4 4PK700
2.0 GLSTD (E57A)	4 D 68 T	66	11/92 → 08/96			SVB13950 13x950 SVB131025 13x1025 TB326 65x12.7 TB671 158x32 MVB640R4 4PK640
2.0 V6-24 (E54A)	6A12	110	11/92 → 08/96		A/C(-)	MVB1060R5 5PK1060 MVB950R4 4PK950 MVB925R5 5PK925
2.5 V6-24 4x4 (E88A)	6G73	125	11/92 → 08/96		A/C(-) A/C(+)	MVB1065R6 6PK1065 MVB1150R6 6PK1150 TB403 257x32 MVB920R4 4PK920

GALANT VI (EA_)

2.0		98	09/00 → 10/04		08/01→10/03 08/01→10/03 08/01→10/03 08/01→10/03 08/01→10/03	MVB940R4 4PK940 TB326 65x12.7 TB540 122x29 MVB1073R5 5PK1073 MVB1330R5 5PK1330
-----	--	----	---------------	--	---	---



kW



MITSUBISHI

...MITSUBISHI

...GALANT VI (EA_)

2.0 (EA2A)		100	09/96 → 09/00	⊗ ⊕ ⊖ ⊗ ⊕ ⊖ ⊗ ⊕ ⊖		MVB940R4 TB326 TB540 MVB1090R5 MVB1073R5 MVB1370R5 MVB1330R5	4PK940 65x12.7 122x29 5PK1090 5PK1073 5PK1370 5PK1330
2.0 TDI (EA6A)	4D68 SOHC	66	09/96 → 10/04	⊗ ⊕ ⊖ ⊗ ⊕ ⊖	→07/01 →07/01 →07/01 →07/01 →07/01	MVB938R5 SVB131025 TB326 TB671 MVB887R4	5PK938 13x1025 65x12.7 158x32 4PK887
2.4 GDI	4G64 (GDI)	110	02/99 → 09/00	⊗ ⊕ ⊖ ⊗ ⊕ ⊖		MVB938R5 TB326 TB788 MVB1073R5 MVB1330R5	5PK938 65x12.7 154x29 5PK1073 5PK1330
		106	09/00 → 10/04	⊗ ⊕ ⊖ ⊗ ⊕ ⊖	→10/03 →10/03 →10/03 A/C(-), →10/03 A/C(+), →10/03	MVB938R5 TB326 TB788 MVB1073R5 MVB1330R5	5PK938 65x12.7 154x29 5PK1073 5PK1330
2.5 V6 24V	6A13	118	09/00 → 10/04	⊗ ⊕ ⊖ ⊗ ⊕ ⊖	→10/03 →10/03 A/C(-), →10/03 A/C(+), →10/03	MVB950R4 TB801 MVB962R6 MVB1065R6	4PK950 177x30 6PK962 6PK1065
2.5 V6 24V (EA5A)	6A13	120	09/96 → 09/00	⊗ ⊕ ⊖ ⊗ ⊕ ⊖		MVB950R4 TB801 MVB962R6 MVB1065R6	4PK950 177x30 6PK962 6PK1065

GALANT VI Estate (EA_)

2.0		98	09/00 → 10/03	⊗ ⊕ ⊖ ⊗ ⊕ ⊖	→10/02 →10/02 →10/02 A/C(-), →10/02 A/C(+), →10/02	MVB940R4 TB326 TB540 MVB1073R5 MVB1330R5	4PK940 65x12.7 122x29 5PK1073 5PK1330
2.0 (EA2W)		100	09/96 → 09/00	⊗ ⊕ ⊖ ⊗ ⊕ ⊖		MVB940R4 TB326 TB540 MVB1090R5 MVB1073R5 MVB1370R5 MVB1330R5	4PK940 65x12.7 122x29 5PK1090 5PK1073 5PK1370 5PK1330
2.0 TDI (EA6W)	4D68 SOHC	66	09/96 → 10/03	⊗ ⊕ ⊖ ⊗ ⊕ ⊖	→07/01 →07/01 →07/01 →07/01 →07/01	MVB938R5 SVB131025 TB326 TB671 MVB887R4	5PK938 13x1025 65x12.7 158x32 4PK887
2.4 GDI	4G64 (GDI)	110	02/99 → 09/00	⊗ ⊕ ⊖ ⊗ ⊕ ⊖		MVB938R5 TB326 TB788 MVB1073R5 MVB1330R5	5PK938 65x12.7 154x29 5PK1073 5PK1330
		106	09/00 → 10/03	⊗ ⊕ ⊖ ⊗ ⊕ ⊖	A/C(-) A/C(+)	MVB938R5 TB326 TB788 MVB1073R5 MVB1330R5	5PK938 65x12.7 154x29 5PK1073 5PK1330
2.5 V6 24V	6A13	118	09/00 → 10/03	⊗ ⊕ ⊖ ⊗ ⊕ ⊖		MVB950R4 TB801 MVB962R6 MVB1065R6	4PK950 177x30 6PK962 6PK1065



kW



...MITSUBISHI

...GALANT VI Estate (EA_)

2.5 V6 24V (EA5W)	6A13	120	09/96 → 09/00	 	 A/C(-) A/C(+)	MVB950R4 TB801 MVB962R6 MVB1065R6	4PK950 177x30 6PK962 6PK1065
-------------------	------	-----	---------------	--------------	--------------------------	--	---------------------------------------

GALLOPER (JK-01)

2.5 TD		65	02/99 →	 	 09/99 → 08/02 09/99 → 08/02 09/99 → 08/02 09/99 → 08/02 09/99 → 08/02	SVB13925 SVB101100 TB490 TB489 SVB13780	13x925 10x1100 99x19 163x25.4 13x780
2.5 TD intercooler	D4BH	73	02/99 →	 	 → 08/02 → 08/02 → 08/02 → 08/02 → 08/02 → 08/02	SVB13925 SVB101100 TB490 TB489 TBK311 SVB13780	13x925 10x1100 99x19 163x25.4 13x780

GRANDIS

2.0 DI-D	BSY	100	09/05 →	 		MVB1715R6 TB743	6PK1715 141x30
		103	02/07 →	 		MVB1715R6 TB743	6PK1715 141x30
2.4	4G69	121	04/04 →	 		MVB1875R6 TB326	6PK1875 65x12.7

L 200

2.5 DI-D		100	05/06 →			SVB13900	13x900
		123	10/07 →			SVB13900	13x900

L 200 (K__T)

2.0 (K62T)		90	06/96 →	 	 → 07/01 → 07/01 → 07/01 → 07/01 → 07/01	MVB925R4 MVB985R4 TB326 TB406 MVB1050R4	4PK925 4PK985 65x12.7 123x29 4PK1050
2.4 4x4 (K75T)		97	06/96 →	 	 11/96 → 07/01 11/96 → 07/01 11/96 → 07/01 11/96 → 07/01 11/96 → 07/01	MVB925R4 MVB985R4 TB326 TB407 MVB1050R4	4PK925 4PK985 65x12.7 124x29 4PK1050
2.5 D (K14T)	4 D 56	51	11/86 → 08/96	 	 → 05/93 06/93 → → 05/93 06/93 → → 05/93, bal. shaft → 05/93 06/93 →	SVB171115 TB268 TB490 TB359 TB489 TBK067 TBK069 TBK311 SVB13780	17x1115 83x19 99x19 163x25.4 163x25.4 13x780
2.5 D (K64T)	4 D 56	55	06/96 →	 	 → 11/05 → 11/05 → 11/05 → 11/05 → 11/05 → 11/05	SVB13875 SVB101075 TB490 TB489 TBK311 MVB1125R4	13x875 10x1075 99x19 163x25.4 4PK1125
2.5 D 4WD (K24T)	4 D 56	51	12/87 → 05/93	 	 bal. shaft	SVB171115 TB268 TB359 TBK067 TBK069 SVB13780	17x1115 83x19 163x25.4 13x780



kw



MITSUBISHI

...MITSUBISHI

...L 200 (K__T)

2.5 TD 4WD (K34T)	4 D 56 T	64	11/92 → 08/96	⊗		SVB171115	17x1115
				⊗	→05/93	TB268	83x19
				⊗	06/93→	TB490	99x19
				⊗	→05/93	TB359	163x25.4
				⊗	06/93→	TB489	163x25.4
				⊗	→05/93, bal. shaft	TBK067	
				⊗	→05/93	TBK069	
				⊗	06/93→	TBK311	
				⊗		SVB13780	13x780
2.5 TD 4WD (K74T)	4 D 56 T	85	09/01 →	⊗	→11/05	SVB13875	13x875
				⊗	→11/05	SVB101075	10x1075
				⊗	→11/05	TB490	99x19
				⊗	→11/05	TB489	163x25.4
				⊗	→11/05	TBK311	
				⊗	→11/05	MVB1125R4	4PK1125
2.5 TD 4x4		74	11/01 →	⊗	→11/05	SVB13875	13x875
				⊗	→11/05	SVB101075	10x1075
				⊗	→11/05	TB490	99x19
				⊗	→11/05	TB489	163x25.4
				⊗	→11/05	TBK311	
				⊗	→11/05	MVB1125R4	4PK1125
2.5 TD 4x4 (K74T)		73	06/96 →	⊗	→11/05	SVB13875	13x875
				⊗	→11/05	SVB101075	10x1075
				⊗	→11/05	TB490	99x19
				⊗	→11/05	TB489	163x25.4
				⊗	→11/05	TBK311	
				⊗	→11/05	MVB1125R4	4PK1125
2.6 4WD (K33T)	G54B	76	11/89 → 05/95	⊗	→05/92	SVB10940	10x940
				⊗	→05/92	SVB13750	13x750

L 300 Box (L03_P)

1.6 (L032P, L062P)	4G32	48	05/80 → 10/86	⊗		SVB10940	10x940
				⊗	→03/82	TB173	120x19
				⊗	04/82→	TB360	120x19
1.8		60	03/83 → 10/86	⊗		SVB10960	10x960
				⊗		TB302	55x12.7
				⊗		TB213	122x19
				⊗	bal. shaft	TBK060	
				⊗		SVB13975	13x975
2.3 D (L038P, L068P)	4 D 55	50	09/83 → 10/86	⊗		SVB171115	17x1115
				⊗		TB268	83x19
				⊗		TB359	163x25.4
				⊗	bal. shaft	TBK067	
				⊗		TBK069	
				⊗		SVB13750	13x750

L 300 Box (PO_W, P1_W)

1.6 (P12V, P02V)	4G32	51	11/86 → 05/94	⊗		SVB13950	13x950
				⊗		SVB10940	10x940
				⊗		TB360	120x19
				⊗		SVB13975	13x975
2.0 4x4		63	08/88 → 05/94	⊗		SVB131000	13x1000
				⊗	→04/92	TB302	55x12.7
				⊗	05/92→	TB326	65x12.7
				⊗	→04/92	TB213	122x19
				⊗	05/92→	TB405	122x19
				⊗		SVB13975	13x975





kW



...MITSUBISHI

...L 300 Box (PO_W, P1_W)

2.0 (P03V, P13V)	G63B	64	11/86 →	⊗	→09/99	SVB13950	13x950
				⊗	→05/94	SVB131000	13x1000
				⊗	06/94→09/99	MVB985R4	4PK985
				⊗	→04/92	TB302	55x12.7
				⊗	05/92→09/99	TB326	65x12.7
				⊗	→04/92	TB213	122x19
				⊗	05/92→05/94	TB405	122x19
				⊗	06/94→09/99	TB406	123x29
				⊗	→04/87, bal. shaft	TBK060	
				⊗	→05/94	SVB13975	13x975
2.5 D (P05V, P05W, P15V)	4 D 56	51	11/86 →	⊗	→05/03	SVB13925	13x925
				⊗	→05/03	SVB101090	10x1090
				⊗	→05/93	TB268	83x19
				⊗	06/93→05/03	TB490	99x19
				⊗	→05/93	TB359	163x25.4
				⊗	06/93→05/03	TB489	163x25.4
				⊗	→05/93, bal. shaft	TBK067	
				⊗	→05/93	TBK069	
				⊗	06/93→05/03	TBK311	
				⊗	→05/03	SVB13750	13x750
2.5 TD 4x4		64	11/91 → 05/03	⊗		SVB13925	13x925
				⊗		SVB101090	10x1090
				⊗	→05/93	TB268	83x19
				⊗	06/93→	TB490	99x19
				⊗	→05/93	TB359	163x25.4
				⊗	06/93→	TB489	163x25.4
				⊗	→05/93, bal. shaft	TBK067	
				⊗	→05/93	TBK069	
				⊗	06/93→	TBK311	
				⊗		SVB13750	13x750

L 300 Bus (LO3_P/G, LO_2P)

1.6 (L032P, L062P)	4G32	48	09/81 → 10/86	⊗		SVB10940	10x940
				⊗	→03/82	TB173	120x19
				⊗	04/82→	TB360	120x19
				⊗		SVB10940	10x940
		51	11/84 → 02/87	⊗		TB360	120x19
				⊗		SVB10960	10x960
				⊗		TB302	55x12.7
				⊗		TB213	122x19
1.8		60	03/83 → 10/86	⊗		TBK060	
				⊗	bal. shaft	SVB13975	13x975
				⊗		SVB10960	10x960
				⊗		TB302	55x12.7
1.8 4x4 (L035G)	4G62	60	08/84 → 02/87	⊗	→10/86	TB213	122x19
				⊗	→10/86	TBK060	
				⊗	→10/86	SVB13975	13x975
				⊗	→10/86, bal. shaft	TB302	55x12.7
				⊗	→10/86	TB213	122x19

L 300 Bus (PO_W, P1_W, P2_W)

2.0 (P00W)		83	07/96 →	⊗	→09/99	SVB13950	13x950
				⊗	→09/99	MVB985R4	4PK985
				⊗	→09/99	TB326	65x12.7
				⊗	→09/99	TB406	123x29
				⊗	→09/99	MVB1050R4	4PK1050



kw



MITSUBISHI

...MITSUBISHI

...L 300 Bus (P0_W, P1_W, P2_W)

2.0 (P03W)	G63B	64	11/86 →	⊗	→09/99	SVB13950	13x950
				⊗	→06/95	SVB131000	13x1000
				⊗	06/95→09/99	MVB985R4	4PK985
				T	→04/92	TB302	55x12.7
				T	05/92→09/99	TB326	65x12.7
				☞	→04/92	TB213	122x19
				☞	05/92→06/95	TB405	122x19
				☞	06/96→09/99	TB406	123x29
				☞KIT	→04/87, bal. shaft	TBK060	
				⊗	→06/95	SVB13975	13x975
				⊗	06/95→09/99	MVB1050R4	4PK1050
2.0 (P03W, P03V, P13V)	4G63	66	11/86 →	⊗	→09/99	SVB13950	13x950
				⊗	→06/95	SVB131000	13x1000
				⊗	06/95→09/99	MVB985R4	4PK985
				T	→04/92	TB302	55x12.7
				T	05/92→09/99	TB326	65x12.7
				☞	→04/92	TB213	122x19
				☞	05/92→06/95	TB405	122x19
				☞	06/96→09/99	TB406	123x29
				☞KIT	→04/87, bal. shaft	TBK060	
				⊗	→06/95	SVB13975	13x975
				⊗	06/95→09/99	MVB1050R4	4PK1050
2.4 (P04W, P14V, P04V)	4G64	82	11/90 →	⊗	→05/96	SVB131000	13x1000
				T	→04/92	TB302	55x12.7
				T	05/92→05/96	TB326	65x12.7
				☞	→04/92	TB356	123x19
				☞	05/92→05/96	TB404	123x19
				☞KIT	→04/92	TBK292	
				⊗	→05/96	SVB13975	13x975
2.4 4WD (P24W, P24V)	G64B	80	11/86 → 12/90	⊗		SVB131000	13x1000
				T		TB302	55x12.7
				☞		TB356	123x19
				☞KIT		TBK292	
				⊗		SVB13975	13x975
	4G64	82	11/90 →	⊗	→05/96	SVB131000	13x1000
				T	→04/92	TB302	55x12.7
				T	05/92→05/96	TB326	65x12.7
				☞	→04/92	TB356	123x19
				☞	05/92→05/96	TB404	123x19
				☞KIT	→04/92	TBK292	
				⊗	→05/96	SVB13975	13x975
2.5 D (P05W, P05V, P15V)	4 D 56	51	11/86 →	⊗	→05/03	SVB13925	13x925
				⊗	→05/03	SVB101090	10x1090
				T	→05/93	TB268	83x19
				T	06/93→05/03	TB490	99x19
				☞	→05/93	TB359	163x25.4
				☞	06/93→05/03	TB489	163x25.4
				☞KIT	→05/93, bal. shaft	TBK067	
				☞KIT	→05/93	TBK069	
				☞KIT	06/93→05/03	TBK311	
				⊗	→05/03	SVB13750	13x750
2.5 TD 4WD (P25W, P25V)	4 D 56 T	64	11/88 →	⊗	→05/03	SVB13925	13x925
				⊗	→05/03	SVB101090	10x1090
				T	→05/93	TB268	83x19
				T	06/93→05/03	TB490	99x19
				☞	→05/93	TB359	163x25.4
				☞	06/93→05/03	TB489	163x25.4
				☞KIT	→05/93, bal. shaft	TBK067	
				☞KIT	→05/93	TBK069	
				☞KIT	06/93→05/03	TBK311	
				⊗	→05/03	SVB13750	13x750



kW



...MITSUBISHI

L 300 Flatbed / Chassis (L03_P)

1.6 (L062P)	4G32	51	04/83 → 04/94			SVB10940	10x940
						TB360	120x19
2.5 D (L039P)	4 D 56	51	11/86 → 04/94			SVB13925	13x925
						SVB101090	10x1090
					→05/93	TB268	83x19
					06/93→	TB490	99x19
					→05/93	TB359	163x25.4
					06/93→	TB489	163x25.4
					→05/93, bal. shaft	TBK067	
					→05/93	TBK069	
					06/93→	TBK311	
						SVB13750	13x750

L 300 Flatbed / Chassis (P1_T)

2.0 (P13T)	4 G 63	85	07/94 →		→09/99	MVB985R4	4PK985
					→09/99	TB326	65x12.7
					→09/99	TB406	123x29
					→09/99	MVB1050R4	4PK1050
2.5 D (P15T)		64	11/94 →		→09/99	SVB101100	10x1100
					→09/99	TB490	99x19
					→09/99	TB489	163x25.4
					→09/99	TBK311	
					→09/99	MVB1125R4	4PK1125

L 400 Box (PAOV)

2.0	4G63	85	06/96 → 03/01			MVB940R4	4PK940
						MVB985R4	4PK985
						TB326	65x12.7
						TB406	123x29
						MVB1050R4	4PK1050
2500 TD	4 D 56 T	64	09/96 →		→09/02	SVB13900	13x900
					→09/02	SVB101100	10x1100
					→09/02	TB490	99x19
					→09/02	TB489	163x25.4
					→09/02	MVB1080R4	4PK1080
2500 TD 4x4		64	09/96 →		→09/02	SVB13900	13x900
					→09/02	SVB101100	10x1100
					→09/02	TB490	99x19
					→09/02	TB489	163x25.4
					→09/02	MVB1080R4	4PK1080

L 400 Bus (PAOV)

2500 TD	4 D 56 T	64	06/96 →		→09/02	SVB13900	13x900
					→09/02	SVB101100	10x1100
					→09/02	TB490	99x19
					→09/02	TB489	163x25.4
					→09/02	MVB1080R4	4PK1080

LANCER Estate (CS_W)

1.6	4G18	72	09/03 →		→03/07	MVB900R5	5PK900
					→03/07	TB786	109x25
					→03/07	MVB1060R5	5PK1060
2.0	4 G 63	99	09/03 →		→03/07	MVB1833R6	6PK1833
					→03/07	TB325	153x29

LANCER III (C1_A, C6_A)

1.2 (C65A)	4G16	44	08/86 → 04/88			MVB870R4	4PK870
					→05/87	TB160	92x19
					06/87→	TB518	92x19
					06/87→	TBK291	
1.2 GL (C15AS)	4G16	40	01/84 → 10/86		05/84→	MVB870R4	4PK870
					05/84→	TB160	92x19



kw



MITSUBISHI

...MITSUBISHI

...LANCER III (C1_A, C6_A)

1.5 GLX (C12AS)	G15B	51	06/85 → 04/88	⊗	Cat(-)	MVB870R4	4PK870
				⊗	Cat(+)	MVB875R4	4PK875
				Ⓜ	→05/87	TB160	92x19
	4 G 15	55	11/83 → 04/88	Ⓜ	06/87→	TB518	92x19
				Ⓜ	06/87→	TBK291	
				Ⓜ	06/87→	TBK291	
1.8 Diesel (C14AS)	4 D 65	43	01/84 → 09/86	⊗		SVB131000	13x1000
				Ⓜ		TB302	55x12.7
				Ⓜ		TB267	157x32
	44	09/86 → 04/88	⊗		SVB13675	13x675	
			Ⓜ		SVB131000	13x1000	
			Ⓜ		TB302	55x12.7	
			Ⓜ		TB267	157x32	
			⊗		SVB13625	13x625	

LANCER III Station Wagon (C1_V, C3_V)

1.5 (C12V)	G15B	51	09/85 → 08/89	⊗		MVB870R4	4PK870
				Ⓜ	→06/87	TB160	92x19
				Ⓜ	06/86→	TB518	92x19
	4 G 15	55	09/85 → 12/87	⊗		SVB13625	13x625
				Ⓜ	→06/87	MVB870R4	4PK870
				Ⓜ	06/86→	TB160	92x19
61	09/88 → 12/90	⊗		TB518	92x19		
		Ⓜ	→05/90	SVB13625	13x625		
		Ⓜ	06/90→	MVB870R4	4PK870		
			Ⓜ		TB518	92x19	
			Ⓜ		TB366	92x22	
			⊗		SVB13625	13x625	
1.5 12V (C12V)	4G15 (12V)	66	09/90 → 12/91	⊗	Cat(-)	MVB870R4	4PK870
				⊗	Cat(+)	MVB875R4	4PK875
				Ⓜ		TB366	92x22
			⊗		SVB13625	13x625	
1.8 4x4 (C37V)	G37B	61	01/87 → 08/89	⊗		MVB940R4	4PK940
				Ⓜ		TB360	120x19
				⊗		SVB13625	13x625
	4G37	66	01/87 → 12/87	⊗		MVB940R4	4PK940
				Ⓜ		TB360	120x19
				⊗		SVB13625	13x625
63	03/89 → 12/90	⊗		MVB940R4	4PK940		
		Ⓜ		TB360	120x19		
		⊗		SVB13625	13x625		
69	08/90 → 06/92	⊗		MVB940R4	4PK940		
		Ⓜ		TB360	120x19		
		⊗		SVB13625	13x625		
1.8 D (C14V)	4 D 65	43	09/85 → 09/86	⊗		SVB131000	13x1000
				Ⓜ		TB302	55x12.7
				Ⓜ		TB267	157x32
	44	08/86 → 06/92	⊗	→05/86	SVB13675	13x675	
			⊗	06/86→	SVB13625	13x625	
			⊗		SVB131000	13x1000	
			Ⓜ		TB302	55x12.7	
			Ⓜ		TB267	157x32	
			⊗		SVB13625	13x625	

LANCER IV (C6_A, C7_A)

1.3 12V (C61A)	4 G 13 (12V)	55	06/92 → 05/94	⊗	→07/93	MVB870R4	4PK870
				Ⓜ	→07/93	TB366	92x22
				⊗	→07/93	SVB13625	13x625



kW



...MITSUBISHI

...LANCER IV (C6_A, C7_A)

1.5	4 G 15	62	06/88 → 05/92	 	Cat(-) Cat(+) →05/90 06/90→	MVB870R4 MVB875R4 TB518 TB366 SVB13625	4PK870 4PK875 92x19 92x22 13x625
1.5 12V (C62A)	4G15 (12V)	66	05/89 → 05/92	 	Cat(-) Cat(+) →05/90 06/90→	MVB870R4 MVB875R4 TB518 TB366 SVB13625	4PK870 4PK875 92x19 92x22 13x625
1.6 16V (C66A)	4 G 92	83	06/92 → 05/94	 	→11/93 →11/93 →11/93	MVB775R4 TB379 MVB950R5	4PK775 117x29 5PK950
1.8 4x4 (C77A)	4G37	71	09/89 → 06/92	 		MVB940R4 TB360 SVB13625	4PK940 120x19 13x625
1.8 D (C64A)	4 D 65	44	04/88 → 05/92	 		SVB131000 TB302 TB267 SVB13655	13x1000 55x12.7 157x32 13x655
1.8 GTi 16V (C68A)	4G67	100	11/89 → 05/92	 	06/90→ 06/90→ 06/90→	MVB775R4 TB379 MVB950R5	4PK775 117x29 5PK950
2.0 D		50	06/92 → 07/93	 		SVB131000 SVB131025 TB671 SVB13625	13x1000 13x1025 158x32 13x625

LANCER IV Saloon (C6_A)

1.3 (C61A)	G13B	51	08/88 → 05/92	 	→05/90 06/90→	MVB870R4 TB518 TB366 SVB13625	4PK870 92x19 92x22 13x625
	4 G 13	44	04/88 → 05/92	 	→05/90 06/90→	MVB870R4 TB518 TB366 SVB13625	4PK870 92x19 92x22 13x625
1.3 12V (C61A)	4 G 13 (12V)	55	01/91 → 06/92	 		MVB870R4 TB366 SVB13625	4PK870 92x22 13x625
1.5 (C62A)	4 G 15	62	04/88 → 05/92	 	Cat(-) Cat(+) →05/90 06/90→	MVB870R4 MVB875R4 TB518 TB366 SVB13625	4PK870 4PK875 92x19 92x22 13x625
1.5 12V (C62A)	4G15 (12V)	66	05/89 → 05/92	 	Cat(-) Cat(+) →05/90 06/90→	MVB870R4 MVB875R4 TB518 TB366 SVB13625	4PK870 4PK875 92x19 92x22 13x625
1.8 GLX Diesel (C64A)	4 D 65	44	04/88 → 05/92	 		SVB131000 TB302 TB267 SVB13655	13x1000 55x12.7 157x32 13x655

LANCER Saloon

1.5	4A91	80	06/08 →		A/C(+)	MVB1188R5	5PK1188
2.0 DI-D		103	01/08 →			MVB1715R6	6PK1715



kW



MITSUBISHI

...MITSUBISHI

LANCER Saloon (CS_A)

1.3		60	09/03 →		→08/05	MVB900R5	5PK900
					→08/05	TB786	109x25
					→08/05	MVB1060R5	5PK1060
1.6	4G18	72	09/03 →		→03/07	MVB900R5	5PK900
					→03/07	TB786	109x25
					→03/07	MVB1060R5	5PK1060
2.0	4 G 63	99	12/03 →		→03/07	MVB1833R6	6PK1833
					→03/07	TB325	153x29
2.0 4x4		213	08/05 →		→08/07	MVB1795R6	6PK1795
					→08/07	TB326	65x12.7
2.0 16V EVO IX		206	01/06 →		→08/07	MVB1795R6	6PK1795
					→08/07	TB326	65x12.7
2.0 16V EVO VIII		195	03/04 →		→07/05	MVB1795R6	6PK1795
					→07/05	TB326	65x12.7
					→07/05	TB325	153x29

LANCER V (CB/D_A)

1.3 (CB1A)	4 G 13 (BJ92-..., 12V)	55	06/92 →		08/93→02/96	SVB13800	13x800
					08/93→02/96	MVB875R4	4PK875
					08/93→02/96	TB366	92x22
					08/93→11/93	SVB13610	13x610
					12/93→02/96	MVB588R4	4PK588
1.6		66	02/94 →		MS, →02/96	MVB875R5	5PK875
					PS, →02/96	MVB1120R5	5PK1120
					→02/96	MVB775R4	4PK775
					→02/96	TB379	117x29
					→02/96	MVB950R5	5PK950
1.6 16V (CB4A)	4 G 92	83	06/92 →		MS, 08/93→11/93	MVB850R5	5PK850
					MS, 12/93→02/96	MVB875R5	5PK875
					PS, 08/93→11/93	MVB1110R5	5PK1110
					PS, 12/93→02/96	MVB1120R5	5PK1120
						MVB775R4	4PK775
					08/93→02/96	TB379	117x29
					09/95→08/03	TB492	111x29
					08/93→02/96	MVB950R5	5PK950
					A/C(+), 09/95→08/03	MVB1300R5	5PK1300
1.6 16V 4WD (CD4A)	4 G 92	83	06/92 →		08/93→08/95	MVB775R4	4PK775
					08/93→08/95	TB379	117x29
1.8 16V (CB5A)	4G93	103	06/92 → 12/93		MS, 08/93→	MVB850R5	5PK850
					PS, 08/93→	MVB1110R5	5PK1110
					08/93→	MVB763R4	4PK763
					08/93→	TB380	156x29
					A/C(-), 08/93→	MVB950R5	5PK950
2.0 Diesel (CB8A)	4 D 68	50	06/92 →		08/93→08/95	SVB13950	13x950
					08/93→08/95	SVB131025	13x1025
					08/93→08/95	TB326	65x12.7
					08/93→08/95	TB671	158x32
					08/93→08/95	MVB640R4	4PK640

LANCER V Station Wagon (CB_W, CD_W)

1.6 16V (CB4W)	4 G 92	83	12/92 → 10/03			MVB1120R5	5PK1120
						MVB775R4	4PK775
						TB379	117x29
						MVB950R5	5PK950
1.6 16V 4WD (CD4W)	4 G 92	83	12/92 → 10/03			MVB1120R5	5PK1120
						MVB775R4	4PK775
						TB379	117x29
						MVB950R5	5PK950
2.0 D (CB8W)	4 D 68	50	12/92 → 10/03			SVB13950	13x950
						SVB131025	13x1025
						TB326	65x12.7
						TB671	158x32
						MVB640R4	4PK640





kW



...MITSUBISHI

LANCER VI (CK/P_A)

1.3 12V (CK1A)	4 G 13 (12V)	55	12/95 → 08/03	 	→07/01 →07/01 A/C(-), →07/01 A/C(+), →07/01	MVB865R5 TB491 MVB950R5 MVB1073R5	5PK865 107x25.4 5PK950 5PK1073
1.5 16V (CK2A)	4 G 15 (16V)	69	12/95 → 08/03	 	→03/96 04/96→10/00	MVB869R5 MVB865R5 TB491 MVB1073R5 MVB950R5	5PK869 5PK865 107x25.4 5PK1073 5PK950
2.0 16V EVO VI / VII (CP9A)	4 G 63 Turbo	206	01/99 → 08/03	 	A/C(-), →04/01 A/C(+), →04/01 →04/01 →04/01	MVB1440R6 MVB1775R6 TB326 TB325	6PK1440 6PK1775 65x12.7 153x29

MIRAGE Coupe

1.5		81	09/95 → 08/99	 		MVB865R5 MVB1073R5	5PK865 5PK1073
-----	--	----	---------------	------	--	-------------------------------------	-------------------

MIRAGE Hatchback

1.5		64	10/83 → 08/86	 		MVB875R4 TB518 TBK291	4PK875 92x19
		81	09/95 → 08/99	 		MVB865R5 MVB1073R5	5PK865 5PK1073

OUTLANDER

2.0 4WD		177	05/03 →	 	04/04→10/06 04/04→10/06 04/04→10/06	MVB1833R6 TB326 TB325	6PK1833 65x12.7 153x29
2.0 DI-D	BSY	103	02/07 →	 		MVB1715R6 TB743	6PK1715 141x30
2.0 Turbo 4WD		148	04/04 →	 	→10/06 →10/06 →10/06	MVB1833R6 TB326 TB325	6PK1833 65x12.7 153x29
2.2 DI-D		115	08/07 →		A/C(+)	MVB1740R6	6PK1740
2.4 4WD	4G69	118	11/03 →	 	A/C(+), →10/06 →10/06	MVB1885R6 TB326	6PK1885 65x12.7
		119	05/03 →	 	A/C(+), →10/06 →10/06	MVB1885R6 TB326	6PK1885 65x12.7

PAJERO CLASSIC (V2_W)

2.5 TD		85	07/02 →	 	→08/06 →08/06 →08/06 →08/06 →08/06	SVB13975 MVB1369R6 TB490 TB489 TBK311	13x975 6PK1369 99x19 163x25.4
3.2 DI-D		118	05/05 →	 	→08/06 →08/06	SVB13925 SVB10960	13x925 10x960

PAJERO I (L04_G, L14_G)

2.5 TD (L044G, L049G)	4 D 56 T	64	01/90 → 12/91	 	→02/91 →02/91 →02/91, bal. shaft →02/91	TB268 TB359 TBK067 TBK069	83x19 163x25.4
3.0 V6 (L141G, L146G)	6G72	104	11/88 → 11/90	 	→02/91	SVB13780 SVB13925 MVB1345R5 TB401 SVB13800	13x780 13x925 5PK1345 149x25.4 13x800



kw



MITSUBISHI

...MITSUBISHI

PAJERO I Open Off-Road Vehicle (L04_G)

2.3 TD (L043G, L048G)	4 D 55 T	62	12/82 → 04/86	 	bal. shaft	SVB171115 17x1115 TB268 83x19 TB359 163x25.4 TBK067 TBK069 SVB13780 13x780
2.5 TD (L044G, L049G)	4 D 56 T	62	05/86 → 10/89	 	11/88 →, bal. shaft	TB268 83x19 TB359 163x25.4 TBK069 TBK067 SVB13780 13x780
2.6 (L042G, L047G)	4G54	76	01/83 → 11/90	 	Cat(-) Cat(+)	SVB10940 10x940 SVB13950 13x950 SVB13750 13x750

PAJERO II (V2_W, V4_W)

2.4	4G64	82	04/91 → 04/00	 	→08/94 →04/92 05/92 →08/94 →04/92 05/92 →08/94 →04/92	SVB131000 13x1000 TB302 55x12.7 TB326 65x12.7 TB356 123x19 TB404 123x19 TBK292
2.5 TD (V24C, V24W)	4 D 56 TD	73	12/90 → 04/00	 	→08/99 12/98 → →10/93 11/93 → →10/93 11/93 → →10/93 11/93 → →10/93, bal. shaft →10/93 11/93 → →10/93 11/93 →	SVB13925 13x925 SVB13825 13x825 SVB171115 17x1115 SVB101075 10x1075 TB268 83x19 TB490 99x19 TB359 163x25.4 TB489 163x25.4 TBK067 TBK069 TBK311 SVB131150 13x1150 MVB1125R4 4PK1125
2.8 TD (V46W)	4 M 40	92	06/94 → 04/00	 	→08/99 →08/99	SVB13950 13x950 SVB10975 10x975
3.0 V6 (V23W, V43W, V23C)	6G72	110	12/90 → 12/95	 	→05/94 06/94 → →05/94 06/94 → →05/94 06/94 →	SVB13925 13x925 MVB1345R5 5PK1345 MVB1135R5 5PK1135 TB401 149x25.4 TB673 187x32 SVB13800 13x800 MVB960R4 4PK960
3.0 V6 24V	6G72	133	06/94 → 05/97	 	→08/99 11/97 →	SVB13925 13x925 MVB1135R5 5PK1135 TB673 187x32 MVB960R4 4PK960 SVB13925 13x925 SVB13875 13x875 MVB1135R5 5PK1135 TB673 187x32 MVB960R4 4PK960 MVB970R4 4PK970
3.5 V6 24V	6G72	143	07/97 → 04/00	 	→08/99 →08/99 →08/99 →01/99 02/99 →08/99	SVB13925 13x925 MVB1135R5 5PK1135 TB694 195x32 MVB995R4 4PK995 MVB1000R4 4PK1000





kw



...MITSUBISHI

...PAJERO II (V2_W, V4_W)

3.5 V6 24V (V25W, V45W)	6G74 DOHC	153	06/94 → 04/00	⚙️	→08/99	SVB13925	13x925
				⚙️	→08/99	MVB1135R5	5PK1135
				🔧	→05/97	TB550	265x32
				🔧	06/97→08/99	TB694	195x32
				⊕	→05/97	MVB1065R4	4PK1065
				⊕	02/99→08/99	MVB1000R4	4PK1000
				⊕	06/97→01/99	MVB995R4	4PK995

PAJERO II Open Off-Road Vehicle (V2_W, V4_W)

2.4	4G64	82	04/91 → 04/00	⚙️	→08/94	SVB131000	13x1000
				⚙️	→04/92	TB302	55x12.7
				⚙️	05/92→08/94	TB326	65x12.7
				🔧	→04/92	TB356	123x19
				🔧	05/92→08/94	TB404	123x19
				🔧KIT	→04/92	TBK292	
2.5 TD (V24C, V24W)	4 D 56 TD	73	12/90 → 04/00	⚙️	→08/99	SVB13925	13x925
				⚙️	→10/93	SVB171115	17x1115
				⚙️	11/93→08/99	SVB101075	10x1075
				⚙️	11/93→08/99	SVB101090	10x1090
				⚙️	→10/93	TB268	83x19
				⚙️	11/93→08/99	TB490	99x19
				🔧	→10/93	TB359	163x25.4
				🔧	11/93→08/99	TB489	163x25.4
				🔧KIT	→10/93, bal. shaft	TBK067	
				🔧KIT	→10/93	TBK069	
				🔧KIT	11/93→08/99	TBK311	
				⊕	→10/93	SVB131138	13x1138
				⊕	→10/93	SVB131150	13x1150
				⊕	11/93→08/99	MVB1125R4	4PK1125
3.0 V6 (V23W, v43W, V23C)	6G72	110	12/90 → 12/95	⚙️		SVB13925	13x925
				⚙️	→05/94	MVB1345R5	5PK1345
				⚙️	06/94→	MVB1135R5	5PK1135
				🔧	→05/94	TB401	149x25.4
				🔧	06/94→	TB673	187x32
				⊕	→05/94	SVB13800	13x800
				⊕	06/94→	MVB960R4	4PK960
3.0 V6 24V		133	06/94 → 04/00	⚙️	→08/99	SVB13925	13x925
				⚙️	→08/99	MVB1135R5	5PK1135
				🔧	→08/99	TB673	187x32
				⊕	→02/99	MVB960R4	4PK960
				⊕	02/99→08/99	MVB970R4	4PK970

PAJERO III (V60, V70)

2.5 TDi (V64W, V74W)		85	09/01 →	⚙️	→08/06	SVB13975	13x975
				⚙️	→08/06	MVB1369R6	6PK1369
				⚙️	→08/06	TB490	99x19
				🔧	→08/06	TB489	163x25.4
				🔧KIT	→08/06	TBK311	
3.2 DI-D (V68W, V78W)	4M41	121	04/00 → 10/01	⚙️		SVB13925	13x925
				⚙️		SVB10960	10x960
		118	10/01 →	⚙️	→08/06	SVB13925	13x925
				⚙️	→08/06	SVB10960	10x960
3.5 V6 GDI (V65W, V75W)		149	04/00 →	⚙️	A/C(+), →08/06	MVB2418R7	7PK2418
				🔧	→08/06	TB550	265x32

PAJERO PININ (H6_W, H7_W)

1.8	4G93	84	11/01 →	⚙️	→02/05	MVB775R4	4PK775
				🔧	→02/05	TB493	116x29
				⊕	A/C(-), →02/05	MVB1090R5	5PK1090
				⊕	A/C(+), →02/05	MVB1330R5	5PK1330
				⊕	A/C(+), →02/05	MVB1345R5	5PK1345



kw



MITSUBISHI

...MITSUBISHI

...PAJERO PININ (H6_W, H7_W)

1.8 GDI (H66W)		88	10/99 →	⊗	→02/05	MVB775R4	4PK775
				⊗	09/01→02/05	TB493	116x29
				⊗	A/C(-), →02/05	MVB1090R5	5PK1090
				⊗	A/C(+), →02/05	MVB1330R5	5PK1330
				⊗	A/C(+), →02/05	MVB1345R5	5PK1345
2.0 GDI (H67W, H77W)	4G94	95	10/00 →	⊗	10/01→02/05	MVB775R4	4PK775
				⊗	10/01→02/05	TB718	159x29
				⊗	A/C(-), 10/01→02/05	MVB1090R5	5PK1090
				⊗	A/C(+), 10/01→02/05	MVB1345R5	5PK1345

PAJERO SPORT (K90)

2.5 TD	4 D 56 T	73	11/98 →	⊗		SVB13825	13x825
				⊗	09/99→08/06	SVB13975	13x975
				⊗		SVB101075	10x1075
				⊗	09/99→08/06	MVB1369R6	6PK1369
				⊗		TB490	99x19
				⊗		TB489	163x25.4
				⊗		TBK311	
				⊗		MVB1125R4	4PK1125
		85	07/02 →	⊗		SVB13825	13x825
				⊗	→08/06	SVB13975	13x975
				⊗		SVB101075	10x1075
				⊗	→08/06	MVB1369R6	6PK1369
				⊗		TB490	99x19
				⊗		TB489	163x25.4
				⊗		TBK311	
				⊗		MVB1125R4	4PK1125
		98	08/03 →	⊗		SVB13825	13x825
				⊗		SVB101075	10x1075
				⊗		TB490	99x19
				⊗		TB489	163x25.4
				⊗		TBK311	
				⊗		MVB1125R4	4PK1125
3.0 V6		130	11/98 →	⊗		SVB13875	13x875
				⊗		MVB1135R5	5PK1135
				⊗		TB673	187x32
				⊗		MVB970R4	4PK970
				⊗	→01/99	MVB960R4	4PK960
		125	06/00 →	⊗		SVB13875	13x875
				⊗	→08/03	MVB1135R5	5PK1135
				⊗		TB673	187x32
				⊗		MVB970R4	4PK970

SANTAMO

2.0 16V		102	05/99 →	⊗	→10/03	MVB960R4	4PK960
				⊗	→10/03	MVB995R4	4PK995
				⊗	→10/03	TB326	65x12.7
				⊗	→10/03	TB325	153x29
				⊗	→10/03	SVB13675	13x675
2.0 16V 4x4		102	05/99 →	⊗	→10/03	MVB960R4	4PK960
				⊗	→10/03	MVB995R4	4PK995
				⊗	→10/03	TB326	65x12.7
				⊗	→10/03	TB325	153x29
				⊗	→10/03	SVB13675	13x675

SAPPORO III (E16A)

2.4 (E16A)	4G64	91	06/87 → 08/90	⊗		MVB975R4	4PK975
				⊗		TB302	55x12.7
				⊗		TB356	123x19
				⊗		TBK292	
				⊗	bal. shaft	TBK060	
				⊗		SVB13655	13x655





kW



...MITSUBISHI

SIGMA (F16A)

3.0 V6 (F16A)	6G72	130	12/90 → 07/96	 	A/C(-) A/C(+)	MVB1065R6 MVB1150R6 TB403 SVB13925	6PK1065 6PK1150 257x32 13x925
		151	12/90 → 07/96	 	→11/91 12/91→ A/C(-) A/C(+) →11/91 12/91→	MVB920R4 MVB1065R6 MVB1150R6 TB403 SVB13925 MVB920R4	4PK920 6PK1065 6PK1150 257x32 13x925 4PK920

SIGMA Station Wagon (F07W)

3.0 (V6)	6G72	125	01/93 → 07/96	 		MVB940R4 MVB960R4 MVB1240R5 TB401 SVB13925	4PK940 4PK960 5PK1240 149x25.4 13x925
----------	------	-----	---------------	------------------	--	--	---

SPACE GEAR (PA/B/D_V/W)

2.0 16V (PA3V/W, PB3V)	4 G 63	85	05/95 → 05/00	 		MVB940R4 MVB985R4 TB326 TB406	4PK940 4PK985 65x12.7 123x29
		83	08/96 → 05/00	 		MVB1050R4 MVB940R4 MVB985R4 TB326 TB406	4PK1050 4PK940 4PK985 65x12.7 123x29
2.4 i (PA4W)	4G64	97	05/95 → 05/00	 		MVB940R4 MVB985R4 TB326 TB407	4PK940 4PK985 65x12.7 124x29
				 		MVB1050R4	4PK1050
2.4 i 4x4 (PD4V/W)	4G64	97	05/95 → 05/00	 		MVB940R4 MVB985R4 TB326 TB407	4PK940 4PK985 65x12.7 124x29
				 		MVB1050R4	4PK1050
2.5 TD (PA5V/W, PB5V)	4 D 56 T	64	05/95 → 05/00	 		SVB13900 SVB101100 TB490 TB489	13x900 10x1100 99x19 163x25.4
				 		TBK311	
	4 D 56 TD	73	05/95 → 05/00	 		MVB1080R4 SVB13900 SVB101100 TB490 TB489	4PK1080 13x900 10x1100 99x19 163x25.4
				 		TBK311	
2.5 TD 4x4 (PD5V/W)	4 D 56 TD	73	05/95 → 05/00	 		MVB1080R4 SVB13900 SVB101100 TB490 TB489	4PK1080 13x900 10x1100 99x19 163x25.4
				 		TBK311	
				 		MVB1080R4	4PK1080



kW



MITSUBISHI

...MITSUBISHI

SPACE RUNNER (N1_W, N2_W)

1.8 (N11W)	4G93	90	10/91 → 08/99	⊗	→06/93	MVB763R4	4PK763		
				⊗	06/93→	MVB775R4	4PK775		
				☺		TB381	121x29		
				⊗	A/C(-), →06/92	MVB950R5	5PK950		
				⊗	A/C(-), 07/92→	MVB925R5	5PK925		
		85	06/96 → 08/99	⊗		MVB1148R5	5PK1148		
				☺		MVB775R4	4PK775		
				☺		TB381	121x29		
				⊗	A/C(-)	MVB925R5	5PK925		
				⊗	A/C(+)	MVB1148R5	5PK1148		
1.8 4x4 (N21W)	4G93	90	10/91 → 08/99	⊗	→06/93	MVB763R4	4PK763		
				⊗	06/93→	MVB775R4	4PK775		
				☺		TB381	121x29		
				⊗	A/C(-), →06/92	MVB950R5	5PK950		
				⊗	A/C(-), 07/92→	MVB925R5	5PK925		
		2.0 TD (N18W)	4D68 T	60	10/92 → 08/99	☼		MVB1148R5	5PK1148
						⊗		SVB13950	13x950
						⊗		SVB131025	13x1025
						☺		TB326	65x12.7
						☺		TB671	158x32

SPACE RUNNER (N50)

2.0	4 G 63	100	08/99 →	⊗	→04/03	MVB938R5	5PK938
				☺	→04/03	TB326	65x12.7
				☺	→04/03	TB540	122x29
				⊗	A/C(-), →04/03	MVB1090R5	5PK1090
				⊗	A/C(+), →04/03	MVB1388R5	5PK1388
2.4 GDI	4G64 (GDI)	110	08/99 →	⊗	→04/03	MVB938R5	5PK938
				☺	→04/03	TB326	65x12.7
				☺	→04/03	TB788	154x29
				⊗	A/C(-), →04/03	MVB1090R5	5PK1090
				⊗	A/C(+), →04/03	MVB1388R5	5PK1388

SPACE STAR (DGO)

1.3 16V	4 G 13 (16 V)	63	06/98 →	⊗	→03/06	MVB865R5	5PK865
				☺	→03/06	TB786	109x25
				⊗	A/C(-), →03/06	MVB960R5	5PK960
				⊗	A/C(+), →03/06	MVB1060R5	5PK1060
				61	12/98 →	⊗	→03/06
		☺	→03/06			TB786	109x25
		⊗	A/C(-), →03/06			MVB960R5	5PK960
		⊗	A/C(+), →03/06			MVB1060R5	5PK1060
		60	09/00 →			⊗	→03/06
				☺	→03/06	TB786	109x25
⊗	A/C(-), →03/06			MVB960R5	5PK960		
⊗	A/C(+), →03/06			MVB1060R5	5PK1060		
1.6 16V	4G18			72	09/01 →	⊗	→03/06
		☺	→03/06			TB786	109x25
		⊗	A/C(-), →03/06			MVB960R5	5PK960
		⊗	A/C(+), →03/06			MVB1060R5	5PK1060



kW



...MITSUBISHI

...SPACE STAR (DGO)

1.8 GDI	4G93	90	06/98 →	⊗	→03/06, Cold climates (-)	MVB775R4	4PK775
				⊗	→03/06, Cold climates (+)	MVB775R4	4PK775
					→08/02	TB684	154x29
					09/02→03/06	TB493	116x29
				⊕	A/C(-), →03/06	MVB1090R5	5PK1090
				⊕	A/C(+), →03/06	MVB1345R5	5PK1345
87	06/98 →	87	06/98 →	⊗	→03/06, Cold climates (-)	MVB775R4	4PK775
				⊗	→03/06, Cold climates (+)	MVB775R4	4PK775
					→08/02	TB684	154x29
					09/02→03/06	TB493	116x29
				⊕	A/C(-), →03/06	MVB1090R5	5PK1090
				⊕	A/C(+), →03/06	MVB1345R5	5PK1345
82	10/02 →	82	10/02 →	⊗	→03/06, Cold climates (-)	MVB775R4	4PK775
				⊗	→03/06, Cold climates (+)	MVB775R4	4PK775
					→03/06	TB493	116x29
				⊕	A/C(-), →03/06	MVB1090R5	5PK1090
				⊕	A/C(+), →03/06	MVB1345R5	5PK1345
				1.9 DI-D	F9Q1	75	02/01 →
⊗	A/C(+), →03/06	MVB1795R6	6PK1795				
	→03/06	TB653	132x26				
KIT	→03/06	TBK275					

SPACE WAGON (DO_V/W)

1.8 4x4 (D05V, D05W)	4G37	66	10/87 → 08/88	⊗	PS	MVB940R4	4PK940
						TB302	55x12.7
						TB213	122x19
				⊕		SVB13625	13x625
1.8 GLX (D05V, D05W)	4G37	66	01/84 → 12/88	⊗	MS, →02/85	SVB10940	10x940
				⊗	PS, →02/85	SVB13950	13x950
				⊗	PS, 03/85 →	MVB940R4	4PK940
						TB302	55x12.7
						TB213	122x19
				⊕		SVB13625	13x625
1.8 TD (D09W)	4 D 65 T	55	06/86 → 04/91	⊗		SVB131000	13x1000
						TB302	55x12.7
						TB267	157x32
				KIT	bal. shaft	TBK060	
2.0 4x4 (D08W)	4G63	75	03/85 → 04/91	⊗		SVB13675	13x675
						MVB975R4	4PK975
						TB302	55x12.7
						TB213	122x19
2.0 GLX (D04W)	G63B	62	06/86 → 05/88	⊗		SVB13675	13x675
						MVB975R4	4PK975
						TB302	55x12.7
						TB213	122x19
2.0 GLX 4x4 (D08W)	G63B	62	06/86 → 05/88	⊗		SVB13675	13x675
						MVB975R4	4PK975
						TB302	55x12.7
						TB213	122x19
2.0 GLXi (D04W)	4G63	74	06/88 → 04/91	⊗		SVB13675	13x675
						MVB975R4	4PK975
						TB302	55x12.7
						TB213	122x19
2.0 GLXi 4x4 (D08W)	4G63	74	06/88 → 04/91	⊗		SVB13675	13x675
						MVB975R4	4PK975
						TB302	55x12.7
						TB213	122x19



kw



MITSUBISHI

...MITSUBISHI

SPACE WAGON (N3_W, N4_W)

1.8 (N31W)	4G93	90	10/91 → 10/98	 	→09/95 →09/95 A/C(-), →09/95 A/C(+), →09/95	MVB763R4 TB381 MVB950R5 MVB1148R5	4PK763 121x29 5PK950 5PK1148
1.8 4x4 (N41W)	4G93	90	10/91 → 10/98	 	→09/95 →09/95 A/C(-), →09/95 A/C(+), →09/95	MVB763R4 TB381 MVB950R5 MVB1148R5	4PK763 121x29 5PK950 5PK1148
1.8 TD (N35W)	4 D 65 T	55	10/91 → 10/98	 	→12/93 →12/93 →12/93 →12/93 →12/93 →12/93, bal. shaft →12/93	SVB13925 SVB13950 SVB131000 TB302 TB267 TBK060 SVB13655	13x925 13x950 13x1000 55x12.7 157x32 13x655
2.0 (N33W)	4 G 63	98	10/92 → 10/98	 		MVB925R4 MVB940R4 MVB985R4 TB326 TB406 MVB648R4	4PK925 4PK940 4PK985 65x12.7 123x29 4PK648
2.0 4x4 (N43W)	4 G 63	98	10/92 → 10/98	 		MVB925R4 MVB940R4 MVB985R4 TB326 TB406 MVB648R4	4PK925 4PK940 4PK985 65x12.7 123x29 4PK648
2.0 TD (N38W)	4D68 T	60	10/92 → 10/98	 		SVB13950 SVB131025 TB326 TB671 MVB640R4	13x950 13x1025 65x12.7 158x32 4PK640
2.4 i		102	10/92 → 10/98	 	06/95 →	MVB925R4 MVB985R4 TB326 TB407 MVB648R4	4PK925 4PK985 65x12.7 124x29 4PK648

SPACE WAGON (N5_W)

2.0 GDI		98	04/02 →	 	→05/03 →05/03 →05/03 A/C(-), →05/03 A/C(+), →05/03	MVB938R5 TB326 TB540 MVB1090R5 MVB1388R5	5PK938 65x12.7 122x29 5PK1090 5PK1388
2.4 GDI	4G64 (GDI)	110	10/98 →	 	→05/03 →05/03 →05/03 A/C(-), →05/03 A/C(+), →05/03	MVB938R5 TB326 TB788 MVB1090R5 MVB1388R5	5PK938 65x12.7 154x29 5PK1090 5PK1388
		108	09/00 →	 	→05/03 →05/03 →05/03 A/C(-), →05/03 A/C(+), →05/03	MVB938R5 TB326 TB788 MVB1090R5 MVB1388R5	5PK938 65x12.7 154x29 5PK1090 5PK1388



kW



...MITSUBISHI

...SPACE WAGON (N5_W)

2.4 GDI 4x4	4G64 (GDI)	110	10/98 →		→05/03	MVB938R5	5PK938
					→05/03	TB326	65x12.7
					→05/03	TB788	154x29
					A/C(-), →05/03	MVB1090R5	5PK1090
					A/C(+), →05/03	MVB1388R5	5PK1388
		108	09/00 →		→05/03	MVB938R5	5PK938
					→05/03	TB326	65x12.7
					→05/03	TB788	154x29
					A/C(-), →05/03	MVB1090R5	5PK1090
					A/C(+), →05/03	MVB1388R5	5PK1388

STARION (A18_A)

2.0 Turbo ECi (A183A)	4 G 63 T (ECi)	125	06/82 → 12/85			SVB10975	10x975
						TB302	55x12.7
						TB213	122x19
					bal. shaft	TBK060	
					→02/83	SVB131025	13x1025
					03/83 →	SVB13975	13x975
	4 G 63 T/C	132	05/85 → 08/87			SVB10975	10x975
						TB302	55x12.7
						TB213	122x19
					→04/87, bal. shaft	TBK060	
						SVB13975	13x975
2.6 Turbo ECi (A187A)	G 54 B T/C	114	09/87 → 06/90		→01/88	SVB10940	10x940
					02/88 →	SVB13975	13x975
						SVB13750	13x750

MOSKVICH

407

1.4		33	08/58 →		→09/69	SVB10850	10x850
-----	--	----	---------	--	--------	-----------------	--------

412

1.5		55	03/71 →		10/71 → 09/79	SVB10825	10x825
					10/71 → 09/79	SVB10888	10x888

427 Estate

1.5		55	01/75 →		→09/79	SVB10825	10x825
					→09/79	SVB10888	10x888

2140

1.5		55	07/78 → 11/83		10/79 →	SVB10825	10x825
-----	--	----	---------------	--	---------	-----------------	--------

ASLK 2137 Estate

1.5		55	07/76 →		→08/87	SVB10825	10x825
-----	--	----	---------	--	--------	-----------------	--------

ASLK 2140

1.5		55	03/76 →		10/79 → 10/97	SVB10825	10x825
-----	--	----	---------	--	---------------	-----------------	--------

NISSAN

100 NX (B13)

1.6	GA16DS	66	03/90 → 10/94		10/90 →	MVB835R4	4PK835
					MS, 10/90 →	MVB915R4	4PK915
					PS, 10/90 →	MVB800R4	4PK800
					10/90 →	MVB810R4	4PK810
1.6 SR	GA16DE	75	09/93 → 10/94			MVB835R4	4PK835
					MS	MVB915R4	4PK915
					PS	MVB800R4	4PK800
						MVB810R4	4PK810
2.0 GTI	SR20DE	105	03/91 → 10/94		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1035R6	6PK1035
						MVB845R4	4PK845



kW



NISSAN

...NISSAN

200 SX (S13)

1.8		99	09/88 → 03/94	☀ ⌚ 🔧 ⊕		MVB845R4 MVB870R4 TB333 MVB838R3	4PK845 4PK870 151x19 3PK838
1.8 Turbo	CA18DET	124	07/88 → 11/93	☀ ⌚ 🔧 ⊕		MVB845R4 MVB870R4 TB333 MVB838R3	4PK845 4PK870 151x19 3PK838

200 SX (S14)

2.0 i 16V Turbo	SR20DET	147	10/93 → 12/99	☀ ⌚ ⊕	04/94 → 04/94 → 04/94 →	MVB875R4 MVB938R5 MVB872R3	4PK875 5PK938 3PK872
-----------------	----------------	-----	---------------	-------------	-------------------------------	---	----------------------------

300 ZX (Z31)

3.0	VG30E	125	01/84 → 12/87	⌚		SVB13925	13x925
3.0 Turbo	VG30ET	149	05/87 → 10/90	☀ ⌚ 🔧 ⊕	→12/89 →12/89 →12/89 →12/89	MVB1420R4 MVB1025R4 TB128 MVB1000R3	4PK1420 4PK1025 133x25.4 3PK1000
	VG30T	168	04/84 → 10/90	☀ ☀ ⌚ 🔧 ⊕ ⊕	→02/87 02/87 →12/89 →12/89 →12/89 →02/87 02/87 →12/89	SVB131425 MVB1420R4 MVB1025R4 TB128 SVB131050 MVB1000R3	13x1425 4PK1420 4PK1025 133x25.4 13x1050 3PK1000

300 ZX (Z32)

3.0 Twin Turbo	VG30DETT	208	05/90 → 09/95	☀ ⌚ 🔧 ⊕		MVB960R4 MVB1040R4 TB626 MVB920R4	4PK960 4PK1040 228x32 4PK920
		197	05/90 → 09/95	☀ ⌚ 🔧 ⊕	→01/94	MVB960R4 MVB1040R4 TB626 MVB920R4	4PK960 4PK1040 228x32 4PK920

350 Z (Z33)

3.5	VQ35DE	206	10/03 →	☀ ⌚ ⊕		MVB950R4 MVB1173R6	4PK950 6PK1173
		221	04/06 →	☀ ⌚		MVB950R4 MVB1173R6	4PK950 6PK1173

350 Z Roadster

3.5	VQ35DE	206	03/05 →	☀ ⌚ ⊕		MVB950R4 MVB1173R6	4PK950 6PK1173
		221	04/06 →	☀ ⌚		MVB950R4 MVB1173R6	4PK950 6PK1173

ALMERA I (N15)

1.4	GA14DE	64	09/95 → 07/00	☀ ⌚ ⌚ ⊕	→12/99 Water pump (-), →12/99 Water pump (+), →12/99 Water pump (+), →12/99	MVB835R4 MVB800R4 MVB915R4 MVB810R4	4PK835 4PK800 4PK915 4PK810
1.4 GX,LX	GA14DE	55	09/95 → 07/00	☀ ⌚ ⌚ ⊕	→12/99 Water pump (-), →12/99 Water pump (+), →12/99 Water pump (+), →12/99	MVB835R4 MVB800R4 MVB915R4 MVB810R4	4PK835 4PK800 4PK915 4PK810
1.6	GA16DE	73	09/95 → 07/00	⌚ ⌚ ⌚ ⊕	A/C(-), →03/00 A/C(+), →04/96 A/C(+), 04/96 →03/00 →03/00	MVB825R4 MVB1125R4 MVB1100R4 MVB810R4	4PK825 4PK1125 4PK1100 4PK810





kW



...NISSAN

...ALMERA I (N15)

1.6 SLX	GA16DE	66	09/95 → 07/00	 	A/C(-), →03/00 A/C(+), →04/96 A/C(+), 04/96→03/00 →03/00	MVB825R4 MVB1125R4 MVB1100R4 MVB810R4	4PK825 4PK1125 4PK1100 4PK810
2.0 D	CD20	55	11/95 → 07/00	 	→03/00 →03/00 →04/96 →04/96 04/96→03/00 →03/00	SVB13850 TB290 TBK053 TB503 TB645 SVB13800	13x850 111x25.4 76x19 79x19 13x800

ALMERA I Hatchback (N15)

1.4	GA14DE	64	09/95 → 03/00	 	Water pump (-) Water pump (+) Water pump (+)	MVB835R4 MVB800R4 MVB915R4 MVB810R4	4PK835 4PK800 4PK915 4PK810
1.4 S,GX,LX	GA14DE	55	09/95 → 03/00	 	Water pump (-) Water pump (+) Water pump (+)	MVB835R4 MVB800R4 MVB915R4 MVB810R4	4PK835 4PK800 4PK915 4PK810
1.6	GA16DE	73	09/95 → 03/00	 	A/C(-) A/C(+), →04/96 A/C(+), 04/96→	MVB825R4 MVB1125R4 MVB1100R4 MVB810R4	4PK825 4PK1125 4PK1100 4PK810
1.6 SR,SLX	GA16DE	66	09/95 → 03/00	 	A/C(-) A/C(+), →04/96 A/C(+), 04/96→	MVB825R4 MVB1125R4 MVB1100R4 MVB810R4	4PK825 4PK1125 4PK1100 4PK810
2.0 D	CD20	55	11/95 → 03/00	 	→04/96 →04/96 04/96→	SVB13850 TB290 TBK053 TB503 TB645 SVB13800	13x850 111x25.4 76x19 79x19 13x800
2.0 GTi	SR20DE	105	07/96 → 03/00	 	A/C(-) A/C(+) 	MVB835R4 MVB1035R6 MVB845R4	4PK835 6PK1035 4PK845

ALMERA II (N16)

1.5	QG15DE	66	07/00 →	 	A/C(-), →11/02 A/C(+), →03/01 A/C(+), 01/01→11/02 →03/01 →11/02	MVB825R6 MVB1115R6 MVB1100R6 MVB850R3 MVB850R4	6PK825 6PK1115 6PK1100 3PK850 4PK850
		72	10/02 →	 	A/C(-), →09/06 A/C(+), →09/06 →09/06	MVB825R6 MVB1100R6 MVB850R4	6PK825 6PK1100 4PK850
1.5 dCi		60	01/03 →	 	A/C(-), 06/03→09/06 A/C(+), 06/03→09/06 06/03→09/06 06/03→08/03 08/03→09/06	MVB1135R5 MVB1200R5 TB713 TBK273 TBK301	5PK1135 5PK1200 123x27
1.8	QG18DE	84	07/00 →	 	A/C(-), →09/06 A/C(+), →03/01 A/C(+), 04/01→09/06 →03/01 04/01→09/06	MVB825R6 MVB1115R6 MVB1100R6 MVB870R4 MVB850R4	6PK825 6PK1115 6PK1100 4PK870 4PK850
		85	10/02 →	 	A/C(-), →09/06 A/C(+), →09/06 →09/06	MVB825R6 MVB1100R6 MVB850R4	6PK825 6PK1100 4PK850



kW



NISSAN

...NISSAN

...ALMERA II (N16)

2.2 dCi	YD22DDT	82	09/03 →	☼ ⌚	→09/06 →09/06	SVB13900 SVB13975	13x900 13x975
	YD22DDTi	100	09/03 →	☼ ⌚	→09/06 →09/06	SVB13900 SVB13975	13x900 13x975
2.2 Di	YD22DDT	81	07/00 →	☼ ⌚	→04/03 →04/03	SVB13900 SVB13975	13x900 13x975

ALMERA II Hatchback (N16)

1.5	QG15DE	66	03/00 →	⌚	A/C(-), →11/02	MVB825R6	6PK825
				⌚	A/C(+), →01/01	MVB1115R6	6PK1115
				⌚	A/C(+), 01/01→11/02	MVB1100R6	6PK1100
				☼	→11/02	MVB850R4	4PK850
		72	10/02 →	⌚	A/C(-), →09/06	MVB825R6	6PK825
				⌚	A/C(+), →09/06	MVB1100R6	6PK1100
				☼	→09/06	MVB850R4	4PK850
				⌚	A/C(-), 06/03→09/06	MVB1135R5	5PK1135
1.5 dCi	K9K 722	60	01/03 →	⌚	A/C(+), 06/03→09/06	MVB1200R5	5PK1200
				⌚	06/03→09/06	TB713	123x27
				⌚	06/03→08/03	TBK273	
				⌚	08/03→09/06	TBK301	
1.8	QG18DE	84	03/00 →	⌚	A/C(-), →09/06	MVB825R6	6PK825
				⌚	A/C(+), →01/01	MVB1115R6	6PK1115
				⌚	A/C(+), 01/01→09/06	MVB1100R6	6PK1100
				☼	→09/06	MVB850R4	4PK850
		85	10/02 →	⌚	A/C(-), →09/06	MVB825R6	6PK825
				⌚	A/C(+), →09/06	MVB1100R6	6PK1100
				☼	→09/06	MVB850R4	4PK850
				⌚	→09/06	SVB13900	13x900
2.2 dCi	YD22DDT	82	09/03 →	☼ ⌚	→09/06 →09/06	SVB13900 SVB13975	13x900 13x975
		YD22DDTi	100	09/03 →	☼ ⌚	→09/06 →09/06	SVB13900 SVB13975
2.2 Di	YD22DDT	81	03/00 →	☼ ⌚	→04/03 →04/03	SVB13900 SVB13975	13x900 13x975

ALMERA TINO (V10)

1.8	QG18DE	84	08/00 →	☼	→01/01	MVB1115R6	6PK1115
				☼	01/01→11/06	MVB1100R6	6PK1100
				⌚	→11/06	MVB825R6	6PK825
				☼	→11/06	MVB850R4	4PK850
		85	12/02 →	☼	→11/06	MVB1100R6	6PK1100
				⌚	→11/06	MVB825R6	6PK825
				☼	→11/06	MVB850R4	4PK850
				⌚	→05/03	MVB1025R6	6PK1025
2.0	SR20DE	100	08/00 →	☼	→05/03	MVB835R4	4PK835
				☼	→05/03		
2.2 dCi	YD22DDT	82	09/03 →	☼ ⌚	→11/06 →11/06	SVB13900 SVB13975	13x900 13x975
		YD22DDTi	100	09/03 →	☼ ⌚	→11/06 →11/06	SVB13900 SVB13975
2.2 Di	YD22DDTi	84	08/00 →	☼ ⌚	→05/03 →05/03	SVB13900 SVB13975	13x900 13x975

BLUEBIRD (T72 , T12)

1.6	CA16S	61	03/86 → 06/90	☼		MVB884R6	6PK884
				⌚	A/C(-), MS	MVB960R4	4PK960
				⌚	A/C(-), PS, →12/87	MVB730R6	6PK730
				⌚	A/C(-), PS, 12/87→	MVB725R4	4PK725
				⌚	A/C(+)	MVB706R4	4PK706
				⌚		TB127	95x19
				☼		MVB920R4	4PK920
				⌚	A/C(+), MS, →01/88	MVB810R4	4PK810



kW



...NISSAN

...BLUEBIRD (T72 , T12)

1.8 i 16V (RLT72)	CA18D	95	02/89 → 12/90	⚙️	→02/90	MVB884R6	6PK884
				⚙️	A/C(-), →02/90	MVB725R4	4PK725
				⚙️	A/C(+), →02/90	MVB706R4	4PK706
				🔧	→02/90	TB333	151x19
				⚙️	PS, →02/90	MVB940R4	4PK940
1.8 Turbo	CA18T	99	12/85 → 05/90	⚙️		MVB884R6	6PK884
				⚙️	A/C(-), MS	MVB960R4	4PK960
				⚙️	A/C(-), PS, →12/87	MVB730R6	6PK730
				⚙️	A/C(-), PS, 12/87→	MVB725R4	4PK725
				⚙️	A/C(+)	MVB706R4	4PK706
				🔧		TB127	95x19
				⚙️		MVB920R4	4PK920
				⚙️	A/C(+), MS	MVB810R4	4PK810
2.0 (T12)	CA20S	75	12/85 → 12/87	⚙️		MVB884R6	6PK884
				⚙️	A/C(-), MS	MVB960R4	4PK960
				⚙️	A/C(-), PS	MVB730R6	6PK730
				⚙️	A/C(+)	MVB706R4	4PK706
				🔧		TB184	98x19
2.0 D (SLT72, T12)	LD20	49	03/86 → 12/90	⚙️		MVB920R4	4PK920
				⚙️	A/C(+), MS	MVB810R4	4PK810
				⚙️	A/C(-), PS, →05/90	SVB13780	13x780
				⚙️	A/C(+), MS, →05/90	SVB13900	13x900
				⚙️	A/C(+), PS, →05/90	SVB13725	13x725
2.0 i	CA20E	85	09/88 → 09/90	🔧		TB361	143x30
				⚙️	→05/90	TB610	143x29
				⚙️		MVB884R6	6PK884
				⚙️	A/C(-), MS	MVB960R4	4PK960
				⚙️	A/C(-), PS	MVB725R4	4PK725
2.0 i (HLT72, T12)	CA20E	77	12/85 → 12/90	⚙️	A/C(+)	MVB706R4	4PK706
				🔧		TB184	98x19
				⚙️		MVB920R4	4PK920
				⚙️	A/C(+), MS	MVB810R4	4PK810
				⚙️		MVB884R6	6PK884

BLUEBIRD (U11)

1.8	CA18S	66	11/83 → 06/88	⚙️	A/C(-), MS	SVB101050	10x1050
				⚙️	A/C(+), PS	SVB10790	10x790
				🔧		TB127	95x19
				⚙️		SVB10950	10x950
1.8 Turbo	CA18T	99	04/84 → 05/90	⚙️	A/C(-), MS	SVB101050	10x1050
				⚙️	A/C(+), PS	SVB10790	10x790
				🔧		TB127	95x19
				⚙️		SVB10940	10x940
2.0 D	LD20	43	04/84 → 01/88	⚙️	A/C(-), PS	SVB13780	13x780
				⚙️	A/C(+), PS	SVB13725	13x725
				🔧		TB610	143x29
				🔧	10/85→	TB361	143x30
2.0 i	CA20E	77	04/84 → 01/88	⚙️		SVB13900	13x900
				⚙️		MVB884R6	6PK884
				⚙️	A/C(-), MS	MVB960R4	4PK960
				⚙️	A/C(-), PS	MVB730R6	6PK730
				⚙️	A/C(-), PS, 12/87→	MVB725R4	4PK725
				⚙️	A/C(+)	MVB706R4	4PK706
2.0 i	CA20E	77	04/84 → 01/88	🔧		TB184	98x19
				⚙️		MVB920R4	4PK920
				⚙️	A/C(+), MS	MVB810R4	4PK810
				⚙️		MVB884R6	6PK884



kw



NISSAN

...NISSAN

...BLUEBIRD (U11)

2.0 TD		62	11/83 → 12/85		A/C(-), PS	SVB13780	13x780
					A/C(+), MS	SVB13900	13x900
					A/C(+), PS	SVB13725	13x725
						TB610	143x29
					10/85→	TB361	143x30

BLUEBIRD Hatchback (T72, T12)

1.6	CA16S	61	03/86 → 06/90			MVB884R6	6PK884
					A/C(-), MS	MVB960R4	4PK960
					A/C(-), PS, →12/87	MVB730R6	6PK730
					A/C(-), PS, 12/87→	MVB725R4	4PK725
					A/C(+)	MVB706R4	4PK706
						TB127	95x19
						MVB920R4	4PK920
					A/C(+), MS, →01/88	MVB810R4	4PK810
		66	03/86 → 06/91			MVB884R6	6PK884
					A/C(-), MS	MVB960R4	4PK960
					A/C(-), PS, →12/87	MVB730R6	6PK730
					A/C(-), PS, 12/87→	MVB725R4	4PK725
					A/C(+)	MVB706R4	4PK706
						TB127	95x19
						MVB920R4	4PK920
					A/C(+), MS, →01/88	MVB810R4	4PK810
1.8 i 16V (FRLT72)	CA18D	95	02/89 → 12/90			MVB884R6	6PK884
					→02/90	MVB725R4	4PK725
					A/C(-), →02/90	MVB706R4	4PK706
					A/C(+), →02/90	TB333	151x19
					→02/90	MVB940R4	4PK940
					PS, →02/90		
1.8 Turbo	CA18T	99	12/85 → 05/90			MVB884R6	6PK884
					A/C(-), MS	MVB960R4	4PK960
					A/C(-), PS, →12/87	MVB730R6	6PK730
					A/C(-), PS, 12/87→	MVB725R4	4PK725
					A/C(+)	MVB706R4	4PK706
						TB127	95x19
						MVB920R4	4PK920
					A/C(+), MS	MVB810R4	4PK810
2.0 (T12)	CA20S	75	12/85 → 12/87			MVB884R6	6PK884
					A/C(-), MS	MVB960R4	4PK960
					A/C(-), PS	MVB730R6	6PK730
					A/C(+)	MVB706R4	4PK706
						TB184	98x19
						MVB920R4	4PK920
					A/C(+), MS	MVB810R4	4PK810
2.0 D (FSLT72, T12)	LD20	49	03/86 → 12/90		A/C(-), →04/90	SVB13780	13x780
					A/C(+), →04/90	SVB13725	13x725
					→04/90	TB361	143x30
					→04/90	SVB13900	13x900
2.0 i	CA20E	85	09/88 → 09/90			MVB884R6	6PK884
					A/C(-), MS	MVB960R4	4PK960
					A/C(-), PS	MVB725R4	4PK725
					A/C(+)	MVB706R4	4PK706
						TB184	98x19
						MVB920R4	4PK920
					A/C(+), MS	MVB810R4	4PK810
2.0 i (FHLT72, T12)	CA20E	77	12/85 → 12/90			MVB884R6	6PK884
					A/C(-), MS	MVB960R4	4PK960
					A/C(-), PS, →12/87	MVB730R6	6PK730
					A/C(-), PS, 12/87→	MVB725R4	4PK725
					A/C(+)	MVB706R4	4PK706
						TB184	98x19
						MVB920R4	4PK920
					A/C(+), MS	MVB810R4	4PK810



kW



...NISSAN

BLUEBIRD Station Wagon (WU11)

2.0	CA20S	75	04/86 → 09/90			MVB884R6	6PK884	
					A/C(-), MS	MVB960R4	4PK960	
					A/C(-), PS, →12/87	MVB730R6	6PK730	
					A/C(-), PS, 12/87→	MVB725R4	4PK725	
					A/C(+)	MVB706R4	4PK706	
2.0 D	LD20	43	04/84 → 01/88		A/C(-), PS	SVB13780	13x780	
					A/C(+), MS	SVB13900	13x900	
					A/C(+), PS	SVB13725	13x725	
						TB610	143x29	
						TB361	143x30	
	49			03/86 → 12/90		A/C(-), PS, →05/90	SVB13780	13x780
						A/C(+), MS, →05/90	SVB13900	13x900
						A/C(+), PS, →05/90	SVB13725	13x725
						→05/90	TB361	143x30
						→05/90	TB610	143x29
2.0 i	CA20E	77	04/84 → 12/90			MVB884R6	6PK884	
					A/C(-), MS	MVB960R4	4PK960	
					A/C(-), PS, →12/87	MVB730R6	6PK730	
					A/C(-), PS, 12/87→	MVB725R4	4PK725	
					A/C(+)	MVB706R4	4PK706	
	85			09/88 → 09/90			MVB884R6	6PK884
						A/C(-), MS	MVB960R4	4PK960
						A/C(-), PS	MVB725R4	4PK725
						A/C(+)	MVB706R4	4PK706
							TB184	98x19
					A/C(+), MS	MVB920R4	4PK920	
					A/C(+), MS	MVB810R4	4PK810	

CHERRY (N12)

1.0	E10	37	05/82 → 05/86			SVB10990	10x990
						TB261	102x19
1.3	E13	44	05/82 → 10/86			SVB10990	10x990
						TB261	102x19
1.5	E15S	55	11/83 → 10/86			SVB10850	10x850
						TB106	98x17
1.5 Turbo	E15ET	77	01/83 → 12/85			SVB10990	10x990
						TB169	106x19
1.7 D	CD17	40	10/82 → 12/86		A/C(-), →07/86	SVB13800	13x800
					A/C(+), →07/86	SVB13875	13x875
					→07/86	TB521	117x25.4
					→07/86	TBK053	
					→07/86	TB503	76x19

INTERSTAR Box (X70)

dCi 80	F9Q 772	60	07/02 →		A/C(-), →08/06	MVB1120R5	5PK1120
					A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB653	132x26
					→08/06	TBK275	
dCi 90	G9T 722	66	07/02 →		A/C(-), →08/06	MVB1150R6	6PK1150
					A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB710	89x25
dCi 100		73	11/03 →		A/C(-), →08/06	MVB1150R6	6PK1150
					A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB710	89x25



kw



NISSAN

...NISSAN

...INTERSTAR Box (X70)

dCi 120	G9U 720	84	07/02 →	⊗	A/C(-), →08/06	MVB1150R6	6PK1150
				⊗	A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB710	89x25
dCi 150	G9U 720	107	09/06 →	⊗	A/C(-), eng. PTO shaft (-), 09/06 →	MVB1115R7	7PK1115
				⊗	A/C(+), 09/06 →	MVB1788R7	7PK1788
				⊗	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
				⊗	A/C(+)	MVB1788R7	7PK1788

INTERSTAR Bus (X70)

dCi 80	F9Q 722	60	07/02 →	⊗	A/C(-), →08/06	MVB1120R5	5PK1120
				⊗	A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB653	132x26
					→08/06	TBK275	
dCi 90	G9T 722	66	07/02 →	⊗	A/C(-), →08/06	MVB1150R6	6PK1150
				⊗	A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB710	89x25
dCi 100	G9U 720	73	11/03 →	⊗	A/C(-), →08/06	MVB1150R6	6PK1150
				⊗	A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB710	89x25
dCi 120	G9U 720	84	07/02 →	⊗	A/C(-), →08/06	MVB1150R6	6PK1150
				⊗	A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB710	89x25
				⊗	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
dCi 150	G9U 720	107	09/06 →	⊗	A/C(+)	MVB1788R7	7PK1788
				⊗	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
				⊗	A/C(+)	MVB1788R7	7PK1788
				⊗	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115

INTERSTAR Flatbed / Chassis

dCi 100	G9U 720	73	02/04 →	⊗	A/C(-), →08/06	MVB1150R6	6PK1150
				⊗	A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB710	89x25
dCi 120	G9U 720	84	08/03 →	⊗	A/C(-), →08/06	MVB1150R6	6PK1150
				⊗	A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB710	89x25
				⊗	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
dCi 150	G9U 720	107	08/06 →	⊗	A/C(+)	MVB1788R7	7PK1788
				⊗	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
				⊗	A/C(+)	MVB1788R7	7PK1788

KUBISTAR (X76)

1.2	G9U 720	44	08/03 →	⊗	→08/05	MVB735R3	3PK735	
				⊗	A/C(-), →08/05	MVB915R4	4PK915	
				⊗	A/C(+), →08/05	MVB920R4	4PK920	
					→08/05	TB482	87x17	
					→08/05	TBK092		
1.5 dCi	G9U 720	60	08/03 →	⊗	→08/05	MVB905R4	4PK905	
				⊗	A/C(-)	MVB1135R5	5PK1135	
				⊗	A/C(+), →08/05	MVB1200R5	5PK1200	
				⊗	A/C(+), 04/06 →	MVB1200R6	6PK1200	
						TB713	123x27	
	K9K 704	G9U 720	48	08/03 →			TBK301	
					⊗	A/C(-)	MVB1135R5	5PK1135
					⊗	A/C(+), →08/05	MVB1200R5	5PK1200
					⊗	A/C(+), 04/06 →	MVB1200R6	6PK1200
							TB713	123x27
	G9U 720	42	08/03 →	⊗		TBK301		
				⊗	A/C(-), →08/05	MVB1135R5	5PK1135	
				⊗	A/C(+), →08/05	MVB1200R5	5PK1200	
					→08/05	TB713	123x27	
					→08/05	TBK301		
		45	08/05 →			TB713	123x27	
1.5 dCi 70	G9U 720	50	04/06 →			TB713	123x27	
1.5 dCi 85	G9U 720	62	04/06 →			TB713	123x27	
1.6 16V	G9U 720	70	08/03 →			TB636	132x27	



kW



...NISSAN

LAUREL (JC31)

2.0	L20A	71	01/81 → 01/84	 	A/C(-), MS A/C(+), PS	SVB13925 SVB13900 SVB13875 SVB131125	13x925 13x900 13x875 13x1125
2.4	L24	83	01/81 → 01/84	 	A/C(-), MS A/C(+), PS	SVB13925 SVB13900 SVB13875 SVB131125	13x925 13x900 13x875 13x1125
		88	09/83 → 12/85	 	→10/84 A/C(-), MS, →10/84 A/C(+), PS, →10/84 →10/84	SVB13925 SVB13900 SVB13875 SVB131125	13x925 13x900 13x875 13x1125
2.8 D	LD28	62	01/81 → 10/85	 	→10/84 →10/84 →10/84	SVB13900	13x900
						TB168 SVB13825	69x19 13x825

LAUREL (JC32)

2.4	L24E, L24S	94	01/85 → 12/87	 	Eng. L24E Eng. L24E	SVB13925	13x925
						SVB13875 SVB131125	13x875 13x1125
2.8 D	LD28	62	01/85 → 12/87	 	→01/87 →01/87 →01/87	SVB13900	13x900
						TB168 SVB13825	69x19 13x825
	RD28	66	01/85 → 12/89	 	02/87→ 02/87→ 02/87→ 02/87→	SVB13900	13x900
						SVB131150 TB300 SVB131075	13x1150 149x30 13x1075

MAXIMA (J30)

3.0 i	VG30E	125	10/88 → 06/94	 	→06/93 06/93→	MVB1190R4	4PK1190
						MVB775R4 TB128 TB793 MVB1040R4	4PK775 133x25.4 133x25.4 4PK1040

MAXIMA QX (A32)

2.0	VQ20DE	103	02/95 → 08/00	 	→12/99 →12/99 →12/99	MVB1105R6	6PK1105
						MVB884R6	6PK884
						MVB775R4	4PK775
3.0	VQ30DE	142	01/95 → 08/00	 	A/C(-), →12/99 A/C(+), →12/99 →12/99	MVB890R6	6PK890
						MVB1105R6	6PK1105
						MVB775R4	4PK775

MAXIMA QX (A33)

2.0 V6 24V	VQ20DE	103	03/00 →	 	A/C(-), →09/03 A/C(+), →09/03 →10/00	MVB890R6	6PK890
						MVB1105R6	6PK1105
						MVB775R4	4PK775
3.0 V6 24V	VQ30DE	147	03/00 →	 	→09/03 →09/03 →10/00	MVB1105R6	6PK1105
						MVB890R6	6PK890
						MVB775R4	4PK775

MAXIMA Station Wagon

2.0 QX	VQ20DE	103	10/97 →	 	A/C(-), 01/00→09/03 A/C(+), 01/00→09/03 01/00→10/00	MVB890R6	6PK890
						MVB1105R6	6PK1105
						MVB775R4	4PK775
3.0 QX	VQ30DE	142	10/97 →	 	A/C(-), →12/99 A/C(+), →12/99 →12/99	MVB890R6	6PK890
						MVB1105R6	6PK1105
						MVB775R4	4PK775



kw



NISSAN

...NISSAN

MICRA (K10)

1.0	MA10S	40	12/82 → 05/89	☀	MS	SVB13825	13x825
				☀	PS	MVB810R4	4PK810
				☀	A/C(-), MS	SVB10975	10x975
				☀	A/C(-), PS	MVB872R3	3PK872
				☀	A/C(+), PS	MVB785R3	3PK785
		37	12/82 → 12/89	☀	MS	SVB13825	13x825
				☀	PS	MVB810R4	4PK810
				☀	A/C(-), PS	MVB872R3	3PK872
				☀	A/C(+), PS	MVB785R3	3PK785
				☀	MS	SVB10975	10x975
		43	12/82 → 05/91	☀	MS	SVB13825	13x825
				☀	PS	MVB810R4	4PK810
				☀	A/C(-), MS	SVB10975	10x975
				☀	A/C(-), PS	MVB872R3	3PK872
				☀	A/C(+), PS	MVB785R3	3PK785
1.2	MA12S	44	07/86 → 07/92	☀	MS	SVB13825	13x825
				☀	PS	MVB810R4	4PK810
				☀	A/C(-), MS	SVB10975	10x975
				☀	A/C(-), PS	MVB872R3	3PK872
				☀	A/C(+), PS	MVB785R3	3PK785
		40	07/86 → 07/92	☀	MS	SVB13825	13x825
				☀	PS	MVB810R4	4PK810
				☀	A/C(-), MS	SVB10975	10x975
				☀	A/C(-), PS	MVB872R3	3PK872
				☀	A/C(+), PS	MVB785R3	3PK785

MICRA (K11)

1.0 i 16V	CG10DE	40	08/92 → 09/00	☀	A/C(-)	MVB675R6	6PK675
				☀	A/C(-), PS, →09/93	MVB884R6	6PK884
				☀	A/C(+)	MVB955R6	6PK955
				☀	MS	MVB648R4	4PK648
				☀	PS, →02/98	MVB763R4	4PK763
		44	09/00 → 02/03	☀	PS, 02/98 →	MVB725R4	4PK725
				☀	A/C(-), MS	MVB675R6	6PK675
				☀	A/C(+)	MVB955R6	6PK955
				☀	MS	MVB648R4	4PK648
				☀	PS	MVB725R4	4PK725
1.3 i 16V	CG13DE	55	08/92 → 09/00	☀	A/C(-), PS	MVB675R6	6PK675
				☀	A/C(-), PS, →09/93	MVB884R6	6PK884
				☀	A/C(+)	MVB955R6	6PK955
				☀	MS	MVB648R4	4PK648
				☀	PS, →02/98	MVB763R4	4PK763
				☀	PS, 02/98 →	MVB725R4	4PK725
1.4 i 16V	CGA3DE	60	09/00 → 02/03	☀	A/C(-)	MVB675R6	6PK675
				☀	A/C(+), PS	MVB955R6	6PK955
				☀	MS	MVB648R4	4PK648
1.5 D	TD15	42	02/98 → 02/03	☀	MS	MVB775R5	5PK775
				☀	PS	MVB960R5	5PK960
				☀		TB457	136x25.4
				☀		TBK041	



kW



...NISSAN

MICRA (K12)

1.0 16V		48	01/03 →		A/C(-), →05/05 A/C(+), →05/05 →05/05	MVB835R4 MVB1065R4 MVB668R3	4PK835 4PK1065 3PK668
1.2 16V	CR12DE	59	01/03 →		A/C(-) A/C(+), →05/05	MVB835R4 MVB1065R4 MVB668R3	4PK835 4PK1065 3PK668
		48	01/03 →		A/C(-) A/C(+), →05/05	MVB835R4 MVB1065R4 MVB668R3	4PK835 4PK1065 3PK668
1.4 16V	CR14DE	65	01/03 →		A/C(-), →05/06 A/C(+), →05/05	MVB835R4 MVB1065R4 MVB668R3	4PK835 4PK1065 3PK668
1.5 dCi	K9K 704	48	01/03 →		A/C(-), →05/05 A/C(+), →05/05 →05/05 →08/03 08/03→05/05	MVB1135R5 MVB1200R5 TB713 TBK273 TBK301	5PK1135 5PK1200 123x27
	K9K 722	60	09/03 →		A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05	MVB1135R5 MVB1200R5 TB713 TBK301	5PK1135 5PK1200 123x27
		50	01/03 →		A/C(-), 06/05→ A/C(+), 06/05→ 06/05→	MVB1135R5 MVB1200R5 TB713	5PK1135 5PK1200 123x27
		63	01/03 →		A/C(-), 06/05→ A/C(+), 06/05→ 06/05→	MVB1135R5 MVB1200R5 TB713	5PK1135 5PK1200 123x27
160 SR	HR 16 DE	81	05/05 →		A/C(-)	MVB1035R7 MVB668R3	7PK1035 3PK668

MICRA C+C (K12)

1.4 16V	CR14DE	65	08/05 →		A/C(-), →05/06	MVB835R4 MVB668R3	4PK835 3PK668
1.6 160 SR	HR 16 DE	81	08/05 →		A/C(-)	MVB1035R7 MVB668R3	7PK1035 3PK668

MURANO (Z50)

3.5 4x4	VQ35DE	172	03/05 →		→10/07 →10/07	MVB1065R6 MVB775R4	6PK1065 4PK775
---------	--------	-----	---------	--	------------------	-----------------------	-------------------

NAVARA (D40)

2.5 dCi		106	07/05 →		A/C(+)	MVB1270R7 MVB825R4	7PK1270 4PK825
2.5 dCi 4WD		128	07/05 →		A/C(+)	MVB1270R7 MVB825R4	7PK1270 4PK825
		126	10/06 →		A/C(+)	MVB1270R7 MVB825R4	7PK1270 4PK825

NOTE (E11)

1.4	CR14DE	65	03/06 →		A/C(-)	MVB835R4 MVB668R3	4PK835 3PK668
1.5 dCi		50	03/06 →		A/C(+)	MVB1200R6 TB713	6PK1200 123x27
		63	03/06 →		A/C(+)	MVB1200R6 TB713	6PK1200 123x27
1.6	HR 16 DE	81	03/06 →		A/C(-)	MVB1035R7	7PK1035



kW



NISSAN

...NISSAN

PATHFINDER (R50)

3.3 V6 4WD	VG33E	125	09/97 → 12/04	☀ ⌚ 🔧 ⊕	→07/00 Water pump (+), →07/00 →07/00 →07/00	MVB1285R5 MVB1065R6 TB793 SVB13875	5PK1285 6PK1065 133x25.4 13x875
		110	03/98 → 10/00	☀ ⌚ 🔧 ⊕	Water pump (+)	MVB1285R5 MVB1065R6 TB793 SVB13875	5PK1285 6PK1065 133x25.4 13x875
3.5 V6 4WD	VQ35	162	11/00 → 12/04	☀ ⌚	→07/04 →07/04	MVB950R4 MVB1173R6	4PK950 6PK1173

PATHFINDER (R51)

2.5 dCi 4WD		128	03/05 →	⌚ ⊕	A/C(+)	MVB1270R7 MVB825R4	7PK1270 4PK825
		126	10/06 →	⌚ ⊕	A/C(+)	MVB1270R7 MVB825R4	7PK1270 4PK825

PATROL GR I (Y60)

2.8 TD (Y60A)	RD28T	85	09/88 → 06/97	☀ ⌚ 🔧 ⊕	→09/94 09/94 →	SVB13900 SVB131075 TB300 TB542 SVB13775	13x900 13x1075 149x30 149x30 13x775
4.2 CAT	TB42E	121	11/88 → 06/97	☀ ⌚ ⊕	10/91 → 10/91 → 10/91 →	SVB13900 SVB101140 SVB131050	13x900 10x1140 13x1050
4.2 D (Y60GR)		85	11/88 → 06/97	☀ ⌚ ⊕		SVB13950 SVB131150 SVB131250	13x950 13x1150 13x1250

PATROL GR II (Y61)

2.8 TD	RD28Ti	95	06/97 → 05/00	☀ ⌚ 🔧	10/97 → 10/97 → 10/97 →	SVB13900 SVB131075 TB542	13x900 13x1075 149x30
3.0 DTi	ZD30DDTi	116	05/00 →	⌚	A/C(+), →08/04	MVB1638R7	7PK1638
		118	05/00 →	⌚	A/C(+), 09/04 →	MVB1638R7	7PK1638

PATROL Hardtop (K160)

2.8 (K160)	L28	88	07/80 → 08/88	☀ ⌚ ⊕	→10/84	SVB13900 SVB13875 SVB131125	13x900 13x875 13x1125
		89	07/80 → 08/88	⌚ ⊕	→10/84	SVB13900 SVB13875 SVB131125	13x900 13x875 13x1125
3.2 TD (K160)	SD33T	81	07/83 → 08/88	☀ ⌚ ⊕	A/C(-), →12/86 A/C(-), 01/87 → A/C(+)	SVB131500 SVB13950 SVB13925 SVB13975 SVB131275	13x1500 13x950 13x925 13x975 13x1275
3.3 D (K160)	SD33	70	11/79 → 08/88	☀ ⌚ ⊕	01/81 → A/C(-), 01/81 → 12/86 A/C(-), 01/87 → A/C(+), 01/81 → 01/81 →	SVB131500 SVB13950 SVB13925 SVB13975 SVB131275	13x1500 13x950 13x925 13x975 13x1275

PATROL Hardtop (K260)

2.8	L28	88	05/86 → 06/90	☀ ⊕	→08/88 →08/88	SVB13900 SVB131125	13x900 13x1125
2.8 TD	RD28T	85	05/86 → 06/90	☀ ⌚ 🔧 ⊕	03/89 → A/C(-), 03/89 → 03/89 → 03/89 →	SVB13900 SVB131075 TB300 SVB13775	13x900 13x1075 149x30 13x775
3.2 D		81	08/88 → 06/90	☀ ⌚ ⊕	→02/89 A/C(-), →02/89 A/C(+), →02/89 →02/89	SVB131500 SVB13925 SVB13975 SVB131275	13x1500 13x925 13x975 13x1275





kW



...NISSAN

PATROL Station Wagon (W160)

2.8 (W160)	L28	88	07/80 → 08/88	⚙️ ⚙️ ⚙️ ⚙️	→10/84	SVB13900 SVB13875 SVB131125	13x900 13x875 13x1125
3.2 TD (W160)	SD33T	81	07/83 → 08/88	⚙️ ⚙️ ⚙️ ⚙️	A/C(-), →12/86 A/C(-), 01/87→ A/C(+)	SVB131500 SVB13950 SVB13925 SVB13975 SVB131275	13x1500 13x950 13x925 13x975 13x1275
3.3 D (W160)	SD33	70	11/79 → 08/88	⚙️ ⚙️ ⚙️ ⚙️	01/81→ A/C(-), 01/81→12/86 A/C(-), 01/87→ A/C(+), 01/81→ 01/81→	SVB131500 SVB13950 SVB13925 SVB13975 SVB131275	13x1500 13x950 13x925 13x975 13x1275

PATROL Station Wagon (W260)

2.8 TD	RD28T	85	06/89 → 11/95	⚙️ ⚙️ ⚙️ ⚙️	A/C(-) →08/94 08/94→	SVB13900 SVB131075 TB300 TB542 SVB13775	13x900 13x1075 149x30 149x30 13x775
3.2 D		81	08/88 → 06/90	⚙️ ⚙️ ⚙️ ⚙️	→02/89 A/C(-), →02/89 A/C(+), →02/89 →02/89	SVB131500 SVB13925 SVB13975 SVB131275	13x1500 13x925 13x975 13x1275

PICK UP (720)

1.8	L18	59	01/83 → 03/86	⚙️	→08/85	SVB10900	10x900
2.2 4WD	Z22	71	04/83 → 03/86	⚙️	→08/85	SVB10913	10x913
2.2 D	SD22	47	01/82 → 01/84	⚙️	→12/82	SVB13950	13x950
2.3 D	SD23	51	04/83 → 03/86	⚙️	→08/85	SVB13975	13x975
2.5 D 4WD	SD25	53	04/83 → 03/86	⚙️ ⚙️ ⚙️		SVB131450 SVB13975 SVB131175	13x1450 13x975 13x1175

PICK UP (D21)

2.4 i 12V	KA24E	91	04/92 → 02/98	⚙️ ⚙️		SVB10900 SVB131150	10x900 13x1150
2.4 i 12V 4WD	KA24E	93	04/92 → 02/98	⚙️ ⚙️		SVB10900 SVB131150	10x900 13x1150
2.4 i 4WD	Z24i	74	03/86 → 04/92	⚙️ ⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	SVB13825 SVB10940 SVB10913 SVB131175	13x825 10x940 10x913 13x1175
2.5 D	TD25	61	03/96 → 02/98	⚙️ ⚙️		SVB13925 SVB131150	13x925 13x1150
2.5 D 4WD	TD25	61	03/96 → 02/98	⚙️ ⚙️		SVB13925 SVB131150	13x925 13x1150
		59	08/87 → 02/98	⚙️ ⚙️		SVB13925 SVB131150	13x925 13x1150
	SD25	55	03/86 → 08/91	⚙️ ⚙️	10/87→ 10/87→	SVB13925 SVB131150	13x925 13x1150
2.7 D 4WD	TD27	73	08/87 → 02/98	⚙️ ⚙️		SVB13925 SVB131150	13x925 13x1150

PICK UP (D22)

2.4 i	KA24E	88	02/98 →	⚙️ ⚙️ ⚙️	→10/01 →10/01 →10/01	SVB13925 SVB10900 SVB131150	13x925 10x900 13x1150
2.4 i 4WD	KA24E	88	02/98 →	⚙️ ⚙️ ⚙️	→10/01 →10/01 →10/01	SVB13925 SVB10900 SVB131150	13x925 10x900 13x1150
	KA24DE	98	03/02 →	⚙️	→04/05	SVB13900	13x900



kw



NISSAN

...NISSAN

...PICK UP (D22)

2.5 D	TD25	61	02/98 →	☼ ⊖	→10/01 →10/01	SVB13925 SVB131150	13x925 13x1150
2.5 D 4WD	TD25	61	02/98 →	☼ ⊕	→10/01 →10/01	SVB13925 SVB131150	13x925 13x1150
2.5 Di	YD25DDTi	98	03/02 →	☼ ⊖ ⊕	→04/05 →04/05 →04/05	SVB13900 SVB131050 SVB13775	13x900 13x1050 13x775
2.5 Di 4WD	YD25DDTi	98	03/02 →	☼ ⊖ ⊕	→04/05 →04/05 →04/05	SVB13900 SVB131050 SVB13775	13x900 13x1050 13x775
2.5 TD 4WD	TD25Ti	76	05/98 →	☼ ⊖	→10/01 →10/01	SVB13925 SVB131150	13x925 13x1150

PRAIRIE (M10, NM10)

1.5 S (M10)	E15S	55	01/84 → 12/87	☼ ⊖ ☞		SVB13800 SVB10990 TB169	13x800 10x990 106x19
1.8 SGL (M10)	CA18S	65	07/83 → 12/85	☼ ⊖ ☞		SVB17850 SVB10875 TB127	17x850 10x875 95x19
		66	05/85 → 10/87	☼ ⊖ ☞		SVB13750 SVB17850 SVB10875 TB127	13x750 17x850 10x875 95x19
2.0 4x4 (NM10)	CA20S	68	06/86 → 09/88	☼ ⊖ ☞		SVB13900 SVB13875 TB184 SVB13825	13x900 13x875 98x19 13x825

PRAIRIE PRO (M11)

2.0 i	CA20E	72	10/88 → 04/92	☼ ⊖ ⊕ ☞	A/C(-), →01/89 A/C(+)	MVB884R6 MVB730R6 MVB725R4 TB184 MVB900R4	6PK884 6PK730 4PK725 98x19 4PK900
2.0 i 4x4	CA20E	72	10/88 → 12/92	☼ ⊖ ⊕ ☞	→03/92 →03/92 A/C(-), →01/89 →03/92	MVB884R6 MVB725R4 MVB730R6 TB184 MVB900R4	6PK884 4PK725 6PK730 98x19 4PK900
2.4 i	KA24E	98	04/92 → 07/94	⊖ ⊕		MVB1306R6 MVB875R4	6PK1306 4PK875
2.4 i 4x4	KA24E	98	04/92 → 07/94	⊖ ⊕		MVB1306R6 MVB875R4	6PK1306 4PK875

PRIMASTAR Box (X83)

2.0		88	02/03 →	⊖ ⊕ ☞	A/C(-), →03/06 A/C(+), →03/06 →03/06	MVB1120R5 MVB1795R6 TB652	5PK1120 6PK1795 126x27
dCi 80	F9Q 762	60	09/02 →	⊖ ⊕ ☞ ☞ KIT	A/C(-), →03/06 A/C(+), →03/06 →03/06 →03/06	MVB1120R5 MVB1795R6 TB653 TBK275	5PK1120 6PK1795 132x26
dCi 100	F9Q 760	74	09/02 →	⊖ ⊕ ☞ ☞ KIT	A/C(-), →03/06 A/C(+), →03/06 →03/06 →03/06	MVB1120R5 MVB1795R6 TB653 TBK275	5PK1120 6PK1795 132x26
dCi 120		84	09/06 →	⊖	A/C(+)	MVB1969R7	7PK1969
dCi 140	G9U 730	99	09/03 →	⊖ ⊕ ☞	A/C(-), →03/06 A/C(+), →03/06 →03/06	MVB1150R6 MVB1795R6 TB710	6PK1150 6PK1795 89x25



kW



...NISSAN

PRIMASTAR Bus (X83)

2.0	F4R 720, F4R 722	88	03/01 →		A/C(-), 07/02 → 03/06	MVB1120R5	5PK1120
					A/C(+), 07/02 → 03/06	MVB1795R6	6PK1795
					07/02 → 03/06	TB652	126x27
dCi 80	F9Q 762	60	03/01 →		A/C(-), 07/02 → 03/06	MVB1120R5	5PK1120
					A/C(+), 07/02 → 03/06	MVB1795R6	6PK1795
					07/02 → 03/06	TB653	132x26
				KIT	07/02 → 03/06	TBK275	
dCi 100	F9Q 760	74	03/01 →		A/C(-), 07/02 → 03/06	MVB1120R5	5PK1120
					A/C(+), 07/02 → 03/06	MVB1795R6	6PK1795
					07/02 → 03/06	TB653	132x26
				KIT	07/02 → 03/06	TBK275	
dCi 120		84	09/06 →		A/C(+)	MVB1969R7	7PK1969
dCi 140	G9U 730	99	09/03 →		A/C(-), → 03/06	MVB1150R6	6PK1150
					A/C(+), → 03/06	MVB1795R6	6PK1795
					→ 03/06	TB710	89x25

PRIMERA (P10)

1.6	GA16DS	66	06/90 → 01/96		MS, → 04/93	MVB915R4	4PK915
					PS, → 04/93	MVB810R4	4PK810
		71	06/90 → 01/96		MS, → 04/93	MVB915R4	4PK915
					PS, → 04/93	MVB810R4	4PK810
	GA16DE	75	06/93 → 01/96			MVB810R4	4PK810
					MS	MVB915R4	4PK915
					PS	MVB800R4	4PK800
2.0 16V	SR20DI	85	06/90 → 01/96		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1035R6	6PK1035
						MVB845R4	4PK845
2.0 16V 4x4	SR20DI	85	04/91 → 06/96		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1035R6	6PK1035
						MVB845R4	4PK845
2.0 D	CD20	55	01/91 → 01/96			SVB13850	13x850
						TB290	111x25.4
				KIT		TBK053	
						TB503	76x19
						SVB13800	13x800
2.0 GT	SR20DE	110	06/90 → 01/96		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1035R6	6PK1035
						MVB845R4	4PK845
2.0 i	SR20DE	92	01/95 → 06/96		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1035R6	6PK1035
						MVB845R4	4PK845

PRIMERA (P11)

1.6 16V	GA16DE	73	09/96 → 10/00		→ 05/99	MVB835R4	4PK835
					→ 05/99	MVB800R4	4PK800
					→ 05/99	MVB810R4	4PK810
		66	09/96 → 12/01		→ 05/99	MVB835R4	4PK835
					→ 05/99	MVB800R4	4PK800
					→ 05/99	MVB810R4	4PK810
	QG16DE	78	06/96 → 12/01		A/C(-), 06/99 →	MVB825R6	6PK825
					A/C(+), 06/99 →	MVB1100R6	6PK1100
					06/99 →	MVB845R4	4PK845
1.8 16V	QG18DE	84	08/99 → 12/01		A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1115R6	6PK1115
						MVB850R4	4PK850



kW



NISSAN

...NISSAN

...PRIMERA (P11)

2.0 16V	SR20DE	96	09/96 → 12/01	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB825R4 MVB1025R6 MVB845R4	4PK825 6PK1025 4PK845
		85	09/96 → 12/01	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB825R4 MVB1025R6 MVB845R4	4PK825 6PK1025 4PK845
		110	09/96 → 12/01	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB825R4 MVB1025R6 MVB845R4	4PK825 6PK1025 4PK845
		103	08/99 → 12/01	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB825R4 MVB1025R6 MVB845R4	4PK825 6PK1025 4PK845
2.0 TD	CD20T	66	09/96 → 12/01	⊗ ⊗ ⊗		SVB13850 TB290 TB645	13x850 111x25.4 79x19

PRIMERA (P12)

1.6	QG16DE	78	03/02 →	⊗ ⊗ ⊗	A/C(-), →04/06 A/C(+), →04/06 →04/06	MVB825R6 MVB1100R6 MVB850R4	6PK825 6PK1100 4PK850
		80	01/02 →	⊗ ⊗ ⊗	A/C(-), →04/06 A/C(+), →04/06 →04/06	MVB825R6 MVB1100R6 MVB850R4	6PK825 6PK1100 4PK850
1.8	QG18DE	85	03/02 →	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB825R6 MVB1100R6 MVB850R4	6PK825 6PK1100 4PK850
1.9 dCi		88	04/03 →	⊗ ⊗ ⊗	→10/07 →10/07 →10/07	MVB1788R7 TB756 TBK322	7PK1788 133x26
		85	08/02 →	⊗ ⊗ ⊗	05/03→10/07 05/03→10/07 05/03→10/07	MVB1788R7 TB756 TBK322	7PK1788 133x26
2.0	QR20DE	103	03/02 →	⊗		MVB2250R6	6PK2250
2.2 dCi	YD22DDT	102	04/03 →	⊗ ⊗	→10/07 →10/07	SVB13900 SVB13975	13x900 13x975
2.2 Di	YD22DDT	93	03/02 →	⊗ ⊗	→04/03 →04/03	SVB13900 SVB13975	13x900 13x975

PRIMERA Estate (WP12)

1.6 Visia	QG16DE	80	01/02 →	⊗ ⊗ ⊗	A/C(-), →04/06 A/C(+), →04/06 →04/06	MVB825R6 MVB1100R6 MVB850R4	6PK825 6PK1100 4PK850
1.8	QG18DE	85	03/02 →	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB825R6 MVB1100R6 MVB850R4	6PK825 6PK1100 4PK850
1.9 dCi		88	04/03 →	⊗ ⊗ ⊗	→10/07 →10/07 →10/07	MVB1788R7 TB756 TBK322	7PK1788 133x26
		85	08/02 →	⊗ ⊗ ⊗	05/03→10/07 05/03→10/07 05/03→10/07	MVB1788R7 TB756 TBK322	7PK1788 133x26
2.0	QR20DE	103	03/02 →	⊗		MVB2250R6	6PK2250
2.2 dCi	YD22DDT	102	04/03 →	⊗ ⊗	→10/07 →10/07	SVB13900 SVB13975	13x900 13x975
2.2 Di	YD22DDT	93	03/02 →	⊗ ⊗	→04/03 →04/03	SVB13900 SVB13975	13x900 13x975



kW



...NISSAN

PRIMERA Hatchback (P10)

1.6	GA16DS	66	06/90 → 01/96		MS, →04/93	MVB915R4	4PK915
		71	06/90 → 06/93		PS, →04/93	MVB810R4	4PK810
	GA16DE	75	06/93 → 01/96		MS	MVB915R4	4PK915
					PS	MVB810R4	4PK810
2.0 16V	SR20DI	85	06/90 → 01/96		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1035R6	6PK1035
						MVB845R4	4PK845
2.0 16V 4x4	SR20DI	85	04/91 → 06/96		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1035R6	6PK1035
						MVB845R4	4PK845
2.0 D	CD20	55	01/91 → 01/96			SVB13850	13x850
						TB290	111x25.4
						TBK053	
						TB503	76x19
						SVB13800	13x800
2.0 i	SR20DE	92	01/95 → 06/96		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1035R6	6PK1035
						MVB845R4	4PK845

PRIMERA Hatchback (P11)

1.6 16V	GA16DE	73	09/96 → 07/02		→05/99	MVB835R4	4PK835		
					→05/99	MVB800R4	4PK800		
					→05/99	MVB810R4	4PK810		
		66	09/96 → 07/02		→05/99	MVB835R4	4PK835		
					→05/99	MVB800R4	4PK800		
1.8 16V	QG18DE	84	08/99 → 07/02		A/C(-), →12/01	MVB825R6	6PK825		
					A/C(+), →12/01	MVB1100R6	6PK1100		
					→12/01	MVB845R4	4PK845		
					A/C(-), →12/01	MVB825R6	6PK825		
					A/C(+), →12/01	MVB1115R6	6PK1115		
2.0 16V	SR20DE	96	09/96 → 07/02		A/C(-), →12/01	MVB825R4	4PK825		
					A/C(+), →12/01	MVB1025R6	6PK1025		
					→12/01	MVB845R4	4PK845		
				85	09/96 → 07/02		A/C(-), →12/01	MVB825R4	4PK825
							A/C(+), →12/01	MVB1025R6	6PK1025
		110	09/96 → 07/02			→12/01	MVB845R4	4PK845	
						A/C(-), →12/01	MVB825R4	4PK825	
						A/C(+), →12/01	MVB1025R6	6PK1025	
						→12/01	MVB845R4	4PK845	
						A/C(-), →12/01	MVB825R4	4PK825	
2.0 TD	CD20T	66	09/96 → 07/02		→12/01	SVB13850	13x850		
					→12/01	TB290	111x25.4		
					→12/01	TB645	79x19		

PRIMERA Hatchback (P12)

1.6		78	07/02 →		A/C(-), →04/06	MVB825R6	6PK825
					A/C(+), →04/06	MVB1100R6	6PK1100
					→04/06	MVB850R4	4PK850
1.8	QG18DE	80	07/02 →		A/C(-), →04/06	MVB825R6	6PK825
					A/C(+), →04/06	MVB1100R6	6PK1100
					→04/06	MVB850R4	4PK850
1.8	QG18DE	85	07/02 →		A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1100R6	6PK1100
						MVB850R4	4PK850



kW



NISSAN

...NISSAN

...PRIMERA Hatchback (P12)

1.9 dCi		88	04/03 →		→10/07	MVB1788R7	7PK1788
					→10/07	TB756	133x26
				KIT	→10/07	TBK322	
		85	08/02 →		05/03→10/07	MVB1788R7	7PK1788
					05/03→10/07	TB756	133x26
				KIT	05/03→10/07	TBK322	
2.0	QR20DE	103	07/02 →			MVB2250R6	6PK2250
2.2 dCi	YD22DDT	102	04/03 →		→10/07	SVB13900	13x900
					→10/07	SVB13975	13x975
2.2 Di	YD22DDT	93	07/02 →		→04/03	SVB13900	13x900
					→04/03	SVB13975	13x975

PRIMERA Traveller (W10)

1.6 i	GA16DS	66	07/90 → 03/98		MS	MVB915R4	4PK915
					PS	MVB800R4	4PK800
						MVB810R4	4PK810
	GA16DE	75	03/94 → 03/98		MS	MVB915R4	4PK915
					PS	MVB800R4	4PK800
						MVB810R4	4PK810
2.0 D	CD20	55	07/90 → 12/95			SVB13850	13x850
						TB290	111x25.4
				KIT		TBK053	
						TB503	76x19
						SVB13800	13x800
2.0 i	SR20DI	85	07/90 → 03/98		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1035R6	6PK1035
						MVB845R4	4PK845

PRIMERA Traveller (WP11)

1.6 16V	GA16DE	66	04/98 → 12/01		A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1100R6	6PK1100
						MVB850R4	4PK850
		73	04/98 → 12/01		A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1100R6	6PK1100
						MVB850R4	4PK850
1.8 16V	QG18DE	84	08/99 → 12/01		A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1115R6	6PK1115
						MVB850R4	4PK850
2.0 16V	SR20De	85	04/98 → 12/01		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1025R6	6PK1025
						MVB845R4	4PK845
		96	04/98 → 12/01		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1025R6	6PK1025
						MVB845R4	4PK845
		103	08/99 → 12/01		A/C(-)	MVB835R4	4PK835
					A/C(+)	MVB1025R6	6PK1025
						MVB845R4	4PK845
2.0 TD	CD20T	66	04/98 → 12/01			SVB13850	13x850
						TB290	111x25.4
						TB645	79x19

QASHQAI (J10)

1.5 dCi		78	02/07 →			TB713	123x27
2.0	MR20DE	103	02/07 →			MVB1215R6	6PK1215
2.0 All-wheel Drive	MR20DE	103	02/07 →			MVB1215R6	6PK1215

SERENA (C23M)

1.6 16V	GA16DE	71	02/93 →		→08/00	MVB835R4	4PK835
					MS, →08/00	MVB915R4	4PK915
					A/C(+), →08/00	MVB810R4	4PK810
2.0 16V	SR20DE	93	11/92 →		→08/00	MVB875R4	4PK875
					→12/93	MVB950R5	5PK950
					12/93→08/00	MVB938R5	5PK938



kW



...NISSAN

...SERENA (C23M)

2.0 D	LD20	49	11/92 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→09/94 →09/94 →09/94 →09/94 →09/94 →09/94 →09/94 →09/94	SVB13925 SVB131050 TB412 TBK080 SVB13750	13x925 13x1050 141x30 141x30 13x750
2.3 D	LD23	55	01/95 →	⊗ ⊗ ⊗ ⊗ ⊗	→08/00 →08/00 →08/00 →08/00 →08/00	SVB13950 SVB131100 TB487 SVB13850	13x950 13x1100 145x30 13x850

SILVIA (S12)

1.8		90	07/86 → 04/88	⊗ ⊗ ⊗ ⊗ ⊗		MVB845R4 MVB870R4 TB127 MVB825R3	4PK845 4PK870 95x19 3PK825
2.0 GP	FJ20E	107	04/84 → 09/88	⊗ ⊗ ⊗	→05/88 →05/88 →05/88	SVB13850 SVB131000 SVB131250	13x850 13x1000 13x1250

STANZA (T11)

1.6	CA16S	60	08/81 → 12/85	⊗ ⊗ ⊗ ⊗		SVB10875 SVB13750 TB127	10x875 13x750 95x19
1.8 SGL	CA18S	66	03/83 → 12/85	⊗ ⊗ ⊗ ⊗		SVB10875 SVB13750 TB127	10x875 13x750 95x19

STANZA Hatchback (T11)

1.6	CA16S	60	08/81 → 12/85	⊗ ⊗ ⊗ ⊗		SVB10875 SVB13750 TB127	10x875 13x750 95x19
1.8	CA18, CA18S	65	08/81 → 12/85	⊗ ⊗ ⊗ ⊗	Eng. CA18S Eng. CA18S	SVB10875 TB127 SVB13750	10x875 95x19 13x750
	CA18S	66	08/81 → 12/85	⊗ ⊗ ⊗ ⊗		SVB10875 SVB13750 TB127	10x875 13x750 95x19

SUNNY Box (Y10)

1.6 i 16V	GA16DE	66	10/92 → 03/00	⊗ ⊗ ⊗ ⊗ ⊗	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.7 D	CD17	40	11/90 → 03/00	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	11/91→03/94 10/93→03/94 11/91→10/93 11/91→03/94 11/91→03/94 11/91→03/94	SVB13850 TB469 TB521 TBK053 TB503 SVB13675	13x850 117x25.4 117x25.4 117x25.4 76x19 13x675

SUNNY I (B11)

1.3	E13	44	03/82 → 09/87	⊗ ⊗ ⊗ ⊗	→09/86 →09/86 →09/86	SVB13800 SVB10990 TB261	13x800 10x990 102x19
1.5	E15S	55	03/82 → 10/86	⊗ ⊗ ⊗ ⊗	→05/86 →05/86 →05/86	SVB13800 SVB10990 TB169	13x800 10x990 106x19
1.7 D	CD17	40	03/82 → 10/86	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→05/86 A/C(-), →05/86 →05/86 →05/86 →05/86	SVB13875 SVB13800 TB521 TBK053 TB503	13x875 13x800 117x25.4 117x25.4 76x19



kW



NISSAN

...NISSAN

SUNNY I Coupe (B11)

1.3	E13	44	04/82 → 09/86	 		SVB13800 SVB10990 TB261	13x800 10x990 102x19
1.5	E15S	55	03/82 → 10/86	 	→05/86 →05/86 →05/86	SVB13800 SVB10990 TB169	13x800 10x990 106x19

SUNNY I Traveller (B11)

1.3	E13	44	08/82 → 08/90	 	→05/86 →05/86 →05/86	SVB13800 SVB10990 TB261	13x800 10x990 102x19
1.5	E15S	55	03/82 → 10/86	 	→05/86 →05/86 →05/86	SVB13800 MVB995R4 TB169	13x800 4PK995 106x19
1.7 D	CD17	40	03/82 → 10/86	 	→05/86 A/C(-), →05/86 →05/86 →05/86 →05/86	SVB13875 SVB13800 TB521 TBK053 TB503	13x875 13x800 117x25.4 76x19

SUNNY II (N13)

1.3	E13S	44	07/86 → 10/91	 	→10/88 →10/88 →10/88 →10/88	SVB13800 MVB995R4 TB261 SVB13925	13x800 4PK995 102x19 13x925
1.4 LX	GA14S	55	10/88 → 08/91	 	→09/90 MS, →09/90 →09/90 →09/90	MVB835R4 MVB915R4 TB169 MVB810R4	4PK835 4PK915 106x19 4PK810
1.5	E15S	52	06/86 → 10/88	 		SVB13800 MVB995R4 TB169	13x800 4PK995 106x19
1.6	E16S	62	06/86 → 10/88	 	Alt. 60A Alt. 70A	SVB13800 MVB995R4 MVB1015R4 TB169	13x800 4PK995 4PK1015 106x19
1.6 GTI 16V	CA16D	81	02/87 → 10/88	 	A/C(-) A/C(+)	SVB13925 MVB884R6 MVB730R6 MVB706R4 TB333	13x925 6PK884 6PK730 4PK706 151x19
1.6 i	E16i	54	06/86 → 10/90	 	Alt. 60A Alt. 70A	SVB13800 MVB995R4 MVB1015R4 TB169	13x800 4PK995 4PK1015 106x19
1.6 i 12V	GA16i	66	10/88 → 06/91	 	→09/90 →09/90 →09/90 Alt. 60A, →09/90 Alt. 70A, →09/90 →09/90 →09/90 →09/90	SVB13925 MVB835R4 SVB13800 MVB915R4 MVB995R4 MVB1015R4 TB169 MVB810R4 SVB13925	13x925 4PK835 13x800 4PK915 4PK995 4PK1015 106x19 4PK810 13x925
1.6 i 4x4 (A)	E16i	54	06/86 → 10/90	 	Alt. 60A Alt. 70A	SVB13800 MVB995R4 MVB1015R4 TB169	13x800 4PK995 4PK1015 106x19



kW



...NISSAN

...SUNNY II (N13)

1.7 D	GD17	40	06/86 → 05/89				SVB13850	13x850
						MAN, →03/87	SVB13825	13x825
							TB521	117x25.4
							TBK053	
							TB503	76x19
							SVB13675	13x675

SUNNY II Coupe (B12)

1.6	E16S	62	06/86 → 10/88				SVB13800	13x800
						Alt. 60A	MVB995R4	4PK995
						Alt. 70A	MVB1015R4	4PK1015
							TB169	106x19
							SVB13925	13x925
1.6 GTI 16V	CA16D	81	05/87 → 05/89			→10/88	MVB884R6	6PK884
						A/C(-), →10/88	MVB730R6	6PK730
						A/C(+), →10/88	MVB706R4	4PK706
						→10/88	TB333	151x19
						→10/88	MVB940R4	4PK940
1.6 i	E16i	54	06/86 → 05/89				SVB13800	13x800
						Alt. 60A	MVB995R4	4PK995
						Alt. 70A	MVB1015R4	4PK1015
							TB169	106x19
							SVB13925	13x925
1.6 i 12V	GA16i	66	10/88 → 06/91			→09/90	MVB835R4	4PK835
						MS, →09/90	MVB915R4	4PK915
						PS, →09/90	MVB800R4	4PK800
						→09/90	MVB810R4	4PK810
1.8 GTI 16V	CA18D	92	01/89 → 06/91			→09/90	MVB884R6	6PK884
						A/C(-), →09/90	MVB730R6	6PK730
						A/C(+), →09/90	MVB706R4	4PK706
						→09/90	TB333	151x19
						→09/90	MVB940R4	4PK940

SUNNY II Hatchback (N13)

1.0		37	07/86 → 09/90				SVB13800	13x800
							MVB995R4	4PK995
							TB261	102x19
							SVB13925	13x925
1.3	E13S	44	06/86 → 10/88				SVB13800	13x800
							MVB995R4	4PK995
							TB261	102x19
							SVB13925	13x925
1.4 LX	GA14S	55	01/89 → 08/91			10/90→	MVB835R4	4PK835
						MS, 10/90→	MVB915R4	4PK915
						PS, 10/90→	MVB800R4	4PK800
						10/90→	MVB810R4	4PK810
1.5	E15S	52	06/86 → 10/88				SVB13800	13x800
							MVB995R4	4PK995
							TB169	106x19
							SVB13925	13x925
1.6	E16S	62	06/86 → 10/88				SVB13800	13x800
						Alt. 60A	MVB995R4	4PK995
						Alt. 70A	MVB1015R4	4PK1015
							TB169	106x19
							SVB13925	13x925
1.6 GTI 16V	CA16D	81	06/87 → 05/89			→10/88	MVB884R6	6PK884
						A/C(-), →10/88	MVB730R6	6PK730
						A/C(+), →10/88	MVB706R4	4PK706
						→10/88	TB333	151x19
						→10/88	MVB940R4	4PK940



kw



NISSAN

...NISSAN

...SUNNY II Hatchback (N13)

1.6 i	E16i	54	06/86 → 10/90	 	Alt. 60A Alt. 70A	SVB13800 13x800 MVB995R4 4PK995 MVB1015R4 4PK1015 TB169 106x19 SVB13925 13x925
1.6 i 12V	GA16i	66	06/86 → 10/90	 	10/86 → 10/86 → Alt. 60A Alt. 70A	SVB13800 13x800 MVB835R4 4PK835 MVB915R4 4PK915 MVB995R4 4PK995 MVB1015R4 4PK1015 TB169 106x19 SVB13925 13x925 MVB810R4 4PK810
1.7 D	CD17	40	06/86 → 01/91	 	→09/90 MAN, →03/87 →09/90 →09/90 →09/90	SVB13850 13x850 SVB13825 13x825 TB521 117x25.4 TBK053 TB503 76x19 SVB13675 13x675
1.8 GTI 16V	CA18D	92	01/89 → 06/91	 	→09/90 A/C(-), →09/90 A/C(+), →09/90 →09/90 →09/90	MVB884R6 6PK884 MVB730R6 6PK730 MVB706R4 4PK706 TB333 151x19 MVB940R4 4PK940

SUNNY II Traveller (B12)

1.5	E15S	52	06/86 → 10/88	 		SVB13800 13x800 MVB1000R4 4PK1000 TB169 106x19 SVB13925 13x925
1.6	E16S	62	06/86 → 10/88	 	Alt. 60A Alt. 70A	SVB13800 13x800 MVB995R4 4PK995 MVB1015R4 4PK1015 TB169 106x19 SVB13925 13x925
1.6 i	E16i	54	08/86 → 05/89	 	Alt. 60A Alt. 70A	SVB13800 13x800 MVB995R4 4PK995 MVB1015R4 4PK1015 TB169 106x19 SVB13925 13x925
1.6 i 12V 4x4	GA16i	66	10/88 → 08/90	 	MS PS	MVB835R4 4PK835 MVB915R4 4PK915 MVB800R4 4PK800 MVB810R4 4PK810
1.6 i 4x4 (A)	E16i	54	06/86 → 05/89	 	Alt. 60A Alt. 70A	SVB13800 13x800 MVB995R4 4PK995 MVB1015R4 4PK1015 TB169 106x19 SVB13925 13x925
1.7 D	CD17	40	01/86 → 06/91	 	06/86 →09/90 MAN, 06/86 →03/87 06/86 →09/90 06/86 →09/90 06/86 →09/90, bal. shaft 06/86 →09/90	SVB13850 13x850 SVB13825 13x825 TB503 76x19 TB521 117x25.4 TBK053 SVB13675 13x675

SUNNY III (N14)

1.4 i	GA14DE, GA14DS	55	10/90 → 05/95	 	MS PS	MVB835R4 4PK835 MVB915R4 4PK915 MVB800R4 4PK800 MVB810R4 4PK810
-------	----------------	----	---------------	--------------	----------	--



kW



...NISSAN

...SUNNY III (N14)

1.4 i 16V	GA14DE	64	10/90 → 06/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.6 i	GA16DE, GA16DEL, GA16DS	66	10/90 → 05/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.6 i 16V	GA16DE	75	10/92 → 05/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.6 i 16V 4WD	GA16DS	66	10/90 → 05/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
2.0 D	CD20	55	10/90 → 05/95	 		SVB13850 TB290 TBK053 TB503 SVB13800	13x850 111x25.4 76x19 13x800

SUNNY III Hatchback (N14)

1.4 i	GA14DE, GA14DS	55	10/90 → 05/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.4 i 16V	GA14DE	64	10/90 → 05/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.6 i	GA16DE, GA16DEL, GA16DS	66	10/90 → 05/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.6 i 16V	GA16DE	75	10/92 → 05/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.6 i 16V 4x4	GA16DE	75	10/92 → 05/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
2.0 D	CD20	55	10/90 → 05/95	 		SVB13850 TB290 TBK053 TB503 SVB13800	13x850 111x25.4 76x19 13x800
2.0 GTI 16V	SR20DE	105	10/90 → 05/95	 	A/C(-) A/C(+)	MVB835R4 MVB1035R6 MVB845R4	4PK835 6PK1035 4PK845
2.0 GTI-R 4x4	SR20DET	162	10/90 → 05/95	 		MVB835R4 MVB920R4	4PK835 4PK920

SUNNY III Liftback (N14)

1.4 i	GA14DE, GA14DS	55	10/90 → 05/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.4 i 16V	GA14DE	64	10/90 → 06/95	 	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810



kW



NISSAN

...NISSAN

...SUNNY III Liftback (N14)

1.6 i	GA16DE, GA16DEL, GA16DS	66	10/90 → 05/95	☼ ⚙️ ⚙️ ⚙️	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.6 i 16V	GA16DE	75	10/92 → 05/95	☼ ⚙️ ⚙️ ⚙️	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
2.0 D	CD20	55	10/90 → 05/95	⚙️ 🔧 🔧 🔧 🔧 ⚙️		SVB13850 TB290 TBK053 TB503 SVB13800	13x850 111x25.4 76x19 13x800
2.0 i 16V	SR20DE	105	10/90 → 05/95	⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB835R4 MVB1035R6 MVB845R4	4PK835 6PK1035 4PK845

SUNNY III Traveller (Y10)

1.6 16V 4x4	GA16DS	66	11/90 → 05/95	☼ ⚙️ ⚙️ ⚙️	→03/94 MS, →03/94 PS, →03/94 →03/94	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.6 i	GA16DE, GA16DS	66	06/91 → 03/00	☼ ⚙️ ⚙️ ⚙️	MS PS	MVB835R4 MVB915R4 MVB800R4 MVB810R4	4PK835 4PK915 4PK800 4PK810
1.6 i 16V 4x4	GA16DE	75	10/92 → 03/00	☼ ⚙️ ⚙️ ⚙️ ⚙️ ⚙️ ⚙️	04/94 → MS, 04/94 → 07/95 MS, 07/95 → PS, 04/94 → 07/95 PS, 07/95 → A/C(-), 07/95 → A/C(+), 04/94 →	MVB835R4 MVB915R4 MVB825R4 MVB800R4 MVB1125R4 MVB715R4 MVB810R4	4PK835 4PK915 4PK825 4PK800 4PK1125 4PK715 4PK810
2.0 D	CD20	55	06/91 → 03/00	⚙️ 🔧 🔧 🔧 🔧 ⚙️	→06/96 →06/96 06/96 →	SVB13850 TB290 TBK053 TB503 TB645 SVB13800	13x850 111x25.4 76x19 79x19 13x800

TERRANO I (WD21)

2.4 i 4WD	Z24i	76	10/87 → 02/93	☼ ⚙️ ⚙️	→07/92	SVB13825 SVB10940 SVB131175	13x825 10x940 13x1175
2.7 TD 4WD	TD27T	73	02/89 → 02/96	☼ ⚙️	→01/93 →01/93	SVB13925 SVB131150	13x925 13x1150
3.0 i 4WD	VG30E	109	01/90 → 12/95	⚙️ 🔧 ⚙️	→01/93 →01/93 →01/93	SVB13925 TB128 SVB13900	13x925 133x25.4 13x900

TERRANO II (R20)

2.4 4WD	KA24E	85	05/96 → 01/02	☼ ⚙️ ⚙️		SVB13925 SVB10900 SVB131150	13x925 10x900 13x1150
		87	05/96 →	☼ ⚙️ ⚙️	→11/05 →11/05 →11/05	SVB13925 SVB10900 SVB131150	13x925 10x900 13x1150
2.4 i 12V 4WD	KA24E	91	02/93 → 06/96	☼ ⚙️ ⚙️		SVB13925 SVB10900 SVB131150	13x925 10x900 13x1150
2.7 TD 4WD	TD27T	74	02/93 → 01/02	☼ ⚙️		SVB13925 SVB131150	13x925 13x1150
2.7 TDi 4WD	TD27Ti	92	05/96 →	☼ ⚙️	→11/05 →11/05	SVB13925 SVB131150	13x925 13x1150
3.0 Di 4WD		113	05/02 →	⚙️	→04/06	MVB1638R7	7PK1638





kW



...NISSAN

TIIDA Hatchback (C11X)

1.5 dCi		78	09/07 →			TB713	123x27
---------	--	----	---------	--	--	--------------	--------

TIIDA Saloon (SC11X)

1.5 dCi		78	09/07 →			TB713	123x27
1.8	MR18DE	93	09/07 →		A/C(+)	MVB1200R6	6PK1200

URVAN Box (E23)

2.0	H20	55	07/81 → 11/82		→03/82	SVB10950	10x950
2.2 D		47	07/81 → 11/82		→03/82	SVB131000	13x1000
2.3 D	SD23	50	11/82 → 05/87		→01/87	SVB131500	13x1500
					→01/87	SVB131000	13x1000

URVAN Box (E24)

2.0	Z20	64	05/87 → 05/97		→07/94	SVB13850	13x850
					→07/94	SVB10888	10x888
					→07/94	SVB131125	13x1125
2.3 D	TD23	51	01/88 → 05/97		→06/89	SVB13925	13x925
					→06/89	SVB131150	13x1150
2.5 D	TD25	59	12/88 → 05/97			SVB13925	13x925
						SVB131150	13x1150

URVAN Bus (E23)

2.0 (E23B)	Z20	64	12/82 → 11/88			SVB13850	13x850
						SVB10888	10x888
						SVB131125	13x1125
2.3 D (E23B)	SD23	51	04/85 → 11/88		→01/87	SVB131500	13x1500
					02/87 →	SVB13925	13x925
					→01/87	SVB131000	13x1000
					02/87 →	SVB131150	13x1150

URVAN Bus (E24)

2.0		66	01/92 → 09/93			SVB13850	13x850
						SVB10888	10x888
						SVB131125	13x1125
2.4 i	Z24i	74	05/89 → 09/93			SVB13850	13x850
						SVB13925	13x925
						SVB131125	13x1125
2.5 D	TD25	59	05/89 → 10/96			SVB13925	13x925
						SVB131150	13x1150

VANETTE Box (C22)

1.5	A15S	51	10/86 → 12/95		→06/87	SVB13850	13x850
					→11/94	SVB13825	13x825
					→11/94	SVB10975	10x975
2.0 D	LD20II	49	07/91 → 01/95			SVB13925	13x925
						SVB171045	17x1045
					01/92 → 08/94	SVB131050	13x1050
						TB412	141x30
						TBK080	
					→08/94	SVB13750	13x750

VANETTE Bus (C22)

1.5	A15S	51	10/86 → 12/95		07/87 → 11/94	SVB13825	13x825
					07/87 → 11/94	SVB10975	10x975
2.0 D (ULC22)	LD20	47	10/86 → 12/95		07/87 → 11/94	SVB13925	13x925
					07/87 → 11/94	SVB171045	17x1045
					07/87 → 11/94	TB412	141x30
					07/87 → 11/94	TBK080	
		49	10/86 → 12/95		07/87 → 11/94	SVB13925	13x925
					01/92 → 08/94	SVB131050	13x1050
					07/87 → 11/94	SVB171045	17x1045
					07/87 → 11/94	TB412	141x30
					07/87 → 11/94	TBK080	
					07/87 → 08/94	SVB13750	13x750



kw



NISSAN

...NISSAN

...VANETTE Bus (C22)

2.4 i (SLC22)	Z24i	74	10/86 → 12/95	☼ ☼ ☼	07/87 → 08/94 07/87 → 08/94 07/87 → 08/94	SVB13925 SVB131125 SVB13925 SVB131125	13x925 13x1125 13x925 13x1125
---------------	------	----	---------------	-------------	---	--	--

VANETTE Bus (KC120)

1.5	A15	51	01/83 → 12/87	☼ ☼ Ⓢ	→ 06/87 → 06/87 → 06/87	SVB13825 SVB13850 SVB10975	13x825 13x850 10x975
-----	-----	----	---------------	-------------	-------------------------------	---	----------------------------

VANETTE CARGO Box (HC 23)

1.6 i	GA16DE	71	01/95 →	☼ Ⓢ ☼	→ 05/01 → 05/01 → 05/01	MVB835R4 MVB915R4 MVB810R4	4PK835 4PK915 4PK810
2.3 D	LD23	55	01/95 →	☼ Ⓢ ☼ ☼	→ 05/01 → 05/01 → 05/01 → 05/01	SVB13950 SVB131100 TB487 SVB13850	13x950 13x1100 145x30 13x850

VANETTE CARGO Bus (HC 23)

1.6 i	GA16DE	72	01/96 →	☼ Ⓢ ☼	→ 05/01 → 05/01 → 05/01	MVB835R4 MVB915R4 MVB810R4	4PK835 4PK915 4PK810
2.3 D	LD23	55	01/96 →	☼ Ⓢ ☼ ☼	→ 05/01 → 05/01 → 05/01 → 05/01	SVB13950 SVB131100 TB487 SVB13850	13x950 13x1100 145x30 13x850

X-TRAIL (T30)

2.0	QR20DE	103	07/01 →	Ⓢ	→ 02/07	MVB2250R6	6PK2250
2.0 4x4	QR20DE	103	07/01 →	Ⓢ	→ 02/07	MVB2250R6	6PK2250
2.2 dCi	YD22DDTi	100	12/03 →	☼ Ⓢ	→ 02/07 → 02/07	SVB13900 SVB13975	13x900 13x975
2.2 dCi 4x4	YD22DDTi	100	12/03 →	☼ Ⓢ	→ 02/07 → 02/07	SVB13900 SVB13975	13x900 13x975
2.2 Di 4x4	YD22ETi	84	07/01 →	☼ Ⓢ	→ 09/03 → 09/03	SVB13900 SVB13975	13x900 13x975
2.5 4x4	QR25DE	121	01/03 →	Ⓢ	→ 02/07	MVB2250R6	6PK2250

X-TRAIL (T31)

2.0		104	06/07 →	Ⓢ		MVB1215R6	6PK1215
-----	--	-----	---------	---	--	------------------	---------

OPEL

AGILA

1.3 CDTI	Z 13 DTJ	55	09/07 →	Ⓢ Ⓢ	A/C(-), 05/08 → A/C(+), 05/08 →	MVB1180R6 MVB1318R6	6PK1180 6PK1318
----------	----------	----	---------	--------	------------------------------------	--------------------------------------	--------------------

AGILA (H00)

1.0	Z 10 XEP	44	08/03 →	Ⓢ Ⓢ	A/C(-), → 04/08 A/C(+), → 04/08	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.0 12V	Z 10 XE	43	09/00 →	Ⓢ Ⓢ	A/C(-), → 07/03 A/C(+), → 07/03	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.2 16V	Z 12 XE	55	09/00 →	Ⓢ Ⓢ	A/C(-), → 07/04 A/C(+), → 07/04	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.2 16V Twinport	Z 12 XEP	59	07/04 →	Ⓢ Ⓢ	A/C(-), → 04/08 A/C(+), → 04/08	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.3 CDTI	Z 13 DT	51	08/03 →	Ⓢ Ⓢ	A/C(-), → 04/08 A/C(+), → 04/08	MVB1180R6 MVB1318R6	6PK1180 6PK1318

ANTARA

2.0 CDTI	Z 20 DMH, Z 20 S	110	05/06 →	Ⓢ ☼		MVB2063R6 TB800	6PK2063 151x22
	Z 20 S	93	03/07 →	Ⓢ ☼		MVB2063R6 TB800	6PK2063 151x22



kW



...OPEL

...ANTARA

2.4	Z 24 XED	104	05/06 →		A/C(+)	MVB1885R6	6PK1885
						TB524	171x24
3.2 V6	Z 32 SEE	165	05/06 →			MVB2403R6	6PK2403
	10 HM	167	03/07 →			MVB2403R6	6PK2403

ARENA Box (TB, TF)

1.9 D	F8Q 600, F8Q 606	44	03/98 → 08/01		→04/01, → Eng Nr C018102	MVB1137R6	6PK1137
					→04/01	TB545	153x25.4
					→04/01	TBK098	
2.5 D	S8U 758, S8U 780, S8U 782	55	03/98 → 08/01		→04/01	TB368	152x30
					→04/01	TBK037	

ARENA Combi (THB)

1.9 D	F8Q 600, F8Q 606	44	03/98 → 08/01		→04/01, → Eng Nr C014196	MVB1137R6	6PK1137
					→04/01	TB545	153x25.4
					→04/01	TBK098	
2.5 D	S8U 758, S8U 780, S8U 782	55	03/98 → 08/01		→04/01	TB368	152x30
					→04/01	TBK037	

ASCONA C (81_, 86_, 87_, 88_)

1.3 N	13 N	44	09/81 → 08/86			SVB10875	10x875
						TB129	104x15
1.3 S	13 S	55	09/81 → 08/88			SVB10875	10x875
						TB129	104x15
1.6	16 N	55	09/81 → 09/87		09/82 →	SVB10888	10x888
						SVB10913	10x913
					09/82 →	TB155	111x20
						TB218	104x17
						SVB10850	10x850
	16 SV	60	09/86 → 08/88			SVB10913	10x913
						TB218	104x17
						SVB10850	10x850
1.6 D	16 D, 16 DA	40	03/82 → 08/88			SVB10913	10x913
					AUTO, → Eng Nr 14503756	TB178	147x24
					AUTO, Eng Nr 14503757 →	TB224	146x24
					AUTO, → Eng Nr 14503756	TBK046	
					AUTO, Eng Nr 14503757 →	TBK031	
						SVB10850	10x850
1.6 i	E 16 NZ	55	09/87 → 08/88			SVB10913	10x913
						TB218	104x17
						SVB10850	10x850
1.6 i CAT	C 16 LZ, C 16 NZ	55	09/86 → 08/88			SVB10913	10x913
						TB218	104x17
						SVB10850	10x850
1.6 S	16 SH	66	09/81 → 08/86			SVB10888	10x888
						TB155	111x20
						SVB10850	10x850
1.8	E 18 NV	62	09/87 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
1.8 E	C 18 NE, S 18 NV	74	01/85 → 08/86		09/85 →	SVB10925	10x925
						SVB10888	10x888
						TB155	111x20
					Eng. C18NE	SVB10850	10x850
1.8 i	18 E	85	09/82 → 08/86		→08/84	SVB10888	10x888
					09/83 →	SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
2.0 i	20 NE	85	09/86 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
2.0 i CAT	C 20 NE	85	09/86 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850



kW



...OPEL

OPEL

...ASCONA C (81_, 86_, 87_, 88_)

2.0 i GT	20 SEH	95	03/87 → 08/88			SVB10925 TB155 SVB10850	10x925 111x20 10x850
----------	--------	----	---------------	--	--	--	----------------------------

ASCONA C Hatchback (84_, 89_)

1.3 N	13 N	44	09/81 → 08/86			SVB10875 TB129	10x875 104x15
1.3 S	13 S	55	09/81 → 08/88			SVB10875 TB129	10x875 104x15
1.6	16 N	55	09/81 → 08/88			SVB10888	10x888
					09/82 →	SVB10913	10x913
					09/82 →	TB155	111x20
						TB218	104x17
1.6	16 SV	60	09/86 → 08/88			SVB10850	10x850
						SVB10913	10x913
						TB218	104x17
						SVB10850	10x850
1.6 D	16 D, 16 DA	40	03/82 → 08/88			SVB10913	10x913
						TB224	146x24
					AUTO, Eng Nr 14503757 → MAN, → Eng Nr 14498630	TB178	147x24
					AUTO, → Eng Nr 14503756	TBK046	
					AUTO, Eng Nr 14503757 →	TBK031	
1.6 i	E 16 NZ	55	09/87 → 08/88			SVB10850	10x850
						SVB10913	10x913
						TB218	104x17
						SVB10850	10x850
						SVB10913	10x913
1.6 i CAT	C 16 LZ, C 16 NZ	55	09/86 → 08/88			SVB10913	10x913
						TB218	104x17
						SVB10850	10x850
1.6 S	16 SH	66	09/81 → 08/86			SVB10888	10x888
						TB155	111x20
						SVB10850	10x850
1.8	E 18 NV	62	09/87 → 08/88			SVB10888	10x888
						SVB10925	10x925
						TB155	111x20
1.8 E	C 18 NE, S 18 NV	74	01/85 → 08/86			SVB10850	10x850
						SVB10925	10x925
					09/85 →	SVB10888	10x888
						TB155	111x20
					Eng. C18NE	SVB10850	10x850
1.8 i	18 E	85	09/82 → 08/86		→08/84	SVB10888	10x888
					09/83 →	SVB10925	10x925
						TB155	111x20
2.0 i	20 NE	85	09/86 → 08/88			SVB10850	10x850
						SVB10925	10x925
						TB155	111x20
2.0 i CAT	C 20 NE	85	09/86 → 08/88			SVB10850	10x850
						SVB10925	10x925
						TB155	111x20
2.0 i GT	20 SEH	95	03/87 → 08/88			SVB10850	10x850
						SVB10925	10x925
						TB155	111x20
						SVB10850	10x850



kW



...OPEL

ASTRA F (56_, 57_)

1.4	14 NV	55	09/91 → 09/93	 KIT	MS PS	SVB10875 MVB985R5 TB336 TBK008	10x875 5PK985 111x17
	14 SE	60	09/92 → 09/98	 KIT	A/C(-), MS, →02/98, → Ch. R5999999, R8999999 A/C(-), MS, →02/98, Ch. S5000001, R8000001→ A/C(-), PS, →02/98 A/C(+), PS, →02/98 →02/98 →02/98	SVB10913 SVB10925 MVB1460R6 MVB1805R6 TB336 TBK008	10x913 10x925 6PK1460 6PK1805 111x17
1.4 i	C 14 NZ	44	09/91 → 09/98	 KIT	A/C(-), MS, →02/98, → Ch. S2500015 A/C(-), MS, →02/98, Ch. S5000001, R8000001→ A/C(-), PS, →08/92 A/C(-), PS, 09/92→02/98 A/C(+), PS, →02/98 →02/98 →02/98	SVB10913 SVB10925 MVB985R5 MVB1460R6 MVB1805R6 TB336 TBK008	10x913 10x925 5PK985 6PK1460 6PK1805 111x17
				 KIT	A/C(-), MS, 09/96→01/98 A/C(-), PS, 09/96→01/98 A/C(+), 09/96→01/98 09/96→01/98 09/96→01/98	MVB890R6 MVB1530R6 MVB1805R6 TB780 TBK260	6PK890 6PK1530 6PK1805 169x20
1.4 i 16V	X 14 XE	66	02/96 → 09/98	 KIT	A/C(-), MS, 09/96→01/98 A/C(-), PS, 09/96→01/98 A/C(+), 09/96→01/98 09/96→01/98 09/96→01/98	MVB890R6 MVB1530R6 MVB1805R6 TB780 TBK260	6PK890 6PK1530 6PK1805 169x20
				 KIT	A/C(-), MS, →02/98, → Ch. S2500015 A/C(-), MS, →02/98, Ch. S5000001, R8000001→ A/C(-), PS, →02/98 A/C(-), PS, →07/93, → Ch. N4999999, N5999999 A/C(+), PS, →02/98 →02/98 →02/98	SVB10913 SVB10925 MVB1460R6 MVB985R5 MVB1805R6 TB336 TBK008	10x913 10x925 6PK1460 5PK985 6PK1805 111x17
1.6	16 LZ2, 16 NZR	55	09/95 → 09/98	 KIT	A/C(-), 09/96→01/98 A/C(+), 09/96→01/98 09/96→01/98 09/96→01/98	MVB1460R6 MVB1805R6 TB336 TBK008	6PK1460 6PK1805 111x17
				 KIT	A/C(-), MS, 09/94→, → Ch. R5999999, R8999999 A/C(-), MS, 09/94→, Ch. S5000001, R8000001→ A/C(-), PS, 09/94→ A/C(+), PS, 09/94→ 09/94→ 09/94→	SVB10913 SVB10925 MVB1460R6 MVB1805R6 TB336 TBK008	10x913 10x925 6PK1460 6PK1805 111x17
1.6 i	X 16 SZ	52	05/93 → 07/96	 KIT	A/C(-), MS, 09/94→, → Ch. R5999999, R8999999 A/C(-), MS, 09/94→, Ch. S5000001, R8000001→ A/C(-), PS, 09/94→ A/C(+), PS, 09/94→ 09/94→ 09/94→	SVB10913 SVB10925 MVB1460R6 MVB1805R6 TB336 TBK008	10x913 10x925 6PK1460 6PK1805 111x17
				 KIT	A/C(-), MS A/C(-), PS, →08/92 A/C(-), PS, 09/92→ A/C(+), PS	SVB10913 MVB985R5 MVB1460R6 MVB1805R6 TB336 TBK008	10x913 5PK985 6PK1460 6PK1805 111x17

OPEL



kW



...OPEL

OPEL

...ASTRA F (56_, 57_)

...1.6 i	X 16 SZR	55	08/96 → 09/98	⊗	A/C(-), →01/98	MVB1460R6	6PK1460
				⊗	A/C(+), →01/98	MVB1805R6	6PK1805
				→	→01/98	TB336	111x17
				→	→01/98	TBK008	
				→	→01/98	MVB890R6	6PK890
				→	→01/98	MVB1530R6	6PK1530
1.6 i 16V	X 16 XEL	74	08/94 → 09/98	⊗	A/C(-), MS, →01/98	MVB1805R6	6PK1805
				⊗	A/C(-), PS, →01/98	TB780	169x20
				→	→01/98	TBK260	
				→	→01/98	SVB10913	10x913
				→	→08/92	MVB985R5	5PK985
				→	→09/92	MVB1460R6	6PK1460
1.6 Si	C 16 SE	74	05/92 → 12/94	⊗	A/C(-), PS	MVB1805R6	6PK1805
				⊗	A/C(+), PS	TB336	111x17
				→	→01/98	TBK008	
				→	→01/98	SVB10925	10x925
				→	→08/92	TB224	146x24
				→	→09/92	TB509	176x24
1.7 D	17 D	42	03/92 → 09/92	⊗	→ Eng Nr 14363651	TBK031	
				→	Eng Nr 14363652 →	TBK081	
				→	Eng Nr 14363651	SVB10813	10x813
				→	Eng Nr 14363652 →	SVB10925	10x925
				→	Eng Nr 14363651	TB224	146x24
				→	Eng Nr 14363652 →	TB509	176x24
1.7 D	17 DR	44	07/92 → 09/98	⊗	→02/98	TBK031	
				→	→02/98	SVB10925	10x925
				→	→07/96, → Eng Nr 14363651	TB509	176x24
				→	→02/98	TB224	146x24
				→	→07/96, → Eng Nr 14363651	TBK081	
				→	→02/98	TBK031	
1.7 TD	X 17 DTL	50	11/94 → 09/98	⊗	→02/98	SVB10813	10x813
				→	→02/98	SVB10925	10x925
				→	→02/98	TB509	176x24
				→	→02/98	TBK081	
				→	→02/98	SVB10813	10x813
				→	→02/98	SVB10925	10x925
1.7 TDS	17 DT (TC4EE1), X 17 DT (TC4EE1)	60	03/92 → 09/98	⊗	Eng. 17DT, →01/98	TB413	136x25.4
				→	→01/98	TBK022	
				→	→08/94, → Ch. R... 09/94 →01/98	TBK023	
				→	Eng. 17DT, →01/98	SVB10950	10x950
				→	→08/94	SVB10925	10x925
				→	A/C(-), PS, 09/92 →08/94	MVB1725R6	6PK1725
1.8 i	C 18 NZ	66	03/92 → 09/98	⊗	A/C(+), PS, →08/94	MVB1904R6	6PK1904
				→	→08/94, → Eng Nr 14254438	TB155	111x20
				→	→08/94, Eng Nr 14254439 →	TB508	146x20
				→	→08/94, Eng Nr 14254439 →	TBK032	
				→	→08/92	SVB10800	10x800
				→	→08/92	MVB1725R6	6PK1725
1.8 i 16V	C 18 XE	92	06/93 → 10/94	⊗	A/C(-)	MVB1904R6	6PK1904
				⊗	A/C(+)	TB783	169x24
				→	→01/98	TBK261	
	C 18 XEL, X 18 XE	85	11/94 → 09/98	⊗	A/C(-), →02/98	MVB1725R6	6PK1725
				⊗	A/C(+), →02/98	MVB1904R6	6PK1904
				→	→02/98	TB783	169x24
2.0 i	C 20 NE	85	03/92 → 09/98	⊗	→02/98	TBK261	
				⊗	A/C(-), MS, →08/94	SVB10925	10x925
				⊗	A/C(-), PS, 09/92 →08/94	MVB1725R6	6PK1725
				→	A/C(+), PS, →08/94	MVB1904R6	6PK1904
				→	→08/94, → Eng Nr 14608700	TB155	111x20
				→	→08/94, Eng Nr 14608701 →	TB508	146x20
2.0 i 16V	X 20 XEV	100	02/95 → 09/98	⊗	→08/94, Eng Nr 14608701 →	TBK032	
				⊗	→08/94, Eng Nr 14608701 →	SVB10790	10x790
				→	→08/92	MVB1725R6	6PK1725
				→	A/C(-), →01/98	MVB1904R6	6PK1904
				→	A/C(+), →01/98	TB783	169x24
				→	→01/98	TBK261	



kW



...OPEL

ASTRA F CLASSIC Estate

1.4 i	X 14 NZ	44	01/98 → 01/05		A/C(-), MS, →02/98, → Ch. R5999999, R8999999	SVB10913	10x913
					A/C(+), PS, →02/98	MVB1805R6	6PK1805
					MS, →08/02	SVB10925	10x925
					PS, →08/02	MVB1460R6	6PK1460
					→08/02	TB336	111x17
					→08/02	TBK008	
1.6 i	X 16 SZR	55	01/98 → 01/05		MS, →08/02	SVB10925	10x925
					PS, →08/02	MVB1460R6	6PK1460
					→08/02	TB336	111x17
					→08/02	TBK008	
1.6 i 16V	X 16 XEL	74	01/98 → 01/05		A/C(-), MS, →08/02	MVB890R6	6PK890
					A/C(-), PS, →08/02	MVB1530R6	6PK1530
					A/C(+), →08/02	MVB1805R6	6PK1805
					→08/02	TB780	169x20
					→08/02	TBK260	

ASTRA F CLASSIC Hatchback

1.4 i	X 14 NZ	44	01/98 → 08/02		A/C(-), MS, →02/98, → Ch. R5999999, R8999999	SVB10913	10x913
					A/C(-), MS, Ch. S5000001, R8000001→	SVB10925	10x925
					A/C(-), PS	MVB1460R6	6PK1460
					A/C(+), PS, →02/98	MVB1805R6	6PK1805
						TB336	111x17
						TBK008	
1.6 i	X 16 SZR	55	01/98 → 08/02		MS	SVB10925	10x925
					PS	MVB1460R6	6PK1460
						TB336	111x17
						TBK008	
1.6 i 16V	X 16 XEL	74	01/98 → 08/02		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	

ASTRA F CLASSIC Saloon

1.4 i	X 14 NZ	44	01/98 → 08/02		A/C(-), MS, →02/98, → Ch. R5999999, R8999999	SVB10913	10x913
					A/C(-), MS, Ch. S2500016→	SVB10925	10x925
					A/C(-), PS	MVB1460R6	6PK1460
					A/C(+), PS, →02/98	MVB1805R6	6PK1805
						TB336	111x17
						TBK008	
1.6 i	X 16 SZR	55	01/98 → 08/02		MS	SVB10925	10x925
					PS	MVB1460R6	6PK1460
						TB336	111x17
						TBK008	
1.6 i 16V	X 16 XEL	74	01/98 → 08/02		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	

OPEL



kw



...OPEL

OPEL

ASTRA F Convertible (53_B)

1.4 i 16V	X 14 XE	66	01/96 → 03/01	①	A/C(-), MS, 09/96→	MVB890R6	6PK890	
				②	A/C(-), PS, 09/96→	MVB1530R6	6PK1530	
				③	A/C(+), 09/96→	MVB1805R6	6PK1805	
				④	09/96→	TB780	169x20	
				⑤	09/96→	TBK260		
				⑥	09/96→	TBK260		
				⑦	09/96→	TBK260		
				⑧	09/96→	TBK260		
1.4 Si	C 14 SE	60	05/93 → 03/01	①	A/C(-), MS, → Ch. R5999999, R8999999	SVB10913	10x913	
				②	A/C(-), MS, Ch. S5000001, R80000001→	SVB10925	10x925	
				③	A/C(-), PS	MVB1460R6	6PK1460	
				④	A/C(+), PS	MVB1805R6	6PK1805	
				⑤		TB336	111x17	
				⑥		TBK008		
				⑦		TBK008		
				⑧		TBK008		
1.6 i	X 16 SZ	52	03/93 → 08/96	①	A/C(-), 09/94→	MVB1725R6	6PK1725	
				②	A/C(-), MS, 09/94→, → Ch. R5999999, R8999999	SVB10913	10x913	
				③	A/C(-), MS, 09/94→, Ch. S5000001, R80000001→	SVB10925	10x925	
				④	A/C(-), PS, 09/94→	MVB1460R6	6PK1460	
					⑤	A/C(+), 09/94→	MVB1904R6	6PK1904
					⑥	A/C(+), PS, 09/94→	MVB1805R6	6PK1805
					⑦	09/94→	TB336	111x17
					⑧	09/94→	TB508	146x20
					⑨	09/94→	TBK008	
					⑩	09/94→	TBK008	
					⑪	09/94→	TBK032	
					⑫	09/94→	TBK032	
	X 16 SZR	55	01/96 → 03/01	①	A/C(-), 09/96→	MVB1460R6	6PK1460	
				②	A/C(+), 09/96→	MVB1805R6	6PK1805	
				③	09/96→	TB336	111x17	
				④	09/96→	TBK008		
1.8 i 16V	C 18 XEL, X 18 XE	85	11/94 → 03/01	①	Eng. C18XEL, A/C(-)	MVB1725R6	6PK1725	
				②	Eng. C18XEL, A/C(+)	MVB1904R6	6PK1904	
				③		TB783	169x24	
				④		TBK261		
2.0 i	C 20 NE	85	03/93 → 10/94	①	A/C(-), MS	SVB10925	10x925	
				②	A/C(-), PS	MVB1725R6	6PK1725	
				③	A/C(+), PS	MVB1904R6	6PK1904	
				④	→ Eng Nr 14608700	TB155	111x20	
				⑤	Eng Nr 14608701→	TB508	146x20	
				⑥	Eng Nr 14608701→	TBK032		
				⑦	Eng Nr 14608701→	TBK032		
				⑧	Eng Nr 14608701→	TBK032		

ASTRA F Estate (51_, 52_)

1.4	14 NV	55	09/91 → 09/93	①	MS	SVB10875	10x875
				②	PS	MVB985R5	5PK985
				③		TB336	111x17
				④		TBK008	
	14 SE	60	09/92 → 01/98	①	A/C(-), MS, → Ch. S2500015	SVB10913	10x913
				②	A/C(-), MS, Ch. S2500016→	SVB10925	10x925
				③	A/C(-), PS	MVB1460R6	6PK1460
				④	A/C(+), PS	MVB1805R6	6PK1805
				⑤		TB336	111x17
				⑥		TBK008	
1.4 i	C 14 NZ	44	09/91 → 01/98	①	A/C(-), MS, → Ch. S2500015	SVB10913	10x913
				②	A/C(-), MS, Ch. S5000001, R80000001→	SVB10925	10x925
				③	A/C(-), PS, →08/92	MVB985R5	5PK985
				④	A/C(-), PS, 09/92→	MVB1460R6	6PK1460
				⑤	A/C(+), PS	MVB1805R6	6PK1805
				⑥		TB336	111x17
				⑦		TBK008	
				⑧		TBK008	



kW



...OPEL

...ASTRA F Estate (51_, 52_)

1.4 i 16V	X 14 XE	66	02/96 → 01/98	⊗	A/C(-), MS, 09/96→	MVB890R6	6PK890				
				⊗	A/C(-), PS, 09/96→	MVB1530R6	6PK1530				
				⊗	A/C(+), 09/96→	MVB1805R6	6PK1805				
					09/96→	TB780	169x20				
1.4 Si	C 14 SE	60	03/92 → 01/98		09/96→	TBK260					
					09/96→						
				⊗	A/C(-), MS, → Ch. R8999999	SVB10913	10x913				
				⊗	A/C(-), MS, Ch. R8100001→	SVB10925	10x925				
1.6	16 LZ2, 16 NZR	55	09/95 → 01/98	⊗	A/C(-), PS	MVB1460R6	6PK1460				
				⊗	A/C(-),	MVB985R5	5PK985				
					PS, →07/93, → Ch. N4999999, N5999999						
					A/C(+), PS, → Ch. R5131480, R8000000	MVB1805R6	6PK1805				
						TB336	111x17				
						TBK008					
				⊗	A/C(-), →08/96	MVB1725R6	6PK1725				
				⊗	A/C(+), →08/96	MVB1904R6	6PK1904				
					→08/96	TB508	146x20				
					→08/96	TBK032					
1.6 i	X 16 SZ	52	05/93 → 07/96	⊗	A/C(-), MS, → Ch. R5999999, R8999999	SVB10913	10x913				
				⊗	A/C(-), MS, Ch. S5000001, R8000001→	SVB10925	10x925				
				⊗	A/C(-), PS	MVB1460R6	6PK1460				
				⊗	A/C(+), PS	MVB1805R6	6PK1805				
						TB336	111x17				
						TBK008					
				1.6 i	C 16 NZ, X 16 SZR	55	09/91 → 01/98	⊗	A/C(-), 09/92→	MVB1460R6	6PK1460
								⊗	A/C(-), 09/94→08/96	MVB1725R6	6PK1725
								⊗	A/C(-), MS, →08/96	SVB10913	10x913
								⊗	A/C(-), PS, →08/92	MVB985R5	5PK985
⊗	A/C(+)	MVB1805R6	6PK1805								
⊗	A/C(+), 09/94→08/96	MVB1904R6	6PK1904								
		TB336	111x17								
	09/94→08/96	TB508	146x20								
	09/94→08/96	TBK032									
	Eng. X16SZR	TBK008									
1.6 i 16V	X 16 XEL	74	08/94 → 01/98	⊗	A/C(-), MS	MVB890R6	6PK890				
				⊗	A/C(-), PS	MVB1530R6	6PK1530				
				⊗	A/C(+)	MVB1805R6	6PK1805				
						TB780	169x20				
1.6 Si	C 16 SE	74	03/92 → 12/94			TBK260					
				⊗	A/C(-), MS	SVB10913	10x913				
				⊗	A/C(-), PS, →08/92	MVB985R5	5PK985				
				⊗	A/C(-), PS, 09/92→	MVB1460R6	6PK1460				
1.7 D	17 D	42	12/91 → 09/92	⊗	A/C(+), PS	MVB1805R6	6PK1805				
						TB336	111x17				
						TBK008					
1.7 D	17 DR	44	07/92 → 01/98	⊗		SVB10925	10x925				
						TB224	146x24				
						TB509	176x24				
					→ Eng Nr 14363651	TBK031					
					Eng Nr 14363652→	TBK081					
					→ Eng Nr 14363651	SVB10813	10x813				
					Eng Nr 14363652→						
1.7 D	17 DR	44	07/92 → 01/98	⊗		SVB10925	10x925				
					→07/96, → Eng Nr 14363651	TB224	146x24				
					Eng Nr 14363652→	TB509	176x24				
					→07/96, → Eng Nr 14363651	TBK031					
					Eng Nr 14363652→	TBK081					
						SVB10813	10x813				



kW



...OPEL

OPEL

...ASTRA F Estate (51_, 52_)

1.7 TD	X 17 DTL	50	11/94 → 01/98	⊗	Eng. 17DT	SVB10925	10x925	
						TB509	176x24	
				KIT		TBK081		
1.7 TDS	17 DT (TC4EE1), X 17 DT (TC4EE1)	60	12/91 → 01/98	⊗	→08/94, → Ch. R... 09/94→	SVB10813	10x813	
						SVB13925	13x925	
				KIT		TB413	136x25.4	
1.8 i	C 18 NZ	66	09/91 → 01/98	⊗	Eng. 17DT	TBK022		
				⊗		TBK023		
						SVB10950	10x950	
1.8 i	C 18 NZ	66	09/91 → 01/98	⊗	A/C(-), MS, →08/94	SVB10925	10x925	
				⊗		A/C(-), PS, 09/92→08/94	MVB1725R6	6PK1725
				⊗		A/C(+), PS, →08/94	MVB1904R6	6PK1904
1.8 i 16V	C 18 XE	92	06/93 → 01/98		→08/94, → Eng Nr 14254438	TB155	111x20	
						→08/94, Eng Nr 14254439→	TB508	146x20
				KIT		→08/94, Eng Nr 14254439→	TBK032	
1.8 i 16V	C 18 XE	92	06/93 → 01/98	⊗	→08/92	SVB10800	10x800	
				⊗		A/C(-)	MVB1725R6	6PK1725
						A/C(+)	MVB1904R6	6PK1904
1.8 i 16V	C 18 XEL, X 18 XE	85	07/94 → 01/98		Eng. X18XE, A/C(-)	TB783	169x24	
						Eng. X18XE, A/C(+)	MVB1725R6	6PK1725
				KIT			MVB1904R6	6PK1904
2.0 i	C 20 NE	85	09/91 → 07/94	⊗	→ Eng Nr 14608700	TB155	111x20	
				⊗		Eng Nr 14608701→	TB508	146x20
						Eng Nr 14608701→	TBK032	
2.0 i 16V	C 20 XE	110	03/93 → 01/98	⊗	→08/92	SVB10790	10x790	
				⊗		A/C(-)	MVB1725R6	6PK1725
						A/C(+)	MVB1904R6	6PK1904
2.0 i 16V	C 20 XE	110	03/93 → 01/98		→ Eng Nr 14142838	TB221	141x24	
						Eng Nr 14142839→	TB509	176x24
				KIT		→ Eng Nr 14142838	TBK028	
2.0 i 16V	X 20 XEV	100	02/95 → 01/98	⊗	Eng Nr 14142839→	TBK111		
				⊗		A/C(-)	MVB1725R6	6PK1725
						A/C(+)	MVB1904R6	6PK1904
				KIT		TB783	169x24	
						TBK261		

ASTRA F Hatchback (53_, 54_, 58_, 59_)

1.4	14 NV	55	09/91 → 09/93	⊗	MS	SVB10875	10x875	
				⊗		PS	MVB985R5	5PK985
							TB336	111x17
1.4	14 SE	60	09/92 → 01/98	KIT		TBK008		
				⊗	A/C(-), MS, → Ch. S2500015	SVB10913	10x913	
				⊗	A/C(-), MS, Ch. S2500016→	SVB10925	10x925	
1.4	14 SE	60	09/92 → 01/98	⊗	A/C(-), PS	MVB1460R6	6PK1460	
				⊗		A/C(+), PS	MVB1805R6	6PK1805
							TB336	111x17
1.4 i	C 14 NZ	44	03/92 → 01/98	KIT		TBK008		
				⊗	A/C(-), MS, → Ch. S2500015	SVB10913	10x913	
				⊗	A/C(-), MS, Ch. S5000001, R8000001→	SVB10925	10x925	
1.4 i	C 14 NZ	44	03/92 → 01/98	⊗	A/C(-), PS, →08/92	MVB985R5	5PK985	
				⊗		A/C(-), PS, 09/92→	MVB1460R6	6PK1460
						A/C(+), PS	MVB1805R6	6PK1805
						TB336	111x17	
				KIT		TBK008		



kW



...OPEL

...ASTRA F Hatchback (53_, 54_, 58_, 59_)

1.4 i 16V	X 14 XE	66	01/96 → 01/98	⊗	A/C(-), MS, 09/96 →	MVB890R6	6PK890				
				⊗	A/C(-), PS, 09/96 →	MVB1530R6	6PK1530				
				⊗	A/C(+), 09/96 →	MVB1805R6	6PK1805				
					09/96 →	TB780	169x20				
1.4 Si	C 14 SE	60	03/92 → 01/98		09/96 →	TBK260					
					09/96 →	TBK260					
				⊗	A/C(-), MS, → Ch. R8999999	SVB10913	10x913				
				⊗	A/C(-), MS, Ch. R8100001 →	SVB10925	10x925				
1.6	16 LZ2, 16 NZR	55	09/95 → 01/98	⊗	A/C(-), MS, Ch. R8100001 →	MVB1460R6	6PK1460				
				⊗	A/C(-), PS	MVB985R5	5PK985				
				⊗	A/C(-), PS, →07/93, → Ch. N4999999, N5999999						
				⊗	A/C(+), PS, → Ch. R5131480, R8000000	MVB1805R6	6PK1805				
						TB336	111x17				
						TBK008					
				⊗	A/C(-), →08/96	MVB1725R6	6PK1725				
				⊗	A/C(+), →08/96	MVB1904R6	6PK1904				
					→08/96	TB508	146x20				
					→08/96	TBK032					
1.6 i	X 16 SZ	52	05/93 → 07/96	⊗	A/C(-), MS, 09/94 →, → Ch. R5999999, R8999999	SVB10913	10x913				
				⊗	A/C(-), MS, 09/94 →, Ch. S5000001, R8000001 →	SVB10925	10x925				
				⊗	A/C(-), PS, 09/94 →	MVB1460R6	6PK1460				
				⊗	A/C(+), PS, 09/94 →	MVB1805R6	6PK1805				
					09/94 →	TB336	111x17				
					09/94 →	TBK008					
				1.6 i 16V	X 16 XEL	74	08/94 → 01/98	⊗	A/C(-), 09/92 →	MVB1460R6	6PK1460
								⊗	A/C(-), 09/94 →08/96	MVB1725R6	6PK1725
								⊗	A/C(-), MS, →08/96	SVB10913	10x913
								⊗	A/C(-), PS, →08/92	MVB985R5	5PK985
⊗	A/C(+)	MVB1805R6	6PK1805								
⊗	A/C(+), 09/94 →08/96	MVB1904R6	6PK1904								
		TB336	111x17								
	09/94 →08/96	TB508	146x20								
	09/94 →08/96	TBK032									
	Eng. X16SZR	TBK008									
1.6 Si	C 16 SE	74	03/92 → 12/94	⊗	A/C(-), MS	MVB890R6	6PK890				
				⊗	A/C(-), PS	MVB1530R6	6PK1530				
				⊗	A/C(+)	MVB1805R6	6PK1805				
						TB780	169x20				
1.6 D	17 D	42	12/91 → 09/92			TBK260					
						TBK260					
				⊗	A/C(-), MS	SVB10913	10x913				
				⊗	A/C(-), PS, →08/92	MVB985R5	5PK985				
1.7 D	17 DR	44	07/92 → 01/98	⊗	A/C(-), PS, 09/92 →	MVB1460R6	6PK1460				
				⊗	A/C(+), PS	MVB1805R6	6PK1805				
						TB336	111x17				
						TBK008					
				⊗	→ Eng Nr 14363651	SVB10925	10x925				
					Eng Nr 14363652 →	TB224	146x24				
					→ Eng Nr 14363651	TB509	176x24				
					Eng Nr 14363652 →	TBK031					
						TBK081					
						SVB10813	10x813				
1.7 D	17 DR	44	07/92 → 01/98	⊗	→07/96, → Eng Nr 14363651	SVB10925	10x925				
					Eng Nr 14363652 →	TB224	146x24				
					→07/96, → Eng Nr 14363651	TB509	176x24				
					Eng Nr 14363652 →	TBK031					
						TBK081					
						SVB10813	10x813				



kW



...OPEL

OPEL

...ASTRA F Hatchback (53_, 54_, 58_, 59_)

1.7 TD	X 17 DTL	50	11/94 → 01/98	 		SVB10925 TB509 TBK081 SVB10813	10x925 176x24 10x813
1.7 TDS	17 DT (TC4EE1), X 17 DT (TC4EE1)	60	12/91 → 01/98	 	Eng. 17DT →08/94, → Ch. R... 09/94→ Eng. 17DT	SVB13925 TB413 TBK022 TBK023 SVB10950	13x925 136x25.4 10x950
1.8 i	C 18 NZ	66	09/91 → 01/98	 	A/C(-), MS, →08/94 A/C(-), PS, 09/92→08/94 A/C(+), PS, →08/94 →08/94, → Eng Nr 14254438 →08/94, Eng Nr 14254439→ →08/94, Eng Nr 14254439→ →08/92	SVB10925 MVB1725R6 MVB1904R6 TB155 TB508 TBK032 SVB10800	10x925 6PK1725 6PK1904 111x20 146x20 10x800
1.8 i 16V	C 18 XEL, X 18 XE	85	09/94 → 01/98	 	Eng. X18XE, A/C(-) Eng. X18XE, A/C(+)	MVB1725R6 MVB1904R6 TB783 TBK261	6PK1725 6PK1904 169x24
	C 18 XE	92	06/93 → 08/94	 	A/C(-) A/C(+)	MVB1725R6 MVB1904R6 TB783 TBK261	6PK1725 6PK1904 169x24
2.0 GSI 16V	C 20 XE	110	09/91 → 01/98	 	A/C(-), →08/92 A/C(-), 09/92→ A/C(+) → Eng Nr 14142838 Eng Nr 14142839→ → Eng Nr 14142838 Eng Nr 14142839→ →08/92	SVB10925 MVB1725R6 MVB1904R6 TB221 TB509 TBK028 TBK111 SVB10790	10x925 6PK1725 6PK1904 141x24 176x24 111x20 146x20 10x790
2.0 i	C 20 NE	85	09/91 → 01/98	 	A/C(-), MS, →08/94 A/C(-), PS, 09/92→08/94 A/C(+), PS, →08/94 →08/94, → Eng Nr 14608700 →08/94, Eng Nr 14608701→ →08/94, Eng Nr 14608701→ →08/92	SVB10925 MVB1725R6 MVB1904R6 TB155 TB508 TBK032 SVB10790	10x925 6PK1725 6PK1904 111x20 146x20 10x790
2.0 i 16V	X 20 XEV	100	02/95 → 01/98	 	A/C(-) A/C(+)	MVB1725R6 MVB1904R6 TB783 TBK261	6PK1725 6PK1904 169x24

ASTRA F Van (55_)

1.4 i	C 14 NZ	44	10/91 → 01/99		A/C(-),	SVB10913	10x913
					MS, →08/98, → Ch. R5999999, R8999999		
					A/C(-),	SVB10925	10x925
					MS, →08/98, Ch. S5000001, R8000001→		
					A/C(-), PS, →08/92	MVB985R5	5PK985
					A/C(-), PS, 09/92→08/98	MVB1460R6	6PK1460
					A/C(+), PS, →08/98	MVB1805R6	6PK1805
					→08/98	TB336	111x17
					→08/98	TBK008	



kW



OPEL

...OPEL

...ASTRA F Van (55_)

1.6 i	C 16 NZ	55	10/91 → 04/93	⊗	A/C(-), MS	SVB10913	10x913
				⊗	A/C(-), PS, →08/92	MVB985R5	5PK985
				⊗	A/C(-), PS, 09/92→	MVB1460R6	6PK1460
				⊗	A/C(+), PS	MVB1805R6	6PK1805
						TB336	111x17
				KIT		TBK008	
	X 16 SZ	52	02/93 → 07/96	⊗	A/C(-), MS, 06/93→, → Ch. S2500015	SVB10913	10x913
				⊗	A/C(-), MS, 06/93→, Ch. S5000001, R8000001→	SVB10925	10x925
				⊗	A/C(-), PS, 06/93→	MVB1460R6	6PK1460
				⊗	A/C(+), PS, 06/93→	MVB1805R6	6PK1805
					06/93→	TB336	111x17
				KIT	06/93→	TBK008	
1.7 D	17 DR	44	07/92 → 01/99	⊗	→08/98	SVB10925	10x925
					→08/94, → Eng Nr 14363650	TB224	146x24
					→08/98	TB509	176x24
					→08/94, → Eng Nr 14363650	TBK031	
					→08/98	TBK081	
			⊗	→08/98	SVB10813	10x813	
	17 D	42	12/91 → 09/92	⊗		SVB10925	10x925
					→ Eng Nr 14363650	TB224	146x24
					Eng Nr 14363651→	TB509	176x24
					→ Eng Nr 14363650	TBK031	
					Eng Nr 14363651→	TBK081	
			⊗		SVB10813	10x813	
1.7 TD	X 17 DTL	50	08/94 → 01/99	⊗	→08/98	SVB10925	10x925
					→08/98	TB509	176x24
					→08/98	TBK081	
				⊗	→08/98	SVB10813	10x813

ASTRA G Box (F70)

1.6	X 16 SZR	55	01/99 → 09/00	⊗	A/C(-)	MVB938R5	5PK938
				⊗	A/C(+)	MVB1215R5	5PK1215
						TB336	111x17
						TBK008	
	Z 16 SE	62	09/00 → 04/05	⊗	A/C(-)	MVB938R5	5PK938
				⊗	A/C(+)	MVB1215R5	5PK1215
						TB336	111x17
						TBK008	
1.7 TD	X 17 DTL	50	01/99 → 04/05	⊗	→08/00	MVB885R4	4PK885
				⊗	→08/00	SVB10925	10x925
					→08/00	TB509	176x24
					→08/00	TBK081	
2.0 DI	X 20 DTL	60	01/99 → 04/05	⊗	A/C(-)	MVB1805R6	6PK1805
				⊗	A/C(+)	MVB1875R6	6PK1875

ASTRA G Convertible

1.6	Z 16 XEP	76	01/03 → 10/05	⊗	A/C(-), 10/03→	MVB1450R5	5PK1450
				⊗	A/C(+), 10/03→	MVB1550R5	5PK1550
					10/03→	TB741	146x24
1.6 16V	Z 16 XE	74	03/01 → 10/05	⊗	A/C(-), →01/04	MVB938R5	5PK938
				⊗	A/C(+), →01/04	MVB1215R5	5PK1215
					→01/04	TB638	162x20
					→01/04, → Eng Nr 20041690, 02HL5117	TBK103	
				→01/04, Eng Nr 02HL5118, 20041691→	TBK240		



kW



...OPEL

OPEL

...ASTRA G Convertible

1.8 16V	Z 18 XE	92	03/01 → 10/05	 	A/C(-) A/C(+) → Eng Nr 20041690,02HL5117 Eng Nr 20041691,02HL5118→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
2.0 16V Turbo	Z 20 LER	147	11/02 → 10/05	 		MVB1680R5 TB647	5PK1680 168x24
2.0 OPC	Z 20 LET	141	03/02 → 10/05	 		MVB1680R5 TB647	5PK1680 168x24
2.2 16V	Z 22 SE	108	03/01 → 10/05	 	A/C(-) A/C(+)	MVB875R5 MVB1030R5	5PK875 5PK1030
2.2 DTI	Y 22 DTR	92	09/02 → 10/05	 	A/C(-), 03/03→ A/C(+), 03/03→	MVB1805R6 MVB1875R6	6PK1805 6PK1875

ASTRA G Coupe (F07_)

1.6 16V	Z 16 XEP	76	03/00 → 05/05	 	A/C(-), 02/04→ A/C(+), 02/04→ 02/04→	MVB1450R5 MVB1550R5 TB741	5PK1450 5PK1550 146x24
1.8 16V	X 18 XE1	85	03/00 → 10/00	 	A/C(-) A/C(+) → Eng Nr 02HL5117,20041690 Eng Nr 02HL5118,20041691→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
	Z 18 XE	92	09/00 → 05/05	 	A/C(-) A/C(+) → Eng Nr 02HL5117,20041690 Eng Nr 02HL5118,20041691→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
2.0 16V Turbo	Z 20 LET	140	09/00 → 08/01	 		MVB1680R5 TB647	5PK1680 168x24
		141	08/01 → 05/05	 		MVB1680R5 TB647	5PK1680 168x24
	Z 20 LER	147	11/02 → 05/05	 		MVB1680R5 TB647	5PK1680 168x24
2.2 16V	Z 22 SE	108	09/00 → 05/05	 	A/C(-) A/C(+)	MVB875R5 MVB1030R5	5PK875 5PK1030
2.2 DTI	Y 22 DTR	92	09/02 → 05/05	 	A/C(-), 03/03→ A/C(+), 03/03→	MVB1805R6 MVB1875R6	6PK1805 6PK1875

ASTRA G Estate (F35_)

1.2 16V	X 12 XE	48	02/98 → 09/00	 	A/C(-) A/C(+)	MVB1230R5 MVB1360R5	5PK1230 5PK1360
	Z 12 XE	55	09/00 → 07/04	 	A/C(-) A/C(+)	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.4	Z 14 XEP	66	09/03 → 07/04			MVB1360R5	5PK1360
1.4 16V	X 14 XE, Z 14 XE	66	06/98 → 07/04	 	A/C(-), MS, →08/00 Eng. X14XE, A/C(-), PS, →08/00 Eng. X14XE, A/C(+), →08/00 Eng. Z14XE, A/C(-) Eng. Z14XE, A/C(+) →08/00 Eng. X14XE, →08/00 Eng. Z14XE, → Eng Nr 02HL5117,20041690 Eng. Z14XE, Eng Nr 02HL5118, 20041691→	MVB890R6 MVB1530R6 MVB1805R6 MVB938R5 MVB1215R5 TB638 TB780 TBK260 TBK103 TBK240	6PK890 6PK1530 6PK1805 5PK938 5PK1215 162x20 169x20



kW



...OPEL

...ASTRA G Estate (F35_)

1.6	X 16 SZR	55	02/98 → 09/00		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB336	111x17
						TBK008	
	Z 16 SE	62	09/00 → 07/04		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB336	111x17
						TBK008	
	Z 16 XEP	76	12/02 → 07/04		A/C(-), 02/04→	MVB1450R5	5PK1450
					A/C(+), 02/04→	MVB1550R5	5PK1550
					02/04→	TB741	146x24
1.6 16V	X 16 XEL, Z 16 XE	74	02/98 → 07/04		Eng. Z16XE, A/C(-)	MVB938R5	5PK938
					Eng. Z16XE, A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					Eng. Z16XE, → Eng Nr 20041690,02HL5117	TBK103	
					Eng. Z16XE, Eng Nr 02HL5118, 20041691→	TBK240	
1.6 CNG	Z 16 YNG	71	03/03 → 07/04		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
						TBK240	
1.7 CDTI	Z 17 DTL	59	04/03 → 07/04		A/C(-)	MVB1270R6	6PK1270
					A/C(+)	MVB1600R6	6PK1600
						TB740	129x25
1.7 DTI 16V	Y 17 DT	55	02/00 → 07/04		A/C(-), →06/03	MVB1250R6	6PK1250
					A/C(+), →06/03	MVB1588R6	6PK1588
					→06/03	TB656	131x25
1.7 TD	X 17 DTL	50	02/98 → 08/00			MVB885R4	4PK885
						SVB10925	10x925
						TB509	176x24
						TBK081	
1.8 16V	X 18 XE1	85	02/98 → 09/00		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Eng Nr 02HL5117,20041690	TBK103	
					Eng Nr 02HL5118,20041691→	TBK240	
	Z 18 XE	92	09/00 → 07/04		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Eng Nr 02HL5117,20041690	TBK103	
					Eng Nr 02HL5118,20041691→	TBK240	
2.0 16V	X 20 XEV	100	02/98 → 07/04		A/C(-), →08/00	MVB938R5	5PK938
					A/C(+), →08/00	MVB1680R5	5PK1680
					→08/00	TB647	168x24
2.0 DI	X 20 DTL, Y 20 DTL	60	02/98 → 07/04		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1875R6	6PK1875
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	08/99 → 07/04		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1875R6	6PK1875
2.0 OPC	Z 20 LET	141	09/02 → 07/04			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LER	147	11/02 → 07/04			MVB1680R5	5PK1680
						TB647	168x24
2.2 16V	Z 22 SE	108	03/01 → 07/04		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.2 DTI	Y 22 DTR	92	09/02 → 07/04		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1875R6	6PK1875



kw



...OPEL

OPEL

ASTRA G Hatchback (F48_, F08_)

1.2 16V	X 12 XE	48	02/98 → 09/00		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1360R5	5PK1360
	Z 12 XE	55	09/00 → 01/05		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1360R5	5PK1360
1.4	Z 14 XEP	66	09/03 → 01/05			MVB1360R5	5PK1360
1.4 16V	X 14 XE, Z 14 XE	66	02/98 → 01/05		A/C(-), →07/04	MVB938R5	5PK938
					A/C(+), →07/04	MVB1215R5	5PK1215
					→07/04	TB638	162x20
					→07/04, → Eng Nr 02HL5117, 20041690	TBK103	
					→07/04, Eng Nr 02HL5118, 20041691→	TBK240	
1.6	X 16 SZR	55	02/98 → 09/00		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB336	111x17
						TBK008	
	Z 16 SE	62	09/00 → 01/05		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB336	111x17
						TBK008	
	Z 16 XEP	76	12/02 → 01/05		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.6 16V	X 16 XEL, Z 16 XE	74	02/98 → 01/05		Eng. Z16XE, A/C(-)	MVB938R5	5PK938
					Eng. Z16XE, A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					Eng. Z16XE, → Eng Nr 20041690,02HL5117	TBK103	
					Eng. Z16XE, Eng Nr 02HL5118, 20041691→	TBK240	
1.7 CDTI	Z 17 DTL	59	04/03 → 01/05		A/C(-)	MVB1270R6	6PK1270
					A/C(+)	MVB1600R6	6PK1600
						TB740	129x25
1.7 DTI 16V	Y 17 DT	55	02/00 → 01/05		A/C(-), →06/03	MVB1250R6	6PK1250
					A/C(+), →06/03	MVB1588R6	6PK1588
					→06/03	TB656	131x25
1.7 TD	X 17 DTL	50	02/98 → 08/00			MVB885R4	4PK885
						SVB10925	10x925
						TB509	176x24
						TBK081	
1.8 16V	X 18 XE1	85	02/98 → 09/00		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Eng Nr 02HL5117,20041690	TBK103	
					Eng Nr 02HL5118,20041691→	TBK240	
	Z 18 XE	92	09/00 → 01/05		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Eng Nr 02HL5117,20041690	TBK103	
					Eng Nr 02HL5118,20041691→	TBK240	
2.0 16V	X 20 XEV	100	02/98 → 01/05		A/C(-), →08/00	MVB938R5	5PK938
					A/C(+), →08/00	MVB1680R5	5PK1680
					→08/00	TB647	168x24
2.0 16V OPC	X 20 XER	118	11/99 → 09/02		A/C(-), →08/00	MVB938R5	5PK938
					A/C(+), →08/00	MVB1680R5	5PK1680
					→08/00	TB647	168x24
2.0 DI	X 20 DTL, Y 20 DTL	60	02/98 → 01/05		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1875R6	6PK1875
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	08/99 → 01/05		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1875R6	6PK1875



kW



...OPEL

...ASTRA G Hatchback (F48_, F08_)

2.0 OPC	Z 20 LET	141	09/02 → 01/05		→07/04	MVB1680R5	5PK1680
					→07/04	TB647	168x24
	Z 20 LER, Z 20 LET	147	11/02 → 01/05		→07/04	MVB1680R5	5PK1680
					→07/04	TB647	168x24
2.2 16V	Z 22 SE	108	03/01 → 01/05		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.2 DTI	Y 22 DTR	92	09/02 → 01/05		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1875R6	6PK1875

ASTRA G Saloon (F69_)

1.2 16V	X 12 XE	48	09/98 → 09/00		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1360R5	5PK1360
	Z 12 XE	55	09/00 → 01/05		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1360R5	5PK1360
1.4	Z 14 XEP	66	09/03 → 01/05			MVB1360R5	5PK1360
1.4 16V	X 14 XE, Z 14 XE	66	09/98 → 01/05		A/C(-), →07/04	MVB938R5	5PK938
					A/C(+), →07/04	MVB1215R5	5PK1215
					→07/04	TB638	162x20
					→07/04, → Eng Nr 02HL5117, 20041690	TBK103	
					→07/04, Eng Nr 02HL5118, 20041691→	TBK240	
1.6	X 16 SZR	55	09/98 → 09/00		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB336	111x17
						TBK008	
	Z 16 SE	62	09/00 → 01/05		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB336	111x17
						TBK008	
	Z 16 XEP	76	12/02 → 01/05		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Eng Nr 20041690,02HL5117	TBK103	
					Eng Nr 02HL5118,20041691→	TBK240	
1.6 16V	X 16 XEL, Z 16 XE	74	09/98 → 01/05		Eng. Z16XE, A/C(-)	MVB938R5	5PK938
					Eng. Z16XE, A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					Eng. Z16XE,	TBK103	
					→ Eng Nr 20041690,02HL5117	TBK240	
					Eng. Z16XE, Eng Nr 02HL5118, 20041691→	TBK240	
1.7 CDTI	Z 17 DTL	59	04/03 → 01/05		A/C(-)	MVB1270R6	6PK1270
					A/C(+)	MVB1600R6	6PK1600
						TB740	129x25
1.7 DTI 16V	Y 17 DT	55	02/00 → 01/05		A/C(-), →06/03	MVB1250R6	6PK1250
					A/C(+), →06/03	MVB1588R6	6PK1588
					→06/03	TB656	131x25
1.7 TD	X 17 DTL	50	09/98 → 08/00			MVB885R4	4PK885
						SVB10925	10x925
						TB509	176x24
						TBK081	
1.8 16V	X 18 XE1	85	09/98 → 09/00		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Eng Nr 02HL5117,20041690	TBK103	
					Eng Nr 02HL5118,20041691→	TBK240	
	Z 18 XE	92	09/00 → 01/05		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Eng Nr 02HL5117,20041690	TBK103	
					Eng Nr 02HL5118,20041691→	TBK240	



kW



...OPEL

OPEL

...ASTRA G Saloon (F69_)

2.0 16V	X 20 XEV	100	09/98 → 01/05	 	A/C(-), →08/00 A/C(+), →08/00 →08/00	MVB938R5 MVB1680R5 TB647	5PK938 5PK1680 168x24
2.0 DI	X 20 DTL, Y 20 DTL	60	09/98 → 01/05	 	A/C(-) A/C(+) A/C(+)	MVB1805R6 MVB1875R6	6PK1805 6PK1875
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	08/99 → 01/05	 	A/C(-) A/C(+) A/C(+)	MVB1805R6 MVB1875R6	6PK1805 6PK1875
2.2 16V	Z 22 SE	108	03/01 → 01/05	 	A/C(-) A/C(+) A/C(+)	MVB875R5 MVB1030R5	5PK875 5PK1030
2.2 DTI	Y 22 DTR	92	09/02 → 01/05	 	A/C(-) A/C(+) A/C(+)	MVB1805R6 MVB1875R6	6PK1805 6PK1875

ASTRA H

1.2		59	08/05 →	 	A/C(-) A/C(+) A/C(+)	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.3 CDTI	Z 13 DTH	66	08/05 →	 	A/C(-) A/C(+) A/C(+)	MVB1180R6 MVB1306R6	6PK1180 6PK1306
1.4	Z 14 XEP	66	03/04 →	 	A/C(-) A/C(+) A/C(+)	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.6	Z 16 XEP	77	03/04 →	 	A/C(-) A/C(+) A/C(+) A/C(+)	MVB1450R5 MVB1550R5 TB741	5PK1450 5PK1550 146x24
	Z 16 XER	85	12/06 →	 	A/C(-) A/C(+) A/C(+) A/C(+)	MVB1450R5 MVB1550R5 TB741	5PK1450 5PK1550 146x24
1.6 Turbo	Z 16 LET	132	02/07 →	 	A/C(-) A/C(+) A/C(+) A/C(+)	MVB1450R5 MVB1550R5 TB741	5PK1450 5PK1550 146x24
1.7 CDTI	Z 17 DTL	59	03/04 →	 	A/C(-) A/C(+) A/C(+) A/C(+)	MVB1270R6 MVB1625R6 TB740	6PK1270 6PK1625 129x25
	Z 17 DTH	74	03/04 →	 	A/C(-) A/C(+) A/C(+) A/C(+)	MVB1270R6 MVB1625R6 TB740	6PK1270 6PK1625 129x25
	Z 17 DTR	92	02/07 →	 	A/C(-) A/C(+) A/C(+) A/C(+)	MVB1250R6 TB656	6PK1250 131x25
1.8	Z 18 XE	92	03/04 →	 	A/C(-), →11/06 A/C(+), →11/06 →11/06 →11/06, → Eng Nr 20EB2048	MVB938R5 MVB1215R5 TB638 TBK240	5PK938 5PK1215 162x20
	Z 18 XER	103	01/06 →	 	A/C(-) A/C(+) A/C(+) A/C(+)	MVB1450R5 MVB1550R5 TB741	5PK1450 5PK1550 146x24
1.9 CDTI	Z 19 DTH	110	09/04 →	 	A/C(-) A/C(+) A/C(+) A/C(+) A/C(+)	MVB1050R6 MVB1369R6 TB790 TBK306	6PK1050 6PK1369 199x24
	Z 19 DT	88	06/04 →	 	A/C(-) A/C(+) A/C(+) A/C(+) A/C(+)	MVB1050R6 MVB1369R6 TB790 TBK306	6PK1050 6PK1369 199x24
		74	09/05 →	 	A/C(-) A/C(+) A/C(+) A/C(+) A/C(+)	MVB1050R6 MVB1369R6 TB639 TBK329	6PK1050 6PK1369 190x24
1.9 CDTI 16V	Z 19 DTH, Z 19 DTJ	88	04/04 →	 	A/C(-), 10/04→ A/C(+), 10/04→ 10/04→ 10/04→	MVB1050R6 MVB1369R6 TB639 TBK329	6PK1050 6PK1369 190x24



kW



...OPEL

...ASTRA H

2.0 Turbo	Z 20 LEL	125	03/04 →			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LER	147	09/04 →			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LEH	177	03/05 →		11/05 →	MVB1680R5	5PK1680
					11/05 →	TB647	168x24

ASTRA H Estate

1.3 CDTI	Z 13 DTH	66	08/05 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.4	Z 14 XEP	66	08/04 →		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1360R5	5PK1360
1.6	Z 16 XEP	77	08/04 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
						MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.6 Turbo	Z 16 LET	132	02/07 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.7 CDTI	Z 17 DTL	59	08/04 →		A/C(-)	MVB1270R6	6PK1270
					A/C(+)	MVB1625R6	6PK1625
						TB740	129x25
						MVB1270R6	6PK1270
	Z 17 DTH	74	08/04 →		A/C(-)	MVB1250R6	6PK1250
				A/C(-), 05/06 →	MVB1625R6	6PK1625	
				A/C(+)	MVB1625R6	6PK1625	
						TB740	129x25
					05/06 →	TB656	131x25
	A 17 DTR	92	02/07 →		A/C(-)	MVB1250R6	6PK1250
						TB656	131x25
1.8	Z 18 XE	92	08/04 →		A/C(-), →11/06	MVB938R5	5PK938
					A/C(+), →11/06	MVB1215R5	5PK1215
					→11/06	TB638	162x20
					→11/06, → Eng Nr 20EB2048	TBK240	
	Z 18 XER	103	08/05 →		A/C(-)	MVB1450R5	5PK1450
				A/C(+)	MVB1550R5	5PK1550	
					TB741	146x24	
1.9 CDTI	Z 19 DTH	110	09/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
						TBK306	
	Z 19 DT	88	09/05 →		A/C(-)	MVB1050R6	6PK1050
				A/C(+)	MVB1369R6	6PK1369	
					TB790	199x24	
						TBK306	
		74	09/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB639	190x24
						TBK329	
1.9 CDTI 16V	Z 19 DTJ	88	08/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB639	190x24
						TB790	199x24
						TBK306	
						TBK329	
2.0 Turbo	Z 20 LEL	125	08/04 →			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LER	147	09/04 →			MVB1680R5	5PK1680
						TB647	168x24



kw



...OPEL

OPEL

ASTRA H GTC

1.2		59	08/05 →		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1360R5	5PK1360
1.3 CDTi	Z 13 DTH	66	04/05 →		A/C(-), 08/05 →	MVB1180R6	6PK1180
					A/C(+), 08/05 →	MVB1306R6	6PK1306
1.4	Z 14 XEP	66	03/05 →		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1360R5	5PK1360
1.6	Z 16 XEP	77	03/05 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
	Z 16 XER	85	12/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.6 Turbo	Z 16 LET	132	02/07 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.7 CDTi	Z 17 DTH	74	03/05 →		A/C(-)	MVB1270R6	6PK1270
					A/C(-), 05/06 →	MVB1250R6	6PK1250
					A/C(+)	MVB1625R6	6PK1625
						TB740	129x25
					05/06 →	TB656	131x25
	A 17 DTR	92	02/07 →		A/C(-)	MVB1250R6	6PK1250
						TB656	131x25
1.8	Z 18 XE	92	03/05 →		A/C(-), →11/06	MVB938R5	5PK938
					A/C(+), →11/06	MVB1215R5	5PK1215
					→11/06	TB638	162x20
					→11/06, → Eng Nr 20EB2048	TBK240	
	Z 18 XER	103	01/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.9 CDTi	Z 19 DTH	110	03/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
						TBK306	
		74	01/06 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB639	190x24
						TBK329	
	Z 19 DT	88	09/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
						TBK306	
1.9 CDTi 16V	Z 19 DTJ	88	03/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
						TBK306	
2.0 Turbo	Z 20 LER	147	03/05 →			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LEL	125	03/05 →			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LEH	177	08/05 →			MVB1680R5	5PK1680
						TB647	168x24

ASTRA H TwinTop

1.6	Z 16 XEP	77	09/05 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
	Z 16 XER	85	12/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24



kW



...OPEL

...ASTRA H TwinTop

1.6 Turbo	Z 16 LET	132	02/07 →	⊗	A/C(-)	MVB1450R5	5PK1450
				⊗	A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.8	Z 18 XE	92	09/05 →	⊗	A/C(-)	MVB938R5	5PK938
				⊗	A/C(+)	MVB1215R5	5PK1215
				KIT	→ Eng Nr 20EB2048	TB638	162x20
	Z 18 XER	103	09/05 →	⊗	A/C(-), 02/06→	MVB1450R5	5PK1450
				⊗	A/C(+), 02/06→	MVB1550R5	5PK1550
					02/06→	TB741	146x24
1.9 CDTi	Z 19 DTH	110	09/05 →	⊗	A/C(-)	MVB1050R6	6PK1050
				⊗	A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
2.0 Turbo	Z 20 LEL	125	09/05 →	⊗		MVB1680R5	5PK1680
						TB647	168x24
						MVB1680R5	5PK1680
	Z 20 LER	147	09/05 →			TB647	168x24

CALIBRA A (85_)

2.0 i	C 20 NE	85	06/90 → 07/97	⊗	→08/92	SVB13875	13x875
				⊗	A/C(-), 09/92→12/96	MVB1725R6	6PK1725
				⊗	A/C(+), 09/92→12/96	MVB1904R6	6PK1904
				⊗	Alt. 70A, →08/92	SVB10925	10x925
				⊗	Alt. 90A, →08/90	SVB101000	10x1000
				⊗	Alt. 90A, →08/92	SVB10940	10x940
					→12/96, → Eng Nr 14142838	TB155	111x20
					→12/96, Eng Nr 14142839→	TB508	146x20
				KIT	→12/96, Eng Nr 14142839→	TBK032	
				⊗	A/C(-), →08/92	SVB10800	10x800
	A/C(+), →08/92	SVB10690	10x690				
2.0 i 16V	C 20 XE	110	06/90 → 02/94	⊗	→08/92	SVB13875	13x875
				⊗	A/C(-), 09/92→, Ch. P→	MVB1725R6	6PK1725
				⊗	A/C(+), 09/92→, Ch. P→	MVB1904R6	6PK1904
				⊗	Alt. 70A, →08/92	SVB10913	10x913
				⊗	Alt. 90A, →08/90	SVB101000	10x1000
				⊗	Alt. 90A, →08/92	SVB10940	10x940
					→ Eng Nr 14142838	TB221	141x24
					Eng Nr 14142839→	TB509	176x24
				KIT	→ Eng Nr 14142838	TBK028	
				KIT	Eng Nr 14142839→	TBK111	
	A/C(-), →08/92	SVB10790	10x790				
	A/C(+), →08/92	SVB10690	10x690				
	X 20 XEV	100	02/94 → 07/97	⊗	A/C(-), 09/94→	MVB1725R6	6PK1725
				⊗	A/C(+), 09/94→	MVB1904R6	6PK1904
					09/94→	TB783	169x24
				KIT	09/94→	TBK261	
2.0 i 16V 4x4	C 20 XE	110	06/90 → 02/94	⊗	→08/92	SVB13875	13x875
				⊗	A/C(-), 09/92→, Ch. P→	MVB1725R6	6PK1725
				⊗	A/C(+), 09/92→, Ch. P→	MVB1904R6	6PK1904
				⊗	Alt. 70A, →08/92	SVB10913	10x913
				⊗	Alt. 90A, →08/90	SVB101000	10x1000
				⊗	Alt. 90A, →08/92	SVB10940	10x940
					→ Eng Nr 14142838	TB221	141x24
					Eng Nr 14142839→	TB509	176x24
				KIT	→ Eng Nr 14142838	TBK028	
				KIT	Eng Nr 14142839→	TBK111	
	A/C(-), →08/92	SVB10790	10x790				
	A/C(+), →08/92	SVB10690	10x690				
	X 20 XEV	100	02/94 → 07/97	⊗	A/C(-), 09/94→	MVB1725R6	6PK1725
				⊗	A/C(+), 09/94→	MVB1904R6	6PK1904
					09/94→	TB783	169x24
				KIT	09/94→	TBK261	



kw



...OPEL

...CALIBRA A (85_)

2.0 i 4x4	C 20 NE	85	06/90 → 07/97	☼	→08/92	SVB13875	13x875
				⊗	A/C(-), 09/92→12/96	MVB1725R6	6PK1725
				⊗	A/C(+), 09/92→12/96	MVB1904R6	6PK1904
				⊗	Alt. 70A, →08/92	SVB10925	10x925
				⊗	Alt. 90A, →08/90	SVB101000	10x1000
				⊗	Alt. 90A, →08/92	SVB10940	10x940
				☞	→12/96, → Eng Nr 14142838	TB155	111x20
				☞	→12/96, Eng Nr 14142839→	TB508	146x20
				☞KIT	→12/96, Eng Nr 14142839→	TBK032	
				⊗	A/C(-), →08/92	SVB10800	10x800
				⊗	A/C(+), →08/92	SVB10690	10x690
2.0 i Turbo 4x4	C 20 LET	150	03/92 → 07/97	⊗	A/C(-), →08/96	MVB1725R6	6PK1725
				⊗	A/C(+), →08/96	MVB1904R6	6PK1904
				☞	→08/96, → Eng Nr 14002934	TB221	141x24
				☞	→08/96, Eng Nr 14002935→	TB509	176x24
				☞KIT	→08/96, → Eng Nr 14002934	TBK028	
2.5 i V6	C 25 XE, X 25 XE	125	04/93 → 07/97	⊗	A/C(+), 09/93→, → Ch. S9001729	MVB2265R6	6PK2265
				⊗	Eng. C25XE, A/C(-), 09/93→	MVB1904R6	6PK1904
				⊗	Eng. C25XE, A/C(+), 09/93→, Ch. S9001730→	MVB2020R6	6PK2020
				☞	09/93→	TB481	225x30
				☞KIT	09/93→	TBK091	

CAMPO (TF_)

2.2 D		45	09/90 → 08/92	☞		TB162	87x34
				⊗		SVB131500	13x1500
2.2 D 4x4		45	09/90 → 08/92	☞		TB162	87x34
				⊗		SVB131500	13x1500
2.3 (TFR16)	4 ZD1	69	08/91 → 08/94	⊗		SVB10760	10x760
				⊗		SVB13875	13x875
				☞		TB265	115x19
	23 P	72	08/94 → 09/96	⊗		SVB131025	13x1025
				⊗		SVB10760	10x760
				⊗		SVB13875	13x875
				☞		TB265	115x19
				⊗		SVB131025	13x1025
2.3 4x4 (TFS16)	4 ZD1	69	08/91 → 08/94	⊗		SVB10760	10x760
				⊗		SVB13875	13x875
				☞		TB265	115x19
		72	08/94 → 09/96	⊗		SVB131025	13x1025
				⊗		SVB10760	10x760
				⊗		SVB13875	13x875
				☞		TB265	115x19
				⊗		SVB131025	13x1025
2.5 D (TFR54)	4 JA1	56	08/91 → 06/94	⊗		SVB171055	17x1055
				☞		TB291	119x32
				☞KIT		TBK075	
				⊗		SVB131375	13x1375
2.5 D 4x4 (TFS54)	4 JA1	56	08/91 → 06/94	⊗		SVB171055	17x1055
				☞		TB291	119x32
				☞KIT		TBK075	
				⊗		SVB131375	13x1375
				⊗		SVB171055	17x1055
2.5 DTI	4 JA1	74	12/01 →	☼	→07/03	SVB131500	13x1500
				⊗	→07/03	SVB171055	17x1055
				⊗	→07/03	SVB131375	13x1375
2.5 DTI 4x4	4 JA1	74	12/01 →	☼	→07/03	SVB131500	13x1500
				⊗	→07/03	SVB171055	17x1055
				⊗	→07/03	SVB131375	13x1375



kW



...OPEL

...CAMPO (TF_)

2.5 TD (TFR54)	4 JA1T	56	07/94 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	10/96 →07/01 →07/01 →07/01 →07/01 →07/01 →07/01	SVB131500 SVB171055 TB291 TBK075 SVB131375	13x1500 17x1055 119x32 13x1375
2.5 TD 4x4 (TFS54)	4 JA1T	56	07/94 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	10/96 →07/01 →07/01 →07/01 →07/01 →07/01 →07/01	SVB131500 SVB171055 TB291 TBK075 SVB131375	13x1500 17x1055 119x32 13x1375
3.1 TD (TFR69)	4 JG2T	80	12/92 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	MS, 10/96 →07/01 PS, 10/96 →07/01 →07/01 →07/01 →07/01 →07/01	SVB131325 SVB131525 SVB171055 TB291 TBK075 SVB131450	13x1325 13x1525 17x1055 119x32 13x1450
3.1 TD 4x4 (TFS69)	4 JG2T	80	12/92 →	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	MS, 10/96 →07/01 PS, 10/96 →07/01 →07/01 →07/01 →07/01 →07/01	SVB131325 SVB131525 SVB171055 TB291 TBK075 SVB131450	13x1325 13x1525 17x1055 119x32 13x1450

COMBO (71_)

1.2	C 12 NZ, X 12 SZ	33	07/94 → 10/01	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	MS, →08/94, → Ch. R... MS, Ch. S...→ PS	SVB10913 SVB10925 MVB1460R6 TB336 TBK008	10x913 10x925 6PK1460 111x17
1.4	C 14 NZ, X 14 SZ	44	07/94 → 10/01	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), MS A/C(-), PS A/C(+)	SVB10913 MVB1460R6 MVB1805R6 TB336 TBK008	10x913 6PK1460 6PK1805 111x17
	C 14 SE	60	07/94 → 10/01	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), MS A/C(-), MS, →08/95, Ch. R8100001→ A/C(-), PS A/C(-), PS, →08/95, → Ch. N4999999, N5999999 A/C(+)	SVB10913 SVB10925 MVB1460R6 MVB985R5 MVB1805R6 TB336 TBK008	10x913 10x925 6PK1460 5PK985 6PK1805 111x17
1.7 D	17 D (4EE1), X 17 D (4EE1)	44	07/94 → 10/01	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) Eng. X17D, A/C(+) →08/94, → Ch. R... Eng. X17D	SVB13925 SVB13900 TB413 TBK023 TBK022 SVB10950	13x925 13x900 136x25.4 10x950

COMBO Box Body / Estate

1.3 CDTI 16V	Z 13 DT	51	08/05 →	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318
	Z 13 DTJ	55	10/05 →	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318
1.4 16V	Z 14 XEP	66	08/05 →	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1230R5 MVB1370R5	5PK1230 5PK1370
1.6	Z 16 SE	64	10/01 →	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB938R5 MVB1215R5 TB336 TBK008	5PK938 5PK1215 111x17



kw



...OPEL

OPEL

...COMBO Box Body / Estate

1.6 16V	Z 16 YNG	69	06/06 →	 	A/C(-) A/C(+)	MVB938R5 MVB1215R5 TB638 TBK240	5PK938 5PK1215 162x20
1.6 CNG	Z 16 YNG	71	04/05 →	 	A/C(-), 08/05 → A/C(+), 08/05 → 08/05 → 08/05 →	MVB938R5 MVB1215R5 TB638 TBK240	5PK938 5PK1215 162x20
1.7 DI 16V	Y 17 DTL	48	10/01 →	 	A/C(-) A/C(+)	MVB1250R6 MVB1588R6 TB656	6PK1250 6PK1588 131x25
1.7 DTI 16V	Y 17 DT	55	10/01 →	 	A/C(-) A/C(+)	MVB1250R6 MVB1588R6 TB656	6PK1250 6PK1588 131x25

COMBO Tour

1.3 CDTI 16V	Y 13 DT, Z 13 DT	51	10/04 →	 	Eng. Z13DT, A/C(-) Eng. Z13DT, A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318
	Z 13 DTJ	55	10/05 →	 	A/C(-), 04/06 → A/C(+), 04/06 →	MVB1180R6 MVB1318R6	6PK1180 6PK1318
1.4	Z 14 XEP	66	10/04 →	 	A/C(-) A/C(+)	MVB1230R5 MVB1370R5	5PK1230 5PK1370
1.6	Z 16 SE	64	10/01 →	 	A/C(-) A/C(+)	MVB938R5 MVB1215R5 TB336 TBK008	5PK938 5PK1215 111x17
				 	A/C(-) A/C(+)	MVB938R5 MVB1215R5 TB638 TBK240	5PK938 5PK1215 162x20
1.6 16V	Z 16 YNG	69	06/06 →	 	A/C(-) A/C(+)	MVB938R5 MVB1215R5 TB638 TBK240	5PK938 5PK1215 162x20
1.6 CNG	Z 16 YNG	71	04/05 →	 	A/C(-), 08/05 → A/C(+), 08/05 → 08/05 → 08/05 →	MVB938R5 MVB1215R5 TB638 TBK240	5PK938 5PK1215 162x20
1.7 CDTI 16V	Z 17 DTH	74	12/04 →	 	A/C(-) A/C(+)	MVB1270R6 MVB1600R6 TB656	6PK1270 6PK1600 131x25
1.7 DI 16V	Y 17 DTL	48	10/01 →	 	A/C(-) A/C(+)	MVB1250R6 MVB1588R6 TB656	6PK1250 6PK1588 131x25
1.7 DTI 16V	Y 17 DT	55	10/01 →	 	A/C(-) A/C(+)	MVB1250R6 MVB1588R6 TB656	6PK1250 6PK1588 131x25

CORSA A Box

1.0	10 S	33	02/86 → 04/89	 		SVB10925	10x925
1.2	12 NC, E 12 GV	33	02/86 → 04/89	 	08/87 →	SVB10925	10x925
	12 ST	40	02/86 → 04/89	 		SVB10875 SVB10913 TB190	10x875 10x913 101x17
	12 S	44	02/86 → 07/90	 		SVB10875 SVB10913 TB190	10x875 10x913 101x17
				 		SVB10875 SVB10913 TB129	10x875 10x913 104x15
1.3	13 NB	44	02/86 → 04/89	 		SVB10875 SVB10913 TB129	10x875 10x913 104x15
	13 SB	51	02/86 → 04/89	 		SVB10875 SVB10913 TB129	10x875 10x913 104x15
1.5 D	15 D (4EC1)	37	06/87 → 04/89	 		SVB13875 TB413 TBK021	13x875 136x25.4



kW



...OPEL

CORSA A Hatchback (93_, 94_, 98_, 99_)

1.0	10 S	33	09/82 → 03/93		→08/90	SVB10925	10x925
1.2	12 NC, E 12 GV	33	09/82 → 08/90			SVB10925	10x925
	12 S	44	09/82 → 08/90			SVB10875	10x875
1.2 i	C 12 NZ	33	09/89 → 03/93		09/90 →	SVB10875	10x875
					09/90 →	SVB10913	10x913
					09/90 →	TB336	111x17
				KIT	09/90 →	TBK008	
1.2 N	12 NV	38	01/90 → 03/93		→08/90	SVB10875	10x875
					→08/90	SVB10913	10x913
					→08/90	TB190	101x17
1.2 S	12 ST	40	09/82 → 02/90			SVB10875	10x875
						SVB10913	10x913
						SVB10925	10x925
						TB190	101x17
1.3	13 NB	44	09/85 → 10/89			SVB10875	10x875
						SVB10913	10x913
						TB129	104x15
1.3 i	C 13 N	44	09/86 → 09/90			SVB10875	10x875
						SVB10913	10x913
						TB129	104x15
1.3 S	13 SB	51	09/82 → 10/89			SVB10875	10x875
						SVB10913	10x913
						TB129	104x15
1.4 i	C 14 NZ	44	01/90 → 03/93			SVB10875	10x875
						SVB10913	10x913
						TB218	104x17
					→ Eng Nr 19311737,02J22349	TB336	111x17
		40	01/85 → 03/93		08/88 →	SVB10875	10x875
					08/88 →	SVB10913	10x913
					08/88 →, → Eng Nr 19311737, 02J22349	TB218	104x17
					08/88 →, Eng Nr 19311738, 02J22350 →	TB336	111x17
40	01/85 → 03/93		08/88 →, Eng Nr 19311738, 02J22350 →	TBK008			
1.4 S	14 NV	53	01/90 → 03/93			SVB10875	10x875
						SVB10913	10x913
					→ Eng Nr 19307805,02J223549	TB218	104x17
					Eng Nr 19307806,02J22350 →	TB336	111x17
1.4 Si	C 14 SE	60	09/91 → 03/93			SVB10875	10x875
						SVB10913	10x913
						TB336	111x17
				KIT		TBK008	
1.5 D	15 D (4EC1)	37	09/87 → 03/93			SVB13875	13x875
						TB413	136x25.4
				KIT		TBK021	
1.5 TD	15 DT (T4EC1)	49	03/88 → 03/93			SVB13875	13x875
						TB413	136x25.4
				KIT		TBK021	



kW



...OPEL

OPEL

...CORSA A Hatchback (93_, 94_, 98_, 99_)

1.6 GSI	C 16 SEI	72	09/89 → 03/93	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
					→ Eng Nr 16-02J22349	TB218	104x17
					Eng Nr 16-02J22350→	TB336	111x17
					Eng Nr 16-02J22350→	TBK008	
	E 16 SE	74	05/88 → 03/92	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
					→ Eng Nr 16-02J22349	TB218	104x17
					Eng Nr 16-02J22350→	TB336	111x17
					Eng Nr 16-02J22350→	TBK008	
C 16 NZ	55	08/88 → 09/92	⊗		SVB10875	10x875	
			⊗		SVB10913	10x913	
				→ Eng Nr 16-02J22349	TB218	104x17	
				Eng Nr 16-02J22350→	TB336	111x17	
				Eng Nr 16-02J22350→	TBK008		
1.6 GSI CAT	C 16 SE	74	02/92 → 03/93	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
					→ Eng Nr 16-02J22349	TB218	104x17
					Eng Nr 16-02J22350→	TB336	111x17
					Eng Nr 16-02J22350→	TBK008	

CORSA A TR (91_, 92_, 96_, 97_)

1.0	10 S	33	09/82 → 09/92	⊗	→08/90	SVB10925	10x925
1.2 i	C 12 NZ	33	09/89 → 03/93	⊗	09/90→	SVB10875	10x875
				⊗	09/90→	SVB10913	10x913
					09/90→	TB336	111x17
					09/90→	TBK008	
1.2 N	12 NC, E 12 GV	33	01/85 → 10/87	⊗		SVB10925	10x925
1.2 S	12 ST	40	09/82 → 03/93	⊗	→08/90	SVB10875	10x875
				⊗	→08/90	SVB10913	10x913
					→08/90	TB190	101x17
1.2 S	12 S	43	09/82 → 10/87	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
						TB190	101x17
1.3	13 NB	44	09/85 → 10/87	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
						TB129	104x15
1.3 S	13 SB	51	09/82 → 10/87	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
						TB129	104x15
1.4 i	C 14 NZ	44	10/89 → 03/93	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
					→ Eng Nr 19311737,02J22349	TB218	104x17
					Eng Nr 19311738,02J22350→	TB336	111x17
1.4 S	14 NV	53	09/89 → 03/93	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
					→ Eng Nr 19307805,02J223549	TB218	104x17
					Eng Nr 19307806,02J22350→	TB336	111x17
1.4 S	14 NV	53	09/89 → 03/93	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
					→ Eng Nr 19307805,02J223549	TB218	104x17
					Eng Nr 19307806,02J22350→	TB336	111x17
1.5 D	15 D (4EC1)	37	10/87 → 11/92	⊗		SVB13875	13x875
						TB413	136x25.4
						TBK021	
1.5 TD	15 DT (T4EC1)	49	10/87 → 03/93	⊗		SVB13875	13x875
						TB413	136x25.4
						TBK021	

CORSA B (73_, 78_, 79_, F35_)

1.0 i 12V	X 10 XE	40	11/96 → 09/00	⊗	A/C(-)	MVB1230R5	5PK1230
				⊗	A/C(+)	MVB1360R5	5PK1360



kW



...OPEL

...CORSA B (73_, 78_, 79_, F35_)

1.2 i	C 12 NZ, X 12 SZ	33	03/93 → 09/00		MS, →08/94, → Ch. R...	SVB10913	10x913
					MS, 08/94→, Ch. S...→	SVB10925	10x925
					PS	MVB1460R6	6PK1460
				 KIT		TB336 TBK008	111x17
12 NZ	33	03/93 → 09/00		MS, →08/94, → Ch. R...	SVB10913	10x913	
				MS, 08/94→, Ch. S...→	SVB10925	10x925	
				PS	MVB1460R6	6PK1460	
			 KIT		TB336 TBK008	111x17	
1.2 i 16V	X 12 XE	48	03/98 → 09/00		A/C(-), 08/98→	MVB1230R5	5PK1230
					A/C(+), 08/98→	MVB1360R5	5PK1360
1.4 i	C 14 NZ, X 14 SZ	44	03/93 → 09/00		A/C(-), MS, →08/98	SVB10913	10x913
					A/C(-), PS, →08/98	MVB1460R6	6PK1460
					A/C(+), →08/98	MVB1805R6	6PK1805
				 KIT	→08/98 →08/98	TB336 TBK008	111x17
1.4 i 16V	X 14 XE	66	09/94 → 09/00		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
				 KIT		TB780 TBK260	169x20
C 14 SEL	63	08/97 → 09/00		A/C(-), MS	MVB890R6	6PK890	
				A/C(-), PS	MVB1530R6	6PK1530	
				A/C(+)	MVB1805R6	6PK1805	
			 KIT		TB780 TBK260	169x20	
1.4 Si	C 14 SE	60	03/93 → 09/00		A/C(-), MS, →08/98	SVB10913	10x913
					A/C(-), PS, →08/98	MVB1460R6	6PK1460
					A/C(+), →08/98	MVB1805R6	6PK1805
				 KIT	→08/98 →08/98	TB336 TBK008	111x17
1.5 D	15 D (4EC1)	37	03/93 → 09/00			SVB13925	13x925
						TB413	136x25.4
				 KIT		TBK021	
						SVB10950	10x950
1.5 TD	15 DT (T4EC1), X 15 DT (T4EC1)	49	03/93 → 09/00			SVB13925	13x925
						TB413	136x25.4
				 KIT		TBK021	
						SVB10950	10x950
1.6 GSI 16V	C 16 XE	80	03/93 → 09/00		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
				 KIT		TB780 TBK260	169x20
1.6 i 16V	X 16 XE	78	09/94 → 09/00		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
				 KIT		TB780 TBK260	169x20
C 16 SEL	74	08/97 → 09/00		A/C(-), MS	MVB890R6	6PK890	
				A/C(-), PS	MVB1530R6	6PK1530	
				A/C(+)	MVB1805R6	6PK1805	
			 KIT		TB780 TBK260	169x20	
1.7 D	17 D (4EE1), X 17 D (4EE1)	44	02/96 → 09/00		A/C(-)	SVB13925	13x925
					Eng. X17D, A/C(+)	SVB13900	13x900
				 KIT		TB413 TBK023	136x25.4
					Eng. X17D	SVB10950	10x950



kw



...OPEL

OPEL

CORSA B Box (73_)

1.4 i	X 14 SZ	44	08/99 → 09/00	 	A/C(-), MS A/C(-), PS A/C(+) Eng. X17D, A/C(+)	SVB10913 MVB1460R6 MVB1805R6 TB336 TBK008	10x913 6PK1460 6PK1805 111x17
1.7 D	17 D (4EE1), X 17 D (4EE1)	44	08/99 → 09/00	 	A/C(-) Eng. X17D, A/C(+) Eng. X17D	SVB13925 SVB13900 TB413 TBK023 SVB10950	13x925 13x900 136x25.4 10x950

CORSA C (F08, F68)

1.0	Z 10 XE	43	09/00 →	 	A/C(-), →07/03 A/C(+), →07/03	MVB1230R5 MVB1360R5	5PK1230 5PK1360
	Z 10 XEP	44	06/03 →	 	A/C(-), →07/06 A/C(+), →07/06	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.2	Z 12 XE	55	09/00 →	 	A/C(-), →07/04 A/C(+), →07/04, → Ch. 44001048 A/C(+), →07/04, Ch. 44001049 →	MVB1230R5 MVB1360R5 MVB1370R5	5PK1230 5PK1360 5PK1370
1.2 Twinport	Z 12 XEP	59	07/04 →	 	A/C(-), →07/06 A/C(+), →07/06, → Ch. 36152608 A/C(+), →07/06, Ch. 36152609 →	MVB1230R5 MVB1360R5 MVB1370R5	5PK1230 5PK1360 5PK1370
1.3 CDTI	Z 13 DT	51	06/03 →	 	A/C(-), →07/06 A/C(+), →07/06	MVB1180R6 MVB1318R6	6PK1180 6PK1318
1.4	Z 14 XE	66	09/00 →	 	A/C(-), →07/03 A/C(+), →07/03 →07/03 →07/03, → Eng Nr 02NF0884, 20V82069 →07/03, Eng Nr 02NF0885, 20V82070 →	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
1.4 Twinport	Z 14 XEP	66	06/03 →	 	A/C(-), →07/06 A/C(+), →07/06	MVB1230R5 MVB1370R5	5PK1230 5PK1370
1.7 CDTI	Z 17 DTH	74	06/03 →	 	A/C(-), →07/06 A/C(+), →07/06 →07/06	MVB1270R6 MVB1600R6 TB656	6PK1270 6PK1600 131x25
1.7 DI	Y 17 DTL	48	09/00 →	 	A/C(-), →07/03 A/C(+), →07/03 →07/03	MVB1250R6 MVB1588R6 TB656	6PK1250 6PK1588 131x25
1.7 DTI	Y 17 DT	55	09/00 →	 	A/C(-), →07/03 A/C(+), →07/03 →07/03	MVB1250R6 MVB1588R6 TB656	6PK1250 6PK1588 131x25
1.8	Z 18 XE	92	09/00 →	 	A/C(-), →07/06 A/C(+), →07/06 →07/06 →07/06, → Eng Nr 02NF0884, 20V82069 →07/06, Eng Nr 02NF0885, 20V82070 →	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20

CORSA C Box (F08, W5L)

1.2	Z 12 XEP	59	07/05 →	 	A/C(-), →07/06 A/C(+), →07/06, → Ch. 36152608 A/C(+), →07/06, Ch. 36152609 →	MVB1230R5 MVB1360R5 MVB1370R5	5PK1230 5PK1360 5PK1370
-----	----------	----	---------	----------	--	--	-------------------------------



kW



...OPEL

...CORSA C Box (F08, W5L)

1.2 16V	Z 12 XE	55	09/00 →	⊗ ⊗ ⊗	A/C(-), →07/03 A/C(+), →07/03, → Ch. 44001048 A/C(+), →07/03, Ch. 44001049 →	MVB1230R5 MVB1360R5 MVB1370R5	5PK1230 5PK1360 5PK1370
1.3 CDTI 16V	Z 13 DT	51	08/05 →	⊗ ⊗	A/C(-) A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318
1.4		66	08/03 →	⊗ ⊗	A/C(-) A/C(+)	MVB1230R5 MVB1370R5	5PK1230 5PK1370
1.7 CDTi		74	08/03 →	⊗ ⊗	A/C(-) A/C(+)	MVB1270R6 MVB1600R6	6PK1270 6PK1600
1.7 DI 16V	Y 17 DTL	48	09/00 →	⊗ ⊗ ⊗	A/C(-), →07/03 A/C(+), →07/03 →07/03	TB656 MVB1250R6 MVB1588R6	131x25 6PK1250 6PK1588
1.7 DTI 16V	Y 17 DT	55	09/00 →	⊗ ⊗ ⊗	A/C(-), →07/03 A/C(+), →07/03 →07/03	MVB1250R6 MVB1588R6 TB656	6PK1250 6PK1588 131x25

CORSA D

1.0	Z 10 XEP	44	07/06 →	⊗ ⊗	A/C(-) A/C(+)	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.2	Z 12 XEP	59	07/06 →	⊗ ⊗	A/C(-) A/C(+)	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.3 CDTI	Z 13 DTJ	55	07/06 →	⊗ ⊗	A/C(-) A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318
	Z 13 DTH	66	07/06 →	⊗ ⊗	A/C(-) A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318
1.4	Z 14 XEP	66	07/06 →	⊗ ⊗	A/C(-) A/C(+)	MVB1230R5 MVB1360R5	5PK1230 5PK1360
1.6 Turbo	Z 16 LER	141	02/07 →	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1450R5 MVB1550R5 TB741	5PK1450 5PK1550 146x24
	Z 16 LEL	110	02/07 →	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1450R5 MVB1550R5 TB741	5PK1450 5PK1550 146x24
1.7 CDTI	A 17 DTR	92	07/06 →	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1250R6 MVB1613R6 TB656	6PK1250 6PK1613 131x25

FRONTERA A (5_MWL4)

2.2 i (54MWL4)	X 22 XE	100	03/95 → 10/98	⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1725R6 MVB2050R6 TB524	6PK1725 6PK2050 171x24
2.3 TD (5JMWL4)	23 DTR	74	03/92 → 10/98	⊗ ⊗	→02/95 A/C(-), →02/95	SVB10900 SVB10825	10x900 10x825
2.4 i (53MWL4)	C 24 NE	92	03/92 → 10/98	⊗ ⊗ ⊗ ⊗ ⊗	→02/95 Alt. 90A, →02/95 Not Alt. 90A, →02/95 A/C(-), →02/95 A/C(+), →02/95	SVB131000 SVB10875 SVB10888 SVB10825 SVB10760	13x1000 10x875 10x888 10x825 10x760
2.5 TDS	25TDS (VM41B)	85	09/96 → 10/98	⊗		MVB2188R8	8PK2188
2.8 TD (5BMW4)	28 TDI (4JB1T)	83	03/95 → 10/98	⊗ ⊗ ⊗ ⊗		SVB131525 SVB171055 TB291 TBK075 SVB131450	13x1525 17x1055 119x32 13x1450



kW



...OPEL

OPEL

FRONTERA A Sport (5_SUD2)

2.0 i (52SUD2, 55SUD2)	C 20 NE, X 20 SE	85	03/92 → 10/98	☼ ⊖ ⊖ ☞ ☞ ☞ ☞ ^{KIT} ⊕	Eng. C20NE Eng. C20NE, Alt. 90A Eng. C20NE, Not Alt. 90A → Eng Nr 14142838 Eng Nr 14142839 → Eng. C20NE, Eng Nr 14142839 → Eng. C20NE	SVB131000 SVB101025 SVB101000 TB155 TB508 TBK032 SVB10790	13x1000 10x1025 10x1000 111x20 146x20 10x790
2.5 TDS	25TDS (VM41B)	85	09/96 → 10/98	⊖		MVB2188R8	8PK2188
2.8 TD (53SUD2)	28 TDI (4JB1T)	83	03/95 → 08/96	☼ ⊖ ☞ ☞ ☞ ^{KIT} ⊕		SVB131525 SVB171055 TB291 TBK075 SVB131450	13x1525 17x1055 119x32 13x1450

FRONTERA B (6B_)

2.2 DTI	Y 22 DTH	88	09/02 →	⊖ ⊖	A/C(-), →07/04 A/C(+), →07/04	MVB1805R6 MVB1904R6	6PK1805 6PK1904
2.2 DTI (6B_ZC, 6B_VF, 6B_66, 6B_76)	X 22 DTH, Y 22 DTH	85	10/98 → 09/02	⊖ ⊖	A/C(-) A/C(+)	MVB1805R6 MVB1904R6	6PK1805 6PK1904
2.2 i (6B_ZC, 6B_VF, 6B_66, 6B_76)	X 22 SE, Y 22 SE	100	10/98 →	⊖ ⊖ ☞ ⊖	A/C(-), →07/04 A/C(+), →07/04 →07/04	MVB1725R6 MVB1855R6 TB524	6PK1725 6PK1855 171x24
3.2 i (6B1VF, 6B1_6)	6 VD1, Y 32 NE	151	10/98 →	⊖ ⊖ ☞	A/C(-), →07/04 A/C(+), →07/04 →07/04	MVB2040R6 MVB2280R6 TB436	6PK2040 6PK2280 191x32

GT Convertible

2.0	LNF, Z 20 NHH	194	06/07 →	⊖		MVB1030R5	5PK1030
-----	---------------	-----	---------	---	--	------------------	---------

KADETT E (39_, 49_)

1.2	12 SC	40	09/84 → 07/86	⊖ ⊕		SVB10950 SVB10760	10x950 10x760
1.3 i CAT	C 13 N	44	09/85 → 08/91	⊖ ☞ ⊕		SVB10875 TB129 SVB10760	10x875 104x15 10x760
1.3 N	13 N, 13 NB	44	09/84 → 08/89	⊖ ☞ ⊕		SVB10875 TB129 SVB10760	10x875 104x15 10x760
1.3 S	13 S	55	09/84 → 08/87	⊖ ☞ ⊕		SVB10875 TB129 SVB10760	10x875 104x15 10x760
1.4 i	C 14 NZ	44	01/90 → 08/91	⊖ ☞ ☞ ☞ ^{KIT}	→ Eng Nr 19311737 Eng Nr 19311738 → Eng Nr 19311738 →	SVB10875 TB218 TB336 TBK008	10x875 104x17 111x17
1.4 S	14 NV	55	01/90 → 08/91	⊖ ☞ ☞ ☞ ^{KIT}	→ Eng Nr 19307805,14-02J22349 Eng Nr 19307806,14-02J22350 → Eng Nr 19307806,14-02J22350 →	SVB10875 TB218 TB336 TBK008	10x875 104x17 111x17
1.5 TD	15 DT (T4EC1)	53	07/88 → 08/91	⊖ ☞ ☞ ^{KIT} ⊕		SVB13925 TB413 TBK021 SVB10950	13x925 136x25.4 10x950
1.6 D	16 D, 16 DA	40	09/84 → 01/89	⊖ ☞ ☞ ☞ ^{KIT} ☞ ^{KIT} ⊕ ⊕	AUTO, → Eng Nr 14503756 AUTO, Eng Nr 14503757 → AUTO, → Eng Nr 14503756 MAN, Eng Nr 14498631 → AUTO, → Eng Nr 14503744 AUTO, Eng Nr 14503745 →	SVB10913 TB178 TB224 TBK046 TBK031 SVB10760 SVB10813	10x913 147x24 146x24 10x760 10x813



kW



...OPEL

...KADETT E (39_, 49_)

1.6 i	E 16 NZ	55	09/86 → 08/91	⊗	MS, →08/87	SVB10888	10x888
				⊗	PS, →08/87	SVB10925	10x925
					→08/87	TB155	111x20
				⊗	→08/87	SVB10760	10x760
1.6 i CAT	C 16 LZ, C 16 NZ	55	09/86 → 08/91	⊗	MS, → Ch. H2517837	SVB10913	10x913
				⊗	MS, →08/87	SVB10888	10x888
				⊗	PS	MVB1015R5	5PK1015
				⊗	PS	MVB970R5	5PK970
				⊗	PS	SVB10925	10x925
					→ Eng Nr 16-02J22349	TB218	104x17
					→08/87	TB155	111x20
					Eng Nr 16-02J22350→	TB336	111x17
					Eng Nr 16-02J22350→	TBK008	
				⊗	→08/87	SVB10760	10x760
1.6 S	16 SV	60	09/86 → 08/91	⊗	MS, → Ch. H2517837	SVB10913	10x913
				⊗	MS, Ch. H2517838→	SVB10925	10x925
				⊗	PS	MVB1015R5	5PK1015
				⊗	PS	MVB970R5	5PK970
					→ Eng Nr 16-02J22349	TB218	104x17
		Eng Nr 16-02J22350→	TB336	111x17			
		Eng Nr 16-02J22350→	TBK008				
	16 SH	66	09/84 → 08/86	⊗	MS	SVB10888	10x888
				⊗	PS	SVB10925	10x925
						TB155	111x20
⊗					SVB10760	10x760	
⊗					SVB10913	10x913	
1.7 D	17 D	42	02/89 → 08/91	⊗	09/89→	SVB10913	10x913
					09/89→, → Eng Nr 14363650	TB224	146x24
					09/89→, Eng Nr 14363651→	TB509	176x24
					09/89→, → Eng Nr 14363650	TBK031	
					09/89→, Eng Nr 14363651→	TBK081	
⊗	09/89→	SVB10813	10x813				
1.8	18 E	84	09/87 → 08/90	⊗		SVB10888	10x888
						TB155	111x20
1.8 i	C 18 NE	74	10/85 → 08/86	⊗		SVB10800	10x800
						SVB10925	10x925
				⊗		TB155	111x20
	C 18 NT, C 18 NZ	66	09/90 → 08/91	⊗		SVB10760	10x760
				⊗		SVB10800	10x800
1.8 S	E 18 NV	62	09/87 → 08/91	⊗		SVB10925	10x925
						TB155	111x20
				⊗		SVB10800	10x800
				⊗		SVB10800	10x800
2.0 i	20 NE	85	03/87 → 08/91	⊗		SVB10913	10x913
						TB155	111x20
				⊗		SVB10800	10x800
2.0 i CAT	C 20 NE	85	03/87 → 08/91	⊗		SVB10913	10x913
						TB155	111x20
				⊗		SVB10800	10x800

KADETT E Box (37_, 47_)

1.2	12 SC	40	09/84 → 07/86	⊗		SVB10950	10x950
				⊗		SVB10760	10x760
1.3 N	13 N, 13 NB	44	09/84 → 07/89	⊗	Eng. 13N	SVB10875	10x875
						TB129	104x15
				⊗	Eng. 13N	SVB10760	10x760



kw



...OPEL

...KADETT E Box (37_, 47_)

1.4 i	C 14 NZ	44	01/90 → 08/91	⊗		SVB10875	10x875
					→ Eng Nr 19311737	TB218	104x17
					Eng Nr 19311738→	TB336	111x17
				KIT	Eng Nr 19311738→	TBK008	
1.6 D	16 D, 16 DA	40	08/84 → 08/88	⊗	Eng. 16DA	SVB10913	10x913
					AUTO, → Eng Nr 14503756	TB178	147x24
					AUTO, Eng Nr 14503757→	TB224	146x24
				KIT	Eng. 16DA, AUTO,	TBK046	
					→ Eng Nr 14503756		
				KIT	Eng. 16DA, AUTO,	TBK031	
					Eng Nr 14503757→		
	AUTO, → Eng Nr 14503744	SVB10760	10x760				
	Eng. 16DA, AUTO,	SVB10813	10x813				
	Eng Nr 14503745→						
1.6 i	C 16 NZ	55	08/89 → 09/93	⊗	MS, → Ch. H2517837	SVB10913	10x913
				⊗	MS, Ch. H2517838→	SVB10925	10x925
				⊗	PS	MVB1015R5	5PK1015
				⊗	PS	MVB970R5	5PK970
					→ Eng Nr 16-02J22349	TB218	104x17
					Eng Nr 16-02J22350→	TB336	111x17
				KIT	Eng Nr 16-02J22350→	TBK008	
1.7 D	17 D	42	08/88 → 09/92	⊗	08/89→	SVB10925	10x925
				⊗	09/89→	SVB10913	10x913
					08/89→, → Eng Nr 14363650	TB224	146x24
					08/89→, Eng Nr 14363651→	TB509	176x24
				KIT	08/89→, → Eng Nr 14363650	TBK031	
				KIT	08/89→, Eng Nr 14363651→	TBK081	
				⊗	08/89→	SVB10813	10x813
1.8 i	C 18 NT	66	08/84 → 09/92	⊗	08/88→05/92	SVB10888	10x888
					08/88→05/92	TB155	111x20
				⊗	08/88→05/92	SVB10800	10x800

KADETT E Combo (38_, 48_)

1.3 N	13 N	44	01/86 → 12/89	⊗	→08/89	SVB10875	10x875
					→08/89	TB129	104x15
				⊗	→08/89	SVB10760	10x760
1.3 S	13 S	55	01/86 → 12/89	⊗	→08/89	SVB10875	10x875
					→08/89	TB129	104x15
				⊗	→08/89	SVB10760	10x760
1.4 i	C 14 NZ	44	08/91 → 07/94	⊗	→08/92	SVB10875	10x875
					→08/92, → Eng Nr 19311737	TB218	104x17
					→08/92, Eng Nr 19311738→	TB336	111x17
				KIT	→08/92, Eng Nr 19311738→	TBK008	
1.4 S	14 NV	55	07/89 → 08/91	⊗		SVB10875	10x875
					→ Eng Nr 19307805,14-02J22349	TB218	104x17
					Eng Nr 19307806,14-02J22350→	TB336	111x17
				KIT	Eng Nr 19307806,14-02J22350→	TBK008	
1.6	16 SV	60	09/86 → 12/91	⊗	MS, → Ch. H2517837	SVB10913	10x913
				⊗	MS, Ch. H2517838→	SVB10925	10x925
				⊗	PS	MVB1015R5	5PK1015
				⊗	PS	MVB970R5	5PK970
					→ Eng Nr 16-02J22349	TB218	104x17
					Eng Nr 16-02J22350→	TB336	111x17
				KIT	Eng Nr 16-02J22350→	TBK008	
1.6 D	16 DA	40	01/86 → 12/89	⊗		SVB10913	10x913
					AUTO, → Eng Nr 14503756	TB178	147x24
					AUTO, Eng Nr 14503757→	TB224	146x24
				KIT	AUTO, → Eng Nr 14503756	TBK046	
				KIT	AUTO, Eng Nr 14503757→	TBK031	
				⊗	AUTO, → Eng Nr 14503744	SVB10760	10x760
	AUTO, Eng Nr 14503745→	SVB10813	10x813				



kW



...OPEL

...KADETT E Combo (38_, 48_)

1.6 i	C 16 NZ	55	08/91 → 07/94	⊗	MS, →08/93, → Ch. H2517837	SVB10913	10x913
				⊗	MS, →08/93, Ch. H2517838→	SVB10925	10x925
				⊗	PS, →08/93	MVB1015R5	5PK1015
				⊗	PS, →08/93	MVB970R5	5PK970
					→08/93, → Eng Nr 16-02J22349	TB218	104x17
1.7 D	17 D	42	01/89 → 07/94		→08/93, Eng Nr 16-02J22350→	TB336	111x17
					→08/93, Eng Nr 16-02J22350→	TBK008	
					09/89→	SVB10913	10x913
					09/89→, → Eng Nr 14363650	TB224	146x24
					09/89→, Eng Nr 14363651→	TB509	176x24
1.7 DR	17 DR	44	07/92 → 07/94		09/89→, → Eng Nr 14363650	TBK031	
					09/89→, Eng Nr 14363650	TBK081	
					09/89→, Eng Nr 14363651→	SVB10813	10x813
					09/89→	SVB10913	10x913
					→ Eng Nr 14363650	TB224	146x24
					Eng Nr 14363651→	TB509	176x24
					→ Eng Nr 14363650	TBK031	
					Eng Nr 14363651→	TBK081	
				⊗		SVB10813	10x813

KADETT E Convertible (43B_)

1.3 S	13 S	55	03/87 → 02/93	⊗	→05/92	SVB10875	10x875	
					→05/92	TB129	104x15	
				⊗	→05/92	SVB10760	10x760	
1.4 i	C 14 NZ	44	01/90 → 08/91	⊗		SVB10875	10x875	
					→ Eng Nr 19311737	TB218	104x17	
					Eng Nr 19311738→	TB336	111x17	
1.4 S	14 NV	55	08/90 → 02/93		Eng Nr 19311738→	TBK008		
				⊗	→05/92	SVB10875	10x875	
					→05/92, → Eng Nr 19307805, 14-02J22349	TB218	104x17	
					→05/92, Eng Nr 19307806,	TB336	111x17	
					14-02J22350→	TBK008		
1.6 i	E 16 NZ	55	10/86 → 02/93	⊗	→05/92, Eng Nr 19307806,	TBK008		
				⊗	14-02J22350→			
				⊗	MS, →05/92, → Ch. H2517837	SVB10913	10x913	
				⊗	MS, →05/92, Ch. H2517838→	SVB10925	10x925	
				⊗	PS, →05/92	MVB1015R5	5PK1015	
	1.6 SV	16 SV	60	07/89 → 02/93	⊗	PS, →05/92	MVB970R5	5PK970
						→05/92, → Eng Nr 16-02J22349	TB218	104x17
						→05/92, Eng Nr 16-02J22350→	TB336	111x17
						→05/92, Eng Nr 16-02J22350→	TBK008	
						MS, →05/92, → Ch. H2517837	SVB10913	10x913
1.6 i CAT	C 16 LZ, C 16 NZ	55	10/87 → 02/93	⊗	MS, →05/92, Ch. H2517838→	SVB10925	10x925	
				⊗	PS, →05/92	MVB1015R5	5PK1015	
				⊗	PS, →05/92	MVB970R5	5PK970	
					→05/92, → Eng Nr 16-02J22349	TB218	104x17	
					→05/92, Eng Nr 16-02J22350→	TB336	111x17	
					→05/92, Eng Nr 16-02J22350→	TBK008		
				⊗	MS, →05/92, → Ch. H2517837	SVB10913	10x913	
				⊗	MS, →05/92, Ch. H2517838→	SVB10925	10x925	
				⊗	PS, →05/92	MVB1015R5	5PK1015	
				⊗	PS, →05/92	MVB970R5	5PK970	
2.0		110	09/90 → 05/92		→05/92, → Eng Nr 16-02J22349	TB218	104x17	
					→05/92, Eng Nr 16-02J22350→	TB336	111x17	
					→05/92, Eng Nr 16-02J22350→	TBK008		
2.0 GSi		115	09/90 → 05/92	⊗		SVB10913	10x913	
						TB155	111x20	
				⊗		SVB10800	10x800	
				⊗		SVB10913	10x913	
						TB155	111x20	
				⊗		SVB10800	10x800	



kw



...OPEL

OPEL

...KADETT E Convertible (43B_)

2.0 i	20 NE	85	10/86 → 02/93	⊗ ⊗ ⊗ ⊗	→05/92 →05/92 →05/92	SVB10913 TB155 SVB10800	10x913 111x20 10x800
2.0 i CAT	C 20 NE	85	10/86 → 02/93	⊗ ⊗ ⊗	→05/92 →05/92 →05/92	SVB10913 TB155 SVB10800	10x913 111x20 10x800

KADETT E Estate (35_, 36_, 45_, 46_)

1.2	12 SC	40	09/84 → 07/86	⊗ ⊗ ⊗ ⊗		SVB10875 SVB10950 TB190 SVB10760	10x875 10x950 101x17 10x760
1.3 i CAT	C 13 N	44	09/85 → 08/91	⊗ ⊗ ⊗		SVB10875 TB129 SVB10760	10x875 104x15 10x760
1.3 N	13 N	44	09/84 → 08/91	⊗ ⊗ ⊗		SVB10875 TB129 SVB10760	10x875 104x15 10x760
1.3 S	13 S	55	09/84 → 08/87	⊗ ⊗ ⊗		SVB10875 TB129 SVB10760	10x875 104x15 10x760
1.4 i	C 14 NZ	44	01/90 → 08/91	⊗ ⊗ ⊗ ⊗ ^{KIT}	→ Eng Nr 19311737 Eng Nr 19311738 → Eng Nr 19311738 →	SVB10875 TB218 TB336 TBK008	10x875 104x17 111x17 10x760
1.4 S	14 NV	55	01/90 → 08/91	⊗ ⊗ ⊗ ⊗ ^{KIT}	→ Eng Nr 19307805,14-02J22349 Eng Nr 19307806,14-02J22350 → Eng Nr 19307806,14-02J22350 →	SVB10875 TB218 TB336 TBK008	10x875 104x17 111x17 10x760
1.5 TD	15 DT (T4EC1)	53	07/88 → 08/91	⊗ ⊗ ⊗ ^{KIT} ⊗		SVB13925 TB413 TBK021 SVB10950	13x925 136x25.4 10x950
1.6	16 SV	60	09/86 → 08/91	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ^{KIT}	MS, → Ch. H2517837 MS, Ch. H2517838 → PS PS → Eng Nr 16-02J22349 Eng Nr 16-02J22350 → Eng Nr 16-02J22350 →	SVB10913 SVB10925 MVB1015R5 MVB970R5 TB218 TB336 TBK008	10x913 10x925 5PK1015 5PK970 104x17 111x17 10x760
1.6 D	16 D, 16 DA	40	09/84 → 01/89	⊗ ⊗ ⊗ ^{KIT} ⊗ ^{KIT} ⊗ ⊗	AUTO, → Eng Nr 14503756 AUTO, Eng Nr 14503757 → AUTO, → Eng Nr 14503756 MAN, Eng Nr 14498631 → AUTO, → Eng Nr 14503744 AUTO, Eng Nr 14503745 →	SVB10913 TB178 TB224 TBK046 TBK031 SVB10760 SVB10813	10x913 147x24 146x24 10x760 10x813
1.6 i	E 16 NZ	55	09/86 → 08/91	⊗ ⊗ ⊗ ⊗ ^{KIT}	MS, →08/89 PS, →08/89 →08/89 →08/89	SVB10888 SVB10925 TB155 SVB10760	10x888 10x925 111x20 10x760
1.6 i CAT	C 16 LZ, C 16 NZ	55	09/86 → 08/91	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ^{KIT} ⊗	MS, → Ch. H2517837 MS, →08/89 PS PS PS → Eng Nr 16-02J22349 →08/89 Eng Nr 16-02J22350 → Eng Nr 16-02J22350 → →08/89	SVB10913 SVB10888 MVB1015R5 MVB970R5 SVB10925 TB218 TB155 TB336 TBK008 SVB10760	10x913 10x888 5PK1015 5PK970 10x925 104x17 111x20 111x17 10x760



kW



...OPEL

...KADETT E Estate (35_, 36_, 45_, 46_)

1.6 S	16 SH	66	09/84 → 08/86	⊗	MS	SVB10888	10x888
				⊗	PS	SVB10925	10x925
				⊗		TB155	111x20
				⊗		SVB10760	10x760
1.7 D	17 D	42	02/89 → 08/91	⊗	09/89 →	SVB10913	10x913
				⊗	09/89 →, → Eng Nr 14363650	TB224	146x24
				⊗	09/89 →, Eng Nr 14363651 →	TB509	176x24
				⊗ KIT	09/89 →, → Eng Nr 14363650	TBK031	
				⊗ KIT	09/89 →, Eng Nr 14363651 →	TBK081	
1.8 E	C 18 NE	74	10/85 → 08/86	⊗	09/89 →	SVB10813	10x813
				⊗		SVB10925	10x925
				⊗		TB155	111x20
				⊗		SVB10760	10x760
1.8 i	C 18 NT, C 18 NZ	66	06/85 → 08/91	⊗		SVB10800	10x800
				⊗		SVB10925	10x925
	18 E	85	09/84 → 08/86	⊗		TB155	111x20
				⊗		SVB10888	10x888
1.8 S	E 18 NV	62	09/87 → 08/91	⊗	→09/90	SVB10800	10x800
				⊗	→09/90	TB155	111x20
				⊗	→09/90	SVB10925	10x925
				⊗	→09/90	SVB10800	10x800
2.0 i	20 NE	85	09/87 → 08/91	⊗		SVB10913	10x913
				⊗		TB155	111x20
				⊗		SVB10800	10x800
2.0 i CAT	C 20 NE	85	09/87 → 08/91	⊗		SVB10913	10x913
				⊗		TB155	111x20
				⊗		SVB10800	10x800

KADETT E Hatchback (33_, 34_, 43_, 44_)

1.2	12 SC	40	09/84 → 07/86	⊗		SVB10875	10x875
				⊗		SVB10950	10x950
				⊗		TB190	101x17
				⊗		SVB10760	10x760
1.3 i CAT	C 13 N	44	09/85 → 08/91	⊗		SVB10875	10x875
				⊗		TB129	104x15
				⊗		SVB10760	10x760
1.3 N	13 N, 13 NB	44	09/84 → 08/91	⊗		SVB10875	10x875
				⊗		TB129	104x15
				⊗		SVB10760	10x760
1.3 S	13 S	55	09/84 → 08/87	⊗		SVB10875	10x875
				⊗		TB129	104x15
				⊗		SVB10760	10x760
1.4 i	C 14 NZ	44	01/90 → 08/91	⊗		SVB10875	10x875
				⊗	→ Eng Nr 19311737	TB218	104x17
				⊗	Eng Nr 19311738 →	TB336	111x17
				⊗ KIT	Eng Nr 19311738 →	TBK008	
1.4 S	14 NV	55	01/90 → 08/91	⊗		SVB10875	10x875
				⊗	→ Eng Nr 19307805,14-02J22349	TB218	104x17
				⊗	Eng Nr 19307806,14-02J22350 →	TB336	111x17
				⊗ KIT	Eng Nr 19307806,14-02J22350 →	TBK008	
1.5 TD	15 DT (T4EC1)	53	07/88 → 08/91	⊗		SVB13925	13x925
				⊗		TB413	136x25.4
				⊗		TBK021	
				⊗		SVB10950	10x950



kW



...OPEL

OPEL

...KADETT E Hatchback (33_, 34_, 43_, 44_)

1.6 D	16 D, 16 DA	40	09/84 → 01/89		AUTO, → Eng Nr 14503756	SVB10913	10x913
					AUTO, Eng Nr 14503757→	TB178	147x24
					AUTO, → Eng Nr 14503756	TB224	146x24
					MAN, Eng Nr 14498631→	TBK046	
					AUTO, → Eng Nr 14503744	TBK031	
					AUTO, Eng Nr 14503745→	SVB10760	10x760
						SVB10813	10x813
1.6 i	E 16 NZ	55	09/86 → 08/91		MS, →08/87	SVB10888	10x888
					PS, →08/87	SVB10925	10x925
					→08/87	TB155	111x20
					→08/87	SVB10760	10x760
1.6 i CAT	C 16 LZ, C 16 NZ	55	09/86 → 08/91		MS, → Ch. H2517837	SVB10913	10x913
					MS, →08/87	SVB10888	10x888
					PS	MVB1015R5	5PK1015
					PS	MVB970R5	5PK970
					PS	SVB10925	10x925
					→ Eng Nr 16-02J22349	TB218	104x17
					→08/87	TB155	111x20
					Eng Nr 16-02J22350→	TB336	111x17
					Eng Nr 16-02J22350→	TBK008	
					→08/87	SVB10760	10x760
1.6 S	16 SV	60	09/86 → 08/91		MS, → Ch. H2517837	SVB10913	10x913
					MS, Ch. H2517838→	SVB10925	10x925
					PS	MVB1015R5	5PK1015
					PS	MVB970R5	5PK970
					→ Eng Nr 16-02J22349	TB218	104x17
					Eng Nr 16-02J22350→	TB336	111x17
					Eng Nr 16-02J22350→	TBK008	
	16 SH	66	09/84 → 08/86		MS	SVB10888	10x888
					PS	SVB10925	10x925
						TB155	111x20
						SVB10760	10x760
1.7 D	17 D	42	02/89 → 08/91		09/89→	SVB10913	10x913
					09/89→, → Eng Nr 14363650	TB224	146x24
					09/89→, Eng Nr 14363651→	TB509	176x24
					09/89→, → Eng Nr 14363650	TBK031	
					09/89→, Eng Nr 14363651→	TBK081	
					09/89→	SVB10813	10x813
1.8 E	C 18 NE	74	10/85 → 08/86			SVB10925	10x925
						TB155	111x20
						SVB10760	10x760
						SVB10800	10x800
1.8 GSI	18 E	85	09/84 → 08/86			SVB10888	10x888
						TB155	111x20
						SVB10800	10x800
1.8 i	C 18 NT, C 18 NZ, S 18 NV	66	06/85 → 08/91			SVB10925	10x925
						TB155	111x20
						SVB10800	10x800
1.8 S	E 18 NV, S 18 NV	62	09/87 → 08/91		Eng. E18NV, →09/90	SVB10925	10x925
					→09/90	TB155	111x20
					Eng. E18NV, →09/90	SVB10800	10x800
2.0 GSI	20 NE	85	09/86 → 08/91			SVB10913	10x913
						TB155	111x20
						SVB10800	10x800
	20 SEH	95	09/86 → 08/91			SVB10913	10x913
						TB155	111x20
						SVB10800	10x800



kW



...OPEL

...KADETT E Hatchback (33_, 34_, 43_, 44_)

2.0 GSI 16V	20 XEJ	110	03/88 → 08/91	 	→ Eng Nr 14142838 Eng Nr 14142839 →	SVB13875 SVB10913 TB221 TB509 SVB10790	13x875 10x913 141x24 176x24 10x790
	20 XE	115	12/87 → 08/91	 	→ Eng Nr 14142838 Eng Nr 14142839 →	SVB13875 SVB10913 TB221 TB509 SVB10790	13x875 10x913 141x24 176x24 10x790
2.0 GSI 16V CAT	C 20 XE	110	03/88 → 08/91	 	→ Eng Nr 14142838 Eng Nr 14142839 →	SVB13875 SVB10913 TB221 TB509 SVB10790	13x875 10x913 141x24 176x24 10x790
2.0 GSI CAT	C 20 NE	85	09/86 → 08/91	 		SVB10913 TB155 SVB10800	10x913 111x20 10x800

MANTA B (58_, 59_)

1.3 N	13 N	44	03/79 → 12/80	 		SVB10950 TB129	10x950 104x15
1.3 S	13 S	55	08/81 → 08/86	 		SVB10950 TB129	10x950 104x15
1.6 N	16 N	44	09/75 → 12/80	 	standard cooling (+)	SVB10888 SVB10900	10x888 10x900
1.6 S	16 S	55	09/75 → 12/81	 	→08/81	SVB10888 SVB10900	10x888 10x900
1.8 S	18 S	66	07/82 → 08/87	 	standard cooling (+), →08/81	SVB10975 TB155 TB179	10x975 111x20 45x10
1.9 E	19 E	77	09/75 → 08/77			SVB10888	10x888
1.9 N	19 N	55	08/76 → 12/81	 	→07/80	SVB10888 SVB10900	10x888 10x900
1.9 S	19 S	66	09/75 → 12/80	 	→07/80	SVB10888 SVB10900	10x888 10x900
2.0	20 N	66	08/77 → 12/80			SVB10888	10x888
2.0 E	20 E	81	08/77 → 08/88			SVB10888	10x888
2.0 S	20 S	74	08/77 → 08/84			SVB10888	10x888

MANTA B CC (53_, 55_)

1.3 N	13 N	44	03/79 → 12/80	 		SVB10950 TB129	10x950 104x15
1.3 S	13 S	55	08/79 → 08/86	 		SVB10950 TB129	10x950 104x15
1.6		55	08/77 → 07/81	 	extra cooling (+)	SVB10888 SVB10900	10x888 10x900
1.6 N	16 N	44	09/75 → 12/80	 	standard cooling (+)	SVB10888 SVB10900	10x888 10x900
1.6		55	08/77 → 07/81	 	extra cooling (+)	SVB10888 SVB10900	10x888 10x900
1.6 N	16 N	44	09/75 → 12/80	 	standard cooling (+)	SVB10888 SVB10900	10x888 10x900
1.8 S	18 S	66	07/82 → 08/87	 		SVB10975 TB155 TB179	10x975 111x20 45x10
1.9 N	19 N	55	08/76 → 12/81	 	→07/80	SVB10888 SVB10900	10x888 10x900
2.0	20 N	66	08/77 → 12/80			SVB10888	10x888
		92	08/81 → 07/88			SVB10888	10x888
2.0 E	20 E	81	08/77 → 08/88			SVB10888	10x888
2.0 S	20 S	74	08/77 → 08/84			SVB10888	10x888



kw



...OPEL

...MERIVA

MERIVA

1.3 CDTI	Z 13 DTJ	55	09/03 →		A/C(-)	MVB1250R6	6PK1250
					A/C(+)	MVB1588R6	6PK1588
	Z 13 DT	51	04/05 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1318R6	6PK1318
1.4 16V Twinport	Z 14 XEP	66	07/04 →		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1370R5	5PK1370
1.6	Z 16 SE	64	05/03 →		A/C(-), →07/04	MVB938R5	5PK938
					A/C(+), →07/04	MVB1215R5	5PK1215
					→07/04	TB336	111x17
					→07/04	TBK008	
	Z 16 XEP	77	01/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.6 16V	Z 16 XE	74	05/03 →		A/C(-), →07/05	MVB938R5	5PK938
					A/C(+), →07/05	MVB1215R5	5PK1215
					→07/05	TB638	162x20
					→07/05, → Eng Nr 20EB2049	TBK240	
1.6 Turbo	Z 16 LET	132	09/05 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.7 CDTI	Z 17 DTH	74	09/03 →		A/C(-)	MVB1270R6	6PK1270
					A/C(-), 08/05 →	MVB1250R6	6PK1250
					A/C(+)	MVB1600R6	6PK1600
						TB656	131x25
	Z 17 DTR	92	09/06 →		A/C(-)	MVB1250R6	6PK1250
						TB656	131x25
1.7 DTI	Y 17 DT	55	09/03 →		A/C(-)	MVB1250R6	6PK1250
					A/C(+)	MVB1588R6	6PK1588
						TB656	131x25
1.8	Z 18 XE	92	05/03 →		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Eng Nr 230EK4285	TBK240	

MONTEREY A (UBS_)

3.1 TD (UBS69_)	4 JG2TC	84	09/91 → 07/98			SVB171055	17x1055
						TB291	119x32
						TBK075	
					A/C(-)	SVB131450	13x1450
					A/C(+)	SVB131525	13x1525
3.2 (UBS25_)	6VD1	130	06/92 → 07/98			MVB800R4	4PK800
						MVB960R4	4PK960
						TB393	223x32
						SVB101025	10x1025

MONTEREY B

3.0 DTI	4 JX1	117	07/98 → 08/99			SVB131250	13x1250
						SVB10990	10x990
						TB749	104x22
3.5 V6 24V	6 VE1	158	07/98 → 08/99		A/C(-)	MVB2040R6	6PK2040
					A/C(+)	MVB2280R6	6PK2280
						TB436	191x32

MONZA A (22_)

2.0 E	H 20 E	85	03/83 → 10/84			SVB10888	10x888
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
2.2 E	22 E	85	11/84 → 08/86		→08/85	SVB10888	10x888
					A/C(-), →08/85	SVB10875	10x875
					A/C(+), →08/85	SVB101075	10x1075



kW



...OPEL

...MONZA A (22_)

2.5 E	H 25 E	100	05/81 → 08/86	⊗	09/81 →	SVB10888	10x888
				⊗	A/C(-), 09/81 →	SVB10875	10x875
				⊗	A/C(+), 09/81 →	SVB101075	10x1075
25 E		103	06/84 → 08/86	⊗		SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
2.8	28 H	103	02/78 → 04/81	⊗		SVB10888	10x888
				⊗	MAN, →04/79	SVB10900	10x900
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
3.0	30 H	110	04/78 → 07/82	⊗		SVB10888	10x888
				⊗	MAN, →04/79	SVB10900	10x900
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
3.0 GSE	C 30 LE	115	09/85 → 08/86	⊗		SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
	30 E	132	02/78 → 08/86	⊗		SVB10888	10x888
				⊗	MAN, →04/79	SVB10900	10x900
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075

MOVANO Box (F9)

1.9 DTI	F9Q 770	59	09/00 → 10/01	⊗		MVB1130R6	6PK1130	
				⊗		TB654	153x26	
	F9Q 774	60	10/01 →	⊗	A/C(-), →09/06	MVB1120R5	5PK1120	
				⊗	A/C(+), →09/06	MVB1795R6	6PK1795	
				⊗	→09/06	TB653	132x26	
				⊗	→09/06	TBK275		
2.2 DTI	G9T 720	66	09/00 →	⊗	A/C(-), →09/03	MVB1150R6	6PK1150	
				⊗	A/C(-), eng. PTO shaft (-), 10/03 → 09/06	MVB1103R7	7PK1103	
				⊗	A/C(-), eng. PTO shaft (-), 10/03 → 09/06	MVB1150R7	7PK1150	
				⊗	A/C(+), →09/03	MVB1795R6	6PK1795	
				⊗	A/C(+), eng. PTO shaft (+), 10/03 → 09/06	MVB1788R7	7PK1788	
				⊗	→09/06	TB710	89x25	
				⊗	A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788	
				⊗	A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788	
2.5 CDTI		107	08/06 →	⊗	A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788	
				⊗		TB710	89x25	
				⊗	A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788	
				⊗		TB710	89x25	
				⊗	A/C(-), eng. PTO shaft (-)	MVB1103R7	7PK1103	
				⊗	A/C(-), eng. PTO shaft (-)	MVB1150R7	7PK1150	
2.5 D	S8U 770	59	01/99 → 09/00	⊗		MVB1788R7	7PK1788	
				⊗		MVB1788R7	7PK1788	
				⊗		TB710	89x25	
				⊗	→ Eng Nr 3053818	MVB1200R5	5PK1200	
				⊗	Eng Nr 3053819 →	MVB860R6	6PK860	
				⊗		MVB870R6	6PK870	
				⊗		TB368	152x30	
				⊗		TBK037		
2.5 DTI	G9U 720, G9U 754	84	10/01 →	⊗	A/C(-), →09/03	MVB1150R6	6PK1150	
				⊗	A/C(-), eng. PTO shaft (-), 10/03 →	MVB1103R7	7PK1103	
				⊗	A/C(-), eng. PTO shaft (-), 10/03 →	MVB1150R7	7PK1150	
				⊗	A/C(+), →09/03	MVB1795R6	6PK1795	
				⊗	A/C(+), 10/03 →	MVB1788R7	7PK1788	
					⊗		TB710	89x25
	G9U 754	73	10/03 →	⊗	A/C(-), eng. PTO shaft (-)	MVB1103R7	7PK1103	
				⊗	A/C(-), eng. PTO shaft (-)	MVB1150R7	7PK1150	
				⊗	A/C(+)	MVB1788R7	7PK1788	
				⊗		MVB1788R7	7PK1788	
⊗					TB710	89x25		



kW



...OPEL

OPEL

2.8 DTI	S9W 702	84	01/99 → 10/01	 	→ Eng Nr 3053818 Eng Nr 3053819→	MVB1200R5 MVB838R6 MVB850R6 TB558 TBK102	5PK1200 6PK838 6PK850 154x30
---------	---------	----	---------------	------------------	-------------------------------------	---	---------------------------------------

3.0 DTI		100	10/03 →		→09/06	MVB1920R7	7PK1920
---------	--	-----	---------	--	--------	------------------	---------

MOVANO Combi (J9)

1.9 DTI	F9Q 770	59	09/00 → 10/01	 	A/C(-) A/C(+) →09/06 →09/06 →09/06	MVB1120R5 MVB1795R6 TB653 TBK275	5PK1120 6PK1795 132x26
---------	---------	----	---------------	--------------	--	---	------------------------------

	F9Q 774	60	10/01 →	 	A/C(-), →09/06 A/C(+), →09/06 →09/06 →09/06	MVB1120R5 MVB1795R6 TB653 TBK275	5PK1120 6PK1795 132x26
--	---------	----	---------	--------------	--	---	------------------------------

2.2 DTI	G9T 720	66	09/00 →	 	A/C(-), →09/03 A/C(-), eng. PTO shaft (-), 10/03→09/06 A/C(-), eng. PTO shaft (-), 10/03→09/06 A/C(+), →09/03 A/C(+), eng. PTO shaft (+), 10/03→09/06 →09/06	MVB1150R6 MVB1103R7 MVB1150R7 MVB1795R6 MVB1788R7 TB710	6PK1150 7PK1103 7PK1150 6PK1795 7PK1788 89x25
---------	---------	----	---------	----------------------	--	--	--

2.5 CDTI		107	08/06 →	 	A/C(+), eng. PTO shaft (+) →09/06	MVB1788R7 TB710	7PK1788 89x25
		88	08/06 →	 	A/C(+), eng. PTO shaft (+) →09/06	MVB1788R7 TB710	7PK1788 89x25

2.5 D	S8U 770	59	07/98 → 09/00	 	11/98→ 11/98→, → Eng Nr 3053818 11/98→, Eng Nr 3053819→ 11/98→ 11/98→	MVB1200R5 MVB860R6 MVB870R6 TB368 TBK037	5PK1200 6PK860 6PK870 152x30
-------	---------	----	---------------	------------------	---	---	---------------------------------------

2.5 DTI	G9U 720	84	10/01 →	 	A/C(-), →09/03 A/C(-), eng. PTO shaft (-), 10/03→ A/C(-), eng. PTO shaft (-), 10/03→ A/C(+), →09/03 A/C(+), 10/03→	MVB1150R6 MVB1103R7 MVB1150R7 MVB1795R6 MVB1788R7 TB710	6PK1150 7PK1103 7PK1150 6PK1795 7PK1788 89x25
---------	---------	----	---------	----------------------	--	--	--

2.8 DTI	S9W 702	84	07/98 → 10/01	 	11/98→ 11/98→, → Eng Nr 3053818 11/98→, Eng Nr 3053819→ 11/98→ 11/98→	MVB1200R5 MVB838R6 MVB850R6 TB558 TBK102	5PK1200 6PK838 6PK850 154x30
---------	---------	----	---------------	------------------	---	---	---------------------------------------

3.0 DTi		100	10/03 →		→09/06	MVB1920R7	7PK1920
---------	--	-----	---------	--	--------	------------------	---------

MOVANO Dumptruck (H9)

2.2 DTI	G9T 720	66	09/00 →	 	A/C(-), →09/03 A/C(-), eng. PTO shaft (-), 10/03→09/06 A/C(-), eng. PTO shaft (-), 10/03→09/06 A/C(+), →09/03 A/C(+), eng. PTO shaft (+), 10/03→09/06 →09/06	MVB1150R6 MVB1103R7 MVB1150R7 MVB1795R6 MVB1788R7 TB710	6PK1150 7PK1103 7PK1150 6PK1795 7PK1788 89x25
---------	---------	----	---------	----------------------	--	--	--



kW



...OPEL

...MOVANO Dumptruck (H9)

2.5 CDTI		74	08/06 →		A/C(-), eng. PTO shaft (-)	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-)	MVB1150R7	7PK1150
					A/C(+)	MVB1788R7	7PK1788
						TB710	89x25
		88	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
		107	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
2.5 D	S8U 770	59	01/99 → 09/00			MVB1200R5	5PK1200
					→ Eng Nr 3053818	MVB860R6	6PK860
					Eng Nr 3053819→	MVB870R6	6PK870
						TB368	152x30
						TBK037	
2.5 DTi	G9U 754	74	10/03 →		A/C(-), eng. PTO shaft (-)	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-)	MVB1150R7	7PK1150
					A/C(+)	MVB1788R7	7PK1788
						TB710	89x25
2.8 DTi	S9W 702	84	01/99 → 10/01			MVB1200R5	5PK1200
					→ Eng Nr 3053818	MVB838R6	6PK838
					Eng Nr 3053819→	MVB850R6	6PK850
						TB558	154x30
						TBK102	

MOVANO Flatbed / Chassis (U9, E9)

2.2 DTi	G9T 720	66	09/00 →		A/C(-), →09/03	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), 10/03→09/06	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-), 10/03→09/06	MVB1150R7	7PK1150
					A/C(+), →09/03	MVB1795R6	6PK1795
					A/C(+), eng. PTO shaft (+), 10/03→09/06	MVB1788R7	7PK1788
					→09/06	TB710	89x25
2.5 CDTI		107	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
		88	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
		74	08/06 →		A/C(-), eng. PTO shaft (-)	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-)	MVB1150R7	7PK1150
					A/C(+)	MVB1788R7	7PK1788
						TB710	89x25
2.5 D	S8U 770	59	07/98 → 09/00		11/98→	MVB1200R5	5PK1200
					11/98→, → Eng Nr 3053818	MVB860R6	6PK860
					11/98→, Eng Nr 3053819→	MVB870R6	6PK870
					11/98→	TB368	152x30
					11/98→	TBK037	
2.5 DTi	G9U 720, G9U 754	84	10/01 →		A/C(-), →09/03	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), 10/03→	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-), 10/03→	MVB1150R7	7PK1150
					A/C(+), →09/03	MVB1795R6	6PK1795
					A/C(+), 10/03→	MVB1788R7	7PK1788
						TB710	89x25
	G9U 754	73	10/03 →		A/C(-), eng. PTO shaft (-)	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-)	MVB1150R7	7PK1150
					A/C(+)	MVB1788R7	7PK1788
						TB710	89x25
2.8 DTi	S9W 702	84	07/98 → 10/01		11/98→	MVB1200R5	5PK1200
					11/98→, → Eng Nr 3053818	MVB838R6	6PK838
					11/98→, Eng Nr 3053819→	MVB850R6	6PK850
					11/98→	TB558	154x30
					11/98→	TBK102	



kW



...OPEL

OPEL

3.0 DTI		100	10/03 →		→09/06	MVB1920R7	7PK1920
OMEGA A (16_, 17_, 19_)							
1.8	E 18 NVR	65	09/87 → 03/94	 	→04/93 →04/93	SVB101000 TB155	10x1000 111x20
	18 SEH	85	09/86 → 03/94	 	→04/93 →08/87 →08/87, → Eng Nr 14608700 →08/87, Eng Nr 14608701→ →08/87, Eng Nr 14608701→	SVB10800 SVB101000 TB155 TB508 TBK032	10x800 10x1000 111x20 146x20
					→08/87	SVB10800	10x800
1.8 N	18 NV	60	09/86 → 08/87	 		SVB101000 TB155	10x1000 111x20
						SVB10800	10x800
1.8 S	18 SV	66	09/86 → 03/94	 	→04/93 →04/93	SVB101000 TB155	10x1000 111x20
					→04/93	SVB10800	10x800
2.0	20 SE	90	09/86 → 03/94	 	MS PS	SVB10813 SVB10790	10x813 10x790
					Alt. 90A	SVB101025	10x1025
					Not Alt. 90A	SVB101000	10x1000
					→ Eng Nr 14608700	TB155	111x20
					Eng Nr 14608701→	TB508	146x20
					Eng Nr 14608701→	TBK032	
						SVB10800	10x800
2.0 i	C 20 NE	85	09/86 → 03/94	 	MS PS	SVB10813 SVB10790	10x813 10x790
					Alt. 90A	SVB101025	10x1025
					Not Alt. 90A	SVB101000	10x1000
					→ Eng Nr 14608700	TB155	111x20
					Eng Nr 14608701→	TB508	146x20
					Eng Nr 14608701→	TBK032	
						SVB10800	10x800
2.3 D	23 YD	54	10/86 → 03/94	 	→ Ch. K1000098 Ch. K1000099→	SVB10888 SVB10913	10x888 10x913
					A/C(-)	SVB10900	10x900
					A/C(+)	SVB10813	10x813
					A/C(+)	SVB10960	10x960
2.3 TD	23 YDT	66	10/86 → 08/88	 	→ Ch. K1000098 Ch. K1000099→	SVB10888 SVB10913	10x888 10x913
					A/C(-)	SVB10900	10x900
					A/C(+)	SVB10813	10x813
					A/C(+)	SVB10960	10x960
2.3 TD Interc.	23 DTR	74	08/88 → 03/94	 	→ Ch. K1000098 Ch. K1000099→	SVB10888 SVB10913	10x888 10x913
					A/C(-)	SVB10900	10x900
					A/C(+)	SVB10813	10x813
					A/C(+)	SVB10960	10x960
2.4 i	C 24 NE	92	09/88 → 03/94	 	A/C(-)	SVB10888 SVB10813	10x888 10x813
					A/C(+)	SVB10960	10x960
2.6 i	C 26 NE	110	09/90 → 03/94	 	A/C(-)	MVB1460R6	6PK1460
					A/C(+), → Eng Nr 01032426	MVB2225R6	6PK2225
					A/C(+), Alt. 120A, Eng Nr 01032427→	MVB2265R6	6PK2265
					A/C(+), Not Alt. 120A, Eng Nr 01032427→	MVB2271R6	6PK2271





kW



...OPEL

...OMEGA A (16_, 17_, 19_)

3.0 (3000)	C 30 LE	115	03/87 → 12/87	⚙️	→ Ch. M 1000000	SVB10888	10x888
				⚙️	A/C(-), Ch. M 1000001→	MVB1460R6	6PK1460
				⚙️	A/C(+), → Eng Nr 01039674,	MVB2225R6	6PK2225
					Ch. M 1000001→		
				⚙️	A/C(+), Alt. 120A,	MVB2265R6	6PK2265
					Eng Nr 01039675→		
				⚙️	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271
					Eng Nr 01039675→		
				⚙️	A/C(-), → Ch. M 1000000	SVB10813	10x813
					A/C(+), → Ch. M 1000000	SVB10960	10x960
30 NE	130	03/87 → 09/90	⚙️	→ Ch. M 1000000	SVB10888	10x888	
			⚙️	A/C(-), Ch. M 1000001→	MVB1460R6	6PK1460	
			⚙️	A/C(+), → Eng Nr 01039674,	MVB2225R6	6PK2225	
				Ch. M 1000001→			
			⚙️	A/C(+), Alt. 120A,	MVB2265R6	6PK2265	
				Eng Nr 01039675→			
			⚙️	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271	
				Eng Nr 01039675→			
			⚙️	A/C(-), → Ch. M 1000000	SVB10813	10x813	
				A/C(+), → Ch. M 1000000	SVB10960	10x960	
3.0 (3000) CAT	C 30 NE	130	03/88 → 03/94	⚙️	→ Ch. M 1000000	SVB10888	10x888
				⚙️	A/C(-), Ch. M 1000001→	MVB1460R6	6PK1460
				⚙️	A/C(+), → Eng Nr 01039674,	MVB2225R6	6PK2225
					Ch. M 1000001→		
				⚙️	A/C(+), Alt. 120A,	MVB2265R6	6PK2265
					Eng Nr 01039675→		
				⚙️	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271
					Eng Nr 01039675→		
				⚙️	A/C(-), → Ch. M 1000000	SVB10813	10x813
					A/C(+), → Ch. M 1000000	SVB10960	10x960
3.0 24V (3000)	C 30 SEJ	147	09/89 → 03/94	⚙️	A/C(-)	MVB1460R6	6PK1460
				⚙️	A/C(+), → Eng Nr 01024729	MVB2225R6	6PK2225
				⚙️	A/C(+), Alt. 120A,	MVB2265R6	6PK2265
					Eng Nr 01024730→		
				⚙️	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271
		Eng Nr 01024730→					
	C 30 SE	150	09/89 → 03/94	⚙️	A/C(-)	MVB1460R6	6PK1460
				⚙️	A/C(+), → Eng Nr 01024729	MVB2225R6	6PK2225
				⚙️	A/C(+), Alt. 120A,	MVB2265R6	6PK2265
					Eng Nr 01024730→		
⚙️				A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271	
	Eng Nr 01024730→						
3.6 24V Lotus	C 36 GET	277	08/90 → 09/92	⚙️		MVB2225R6	6PK2225

OMEGA A Estate (66_, 67_)

1.8	E 18 NVR	65	09/87 → 03/94	⚙️	→04/93	SVB101000	10x1000
				⚙️	→04/93	TB155	111x20
				⚙️	→04/93	SVB10800	10x800
18 SEH	85	09/86 → 03/94	⚙️	→08/87	SVB101000	10x1000	
			⚙️	→08/87, → Eng Nr 14608700	TB155	111x20	
			⚙️	→08/87, Eng Nr 14608701→	TB508	146x20	
			⚙️	→08/87, Eng Nr 14608701→	TBK032		
			⚙️	→08/87	SVB10800	10x800	
1.8 N	18 NV	60	09/86 → 08/87	⚙️		SVB101000	10x1000
				⚙️		TB155	111x20
				⚙️		SVB10800	10x800
1.8 S	18 SV	66	09/86 → 03/94	⚙️	→04/93	SVB101000	10x1000
				⚙️	→04/93	TB155	111x20
				⚙️	→04/93	SVB10800	10x800



kW



...OPEL

OPEL

...OMEGA A Estate (66_, 67_)

2.0	20 SE	90	09/86 → 03/94	☼	MS	SVB10813	10x813				
				☼	PS	SVB10790	10x790				
				⊖	Alt. 90A	SVB101025	10x1025				
				⊖	Not Alt. 90A	SVB101000	10x1000				
				⌘	→ Eng Nr 14608700	TB155	111x20				
				⌘	Eng Nr 14608701 →	TB508	146x20				
				⌘KTT	Eng Nr 14608701 →	TBK032					
				☼		SVB10800	10x800				
				<hr/>							
				2.0 i	C 20 NE	85	09/86 → 03/94	☼	MS	SVB10813	10x813
☼	PS	SVB10790	10x790								
⊖	Alt. 90A	SVB101025	10x1025								
⊖	Not Alt. 90A	SVB101000	10x1000								
⌘	→ Eng Nr 14608700	TB155	111x20								
⌘	Eng Nr 14608701 →	TB508	146x20								
⌘KTT	Eng Nr 14608701 →	TBK032									
☼		SVB10800	10x800								
<hr/>											
2.3 D	23 YD	54	09/86 → 03/94					☼		SVB10888	10x888
				⊖	→ Ch. K1000098	SVB10913	10x913				
				⊖	Ch. K1000099 →	SVB10900	10x900				
				☼	A/C(-)	SVB10813	10x813				
				☼	A/C(+)	SVB10960	10x960				
<hr/>											
2.3 TD	23 YDT	66	09/86 → 08/88	☼		SVB10888	10x888				
				⊖	→ Ch. K1000098	SVB10913	10x913				
				⊖	Ch. K1000099 →	SVB10900	10x900				
				☼	A/C(-)	SVB10813	10x813				
				☼	A/C(+)	SVB10960	10x960				
<hr/>											
2.3 TD Interc.	23 DTR	74	09/88 → 03/94	☼		SVB10888	10x888				
				⊖	→ Ch. K1000098	SVB10913	10x913				
				⊖	Ch. K1000099 →	SVB10900	10x900				
				☼	A/C(-)	SVB10813	10x813				
				☼	A/C(+)	SVB10960	10x960				
<hr/>											
2.4 i	C 24 NE	92	09/88 → 03/94	☼		SVB10888	10x888				
				☼	A/C(-)	SVB10813	10x813				
				☼	A/C(+)	SVB10960	10x960				
<hr/>											
2.6 i	C 26 NE	110	09/90 → 03/94	⊖	A/C(-)	MVB1460R6	6PK1460				
				⊖	A/C(+), → Eng Nr 01032426	MVB2225R6	6PK2225				
				⊖	A/C(+), Alt. 120A,	MVB2265R6	6PK2265				
				⊖	Eng Nr 01032427 →						
				⊖	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271				
<hr/>											
3.0	C 30 LE	115	03/87 → 03/94	⊖	→ Ch. M 1000000	SVB10888	10x888				
				⊖	A/C(-), Ch. M 1000001 →	MVB1460R6	6PK1460				
				⊖	A/C(+), → Eng Nr 01039674,	MVB2225R6	6PK2225				
				⊖	Ch. M 1000001 →						
				⊖	A/C(+), Alt. 120A,	MVB2265R6	6PK2265				
				⊖	Eng Nr 01039675 →						
				⊖	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271				
				⊖	Eng Nr 01039675 →						
				☼	A/C(-), → Ch. M 1000000	SVB10813	10x813				
				☼	A/C(+), → Ch. M 1000000	SVB10960	10x960				
	<hr/>										
	30 NE	130	03/87 → 09/90	☼	→ Ch. M 1000000	SVB10888	10x888				
				⊖	A/C(-), Ch. M 1000001 →	MVB1460R6	6PK1460				
				⊖	A/C(+), → Eng Nr 01039674,	MVB2225R6	6PK2225				
				⊖	Ch. M 1000001 →						
⊖				A/C(+), Alt. 120A,	MVB2265R6	6PK2265					
<hr/>											
30 NE	130	03/87 → 09/90	⊖	Eng Nr 01039675 →							
			⊖	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271					
			⊖	Eng Nr 01039675 →							
			☼	A/C(-), → Ch. M 1000000	SVB10813	10x813					
			☼	A/C(+), → Ch. M 1000000	SVB10960	10x960					



kW



...OPEL

...OMEGA A Estate (66_, 67_)

3.0 CAT	C 30 NE	130	03/87 → 03/94	 	→ Ch. M 1000000 A/C(-), Ch. M 1000001→ A/C(+), → Eng Nr 01039674, Ch. M 1000001→ A/C(+), Alt. 120A, Eng Nr 01039675→ A/C(+), Not Alt. 120A, Eng Nr 01039675→ A/C(-), → Ch. M 1000000 A/C(+), → Ch. M 1000000	SVB10888 MVB1460R6 MVB2225R6 MVB2265R6 MVB2271R6 SVB10813 SVB10960	10x888 6PK1460 6PK2225 6PK2265 6PK2271 10x813 10x960
3.0 24V	C 30 SEJ	147	09/89 → 03/94	 	A/C(-) A/C(+), → Eng Nr 01024729 A/C(+), Alt. 120A, Eng Nr 01024730→ A/C(+), Not Alt. 120A, Eng Nr 01024730→	MVB1460R6 MVB2225R6 MVB2265R6 MVB2271R6	6PK1460 6PK2225 6PK2265 6PK2271

OMEGA B (25_, 26_, 27_)

2.0	X 20 SE	85	03/94 → 09/99	 	A/C(-), 09/94→05/99 A/C(+), 09/94→05/99 09/94→05/99 09/94→05/99	MVB1725R6 MVB1904R6 TB508 TBK032	6PK1725 6PK1904 146x20
	20 SE	85	03/94 → 12/00	 	A/C(-), 09/94→05/99 A/C(+), 09/94→05/99 09/94→05/99 09/94→05/99	MVB1725R6 MVB1904R6 TB508 TBK032	6PK1725 6PK1904 146x20
2.0 16V	X 20 XEV	100	03/94 → 09/99	 	A/C(-), →05/99 A/C(+), →05/99 →05/99 →05/99	MVB1725R6 MVB1904R6 TB783 TBK261	6PK1725 6PK1904 169x24
2.0 DTI 16V	X 20 DTH	74	09/97 → 09/00	 	A/C(-) A/C(+) →07/01, → Ch. V1999999 →07/01, Ch. W1000001→ →07/01	MVB1805R6 MVB1904R6 MVB775R4 MVB800R4 MVB1815R5	6PK1805 6PK1904 4PK775 4PK800 5PK1815
2.2 16V	Y 22 XE, Z 22 XE	106	09/99 → 07/03	 	A/C(-) A/C(+) →07/01, → Ch. V1999999 →07/01, Ch. W1000001→ →07/01	MVB1725R6 MVB1904R6 TB524	6PK1725 6PK1904 171x24
2.2 DTI 16V	Y 22 DTH	88	09/00 → 07/03	 	A/C(-) A/C(+) A/C(-) A/C(+) →07/01, → Ch. V1999999 →07/01, Ch. W1000001→ →07/01	MVB1805R6 MVB1904R6 MVB1805R6 MVB1904R6 MVB830R5	6PK1805 6PK1904 6PK1805 6PK1904 5PK830
2.5 DTI	Y 25 DT	110	09/01 → 07/03		→07/01, → Ch. V1999999 →07/01, Ch. W1000001→ →07/01	MVB775R4 MVB800R4 MVB1815R5	4PK775 4PK800 5PK1815
2.5 TD	25 DT, X 25 DT, X 25 TD	96	04/94 → 07/03	 	→07/01, → Ch. V1999999 →07/01, Ch. W1000001→ →07/01 A/C(-) A/C(+), → Ch. S1059678 A/C(+), Ch. S1059679→ → Eng Nr 08300418	MVB775R4 MVB800R4 MVB1815R5 MVB1904R6 MVB2265R6 MVB2020R6 TB481 TBK091	4PK775 4PK800 5PK1815 6PK1904 6PK2265 6PK2020 225x30
2.5 V6	X 25 XE	125	03/94 → 09/00	 	A/C(-) A/C(+), → Ch. S1059678 A/C(+), Ch. S1059679→ → Eng Nr 08300418	MVB1904R6 MVB2265R6 MVB2020R6 TB481 TBK091	6PK1904 6PK2265 6PK2020 225x30
2.6 V6	Y 26 SE	132	09/00 → 07/03	 	A/C(-) A/C(+) →07/01, → Ch. V1999999 →07/01, Ch. W1000001→ →07/01	MVB1904R6 MVB2020R6 TB481	6PK1904 6PK2020 225x30
3.0 V6	X 30 XE	155	04/94 → 02/01	 	A/C(-), →07/00 A/C(+), →07/00, → Ch. S1059678 A/C(+), →07/00, Ch. S1059679→ →07/00 →07/00, → Eng Nr 08300418	MVB1904R6 MVB2265R6 MVB2020R6 TB481 TBK091	6PK1904 6PK2265 6PK2020 225x30
3.2 V6	Y 32 SE	160	02/01 → 07/03	 	A/C(-) A/C(+) →07/01, → Ch. V1999999 →07/01, Ch. W1000001→ →07/01	MVB1904R6 MVB2020R6 TB481	6PK1904 6PK2020 225x30



kW



...OPEL

OPEL

OMEGA B Estate (21_, 22_, 23_)

2.0	X 20 SE	85	03/94 → 09/99	 	A/C(-), 09/94 → 05/99 A/C(+), 09/94 → 05/99 09/94 → 05/99 09/94 → 05/99	MVB1725R6 MVB1904R6 TB508 TBK032	6PK1725 6PK1904 146x20
2.0 16V	X 20 XEV	100	03/94 → 09/99	 	A/C(-), → 05/99 A/C(+), → 05/99 → 05/99 → 05/99	MVB1725R6 MVB1904R6 TB783 TBK261	6PK1725 6PK1904 169x24
2.0 DTI 16V	X 20 DTH	74	09/97 → 09/00	 	A/C(-) A/C(+)	MVB1805R6 MVB1904R6	6PK1805 6PK1904
2.2 16V	Y 22 XE, Z 22 XE	106	09/99 → 07/03	 	A/C(-) A/C(+)	MVB1725R6 MVB1904R6 TB524	6PK1725 6PK1904 171x24
2.2 DTI 16V	Y 22 DTH	88	09/00 → 07/03	 	A/C(-) A/C(+)	MVB1805R6 MVB1904R6	6PK1805 6PK1904
		81	09/00 → 07/03	 	A/C(-) A/C(+)	MVB1805R6 MVB1904R6	6PK1805 6PK1904
2.5 DTI	Y 25 DT	110	09/01 → 07/03			MVB830R5	5PK830
2.5 TD	25 DT, X 25 DT, X 25 TD	96	04/94 → 02/01	 	→ Ch. V1999999 Ch. W1000001 →	MVB775R4 MVB800R4 MVB1815R5	4PK775 4PK800 5PK1815
2.5 V6	X 25 XE	125	03/94 → 09/00	 	A/C(-) A/C(+), → Ch. S1059678 A/C(+), Ch. S1059679 →	MVB1904R6 MVB2265R6 MVB2020R6 TB481 TBK091	6PK1904 6PK2265 6PK2020 225x30
					→ Eng Nr 08300418		
2.6 V6	Y 26 SE	132	09/00 → 07/03	 	A/C(-) A/C(+)	MVB1904R6 MVB2020R6 TB481	6PK1904 6PK2020 225x30
3.0 V6	X 30 XE	155	04/94 → 02/01	 	A/C(-), → 07/00 A/C(+), → 07/00, → Ch. S1059678 A/C(+), → 07/00, Ch. S1059679 →	MVB1904R6 MVB2265R6 MVB2020R6 TB481 TBK091	6PK1904 6PK2265 6PK2020 225x30
					→ 07/00, → Eng Nr 08300418		
3.2 V6	Y 32 SE	160	02/01 → 07/03	 	A/C(-) A/C(+)	MVB1904R6 MVB2020R6 TB481	6PK1904 6PK2020 225x30

REKORD E (17_-19_, 11_, 14_, 16_)

1.7	17 N	44	09/77 → 10/82	 	→ Eng Nr 442155 Eng Nr 442156 →	SVB10900 SVB10888 SVB10875 SVB101075	10x900 10x888 10x875 10x1075
1.8	18 N	55	11/82 → 08/86	 	Cat(-) Cat(+) A/C(-) A/C(+)	SVB10975 SVB10960 TB155 TB179 SVB10825 SVB101075	10x975 10x960 111x20 45x10 10x825 10x1075
1.8 E	C 18 NV	74	05/85 → 08/86	 	Cat(-) Cat(+) A/C(-) A/C(+)	SVB10975 SVB10960 TB155 TB179 SVB10825 SVB101075	10x975 10x960 111x20 45x10 10x825 10x1075



kW



...OPEL

...REKORD E (17_, 19_, 11_, 14_, 16_)

1.8 S	18 S	66	11/82 → 08/86		Cat(-)	SVB10975	10x975
					Cat(+)	SVB10960	10x960
						TB155	111x20
						TB179	45x10
					A/C(-)	SVB10825	10x825
1.9	19 N	55	09/77 → 10/82		→ Eng Nr 545154	SVB10900	10x900
					Eng Nr 545155→	SVB10888	10x888
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
2.0	20 N	66	09/77 → 10/82		→ Eng Nr 197858	SVB10900	10x900
					Eng Nr 197859→	SVB10888	10x888
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
2.0 D	20 D	43	09/77 → 10/82			SVB10900	10x900
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
						SVB10800	10x800
2.0 S	20 S	74	08/77 → 08/86		→ Eng Nr 665090	SVB10900	10x900
					Eng Nr 665091→	SVB10888	10x888
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
2.1 D	21 D	44	09/77 → 07/78		→01/78	SVB10900	10x900
					→01/78	SVB10875	10x875
					→01/78	SVB10800	10x800
2.2 D	23 D	48	08/78 → 08/83		→ Ch. F1000188	SVB10900	10x900
					Ch. F1000189→	SVB10913	10x913
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
						SVB10800	10x800
		52	11/82 → 08/86		→ Ch. F1000188	SVB10900	10x900
					Ch. F1000189→	SVB10913	10x913
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
						SVB10800	10x800
2.2 E	22 E	85	11/84 → 08/86			SVB10888	10x888
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
2.2 TD	23 TD	63	06/84 → 08/86		→ Ch. F1000188	SVB10900	10x900
					Ch. F1000189→	SVB10913	10x913
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
						SVB10800	10x800

REKORD E Estate (61_, 66_, 67_)

1.7	17 N	44	09/77 → 10/82		→ Eng Nr 442155	SVB10900	10x900
					Eng Nr 442156→	SVB10888	10x888
					A/C(-)	SVB10875	10x875
					A/C(+)	SVB101075	10x1075
1.8	18 N	55	11/82 → 08/86		Cat(-)	SVB10975	10x975
					Cat(+)	SVB10960	10x960
						TB155	111x20
						TB179	45x10
					A/C(-)	SVB10825	10x825
1.8 E	C 18 NV	74	05/85 → 08/86			SVB10975	10x975
					Cat(+)	SVB10960	10x960
						TB155	111x20
						TB179	45x10
					A/C(-)	SVB10825	10x825
	A/C(+)	SVB101075	10x1075				



kw



...OPEL

OPEL

...REKORD E Estate (61_, 66_, 67_)

1.8 S	18 S	66	11/82 → 08/86	⊗	Cat(-)	SVB10975	10x975
				⊗	Cat(+)	SVB10960	10x960
				⊗		TB155	111x20
				⊗		TB179	45x10
				⊗	A/C(-)	SVB10825	10x825
				⊗	A/C(+)	SVB101075	10x1075
1.9	19 N	55	09/77 → 10/82	⊗	→ Eng Nr 545154	SVB10900	10x900
				⊗	Eng Nr 545155→	SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
2.0	20 N	66	09/77 → 10/82	⊗	→ Eng Nr 197858	SVB10900	10x900
				⊗	Eng Nr 197859→	SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
2.0 D	20 D	43	09/77 → 10/82	⊗		SVB10900	10x900
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
				⊗		SVB10800	10x800
2.0 S	20 S	74	08/77 → 08/86	⊗	→ Eng Nr 665090	SVB10900	10x900
				⊗	Eng Nr 665091→	SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
2.1 D	21 D	44	09/77 → 07/78	⊗	02/78→	SVB10900	10x900
				⊗	A/C(-), 02/78→	SVB10875	10x875
				⊗	A/C(+), 02/78→	SVB101075	10x1075
				⊗	02/78→	SVB10800	10x800
2.2 D	23 D	48	08/78 → 08/83	⊗	→ Ch. F1000188	SVB10900	10x900
				⊗	Ch. F1000189→	SVB10913	10x913
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
				⊗		SVB10800	10x800
2.2 E	22 E	85	11/84 → 08/86	⊗		SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
2.2 TD	23 TD	63	06/84 → 08/86	⊗	→ Ch. F1000188	SVB10900	10x900
				⊗	Ch. F1000189→	SVB10913	10x913
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
				⊗		SVB10800	10x800
2.3 D	23 D	52	11/82 → 08/86	⊗	→ Ch. F1000188	SVB10900	10x900
				⊗	Ch. F1000189→	SVB10913	10x913
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
				⊗		SVB10800	10x800

SENATOR A (29_)

2.0 E	H 20 E	85	03/83 → 10/84	⊗		SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
2.2 E	22 E	85	11/84 → 08/87	⊗		SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
2.2 TD	23 TD	63	11/84 → 08/87	⊗		SVB10888	10x888
				⊗		SVB10913	10x913
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
2.5 E	H 25 E	100	01/83 → 08/84	⊗		SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
	25 E	103	09/84 → 08/87	⊗		SVB10888	10x888
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075



kW



...OPEL

...SENATOR A (29_)

2.8	28 H	103	02/78 → 04/81	⊗	06/78→07/80	SVB10888	10x888
				⊗	MAN, 06/78→04/79	SVB10900	10x900
				⊗	A/C(-), 06/78→07/80	SVB10875	10x875
				⊗	A/C(+), 06/78→07/80	SVB101075	10x1075
3.0	30 H	110	04/78 → 07/82	⊗		SVB10888	10x888
				⊗	MAN, →04/79	SVB10900	10x900
				⊗	A/C(-)	SVB10875	10x875
3.0 E	30 E	132	02/78 → 12/86	⊗	A/C(+)	SVB101075	10x1075
				⊗	06/78→	SVB10888	10x888
				⊗	MAN, 06/78→04/79	SVB10900	10x900
				⊗	A/C(-), 06/78→	SVB10875	10x875
				⊗	A/C(+), 06/78→	SVB101075	10x1075

SENATOR B (29_)

2.5 i	25 NE	103	09/90 → 09/93	⊗	→ Ch. M 1000000	SVB10888	10x888				
				⊗	A/C(-), Ch. M 1000001→	MVB1460R6	6PK1460				
				⊗	A/C(+), → Eng Nr 1039674,	MVB2225R6	6PK2225				
					Ch. M 1000001→						
				⊗	A/C(+), Alt. 120A,	MVB2265R6	6PK2265				
					Eng Nr 1039675→						
				⊗	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271				
					Eng Nr 1039675→						
				⊗	A/C(-), Cat(-),	SVB10813	10x813				
					→ Ch. M 1000000						
2.6 i	C 26 NE	110	09/90 → 09/93	⊗	A/C(-)	MVB1460R6	6PK1460				
				⊗	A/C(+), → Eng Nr 1032426	MVB2225R6	6PK2225				
				⊗	A/C(+), Alt. 120A,	MVB2265R6	6PK2265				
					Eng Nr 1032427→						
				⊗	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271				
					Eng Nr 1032427→						
				3.0	C 30 LE	115	09/87 → 09/93	⊗	→ Ch. M 1000000	SVB10888	10x888
								⊗	A/C(-), Ch. M 1000001→	MVB1460R6	6PK1460
								⊗	A/C(+), → Eng Nr 1039674,	MVB2225R6	6PK2225
									Ch. M 1000001→		
⊗	A/C(+), Alt. 120A,	MVB2265R6	6PK2265								
	Eng Nr 1039675→										
⊗	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271								
	Eng Nr 1039675→										
⊗	A/C(-), Cat(-),	SVB10813	10x813								
	→ Ch. M 1000000										
				⊗	A/C(-), Cat(+),	SVB10790	10x790				
					→ Ch. M 1000000						
				⊗	A/C(+), Cat(-),	SVB10960	10x960				
					→ Ch. M 1000000						
				⊗	A/C(+), Cat(+),	SVB10940	10x940				
					→ Ch. M 1000000						



kW



...OPEL

...SENATOR B (29_)

Model	Engine	Power (kW)	Year Range	Accessories	Options	Part Numbers	Dimensions
...3.0	30 NE	130	01/88 → 09/90	 	→ Ch. M 1000000	SVB10888	10x888
					A/C(-), Ch. M 1000001→	MVB1460R6	6PK1460
					A/C(+), → Eng Nr 1039674,	MVB2225R6	6PK2225
					Ch. M 1000001→		
					A/C(+), Alt. 120A,	MVB2265R6	6PK2265
					Eng Nr 1039675→		
					A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271
					Eng Nr 1039675→		
					A/C(-), Cat(-),	SVB10813	10x813
					→ Ch. M 1000000		
A/C(-), Cat(+),	SVB10790	10x790					
→ Ch. M 1000000							
A/C(+), Cat(-),	SVB10960	10x960					
→ Ch. M 1000000							
A/C(+), Cat(+),	SVB10940	10x940					
→ Ch. M 1000000							
3.0 24V	C 30 SE	150	09/89 → 09/93	 	A/C(-)	MVB1460R6	6PK1460
					A/C(+), → Eng Nr 1024729	MVB2225R6	6PK2225
					A/C(+), Eng Nr 1024730→	MVB2271R6	6PK2271
3.0 i CAT	C 30 NE	130	01/88 → 09/93	 	→ Ch. M 1000000	SVB10888	10x888
					A/C(-), Ch. M 1000001→	MVB1460R6	6PK1460
					A/C(+), → Eng Nr 1039674,	MVB2225R6	6PK2225
					Ch. M 1000001→		
					A/C(+), Alt. 120A,	MVB2265R6	6PK2265
					Eng Nr 1039675→		
					A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271
					Eng Nr 1039675→		
					A/C(-), Cat(+),	SVB10790	10x790
					→ Ch. M 1000000		
A/C(+), Cat(+),	SVB10940	10x940					
→ Ch. M 1000000							

SIGNUM

1.8	Z 18 XE	90	05/03 →	 	A/C(-), →07/05	MVB938R5	5PK938
					A/C(+), →07/05	MVB1240R5	5PK1240
					→07/05	TB638	162x20
					→07/05, → Eng Nr 20EK4285	TBK240	
	Z 18 XER	103	09/05 →	 	A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.9 CDTI	Z 19 DT	88	04/04 →	 	A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
	Z 19 DTH	110	04/04 →	 	A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
	Z 19 DT	74	08/05 →	 	A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
2.0 DTI	Y 20 DTH	74	05/03 →	 	A/C(-), →04/04	MVB1805R6	6PK1805
					A/C(+), →04/04,	MVB1875R6	6PK1875
					Ch. 31154546→		
2.0 Turbo	Z 20 NET	129	05/03 →	 	A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.2 direct	Z 22 YH	114	05/03 →	 	A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.2 DTI	Y 22 DTR	92	05/03 →	 	A/C(-), →04/04	MVB1805R6	6PK1805
					A/C(+), →04/04,	MVB1875R6	6PK1875
					Ch. 31154546→		



kW



...OPEL

...SIGNUM

2.8 V6 Turbo	Z 28 NEL	169	09/05 →			MVB2120R6	6PK2120
	Z 28 NET	184	01/06 →			MVB2120R6	6PK2120
3.0 V6 CDTI	Y 30 DT	130	05/03 →		→07/05	MVB1920R6	6PK1920
					→07/05	TB750	116x25
	Z 30 DT	135	09/05 →		A/C(+)	MVB1920R6	6PK1920
						TB750	116x25
3.2 V6	Z 32 SE	155	05/03 →		A/C(-), →07/05	MVB1865R6	6PK1865
					A/C(+), →07/05	MVB1995R6	6PK1995
					→07/05	TB481	225x30

SINTRA

2.2 DTI	X 22 DTH	85	07/97 → 04/99		A/C(-), 11/97 →	MVB1805R6	6PK1805
					A/C(+), 11/97 →	MVB1904R6	6PK1904
2.2 i 16V	X 22 XE	104	11/96 → 04/99		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1904R6	6PK1904
						TB524	171x24
3.0 i 24V	X 30 XE	148	11/96 → 04/99			MVB2020R6	6PK2020
						TB481	225x30

SPEEDSTER

2.0		162	10/03 → 08/06			MVB1680R5	5PK1680
						TB647	168x24
2.0 Turbo	Z 20 LET	147	04/03 →		→08/06	MVB1680R5	5PK1680
					→08/06	TB647	168x24
2.2	Z 22 SE	108	09/00 →		A/C(-), →09/05	MVB875R5	5PK875
					A/C(+), →09/05	MVB1030R5	5PK1030

TIGRA (95_)

1.4 16V	X 14 XE	66	07/94 → 12/00		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	
						TBK260	
		63	08/97 → 12/00		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	
						TBK260	
1.6 16V	X 16 XE	78	07/94 → 08/98		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	
						TBK260	

TIGRA TwinTop

1.3 CDTI	Z 13 DT	51	06/04 →		A/C(-), 11/04 →	MVB1180R6	6PK1180
					A/C(+), 11/04 →	MVB1318R6	6PK1318
1.4	Z 14 XEP	66	06/04 →		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1370R5	5PK1370
1.8	Z 18 XE	92	06/04 →		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Ch. 4E999999	TBK240	

VECTRA A (86_, 87_)

1.4 S	14 NV	55	09/88 → 06/92			SVB10875	10x875
						SVB10913	10x913
					→ Eng Nr 19307805,02J22349	TB218	104x17
					Eng Nr 19307806,02J22350 →	TB336	111x17
					Eng Nr 19307806,02J22350 →	TBK008	



kw



...OPEL

...VECTRA A (86_, 87_)

OPEL

1.6	16 SV	60	09/88 → 05/93	☼	→08/92	SVB13875	13x875			
				⊖	A/C(-), 09/92→	MVB1460R6	6PK1460			
				⊕	A/C(+), 09/92→	MVB1805R6	6PK1805			
				⊖	MS, →08/92	SVB10913	10x913			
				⊖	PS, → Ch. M5178236,M1169325	MVB970R5	5PK970			
				⊖	PS, →08/92, Ch. M1169326, M1169326→	MVB985R5	5PK985			
					→ Eng Nr 19307805,02J22349	TB218	104x17			
					Eng Nr 19307806,02J22350→	TB336	111x17			
					Eng Nr 19307806,02J22350→	TBK008				
				1.6 i	E 16 NZ	55	09/88 → 10/90	☼	MS	SVB13875
⊖	PS, → Ch. M5178236,M1169325	SVB10913	10x913							
⊖	PS, Ch. M1169326,M1169326→	MVB970R5	5PK970							
⊖	→ Eng Nr 19307805,02J22349	MVB985R5	5PK985							
	Eng Nr 19307805,02J22349	TB218	104x17							
	Eng Nr 19307806,02J22350→	TB336	111x17							
	Eng Nr 19307806,02J22350→	TBK008								
X 16 SZ	52	09/93 → 11/95	⊖					A/C(-)	SVB13875	13x875
			⊖					A/C(+)	MVB1460R6	6PK1460
			⊖					PS, → Ch. M5178236,M1169325	MVB1805R6	6PK1805
				→ Eng Nr 19307805,02J22349	MVB970R5	5PK970				
				Eng Nr 19307805,02J22349	TB218	104x17				
				Eng Nr 19307806,02J22350→	TB336	111x17				
				Eng Nr 19307806,02J22350→	TBK008					
			16 LZ2	55	09/93 → 11/95	⊖	A/C(-)	MVB1460R6	6PK1460	
						⊖	A/C(+)	MVB1805R6	6PK1805	
							→ Eng Nr 19307805,02J22349	MVB970R5	5PK970	
	Eng Nr 19307805,02J22349	TB218				104x17				
	Eng Nr 19307806,02J22350→	TB336				111x17				
	Eng Nr 19307806,02J22350→	TBK008								
1.6 i CAT	C 16 NZ, C 16 NZ2	55				09/88 → 11/95	☼	→08/92	SVB13875	13x875
							⊖	A/C(-), 09/92→	MVB1460R6	6PK1460
							⊕	A/C(+), 09/92→	MVB1805R6	6PK1805
							⊖	MS, →08/92	SVB10913	10x913
			⊖	PS, → Ch. M5178236,M1169325	MVB970R5		5PK970			
			⊖	PS, →08/92, Ch. M1169326, M1169326→	MVB985R5		5PK985			
				→ Eng Nr 19307805,02J22349	TB218		104x17			
				Eng Nr 19307806,02J22350→	TB336		111x17			
				Eng Nr 19307806,02J22350→	TBK008					
			1.7 D	17 D	42		10/88 → 09/92	☼	A/C(-)	SVB13875
⊖	→ Eng Nr 14333430	SVB10913				10x913				
	Eng Nr 14333431→	TB224				146x24				
	→ Eng Nr 14333430	TB509				176x24				
	Eng Nr 14333431→	TBK031								
	Eng Nr 14333431→	TBK081								
⊕	AUTO	SVB10825				10x825				
⊕	MAN	SVB10813				10x813				
17 DR	44	07/92 → 11/95				☼		A/C(-)	SVB13875	13x875
						⊖		→ Eng Nr 14333430	SVB10913	10x913
				Eng Nr 14333431→	TB224	146x24				
				→ Eng Nr 14333430	TB509	176x24				
				Eng Nr 14333431→	TBK031					
				Eng Nr 14333431→	TBK081					
			⊕	AUTO	SVB10825	10x825				
			⊕	MAN	SVB10813	10x813				
			1.7 TD	17 DT (TC4EE1), X 17 DT (TC4EE1)	60	03/90 → 11/95	⊖	Eng. 17DT, 08/92→	SVB13875	13x875
								08/92→, → Ch. R...	SVB13925	13x925
	08/92→08/94, → Ch. R...	TB413					136x25.4			
	09/94→, Ch. S ...→	TBK022								
	Eng. 17DT, 08/92→	TBK023								
⊕		SVB10950					10x950			



kW



...OPEL

...VECTRA A (86_, 87_)

1.8 i CAT	C 18 NZ	66	03/90 → 11/95	☼	→08/92	SVB13875	13x875				
				⊖	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725				
				⊕	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904				
				⊖	Alt. 70A, →08/92	SVB10925	10x925				
				⊖	Alt. 90A, →08/90	SVB101000	10x1000				
				⊖	Alt. 90A, 09/90→08/92	SVB10940	10x940				
					→ Eng Nr 14142838	TB155	111x20				
					Eng Nr 14142839→	TB508	146x20				
				KIT	Eng Nr 14142839→	TBK032					
				⊖	A/C(-), →08/92	SVB10800	10x800				
⊖	A/C(+), →08/92	SVB10690	10x690								
1.8 S	E 18 NVR	65	09/88 → 07/89	☼		SVB13875	13x875				
				⊖	Alt. 70A	SVB10925	10x925				
				⊖	Alt. 90A	SVB101000	10x1000				
					→ Eng Nr 14142838	TB155	111x20				
					Eng Nr 14142839→	TB508	146x20				
				KIT	Eng Nr 14142839→	TBK032					
				⊖	A/C(-)	SVB10800	10x800				
				⊖	A/C(+)	SVB10690	10x690				
				1.8 SV	18 SV	66	09/89 → 10/90	☼		SVB13875	13x875
								⊖	Alt. 70A	SVB10925	10x925
⊖	Alt. 90A	SVB101000	10x1000								
⊖	Alt. 90A, 09/90→	SVB10940	10x940								
	→ Eng Nr 14142838	TB155	111x20								
	Eng Nr 14142839→	TB508	146x20								
KIT	Eng Nr 14142839→	TBK032									
⊖	A/C(-)	SVB10800	10x800								
⊖	A/C(+)	SVB10690	10x690								
1.8 S 4x4	E 18 NVR	65	01/89 → 07/89					☼		SVB13875	13x875
				⊖	Alt. 70A	SVB10925	10x925				
				⊖	Alt. 90A	SVB101000	10x1000				
					→ Eng Nr 14142838	TB155	111x20				
					Eng Nr 14142839→	TB508	146x20				
				KIT	Eng Nr 14142839→	TBK032					
				⊖	A/C(-)	SVB10800	10x800				
				⊖	A/C(+)	SVB10690	10x690				
				2.0 i	20 NE	85	09/88 → 10/90	☼		SVB13875	13x875
								⊖	Alt. 70A	SVB10925	10x925
⊖	Alt. 90A	SVB101000	10x1000								
⊖	Alt. 90A, 09/90→	SVB10940	10x940								
	→ Eng Nr 14142838	TB155	111x20								
	Eng Nr 14142839→	TB508	146x20								
KIT	Eng Nr 14142839→	TBK032									
⊖	A/C(-)	SVB10800	10x800								
⊖	A/C(+)	SVB10690	10x690								
2.0 SEH	20 SEH	95	09/88 → 09/92					☼		SVB13875	13x875
				⊖	Alt. 70A	SVB10925	10x925				
				⊖	Alt. 90A, →08/90	SVB101000	10x1000				
				⊖	Alt. 90A, 09/90→	SVB10940	10x940				
					→ Eng Nr 14142838	TB155	111x20				
					Eng Nr 14142839→	TB508	146x20				
				KIT	Eng Nr 14142839→	TBK032					
				⊖	A/C(-)	SVB10800	10x800				
				⊖	A/C(+)	SVB10690	10x690				
				2.0 i 16V	X 20 XEV	100	06/94 → 11/95	⊖	A/C(-)	MVB1725R6	6PK1725
⊖	A/C(+)	MVB1904R6	6PK1904								
		TB783	169x24								
KIT		TBK261									
2.0 i 16V 4x4	X 20 XEV	100	06/94 → 11/95	⊖	A/C(-)	MVB1725R6	6PK1725				
				⊖	A/C(+)	MVB1904R6	6PK1904				
						TB783	169x24				
				KIT		TBK261					



kw



...OPEL

...VECTRA A (86_, 87_)

OPEL

2.0 i 4x4	20 NE	85	01/89 → 10/90	☼		SVB13875	13x875
				⊗	Alt. 70A	SVB10925	10x925
				⊗	Alt. 90A	SVB101000	10x1000
				⊗	Alt. 90A, 09/90→	SVB10940	10x940
				☼	→ Eng Nr 14142838	TB155	111x20
				☼	Eng Nr 14142839→	TB508	146x20
				☼	Eng Nr 14142839→	TBK032	
				⊗	A/C(-)	SVB10800	10x800
				⊗	A/C(+)	SVB10690	10x690
				20 SEH	95	01/89 → 09/92	☼
⊗	Alt. 70A	SVB10925	10x925				
⊗	Alt. 90A, →08/90	SVB101000	10x1000				
⊗	Alt. 90A, 09/90→	SVB10940	10x940				
☼	→ Eng Nr 14142838	TB155	111x20				
☼	Eng Nr 14142839→	TB508	146x20				
☼	Eng Nr 14142839→	TBK032					
⊗	A/C(-)	SVB10800	10x800				
⊗	A/C(+)	SVB10690	10x690				
2.0 i 4x4 CAT	C 20 NE	85	01/89 → 11/95				☼
				⊗	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
				⊗	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
				⊗	Alt. 70A, →08/92	SVB10925	10x925
				⊗	Alt. 90A, →08/90	SVB101000	10x1000
				⊗	Alt. 90A, 09/90→08/92	SVB10940	10x940
				☼	→ Eng Nr 14142838	TB155	111x20
				☼	Eng Nr 14142839→	TB508	146x20
				☼	Eng Nr 14142839→	TBK032	
				⊗	A/C(-), →08/92	SVB10800	10x800
⊗	A/C(+), →08/92	SVB10690	10x690				
2.0 i CAT	C 20 NE	85	09/88 → 11/95	☼	→08/92	SVB13875	13x875
				⊗	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
				⊗	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
				⊗	Alt. 70A, →08/92	SVB10925	10x925
				⊗	Alt. 90A, →08/90	SVB101000	10x1000
				⊗	Alt. 90A, 09/90→08/92	SVB10940	10x940
				☼	→ Eng Nr 14142838	TB155	111x20
				☼	Eng Nr 14142839→	TB508	146x20
				☼	Eng Nr 14142839→	TBK032	
				⊗	A/C(-), →08/92	SVB10800	10x800
⊗	A/C(+), →08/92	SVB10690	10x690				
2.5 V6	C 25 XE	125	02/93 → 11/95	⊗	A/C(-)	MVB1904R6	6PK1904
				⊗	A/C(+), Alt. 120A	MVB2265R6	6PK2265
				⊗	A/C(+), Not Alt. 120A	MVB2271R6	6PK2271
				☼		TB481	225x30
				☼		TBK091	
2000 16V 4x4	20 XEJ	110	01/89 → 10/90	☼		SVB13875	13x875
				⊗	Alt. 70A	SVB10913	10x913
				⊗	Alt. 90A	SVB101000	10x1000
				⊗	Alt. 90A, 09/90→	SVB10940	10x940
				☼	→ Eng Nr 14142838	TB221	141x24
				☼	Eng Nr 14142839→	TB509	176x24
				☼	→ Eng Nr 14142838	TBK028	
				☼	Eng Nr 14142839→	TBK111	
				⊗	A/C(-)	SVB10790	10x790
				⊗	A/C(+)	SVB10690	10x690



kW



...OPEL

...VECTRA A (86_, 87_)

2000/GT 16V	20 XEJ	110	01/89 → 06/94	⚙️	→08/92	SVB13875	13x875
				⚙️	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
				⚙️	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
				⚙️	Alt. 70A, →08/92	SVB10913	10x913
				⚙️	Alt. 90A, →08/90	SVB101000	10x1000
				⚙️	Alt. 90A, 09/90→08/92	SVB10940	10x940
				🔧	→ Eng Nr 14142838	TB221	141x24
				🔧	Eng Nr 14142839→	TB509	176x24
				🔧KIT	→ Eng Nr 14142838	TBK028	
				🔧KIT	Eng Nr 14142839→	TBK111	
				⚙️	A/C(-), →08/92	SVB10790	10x790
				⚙️	A/C(+), →08/92	SVB10690	10x690
2000/GT 16V 4x4 CAT	C 20 XE	110	02/90 → 11/95	⚙️	→08/92	SVB13875	13x875
				⚙️	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
				⚙️	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
				⚙️	Alt. 70A, →08/92	SVB10913	10x913
				⚙️	Alt. 90A, →08/90	SVB101000	10x1000
				⚙️	Alt. 90A, 09/90→08/92	SVB10940	10x940
				🔧	→ Eng Nr 14142838	TB221	141x24
				🔧	Eng Nr 14142839→	TB509	176x24
				🔧KIT	→ Eng Nr 14142838	TBK028	
				🔧KIT	Eng Nr 14142839→	TBK111	
				⚙️	A/C(-), →08/92	SVB10790	10x790
				⚙️	A/C(+), →08/92	SVB10690	10x690
2000/GT 16V CAT	C 20 XE	110	02/90 → 11/95	⚙️	→08/92	SVB13875	13x875
				⚙️	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
				⚙️	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
				⚙️	Alt. 70A, →08/92	SVB10913	10x913
				⚙️	Alt. 90A, →08/90	SVB101000	10x1000
				⚙️	Alt. 90A, 09/90→08/92	SVB10940	10x940
				🔧	→ Eng Nr 14142838	TB221	141x24
				🔧	Eng Nr 14142839→	TB509	176x24
				🔧KIT	→ Eng Nr 14142838	TBK028	
				🔧KIT	Eng Nr 14142839→	TBK111	
				⚙️	A/C(-), →08/92	SVB10790	10x790
				⚙️	A/C(+), →08/92	SVB10690	10x690

VECTRA A Hatchback (88_, 89_)

1.4 S	14 NV	55	04/88 → 06/92	⚙️		SVB10875	10x875
				⚙️		SVB10913	10x913
				🔧	→ Eng Nr 19307805,02J22349	TB218	104x17
				🔧	Eng Nr 19307806,02J22350→	TB336	111x17
				🔧KIT	Eng Nr 19307806,02J22350→	TBK008	
1.6 i	X 16 SZ	52	09/93 → 11/95	⚙️	A/C(-)	MVB1460R6	6PK1460
				⚙️	A/C(+)	MVB1805R6	6PK1805
				⚙️	PS, → Ch. M5178236,M1169325	MVB970R5	5PK970
				🔧	→ Eng Nr 19307805,02J22349	TB218	104x17
				🔧	Eng Nr 19307806,02J22350→	TB336	111x17
				🔧KIT	Eng Nr 19307806,02J22350→	TBK008	
	16 LZ2	55	09/93 → 11/95	⚙️	A/C(-)	MVB1725R6	6PK1725
				⚙️	A/C(+)	MVB1904R6	6PK1904
				🔧		TB508	146x20
				🔧KIT		TBK032	
1.6 i CAT	C 16 NZ, C 16 NZ2	55	09/88 → 11/95	⚙️	→08/92	SVB13875	13x875
				⚙️	A/C(-), 09/92→	MVB1460R6	6PK1460
				⚙️	A/C(+), 09/92→	MVB1805R6	6PK1805
				⚙️	MS, →08/92	SVB10913	10x913
				⚙️	PS, → Ch. M5178236,M1169325	MVB970R5	5PK970
				⚙️	PS, →08/92, Ch. M1169326, M1169326→	MVB985R5	5PK985
				🔧	→ Eng Nr 19307805,02J22349	TB218	104x17
				🔧	Eng Nr 19307806,02J22350→	TB336	111x17
				🔧KIT	Eng Nr 19307806,02J22350→	TBK008	



kw



...OPEL

...VECTRA A Hatchback (88_, 89_)

OPEL

1.6 S	16 SV	60	09/88 → 05/93	☼	→08/92	SVB13875	13x875				
				⊗	A/C(-), 09/92→	MVB1460R6	6PK1460				
				⊗	A/C(+), 09/92→	MVB1805R6	6PK1805				
				⊗	MS, →08/92	SVB10913	10x913				
				⊗	PS, → Ch. M5178236,M1169325	MVB970R5	5PK970				
				⊗	PS, →08/92, Ch. M1169326, M1169326→	MVB985R5	5PK985				
					→ Eng Nr 19307805,02J22349	TB218	104x17				
					Eng Nr 19307806,02J22350→	TB336	111x17				
					Eng Nr 19307806,02J22350→	TBK008					
				1.7 D	17 D	42	09/88 → 09/92	☼		SVB13875	13x875
⊗	A/C(-)	SVB10913	10x913								
	→ Eng Nr 14333430	TB224	146x24								
	Eng Nr 14333431→	TB509	176x24								
	→ Eng Nr 14333430	TBK031									
	Eng Nr 14333431→	TBK081									
⊗	AUTO	SVB10825	10x825								
⊗	MAN	SVB10813	10x813								
1.7 D	17 DR	44	07/92 → 11/95					☼		SVB13875	13x875
								⊗	A/C(-)	SVB10913	10x913
					→ Eng Nr 14333430	TB224	146x24				
					Eng Nr 14333431→	TB509	176x24				
					→ Eng Nr 14333430	TBK031					
					Eng Nr 14333431→	TBK081					
				⊗	AUTO	SVB10825	10x825				
				⊗	MAN	SVB10813	10x813				
				1.7 TD	17 DT (TC4EE1), X 17 DT (TC4EE1)	60	03/90 → 11/95	⊗	Eng. 17DT, 08/92→	SVB13925	13x925
									08/92→, → Ch. R...	TB413	136x25.4
	08/92→08/94, → Ch. R...	TBK022									
	09/94→, Ch. S ...→	TBK023									
⊗	Eng. 17DT, 08/92→	SVB10950	10x950								
1.8 i	18 SV	66	09/88 → 10/90	☼		SVB13875	13x875				
				⊗	Alt. 70A	SVB10925	10x925				
				⊗	Alt. 90A	SVB101000	10x1000				
				⊗	Alt. 90A, 09/90→	SVB10940	10x940				
					→ Eng Nr 14142838	TB155	111x20				
					Eng Nr 14142839→	TB508	146x20				
					Eng Nr 14142839→	TBK032					
				⊗	A/C(-)	SVB10800	10x800				
				⊗	A/C(+)	SVB10690	10x690				
				1.8 i CAT	C 18 NZ	66	03/90 → 11/95	☼	→08/92	SVB13875	13x875
⊗	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725								
⊗	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904								
⊗	Alt. 70A, →08/92	SVB10925	10x925								
⊗	Alt. 90A, →08/90	SVB101000	10x1000								
⊗	Alt. 90A, 09/90→08/92	SVB10940	10x940								
	→ Eng Nr 14142838	TB155	111x20								
	Eng Nr 14142839→	TB508	146x20								
	Eng Nr 14142839→	TBK032									
⊗	A/C(-), →08/92	SVB10800	10x800								
⊗	A/C(+), →08/92	SVB10690	10x690								
1.8 S	E 18 NVR	65	09/88 → 07/89	☼		SVB13875	13x875				
				⊗	Alt. 70A	SVB10925	10x925				
				⊗	Alt. 90A	SVB101000	10x1000				
					→ Eng Nr 14142838	TB155	111x20				
					Eng Nr 14142839→	TB508	146x20				
					Eng Nr 14142839→	TBK032					
				⊗	A/C(-)	SVB10800	10x800				
⊗	A/C(+)	SVB10690	10x690								



kW



...OPEL

...VECTRA A Hatchback (88_, 89_)

2.0 i	20 NE	85	09/88 → 10/90	⚙️		SVB13875	13x875				
				⚙️	Alt. 70A	SVB10925	10x925				
				⚙️	Alt. 90A	SVB101000	10x1000				
				⚙️	Alt. 90A, 09/90 →	SVB10940	10x940				
				🔧	→ Eng Nr 14142838	TB155	111x20				
				🔧	Eng Nr 14142839 →	TB508	146x20				
				🔧KIT	Eng Nr 14142839 →	TBK032					
⚙️	A/C(-)	SVB10800	10x800								
⚙️	A/C(+)	SVB10690	10x690								
2.0 i 16V	20 XEJ	110	02/89 → 10/90	⚙️		SVB13875	13x875				
				⚙️	Alt. 70A	SVB10913	10x913				
				⚙️	Alt. 90A	SVB101000	10x1000				
				⚙️	Alt. 90A, 09/90 →	SVB10940	10x940				
				🔧	→ Eng Nr 14142838	TB221	141x24				
				🔧	Eng Nr 14142839 →	TB509	176x24				
				🔧KIT	→ Eng Nr 14142838	TBK028					
	🔧KIT	Eng Nr 14142839 →	TBK111								
	⚙️	A/C(-)	SVB10790	10x790							
	⚙️	A/C(+)	SVB10690	10x690							
		X 20 XEV	100	06/94 → 11/95	⚙️	A/C(-)	MVB1725R6	6PK1725			
⚙️	A/C(+)				MVB1904R6	6PK1904					
🔧					TB783	169x24					
🔧KIT					TBK261						
2.0 i 16V CAT	C 20 XE	110	02/90 → 11/95	⚙️	→08/92	SVB13875	13x875				
				⚙️	A/C(-), 09/92 →, Ch. P... →	MVB1725R6	6PK1725				
				⚙️	A/C(+), 09/92 →, Ch. P... →	MVB1904R6	6PK1904				
				⚙️	Alt. 70A, →08/92	SVB10913	10x913				
				⚙️	Alt. 90A, →08/90	SVB101000	10x1000				
				⚙️	Alt. 90A, 09/90 →08/92	SVB10940	10x940				
				🔧	→ Eng Nr 14142838	TB221	141x24				
				🔧	Eng Nr 14142839 →	TB509	176x24				
				🔧KIT	→ Eng Nr 14142838	TBK028					
				🔧KIT	Eng Nr 14142839 →	TBK111					
				⚙️	A/C(-), →08/92	SVB10790	10x790				
				⚙️	A/C(+), →08/92	SVB10690	10x690				
				2.0 i CAT	C 20 NE	85	09/88 → 11/95	⚙️	→08/92	SVB13875	13x875
⚙️	A/C(-), 09/92 →, Ch. P... →	MVB1725R6	6PK1725								
⚙️	A/C(+), 09/92 →, Ch. P... →	MVB1904R6	6PK1904								
⚙️	Alt. 70A, →08/92	SVB10925	10x925								
⚙️	Alt. 90A, →08/90	SVB101000	10x1000								
⚙️	Alt. 90A, 09/90 →08/92	SVB10940	10x940								
🔧	→ Eng Nr 14142838	TB155	111x20								
🔧	Eng Nr 14142839 →	TB508	146x20								
🔧KIT	Eng Nr 14142839 →	TBK032									
⚙️	A/C(-), →08/92	SVB10800	10x800								
⚙️	A/C(+), →08/92	SVB10690	10x690								
2.0 i GT	20 SEH	95	09/88 → 11/95					⚙️	→08/92	SVB13875	13x875
								⚙️	A/C(-), 09/92 →, Ch. P... →	MVB1725R6	6PK1725
				⚙️	A/C(+), 09/92 →, Ch. P... →	MVB1904R6	6PK1904				
				⚙️	Alt. 70A, →08/92	SVB10925	10x925				
				⚙️	Alt. 90A, →08/90	SVB101000	10x1000				
				⚙️	Alt. 90A, 09/90 →08/92	SVB10940	10x940				
				🔧	→ Eng Nr 14142838	TB155	111x20				
				🔧	Eng Nr 14142839 →	TB508	146x20				
				🔧KIT	Eng Nr 14142839 →	TBK032					
				⚙️	A/C(-), →08/92	SVB10800	10x800				
				⚙️	A/C(+), →08/92	SVB10690	10x690				
				2.5 V6	C 25 XE	125	02/93 → 11/95	⚙️	A/C(-)	MVB1904R6	6PK1904
								⚙️	A/C(+), Alt. 120A	MVB2265R6	6PK2265
⚙️	A/C(+), Not Alt. 120A	MVB2271R6	6PK2271								
🔧		TB481	225x30								
🔧KIT		TBK091									



kw



...OPEL

OPEL

VECTRA B (36_)

1.6 i	X 16 SZR	55	10/95 → 04/02		A/C(-), →06/00	MVB1460R6	6PK1460
					A/C(+), →06/00	MVB1805R6	6PK1805
					→06/00	TB336	111x17
					→06/00	TBK008	
1.6 i 16V	X 16 XEL, Y 16 XE, Z 16 XE	74	10/95 → 04/02		A/C(-)	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	
1.7 TD	X 17 DT (TC4EE1)	60	10/95 → 12/98			SVB131250	13x1250
						SVB13925	13x925
						TB413	136x25.4
						TBK023	
						SVB10950	10x950
1.8 i 16V	X 18 XE, X 18 XE1	85	10/95 → 09/00		A/C(-), 01/99→	MVB1530R6	6PK1530
					A/C(+), 01/99→	MVB1805R6	6PK1805
					Eng. X18XE, A/C(-), →12/98	MVB1725R6	6PK1725
					Eng. X18XE, A/C(+), →12/98	MVB1904R6	6PK1904
					→12/98	TB783	169x24
	Z 18 XE	92	09/00 → 04/02		A/C(-)	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	
2.0 DI 16V	X 20 DTL	60	11/96 → 04/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1904R6	6PK1904
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	06/97 → 04/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1904R6	6PK1904
2.0 i	20 NEJ	82	10/95 → 04/02		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1904R6	6PK1904
						TB508	146x20
2.0 i 16V	C 20 SEL, X 20 XEV	100	10/95 → 09/00		Eng. X20XEV, A/C(-)	MVB1725R6	6PK1725
					Eng. X20XEV, A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
						TBK261	
2.2 DTI 16V	Y 22 DTR	92	09/00 → 04/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1904R6	6PK1904
2.2 i 16V	Z 22 SE	108	09/00 → 04/02		A/C(+)	MVB1030R5	5PK1030
2.5 i V6	X 25 XE	125	10/95 → 09/00		A/C(-)	MVB1904R6	6PK1904
					A/C(+)	MVB2020R6	6PK2020
						TB481	225x30
2.6 i V6	Y 26 SE	125	09/00 → 04/02		→ Ch. W7154258	TBK091	
					A/C(-)	MVB1904R6	6PK1904
					A/C(+)	MVB2020R6	6PK2020
		TB481	225x30				

VECTRA B Estate (31_)

1.6 i	X 16 SZR	55	11/96 → 06/00		A/C(-)	MVB1460R6	6PK1460
					A/C(+)	MVB1805R6	6PK1805
						TB336	111x17
						TBK008	
16 LZ2	55	11/96 → 06/00		A/C(-)	MVB1460R6	6PK1460	
				A/C(+)	MVB1805R6	6PK1805	
					TB336	111x17	
					TBK008		
1.6 i 16V	X 16 XEL, Y 16 XE, Z 16 XE	74	11/96 → 07/02		A/C(-)	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
		TBK260					



kW



OPEL

...OPEL

...VECTRA B Estate (31_)

1.8 i 16V	X 18 XE, X 18 XE1	85	11/96 → 09/00	⊗	A/C(-), 01/99→	MVB1530R6	6PK1530
				⊗	A/C(+), 01/99→	MVB1805R6	6PK1805
				⊗	Eng. X18XE, A/C(-), →12/98	MVB1725R6	6PK1725
				⊗	Eng. X18XE, A/C(+), →12/98	MVB1904R6	6PK1904
				⊗	→12/98	TB783	169x24
				⊗	01/99→	TB780	169x20
				⊗	→12/98	TBK261	
				⊗	01/99→	TBK260	
Z 18 XE		92	09/00 → 07/03	⊗	A/C(-)	MVB1530R6	6PK1530
				⊗	A/C(+)	MVB1805R6	6PK1805
				⊗		TB780	169x20
				⊗		TBK260	
2.0 DI 16V	X 20 DTL	60	11/96 → 06/00	⊗	A/C(-)	MVB1805R6	6PK1805
				⊗	A/C(+)	MVB1904R6	6PK1904
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	06/97 → 07/03	⊗	A/C(-)	MVB1805R6	6PK1805
				⊗	A/C(+)	MVB1904R6	6PK1904
2.0 i	20 NEJ	82	11/96 → 02/02	⊗	A/C(-)	MVB1725R6	6PK1725
				⊗	A/C(+)	MVB1904R6	6PK1904
				⊗		TB508	146x20
				⊗		TBK032	
2.0 i 16V	C 20 SEL, X 20 XEV	100	11/96 → 09/00	⊗	Eng. X20XE, A/C(-)	MVB1725R6	6PK1725
				⊗	Eng. X20XE, A/C(+)	MVB1904R6	6PK1904
				⊗		TB783	169x24
				⊗		TBK261	
2.2 DTI 16V	Y 22 DTR	92	09/00 → 07/03	⊗	A/C(-)	MVB1805R6	6PK1805
				⊗	A/C(+)	MVB1904R6	6PK1904
2.2 i 16V	Z 22 SE	108	09/00 → 07/03	⊗	A/C(+), →07/02	MVB1030R5	5PK1030
2.5 i V6	X 25 XE	125	11/96 → 09/00	⊗	A/C(-)	MVB1904R6	6PK1904
				⊗	A/C(+)	MVB2020R6	6PK2020
				⊗		TB481	225x30
				⊗		TBK091	
				⊗	→ Ch. W7154258		
2.6 i V6	Y 26 SE	125	09/00 → 07/03	⊗	A/C(-), →07/02	MVB1904R6	6PK1904
				⊗	A/C(+), →07/02	MVB2020R6	6PK2020
				⊗	→07/02	TB481	225x30

VECTRA B Hatchback (38_)

1.6 i	X 16 SZR	55	10/95 → 07/03	⊗	A/C(-), →06/00	MVB1460R6	6PK1460
				⊗	A/C(+), →06/00	MVB1805R6	6PK1805
				⊗	→06/00	TB336	111x17
				⊗	→06/00	TBK008	
1.6 i 16V	X 16 XEL, Y 16 XE, Z 16 XE	74	10/95 → 07/02	⊗	A/C(-)	MVB1530R6	6PK1530
				⊗	A/C(+)	MVB1805R6	6PK1805
				⊗		TB780	169x20
				⊗		TBK260	
1.7 TD	X 17 DT (TC4EE1)	60	10/95 → 12/98	⊗		SVB131250	13x1250
				⊗		SVB13925	13x925
				⊗		TB413	136x25.4
				⊗		TBK023	
				⊗		SVB10950	10x950
1.8 i 16V	X 18 XE, X 18 XE1	85	10/95 → 09/00	⊗	A/C(-), 01/99→	MVB1530R6	6PK1530
				⊗	A/C(+), 01/99→	MVB1805R6	6PK1805
				⊗	Eng. X18XE, A/C(-), →12/98	MVB1725R6	6PK1725
				⊗	Eng. X18XE, A/C(+), →12/98	MVB1904R6	6PK1904
				⊗	→12/98	TB783	169x24
				⊗	01/99→	TB780	169x20
				⊗	→12/98	TBK261	
				⊗	01/99→	TBK260	
Z 18 XE		92	09/00 → 07/03	⊗	A/C(-)	MVB1530R6	6PK1530
				⊗	A/C(+)	MVB1805R6	6PK1805
				⊗		TB780	169x20
				⊗		TBK260	
2.0 DI 16V	X 20 DTL	60	11/96 → 06/00	⊗	A/C(-)	MVB1805R6	6PK1805
				⊗	A/C(+)	MVB1904R6	6PK1904



kw



...OPEL

OPEL

...VECTRA B Hatchback (38_)

2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	06/97 → 07/03		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1904R6	6PK1904
2.0 i	20 NEJ	82	10/95 → 02/02		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1904R6	6PK1904
						TB508	146x20
						TBK032	
2.0 i 16V	C 20 SEL, X 20 XEV	100	10/95 → 09/00		Eng. X20XEV, A/C(-)	MVB1725R6	6PK1725
					Eng. X20XEV, A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
						TBK261	
2.2 DTI 16V	Y 22 DTR	92	09/00 → 07/03		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1904R6	6PK1904
2.2 i 16V	Z 22 SE	108	09/00 → 07/03		A/C(+), →07/02	MVB1030R5	5PK1030
2.5 i V6	X 25 XE	125	10/95 → 09/00		A/C(-)	MVB1904R6	6PK1904
					A/C(+)	MVB2020R6	6PK2020
						TB481	225x30
						TBK091	
					→ Ch. W7154258		
2.6 i V6	Y 26 SE	125	09/00 → 07/03		A/C(-), →07/02	MVB1904R6	6PK1904
					A/C(+), →07/02	MVB2020R6	6PK2020
						TB481	225x30
					→07/02		

VECTRA C

1.6	Z 16 XEP	77	01/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.6 16V	Z 16 XE	74	06/04 →		A/C(-), →09/05	MVB938R5	5PK938
					A/C(+), →09/05	MVB1240R5	5PK1240
						TB638	162x20
						TBK240	
					→09/05, → Eng Nr 20E4285		
1.8	Z 18 XEL	81	04/02 →		A/C(-), →09/05	MVB938R5	5PK938
					A/C(+), →09/05	MVB1240R5	5PK1240
						TB638	162x20
						TBK240	
					→09/05, → Eng Nr 20E4285		
	Z 18 XER	103	01/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.8 16V	Z 18 XE	90	04/02 →		A/C(-), →09/05	MVB938R5	5PK938
					A/C(+), →09/05	MVB1240R5	5PK1240
						TB638	162x20
						TBK240	
					→09/05, → Eng Nr 20E4285		
1.9 CDTI	Z 19 DT	88	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
	Z 19 DTH	110	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
	Z 19 DT	74	10/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
2.0 16V Turbo	Z 20 NET	129	03/03 →		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.0 DTI 16V	Y 20 DTH	74	04/02 →		A/C(-), →07/04	MVB1805R6	6PK1805
					A/C(+), →07/04	MVB1875R6	6PK1875
2.2 16V	Z 22 SE	108	04/02 →		A/C(-), →04/04	MVB875R5	5PK875
					A/C(+), →04/04	MVB1030R5	5PK1030
2.2 direct	Z 22 YH	114	10/03 →		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.2 DTI 16V	Y 22 DTR	92	04/02 →		A/C(-), →07/04	MVB1805R6	6PK1805
					A/C(+), →07/04	MVB1875R6	6PK1875



kW



...OPEL

...VECTRA C

2.8 V6 Turbo	Z 28 NEL	169	08/05 →			MVB2120R6	6PK2120
	Z 28 NET	188	08/05 →			MVB2120R6	6PK2120
		184	08/06 →			MVB2120R6	6PK2120
3.0 CDTI	Y 30 DT	130	06/03 →		→07/05	MVB1920R6	6PK1920
					→07/05	TB750	116x25
	Z 30 DT	135	08/05 →			MVB1920R6	6PK1920
						TB750	116x25
3.2 V6	Z 32 SE	155	08/02 →		A/C(-), →07/05	MVB1865R6	6PK1865
					A/C(+), →07/05	MVB1995R6	6PK1995
					→07/05	TB481	225x30

VECTRA C Estate

1.6	Z 16 XEP	77	01/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.6 16V	Z 16 XE	74	06/04 →		A/C(-), →09/05	MVB938R5	5PK938
					A/C(+), →09/05	MVB1240R5	5PK1240
					→09/05	TB638	162x20
					→09/05, → Eng Nr 20EK4285	TBK240	
1.8	Z 18 XE	90	10/03 →		A/C(-), →09/05	MVB938R5	5PK938
					A/C(+), →09/05	MVB1240R5	5PK1240
					→09/05	TB638	162x20
					→09/05, → Eng Nr 20EK4285	TBK240	
	Z 18 XER	103	01/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.9 CDTI	Z 19 DT	88	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
	Z 19 DTH	110	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
	Z 19 DT	74	10/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
2.0 DTI	Y 20 DTH	74	10/03 →		A/C(-), →07/04	MVB1805R6	6PK1805
					A/C(+), →07/04	MVB1875R6	6PK1875
2.0 Turbo	Z 20 NET	129	10/03 →		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.2 direct	Z 22 YH	114	10/03 →		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.2 DTI	Y 22 DTR	92	10/03 →		A/C(-), →07/04	MVB1805R6	6PK1805
					A/C(+), →07/04	MVB1875R6	6PK1875
2.8 V6 Turbo	Z 28 NEL	169	08/05 →			MVB2120R6	6PK2120
		188	08/05 →			MVB2120R6	6PK2120
	206	01/07 →			MVB2120R6	6PK2120	
	184	01/07 →			MVB2120R6	6PK2120	
3.0 V6 CDTI	Y 30 DT	130	10/03 →		→07/05	MVB1920R6	6PK1920
					→07/05	TB750	116x25
	Z 30 DT	135	08/05 →			MVB1920R6	6PK1920
						TB750	116x25
3.2 V6	Z 32 SE	155	10/03 →		A/C(-), →07/05	MVB1865R6	6PK1865
					A/C(+), →07/05	MVB1995R6	6PK1995
					→07/05	TB481	225x30



kW



...OPEL

OPEL

VECTRA C GTS

1.6	Z 16 XE	74	08/05 →		A/C(-), →09/05	MVB938R5	5PK938
					A/C(+), →09/05	MVB1240R5	5PK1240
					→09/05	TB638	162x20
					→09/05, → Eng Nr 20EK4285	TBK240	
	Z 16 XEP	77	01/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.8	Z 18 XER	103	01/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.8 16V	Z 18 XE	90	08/02 →		A/C(-), →09/05	MVB938R5	5PK938
					A/C(+), →09/05	MVB1240R5	5PK1240
					→09/05	TB638	162x20
					→09/05, → Eng Nr 20EK4285	TBK240	
1.9 CDTI	Z 19 DT	88	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
	Z 19 DTH	110	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
	Z 19 DT	74	10/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
2.0 16V Turbo	Z 20 NET	129	03/03 →		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.0 DTI 16V	Y 20 DTH	74	08/02 →		A/C(-), →07/04	MVB1805R6	6PK1805
					A/C(+), →07/04	MVB1875R6	6PK1875
2.2 16V	Z 22 SE	108	08/02 →		A/C(-), →04/04	MVB875R5	5PK875
					A/C(+), →04/04	MVB1030R5	5PK1030
2.2 direct	Z 22 YH	114	10/03 →		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.2 DTI 16V	Y 22 DTR	92	08/02 →		A/C(-), →07/04	MVB1805R6	6PK1805
					A/C(+), →07/04	MVB1875R6	6PK1875
2.8 V6 Turbo	Z 28 NEL	169	08/05 →			MVB2120R6	6PK2120
	Z 28 NET	188	08/05 →			MVB2120R6	6PK2120
		184	08/06 →			MVB2120R6	6PK2120
		206	08/06 →			MVB2120R6	6PK2120
3.0 CDTI	Y 30 DT	130	06/03 →		→07/05	MVB1920R6	6PK1920
					→07/05	TB750	116x25
	Z 30 DT	135	08/05 →			MVB1920R6	6PK1920
						TB750	116x25
3.2 V6	Z 32 SE	155	08/02 →		A/C(-), →07/05	MVB1865R6	6PK1865
					A/C(+), →07/05	MVB1995R6	6PK1995
					→07/05	TB481	225x30

VIVARO Box (F7)

1.9 DI	F9Q 762	60	08/01 →		A/C(-), →07/06	MVB1120R5	5PK1120
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
1.9 DTI	F9Q 760	74	08/01 →		A/C(-), →07/06	MVB1120R5	5PK1120
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
2.0 16V	F4R 720	88	08/01 →		A/C(-), →07/06	MVB1120R5	5PK1120
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB652	126x27



kW



OPEL

...OPEL

...VIVARO Box (F7)

2.0 CDTI		66	08/06 →		A/C(-), eng. PTO shaft (+)	MVB2000R7	7PK2000
		84	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1969R7	7PK1969
					A/C(-), eng. PTO shaft (+)	MVB1969R7	7PK1969
					A/C(-), eng. PTO shaft (+)	MVB2000R7	7PK2000
2.0 ECOTEC		86	08/06 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.5 CDTI	G9MB6	107	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
2.5 DTI	G9U 730	99	05/03 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1150R6	6PK1150
					A/C(+), eng. PTO shaft (+), →07/06	MVB1795R6	6PK1795
					A/C(+), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					→07/06	TB710	89x25

VIVARO Combi (J7)

1.9 DI	F9Q 774	60	08/01 →		A/C(-), →07/06	MVB1120R5	5PK1120
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
1.9 DTI	F9Q 760	74	08/01 →		A/C(-), →07/06	MVB1120R5	5PK1120
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
2.0 16V	F4R 720	88	08/01 →		A/C(-), →07/06	MVB1120R5	5PK1120
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB652	126x27
2.0 CDTI		66	08/06 →		A/C(-), eng. PTO shaft (+)	MVB1969R7	7PK1969
					A/C(-), eng. PTO shaft (+)	MVB2000R7	7PK2000
	M9R 780	84	08/06 →		A/C(-), eng. PTO shaft (+)	MVB2000R7	7PK2000
					A/C(+), eng. PTO shaft (+)	MVB1969R7	7PK1969
2.0 ECOTEC		86	08/06 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.5 CDTI	G9U 630	107	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
2.5 DTI	G9U 730	99	05/03 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1150R6	6PK1150
					A/C(+), eng. PTO shaft (+), →07/06	MVB1795R6	6PK1795
					A/C(+), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					→07/06	TB710	89x25

VIVARO Flatbed / Chassis (E7)

2.0 16V		88	08/06 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.0 CDTI		66	01/06 →		A/C(-), eng. PTO shaft (+), 08/06 →	MVB2000R7	7PK2000
					A/C(+), eng. PTO shaft (+), 08/06 →	MVB1969R7	7PK1969
	M9R 780	84	08/06 →		A/C(-), eng. PTO shaft (+)	MVB2000R7	7PK2000
					A/C(+), eng. PTO shaft (+)	MVB1969R7	7PK1969
2.0 ECOTEC	F4R 820	86	08/06 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.5 CDTI		107	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25



kW



...OPEL

OPEL

ZAFIRA

1.6	Z 16 XEP	77	07/05 →		A/C(-), →06/07	MVB1450R5	5PK1450
					A/C(+), →06/07	MVB1550R5	5PK1550
					→06/07	TB741	146x24
	Z 16 YNG	69	01/06 →		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
	Z 16 XER	85	01/08 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.7 CDTI	A 17 DTJ	81	01/08 →		A/C(-)	MVB1250R6	6PK1250
						TB656	131x25
	A 17 DTR	92	01/08 →		A/C(-)	MVB1250R6	6PK1250
						TB656	131x25
1.8	Z 18 XEP, Z 18 XER	103	07/05 →		Eng. Z18XER, A/C(-)	MVB1450R5	5PK1450
					Eng. Z18XER, A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.9 CDTI	Z 19 DTH	110	07/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
	Z 19 DT	74	07/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB639	190x24
		88	07/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB639	190x24
2.0	Z 20 LER	147	07/05 →			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LEH	177	01/06 →			MVB1680R5	5PK1680
						TB647	168x24
2.2	Z 22 YH	110	07/05 →		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030

ZAFIRA (F75_)

1.6 16V	X 16 XEL, Z 16 XE	74	04/99 → 06/05		A/C(-)	MVB938R5	5PK938
					A/C(-), 10/03 →	MVB1450R5	5PK1450
					A/C(+), 10/03 →	MVB1550R5	5PK1550
					Eng. Z16XE, A/C(+), Alt. 100A, → Ch. 12999999, 1H999999	MVB1255R5	5PK1255
					Eng. Z16XE, A/C(+), Alt. 120A, Ch. 22999999, 2H999999 →	MVB1215R5	5PK1215
						TB638	162x20
					10/03 →	TB741	146x24
					Eng. Z16XE, → Eng Nr 20041690,02HL5117	TBK103	
					Eng. Z16XE, Eng Nr 20041691, 02HL5118 →	TBK240	
					A/C(-), 09/02 →	MVB938R5	5PK938
					A/C(+), 09/02 →	MVB1215R5	5PK1215
					09/02 →	TB638	162x20
1.6 CNG	Z 16 YNG	71	09/01 → 06/05		A/C(-), 09/02 →	MVB938R5	5PK938
					A/C(+), 09/02 →	MVB1215R5	5PK1215
					09/02 →	TB638	162x20
					09/02 →	TBK240	



kW



...OPEL

...ZAFIRA (F75_)

1.8 16V	X 18 XE1	85	04/99 → 09/00	 	A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1255R5	5PK1255
				 	→ Eng Nr 20041690,02HL5117	TB638	162x20
				 	Eng Nr 20041691,02HL5118→	TBK103	
	Z 18 XE	92	09/00 → 06/05	 	A/C(-)	MVB938R5	5PK938
				 	A/C(+)	MVB1255R5	5PK1255
				 	A/C(+), Eng Nr 22000001, 2H000001→	MVB1215R5	5PK1215
				 	→ Eng Nr 20041690,02HL5117	TB638	162x20
				 	Eng Nr 20041691,02HL5118→	TBK103	
				 	Eng Nr 20041691,02HL5118→	TBK240	
2.0 DI 16V	X 20 DTL	60	10/99 → 06/05	 	A/C(-)	MVB1805R6	6PK1805
				 	A/C(+)	MVB1865R6	6PK1865
				 	A/C(+), 08/03→, Ch. 2H019031, 22109975→	MVB1875R6	6PK1875
2.0 DTI 16V	Y 20 DTH	74	09/00 → 06/05	 	A/C(-)	MVB1805R6	6PK1805
				 	A/C(+), → Ch. 2H019030, 22109974	MVB1865R6	6PK1865
				 	A/C(+), Ch. 2H019031, 22109975→	MVB1875R6	6PK1875
2.0 OPC	Z 20 LET	141	09/01 → 06/05	 	06/02→	MVB1680R5	5PK1680
				 	06/02→	TB647	168x24
	Z 20 LER	147	11/02 → 06/05	 		MVB1680R5	5PK1680
				 		TB647	168x24
2.2 16V	Z 22 SE	108	09/00 → 06/05	 	A/C(-)	MVB875R5	5PK875
				 	A/C(+)	MVB1030R5	5PK1030
2.2 DTI 16V	Y 22 DTR	92	01/02 → 06/05	 	A/C(-)	MVB1805R6	6PK1805
				 	A/C(+)	MVB1865R6	6PK1865

PEUGEOT

104

0.9	108 (XV5)	33	10/79 → 10/83	 		SVB10913	10x913
	108 (XV3)	34	10/72 → 10/79	 	08/73→10/78	SVB10900	10x900
				 	10/78→	SVB10913	10x913
1.0	108C (XV8)	32	09/83 → 06/88	 	→07/87	SVB10913	10x913
1.1	109F (XW7)	37	08/80 → 06/88	 	→07/87	SVB10913	10x913
	109 (XW3)	42	07/76 → 08/82	 	→10/78	SVB10900	10x900
				 	10/78→	SVB10913	10x913
	XW3S	48	09/78 → 09/79	 	→10/78	SVB10913	10x913
				 		SVB10900	10x900
1.2	129 (XZ5)	42	08/79 → 06/83	 		SVB10913	10x913
1.4	150 (XY6B)	53	08/79 → 06/83	 		SVB10913	10x913

104 Coupe

0.9	108 (XV3), 108 (XV5)	33	09/73 → 10/83	 	→10/78	SVB10900	10x900
				 	10/78→	SVB10913	10x913
1.1	109F (XW7)	37	08/79 → 06/88	 	→07/87	SVB10913	10x913
	109 (XW3)	42	08/79 → 06/83	 		SVB10913	10x913
	121 (XW3S)	49	08/75 → 06/80	 	→10/78	SVB10900	10x900
				 	10/78→	SVB10913	10x913
	XW3S	48	09/73 → 09/79	 	08/75→10/78	SVB10900	10x900
				 	10/78→	SVB10913	10x913
1.4	150 (XY6B)	53	08/79 → 06/84	 		SVB10913	10x913



kW



PEUGEOT

...PEUGEOT

106 I (1A, 1C)

1.0	CDY (TU9M)	33	09/91 → 04/96		A/C(-) A/C(+)	SVB10710 10x710 MVB1030R5 5PK1030 TB304 104x17 TBK005
	CDZ (TU9M)	37	09/91 → 04/96		A/C(-) A/C(+)	SVB10710 10x710 MVB1030R5 5PK1030 TB304 104x17 TBK005
1.1	HDZ (TU1M)	44	09/91 → 04/96		A/C(-) A/C(+)	SVB10710 10x710 MVB1030R5 5PK1030 TB304 104x17 TBK005
1.3	TU2J2	72	10/93 → 04/96		A/C(-) A/C(+)	SVB10710 10x710 MVB1030R5 5PK1030 TB259 108x17 TBK007
1.4	KDX (TU3MC), KDY (TU3M)	55	09/91 → 04/96		A/C(-) A/C(+) → Ch. 50355042 Ch. 50355043 → Ch. 50355043 → Eng. TU3MC, → Ch. 50355042	SVB10710 10x710 MVB1030R5 5PK1030 TB259 108x17 TB376 101x17 TBK004 TBK007
	KFZ (TU3J2/Z)	69	09/91 → 04/96		A/C(-) A/C(+)	SVB10710 10x710 MVB1030R5 5PK1030 TB376 101x17 TBK004
	TU 3	51	08/91 → 03/96		A/C(-) A/C(+)	SVB10710 10x710 MVB1030R5 5PK1030 TB259 108x17 TBK007
1.4 D	K9Y (TUD3Y)	37	09/92 → 04/96		A/C(-), V-belt pulley (+) A/C(-), V-ribbed belt pulley (+)	SVB10700 10x700 MVB700R5 5PK700
					A/C(+)	MVB1030R5 5PK1030 TB245 143x25.4 TBK030
1.5 D	VJY (TUD5)	40	06/94 → 04/96		A/C(+) MS PS	MVB1030R5 5PK1030 MVB775R5 5PK775 MVB960R5 5PK960 TB457 136x25.4 TBK041
					A/C(+) MS PS	MVB1030R5 5PK1030 MVB775R5 5PK775 MVB960R5 5PK960 TB457 136x25.4 TBK041
1.6	NFZ (TU5JP)	65	06/93 → 04/96		A/C(-), 04/94 → A/C(+), 04/94 → 04/94 → 04/94 →	SVB10710 10x710 MVB1030R5 5PK1030 TB376 101x17 TBK004
	NFY (TU5J2)	76	01/94 → 04/96		A/C(-) A/C(+)	SVB10710 10x710 MVB1030R5 5PK1030 TB376 101x17 TBK004



kW



...PEUGEOT

106 II (1)

1.0 i	CDY (TU9M)	33	05/96 →		A/C(-), V-belt pulley (+),	SVB10710	10x710
					→03/01	MVB710R5	5PK710
					A/C(-),		
					V-ribbed belt pulley (+),		
					→03/01	MVB1030R5	5PK1030
					A/C(+), →03/01	TB304	104x17
					→03/01	TBK005	
					→03/01		
	CDZ (TU9M)	37	01/97 →		A/C(-), V-belt pulley (+),	SVB10710	10x710
					→03/01	MVB710R5	5PK710
					A/C(-),		
					V-ribbed belt pulley (+),		
					→03/01	MVB1030R5	5PK1030
					A/C(+), →03/01	TB304	104x17
					→03/01	TBK005	
					→03/01		
1.1 i	HDZ (TU1M), HFX (TU1JP)	44	05/96 →		A/C(-), V-belt pulley (+),	SVB10710	10x710
					→07/04	MVB710R5	5PK710
					Eng. TU1JP,		
					A/C(-),		
					V-ribbed belt pulley (+),		
					→07/04	MVB1030R5	5PK1030
					Eng. TU1JP, A/C(+), →07/04	TB304	104x17
					→07/04, → Eng Nr 3762433	TB699	100x17
					09/00 →07/04, Eng Nr 3762434 →	TBK316	
					→07/04, Eng Nr 3762433 →	TBK005	
					Eng. TU1JP, →07/04,		
					→ Eng Nr 3762433		
	HDY (TU1M)	40	01/97 →		A/C(-), V-belt pulley (+),	SVB10710	10x710
					→03/01	MVB710R5	5PK710
					A/C(-),		
					V-ribbed belt pulley (+),		
					→03/01	MVB1030R5	5PK1030
					A/C(+), →03/01	TB304	104x17
					→03/01	TBK005	
					→03/01		
1.4 i	KFX (TU3JP), KFX (TU3JP)	55	05/96 →		A/C(-), V-belt pulley (+),	SVB10710	10x710
					→07/04	MVB710R5	5PK710
					A/C(-),		
					V-ribbed belt pulley (+),		
					→07/04	MVB1030R5	5PK1030
					A/C(+), →07/04	TB259	108x17
					→07/04, → Eng Nr 3666765	TB711	104x17
					→07/04, Eng Nr 3666766 →	TBK007	
					→07/04, → Eng Nr 3666765	TBK007	
					Auto Tensioner, →07/04,	TBK312	
					Eng Nr 3666766 →		
1.5 D	VJY (TUD5)	40	05/96 →		A/C(-), MS, →07/04	MVB775R5	5PK775
					A/C(-), PS, →07/04	MVB960R5	5PK960
					A/C(+), →07/04	MVB1030R5	5PK1030
					→07/04	TB457	136x25.4
					→07/04	TBK041	
					→07/04	TBK308	
					→07/04		
					→07/04		
	VJX (TUD5)	42	10/00 →		A/C(-), MS, →07/04	MVB775R5	5PK775
					A/C(-), PS, →07/04	MVB960R5	5PK960
					A/C(+), →07/04	MVB1030R5	5PK1030
					→07/04	TB457	136x25.4
					→07/04	TBK041	
					→07/04	TBK308	
					→07/04		
					→07/04		



kW



PEUGEOT

...PEUGEOT

...106 II (1)

1.6 i	NFZ (TU5JP)	65	05/96 →		A/C(-), →10/99	MVB710R5	5PK710
					A/C(+), →10/99	MVB1030R5	5PK1030
					→10/99	TB376	101x17
					→10/99	TBK004	
1.6 S16	NFX (TU5J4)	87	05/96 →		A/C(-), →01/01	MVB775R5	5PK775
					A/C(+), →01/01	MVB1050R5	5PK1050
					→01/01	TB376	101x17
					→01/01	TBK004	
1.6 S16	NFX (TU5J4)	87	05/96 →		A/C(-), →07/04	MVB775R5	5PK775
					A/C(+), →07/04	MVB1050R5	5PK1050
					→07/04	TB700	134x25.4
					→07/04	TB700	

107

1.0	1KR (384 F)	50	06/05 →		A/C(-)	MVB850R6	6PK850
					A/C(+)	MVB1215R6	6PK1215
1.4 HDi		40	06/05 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB962R6	6PK962
						TB720	114x25.4
						TBK230	

205 Box

1.7 Diesel	161A (XUD7)	44	03/94 →		A/C(-), →05/97	MVB700R4	4PK700
					A/C(-), →05/97	MVB715R4	4PK715
					A/C(+), →05/97	MVB1230R4	4PK1230
					A/C(+), →05/97, → Ch. 5291414	MVB985R4	4PK985
					A/C(+), →05/97, Ch. 5291415→	MVB1215R4	4PK1215
					→05/97	TB560	136x25.4
					→05/97	TBK020	
					→05/97	SVB10650	10x650
	→05/97	SVB10550	10x550				

205 I (741A/C)

1.0	108C (XV8)	33	02/83 → 10/87			MVB960R4	4PK960
					A/C(-)	SVB10913	10x913
					A/C(+)	SVB10925	10x925
1.1	109N (XW7)	36	02/83 → 10/87			MVB960R4	4PK960
					A/C(-)	SVB10913	10x913
					A/C(+)	SVB10925	10x925
						SVB10925	10x925
1.1	109F (XW7)	37	02/83 → 10/87			MVB960R4	4PK960
					A/C(-)	SVB10913	10x913
					A/C(+)	SVB10925	10x925
1.3		47	02/84 → 10/87		08/87→	SVB10775	10x775
					08/87→	SVB10610	10x610
1.4	150D (XY7), 150G (XY7)	44	02/83 → 10/87			MVB960R4	4PK960
					A/C(-)	SVB10913	10x913
					A/C(+)	SVB10925	10x925
						SVB10925	10x925
1.4	150H (XY8)	58	10/85 → 10/87			MVB960R4	4PK960
					A/C(-)	SVB10913	10x913
					A/C(+)	SVB10925	10x925
						SVB10925	10x925
1.4	150B (XY8)	59	02/83 → 10/87			MVB960R4	4PK960
					A/C(-)	SVB10913	10x913
					A/C(+)	SVB10925	10x925
						SVB10925	10x925
1.5		63	02/84 → 10/87			MVB960R4	4PK960
					A/C(-)	SVB10913	10x913
					A/C(+)	SVB10925	10x925



kW



...PEUGEOT

...205 I (741A/C)

1.6	B1E (XU51C)	53	03/87 → 10/87	⊛		MVB835R4	4PK835
				⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
						TB226	113x17
					KIT	TBK009	
	B1A (XU51C)	55	08/86 → 10/87	⊛		MVB835R4	4PK835
				⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
						TB226	113x17
					KIT	TBK009	
	BAZ (XU5CP)	55	08/86 → 10/87	⊛		MVB835R4	4PK835
				⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
						TB226	113x17
					KIT	TBK009	
1.6 GTI	180A (XU5J)	76	12/84 → 10/87	⊛		MVB835R4	4PK835
				⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
						TB226	113x17
					KIT	TBK009	
				⊕		SVB10610	10x610
1.7 Diesel	161A (XUD7)	44	08/83 → 10/87	⊗	A/C(-)	MVB700R4	4PK700
				⊗	A/C(-)	MVB715R4	4PK715
				⊗	A/C(+)	MVB1230R4	4PK1230
				⊗	A/C(+), → Ch. 5291414	MVB985R4	4PK985
				⊗	A/C(+), Ch. 5291415 →	MVB1215R4	4PK1215
						TB560	136x25.4
						TBK019	
				⊕		SVB10610	10x610
		⊕		SVB10550	10x550		
1.9 GTI	D6B (XU9JA (ohne KAT))	94	10/86 → 10/87	⊛		MVB835R4	4PK835
				⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
						TB226	113x17
					KIT	TBK009	
				⊕		SVB10610	10x610
	DFZ (XU9J1)	75	03/87 → 10/87	⊛		MVB835R4	4PK835
				⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
						TB226	113x17
					KIT	TBK009	
				⊕		SVB10610	10x610

205 I Convertible (741B, 20D)

1.1 CJ	HDZ (TU1M)	44	10/89 → 12/94	⊛		MVB810R4	4PK810
				⊗	A/C(-)	SVB10710	10x710
				⊗	A/C(+)	MVB855R4	4PK855
						TB304	104x17
					KIT	TBK005	



kW



PEUGEOT

...PEUGEOT

...205 I Convertible (741B, 20D)

1.4 CJ	150D (XY7), 150G (XY7)	44	03/88 → 05/89	☼		MVB810R4	4PK810
				⊖	A/C(-)	SVB10710	10x710
				⊕	A/C(+)	MVB855R4	4PK855
				☼		TB259	108x17
				☼KIT		TBK007	
K1D (TU3A)		49	03/89 → 12/94	☼	→06/94	MVB810R4	4PK810
				⊖	A/C(-), →06/94	SVB10710	10x710
				⊕	A/C(+), →06/94	MVB855R4	4PK855
				☼	→06/94	TB259	108x17
				☼KIT	→06/94	TBK007	
KDY (TU3M), KDZ (TU3M)		55	05/91 → 12/94	☼		MVB810R4	4PK810
				⊖	A/C(-)	SVB10710	10x710
				⊕	A/C(+)	MVB855R4	4PK855
				☼		TB259	108x17
				☼		TB376	101x17
				☼KIT		TBK007	
				☼KIT	08/92→	TBK004	
1.4 CJ CAT	KAY (TU3CP)	44	01/89 → 09/93	☼		MVB810R4	4PK810
				⊖	A/C(-)	SVB10710	10x710
				⊕	A/C(+)	MVB855R4	4PK855
				☼		TB259	108x17
				☼KIT		TBK007	
1.4 CT	150B (XY8), 150H (XY8)	58	04/86 → 12/88	☼	→07/87	MVB960R4	4PK960
				⊖	A/C(-), →07/87	SVB10913	10x913
				⊕	A/C(+), →07/87	SVB10925	10x925
1.6 CJ	BDY (XU5M3Z)	65	08/92 → 12/94	☼		MVB835R4	4PK835
				⊖	MS	MVB700R4	4PK700
				⊕	PS	MVB960R4	4PK960
				☼		TB419	114x17
				☼KIT		TBK010	
				☼		SVB10610	10x610
1.6 CTI	180A (XU5J), 180Z (XU5J)	76	04/86 → 10/90	☼		MVB835R4	4PK835
				⊖	MS	MVB700R4	4PK700
				⊕	PS	MVB960R4	4PK960
				☼		TB226	113x17
				☼KIT		TBK009	
				☼		SVB10610	10x610
1.9 CTI	DFZ (XU9J1)	75	10/87 → 12/94	☼		MVB835R4	4PK835
				⊖	MS	MVB700R4	4PK700
				⊕	PS	MVB960R4	4PK960
				☼	→01/92	TB226	113x17
				☼	01/92→	TB419	114x17
				☼KIT	→01/92	TBK009	
				☼KIT	01/92→	TBK010	
				☼		SVB10610	10x610

205 II (20A/C)

1.0	TU9	33	10/87 → 09/98	☼	→05/97	MVB810R4	4PK810
				⊖	A/C(-), →05/97	SVB10710	10x710
				⊕	A/C(+), →05/97	MVB855R4	4PK855
				☼	→05/97	TB304	104x17
				☼KIT	→05/97	TBK005	



kW



...PEUGEOT

...205 II (20A/C)

1.1	109N (XW7)	36	10/87 → 10/90	☼		MVB960R4	4PK960	
				⊗	A/C(-)	SVB10913	10x913	
				⊗	A/C(+)	SVB10925	10x925	
H1B (TU1)	40	10/87 → 10/90	☼		MVB810R4	4PK810		
			⊗	A/C(-)	SVB10710	10x710		
			⊗	A/C(+)	MVB855R4	4PK855		
					TB304	104x17		
			KIT		TBK005			
HDZ (TU1M)	44	07/89 → 09/98	☼	→05/97	MVB810R4	4PK810		
			⊗	A/C(-), →05/97	SVB10710	10x710		
			⊗	A/C(+), →05/97	MVB855R4	4PK855		
				→05/97	TB304	104x17		
			KIT	→05/97	TBK005			
1.2	F1	47	01/87 → 12/90	⊗	08/87 → 07/90	SVB10775	10x775	
				⊗	08/87 → 07/90	SVB10610	10x610	
1.3 Rallye	TU24	74	10/87 → 10/90	⊗		MVB855R4	4PK855	
				⊗		SVB10675	10x675	
				⊗		SVB10710	10x710	
						TB304	104x17	
				KIT		TBK005		
1.4	150D (XY7), 150G (XY7)	44	10/87 → 05/89	☼		MVB810R4	4PK810	
				⊗	A/C(-)	SVB10710	10x710	
				⊗	A/C(+)	MVB855R4	4PK855	
						TB259	108x17	
					KIT		TBK007	
	K1D (TU3A)	49	10/87 → 10/90	☼		MVB810R4	4PK810	
				⊗	A/C(-)	SVB10710	10x710	
				⊗	A/C(+)	MVB855R4	4PK855	
						TB259	108x17	
					KIT		TBK007	
	150B (XY8), 150H (XY8)	58	07/88 → 05/89	☼		MVB810R4	4PK810	
				⊗	A/C(-)	SVB10710	10x710	
⊗				A/C(+)	MVB855R4	4PK855		
					TB259	108x17		
				For OE 081655	TB376	101x17		
				KIT		TBK007		
K2B (TU3S)	62	06/87 → 12/89	☼		MVB810R4	4PK810		
			⊗	A/C(-)	SVB10710	10x710		
			⊗	A/C(+)	MVB855R4	4PK855		
						TB259	108x17	
				KIT		TBK007		
KDY (TU3M), KDZ (TU3M), KFX (TU3JP)	55	07/88 → 09/98	☼		MVB810R4	4PK810		
			⊗	A/C(-)	SVB10710	10x710		
			⊗	A/C(+)	MVB855R4	4PK855		
			TB259	108x17				
		For OE 081655	TB376	101x17				
					KIT		TBK007	
				KIT	08/92 → 12/94	TBK004		
150 (XY6B)	53	01/87 → 07/88	☼		MVB960R4	4PK960		
			⊗	A/C(-)	SVB10913	10x913		
			⊗	A/C(+)	SVB10925	10x925		
1.4 CAT	KAY (TU3CP)	44	08/87 → 09/93	☼		MVB810R4	4PK810	
				⊗	A/C(-)	SVB10710	10x710	
				⊗	A/C(+)	MVB855R4	4PK855	
						TB259	108x17	
				KIT		TBK007		



kW



PEUGEOT

...PEUGEOT

...205 II (20A/C)

1.6	B1E (XU51C)	53	10/87 → 09/98	☼	→06/94	MVB835R4	4PK835
				⊗	MS, →06/94	MVB700R4	4PK700
				⊗	PS, →06/94	MVB960R4	4PK960
				☼	→01/92	TB226	113x17
				☼	01/92→06/94	TB419	114x17
				☼KIT	→01/92	TBK009	
	B1A (XU51C), BAZ (XU5CP)	55	10/87 → 09/98	☼	→06/94	MVB835R4	4PK835
				⊗	MS, →06/94	MVB700R4	4PK700
				⊗	PS, →06/94	MVB960R4	4PK960
				☼	→01/92	TB226	113x17
				☼	01/92→06/94	TB419	114x17
				☼KIT	→01/92	TBK009	
1.6 Aut.	BDY (XU5M2Z), BDY (XU5M3Z)	65	05/90 → 09/98	☼	→06/96	MVB835R4	4PK835
				⊗	MS, →06/96	MVB700R4	4PK700
				⊗	PS, →06/96	MVB960R4	4PK960
				☼	→01/92	TB226	113x17
				☼	01/92→06/96	TB419	114x17
				☼KIT	→01/92	TBK009	
		58	10/87 → 09/98	☼	→06/94	MVB835R4	4PK835
				⊗	MS, →06/94	MVB700R4	4PK700
				⊗	PS, →06/94	MVB960R4	4PK960
				☼	→01/92	TB226	113x17
				☼	01/92→06/94	TB419	114x17
				☼KIT	→01/92	TBK009	
1.6 GTI	180A (XU5J), 180Z (XU5J)	76	10/87 → 12/89	☼		MVB835R4	4PK835
				⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
				☼		TB226	113x17
				☼KIT		TBK009	
				☼		SVB10610	10x610
		85	10/87 → 12/89	☼		MVB835R4	4PK835
				⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
				☼		TB226	113x17
				☼KIT		TBK009	
				☼		SVB10610	10x610
1.6 GTX		69	01/87 → 10/91	☼	09/89→07/90	MVB1020R4	4PK1020
				⊗	09/89→07/90	SVB10775	10x775
				☼	09/89→07/90	SVB10610	10x610
1.7 Diesel	161A (XUD7)	44	07/87 → 09/98	⊗	A/C(-), →05/97	MVB700R4	4PK700
				⊗	A/C(-), →05/97	MVB715R4	4PK715
				⊗	A/C(+), →05/97	MVB1230R4	4PK1230
				⊗	A/C(+), →05/97, → Ch. 5291414	MVB985R4	4PK985
				⊗	A/C(+), →05/97, Ch. 5291415→	MVB1215R4	4PK1215
				☼	→05/97	TB560	136x25.4
				☼KIT	→12/93	TBK019	
				☼KIT	01/94→05/97	TBK020	
				☼	→06/91	SVB10610	10x610
				☼	06/91→05/97	SVB10650	10x650
				☼	→05/97	SVB10550	10x550
				1.7 TD	A8B (XUD7TE)	57	01/90 → 09/98
⊗	08/90→05/97	MVB715R4	4PK715				
☼	08/90→05/97	TB560	136x25.4				
☼KIT	01/94→05/97	TBK020					
☼KIT	08/90→12/93	TBK019					



kW



...PEUGEOT

...205 II (20A/C)

1.9 Diesel	DJZ (XUD9Y)	47	10/87 → 09/98	⊗	A/C(-), →06/94, Cold climates (+)	MVB715R4	4PK715	
				⊗	A/C(-), →06/94, Hot climates (+)	MVB700R4	4PK700	
				⊗	A/C(+), →06/94	MVB1230R4	4PK1230	
					→06/94	TB560	136x25.4	
				KIT	→12/93	TBK019		
				KIT	01/94→06/94	TBK020		
1.9 GTI	D6B (XU9JA (G-KAT))	94	10/87 → 09/98	⊗	→06/91	SVB10610	10x610	
				⊗	06/91→06/94	SVB10650	10x650	
				⊗	→06/94	SVB10550	10x550	
				⊗	→05/97	MVB835R4	4PK835	
				⊗	MS, →05/97	MVB700R4	4PK700	
				⊗	PS, →05/97	MVB960R4	4PK960	
	D2A (XU92C)	75	10/87 → 05/89	⊗	→01/92	TB226	113x17	
					01/92→05/97	TB419	114x17	
				KIT	→01/92	TBK009		
				KIT	01/92→05/97	TBK010		
				⊗	→05/97	SVB10610	10x610	
				DKZ (XU9JAZ)	88	10/87 → 10/94	⊗	MS
⊗	PS	MVB700R4	4PK700					
⊗		MVB960R4	4PK960					
		TB226	113x17					
	→01/92	TB419	114x17					
KIT	01/92→	TBK009						
1.9 GTI CAT	DFZ (XU9J1)	75	10/87 → 07/94	KIT	→01/92	TBK010		
				⊗	01/92→	SVB10610	10x610	
				⊗	MS	MVB835R4	4PK835	
				⊗	PS	MVB700R4	4PK700	
					→01/92	MVB960R4	4PK960	
					01/92→	TB226	113x17	
	206 CC (2D)	9HZ (DV6TED4)	80	04/05 →		01/92→	TB419	114x17
					KIT	→01/92	TBK009	
					KIT	01/92→	TBK010	
					⊗		SVB10610	10x610
					⊗	MS	MVB835R4	4PK835
					⊗	PS	MVB700R4	4PK700
1.6 16V	NFU (TU5JP4)	80	09/00 →	⊗	→01/92	TB226	113x17	
				⊗	01/92→	TB419	114x17	
				⊗	→01/92	TBK009		
				⊗	01/92→	TBK010		
				⊗	MS	MVB835R4	4PK835	
				⊗	PS	MVB700R4	4PK700	
1.6 HDi 110	9HZ (DV6TED4)	80	04/05 →		→01/92	MVB960R4	4PK960	
					01/92→	TB226	113x17	
					→01/92	TB419	114x17	
				KIT	01/92→	TBK009		
				KIT	01/92→	TBK010		
				⊗		SVB10610	10x610	
2.0 S16	RFN (EW10J4)	100	09/00 →	⊗	A/C(-), MS, →02/07	SVB10710	10x710	
				⊗	A/C(-), PS, →02/07	MVB1450R6	6PK1450	
				⊗	A/C(+), MS, →02/07	MVB1015R6	6PK1015	
				⊗	A/C(+), PS, →04/02, → Ch. 09275	MVB1560R6	6PK1560	
				⊗	A/C(+), PS, 04/02→02/07, Ch. 09276→	MVB1560R6	6PK1560	
					→02/07	TB700	134x25.4	
1.6 HDi 110	9HZ (DV6TED4)	80	04/05 →	KIT	→02/07, → Eng Nr 1806404	TBK318		
				KIT	→02/07, Eng Nr 1806405→	TBK319		
				⊗	A/C(-), →10/05, → Ch. 10555	MVB795R6	6PK795	
				⊗	A/C(+), →10/05, → Ch. 10555	MVB975R6	6PK975	
					→02/07	TB724	137x25.4	
				KIT	→02/07	TBK302		
2.0 S16	RFN (EW10J4)	100	09/00 →	⊗	A/C(-), →02/07	MVB1200R6	6PK1200	
				⊗	A/C(+), →02/07	MVB1725R6	6PK1725	
					→02/07	TB683	153x25.4	
				KIT	→02/07	TBK279		



kW



PEUGEOT

...PEUGEOT

206 Hatchback (2A/C)

1.1 i	HFZ (TU1JP), HFZ (TU1JP)	44	09/98 →	①	A/C(-), MS, →07/02, → Ch. 09366	SVB10710	10x710
				②	A/C(-), MS, 07/02→02/07, Ch. 09367→	MVB730R6	6PK730
				③	A/C(-), PS, →02/07	MVB1450R6	6PK1450
				④	A/C(+), MS, →02/07	MVB1015R6	6PK1015
				⑤	A/C(+), PS, →02/07, Ch. 10395→	MVB1560R6	6PK1560
				⑥	A/C(+), PS, 04/02→04/05, Ch. 09276→10394	MVB1560R6	6PK1560
					→02/07, → Eng Nr 3762433	TB304	104x17
					→02/07, Eng Nr 3762434→	TB699	100x17
					→02/07, → Eng Nr 3762433	TBK005	
					→02/07, Eng Nr 3762434→	TBK316	
1.4 16V	KFU (ET3J4)	65	10/03 →	①	A/C(-), →02/07	MVB1225R6	6PK1225
				②	A/C(+), →02/07	MVB1560R6	6PK1560
					→02/07	TB813	135x25.4
					→02/07	TBK336	
1.4 HDi eco 70	8HX (DV4TD), 8HZ (DV4TD)	50	09/01 →	①	A/C(-), →09/05, → Ch. 10527	MVB1335R6	6PK1335
				②	A/C(-), 09/05→, Ch. 10528→	MVB1352R6	6PK1352
				③	A/C(+)	MVB1708R6	6PK1708
						TB720	114x25.4
						TBK230	
1.4 i	KFW (TU3JP), KFX (TU3JP)	55	09/98 →	①	A/C(-)	MVB1450R6	6PK1450
				②	A/C(-), 08/06→	MVB1225R6	6PK1225
				③	A/C(-), MS, →07/02	SVB10710	10x710
				④	A/C(-), MS, 07/02→02/07	MVB730R6	6PK730
				⑤	A/C(+)	MVB1560R6	6PK1560
				⑥	A/C(+), 06/07→, Ch. 11178→	MVB1700R6	6PK1700
				⑦	A/C(+), MS, →02/07	MVB1015R6	6PK1015
				⑧	A/C(+), PS, 04/02→04/05, Ch. 09276→10394	MVB1560R6	6PK1560
						TB711	104x17
					→02/07, → Eng Nr 3666765	TB259	108x17
					08/06→	TB376	101x17
						TBK312	
					→02/07, → Eng Nr 3666765	TBK007	
	08/06→	TBK004					
1.6 16V	NFU (TU5JP4)	80	12/00 →	①	A/C(-), MS, →02/07	SVB10710	10x710
				②	A/C(-), PS, →02/07	MVB1450R6	6PK1450
				③	A/C(+), MS, →02/07	MVB1015R6	6PK1015
				④	A/C(+), PS, →02/07, Ch. 10395→	MVB1560R6	6PK1560
				⑤	A/C(+), PS, 04/02→04/05, Ch. 09276→10394	MVB1560R6	6PK1560
					→02/07	TB700	134x25.4
					→02/07, → Eng Nr 1850061	TBK318	
	→02/07, Eng Nr 1850062→, → Ch. 11253	TBK319					
1.6 HDi 110	9HY (DV6TED4), 9HZ (DV6TED4)	80	05/04 →	①	A/C(-), →02/07	MVB795R6	6PK795
				②	A/C(+), →02/07	MVB975R6	6PK975
					→02/07	TB724	137x25.4
					→02/07	TBK302	
1.6 i	NFZ (TU5JP)	65	09/98 → 12/00	①	A/C(-)	MVB1450R6	6PK1450
				②	A/C(+), → Ch. 09275	MVB1560R6	6PK1560
						TB376	101x17
						TBK004	



kW



...PEUGEOT

...206 Hatchback (2A/C)

1.9 D	WJZ (DW8)	51	09/98 → 11/01	⊗	A/C(-), MS	MVB860R6	6PK860	
				⊗	A/C(-), PS, →09/99, → Ch. 8336	MVB1388R6	6PK1388	
				⊗	A/C(-), PS, 09/99 →	MVB1440R6	6PK1440	
				⊗	A/C(+), MS	MVB1025R6	6PK1025	
				⊗	A/C(+), PS	MVB1740R6	6PK1740	
						TB631	140x25.4	
						TBK105		
2.0 HDI 90	RHY (DW10TD)	66	12/99 →	⊗	A/C(-), →02/07	MVB1469R6	6PK1469	
				⊗	A/C(+), →02/07	MVB1740R6	6PK1740	
				⊗	A/C(+), →02/07	MVB1755R6	6PK1755	
					→02/07	TB632	141x25.4	
					→10/00, → Ch. 8735	TBK106		
					10/00 → 02/07, Ch. 8736 → 10460	TBK274		
2.0 RC	RFK (EW10J4S)	130	07/03 →	⊗	A/C(-), →02/07	MVB1200R6	6PK1200	
				⊗	A/C(+), →02/07	MVB1725R6	6PK1725	
					→02/07	TB744	153x25	
					→02/07	TBK304		
2.0 S16	RFR (DEW10J4)	99	04/99 → 10/00	⊗	A/C(-)	MVB1200R6	6PK1200	
				⊗	A/C(+)	MVB1725R6	6PK1725	
						TB683	153x25.4	
							TBK279	
		RFN (EW10J4)	100	10/00 →	⊗	A/C(-), →02/07	MVB1200R6	6PK1200
				⊗	A/C(+), →02/07	MVB1725R6	6PK1725	
					→02/07	TB683	153x25.4	
					→02/07	TBK279		

206 SW (2E/K)

1.1	HFX (TU1JP)	44	07/02 →	⊗	A/C(-), MS, →02/07	MVB730R6	6PK730
				⊗	A/C(-), PS, →02/07	MVB1450R6	6PK1450
				⊗	A/C(+), MS, →02/07	MVB1015R6	6PK1015
				⊗	A/C(+), PS, →04/05, → Ch. 10394	MVB1560R6	6PK1560
				⊗	A/C(+), PS, 04/05 → 02/07, Ch. 10395 →	MVB1560R6	6PK1560
					→02/07, → Eng Nr 3762433	TB304	104x17
					→02/07, Eng Nr 3762434 →	TB699	100x17
					→02/07, → Eng Nr 3762433	TBK005	
					→02/07, Eng Nr 3762434 →	TBK316	
1.4	KFW (TU3JP)	55	07/02 →	⊗	A/C(-), →02/07	MVB1450R6	6PK1450
				⊗	A/C(-), 05/06 → 02/07	MVB1225R6	6PK1225
				⊗	A/C(-), MS, →02/07	MVB730R6	6PK730
				⊗	A/C(+), 04/05 → 02/07	MVB1560R6	6PK1560
				⊗	A/C(+), MS, →02/07	MVB1015R6	6PK1015
				⊗	A/C(+), PS, →04/05, → Ch. 10394	MVB1560R6	6PK1560
					→02/07, → Eng Nr 3666765	TB259	108x17
					→02/07, Eng Nr 3666767 →	TB711	104x17
					05/06 → 02/07	TB376	101x17
					→02/07	TBK312	
					→02/07, → Eng Nr 3666765	TBK007	
					05/06 → 02/07	TBK004	
1.4 16V		65	10/03 →	⊗	A/C(-), →02/07	MVB1225R6	6PK1225
				⊗	A/C(+), →02/07	MVB1560R6	6PK1560
					→02/07	TB813	135x25.4
					→02/07	TBK336	
1.4 HDi	8HX (DV4TD)	50	07/02 →	⊗	A/C(-), →09/05, → Ch. 10527	MVB1335R6	6PK1335
				⊗	A/C(-), 09/05 → 02/07, Ch. 10528 →	MVB1352R6	6PK1352
				⊗	A/C(+), →02/07	MVB1708R6	6PK1708
					→02/07	TB720	114x25.4
					→02/07	TBK230	



kW



PEUGEOT

...PEUGEOT

...206 SW (2E/K)

1.6 16V	NFU (TU5JP4)	80	07/02 →		A/C(-), MS, →02/07	SVB10710	10x710
					A/C(-), PS, →02/07	MVB1450R6	6PK1450
					A/C(+), MS, →02/07	MVB1015R6	6PK1015
					A/C(+), PS, →04/05, → Ch. 10394	MVB1560R6	6PK1560
					A/C(+), PS, 04/05 →02/07, Ch. 10395 →	MVB1560R6	6PK1560
					→02/07	TB700	134x25.4
					→02/07, → Eng Nr 1850061	TBK318	
					→02/07, Eng Nr 1850062 →, → Ch. 11253	TBK319	
1.6 HDi 110	9HZ (DV6TED4)	80	05/04 →		A/C(-), →02/07	MVB795R6	6PK795
					A/C(+), →02/07	MVB975R6	6PK975
					→02/07	TB724	137x25.4
					→02/07	TBK302	
2.0 16V	RFN (EW10J4)	100	07/02 →		A/C(-), →02/07	MVB1200R6	6PK1200
					A/C(+), →02/07	MVB1725R6	6PK1725
					→02/07	TB683	153x25.4
					→02/07	TBK279	
2.0 HDi	RHY (DW10TD)	66	07/02 →		A/C(-), →02/07	MVB1469R6	6PK1469
					A/C(+), →02/07	MVB1740R6	6PK1740
					A/C(+), →02/07	MVB1755R6	6PK1755
					→02/07	TB632	141x25.4
					→02/07, → Ch. 10460	TBK274	

207 (WA_, WC_)

1.4	KFV (TU3JP)	53	02/06 →		A/C(-)	MVB730R6	6PK730
					A/C(+)	MVB1050R6	6PK1050
						TB711	104x17
						TBK312	
1.4 16V	KFU (ET3J4)	65	02/06 →		A/C(-)	MVB730R6	6PK730
					A/C(+)	MVB1050R6	6PK1050
						TB813	135x25.4
						TBK336	
		70	06/07 →		A/C(+)	MVB906R6	6PK906
1.4 HDi		50	02/06 →		A/C(-), 03/07 →, Ch. 11074 →	MVB795R6	6PK795
					A/C(+), 03/07 →, Ch. 11074 →	MVB975R6	6PK975
						TB720	114x25.4
						TBK230	
1.6 16V	NFU (TU5JP4)	80	02/06 →			MVB1050R6	6PK1050
						TB700	134x25.4
						TBK319	
1.6 16V RC		128	02/07 →		A/C(+)	MVB906R6	6PK906
1.6 16V Turbo		110	02/06 →		06/06 →	MVB906R6	6PK906
1.6 16V VTi		88	02/07 →		A/C(+)	MVB906R6	6PK906
1.6 HDi	9HX (DV6ATED4)	66	02/06 →		A/C(+), 03/07 →, Ch. 11074 →	MVB795R6	6PK795
					A/C(+), 03/07 →, Ch. 11074 →	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
	9HY (DV6TED4), 9HZ (DV6TED4)	80	02/06 →		A/C(-), 03/07 →, Ch. 11074 →	MVB795R6	6PK795
					A/C(+), 03/07 →, Ch. 11074 →	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	

207 CC (WD_)

1.6 16V	EP6	88	02/07 →		A/C(+)	MVB906R6	6PK906
1.6 16V Turbo	EP6DT	110	02/07 →			MVB906R6	6PK906
1.6 HDi	9HZ (DV6TED4)	80	02/07 →		A/C(-), Ch. 11074 →	MVB795R6	6PK795
					A/C(+), Ch. 11074 →	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	



kW



PEUGEOT

...PEUGEOT

207 SW (WK_)

1.4		54	06/07 →	 	A/C(-) A/C(+)	MVB730R6 MVB1050R6 TB711 TBK312	6PK730 6PK1050 104x17
1.4 16V		70	06/07 →	 	A/C(+)	MVB906R6	6PK906
1.6 16V		88	06/07 →	 	A/C(+)	MVB906R6	6PK906
1.6 HDi		66	06/07 →	 	A/C(+) A/C(+)	MVB795R6 MVB975R6 TB724 TBK302	6PK795 6PK975 137x25.4
	9HZ (DV6TED4)	80	06/07 →	 	A/C(-) A/C(+)	MVB795R6 MVB975R6 TB724 TBK302	6PK795 6PK975 137x25.4

305 II (581M)

1.3	118 (XL5)	44	10/82 → 08/85	 	→12/83 01/84→	SVB13900 SVB10790 SVB10775 SVB101200	13x900 10x790 10x775 10x1200
1.5	142 (XR5A)	50	09/85 → 07/90	 	→08/89 →08/89 →08/89	SVB13900 SVB10775 SVB101200	13x900 10x775 10x1200
	142 (XR5)	54	10/82 → 08/85	 	→12/83 01/84→	SVB13900 SVB10790 SVB10775 SVB101200	13x900 10x790 10x775 10x1200
1.6	171 (XU5S)	66	07/84 → 08/87	 	MS PS, →09/85 PS, 10/85→	MVB835R4 MVB700R4 MVB970R4 MVB960R4 TB226 TBK009	4PK835 4PK700 4PK970 4PK960 113x17
		71	10/82 → 06/84	 	MS PS	MVB835R4 MVB700R4 MVB970R4 TB226 TBK009	4PK835 4PK700 4PK970 113x17
	B1A (XU51C)	55	10/82 → 07/88	 	MS PS, →09/85 PS, 10/85→	MVB835R4 MVB700R4 MVB970R4 MVB960R4 TB226 TBK009	4PK835 4PK700 4PK970 4PK960 113x17
	BAZ (XU5CP)	54	11/86 → 12/88	 	MS PS	MVB835R4 MVB700R4 MVB960R4 TB226 TBK009	4PK835 4PK700 4PK960 113x17
		69	10/82 → 06/88	 	MS PS, →09/85 PS, 10/85→	MVB835R4 MVB700R4 MVB970R4 MVB960R4 TB226 TBK009	4PK835 4PK700 4PK970 4PK960 113x17



kw



PEUGEOT

...PEUGEOT

...305 II (581M)

1.8 D		44	11/82 → 12/88	⊗	A/C(-), → Eng Nr 1CV17000643	MVB700R4	4PK700				
				⊗	A/C(-), Eng Nr 1CV17000644→	MVB715R4	4PK715				
				⊗	A/C(+), → Ch. 9294843	MVB960R4	4PK960				
				⊗	A/C(+), Ch. 9294844→	MVB1215R4	4PK1215				
						TB560	136x25.4				
						TBK019					
				⊕		SVB10610	10x610				
				⊗	Ch. 9323991→	SVB10550	10x550				
				1.9	159 (XU9S)	75	10/82 → 08/85	⊗		MVB835R4	4PK835
								⊗	MS	MVB700R4	4PK700
⊗	PS	MVB970R4	4PK970								
		TB226	113x17								
		TBK009									
DFZ (XU9J1)	72	11/86 → 12/88	⊗			MVB835R4	4PK835				
			⊗		MS	MVB700R4	4PK700				
			⊗		PS	MVB960R4	4PK960				
						TB226	113x17				
						TBK009					
1.9 D	162 (XUD9), D9A (XUD9)	47	10/82 → 07/88	⊗	A/C(-), → Eng Nr 1CV17000643	MVB700R4	4PK700				
				⊗	A/C(-), Eng Nr 1CV17000644→	MVB715R4	4PK715				
				⊗	A/C(+), → Ch. 9294843	MVB960R4	4PK960				
				⊗	A/C(+), Ch. 9294844→	MVB1215R4	4PK1215				
						TB560	136x25.4				
	162 (XUD9)	48	10/82 → 07/88	⊗		TBK019					
				⊕		SVB10610	10x610				
				⊗	Ch. 9323991→	SVB10550	10x550				
				⊗	A/C(-), → Eng Nr 1CV17000643	MVB700R4	4PK700				
				⊗	A/C(-), Eng Nr 1CV17000644→	MVB715R4	4PK715				
305 II Break (581E)	118 (XL5)	44	10/82 → 08/86	⊗		MVB960R4	4PK960				
				⊗		MVB1215R4	4PK1215				
				⊗		TB560	136x25.4				
				⊗		TBK019					
				⊕		SVB10610	10x610				
	142 (XR5)	54	10/82 → 08/86	⊗		SVB10550	10x550				
				→12/83		MVB700R4	4PK700				
				01/84→		MVB715R4	4PK715				
				*		MVB960R4	4PK960				
				*		MVB1215R4	4PK1215				
142 (XR5A)	50	09/85 → 10/86	⊗		TB560	136x25.4					
			→12/83		TBK019						
			01/84→		SVB10610	10x610					
			*		SVB10550	10x550					
			*		SVB13900	13x900					

305 II Break (581E)

1.3	118 (XL5)	44	10/82 → 08/86	⊗		SVB13900	13x900
				⊗	→12/83	SVB10790	10x790
				⊗	01/84→	SVB10775	10x775
				*		SVB101200	10x1200
				*		SVB13900	13x900
1.5	142 (XR5)	54	10/82 → 08/86	⊗		SVB13900	13x900
				⊗	→12/83	SVB10790	10x790
				⊗	01/84→	SVB10775	10x775
				*		SVB101200	10x1200
				*		SVB13900	13x900
1.5	142 (XR5A)	50	09/85 → 10/86	⊗		SVB13900	13x900
				⊗		SVB10775	10x775
				*		SVB101200	10x1200



kW



...PEUGEOT

...305 II Break (581E)

1.6	171 (XU5S)	71	09/83 → 06/84	⚙️		MVB835R4	4PK835				
				⚙️	MS	MVB700R4	4PK700				
				⚙️	PS	MVB970R4	4PK970				
				🌀		TB226	113x17				
				🌀KIT		TBK009					
BAZ (XU5CP)	54	11/86 → 12/88		⚙️	MS	MVB835R4	4PK835				
				⚙️	PS	MVB700R4	4PK700				
				⚙️		MVB960R4	4PK960				
				🌀		TB226	113x17				
				🌀KIT		TBK009					
B1A (XU51C)	55	02/86 → 12/88		⚙️	MS	MVB835R4	4PK835				
				⚙️	PS	MVB700R4	4PK700				
				⚙️		MVB960R4	4PK960				
				🌀		TB226	113x17				
				🌀KIT		TBK009					
171 (XU5S)	66	07/84 → 12/87		⚙️	MS	MVB835R4	4PK835				
				⚙️	PS, →09/85	MVB700R4	4PK700				
				⚙️	PS, 10/85 →	MVB970R4	4PK970				
				⚙️		MVB960R4	4PK960				
				🌀		TB226	113x17				
1.8 D	44	11/82 → 12/88		⚙️	A/C(-), → Eng Nr 1CV17000643	MVB700R4	4PK700				
				⚙️	A/C(-), Eng Nr 1CV17000644 →	MVB715R4	4PK715				
				⚙️	A/C(+), → Ch. 9294843	MVB960R4	4PK960				
				⚙️	A/C(+), Ch. 9294844 →	MVB1215R4	4PK1215				
				🌀		TB560	136x25.4				
1.9	159 (XU9S)	75	09/84 → 10/87								
								⚙️	MS	MVB835R4	4PK835
								⚙️	PS, →09/85	MVB700R4	4PK700
								⚙️	PS, 10/85 →	MVB970R4	4PK970
								⚙️		MVB960R4	4PK960
DFZ (XU9J1)	72	11/86 → 12/88									
								⚙️	MS	MVB835R4	4PK835
								⚙️	PS	MVB700R4	4PK700
								⚙️		MVB960R4	4PK960
								🌀		TB226	113x17
1.9 Diesel	162 (XUD9), D9A (XUD9)	47	10/82 → 12/88								
								⚙️	A/C(-), → Eng Nr 1CV17000643	MVB700R4	4PK700
								⚙️	A/C(-), Eng Nr 1CV17000644 →	MVB715R4	4PK715
								⚙️	A/C(+), → Ch. 9294843	MVB960R4	4PK960
								⚙️	A/C(+), Ch. 9294844 →	MVB1215R4	4PK1215
162 (XUD9)	48	10/82 → 12/88									
								🌀		TB560	136x25.4
								🌀KIT		TBK019	
								⚙️	→ Ch. 9323990	SVB10610	10x610
								⚙️	Ch. 9323991 →	SVB10550	10x550
162 (XUD9)	48	10/82 → 12/88									
								⚙️	A/C(-), → Eng Nr 1CV17000643	MVB700R4	4PK700
								⚙️	A/C(-), Eng Nr 1CV17000644 →	MVB715R4	4PK715
								⚙️	A/C(+), → Ch. 9294843	MVB960R4	4PK960
								⚙️	A/C(+), Ch. 9294844 →	MVB1215R4	4PK1215
162 (XUD9)	48	10/82 → 12/88									
								🌀		TB560	136x25.4
								🌀KIT		TBK019	
								⚙️	→ Ch. 9323990	SVB10610	10x610
								⚙️	Ch. 9323991 →	SVB10550	10x550



kw



PEUGEOT

...PEUGEOT

306 (7B, N3, N5)

1.1	HDZ (TU1M)	44	06/94 → 05/01		MS, →04/97	MVB800R5	5PK800
					PS, →04/97	MVB1255R5	5PK1255
					A/C(-), MS, →04/97	SVB10710	10x710
					A/C(+), →04/97	MVB855R4	4PK855
					→04/97	TB304	104x17
					→04/97	TBK005	
					A/C(-), →04/97	MVB875R5	5PK875
1.4 SL	KDX (TU3MC), KFW (TU3JP), KFX (TU3JP)	55	06/94 → 05/01		Eng. TU3JP, MS	MVB800R5	5PK800
					A/C(-), MS	SVB10710	10x710
					Eng. TU3JP, A/C(+), PS	MVB855R4	4PK855
					→ Eng Nr 3666765	TB259	108x17
					05/96→, Eng Nr 3666766→	TB711	104x17
					05/96→, Eng Nr 3666766→	TBK312	
					Eng. TU3JP, → Eng Nr 3666765	TBK007	
					Eng. TU3JP, A/C(-)	MVB875R5	5PK875
					Eng. TU3JP, A/C(+)	MVB1255R5	5PK1255
1.6	NFT	72	10/00 → 05/01			MVB1225R5	5PK1225
					A/C(-), MS	SVB10710	10x710
					A/C(+), PS	MVB855R4	4PK855
						TB376	101x17
						TBK004	
	A/C(-)	MVB875R5	5PK875				
	A/C(+)	MVB1255R5	5PK1255				
1.6 SR	NFZ (TU5JP)	65	06/94 → 10/00		05/97→	MVB1225R5	5PK1225
					MS, →04/97	MVB800R5	5PK800
					A/C(-), MS	SVB10710	10x710
					A/C(-), PS	MVB855R4	4PK855
						TB376	101x17
						TBK004	
					A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1255R5	5PK1255
1.8 16V	LFY (XU7JP4)	81	03/97 → 05/01		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB479	136x25.4
						TBK122	
					Auto Tensioner		
1.8 ST	LFZ (XU7JP)	74	06/94 → 05/01		A/C(-), PS, Alt. 70,8A, →04/99	MVB1065R6	6PK1065
					A/C(-), PS, Alt. 90A, →04/99	MVB1080R6	6PK1080
					A/C(+), PS, →04/99	MVB1660R6	6PK1660
					→04/99	TB419	114x17
					→04/99	TBK010	
1.9 D	DHV (XUD9BSD)	55	03/98 → 05/01		A/C(-), MS, →05/99	MVB730R6	6PK730
					A/C(-), PS, →05/99	MVB1130R6	6PK1130
					A/C(+), MS, →05/99	MVB1173R6	6PK1173
					A/C(+), PS, →05/99	MVB1740R6	6PK1740
					→05/99	TB560	136x25.4
		→05/99	TBK020				
	WJY (DW8B), WJZ (DW8)	51	09/98 → 05/01		A/C(-), MS, 02/99→	MVB860R6	6PK860
					A/C(-), PS, 02/99→09/99, → Ch. 8336	MVB1388R6	6PK1388
					A/C(-), PS, 09/99→	MVB1440R6	6PK1440
					Eng. DW8B, A/C(+), MS, 02/99→	MVB1045R6	6PK1045
				Eng. DW8B, A/C(+), PS, 02/99→	MVB1755R6	6PK1755	
	02/99→	TB631	140x25.4				
	Eng. DW8B, 02/99→	TBK105					



kW



...PEUGEOT

...306 (7B, N3, N5)

Engine	Model	kW	Period	Accessories	Options	Part Numbers	Dimensions				
1.9 SLD	DJZ (XUD9Y)	47	06/94 → 05/01	⊗	A/C(-), MS, →05/99	MVB730R6	6PK730				
				⊗	A/C(-), PS, →06/95	MVB1150R6	6PK1150				
				⊗	A/C(-), PS, →09/96	MVB1105R6	6PK1105				
				⊗	A/C(-), PS, 06/95→09/96	MVB1115R6	6PK1115				
				⊗	A/C(-), PS, 09/96→05/99	MVB1130R6	6PK1130				
				⊗	A/C(+), MS, →05/99	MVB1173R6	6PK1173				
				⊗	A/C(+), PS, →06/95	MVB1700R6	6PK1700				
				⊗	A/C(+), PS, 06/95→05/99	MVB1740R6	6PK1740				
					→05/99	TB560	136x25.4				
					→05/99	TBK020					
				1.9 SRDT	DHY (XUD9A)	50	06/94 → 05/01	⊗	A/C(-), MS, →05/99	MVB730R6	6PK730
								⊗	A/C(-), PS, →06/95	MVB1150R6	6PK1150
								⊗	A/C(-), PS, →09/96	MVB1105R6	6PK1105
								⊗	A/C(-), PS, 06/95→09/96	MVB1115R6	6PK1115
⊗	A/C(-), PS, 09/96→05/99	MVB1130R6	6PK1130								
⊗	A/C(+), MS, →05/99	MVB1173R6	6PK1173								
⊗	A/C(+), PS, →06/95	MVB1700R6	6PK1700								
⊗	A/C(+), PS, 06/95→05/99	MVB1740R6	6PK1740								
	→05/99	TB560	136x25.4								
	→05/99	TBK020									
1.9 SRDT	DHY (XUD9TE)	66	06/94 → 05/01					⊗	A/C(-), MS, →05/99	MVB730R6	6PK730
								⊗	A/C(-), PS, →06/95	MVB1150R6	6PK1150
								⊗	A/C(-), PS, →09/96	MVB1105R6	6PK1105
								⊗	A/C(-), PS, 06/95→09/96	MVB1115R6	6PK1115
				⊗	A/C(-), PS, 09/96→05/99	MVB1130R6	6PK1130				
				⊗	A/C(+), MS, →05/99	MVB1173R6	6PK1173				
				⊗	A/C(+), PS, →06/95	MVB1700R6	6PK1700				
				⊗	A/C(+), PS, 06/95→05/99	MVB1740R6	6PK1740				
					→05/99	TB560	136x25.4				
					→05/99	TBK020					
				2.0	RFV (XU10J4R)	97	03/97 → 05/01	⊗	A/C(-)	MVB1165R6	6PK1165
								⊗	A/C(+)	MVB1600R6	6PK1600
										TB479	136x25.4
										TBK113	
2.0 HDI 90	RHY (DW10TD)	66	06/99 → 05/01	⊗	A/C(-)	MVB1469R6	6PK1469				
				⊗	A/C(+)	MVB1755R6	6PK1755				
						TB632	141x25.4				
					→04/00	TBK106					
2.0 S16	RFY (XU10J4Z)	112	06/94 → 05/01	⊗	A/C(-), PS, Alt. 70,8A, →04/97	MVB1065R6	6PK1065				
				⊗	A/C(-), PS, Alt. 90A, →04/97	MVB1080R6	6PK1080				
				⊗	A/C(+), MS, →04/97	MVB1100R6	6PK1100				
				⊗	A/C(+), PS, →04/97	MVB1660R6	6PK1660				
					→04/97	TB453	134x25.4				
	RFT (XU10J4)	110	06/94 → 05/01	⊗	A/C(-), PS, Alt. 70,8A, →04/97	MVB1065R6	6PK1065				
				⊗	A/C(-), PS, Alt. 90A, →04/97	MVB1080R6	6PK1080				
				⊗	A/C(+), MS, →04/97	MVB1100R6	6PK1100				
				⊗	A/C(+), PS, →04/97	MVB1660R6	6PK1660				
					→04/97	TB453	134x25.4				

PEUGEOT



kw



PEUGEOT

...PEUGEOT

...306 (7B, N3, N5)

2.0 ST	RFX (XU10J2)	89	07/94 → 05/01	⊗	A/C(-), 07/96→04/97, Ch. 7175→	MVB1165R6	6PK1165
				⊗	A/C(-), PS, Alt. 70,8A, →06/96, → Ch. 7174	MVB1065R6	6PK1065
				⊗	A/C(-), PS, Alt. 90A, →06/96, → Ch. 7174	MVB1080R6	6PK1080
				⊗	A/C(+), 07/96→04/97, Ch. 7175→	MVB1600R6	6PK1600
				⊗	A/C(+), MS, →06/96, → Ch. 7174	MVB1100R6	6PK1100
				⊗	A/C(+), PS, →06/96, → Ch. 7174	MVB1660R6	6PK1660
					→04/97	TB419	114x17
					→04/97	TBK010	

306 Break (7E, N3, N5)

1.4	KFW (TU3JP), KFX (TU3JP)	55	03/97 → 04/02	⊗	MS	MVB800R5	5PK800
				⊗	A/C(-), MS	SVB10710	10x710
				⊗	A/C(+), PS	MVB855R4	4PK855
					→ Eng Nr 3666765	TB259	108x17
					Eng Nr 3666766→	TB711	104x17
					→ Eng Nr 3666765	TBK007	
					Eng Nr 3666766→	TBK312	
				⊗	A/C(-)	MVB875R5	5PK875
				⊗	A/C(+)	MVB1255R5	5PK1255
1.6	NFZ (TU5JP)	65	03/97 → 10/00	⊗		MVB1225R5	5PK1225
				⊗	A/C(-), MS	SVB10710	10x710
				⊗	A/C(+), PS	MVB855R4	4PK855
						TB376	101x17
						TBK004	
				⊗	A/C(-)	MVB875R5	5PK875
				⊗	A/C(+)	MVB1255R5	5PK1255
	NFT	72	10/00 → 04/02	⊗		MVB1225R5	5PK1225
				⊗	A/C(-), MS	SVB10710	10x710
				⊗	A/C(+), PS	MVB855R4	4PK855
						TB376	101x17
						TBK004	
				⊗	A/C(-)	MVB875R5	5PK875
				⊗	A/C(+)	MVB1255R5	5PK1255
1.8	LFZ (XU7JP)	74	03/97 → 04/02	⊗	A/C(-), PS, Alt. 70,8A, →04/99	MVB1065R6	6PK1065
				⊗	A/C(-), PS, Alt. 90A, →04/99	MVB1080R6	6PK1080
				⊗	A/C(+), PS, →04/99	MVB1660R6	6PK1660
					→04/99	TB419	114x17
					→04/99	TBK010	
1.8 16V	LFY (XU7JP4)	81	03/97 → 04/02	⊗	A/C(-)	MVB1080R6	6PK1080
				⊗	A/C(+)	MVB1660R6	6PK1660
						TB479	136x25.4
					Auto Tensioner	TBK122	



kW



...PEUGEOT

...306 Break (7E, N3, N5)

1.9 D	DJY (XUD9A)	50	03/97 → 04/02	⊗	A/C(-), MS, →05/99	MVB730R6	6PK730				
				⊗	A/C(-), PS, →05/99	MVB1130R6	6PK1130				
				⊗	A/C(+), MS, →05/99	MVB1173R6	6PK1173				
				⊗	A/C(+), PS, →05/99	MVB1740R6	6PK1740				
					→05/99	TB560	136x25.4				
					→05/99	TBK020					
				DHV (XUD9BSD)	55	03/98 → 04/02	⊗	A/C(-), MS, →05/99	MVB730R6	6PK730	
							⊗	A/C(-), PS, →05/99	MVB1130R6	6PK1130	
							⊗	A/C(+), MS, →05/99	MVB1173R6	6PK1173	
							⊗	A/C(+), PS, →05/99	MVB1740R6	6PK1740	
	→05/99	TB560	136x25.4								
	→05/99	TBK020									
WJY (DW8B), WJZ (DW8)	51	09/98 → 04/02	⊗				A/C(-), MS, 02/99→	MVB860R6	6PK860		
			⊗				A/C(-), PS, 02/99→09/99, → Ch. 8336	MVB1388R6	6PK1388		
			⊗				A/C(-), PS, 09/99→	MVB1440R6	6PK1440		
			⊗				Eng. DW8B, A/C(+), MS, 02/99→	MVB1045R6	6PK1045		
			⊗	Eng. DW8B, A/C(+), PS, 02/99→	MVB1755R6	6PK1755					
				02/99→	TB631	140x25.4					
				Eng. DW8B, 02/99→	TBK105						
			1.9 TD	DHY (XUD9TE)	66	02/97 → 04/02	⊗	A/C(-), MS, →05/99	MVB730R6	6PK730	
							⊗	A/C(-), PS, →05/99	MVB1130R6	6PK1130	
							⊗	A/C(+), MS, →05/99	MVB1173R6	6PK1173	
⊗	A/C(+), PS, →05/99	MVB1740R6					6PK1740				
	→05/99	TB560					136x25.4				
	→05/99	TBK020									
2.0	RFV (XU10J4R)	97					03/97 → 04/02	⊗	A/C(-), →10/01	MVB1165R6	6PK1165
								⊗	A/C(+), →10/01	MVB1600R6	6PK1600
									→10/01	TB479	136x25.4
									→10/01	TBK113	
2.0 HDI 90	RHY (DW10TD)	66	06/99 → 04/02	⊗	A/C(-)	MVB1469R6	6PK1469				
				⊗	A/C(+)	MVB1755R6	6PK1755				
						TB632	141x25.4				
					→04/00	TBK106					
					04/00→	TBK274					

306 Convertible (7D, N3, N5)

1.6	NFZ (TU5JP)	65	04/96 → 10/00	⊗	MS, 08/96→	MVB800R5	5PK800			
				⊗	A/C(-), MS, 08/96→	SVB10710	10x710			
				⊗	A/C(+), 08/96→	MVB855R4	4PK855			
					08/96→	TB376	101x17			
					08/96→	TBK004				
				⊗	A/C(-), 08/96→	MVB875R5	5PK875			
				⊗	A/C(+), 08/96→	MVB1255R5	5PK1255			
				NFT	72	10/00 → 04/02	⊗	MS	MVB800R5	5PK800
							⊗	A/C(-), MS	SVB10710	10x710
							⊗	A/C(+)	MVB855R4	4PK855
		TB376	101x17							
		TBK004								
⊗	A/C(-)	MVB875R5	5PK875							
⊗	A/C(+)	MVB1255R5	5PK1255							
1.8	LFZ (XU7JP)	74	03/94 → 04/02				⊗	A/C(-), MS, →04/99	MVB698R6	6PK698
							⊗	A/C(-), PS, Alt. 70,8A, →04/99	MVB1065R6	6PK1065
							⊗	A/C(-), PS, Alt. 90A, →04/99	MVB1080R6	6PK1080
				⊗	A/C(+), MS, →04/99	MVB1100R6	6PK1100			
				⊗	A/C(+), PS, →04/99	MVB1660R6	6PK1660			
					→04/99	TB419	114x17			
1.8 16V	LFY (XU7JP4)	81	07/00 → 04/02		→04/99	TBK010				
				⊗	A/C(-)	MVB1080R6	6PK1080			
				⊗	A/C(+)	MVB1660R6	6PK1660			
						TB479	136x25.4			
					Auto Tensioner	TBK122				



kW



PEUGEOT

...PEUGEOT

...306 Convertible (7D, N3, N5)

2.0	RFX (XU10J2)	89	03/94 → 04/02	⊗	A/C(-), 07/96 → 04/97, Ch. 7175 →	MVB1165R6	6PK1165
				⊗	A/C(-), PS, Alt. 70,8A, → 06/96, → Ch. 7174	MVB1065R6	6PK1065
				⊗	A/C(-), PS, Alt. 90A, → 06/96, → Ch. 7174	MVB1080R6	6PK1080
				⊗	A/C(+), 07/96 → 04/97, Ch. 7175 →	MVB1600R6	6PK1600
				⊗	A/C(+), MS, → 06/96, → Ch. 7174	MVB1100R6	6PK1100
				⊗	A/C(+), PS, → 06/96, → Ch. 7174	MVB1660R6	6PK1660
				⊗	→ 04/97	TB419	114x17
				⊗	→ 04/97	TBK010	
2.0 16V	RFV (XU10J4R)	97	03/97 → 04/02	⊗	A/C(-)	MVB1165R6	6PK1165
				⊗	A/C(+)	MVB1600R6	6PK1600
				⊗		TB479	136x25.4
				⊗		TBK113	

306 Hatchback (7A, 7C, N3, N5)

1.1	HDZ (TU1M)	44	05/93 → 05/01	⊗	MS, → 04/97	MVB800R5	5PK800
				⊗	PS, → 04/97	MVB1255R5	5PK1255
				⊗	A/C(-), MS, → 04/97	SVB10710	10x710
				⊗	A/C(+), → 04/97	MVB855R4	4PK855
				⊗	→ 04/97	TB304	104x17
				⊗	→ 04/97	TBK005	
				⊗	A/C(-), → 04/97	MVB875R5	5PK875
1.4	KDX (TU3MC), KFW (TU3JP), KFX (TU3JP)	55	05/93 → 05/01	⊗	Eng. TU3JP, MS	MVB800R5	5PK800
				⊗	A/C(-), MS	SVB10710	10x710
				⊗	Eng. TU3JP, A/C(+), PS → Eng Nr 3666765	MVB855R4	4PK855
				⊗	05/96 →, Eng Nr 3666766 →	TB259	108x17
				⊗	05/96 →, Eng Nr 3666766 →	TB711	104x17
				⊗	Eng. TU3JP, → Eng Nr 3666765	TBK312	
				⊗	Eng. TU3JP, A/C(-)	TBK007	
				⊗	Eng. TU3JP, A/C(+)	MVB875R5	5PK875
				⊗		MVB1255R5	5PK1255
1.6	NFZ (TU5JP)	65	05/93 → 10/00	⊗	05/97 →	MVB1225R5	5PK1225
				⊗	MS, → 04/97	MVB800R5	5PK800
				⊗	A/C(-), MS	SVB10710	10x710
				⊗	A/C(+), PS	MVB855R4	4PK855
				⊗		TB376	101x17
				⊗		TBK004	
				⊗	A/C(-)	MVB875R5	5PK875
				⊗	A/C(+)	MVB1255R5	5PK1255
	NFT	72	10/00 → 05/01	⊗		MVB1225R5	5PK1225
				⊗	A/C(-), MS	SVB10710	10x710
				⊗	A/C(+), PS	MVB855R4	4PK855
				⊗		TB376	101x17
				⊗		TBK004	
				⊗	A/C(-)	MVB875R5	5PK875
				⊗	A/C(+)	MVB1255R5	5PK1255
1.8	LFZ (XU7JP)	74	05/93 → 05/01	⊗	A/C(-), PS, Alt. 70,8A, → 04/99	MVB1065R6	6PK1065
				⊗	A/C(-), PS, Alt. 90A, → 04/99	MVB1080R6	6PK1080
				⊗	A/C(+), PS, → 04/99	MVB1660R6	6PK1660
				⊗	→ 04/99	TB419	114x17
				⊗	→ 04/99	TBK010	
1.8 16V	LFY (XU7JP4)	81	03/97 → 05/01	⊗	A/C(-)	MVB1080R6	6PK1080
				⊗	A/C(+)	MVB1660R6	6PK1660
				⊗		TB479	136x25.4
				⊗	Auto Tensioner	TBK122	



kW



...PEUGEOT

...306 Hatchback (7A, 7C, N3, N5)

Engine	Model	kW	Year Range	Accessories	Options	Part Numbers	Dimensions				
1.8 D	A9A (XUD7)	43	05/93 → 05/01	?	A/C(-), MS, →06/00	MVB730R6	6PK730				
				?	A/C(-), PS, →06/95	MVB1150R6	6PK1150				
				?	A/C(-), PS, 06/95→09/96	MVB1115R6	6PK1115				
				?	A/C(-), PS, 09/96→06/00	MVB1130R6	6PK1130				
				?	A/C(+), MS, →06/00	MVB1173R6	6PK1173				
				?	A/C(+), PS, →06/95	MVB1700R6	6PK1700				
				?	A/C(+), PS, 06/95→06/00	MVB1740R6	6PK1740				
				?	→06/00	TB560	136x25.4				
				?	→12/93	TBK019					
				?	01/94→06/00	TBK020					
1.9 D	DJZ (XUD9Y)	47	05/93 → 05/01	?	A/C(-), MS, →05/99	MVB730R6	6PK730				
				?	A/C(-), PS, →06/95	MVB1150R6	6PK1150				
				?	A/C(-), PS, →09/96	MVB1105R6	6PK1105				
				?	A/C(-), PS, 06/95→09/96	MVB1115R6	6PK1115				
				?	A/C(-), PS, 09/96→05/99	MVB1130R6	6PK1130				
				?	A/C(+), MS, →05/99	MVB1173R6	6PK1173				
				?	A/C(+), PS, →06/95	MVB1700R6	6PK1700				
				?	A/C(+), PS, 06/95→05/99	MVB1740R6	6PK1740				
				?	→05/99	TB560	136x25.4				
				?	→12/93	TBK019					
1.9 D	DJY (XUD9A)	50	06/94 → 05/01	?	A/C(-), MS, →05/99	MVB730R6	6PK730				
				?	A/C(-), PS, →06/95	MVB1150R6	6PK1150				
				?	A/C(-), PS, →09/96	MVB1105R6	6PK1105				
				?	A/C(-), PS, 06/95→09/96	MVB1115R6	6PK1115				
				?	A/C(-), PS, 09/96→05/99	MVB1130R6	6PK1130				
				?	A/C(+), MS, →05/99	MVB1173R6	6PK1173				
				?	A/C(+), PS, →06/95	MVB1700R6	6PK1700				
				?	A/C(+), PS, 06/95→05/99	MVB1740R6	6PK1740				
				?	→05/99	TB560	136x25.4				
				?	→05/99	TBK020					
1.9 D	DHV (XUD9BSD)	55	03/98 → 05/01	?	A/C(-), MS, →05/99	MVB730R6	6PK730				
				?	A/C(-), PS, →05/99	MVB1130R6	6PK1130				
				?	A/C(+), MS, →05/99	MVB1173R6	6PK1173				
				?	A/C(+), PS, →05/99	MVB1740R6	6PK1740				
				?	→05/99	TB560	136x25.4				
				?	→05/99	TBK020					
				1.9 D	WJY (DW8B), WJZ (DW8)	51	09/98 → 05/01	?	A/C(-), MS, 02/99→	MVB860R6	6PK860
								?	A/C(-), PS, 02/99→09/99, → Ch. 8336	MVB1388R6	6PK1388
								?	A/C(-), PS, 09/99→	MVB1440R6	6PK1440
								?	Eng. DW8B, A/C(+), MS, 02/99→	MVB1045R6	6PK1045
?	Eng. DW8B, A/C(+), PS, 02/99→	MVB1755R6	6PK1755								
?	02/99→	TB631	140x25.4								
?	Eng. DW8B, 02/99→	TBK105									
1.9 DT	DHY (XUD9TE)	66	05/93 → 05/01					?	A/C(-), MS, →05/99	MVB730R6	6PK730
								?	A/C(-), PS, →06/95	MVB1150R6	6PK1150
								?	A/C(-), PS, →09/96	MVB1105R6	6PK1105
				?	A/C(-), PS, 06/95→09/96	MVB1115R6	6PK1115				
				?	A/C(-), PS, 09/96→05/99	MVB1130R6	6PK1130				
				?	A/C(+), MS, →05/99	MVB1173R6	6PK1173				
				?	A/C(+), PS, →06/95	MVB1700R6	6PK1700				
				?	A/C(+), PS, 06/95→05/99	MVB1740R6	6PK1740				
				?	→05/99	TB560	136x25.4				
				?	→12/93	TBK019					
2.0 16V	RFV (XU10J4R)	97	03/97 → 05/01	?	A/C(-)	MVB1165R6	6PK1165				
				?	A/C(+)	MVB1600R6	6PK1600				
				?		TB479	136x25.4				
				?		TBK113					



kw



PEUGEOT

...PEUGEOT

...306 Hatchback (7A, 7C, N3, N5)

2.0 HDI 90	RHY (DW10TD)	66	06/99 → 05/01	⊗	A/C(-)	MVB1469R6	6PK1469				
				⊗	A/C(+)	MVB1755R6	6PK1755				
						TB632	141x25.4				
					→04/00	TBK106					
					04/00→	TBK274					
2.0 S16	RFY (XU10J4Z)	112	05/93 → 05/01	⊗	A/C(-), PS, Alt. 70,8A, →04/97	MVB1065R6	6PK1065				
				⊗	A/C(-), PS, Alt. 90A, →04/97	MVB1080R6	6PK1080				
				⊗	A/C(+), MS, →04/97	MVB1100R6	6PK1100				
				⊗	A/C(+), PS, →04/97	MVB1660R6	6PK1660				
						→04/97	TB453	134x25.4			
		RFT (XU10J4)	110	06/94 → 05/01	⊗	A/C(-), PS, Alt. 70,8A, →04/97	MVB1065R6	6PK1065			
					⊗	A/C(-), PS, Alt. 90A, →04/97	MVB1080R6	6PK1080			
					⊗	A/C(+), MS, →04/97	MVB1100R6	6PK1100			
					⊗	A/C(+), PS, →04/97	MVB1660R6	6PK1660			
						→04/97	TB453	134x25.4			
	RFS (XU10J4RS)	120	03/96 → 05/01	⊗	A/C(-), 05/97→	MVB1165R6	6PK1165				
				⊗	A/C(+), 05/97→	MVB1600R6	6PK1600				
					04/00→	TB724	137x25.4				
					05/97→03/00	TB479	136x25.4				
					05/97→03/00	TBK113					
2.0 XSi	RFX (XU10J2)	89	05/93 → 05/01	⊗	A/C(-), 07/96→04/97, Ch. 7175→	MVB1165R6	6PK1165				
				⊗	A/C(-), PS, Alt. 70,8A, 11/93→06/96, → Ch. 7174	MVB1065R6	6PK1065				
				⊗	A/C(-), PS, Alt. 90A, 11/93→06/96, → Ch. 7174	MVB1080R6	6PK1080				
				⊗	A/C(+), 07/96→04/97, Ch. 7175→	MVB1600R6	6PK1600				
				⊗	A/C(+), MS, 11/93→06/96, → Ch. 7174	MVB1100R6	6PK1100				
				⊗	A/C(+), PS, 11/93→06/96, → Ch. 7174	MVB1660R6	6PK1660				
									11/93→04/97	TB419	114x17
									11/93→04/97	TBK010	

307 (3A/C)

1.4	KFW (TU3JP)	55	08/00 →	⊗	A/C(-), 03/01→09/03	MVB730R6	6PK730
				⊗	A/C(+), Alt. 90A, 03/01→09/03	MVB1125R6	6PK1125
				⊗	A/C(+), Alt. 120A, 03/01→09/03	MVB1150R6	6PK1150
						TB259	108x17
						TB711	104x17
						TBK007	
						TBK312	
1.4 16V	KFU (ET3J4)	65	11/03 →	⊗	A/C(-), →11/07	MVB730R6	6PK730
				⊗	A/C(+), Alt. 80A, →12/03, → Ch. 09887	MVB1125R6	6PK1125
				⊗	A/C(+), Alt. 90A, →11/07, Ch. 09888→	MVB1050R6	6PK1050
				⊗	A/C(+), Alt. 120A, →11/07, Ch. 09888→	MVB1065R6	6PK1065
				⊗	A/C(+), Alt. 120A, →12/03, → Ch. 09887	MVB1150R6	6PK1150
						TB813	135x25.4
						TBK336	



kW



...PEUGEOT

...307 (3A/C)

1.4 HDi	8HX (DV4TD), 8HZ (DV4TD)	50	10/01 →	⊗	Eng. DV4TD, A/C(-), →06/05	MVB795R6	6PK795
				⊗	Eng. DV4TD, A/C(+), →06/05	MVB975R6	6PK975
					→06/05	TB720	114x25.4
				KIT	→06/05	TBK230	
1.6 16V	NFU (TU5JP4)	80	08/00 →	⊗	A/C(-), 03/01→11/07	MVB730R6	6PK730
				⊗	A/C(+),	MVB1125R6	6PK1125
					Alt. 90A, 03/01→12/03,		
					→ Ch. 09887		
				⊗	A/C(+),	MVB1050R6	6PK1050
					Alt. 90A, 12/03→11/07,		
					Ch. 09888→		
				⊗	A/C(+),	MVB1150R6	6PK1150
	Alt. 120A, 03/01→12/03,						
	→ Ch. 09887						
	⊗	A/C(+),	MVB1065R6	6PK1065			
	Alt. 120A, 12/03→11/07,						
	Ch. 09888→						
		03/01→11/07	TB700	134x25.4			
	KIT	03/01→11/07,	TBK318				
		→ Eng Nr 1806404					
	KIT	03/01→11/07, Eng Nr 1806405→	TBK319				
1.6 BioFlex		80	09/07 →	⊗	A/C(-), →11/07	MVB730R6	6PK730
				⊗	A/C(+), Alt. 70,8A, →11/07,	MVB1050R6	6PK1050
					Ch. 09888→		
				⊗	A/C(+), Alt. 120A, →11/07,	MVB1065R6	6PK1065
					Ch. 09888→		
		→11/07	TB700	134x25.4			
	KIT	→11/07, → Eng Nr 1806404	TBK318				
	KIT	→11/07, Eng Nr 1806405→	TBK319				
1.6 HDi	9HX (DV6ATED4)	66	04/05 →	⊗	A/C(-), →11/07, Ch. 11074→	MVB795R6	6PK795
				⊗	A/C(+), →11/07, Ch. 11074→	MVB975R6	6PK975
					→11/07	TB724	137x25.4
				KIT	→11/07	TBK302	
1.6 HDi 110	9HY (DV6TED4)	80	02/04 →	⊗	A/C(-), →11/07, Ch. 11074→	MVB795R6	6PK795
				⊗	A/C(+), →11/07, Ch. 11074→	MVB975R6	6PK975
					→11/07	TB724	137x25.4
				KIT	→11/07	TBK302	
2.0 16V	RFN (EW10J4)	100	08/00 →	⊗	12/04→06/05, Ch. 10248→	MVB1000R6	6PK1000
				⊗	A/C(-), 03/01→11/04,	MVB1190R6	6PK1190
					→ Ch. 10247		
		⊗	A/C(+), 03/01→11/04,	MVB1708R6	6PK1708		
			→ Ch. 10247				
			03/01→06/05	TB683	153x25.4		
		KIT	03/01→06/05	TBK279			
	RFJ (EW10A)	103	03/05 →	⊗	07/05→11/07	MVB1000R6	6PK1000
					07/05→11/07	TB744	153x25
	RFK (EW10J4S)	130	06/05 →	⊗	→11/07	MVB1708R6	6PK1708
					→11/07	TB744	153x25
				KIT	→11/07	TBK304	
2.0 HDi 110	RHS (DW10ATED)	79	08/00 →	⊗	A/C(-), 09/01→10/06	MVB870R6	6PK870
				⊗	A/C(+), 09/01→10/06	MVB1155R6	6PK1155
					09/01→10/06	TB632	141x25.4
				KIT	09/01→10/06	TBK274	
2.0 HDi 135	RHR (DW10BTED4)	100	10/03 →	⊗	→11/07	MVB1215R6	6PK1215
					→11/07	TB742	116x25
				KIT	→11/07	TBK338	
2.0 HDi 90	RHY (DW10TD)	66	08/00 →	⊗	A/C(-), 03/01→06/05	MVB870R6	6PK870
				⊗	A/C(+), 03/01→06/05	MVB1155R6	6PK1155
					03/01→06/05	TB632	141x25.4
				KIT	03/01→06/05	TBK274	



kW



PEUGEOT

...PEUGEOT

307 Break (3E)

1.4 16V	KFU (ET3J4)	65	11/03 →	①	A/C(-)	MVB730R6	6PK730
				②	A/C(+), Alt. 80A, →12/03, → Ch. 09887	MVB1125R6	6PK1125
				③	A/C(+), Alt. 90A, Ch. 09888→	MVB1050R6	6PK1050
				④	A/C(+), Alt. 120A, →12/03, → Ch. 09887	MVB1150R6	6PK1150
				⑤	A/C(+), Alt. 120A, Ch. 09888→	MVB1065R6	6PK1065
						TB813	135x25.4
						TBK336	
1.4 HDi	8HZ (DV4TD)	50	03/02 →	①	A/C(-), →06/05	MVB795R6	6PK795
				②	A/C(+), →06/05	MVB975R6	6PK975
					→06/05	TB720	114x25.4
						TBK230	
1.6 16V	NFU (TU5JP4)	80	03/02 →	①	A/C(-)	MVB730R6	6PK730
				②	A/C(+), Alt. 70,8A, →12/03, → Ch. 09887	MVB1125R6	6PK1125
				③	A/C(+), Alt. 90A, 12/03→,	MVB1050R6	6PK1050
				④	Ch. 09888→		
				⑤	A/C(+), Alt. 120A, →12/03, → Ch. 09887	MVB1150R6	6PK1150
				⑥	A/C(+), Alt. 120A, 12/03→,	MVB1065R6	6PK1065
				⑦	Ch. 09888→		
						TB700	134x25.4
					→ Eng Nr 1806404	TBK318	
					Eng Nr 1806405→	TBK319	
1.6 BioFlex		80	09/07 →	①	A/C(-)	MVB730R6	6PK730
				②	A/C(+), Alt. 90A, Ch. 09888→	MVB1050R6	6PK1050
				③	A/C(+), Alt. 120A, Ch. 09888→	MVB1065R6	6PK1065
				④		TB700	134x25.4
				⑤		TBK318	
					→ Eng Nr 1806404	TBK319	
					Eng Nr 1806405→		
1.6 HDi	9HX (DV6ATED4)	66	04/05 →			TB724	137x25.4
						TBK302	
1.6 HDi 110	9HY (DV6TED4)	80	02/04 →	①	A/C(-), →11/07, Ch. 11074→	MVB795R6	6PK795
				②	A/C(+), →11/07, Ch. 11074→	MVB975R6	6PK975
					→11/07	TB724	137x25.4
						TBK302	
2.0	RFN (EW10J4)	100	03/02 →	①	12/04→06/05, Ch. 10248→	MVB1000R6	6PK1000
				②	A/C(-), →11/04, → Ch. 10247	MVB1190R6	6PK1190
				③	A/C(+), →11/04, → Ch. 10247	MVB1708R6	6PK1708
				④	→06/05	TB683	153x25.4
				⑤	→06/05	TBK279	
2.0 16V	RFJ (EW10A)	103	03/05 →	①		MVB1000R6	6PK1000
						TB744	153x25
				RFK (EW10J4S)	130	06/05 →	①
		TB744	153x25				
						TBK304	
2.0 HDi 110	RHS (DW10ATED)	79	03/02 →	①	A/C(-), →10/06	MVB870R6	6PK870
				②	A/C(+), →10/06	MVB1155R6	6PK1155
					→10/06	TB632	141x25.4
						TBK274	
2.0 HDi 135	RHR (DW10BTED4)	100	02/04 →	①		MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.0 HDi 90	RHY (DW10TD)	66	03/02 →	①	A/C(-), →06/05	MVB870R6	6PK870
				②	A/C(+), →06/05	MVB1155R6	6PK1155
				③	→06/05	TB632	141x25.4
				④	→06/05	TBK274	
				⑤	→06/05		



kW



...PEUGEOT

307 CC (3B)

1.6 16V	NFU (TU5JP4)	80	03/05 →		A/C(-)	MVB730R6	6PK730
					A/C(+), Alt. 90A, Ch. 09888 →	MVB1050R6	6PK1050
					A/C(+), Alt. 90A, Ch. 09888 →	MVB1065R6	6PK1065
						TB700	134x25.4
					→ Eng Nr 1806404	TBK318	
2.0 16V	RFN (EW10J4)	100	10/03 →		11/04 → 06/05	MVB1000R6	6PK1000
					A/C(-), → 11/04, → Ch. 10247	MVB1190R6	6PK1190
					A/C(+), → 11/04, → Ch. 10247	MVB1708R6	6PK1708
					→ 06/05	TB683	153x25.4
					→ 06/05	TBK279	
	RFK (EW10J4S)	130	10/03 →		A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1708R6	6PK1708
						TB744	153x25
						TBK304	
						MVB1000R6	6PK1000
RFJ (EW10A)	103	03/05 →			TB744	153x25	
					MVB1215R6	6PK1215	
					TB742	116x25	
2.0 HDi 135	RHR (DW10BTE4)	100	06/05 →			TBK338	

307 SW (3H)

1.4 16V	KFU (ET3J4)	65	11/03 →		A/C(-)	MVB730R6	6PK730				
					A/C(+), Alt. 80A, → 12/03, → Ch. 09887	MVB1125R6	6PK1125				
					A/C(+), Alt. 90A, Ch. 09888 →	MVB1050R6	6PK1050				
					A/C(+), Alt. 120A, → 12/03, → Ch. 09887	MVB1150R6	6PK1150				
					A/C(+), Alt. 120A, Ch. 09888 →	MVB1065R6	6PK1065				
						TB813	135x25.4				
						TBK336					
				1.6 16V	NFU (TU5JP4)	80	03/02 →		A/C(-)	MVB730R6	6PK730
									A/C(+), Alt. 70.8A, → 12/03, → Ch. 09887	MVB1125R6	6PK1125
									A/C(+), Alt. 90A, 12/03 →, Ch. 09888 →	MVB1050R6	6PK1050
	A/C(+), Alt. 120A, → 12/03, → Ch. 09887	MVB1150R6	6PK1150								
	A/C(+), Alt. 120A, 12/03 →, Ch. 09888 →	MVB1065R6	6PK1065								
		TB700	134x25.4								
	→ Eng Nr 1806404	TBK318									
1.6 BioFlex		80	09/07 →		Eng Nr 1806405 →	TBK319					
					A/C(-)	MVB730R6	6PK730				
					A/C(+), Alt. 70.8A, Ch. 09888 →	MVB1050R6	6PK1050				
1.6 D		66	12/06 →		A/C(+), Alt. 120A, Ch. 09888 →	MVB1065R6	6PK1065				
						TB700	134x25.4				
					→ Eng Nr 1806404	TBK318					
1.6 HDi 110	9HY (DV6TED4)	80	02/04 →		Eng Nr 1806405 →	TBK319					
						TB724	137x25.4				
1.6 D		66	12/06 →			TBK302					
						MVB795R6	6PK795				
					A/C(-), → 11/07, Ch. 11074 →	MVB975R6	6PK975				
					A/C(+), → 11/07, Ch. 11074 →	TB724	137x25.4				
1.6 HDi 110		80	02/04 →		→ 11/07	TBK302					
					→ 11/07						



kw



PEUGEOT

...PEUGEOT

...307 SW (3H)

2.0 16V	RFN (EW10J4)	100	03/02 →		12/04 → 06/05, Ch. 10248 →	MVB1000R6	6PK1000
					A/C(-), →11/04, → Ch. 10247	MVB1190R6	6PK1190
					A/C(+), →11/04, → Ch. 10247	MVB1708R6	6PK1708
					→06/05	TB683	153x25.4
					→06/05	TBK279	
	RFJ (EW10A)	103	03/05 →		07/05 →	MVB1000R6	6PK1000
					07/05 →	TB744	153x25
2.0 HDi 110	RHS (DW10ATED)	79	03/02 →		A/C(-), →10/06	MVB870R6	6PK870
					A/C(+), →10/06	MVB1155R6	6PK1155
					→10/06	TB632	141x25.4
					→10/06	TBK274	
2.0 HDi 135	RHR (DW10BTED4)	100	02/04 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.0 HDi 90	RHY (DW10TD)	66	03/02 →		A/C(-), →06/05	MVB870R6	6PK870
					A/C(+), →06/05	MVB1155R6	6PK1155
					→06/05	TB632	141x25.4
					→06/05	TBK274	

308 (4A_, 4C_)

1.4 16V		70	09/07 →		A/C(+)	MVB906R6	6PK906
1.6 16V		88	09/07 →		A/C(+)	MVB906R6	6PK906
		110	09/07 →			MVB906R6	6PK906
	EP6DTS	128	03/08 →			MVB906R6	6PK906
1.6 HDi		66	09/07 →		A/C(+)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
	9HZ (DV6TED4)	80	09/07 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
2.0 HDi	RHR (DW10BTED4)	100	09/07 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	

308 SW

1.4 16V		70	09/07 →		A/C(+), 04/08 →	MVB906R6	6PK906
1.6 16V		88	09/07 →		A/C(+), 04/08 →	MVB906R6	6PK906
		110	09/07 →		04/08 →	MVB906R6	6PK906
		128	03/08 →			MVB906R6	6PK906
	1.6 HDi		66	09/07 →		A/C(+), 04/08 →	MVB795R6
					A/C(+), 04/08 →	MVB975R6	6PK975
					04/08 →	TB724	137x25.4
					04/08 →	TBK302	
		80	09/07 →		A/C(-), 04/08 →	MVB795R6	6PK795
					A/C(+), 04/08 →	MVB975R6	6PK975
					04/08 →	TB724	137x25.4
					04/08 →	TBK302	
2.0 HDi		100	09/07 →		04/08 →	MVB1215R6	6PK1215
					04/08 →	TB742	116x25
					04/08 →	TBK338	

309 I (10C, 10A)

1.1	E1	40	10/85 → 07/89			SVB10775	10x775
1.3	G1A	47	10/85 → 07/89			SVB10775	10x775



kW



...PEUGEOT

...309 I (10C, 10A)

1.4	K1D (TU3A)	49	03/89 → 07/89	 		MVB810R4 SVB10710 TB259 TBK007	4PK810 10x710 108x17
	KDY (TU3M), KDZ (TU3M)	55	03/89 → 07/89	 		MVB810R4 SVB10710 TB259 TBK007	4PK810 10x710 108x17
	K2B (TU3S)	62	03/89 → 07/89	 		MVB810R4 SVB10710 TB259 TBK007	4PK810 10x710 108x17
1.5	Y2/K	63	06/87 → 12/89			SVB10775	10x775
1.6	B1E (XU51C)	53	08/87 → 07/89			MVB835R4	4PK835
					MS	MVB700R4	4PK700
					PS	MVB960R4	4PK960
	 		TB226 TBK009	113x17			
	B1A (XU51C)	55	10/85 → 07/89			MVB835R4	4PK835
					MS	MVB700R4	4PK700
					PS	MVB960R4	4PK960
	 		TB226 TBK009	113x17			
	180Z (XU5J), B6B (XU5J)	76	11/85 → 09/88			MVB835R4	4PK835
					MS	MVB700R4	4PK700
					PS	MVB960R4	4PK960
		 		TB226 TBK009	113x17		
		59	10/85 → 07/89			MVB835R4	4PK835
				MS	MVB700R4	4PK700	
	PS			MVB960R4	4PK960		
 		TB226 TBK009	113x17				
69	01/86 → 07/89			SVB10775	10x775		
83	07/86 → 06/89			MVB835R4	4PK835		
	MS	MVB700R4	4PK700				
	PS	MVB960R4	4PK960				
 		TB226 TBK009	113x17				
1.6 CAT	BAZ (XU5CP)	55	09/86 → 12/89			MVB835R4	4PK835
					MS	MVB700R4	4PK700
					PS	MVB960R4	4PK960
 		TB226 TBK009	113x17				
1.9	DFZ (XU9J1)	72	03/86 → 07/89			MVB835R4	4PK835
					MS	MVB700R4	4PK700
					PS	MVB960R4	4PK960
	 		TB226 TBK009	113x17			
	D2B (XU9S)	75	10/85 → 07/89			MVB835R4	4PK835
					MS	MVB700R4	4PK700
					PS	MVB960R4	4PK960
	 		TB226 TBK009	113x17			
	DDZ (XU9M)	80	07/88 → 07/89			MVB835R4	4PK835
				MS	MVB700R4	4PK700	
				PS	MVB960R4	4PK960	
 		TB226 TBK009	113x17				



kw



PEUGEOT

...PEUGEOT

...309 I (10C, 10A)

1.9 D	162 (XUD9), D9A (XUD9)	47	06/86 → 07/89	⊗	A/C(-), Cold climates (-)	MVB700R4	4PK700
				⊗	A/C(-), Cold climates (+)	MVB715R4	4PK715
				⊗	A/C(+)	MVB1215R4	4PK1215
				⊗	A/C(+)	MVB1230R4	4PK1230
				🌀		TB560	136x25.4
				🌀		TBK019	
				⊕		SVB10610	10x610
				⊕		SVB10550	10x550
				🌀		MVB835R4	4PK835
				🌀		MVB700R4	4PK700
1.9 GTI	DKZ (XU9JAZ)	88	07/88 → 07/89	⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
				🌀		TB226	113x17
				🌀		TBK009	
				🌀		MVB835R4	4PK835
	D6B (XU9JA (G-KAT))	94	10/86 → 07/89	⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
				🌀		TB226	113x17
				🌀		TBK009	
				🌀		MVB835R4	4PK835

309 II (3C, 3A)

1.1	HDZ (TU1M)	44	08/90 → 12/93	⊗		MVB810R4	4PK810		
				⊗		SVB10710	10x710		
				🌀		TB304	104x17		
				🌀		TBK005			
1.4	KDY (TU3M), KDZ (TU3M)	55	07/89 → 12/93	⊗		MVB810R4	4PK810		
				⊗		MVB855R4	4PK855		
				⊗		SVB10710	10x710		
				🌀		TB259	108x17		
				🌀		TB376	101x17		
				🌀		TBK004			
	K1D (TU3A)	49	07/90 → 12/93	⊗		MVB810R4	4PK810		
				⊗		SVB10710	10x710		
				🌀		TB259	108x17		
				🌀		TBK007			
				🌀		MVB835R4	4PK835		
				🌀		MVB700R4	4PK700		
1.6	BDY (XU5M2Z), BDY (XU5M3Z), BDZ (XU5M)	65	07/89 → 12/93	⊗	MS	MVB700R4	4PK700		
				⊗	PS	MVB960R4	4PK960		
				🌀	->01/92	TB226	113x17		
				🌀	01/92->	TB419	114x17		
				🌀	->01/92	TBK009			
				🌀	01/92->	TBK010			
				69	07/89 → 12/93	⊗	MS	MVB835R4	4PK835
						⊗	PS	MVB700R4	4PK700
						⊗		MVB960R4	4PK960
	🌀	->01/92	TB226			113x17			
	🌀	01/92->	TB419			114x17			
	🌀	->01/92	TBK009						
	🌀	01/92->	TBK010						
	B2A (XU52C/K)	68	07/89 → 12/93			⊗	MS	MVB835R4	4PK835
						⊗	PS	MVB700R4	4PK700
				⊗		MVB960R4	4PK960		
				🌀	->01/92	TB226	113x17		
				🌀	01/92->	TB419	114x17		
🌀				->01/92	TBK009				
🌀	01/92->	TBK010							





kW



...PEUGEOT

...309 II (3C, 3A)

1.8 Diesel	161A (XUD7)	44	07/89 → 12/93		A/C(-), Cold climates (-)	MVB700R4	4PK700
					A/C(-), Cold climates (+)	MVB715R4	4PK715
					A/C(+)	MVB1215R4	4PK1215
					A/C(+)	MVB1230R4	4PK1230
						TB560	136x25.4
						TBK019	
						SVB10610	10x610
1.8 TD	A8B (XUD7TE)	57	08/89 → 12/93		A/C(-), Cold climates (-)	MVB700R4	4PK700
					A/C(-), Cold climates (+)	MVB715R4	4PK715
					A/C(+)	MVB1215R4	4PK1215
					A/C(+)	MVB1230R4	4PK1230
						TB560	136x25.4
						TBK019	
						SVB10650	10x650
1.9	DFZ (XU9J1)	72	08/89 → 12/93		MS	MVB835R4	4PK835
					PS	MVB700R4	4PK700
					→01/92	TB226	113x17
					01/92→	TB419	114x17
					→01/92	TBK009	
					01/92→	TBK010	
					01/92→	TBK010	
	DDZ (XU9M)	80	10/90 → 12/93		MS	MVB835R4	4PK835
					PS	MVB700R4	4PK700
					→01/92	TB226	113x17
					01/92→	TB419	114x17
					→01/92	TBK009	
					01/92→	TBK010	
					01/92→	TBK010	
1.9 Diesel	162 (XUD9), D9A (XUD9), DJZ (XUD9Y)	47	07/89 → 12/93		A/C(-), Cold climates (-)	MVB700R4	4PK700
					A/C(-), Cold climates (+)	MVB715R4	4PK715
					A/C(+)	MVB1215R4	4PK1215
					A/C(+)	MVB1230R4	4PK1230
						TB560	136x25.4
						TBK019	
						SVB10610	10x610
1.9 GTI	DKZ (XU9JAZ)	88	07/89 → 12/93		MS	MVB835R4	4PK835
					PS	MVB700R4	4PK700
					→01/92	TB226	113x17
					01/92→	TB419	114x17
					→01/92	TBK009	
					01/92→	TBK010	
					01/92→	TBK010	
1.9 GTI 16V	DFW (XU9JAZ)	108	10/90 → 12/93		A/C(-)	MVB725R5	5PK725
					A/C(+)	MVB1270R5	5PK1270
	D6C (XU9J4)	116	08/89 → 07/90			TB345	133x25.4
					A/C(-)	MVB725R5	5PK725
					A/C(+)	MVB1270R5	5PK1270
		TB345	133x25.4				



kw



PEUGEOT

...PEUGEOT

405 I (15B)

1.4		47	01/87 → 07/92		06/87 →	SVB10710	10x710
					06/87 →	TB259	108x17
					06/87 →	TBK007	
1.6	B1E (XU51C)	53	07/87 → 12/92		→07/92	MVB835R4	4PK835
					MS, →07/92	MVB700R4	4PK700
					PS, →07/92	MVB960R4	4PK960
					→01/92	TB226	113x17
					01/92 →07/92	TB419	114x17
					→01/92	TBK009	
					01/92 →07/92	TBK010	
	BDZ (XU5M)	66	10/89 → 12/92		→07/92	MVB835R4	4PK835
					MS, →07/92	MVB700R4	4PK700
					PS, →07/92	MVB960R4	4PK960
					→01/92	TB226	113x17
					01/92 →07/92	TB419	114x17
					→01/92	TBK009	
					01/92 →07/92	TBK010	
	B1E (XU51C), BAZ (XU5CP)	55	07/87 → 06/88			MVB835R4	4PK835
					MS	MVB700R4	4PK700
					PS	MVB960R4	4PK960
						TB226	113x17
						TBK009	
	BDY (XU5M2Z), BDZ (XU5M)	65	07/87 → 12/92		→07/92	MVB835R4	4PK835
					MS, →07/92	MVB700R4	4PK700
					PS, →07/92	MVB960R4	4PK960
					→01/92	TB226	113x17
					01/92 →07/92	TB419	114x17
					→01/92	TBK009	
					01/92 →07/92	TBK010	
		69	01/87 → 12/92		06/87 →07/92	MVB835R4	4PK835
					MS, 06/87 →07/92	MVB700R4	4PK700
					PS, 06/87 →07/92	MVB960R4	4PK960
					01/92 →07/92	TB419	114x17
					06/87 →01/92	TB226	113x17
					01/92 →07/92	TBK010	
					06/87 →01/92	TBK009	
1.8 Turbo Diesel	A8A (XUD7TE), AJZ (XUD7TEY)	66	03/88 → 12/92		A/C(+), MAN, →07/92	MVB970R5	5PK970
					Eng. XUD7TE, A/C(-), AUTO, →07/92	MVB710R5	5PK710
					Eng. XUD7TE, A/C(-), MAN, →07/92	MVB700R5	5PK700
					Eng. XUD7TE, A/C(-), MAN, →07/92	MVB715R4	4PK715
					Eng. XUD7TE, A/C(+), AUTO, →07/92	MVB1230R5	5PK1230
					→07/92	TB560	136x25.4
					Eng. XUD7TE, →07/92	TBK019	
					Eng. XUD7TE, →07/92	SVB10650	10x650
					Eng. XUD7TE, →07/92	SVB10550	10x550



kW



...PEUGEOT

...405 I (15B)

PEUGEOT

1.9	DDZ (XU92C (U-KAT))	70	07/87 → 12/92	⚙️	→07/92	MVB835R4	4PK835
				⚙️	MS, →07/92	MVB700R4	4PK700
				⚙️	PS, →07/92	MVB960R4	4PK960
				🔌	→01/92	TB226	113x17
				🔌	01/92→07/92	TB419	114x17
				🔌KIT	→01/92	TBK009	
	DDZ (XU9M)	80	07/88 → 12/92	⚙️		MVB835R4	4PK835
				⚙️	MS	MVB700R4	4PK700
				⚙️	PS	MVB960R4	4PK960
				🔌	→01/92	TB226	113x17
				🔌	01/92→	TB419	114x17
				🔌KIT	→01/92	TBK009	
1.9 4x4	DDZ (XU9JAZ)	88	07/88 → 12/92	⚙️	→07/92	MVB835R4	4PK835
				⚙️	MS, →07/92	MVB700R4	4PK700
				⚙️	PS, →07/92	MVB960R4	4PK960
				🔌	→01/92	TB226	113x17
				🔌	01/92→07/92	TB419	114x17
				🔌KIT	→01/92	TBK009	
	93	07/87 → 12/93	⚙️	→07/92	MVB835R4	4PK835	
			⚙️	MS, →07/92	MVB700R4	4PK700	
			⚙️	PS, →07/92	MVB960R4	4PK960	
			🔌	→01/92	TB226	113x17	
			🔌	01/92→07/92	TB419	114x17	
			🔌KIT	→01/92	TBK009		
1.9 Diesel	DDZ (XU9M)	80	07/88 → 12/92	⚙️	→07/92	MVB835R4	4PK835
				⚙️	MS, →07/92	MVB700R4	4PK700
				⚙️	PS, →07/92	MVB960R4	4PK960
				🔌	→01/92	TB226	113x17
				🔌	01/92→07/92	TB419	114x17
				🔌KIT	→01/92	TBK009	
	DJZ (XUD9Y)	47	07/88 → 09/92	⚙️	A/C(-), AUTO	MVB710R5	5PK710
				⚙️	A/C(-), MAN	MVB700R4	4PK700
				⚙️	A/C(+), AUTO	MVB1230R5	5PK1230
				⚙️	A/C(+), MAN	MVB970R5	5PK970
				🔌		TB560	136x25.4
				🔌KIT		TBK019	
D9B (XUD9A)	51	03/88 → 12/92	⚙️	A/C(-), AUTO, →07/92	SVB10650	10x650	
			⚙️	A/C(-), MAN, →07/92	SVB10550	10x550	
			⚙️	A/C(-), MS, 08/92→	MVB710R5	5PK710	
			⚙️	A/C(-), PS, 08/92→, → Ch. 70980931	MVB700R4	4PK700	
			⚙️	A/C(-), PS, 08/92→, Ch. 70980932→	MVB730R6	6PK730	
			⚙️	A/C(-), PS, 08/92→, Ch. 70980932→	MVB1130R6	6PK1130	
	D9B (XUD9A)	51	03/88 → 12/92	⚙️	A/C(+), AUTO, →07/92	MVB1150R6	6PK1150
				⚙️	A/C(+), MAN, →07/92	MVB1230R5	5PK1230
				⚙️	A/C(+), MS, 08/92→	MVB970R5	5PK970
				⚙️	A/C(+), PS, 08/92→	MVB1173R6	6PK1173
				🔌		MVB1700R6	6PK1700
				🔌KIT		TB560	136x25.4
D9B (XUD9A)	51	03/88 → 12/92	⚙️		TBK019		
			⚙️	→07/92	SVB10650	10x650	
			⚙️	A/C(+), PS	SVB10550	10x550	
			⚙️				
			⚙️				
			⚙️				



kW



PEUGEOT

...PEUGEOT

...405 I (15B)

1.9 Injection	DFZ (XU9J1)	77	07/87 → 12/92	☼ ⊖ ⊖ ☞ ☞ ☞ ^{KIT} ☞ ^{KIT}	→07/92 MS, →07/92 PS, →07/92 →01/92 01/92→07/92 →01/92 01/92→07/92	MVB835R4 MVB700R4 MVB960R4 TB226 TB419 TBK009 TBK010	4PK835 4PK700 4PK960 113x17 114x17
1.9 Sport MI-16	D6C (XU9J4)	116	07/87 → 11/91	⊖ ⊖ ⊖ ☞	A/C(-) A/C(+) A/C(+)	MVB725R5 MVB1015R5 MVB1270R5 TB345	5PK725 5PK1015 5PK1270 133x25.4
	DFW (XU9J4Z)	108	04/88 → 12/92	⊖ ⊖ ⊖ ☞	A/C(-), →07/92 A/C(+), →07/92 A/C(+), →07/92 →07/92	MVB725R5 MVB1015R5 MVB1270R5 TB345	5PK725 5PK1015 5PK1270 133x25.4
1.9 SPort MI-16 4x4	DFW (XU9J4Z)	108	04/88 → 12/92	⊖ ⊖ ⊖ ☞	A/C(-), →07/92 A/C(+), →07/92 A/C(+), →07/92 →07/92	MVB725R5 MVB1015R5 MVB1270R5 TB345	5PK725 5PK1015 5PK1270 133x25.4

405 I Break (15E)

1.4	TU 3	47	05/88 → 07/92	⊖ ☞ ☞ ^{KIT}		SVB10710 TB259 TBK007	10x710 108x17
1.6	B1E (XU51C)	53	10/88 → 08/92	☼ ⊖ ⊖ ☞ ☞ ☞ ^{KIT} ☞ ^{KIT}	MS PS →01/92 01/92→ →01/92 01/92→	MVB835R4 MVB700R4 MVB960R4 TB226 TB419 TBK009 TBK010	4PK835 4PK700 4PK960 113x17 114x17
				66	10/88 → 08/92	☼ ⊖ ⊖ ☞ ☞ ☞ ^{KIT} ☞ ^{KIT}	MS PS →01/92 01/92→ →01/92 01/92→
	BDY (XU5M2Z), BDY (XU5M3Z), BDZ (XU5M)	65	10/88 → 08/92	☼ ⊖ ⊖ ☞ ☞ ☞ ^{KIT} ☞ ^{KIT}	MS PS →01/92 01/92→ →01/92 01/92→	MVB835R4 MVB700R4 MVB960R4 TB226 TB419 TBK009 TBK010	4PK835 4PK700 4PK960 113x17 114x17
				55	10/88 → 08/92	☼ ⊖ ⊖ ☞ ☞ ☞ ^{KIT} ☞ ^{KIT}	MS PS →01/92 01/92→ →01/92 01/92→
	BAZ (XU5CP)	55	10/88 → 08/92	☼ ⊖ ⊖ ☞ ☞ ☞ ^{KIT} ☞ ^{KIT}	MS PS →01/92 01/92→ →01/92 01/92→	MVB835R4 MVB700R4 MVB960R4 TB226 TB419 TBK009 TBK010	4PK835 4PK700 4PK960 113x17 114x17
				69	10/88 → 08/92	☼ ⊖ ⊖ ☞ ☞ ☞ ^{KIT} ☞ ^{KIT}	MS PS →01/92 01/92→ →01/92 01/92→





kW



...PEUGEOT

...405 I Break (15E)

1.6 SRi 4x4	BDZ (XU5M)	65	04/88 → 07/92	⚙️		MVB835R4	4PK835				
				⚙️	MS	MVB700R4	4PK700				
				⚙️	PS	MVB960R4	4PK960				
				🔌	→01/92	TB226	113x17				
				🔌	01/92→	TB419	114x17				
				🔌KIT	→01/92	TBK009					
1.8 TD	A8A (XUD7TE), AJZ (XUD7TEY) 66	66	10/88 → 08/92	⚙️	A/C(+), MAN	MVB970R5	5PK970				
				⚙️	Eng. XUD7TE, A/C(-), AUTO	MVB710R5	5PK710				
				⚙️	Eng. XUD7TE, A/C(-), MAN	MVB700R5	5PK700				
				⚙️	Eng. XUD7TE, A/C(-), MAN	MVB715R4	4PK715				
				⚙️	Eng. XUD7TE, A/C(+), AUTO	MVB1230R5	5PK1230				
				🔌		TB560	136x25.4				
1.9	D2C (XU92C (U-KAT))	70	10/88 → 08/92	⚙️	Eng. XUD7TE	TBK019					
				⚙️	Eng. XUD7TE	SVB10650	10x650				
				⚙️	Eng. XUD7TE	SVB10550	10x550				
				⚙️		MVB835R4	4PK835				
				⚙️	MS	MVB700R4	4PK700				
				⚙️	PS	MVB960R4	4PK960				
1.9	DKZ (XU9JAZ)	88	10/88 → 08/92	🔌	→01/92	TB226	113x17				
				🔌	01/92→	TB419	114x17				
				🔌KIT	→01/92	TBK009					
				🔌KIT	01/92→	TBK010					
				1.9	DFZ (XU9J1)	77	10/88 → 08/92	⚙️		MVB835R4	4PK835
								⚙️	MS	MVB700R4	4PK700
⚙️	PS	MVB960R4	4PK960								
🔌	→01/92	TB226	113x17								
🔌	01/92→	TB419	114x17								
🔌KIT	→01/92	TBK009									
1.9	DDZ (XU9M)	80	10/88 → 08/92	🔌KIT	01/92→	TBK010					
				⚙️		MVB835R4	4PK835				
				⚙️	MS	MVB700R4	4PK700				
				⚙️	PS	MVB960R4	4PK960				
				🔌	→01/92	TB226	113x17				
				🔌	01/92→	TB419	114x17				
1.9 4x4	DDZ (XU9M)	80	10/88 → 08/92	🔌KIT	→01/92	TBK009					
				🔌KIT	01/92→	TBK010					
				⚙️		MVB835R4	4PK835				
				⚙️	MS	MVB700R4	4PK700				
				⚙️	PS	MVB960R4	4PK960				
				🔌	→01/92	TB226	113x17				
1.9 4x4	DDZ (XU9M)	80	10/88 → 08/92	🔌	01/92→	TB419	114x17				
				🔌KIT	→01/92	TBK009					
				🔌KIT	01/92→	TBK010					
				⚙️		MVB835R4	4PK835				
				⚙️	MS	MVB700R4	4PK700				
				⚙️	PS	MVB960R4	4PK960				



kW



PEUGEOT

...PEUGEOT

...405 I Break (15E)

1.9 D	DJZ (XUD9Y)	47	10/88 → 08/92	⊗	A/C(-), AUTO	MVB710R5	5PK710			
				⊗	A/C(-), MAN	MVB700R4	4PK700			
				⊗	A/C(+), AUTO	MVB1230R5	5PK1230			
				⊗	A/C(+), MAN	MVB970R5	5PK970			
						TB560	136x25.4			
						TBK019				
						SVB10550	10x550			
						SVB10650	10x650			
				D9B (XUD9A), DJY (XUD9A)	51	10/88 → 08/92	⊗	A/C(-), AUTO	MVB710R5	5PK710
							⊗	A/C(-), MAN	MVB700R4	4PK700
⊗	A/C(+), AUTO	MVB1230R5	5PK1230							
⊗	A/C(+), MAN	MVB970R5	5PK970							
		TB560	136x25.4							
		TBK019								
		SVB10550	10x550							
		SVB10650	10x650							

405 II (4B)

1.4	KDX (TU3MC)	55	08/92 → 10/95	⊗		SVB10710	10x710				
						TB376	101x17				
						TBK004					
1.6	BDY (XU5M2Z), BDY (XU5M3Z), BDZ (XU5M), BFZ (XU5JP)	65	08/92 → 10/95		Eng. XU5JP, A/C(-), MS	MVB835R4	4PK835				
				⊗	Eng. XU5JP, A/C(-), PS	MVB698R6	6PK698				
				⊗	Eng. XU5JP, A/C(-), PS	MVB1065R6	6PK1065				
				⊗	Eng. XU5JP, A/C(+), MS	MVB1080R6	6PK1080				
				⊗	Eng. XU5JP, A/C(+), PS	MVB1100R6	6PK1100				
				⊗	MS	MVB1660R6	6PK1660				
				⊗	PS	MVB700R4	4PK700				
						MVB960R4	4PK960				
						TB419	114x17				
						TBK010					
1.8	LFZ (XU7JP)	74	08/92 → 10/95	⊗	A/C(-), MS	MVB698R6	6PK698				
				⊗	A/C(-), PS	MVB1065R6	6PK1065				
				⊗	A/C(-), PS	MVB1080R6	6PK1080				
				⊗	A/C(+), MS	MVB1100R6	6PK1100				
				⊗	A/C(+), PS	MVB1660R6	6PK1660				
						TB419	114x17				
						TBK010					
				1.9 D	DJZ (XUD9Y)	47	08/92 → 10/95	⊗	A/C(-), MS	MVB730R6	6PK730
								⊗	A/C(-), PS, → Ch. 70980931	MVB1130R6	6PK1130
								⊗	A/C(-), PS, Ch. 70980932→	MVB1150R6	6PK1150
⊗	A/C(+), MS	MVB1173R6	6PK1173								
⊗	A/C(+), PS	MVB1700R6	6PK1700								
		TB560	136x25.4								
		TBK019									
		TBK020									
		SVB10550	10x550								
DJY (XUD9A)	50	06/94 → 10/95	⊗					A/C(-), MS	MVB730R6	6PK730	
			⊗	A/C(-), PS, → Ch. 70980931	MVB1130R6	6PK1130					
			⊗	A/C(-), PS, Ch. 70980932→	MVB1150R6	6PK1150					
			⊗	A/C(+), MS	MVB1173R6	6PK1173					
			⊗	A/C(+), PS	MVB1700R6	6PK1700					
					TB560	136x25.4					
					TBK020						
			1.9 TD	DHY (XUD9TE)	66	08/92 → 10/95	⊗	A/C(-), MS	MVB730R6	6PK730	
							⊗	A/C(-), PS, → Ch. 70980931	MVB1130R6	6PK1130	
							⊗	A/C(-), PS, Ch. 70980932→	MVB1150R6	6PK1150	
⊗	A/C(+), MS	MVB1173R6					6PK1173				
⊗	A/C(+), PS	MVB1700R6					6PK1700				
		TB560					136x25.4				
		TBK019									
		TBK020									
		SVB10550					10x550				





kW



...PEUGEOT

...405 II (4B)

2.0	RFX (XU10J2)	89	08/92 → 10/95	⊗	A/C(-), MS	MVB698R6	6PK698
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(-), PS	MVB1080R6	6PK1080
				⊗	A/C(+), MS	MVB1100R6	6PK1100
				⊗	A/C(+), PS	MVB1660R6	6PK1660
						TB419	114x17
2.0 X4	RFX (XU10J2)	89	08/92 → 10/95		A/C(-), MS	MVB698R6	6PK698
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(-), PS	MVB1080R6	6PK1080
				⊗	A/C(+), MS	MVB1100R6	6PK1100
				⊗	A/C(+), PS	MVB1660R6	6PK1660
						TB419	114x17
2.0 16V	RFT (XU10J4)	110	06/94 → 10/95		A/C(-), MS	MVB698R6	6PK698
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(-), PS	MVB1080R6	6PK1080
				⊗	A/C(+), MS	MVB1100R6	6PK1100
				⊗	A/C(+), PS	MVB1660R6	6PK1660
						TB453	134x25.4
2.0 MI-16	RFY (XU10J4Z)	112	08/92 → 10/95	⊗	A/C(-), MS	MVB698R6	6PK698
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(-), PS	MVB1080R6	6PK1080
				⊗	A/C(+), MS	MVB1100R6	6PK1100
				⊗	A/C(+), PS	MVB1660R6	6PK1660
						TB453	134x25.4
2.0 T 16 X4	RGZ (XU10J4TE/Z)	144	08/92 → 10/95	⊗	A/C(-), MS	MVB698R6	6PK698
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(-), PS	MVB1080R6	6PK1080
				⊗	A/C(+), MS	MVB1100R6	6PK1100
				⊗	A/C(+), PS	MVB1660R6	6PK1660
						TB453	134x25.4

405 II Break (4E)

1.4	KDX (TU3MC)	55	08/92 → 10/96	⊗		SVB10710	10x710
						TB376	101x17
						TBK004	
1.6	BDY (XU5M2Z), BDY (XU5M3Z), BDZ (XU5M), BFZ (XU5JP)	65	08/92 → 10/96	⊗		MVB835R4	4PK835
				⊗	Eng. XU5JP, A/C(-), MS	MVB698R6	6PK698
				⊗	Eng. XU5JP, A/C(-), PS	MVB1065R6	6PK1065
				⊗	Eng. XU5JP, A/C(-), PS	MVB1080R6	6PK1080
				⊗	Eng. XU5JP, A/C(+), MS	MVB1100R6	6PK1100
				⊗	Eng. XU5JP, A/C(+), PS	MVB1660R6	6PK1660
				⊗	MS	MVB700R4	4PK700
				⊗	PS	MVB960R4	4PK960
1.8	LFZ (XU7JP)	74	08/92 → 10/96			TB419	114x17
						TBK010	
				⊗	A/C(-), MS	MVB698R6	6PK698
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(-), PS	MVB1080R6	6PK1080
				⊗	A/C(+), MS	MVB1100R6	6PK1100
1.8	LFZ (XU7JP)	74	08/92 → 10/96	⊗	A/C(+), PS	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
						TBK010	



kW



PEUGEOT

...PEUGEOT

...405 II Break (4E)

1.9 D	DJZ (XUD9Y)	47	08/92 → 10/96	⊗	A/C(-), MS	MVB730R6	6PK730				
				⊗	A/C(-), PS, → Ch. 70980931	MVB1130R6	6PK1130				
				⊗	A/C(-), PS, Ch. 70980932→	MVB1150R6	6PK1150				
				⊗	A/C(+), MS	MVB1173R6	6PK1173				
				⊗	A/C(+), PS	MVB1700R6	6PK1700				
						TB560	136x25.4				
					→12/93	TBK019					
					01/94→	TBK020					
					A/C(+), PS, →06/93	SVB10550	10x550				
				1.9 TD	DHY (XUD9TE)	66	08/92 → 10/96	⊗	A/C(-), MS	MVB730R6	6PK730
								⊗	A/C(-), PS, → Ch. 70980931	MVB1130R6	6PK1130
								⊗	A/C(-), PS, Ch. 70980932→	MVB1150R6	6PK1150
⊗	A/C(+), MS	MVB1173R6	6PK1173								
⊗	A/C(+), PS	MVB1700R6	6PK1700								
		TB560	136x25.4								
	→12/93	TBK019									
	01/94→	TBK020									
	A/C(+), PS, →06/93	SVB10550	10x550								
2.0	RFX (XU10J2)	89	08/92 → 10/96					⊗	A/C(-), MS	MVB698R6	6PK698
								⊗	A/C(-), PS	MVB1065R6	6PK1065
								⊗	A/C(-), PS	MVB1080R6	6PK1080
				⊗	A/C(+), MS	MVB1100R6	6PK1100				
				⊗	A/C(+), PS	MVB1660R6	6PK1660				
						TB419	114x17				
						TBK010					
				2.0 4x4	RFX (XU10J2)	89	08/92 → 10/96	⊗	A/C(-), MS	MVB698R6	6PK698
								⊗	A/C(-), PS	MVB1065R6	6PK1065
								⊗	A/C(-), PS	MVB1080R6	6PK1080
								⊗	A/C(+), MS	MVB1100R6	6PK1100
								⊗	A/C(+), PS	MVB1660R6	6PK1660
		TB419	114x17								
		TBK010									
144			08/92 → 12/95			⊗	A/C(-), MS	MVB698R6	6PK698		
						⊗	A/C(-), PS	MVB1065R6	6PK1065		
						⊗	A/C(-), PS	MVB1080R6	6PK1080		
						⊗	A/C(+), MS	MVB1100R6	6PK1100		
						⊗	A/C(+), PS	MVB1660R6	6PK1660		
						TB453	134x25.4				

406 (8B)

1.6	BFZ (XU5JP)	65	11/95 → 05/04	⊗	A/C(-), Alt. 70.8A, →12/99	MVB1065R6	6PK1065
				⊗	A/C(-), Alt. 90A, →12/99	MVB1080R6	6PK1080
				⊗	A/C(+), →12/99	MVB1660R6	6PK1660
					→12/99	TB419	114x17
					→12/99	TBK010	
				1.8	LFX (XU7JB)	66	05/97 → 05/04
⊗	A/C(-), Alt. 90A, →08/00	MVB1080R6	6PK1080				
⊗	A/C(+), →08/00	MVB1660R6	6PK1660				
	→08/00	TB419	114x17				
	→08/00	TBK010					



kW



...PEUGEOT

...406 (8B)

1.8 16V	LFY (XU7JP4)	81	11/95 → 10/00		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
					Auto Tensioner	TB479	136x25.4
					Auto Tensioner	TBK122	
6FZ (EW7J4)		85	10/00 → 05/04		A/C(-), →03/03	MVB1200R6	6PK1200
					A/C(+), →03/03	MVB1725R6	6PK1725
					→03/03	TB683	153x25.4
					→03/03	TBK279	
1.9 D	DHW (XUD9SD)	55	10/96 → 05/04		A/C(-), →03/99, Ch. 6994→	MVB1115R6	6PK1115
					A/C(+), →03/99, Ch. 6994→	MVB1740R6	6PK1740
					A/C(+), →03/99, Ch. 6994→	MVB1755R6	6PK1755
					→03/99	TB560	136x25.4
					→03/99	TBK020	
1.9 TD	DHX (XUD9TE)	66	01/96 → 05/04		A/C(-), →03/99, Ch. 6994→	MVB1115R6	6PK1115
					A/C(+), →03/99, Ch. 6994→	MVB1740R6	6PK1740
					A/C(+), →03/99, Ch. 6994→	MVB1755R6	6PK1755
					→03/99	TB560	136x25.4
					→03/99	TBK020	
1.9 TD	DHY (XUD9TE)	68	01/96 → 05/04		A/C(-), →03/99, Ch. 6994→	MVB1115R6	6PK1115
					A/C(+), →03/99, Ch. 6994→	MVB1740R6	6PK1740
					A/C(+), →03/99, Ch. 6994→	MVB1755R6	6PK1755
					→03/99	TB560	136x25.4
					→03/99	TBK020	
2.0 16V	RFV (XU10J4R)	97	11/95 → 05/04		A/C(-), 11/96→08/00	MVB1165R6	6PK1165
					A/C(+), 11/96→08/00	MVB1600R6	6PK1600
					09/97→08/00	TB479	136x25.4
					11/96→08/00	TBK113	
RFR (DEW10J4)		99	01/99 → 08/00		A/C(-)	MVB1200R6	6PK1200
					A/C(+)	MVB1725R6	6PK1725
						TB683	153x25.4
						TBK279	
RFN (EW10J4)		100	08/00 → 05/04		A/C(-), →03/03	MVB1200R6	6PK1200
					A/C(+), →03/03	MVB1725R6	6PK1725
					→03/03	TB683	153x25.4
					→03/03	TBK279	
2.0 16V HPI	RLZ (EW10D)	103	05/01 → 05/04		A/C(-), →03/03	MVB1200R6	6PK1200
					A/C(+), →03/03	MVB1725R6	6PK1725
					→03/03	TB702	143x25.4
2.0 HDI 110	RHZ (DW10ATED)	80	06/98 → 08/01		A/C(-)	MVB1469R6	6PK1469
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1755R6	6PK1755
					→10/00, → Ch. 8735	TB632	141x25.4
					10/00→, Ch. 8736→	TBK106	
						TBK274	
RHS (DW10ATED), RHZ (DW10ATED)		79	08/01 → 05/04		A/C(+), →03/03	MVB1755R6	6PK1755
					Eng. DW10ATED, A/C(-), →03/03	MVB1469R6	6PK1469
					Eng. DW10ATED, A/C(+), →03/03	MVB1740R6	6PK1740
					→03/03	TB632	141x25.4
					Eng. DW10ATED, →03/03, Ch. 8736→	TBK274	
2.0 HDI 90	RHY (DW10TD)	66	02/99 → 05/04		A/C(-), →10/02	MVB1469R6	6PK1469
					A/C(+), →10/02	MVB1740R6	6PK1740
					A/C(+), →10/02	MVB1755R6	6PK1755
					→10/02	TB632	141x25.4
					→10/00, → Ch. 8735	TBK106	
					10/00→10/02, Ch. 8736→	TBK274	
2.0 Turbo	RGX (XU10J2TE)	108	04/96 → 05/04		A/C(-), →03/99	MVB1165R6	6PK1165
					A/C(+), →03/99	MVB1600R6	6PK1600
					→03/99	TB419	114x17
					→03/99	TBK010	



kw



PEUGEOT

...PEUGEOT

...406 (8B)

2.1 TD 12V	P8C (XUD11BTE)	80	01/96 → 05/04		A/C(-), →03/99	MVB1115R6	6PK1115
					A/C(+), →03/99	MVB1740R6	6PK1740
					A/C(+), →03/99	MVB1755R6	6PK1755
					→03/99	TB320	149x25.4
					→03/99	TBK035	
2.2	3FZ (EW12J4)	116	07/00 → 05/04		A/C(-), →03/03	MVB1200R6	6PK1200
					A/C(+), →03/03	MVB1725R6	6PK1725
					→03/03	TB683	153x25.4
					→03/03	TBK279	
2.2 HDi	4HX (DW12TED4/FAP)	98	03/00 → 05/04		09/00→	MVB1740R6	6PK1740
					09/00→	MVB1755R6	6PK1755
					09/00→	TB678	146x25.4
					04/04→	TBK355	
					09/00→	TBK303	
3.0 24V	XFZ (ES9J4)	140	10/96 → 05/04		A/C(-), →12/99	MVB1488R6	6PK1488
					A/C(+), →12/99	MVB1600R6	6PK1600
					→12/99	TB727	259x32
3.0 V6	XFX (ES9J4S)	152	03/00 → 05/04			MVB1580R6	6PK1580
						TB727	259x32

406 Break (8E/F)

1.8	LFX (XU7JB)	66	05/97 → 10/04		A/C(-), Alt. 70, 8A, →08/00	MVB1065R6	6PK1065
					A/C(-), Alt. 90A, →08/00	MVB1080R6	6PK1080
					A/C(+), →08/00	MVB1660R6	6PK1660
					→08/00	TB419	114x17
					→08/00	TBK010	
1.8 16V	LFY (XU7JP4)	81	10/96 → 10/00		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
					Auto Tensioner	TB479	136x25.4
					Auto Tensioner	TBK122	
	6FZ (EW7J4)	85	10/00 → 10/04		A/C(-), →03/03	MVB1200R6	6PK1200
					A/C(+), →03/03	MVB1725R6	6PK1725
					→03/03	TB683	153x25.4
					→03/03	TBK279	
1.9 D	DHW (XUD9SD)	55	10/96 → 10/04		A/C(-), →03/99, Ch. 6994→	MVB1115R6	6PK1115
					A/C(+), →03/99, Ch. 6994→	MVB1740R6	6PK1740
					A/C(+), →03/99, Ch. 6994→	MVB1755R6	6PK1755
					→03/99	TB560	136x25.4
					→03/99	TBK020	
1.9 TD	DHX (XUD9TE)	66	10/96 → 10/04		A/C(-), →03/99, Ch. 6994→	MVB1115R6	6PK1115
					A/C(+), →03/99, Ch. 6994→	MVB1740R6	6PK1740
					A/C(+), →03/99, Ch. 6994→	MVB1755R6	6PK1755
					→03/99	TB560	136x25.4
					→03/99	TBK020	
2.0 16V	RFV (XU10J4R)	97	10/96 → 10/04		A/C(-), →08/00	MVB1165R6	6PK1165
					A/C(+), →08/00	MVB1600R6	6PK1600
					09/97→08/00	TB479	136x25.4
					→08/00	TBK113	
	RFR (DEW10J4)	99	01/99 → 10/00		A/C(-)	MVB1200R6	6PK1200
					A/C(+)	MVB1725R6	6PK1725
						TB683	153x25.4
						TBK279	
	RFN (EW10J4)	100	10/00 → 10/04		A/C(-), →03/03	MVB1200R6	6PK1200
					A/C(+), →03/03	MVB1725R6	6PK1725
					→03/03	TB683	153x25.4
					→03/03	TBK279	
2.0 16V HPi	RLZ (EW10D)	103	05/01 → 10/04		A/C(-), →03/03	MVB1200R6	6PK1200
					A/C(+), →03/03	MVB1725R6	6PK1725
					→03/03	TB702	143x25.4



kW



...PEUGEOT

...406 Break (8E/F)

2.0 HDI 110	RHZ (DW10ATED)	80	02/99 → 04/04		A/C(-), →03/03	MVB1469R6	6PK1469
					A/C(+), →03/03	MVB1740R6	6PK1740
					A/C(+), →03/03	MVB1755R6	6PK1755
					→03/03	TB632	141x25.4
					→10/00, → Ch. 8735	TBK106	
					10/00 →03/03, Ch. 8736 →	TBK274	
					A/C(+), →03/03	MVB1755R6	6PK1755
					Eng. DW10ATED, A/C(-), →03/03	MVB1469R6	6PK1469
2.0 HDI 90	RHY (DW10TD)	66	02/99 → 10/04		Eng. DW10ATED, A/C(+), →03/03	MVB1740R6	6PK1740
					→03/03	TB632	141x25.4
					Eng. DW10ATED, →03/03, Ch. 8736 →	TBK274	
					A/C(-), →10/02	MVB1469R6	6PK1469
2.0 Turbo	RGX (XU10J2TE)	108	10/96 → 10/04		A/C(+), →10/02	MVB1740R6	6PK1740
					A/C(+), →10/02	MVB1755R6	6PK1755
					→10/02	TB632	141x25.4
					→10/00, → Ch. 8735	TBK106	
2.1 TD 12V	P8C (XUD11BTE)	80	10/96 → 10/04		10/00 →10/02, Ch. 8736 →	TBK274	
					A/C(-), →03/99	MVB1165R6	6PK1165
					A/C(+), →03/99	MVB1600R6	6PK1600
					→03/99	TB419	114x17
2.2	3FZ (EW12J4)	116	07/00 → 10/04		→03/99	TBK010	
					A/C(-), →03/99	MVB1115R6	6PK1115
					A/C(+), →03/99	MVB1740R6	6PK1740
					A/C(+), →03/99	MVB1755R6	6PK1755
2.2 HDI	4HX (DW12TED4/FAP)	98	03/00 → 10/04		→03/99	TB320	149x25.4
					→03/99	TBK035	
					A/C(-), →03/03	MVB1200R6	6PK1200
					A/C(+), →03/03	MVB1725R6	6PK1725
3.0 24V	XFZ (ES9J4)	140	10/96 → 10/04		→03/03	TB683	153x25.4
					→03/03	TBK279	
					09/00 →	MVB1740R6	6PK1740
					09/00 →	MVB1755R6	6PK1755
3.0 V6	XFX (ES9J4S)	152	03/00 → 10/04		09/00 →	TB678	146x25.4
					04/04 →	TBK355	
					09/00 →04/04	TBK303	
					A/C(-), →12/99	MVB1488R6	6PK1488
2.2	3FZ (EW12J4)	116	03/02 → 12/04		A/C(+), →12/99	MVB1600R6	6PK1600
					→12/99	TB727	259x32
					→12/99	MVB1580R6	6PK1580
					→12/99	TB727	259x32

406 Coupe (8C)

2.0 16V	RFV (XU10J4R)	97	03/97 → 12/04		A/C(-), →12/99	MVB1165R6	6PK1165
					A/C(+), →12/99	MVB1600R6	6PK1600
					→12/99	TB479	136x25.4
					→12/99	TBK113	
2.2	RFR (DEW10J4)	99	01/99 → 10/00		A/C(-)	MVB1200R6	6PK1200
					A/C(+)	MVB1725R6	6PK1725
						TB683	153x25.4
						TBK279	
2.2	3FZ (EW12J4)	116	03/02 → 12/04		A/C(-)	MVB1200R6	6PK1200
					A/C(+)	MVB1725R6	6PK1725
						TB683	153x25.4
						TBK279	
2.2 HDI	4HX (DW12TED4/FAP)	98	03/00 → 12/04		A/C(-)	MVB1740R6	6PK1740
					A/C(+)	MVB1755R6	6PK1755
						TB678	146x25.4
						TBK303	



kW



PEUGEOT

...PEUGEOT

...406 Coupe (8C)

3.0 V6	XFX (ES9J4S)	152	03/00 → 12/04			MVB1580R6	6PK1580
						TB727	259x32
3.0 V6 24V	XFZ (ES9J4)	140	03/97 → 12/04		A/C(-), →08/00	MVB1488R6	6PK1488
					A/C(+), →08/00	MVB1600R6	6PK1600
					→08/00	TB727	259x32

407 (6D_)

1.6 HDi 110	9HY (DV6TED4)	80	05/04 →			MVB1708R6	6PK1708
						TB724	137x25.4
						TBK302	
1.8	6FZ (EW7J4)	85	05/04 →		→07/05	MVB1708R6	6PK1708
					→07/05	TB683	153x25.4
					→07/05	TBK279	
1.8 16V	6FY (EW7A)	92	09/05 →			MVB1000R6	6PK1000
						TB744	153x25
2.0	RFN (EW10J4)	100	05/04 →		→11/04, → Ch. 10247	MVB1708R6	6PK1708
					11/04→07/05, Ch. 10248→	MVB1000R6	6PK1000
					→07/05	TB683	153x25.4
					→07/05	TBK279	
2.0 16V	RFJ (EW10A)	103	09/05 →			MVB1000R6	6PK1000
						TB744	153x25
2.0 HDi		103	08/08 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.0 HDi 135	RHR (DW10BTED4)	100	05/04 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.2	3FZ (EW12J4)	116	05/04 →		→11/04	MVB1708R6	6PK1708
					12/04→07/05	MVB1000R6	6PK1000
					→07/05	TB683	153x25.4
					→07/05	TBK279	
2.2 16V	3FY (EW12J4)	120	09/05 →			MVB1000R6	6PK1000
						TB683	153x25.4
						TBK279	
2.2 HDi 170	4HT (DW12BTED4)	125	05/06 →			MVB1200R6	6PK1200
						TB810	118x25.4
2.7 HDi	UHZ (DT17)	150	10/05 →			MVB1885R6	6PK1885
						TB814	195x29
						TB815	85x20
3.0	XFV (ES9A)	155	05/04 →			MVB1588R6	6PK1588
						TB727	259x32

407 Coupe (6C_)

2.0 HDi	RHR (DW10BTED4)	100	10/05 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.2 16V	3FY (EW12J4)	120	10/05 →			MVB1000R6	6PK1000
						TB683	153x25.4
						TBK279	
2.7 HDi	UHZ (DT17)	150	10/05 →			MVB1885R6	6PK1885
						TB814	195x29
						TB815	85x20
3.0 V6	XFV (ES9A)	155	10/05 →			MVB1588R6	6PK1588
						TB727	259x32

407 SW (6E_)

1.6 HDi 110	9HY (DV6TED4)	80	05/04 →			MVB1708R6	6PK1708
						TB724	137x25.4
						TBK302	
1.8	6FZ (EW7J4)	85	05/04 →		→07/05	MVB1708R6	6PK1708
					→07/05	TB683	153x25.4
					→07/05	TBK279	
1.8 16V	6FY (EW7A)	92	09/05 →			MVB1000R6	6PK1000
						TB744	153x25





kW



...PEUGEOT

...407 SW (6E_)

2.0	RFN (EW10J4)	100	05/04 →		→11/04, → Ch. 10247	MVB1708R6	6PK1708
					11/04→07/05, Ch. 10248→	MVB1000R6	6PK1000
					→07/05	TB683	153x25.4
					→07/05	TBK279	
2.0 16V	RFJ (EW10A)	103	09/05 →			MVB1000R6	6PK1000
						TB744	153x25
2.0 HDi		103	08/08 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.0 HDi 135	RHR (DW10BTE4)	100	05/04 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.2	3FZ (EW12J4)	116	05/04 →		→11/04	MVB1708R6	6PK1708
					12/04→07/05	MVB1000R6	6PK1000
					→07/05	TB683	153x25.4
					→07/05	TBK279	
2.2 16V	3FY (EW12J4)	120	09/05 →			MVB1000R6	6PK1000
						TB683	153x25.4
						TBK279	
2.2 HDi 170	4HT (DW12BTE4)	125	05/06 →			MVB1200R6	6PK1200
						TB810	118x25.4
2.7 HDi	UHZ (DT17)	150	10/05 →			MVB1885R6	6PK1885
						TB814	195x29
						TB815	85x20
3.0	XFV (ES9A)	155	05/04 →			MVB1588R6	6PK1588
						TB727	259x32

504 (A_, M_)

1.8 (A01, A03)	XM	60	07/68 → 02/71			SVB101175	10x1175
					RHA(+)	SVB10800	10x800
1.8 (M03)	XM7	58	01/71 → 06/83			SVB101175	10x1175
					RHA(+)	SVB10800	10x800
1.8 Injection (A02)	KF5, KF6	71	07/68 → 02/71			SVB101175	10x1175
					RHA(+)	SVB10800	10x800
1.9 D (M20)	XD4x88	40	03/73 → 07/86		Left	SVB10725	10x725
					Right	SVB10875	10x875
					MS	SVB101140	10x1140
					PS	SVB101125	10x1125
					RHA(+)	SVB101050	10x1050
						SVB10600	10x600
					→ Ch. 2.144.799	SVB10650	10x650
					Ch. 2.144.800→	SVB10665	10x665
2.0 (A1, A13, MY1, MY3)	106 (XN1)	71	03/71 → 06/86			SVB101175	10x1175
					RHA(+)	SVB10800	10x800
2.0 TI (A12, A14)	107 (XN2)	78	01/71 → 06/83			SVB101175	10x1175
					A/C(-), MS, →08/79	SVB10700	10x700
					A/C(+), PS, →08/79	SVB101000	10x1000
					A/C(-), MS, →08/79	SVB10888	10x888
					→08/79	SVB10900	10x900
					RHA(+)	SVB10800	10x800
2.1 D (A20, M20)	XD4x90	48	02/71 → 07/86		Left, →08/82	SVB10725	10x725
					Right, →08/82	SVB10875	10x875
					→12/72	SVB101175	10x1175
					MS, 01/73→08/82	SVB101140	10x1140
					PS, 01/73→08/82	SVB101125	10x1125
					RHA(+), →08/82	SVB101050	10x1050
					→08/82	SVB10600	10x600
					→08/82, → Ch. 2.144.799	SVB10650	10x650
					→08/82, Ch. 2.144.800→	SVB10665	10x665



kw



PEUGEOT

...PEUGEOT

...504 (A_, M_)

2.3 D (A40, A45)	134 (XD2)	51	07/75 → 12/83	⊗	Left	SVB10725	10x725
				⊗	Right	SVB10875	10x875
				*	MS	SVB101140	10x1140
				*	PS	SVB101125	10x1125
				⊗	RHA(+)	SVB101050	10x1050
				⊗		SVB10600	10x600
				⊗	→ Ch. 2.144.799	SVB10650	10x650
				⊗	Ch. 2.144.800→	SVB10665	10x665

504 Break (D_, F_)

1.8 (F01, E01)	XM7	54	04/71 → 07/86	⊗		SVB101175	10x1175
				⊗	RHA(+)	SVB10800	10x800
2.0 (D11, F11)	XN1	68	04/71 → 07/86	⊗		SVB101175	10x1175
				⊗	RHA(+)	SVB10800	10x800
2.1 D (E20, F20)	XD4x90	48	04/71 → 07/86	⊗	Left, →08/82	SVB10725	10x725
				⊗	Right, →08/82	SVB10875	10x875
				*	→12/72	SVB101175	10x1175
				*	MS, 01/73→08/82	SVB101140	10x1140
				*	PS, 01/73→08/82	SVB101125	10x1125
				⊗	RHA(+), →08/82	SVB101050	10x1050
				⊗	→08/82	SVB10600	10x600
				⊗	→08/82, → Ch. 2.144.799	SVB10650	10x650
				⊗	→08/82, Ch. 2.144.800→	SVB10665	10x665
2.3 D (D40, F40)	134 (XD2)	51	07/75 → 07/86	⊗	Left	SVB10725	10x725
				⊗	Right	SVB10875	10x875
				*	MS	SVB101140	10x1140
				*	PS	SVB101125	10x1125
				⊗	RHA(+)	SVB101050	10x1050
				⊗		SVB10600	10x600
				⊗	→ Ch. 2.144.799	SVB10650	10x650
				⊗	Ch. 2.144.800→	SVB10665	10x665

504 Convertible

2.0		75	10/74 → 08/82	⊗	A/C(-), MS	SVB10700	10x700
				⊗	A/C(+), PS	SVB101000	10x1000
				*	A/C(-), MS	SVB10888	10x888
				⊗		SVB10900	10x900
	107 (XN2)	78	08/82 → 08/84	⊗	A/C(-), MS	SVB10700	10x700
				⊗	A/C(+), PS	SVB101000	10x1000
				*	A/C(-), MS	SVB10888	10x888
				⊗		SVB10900	10x900

504 Coupe

2.0		75	10/74 → 08/82	⊗	A/C(-), MS	SVB10700	10x700
				⊗	A/C(+), PS	SVB101000	10x1000
				*	A/C(-), MS	SVB10888	10x888
				⊗		SVB10900	10x900
	107 (XN2)	78	08/82 → 08/84	⊗	A/C(-), MS	SVB10700	10x700
				⊗	A/C(+), PS	SVB101000	10x1000
				*	A/C(-), MS	SVB10888	10x888
				⊗		SVB10900	10x900
2.7	140 (ZMJ)	106	10/77 → 08/84	⊗	→08/82	SVB101100	10x1100
				⊗	→08/82	SVB10913	10x913

504 Pickup (E_)

1.8	XM7	53	07/87 → 12/89	⊗		SVB101175	10x1175
				⊗	RHA(+)	SVB10800	10x800



kW



...PEUGEOT

...504 Pickup (E_)

2.3 D	134 (XD2)	51	01/80 → 12/89	⊗	Left, 09/82→	SVB10725	10x725
				⊗	Right, 09/82→	SVB10875	10x875
				*	MS, 09/82→	SVB101140	10x1140
				*	PS, 09/82→	SVB101125	10x1125
				⊕	RHA(+), 09/82→	SVB101050	10x1050
				⊕	09/82→	SVB10600	10x600
				⊕	09/82→, → Ch. 2.144.799	SVB10650	10x650
				⊕	09/82→, Ch. 2.144.800→	SVB10665	10x665

505 (551A)

1.8	105 (XM7)	55	06/81 → 10/85	⊗		SVB101175	10x1175		
				⊕		SVB10800	10x800		
			60	01/82 → 10/85	⊗		SVB101175	10x1175	
					⊕		SVB10800	10x800	
2.0	106 (XN1)	62	09/85 → 10/86	⊗		SVB101175	10x1175		
						⊕		SVB10800	10x800
	106E (XN1A)	71	11/80 → 12/85	⊗		SVB101175	10x1175		
						⊕		SVB10800	10x800
2.0	106E (XN1A)	72	09/85 → 09/91	⊗		SVB101175	10x1175		
						⊕		SVB10800	10x800
	79	09/80 → 11/82	⊗		SVB101175	10x1175			
				⊕		SVB10800	10x800		
2.0 TI,STI	829 (ZEJ)	81	08/79 → 10/86	⊗		SVB101000	10x1000		
				⊕		SVB10790	10x790		
					→ Eng Nr 53472	TB114	116x19		
					Eng Nr 53473→	TB421	116x19		
					→ Eng Nr 53472	TBK015			
					Eng Nr 53473→	TBK281			
2.2	851X (ZDJL)	84	03/86 → 12/93	⊗		SVB101000	10x1000		
				⊕		SVB10813	10x813		
					→08/91	TB126	118x19		
					→08/91, → Eng Nr 32027	TB422	118x19		
					→08/91, Eng Nr 30139→	TBK282			
					→08/91, Eng Nr 32028→	SVB10790	10x790		
	851 (ZDJ)	85	05/81 → 10/84	⊗		SVB101000	10x1000		
						⊕		SVB10813	10x813
					→ Eng Nr 32027	TB126	118x19		
					Eng Nr 30139→	TB422	118x19		
					Eng Nr 32028→	TBK282			
						SVB10790	10x790		
2.2 GTI	851B (ZDJL)	90	08/83 → 12/93	⊗		SVB101000	10x1000		
						⊕		SVB10813	10x813
					→08/91	TB126	118x19		
					→08/91, → Eng Nr 32027	TB422	118x19		
					→08/91, Eng Nr 30139→	TBK282			
					→08/91, Eng Nr 32028→	SVB10790	10x790		
	96	08/83 → 12/93	⊗		SVB101000	10x1000			
						⊕		SVB10813	10x813
					→08/91	TB126	118x19		
					→08/91, → Eng Nr 32027	TB422	118x19		
					→08/91, Eng Nr 32028→	TBK282			
					→08/91, Eng Nr 30139→	SVB10790	10x790		
2.2 Turbo Injection	176B (N9TE)	114	03/84 → 10/88	⊗	ABS(-)	SVB10940	10x940		
					ABS(+)	SVB10925	10x925		
						SVB10850	10x850		
	176X (N9TE)	110	01/86 → 12/87	⊗	ABS(-)	SVB10940	10x940		
					ABS(+)	SVB10925	10x925		
						SVB10850	10x850		
	176W (N9TEA)	128	06/87 → 12/88	⊗	ABS(-)	SVB10940	10x940		
					ABS(+)	SVB10925	10x925		
						SVB10850	10x850		



kw



PEUGEOT

...PEUGEOT

...505 (551A)

2.3 Turbo Diesel	147 (XD2S)	59	09/80 → 06/86	⊗	09/81 → 08/85	SVB10725	10x725				
				⊗	09/81 → 08/85	SVB10750	10x750				
				*	09/81 → 08/85	SVB101125	10x1125				
				⊗	09/81 → 08/85	SVB101050	10x1050				
				⊗	09/81 → 05/84	SVB10650	10x650				
2.5 Diesel	155 (XD3)	55	06/81 → 12/93	⊗	06/82 → 08/91	SVB131000	13x1000				
				⊗	06/82 → 08/91	SVB10875	10x875				
				⊗	LHD, 06/82 → 08/91	SVB10725	10x725				
				*	A/C(-), MS, 06/82 → 08/91	SVB101140	10x1140				
				*	A/C(+), PS, 06/82 → 08/91	SVB101125	10x1125				
				⊗	06/82 → 08/91	SVB101050	10x1050				
				⊗	05/84 → 08/91	SVB10600	10x600				
				⊗	06/82 → 05/84	SVB10665	10x665				
				51	10/81 → 11/90	51	10/81 → 11/90	⊗	06/82 →	SVB131000	13x1000
								⊗	LHD, 06/82 →	SVB10725	10x725
								⊗	RHA(+), 06/82 →	SVB10875	10x875
								*	A/C(-), MS, 06/82 →	SVB101140	10x1140
								*	A/C(+), PS, 06/82 →	SVB101125	10x1125
								⊗	06/82 →	SVB101050	10x1050
								⊗	05/84 →	SVB10600	10x600
⊗	06/82 → 05/84	SVB10665	10x665								
2.5 Turbo Diesel	152A (XD3T)	66	10/83 → 12/93	⊗	→ 08/91	SVB131000	13x1000				
				⊗	→ 08/91	SVB10740	10x740				
				⊗	→ 08/91	SVB10750	10x750				
				*	→ 08/91	SVB101125	10x1125				
				⊗	→ 08/91	SVB101025	10x1025				
				⊗	→ 08/91	SVB101050	10x1050				
				⊗	→ 05/84	SVB10650	10x650				
				⊗	05/84 → 08/91	SVB10610	10x610				
				152B (XD3TE)	77	10/86 → 12/93	10/86 → 12/93	⊗	→ 08/91	SVB131000	13x1000
								⊗	→ 08/91	SVB10740	10x740
								⊗	→ 08/91	SVB10750	10x750
								*	→ 08/91	SVB101125	10x1125
								⊗	→ 08/91	SVB101025	10x1025
								⊗	→ 08/91	SVB101050	10x1050
				70	10/83 → 12/90	70	10/83 → 12/90	⊗	10/85 →	SVB131000	13x1000
⊗	10/85 →	SVB10725	10x725								
⊗	10/85 →	SVB10750	10x750								
⊗	10/85 →	SVB101025	10x1025								
⊗	10/85 →	SVB101050	10x1050								
⊗	10/85 →	SVB10610	10x610								
2.8 GTI V6	154X (ZN3J)	105	06/86 → 12/93	⊗	→ 08/90	SVB131375	13x1375				
				⊗	→ 08/90	SVB101050	10x1050				
				⊗	→ 08/90	SVB10900	10x900				

505 Break (551D)

2.0	106 (XN1)	69	08/83 → 12/85	⊗		SVB101175	10x1175
				⊗		SVB10800	10x800
	106E (XN1A)	72	09/85 → 11/87	⊗		SVB101175	10x1175
				⊗		SVB10800	10x800
2.2	851X (ZDJL)	84	01/86 → 12/93	⊗		SVB101175	10x1175
				⊗		SVB10800	10x800
				⊗	→ 08/91	SVB101000	10x1000
				⊗	→ 08/91, → Eng Nr 30138	TB126	118x19
				⊗	→ 08/91, Eng Nr 30139 →	TB422	118x19
				⊗	→ 08/91, Eng Nr 32028 →	TBK282	
⊗	→ 08/91	SVB10790	10x790				
⊗	→ 08/91	SVB10813	10x813				



kW



...PEUGEOT

...505 Break (551D)

2.2 GTI	851B (ZDJL)	90	09/85 → 12/86	⊗		SVB101000	10x1000	
				⊗	→ Eng Nr 30138	TB126	118x19	
				⊗	Eng Nr 32028→	TB422	118x19	
				⊗KIT	Eng Nr 30139→	TBK282		
				⊗		SVB10790	10x790	
				⊗		SVB10813	10x813	
2.3 Diesel	147 (XD2S)	59	04/82 → 06/86	⊗	→08/85	SVB10725	10x725	
				⊗	→08/85	SVB10750	10x750	
				*	→08/85	SVB101125	10x1125	
				⊗	→08/85	SVB101050	10x1050	
				⊗	→05/84	SVB10650	10x650	
2.5 Diesel	155 (XD3)	51	01/86 → 12/93	⊗	→08/91	SVB131000	13x1000	
				⊗	→08/91	SVB10875	10x875	
				⊗	LHD, →08/91	SVB10725	10x725	
				*	A/C(-), MS, →08/91	SVB101140	10x1140	
				*	A/C(+), PS, →08/91	SVB101125	10x1125	
				⊗	→08/91	SVB101050	10x1050	
		55	08/83 → 12/93	⊗	→08/91	SVB10600	10x600	
	⊗			→08/91	SVB131000	13x1000		
	⊗			LHD, →08/91	SVB10725	10x725		
	⊗			RHA(+), →08/91	SVB10875	10x875		
	*			A/C(-), MS, →08/91	SVB101140	10x1140		
	*			A/C(+), PS, →08/91	SVB101125	10x1125		
			⊗	→08/91	SVB101050	10x1050		
			⊗	→05/84	SVB10665	10x665		
			⊗	05/84→08/91	SVB10600	10x600		
2.5 Turbo Diesel	152A (XD3T)	66	10/85 → 11/87	⊗		SVB131000	13x1000	
				⊗		SVB10740	10x740	
				⊗		SVB10750	10x750	
				*		SVB101125	10x1125	
				⊗		SVB101025	10x1025	
		152B (XD3TE)	77	10/86 → 12/93	⊗	→08/91	SVB101050	10x1050
	⊗				→08/91	SVB10610	10x610	
	⊗				→08/91	SVB131000	13x1000	
	⊗				→08/91	SVB10740	10x740	
	⊗				→08/91	SVB10750	10x750	
				*	→08/91	SVB101125	10x1125	
				⊗	→08/91	SVB101025	10x1025	
				⊗	→08/91	SVB101050	10x1050	
				⊗	→08/91	SVB10610	10x610	
604 (561A_)								
2.3 TD	147 (XD2S)	59	09/79 → 05/83	⊗		SVB131000	13x1000	
				⊗		SVB10750	10x750	
				*		SVB101125	10x1125	
				⊗	A/C(-)	SVB101050	10x1050	
				⊗		SVB10650	10x650	
2.5 TD	152A (XD3T)	66	08/83 → 12/86	⊗		SVB131000	13x1000	
				⊗		SVB10750	10x750	
				*		SVB101125	10x1125	
				⊗		SVB101050	10x1050	
				⊗	→05/84	SVB10650	10x650	
2.7 SL	112 (ZM)	100	08/77 → 05/83	⊗	MS	SVB10913	10x913	
				⊗		SVB131350	13x1350	
				⊗		SVB131375	13x1375	
				⊗		SVB101100	10x1100	
2.7 TI,STI	140 (ZMJ)	106	08/77 → 05/83	⊗	MS	SVB10913	10x913	
				⊗		SVB131350	13x1350	
				⊗		SVB131375	13x1375	
				⊗		SVB101100	10x1100	



kw



PEUGEOT

...PEUGEOT

...604 (561A_)

2.8 GTI	154A (ZMJK)	110	09/83 → 07/87	⊗	MS, →02/87	SVB10913	10x913
				⊗	→02/87	SVB131350	13x1350
				⊗	→02/87	SVB131375	13x1375
				⊗	→02/87	SVB101100	10x1100

605 (6B)

2.0	RFZ (XU10J2Z)	89	06/89 → 09/99	⊗	A/C(-), Alt. 60A, →06/94	MVB700R5	5PK700	
				⊗	A/C(-), Alt. 80,9A, →06/94	MVB710R5	5PK710	
				⊗	A/C(+), Alt. 60A, →06/94	MVB1120R5	5PK1120	
				⊗	A/C(+), Alt. 80,9A, →06/94	MVB1141R5	5PK1141	
				⊗	→06/94	TB419	114x17	
					⊗	01/93→06/94	TBK010	
					⊗	→06/94	SVB101000	10x1000
		R5A (XU102C)	84	06/89 → 09/99	⊗	A/C(-), Alt. 60A, →06/94	MVB700R5	5PK700
	⊗				A/C(-), Alt. 80,9A, →06/94	MVB710R5	5PK710	
	⊗				A/C(+), Alt. 60A, →06/94	MVB1120R5	5PK1120	
⊗	A/C(+), Alt. 80,9A, →06/94				MVB1141R5	5PK1141		
⊗	→06/94				TB419	114x17		
				⊗	01/93→06/94	TBK010		
				⊗	→06/94	SVB101000	10x1000	
		79	02/90 → 09/99	⊗	A/C(-), Alt. 60A, →06/94	MVB700R5	5PK700	
				⊗	A/C(-), Alt. 80,9A, →06/94	MVB710R5	5PK710	
				⊗	A/C(+), Alt. 60A, →06/94	MVB1120R5	5PK1120	
				⊗	A/C(+), Alt. 80,9A, →06/94	MVB1141R5	5PK1141	
				⊗	→06/94	TB419	114x17	
				⊗	01/93→06/94	TBK010		
				⊗	→06/94	SVB101000	10x1000	
2.0 16V	RFV (XU10J4R)	97	07/94 → 09/99	⊗	A/C(-), →05/95	MVB1080R6	6PK1080	
				⊗	A/C(-), 06/95→	MVB1165R6	6PK1165	
				⊗	A/C(+), →05/95	MVB1660R6	6PK1660	
				⊗	A/C(+), 06/95→	MVB1600R6	6PK1600	
				⊗	→06/94	TB479	136x25.4	
				⊗		TBK113		
2.0 Turbo	RGY (XU10J2TE)	104	07/92 → 09/99	⊗	A/C(-), →05/95	MVB710R5	5PK710	
				⊗	A/C(-), 06/95→	MVB1165R6	6PK1165	
				⊗	A/C(+), →05/95	MVB1155R5	5PK1155	
				⊗	A/C(+), 06/95→	MVB1600R6	6PK1600	
				⊗	→06/94	TB419	114x17	
					⊗		TBK010	
					⊗		MVB1025R4	4PK1025
		RGX (XU10J2TE)	108	07/91 → 09/99	⊗	A/C(-), 06/95→	MVB1165R6	6PK1165
	⊗				A/C(-), 07/92→05/95	MVB710R5	5PK710	
	⊗				A/C(+), 06/95→	MVB1600R6	6PK1600	
⊗	A/C(+), 07/92→05/95				MVB1155R5	5PK1155		
⊗	07/92→				TB419	114x17		
				⊗	07/92→	TBK010		
				⊗	07/92→	MVB1025R4	4PK1025	
2.1 D	P9A (XUD11A)	60	06/89 → 07/95	⊗	A/C(-), AUTO, 08/90→06/94	MVB768R5	5PK768	
				⊗	A/C(-), MAN, 08/90→06/94	MVB710R5	5PK710	
				⊗	A/C(-), MAN, 08/90→06/94	MVB735R5	5PK735	
				⊗	A/C(+),	MVB1165R5	5PK1165	
					AUTO, Pulley Diam : 59,4,			
					08/90→06/94			
					A/C(+),	MVB1188R5	5PK1188	
					AUTO, Pulley Diam : 66,			
					08/90→06/94			
				⊗	08/90→06/94	TB319	144x25.4	
				⊗	08/90→06/94	TBK013		
				⊗	08/90→06/94	MVB1025R4	4PK1025	



kW



...PEUGEOT

...605 (6B)

2.1 TD 12V	P8C (XUD11BTE)	80	08/94 → 09/99	⊗	A/C(-), →06/95	MVB768R5	5PK768
				⊗	A/C(-), 06/95→	MVB1115R6	6PK1115
				⊗	A/C(+), →06/95	MVB1188R5	5PK1188
				⊗	A/C(+), 06/95→	MVB1725R6	6PK1725
						TB320	149x25.4
2.1 Turbo Diesel	PHZ (XUD11ATE)	80	06/89 → 09/99			TBK035	
				⊗	→06/95	MVB1025R4	4PK1025
				⊗	A/C(-), AUTO, →12/97	MVB768R5	5PK768
				⊗	A/C(-), MAN, →12/97	MVB710R5	5PK710
				⊗	A/C(-), MAN, →12/97	MVB735R5	5PK735
2.5 Turbo Diesel	THY (DK5ATE)	95	07/94 → 09/99	⊗	A/C(+),	MVB1165R5	5PK1165
				⊗	AUTO, Pulley Diam : 59,4,		
				⊗	→12/97		
				⊗	A/C(+),	MVB1188R5	5PK1188
				⊗	AUTO, Pulley Diam : 66,		
3.0	UFZ (ZPJ)	123	10/89 → 09/99	⊗	→12/97	TB320	149x25.4
						TBK035	
						MVB1025R4	4PK1025
				⊗	→12/97		
				⊗	→12/97		
3.0 SV 24	UKZ (ZPJ4/Z)	147	08/89 → 09/99	⊗	A/C(-)	MVB1190R6	6PK1190
				⊗	A/C(-)	MVB1200R6	6PK1200
				⊗	A/C(+)	MVB1865R6	6PK1865
						TB459	141x28
						TBK029	
3.0 V6	ES 9 J4	140	04/97 → 09/99	⊗	→05/96	MVB950R4	4PK950
				⊗	06/96→	MVB940R3	3PK940
				⊗	→08/97	MVB640R4	4PK640
				⊗	A/C(-), →08/97	MVB850R5	5PK850
				⊗	A/C(+), →08/97	MVB1388R5	5PK1388
3.0 SV 24	UKZ (ZPJ4/Z)	147	08/89 → 09/99	⊗	→06/97	MVB640R4	4PK640
				⊗	A/C(-), →06/97	MVB850R5	5PK850
				⊗	A/C(+), →06/97	MVB1450R5	5PK1450
						MVB1600R6	6PK1600
						TB727	259x32

607 (9D, 9U)

2.0	RFN (EW10J4)	100	02/00 →	⊗	→08/05	MVB1708R6	6PK1708
					→08/05	TB683	153x25.4
					→08/05	TBK279	
2.0 HDI	RHZ (DW10ATED)	80	05/00 →	⊗	→07/04	MVB1740R6	6PK1740
				⊗	08/04→08/05	MVB1740R6	6PK1740
					→08/05	TB632	141x25.4
	RHR (DW10BTED4)	100	09/05 →	⊗	→08/05	TBK274	
						MVB1215R6	6PK1215
RHS (DW10ATED)	79	03/01 → 07/04	⊗		TB742	116x25	
					TBK338		
2.2 16V	3FZ (EW12J4)	116	02/00 →	⊗	A/C(+), →08/05	MVB1708R6	6PK1708
					→08/05	TB683	153x25.4
					→08/05	TBK279	
		120	09/05 →	⊗		MVB1000R6	6PK1000
						TB683	153x25.4
2.2 HDI	4HX (DW12TED4/FAP)	98	02/00 →	⊗		TBK279	
				⊗	AUTO, →12/04	MVB1740R6	6PK1740
				⊗	AUTO, 11/04→02/06	MVB1740R6	6PK1740
		→02/06	TB678	146x25.4			
		→07/04	TBK303				
4HT (DW12BTED4)	125	05/06 →	⊗	04/04→02/06	TBK355		
					MVB1200R6	6PK1200	
					TB810	118x25.4	



kw



PEUGEOT

...PEUGEOT

...607 (9D, 9U)

2.7 HDi 24V	DT17TED4	150	12/04 →	 		MVB1885R6 TB814 TB815	6PK1885 195x29 85x20
3.0 V6 24V	XFX (ES9J4S)	152	02/00 →	 	A/C(+), →07/04 →07/04	MVB1580R6 TB727	6PK1580 259x32
	XFV (ES9A)	155	03/04 →	 	A/C(+), 08/04 → 08/04 →	MVB1588R6 TB727	6PK1588 259x32

806 (221)

1.8	LFW (XU7JP)	73	07/95 → 08/02		A/C(-), Alt. 70,8A, 10/96 → 05/00	MVB1065R6	6PK1065
					A/C(-), Alt. 90A, 10/96 → 05/00	MVB1080R6	6PK1080
					A/C(+), 10/96 → 05/00	MVB1660R6	6PK1660
					10/96 → 05/00	TB419	114x17
				 KIT	10/96 → 05/00	TBK010	
1.9 TD	DHX (XUD9TE)	66	07/95 → 08/02		A/C(-), →05/00	MVB1105R6	6PK1105
					A/C(+), →05/00	MVB1740R6	6PK1740
					→05/00	TB560	136x25.4
				 KIT	→05/00	TBK020	
				DHY (XUD9TE)	68	05/97 → 08/02	
	A/C(+), →05/00	MVB1740R6	6PK1740				
	→05/00	TB560	136x25.4				
 KIT	→05/00	TBK020					
2.0	RFU (XU10J2)	89	06/94 → 08/02				
					A/C(-), PS, Alt. 80,9A, →05/00	MVB1080R6	6PK1080
					A/C(+), PS, →05/00	MVB1660R6	6PK1660
					→05/00	TB419	114x17
				 KIT	→05/00	TBK010	
2.0 16V	RFV (XU10J4R)	97	05/98 → 09/00		A/C(-), 10/98 →	MVB1165R6	6PK1165
					A/C(+), 10/98 →	MVB1600R6	6PK1600
					10/98 →	TB479	136x25.4
				 KIT	10/98 →	TBK113	
				RFN (EW10J4)	100	09/00 → 08/02	
	A/C(+)	MVB1708R6	6PK1708				
		TB683	153x25.4				
 KIT		TBK279					
2.0 HDI	RHZ (DW10ATED)	80	08/99 → 08/02				
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1755R6	6PK1755
						TB632	141x25.4
				 KIT	→04/00	TBK106	
2.0 HDI 16V	RHW (DW10ATED4)	80	08/99 → 08/02		A/C(-), 02/01 →	MVB1469R6	6PK1469
					A/C(+), 02/01 →	MVB1740R6	6PK1740
					A/C(+), 02/01 →	MVB1755R6	6PK1755
					02/01 →	TB720	114x25.4
				2.0 Turbo	RGX (XU10J2TE)	108	06/94 → 08/02
	A/C(-), Alt. 70A, →01/97	MVB1065R6	6PK1065				
	A/C(-), Alt. 80,9A, →01/97	MVB1080R6	6PK1080				
	A/C(+), →01/97	MVB1660R6	6PK1660				
	A/C(+), 02/97 → 05/00	MVB1600R6	6PK1600				
2.1 td 12V	P8C (XUD11BTE)	80	06/96 → 08/99		A/C(-)	MVB1105R6	6PK1105
					A/C(+)	MVB1725R6	6PK1725
						TB320	149x25.4
				 KIT		TBK035	



kW



...PEUGEOT

...807 (E)

807 (E)

2.0	RFN (EW10J4)	100	06/02 →		A/C(-), →08/05	MVB1190R6	6PK1190
					A/C(+), →08/05	MVB1708R6	6PK1708
					→08/05	TB683	153x25.4
					→08/05	TBK279	
2.0 16V	RFJ (EW10A)	103	09/05 →			MVB1000R6	6PK1000
						TB744	153x25
2.0 HDi	DW10UTED4-RHK, RHM (DW10ATED4), RHT (DW10ATED4), RHW (DW10ATED4)	79	06/02 →		→05/06	MVB1740R6	6PK1740
					→05/06	TB720	114x25.4
	RHR (DW10BTED4)	100	06/06 →			MVB1740R6	6PK1740
						TB742	116x25
						TBK338	
		88	11/06 →			MVB1740R6	6PK1740
						TB742	116x25
						TBK338	
2.2	3FZ (EW12J4)	116	06/02 →		A/C(-), →05/06	MVB1190R6	6PK1190
					A/C(+), →05/06	MVB1708R6	6PK1708
					→05/06	TB683	153x25.4
					→05/06	TBK279	
2.2 HDi	4HX (DW12TED4/FAP)	94	06/02 →		→05/06	MVB1740R6	6PK1740
					→05/06	TB678	146x25.4
					→04/04	TBK303	
					04/04→05/06	TBK355	
	4HT (DW12BTED4)	125	06/06 →			MVB1200R6	6PK1200
						TB810	118x25.4
3.0 V6	XFX (ES9J4S)	150	06/02 →		→05/06	MVB1580R6	6PK1580
					→05/06	TB727	259x32

1007 (KM_)

1.4	KFV (TU3JP)	55	04/05 →		A/C(-)	MVB730R6	6PK730
					A/C(+)	MVB1050R6	6PK1050
						TB711	104x17
						TBK312	
1.4 16V	KFU (ET3J4)	65	10/05 →		A/C(-)	MVB730R6	6PK730
					A/C(+)	MVB1050R6	6PK1050
						TB813	135x25.4
						TBK336	
1.4 HDi	8HX (DV4TD), 8HZ (DV4TD)	50	04/05 →		A/C(-), →03/07, → Ch. 11073	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB720	114x25.4
						TBK230	
1.6 16V	NFU (TU5JP4)	80	04/05 →		A/C(-)	MVB730R6	6PK730
					A/C(+), Ch. 10290→	MVB1050R6	6PK1050
						TB700	134x25.4
						TBK319	
1.6 HDi	9HZ (DV6TED4)	80	06/07 →		A/C(-)	MVB795R6	6PK795
					A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	

4007 (GP_)

2.2 HDi		115	02/07 →		09/07→	MVB1740R6	6PK1740
					09/07→	TB810	118x25.4

BIPPER (AA_)

1.4		54	02/08 →		A/C(-)	MVB1225R6	6PK1225
					A/C(+)	MVB1560R6	6PK1560
						TB711	104x17
						TBK312	



kw



PEUGEOT

...PEUGEOT

...BIPPER (AA_)

1.4 HDi		50	02/08 →	⊗	A/C(-)	MVB1352R6	6PK1352
				⊗	A/C(+)	MVB1708R6	6PK1708
						TB720	114x25.4
					KIT	TBK230	

BOXER Box

2.2 HDi 100		74	04/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
2.2 HDi 120		88	04/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
3.0 HDi 160		116	04/06 →	⊗		MVB1165R6	6PK1165

BOXER Box (230L)

1.9 D	D8C (XUD9AU)	51	03/94 → 04/02	⊗	A/C(-), →11/01	MVB730R6	6PK730	
				⊗	A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150	
				⊗	A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155	
					→11/01	TB560	136x25.4	
					→11/01	TBK020		
					⊗	→12/96	SVB10710	10x710
					⊗	12/96→11/01	MVB755R4	4PK755
		DJY (XUD9A)	50	07/99 → 04/02	⊗	A/C(-), →11/01	MVB730R6	6PK730
					⊗	A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
					⊗	A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
					→11/01	TB560	136x25.4	
					→11/01	TBK020		
				⊗	→11/01	MVB755R4	4PK755	
1.9 DT 4x4		66	03/96 → 09/98	⊗	A/C(-)	MVB730R6	6PK730	
				⊗	A/C(+), Alt. 80A	MVB1150R6	6PK1150	
				⊗	A/C(+), Alt. 120A	MVB1155R6	6PK1155	
						TB560	136x25.4	
						TBK020		
				⊗	→12/96	SVB10710	10x710	
1.9 TD	D8C (XUD9UTF)	68	03/94 → 04/02	⊗	A/C(-), →11/01	MVB730R6	6PK730	
				⊗	A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150	
				⊗	A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155	
					→11/01	TB560	136x25.4	
					→11/01	TBK020		
					⊗	→12/96	SVB10710	10x710
					⊗	12/96→11/01	MVB755R4	4PK755
			66	07/99 → 04/02	⊗	A/C(-), →11/01	MVB730R6	6PK730
					⊗	A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
					⊗	A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
					→11/01	TB560	136x25.4	
					→11/01	TBK020		
				⊗	→11/01	MVB755R4	4PK755	
2.0 4x4		80	03/96 → 09/98	⊗	A/C(-)	MVB698R6	6PK698	
				⊗	A/C(+)	MVB1100R6	6PK1100	
						TB454	114x25.4	
						TBK344		
				⊗	→12/96	SVB10710	10x710	
				⊗	12/96→	MVB755R4	4PK755	
2.0 HDi		62	08/01 → 04/02	⊗	A/C(-), 12/01→	MVB1469R6	6PK1469	
				⊗	A/C(+), 12/01→	MVB1180R6	6PK1180	
					12/01→	TB632	141x25.4	
					12/01→	TBK106		
				⊗	12/01→	MVB755R4	4PK755	
2.0 i	RFW (XU10J2)	80	06/94 → 04/02	⊗	A/C(-), →11/01	MVB698R6	6PK698	
				⊗	A/C(+), →11/01	MVB1100R6	6PK1100	
					→11/01	TB454	114x25.4	
					→11/01	TBK344		
				⊗	→12/96	SVB10710	10x710	
				⊗	12/96→11/01	MVB755R4	4PK755	





kW



...PEUGEOT

...BOXER Box (230L)

2.5 D	T9A (DJ5)	63	03/94 → 04/02	⊗	→11/01	MVB915R6	6PK915
				⊗	MS, →11/01	MVB795R6	6PK795
				⊗	PS, →11/01	MVB1015R6	6PK1015
					→11/01	TB459	141x28
				KIT	→11/01	TBK029	
2.5 D 4x4	T9A (DJ5)	63	07/99 → 04/02	⊗	→11/01	MVB915R6	6PK915
				⊗	MS, →11/01	MVB795R6	6PK795
				⊗	PS, →11/01	MVB1015R6	6PK1015
					→11/01	TB459	141x28
				KIT	→11/01	TBK029	
2.5 DT		62	10/97 → 11/01	⊗		MVB1090R5	5PK1090
				⊗		MVB890R6	6PK890
						TB368	152x30
2.5 TD	T8A (DJ5T)	76	03/94 → 04/02	⊗	→09/98	MVB915R6	6PK915
				⊗	MS, →09/98	MVB795R6	6PK795
				⊗	PS, →09/98	MVB1015R6	6PK1015
					→09/98	TB459	141x28
				KIT	→09/98	TBK029	
2.5 TDI	THX (DJ5TED)	79	01/97 → 04/02	⊗	→09/00	MVB915R6	6PK915
				⊗	MS, →09/00	MVB795R6	6PK795
				⊗	PS, →09/00	MVB1015R6	6PK1015
					→09/00	TB525	147x32
					→09/00	MVB940R3	3PK940
2.5 TDI 4x4	THX (DJ5TED)	79	07/99 → 04/02	⊗	→09/00	MVB915R6	6PK915
				⊗	MS, →09/00	MVB795R6	6PK795
				⊗	PS, →09/00	MVB1015R6	6PK1015
					→09/00	TB525	147x32
					→09/00	MVB940R3	3PK940
2.8 HDi	8140.43S	94	11/00 → 04/02	⊗		MVB1100R5	5PK1100
				⊗	AUTO	MVB1000R6	6PK1000
				⊗	MAN	MVB946R6	6PK946
						TB368	152x30
				KIT		TBK037	

BOXER Box (244)

2.0	RFL (XU10J2U)	81	04/02 →	⊗	A/C(-), →06/06	MVB698R6	6PK698
				⊗	A/C(+), →06/06	MVB1100R6	6PK1100
					→06/06	TB454	114x25.4
				KIT	→06/06	TBK344	
				⊗	→06/06	MVB755R4	4PK755
2.0 HDi	RHV (DW10UTD)	62	04/02 →	⊗	A/C(-), →05/04	MVB1469R6	6PK1469
				⊗	A/C(-), 05/04 →06/06	MVB870R6	6PK870
				⊗	A/C(+), →06/06	MVB1180R6	6PK1180
					→06/06	TB632	141x25.4
				KIT	→06/06	TBK106	
2.2 HDi	4HY (DW12UTED)	74	04/02 →	⊗	→06/06	MVB755R4	4PK755
				⊗	A/C(-), →05/04	MVB1469R6	6PK1469
				⊗	A/C(-), 05/04 →06/06	MVB870R6	6PK870
				⊗	A/C(+), →06/06	MVB1180R6	6PK1180
					→06/06	TB722	143x25.4
⊗	→06/06	MVB755R4	4PK755				



kw



PEUGEOT

...PEUGEOT

...BOXER Box (244)

2.8 HDi	8140.43S	94	04/02 →	☼	→06/06	MVB1100R5	5PK1100
				⊗	AUTO, →06/06	MVB1000R6	6PK1000
				⊗	MAN, →06/06	MVB946R6	6PK946
				☼	→06/06	TB368	152x30
				☼KIT	→06/06	TBK037	
				107	04/04 →	☼	→06/06
2.8 HDi 4x4	8140.43S	94	04/02 →	☼	→06/06	MVB1100R5	5PK1100
				⊗	AUTO, →06/06	MVB1000R6	6PK1000
				⊗	MAN, →06/06	MVB946R6	6PK946
				☼	→06/06	TB368	152x30
				☼KIT	→06/06	TBK037	

BOXER Bus

2.2 HDi 100	74	04/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
2.2 HDi 120	88	04/06 →	⊗	A/C(+)	MVB1675R6	6PK1675
3.0 HDi 160	115	04/06 →	⊗		MVB1165R6	6PK1165

BOXER Bus (230P)

1.9 D	D8C (XUD9AU)	51	03/94 → 04/02	⊗	A/C(-), →11/01	MVB730R6	6PK730
				⊗	A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
				⊗	A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
				☼	→11/01	TB560	136x25.4
				☼KIT	→11/01	TBK020	
				☼	→12/96	SVB10710	10x710
1.9 TD	DHY (XUD9TE)	66	08/94 → 04/02	⊗	A/C(-), →11/01	MVB730R6	6PK730
				⊗	A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
				⊗	A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
				☼	→11/01	TB560	136x25.4
				☼KIT	→11/01	TBK020	
				☼	→12/96	SVB10710	10x710
1.9 TD 4x4	D8C (XUD9UTF)	68	03/94 → 04/02	⊗	A/C(-), →11/01	MVB730R6	6PK730
				⊗	A/C(+), Alt. 80A, →11/01	MVB1150R6	6PK1150
				⊗	A/C(+), Alt. 120A, →11/01	MVB1155R6	6PK1155
				☼	→11/01	TB560	136x25.4
				☼KIT	→11/01	TBK020	
				☼	→12/96	SVB10710	10x710
2.0 i	RFW (XU10J2)	80	03/94 → 04/02	⊗	A/C(-), →11/01	MVB698R6	6PK698
				⊗	A/C(+), →11/01	MVB1100R6	6PK1100
				☼	→11/01	TB454	114x25.4
				☼KIT	→11/01	TBK344	
				☼	→12/96	SVB10710	10x710
				☼	12/96 →11/01	MVB755R4	4PK755
2.0 i 4x4	RFW (XU10J2)	80	08/96 → 04/02	⊗	A/C(-), →11/01	MVB698R6	6PK698
				⊗	A/C(+), →11/01	MVB1100R6	6PK1100
				☼	→11/01	TB454	114x25.4
				☼KIT	→11/01	TBK344	
				☼	→12/96	SVB10710	10x710
				☼	12/96 →11/01	MVB755R4	4PK755



kW



...PEUGEOT

...BOXER Bus (230P)

2.5 D	T9A (DJ5)	63	08/94 → 04/02	 	→11/01 MS, →11/01 PS, →11/01 →11/01 →11/01 →05/96	MVB915R6 MVB795R6 MVB1015R6 TB459 TBK029 MVB870R4	6PK915 6PK795 6PK1015 141x28 4PK870
2.5 D 4x4	T9A (DJ5)	63	07/96 → 04/02	 	→11/01 MS, →11/01 PS, →11/01 →11/01 →11/01	MVB915R6 MVB795R6 MVB1015R6 TB459 TBK029	6PK915 6PK795 6PK1015 141x28
2.5 DT		62	10/97 → 11/01	 		MVB1090R5 MVB890R6 TB368 TBK037	5PK1090 6PK890 152x30
2.5 TD	T8A (DJ5T)	76	07/94 → 04/02	 	→09/98 MS, →09/98 PS, →09/98 →09/98 →09/98 →05/96 05/96 →09/98	MVB915R6 MVB795R6 MVB1015R6 TB459 TBK029 MVB950R4 MVB940R3	6PK915 6PK795 6PK1015 141x28 4PK950 3PK940
2.5 TD 4x4	T8A (DJ5T)	76	07/96 → 04/02	 	→09/98 MS, →09/98 PS, →09/98 →09/98 →09/98 →09/98	MVB915R6 MVB795R6 MVB1015R6 TB459 TBK029 MVB940R3	6PK915 6PK795 6PK1015 141x28 3PK940
2.5 TDi	THX (DJ5TED)	79	01/97 → 04/02	 	→09/00 MS, →09/00 PS, →09/00 →09/00 →09/00	MVB915R6 MVB795R6 MVB1015R6 TB525 MVB940R3	6PK915 6PK795 6PK1015 147x32 3PK940
2.5 TDi 4x4	THX (DJ5TED)	79	01/97 → 04/02	 	→09/00 MS, →09/00 PS, →09/00 →09/00 →09/00	MVB915R6 MVB795R6 MVB1015R6 TB525 MVB940R3	6PK915 6PK795 6PK1015 147x32 3PK940
2.8 HDi	8140.43S	94	11/00 → 04/02	 	AUTO MAN	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30

BOXER Bus (244, Z_)

2.0	RFL (XU10J2U)	81	04/02 →	 	A/C(-), →06/06 A/C(+), →06/06 →06/06 →06/06 →06/06	MVB698R6 MVB1100R6 TB454 TBK344 MVB755R4	6PK698 6PK1100 114x25.4 4PK755
2.0 HDi	RHV (DW10UTD)	62	04/02 →	 	A/C(-), →05/04 A/C(-), 05/04 →06/06 A/C(+), →06/06 →06/06 →06/06	MVB1469R6 MVB870R6 MVB1180R6 TB632 TBK106 MVB755R4	6PK1469 6PK870 6PK1180 141x25.4 4PK755
2.2 HDi	4HY (DW12UTED)	74	04/02 →	 	A/C(-), →05/04 A/C(-), 05/04 →06/06 A/C(+), →06/06 →06/06 →06/06	MVB1469R6 MVB870R6 MVB1180R6 TB722 MVB755R4	6PK1469 6PK870 6PK1180 143x25.4 4PK755



kw



PEUGEOT

...PEUGEOT

...BOXER Bus (244, Z_)

2.8 HDi	8140.43S	94	04/02 →	☼ ⊖ ⊖ ☞ ☞KIT	→06/06 AUTO, →06/06 MAN, →06/06 →06/06 →06/06	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30
		107	04/04 →	☼ ⊖ ☞ ☞KIT	→06/06 →06/06 →06/06 →06/06	MVB1100R5 MVB946R6 TB368 TBK037	5PK1100 6PK946 152x30
2.8 HDi 4x4	8140.43S	94	04/02 →	☼ ⊖ ⊖ ☞ ☞KIT	→06/06 AUTO, →06/06 MAN, →06/06 →06/06 →06/06	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30

BOXER Flatbed / Chassis

2.2 HDi 100		74	04/06 →	⊖	A/C(+)	MVB1675R6	6PK1675
2.2 HDi 120		88	04/06 →	⊖	A/C(+)	MVB1675R6	6PK1675
3.0 HDi 160		115	04/06 →	⊖		MVB1165R6	6PK1165

BOXER Flatbed / Chassis (244)

2.0 HDi	RHV (DW10UTD)	62	04/02 →	⊖ ⊖ ⊖ ☞ ☞KIT ☺	A/C(-), →05/04 A/C(-), 05/04 →06/06 A/C(+), →06/06 →06/06 →06/06 →06/06	MVB1469R6 MVB870R6 MVB1180R6 TB632 TBK106 MVB755R4	6PK1469 6PK870 6PK1180 141x25.4 4PK755
2.2 HDi	4HY (DW12UTED)	74	04/02 →	⊖ ⊖ ⊖ ☞ ☺	A/C(-), →05/04 A/C(-), 05/04 →06/06 A/C(+), →06/06 →06/06 →06/06	MVB1469R6 MVB870R6 MVB1180R6 TB722 MVB755R4	6PK1469 6PK870 6PK1180 143x25.4 4PK755
2.8 HDi	8140.43S	94	04/02 →	☼ ⊖ ⊖ ☞ ☞KIT	→06/06 AUTO, →06/06 MAN, →06/06 →06/06 →06/06	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30
		107	04/04 →	☼ ⊖ ☞ ☞KIT	→06/06 →06/06 →06/06 →06/06	MVB1100R5 MVB946R6 TB368 TBK037	5PK1100 6PK946 152x30
2.8 HDi 4x4	8140.43S	94	04/02 →	☼ ⊖ ⊖ ☞ ☞KIT	→06/06 AUTO, →06/06 MAN, →06/06 →06/06 →06/06	MVB1100R5 MVB1000R6 MVB946R6 TB368 TBK037	5PK1100 6PK1000 6PK946 152x30

BOXER Flatbed / Chassis (ZCT_)

1.9 TD	D8C (XUD9UTF)	68	07/96 → 04/02	⊖ ⊖ ⊖ ☞ ☞KIT ☺	A/C(-), →11/01 A/C(+), Alt. 80A, →11/01 A/C(+), Alt. 120A, →11/01 →11/01 →11/01 →12/96 12/96 →11/01	MVB730R6 MVB1150R6 MVB1155R6 TB560 TBK020 SVB10710 MVB755R4	6PK730 6PK1150 6PK1155 136x25.4 10x710 4PK755
	DHY (XUD9TE)	66	12/98 → 04/02	⊖ ⊖ ⊖ ☞ ☞KIT ☺	A/C(-), →11/01 A/C(+), Alt. 80A, →11/01 A/C(+), Alt. 120A, →11/01 →11/01 →11/01 →11/01	MVB730R6 MVB1150R6 MVB1155R6 TB560 TBK020 MVB755R4	6PK730 6PK1150 6PK1155 136x25.4 4PK755



kW



...PEUGEOT

...BOXER Flatbed / Chassis (ZCT_)

2.0 i	RFW (XU10J2)	80	06/94 → 04/02		A/C(-), →11/01	MVB698R6	6PK698
					A/C(+), →11/01	MVB1100R6	6PK1100
					→11/01	TB454	114x25.4
					→11/01	TBK344	
					→12/96	SVB10710	10x710
2.5 D	T9A (DJ5)	63	03/94 → 04/02		→11/01	MVB915R6	6PK915
					MS, →11/01	MVB795R6	6PK795
					PS, →11/01	MVB1015R6	6PK1015
					→11/01	TB459	141x28
					→11/01	TBK029	
2.5 D 4x4	T9A (DJ5)	63	07/99 → 04/02		→11/01	MVB915R6	6PK915
					MS, →11/01	MVB795R6	6PK795
					PS, →11/01	MVB1015R6	6PK1015
					→11/01	TB459	141x28
					→11/01	TBK029	
2.5 TD	T8A (DJ5T)	76	03/94 → 04/02		→09/98	MVB915R6	6PK915
					MS, →09/98	MVB795R6	6PK795
					PS, →09/98	MVB1015R6	6PK1015
					→09/98	TB459	141x28
					→09/98	TBK029	
2.5 TDI	THX (DJ5TED)	79	01/97 → 04/02		→09/00	MVB915R6	6PK915
					MS, →09/00	MVB795R6	6PK795
					PS, →09/00	MVB1015R6	6PK1015
					→09/00	TB525	147x32
					→09/00	MVB940R3	3PK940
2.5 TDI 4x4	THX (DJ5TED)	79	07/99 → 04/02		→09/00	MVB915R6	6PK915
					MS, →09/00	MVB795R6	6PK795
					PS, →09/00	MVB1015R6	6PK1015
					→09/00	TB525	147x32
					→09/00	MVB940R3	3PK940
2.8 HDI	8140.43S	94	11/00 → 04/02			MVB1100R5	5PK1100
					AUTO	MVB1000R6	6PK1000
					MAN	MVB946R6	6PK946
						TB368	152x30
						TBK037	

EXPERT (224)

1.6	222A2 (1580 SPI)	58	02/96 →		→09/00	MVB900R4	4PK900
					A/C(-), →09/00	MVB890R6	6PK890
					A/C(+), →09/00	MVB925R6	6PK925
					→09/00	TB305	138x15
					→09/00	TBK027	
1.8		74	10/96 → 09/00		→09/00	SVB10675	10x675
					A/C(-), Alt. 70,8A	MVB1065R6	6PK1065
					A/C(-), Alt. 90A	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
1.9 D	D9B (XUD9AU)	51	02/96 →			TBK010	
					A/C(-), MS, →05/98	MVB730R6	6PK730
					A/C(-), PS, →05/98	MVB1115R6	6PK1115
					A/C(+), MS, →05/98	MVB1165R6	6PK1165
					A/C(+), PS, →05/98	MVB1740R6	6PK1740
	→05/98	TB560	136x25.4				
	→05/98	TBK020					



kw



PEUGEOT

...PEUGEOT

...EXPERT (224)

1.9 TD	D8B (XUD9TE)	68	02/96 →		A/C(-), MS, →09/00	MVB730R6	6PK730
					A/C(-), PS, →09/00	MVB1115R6	6PK1115
					A/C(+), MS, →09/00	MVB1165R6	6PK1165
					A/C(+), PS, →09/00	MVB1740R6	6PK1740
					→09/00	TB560	136x25.4
					→09/00	TBK020	
D8X (XUD9TE)	66	02/96 →		A/C(-), MS, →09/00	MVB730R6	6PK730	
				A/C(-), PS, →09/00	MVB1115R6	6PK1115	
				A/C(+), MS, →09/00	MVB1165R6	6PK1165	
				A/C(+), PS, →09/00	MVB1740R6	6PK1740	
				→09/00	TB560	136x25.4	
				→09/00	TBK020		
2.0	RFN (EW10J4)	100	07/00 →		A/C(-), →10/06	MVB1190R6	6PK1190
					A/C(+), →10/06	MVB1708R6	6PK1708
					→10/06	TB683	153x25.4
					→10/06	TBK279	
2.0 HDI	RHZ (DW10ATED)	80	07/00 →		A/C(-), →10/06	MVB1469R6	6PK1469
					A/C(+), →10/06	MVB1740R6	6PK1740
					→10/06	TB720	114x25.4
	RHW (DW10ATED4)	80	07/00 →		A/C(-), →10/06	MVB1469R6	6PK1469
					A/C(+), →10/06	MVB1740R6	6PK1740
					→10/06	TB720	114x25.4
RHX (DW10BTED)	69	10/00 → 11/03		A/C(-)	MVB1469R6	6PK1469	
				A/C(+)	MVB1740R6	6PK1740	
					TB632	141x25.4	
		TBK106					

EXPERT Box (222)

1.6	222A2 (1580 SPI)	58	02/96 →		→09/00	MVB900R4	4PK900
					A/C(-), →09/00	MVB890R6	6PK890
					A/C(+), →09/00	MVB925R6	6PK925
					→09/00	TB305	138x15
					→09/00	TBK027	
					→09/00	SVB10675	10x675
1.8		74	10/96 → 09/00		A/C(-), Alt. 70,8A	MVB1065R6	6PK1065
					A/C(-), Alt. 90A	MVB1080R6	6PK1080
					A/C(+)	MVB1660R6	6PK1660
						TB419	114x17
						TBK010	
1.9 D	D9B (XUD9AU)	51	02/96 →		A/C(-), MS, →05/98	MVB730R6	6PK730
					A/C(-), PS, →05/98	MVB1115R6	6PK1115
					A/C(+), MS, →05/98	MVB1165R6	6PK1165
					A/C(+), PS, →05/98	MVB1740R6	6PK1740
					→05/98	TB560	136x25.4
					→05/98	TBK020	
1.9 D 70	WJY (DW8B), WJZ (DW8)	51	12/98 →		A/C(-), 10/99 → 10/06	MVB1440R6	6PK1440
					A/C(-), MS, →08/01	MVB860R6	6PK860
					A/C(-), PS, →10/99, → Ch. 8374	MVB1388R6	6PK1388
					A/C(+), 09/01 → 12/02, → Ch. 09520	MVB1740R6	6PK1740
					A/C(+), 12/02 → 10/06	MVB1675R6	6PK1675
					Eng. DW8, A/C(+), MS, →08/01	MVB1045R6	6PK1045
					Eng. DW8, A/C(+), PS, →08/01	MVB1755R6	6PK1755
					→10/06	TB631	140x25.4
					Eng. DW8B, →10/06	TBK105	



kW



...PEUGEOT

...EXPERT Box (222)

1.9 TD	DHX (XUD9TE)	66	02/96 →	⊗	A/C(-), MS, →09/00	MVB730R6	6PK730
				⊗	A/C(-), PS, →09/00	MVB1115R6	6PK1115
				⊗	A/C(+), MS, →09/00	MVB1165R6	6PK1165
				⊗	A/C(+), PS, →09/00	MVB1740R6	6PK1740
					→09/00	TB560	136x25.4
				KIT	→09/00	TBK020	
D8B (XUD9TE)	68	02/96 →	⊗	A/C(-), MS, →09/00	MVB730R6	6PK730	
			⊗	A/C(-), PS, →09/00	MVB1115R6	6PK1115	
			⊗	A/C(+), MS, →09/00	MVB1165R6	6PK1165	
			⊗	A/C(+), PS, →09/00	MVB1740R6	6PK1740	
				→09/00	TB560	136x25.4	
			KIT	→09/00	TBK020		
2.0	RFN (EW10J4)	100	09/02 →	⊗	A/C(-), →10/06	MVB1190R6	6PK1190
				⊗	A/C(+), →10/06	MVB1708R6	6PK1708
					→10/06	TB683	153x25.4
				KIT	→10/06	TBK279	
2.0 HDI	RHX (DW10BTED)	69	07/00 →	⊗	A/C(-), →10/06	MVB1469R6	6PK1469
				⊗	A/C(+), →10/06	MVB1740R6	6PK1740
					→10/06	TB632	141x25.4
	RHZ (DW10ATED)	80	07/00 →	KIT	→11/03	TBK106	
					11/03→10/06	TBK274	
				⊗	A/C(-), →10/06	MVB1469R6	6PK1469
RHW (DW10ATED4)	80	07/00 →	⊗	A/C(+), →10/06	MVB1740R6	6PK1740	
			⊗	→10/06	TB720	114x25.4	
				A/C(-), →10/06	MVB1469R6	6PK1469	
				⊗	A/C(+), →10/06	MVB1740R6	6PK1740
					→10/06	TB720	114x25.4

EXPERT Box (VF3A_, VF3U_, VF3X_)

1.6 HDi 90		66	01/07 →	⊗	A/C(-)	MVB1352R6	6PK1352
				⊗	A/C(+)	MVB1708R6	6PK1708
						TB724	137x25.4
				KIT		TBK302	
2.0 16V		103	01/07 →	⊗		MVB1000R6	6PK1000
						TB744	153x25
2.0 HDi 120	DW10UTED4-RHK	88	01/07 →	⊗		MVB1215R6	6PK1215
						TB742	116x25
				KIT		TBK338	
2.0 HDi 140	RHR (DW10BTED4)	100	01/07 →	⊗		MVB1215R6	6PK1215
						TB742	116x25
				KIT		TBK338	

EXPERT Flatbed / Chassis

1.6 HDi 90		66	01/07 →	⊗	A/C(-)	MVB1352R6	6PK1352
				⊗	A/C(+)	MVB1708R6	6PK1708
						TB724	137x25.4
				KIT		TBK302	
1.9 D		51	06/98 → 11/03	⊗	A/C(-), 10/99→	MVB1440R6	6PK1440
				⊗	A/C(-), MS, →08/01	MVB860R6	6PK860
				⊗	A/C(-), PS, →10/99, → Ch. 8374	MVB1388R6	6PK1388
				⊗	A/C(+), 09/01→12/02, → Ch. 09520	MVB1740R6	6PK1740
				⊗	A/C(+), 12/02→	MVB1675R6	6PK1675
				⊗	A/C(+), MS, →08/01	MVB1045R6	6PK1045
				⊗	A/C(+), PS, →08/01	MVB1755R6	6PK1755
						TB631	140x25.4
				KIT		TBK105	



kw



PEUGEOT

...PEUGEOT

...EXPERT Flatbed / Chassis

2.0 HDi		69	10/00 → 10/06	⊗	A/C(-)	MVB1469R6	6PK1469
				⊗	A/C(+)	MVB1740R6	6PK1740
						TB632	141x25.4
				KIT	→11/03	TBK106	
2.0 HDi		80	10/00 → 11/03			TBK274	
				KIT	11/03→	TBK274	
				⊗	A/C(-)	MVB1469R6	6PK1469
				⊗	A/C(+)	MVB1740R6	6PK1740
2.0 HDi 120	DW10UTED4-RHK	88	01/07 →			MVB1215R6	6PK1215
						TB742	116x25
				KIT		TBK338	
2.0 HDi 140	RHR (DW10BTED4)	100	01/07 →	⊗		MVB1215R6	6PK1215
						TB742	116x25
				KIT		TBK338	

EXPERT Flatbed / Chassis (223)

1.6	222A2 (1580 SPI)	58	02/96 →		→09/00	MVB900R4	4PK900		
				⊗	A/C(-), →09/00	MVB890R6	6PK890		
				⊗	A/C(+), →09/00	MVB925R6	6PK925		
					→09/00	TB305	138x15		
				KIT	→09/00	TBK027			
				⊗	→09/00	SVB10675	10x675		
1.9 D	D9B (XUD9AU)	51	02/96 →	⊗	A/C(-), MS, →05/98	MVB730R6	6PK730		
				⊗	A/C(-), PS, →05/98	MVB1115R6	6PK1115		
				⊗	A/C(+), MS, →05/98	MVB1165R6	6PK1165		
				⊗	A/C(+), PS, →05/98	MVB1740R6	6PK1740		
					→05/98	TB560	136x25.4		
				KIT	→05/98	TBK020			
				51	06/98 → 11/03	⊗	A/C(-), 10/99→	MVB1440R6	6PK1440
						⊗	A/C(-), MS, →08/01	MVB860R6	6PK860
						⊗	A/C(-), PS, →10/99, → Ch. 8374	MVB1388R6	6PK1388
						⊗	A/C(+), 09/01→12/02, → Ch. 09520	MVB1740R6	6PK1740
						⊗	A/C(+), 12/02→	MVB1675R6	6PK1675
						⊗	A/C(+), MS, →08/01	MVB1045R6	6PK1045
1.9 TD	DHX (XUD9TE)	66	02/96 →	⊗	A/C(+), PS, →08/01	MVB1755R6	6PK1755		
						TB631	140x25.4		
				KIT		TBK105			
				⊗	A/C(-), MS, →09/00	MVB730R6	6PK730		
				⊗	A/C(-), PS, →09/00	MVB1115R6	6PK1115		
				⊗	A/C(+), MS, →09/00	MVB1165R6	6PK1165		
1.9 TD	D8B (XUD9TE)	68	02/96 →	⊗	A/C(+), PS, →09/00	MVB1740R6	6PK1740		
					→09/00	TB560	136x25.4		
				KIT	→09/00	TBK020			
				⊗	A/C(-), MS, →09/00	MVB730R6	6PK730		
				⊗	A/C(-), PS, →09/00	MVB1115R6	6PK1115		
				⊗	A/C(+), MS, →09/00	MVB1165R6	6PK1165		

EXPERT Tepee (VF3V_)

1.6 HDi 90		66	01/07 →	⊗	A/C(-)	MVB1352R6	6PK1352
				⊗	A/C(+)	MVB1708R6	6PK1708
						TB724	137x25.4
2.0 16V		103	01/07 →			TBK302	
						MVB1000R6	6PK1000
				KIT		TB744	153x25
2.0 HDi 120	DW10UTED4-RHK	88	01/07 →	⊗		TBK304	
						MVB1215R6	6PK1215
				KIT		TB742	116x25
						TBK338	



kW



...PEUGEOT

...EXPERT Tepee (VF3V_)

2.0 HDi 140	RHR (DW10BTED4)	100	01/07 →				MVB1215R6	6PK1215
							TB742	116x25
							TBK338	

J5 Box (280L)

1.8	169B (XM7T)	51	01/83 → 11/88				SVB10925	10x925
							SVB10790	10x790
							SVB10888	10x888

J5 Box (290L)

1.9 D	D9B (XUD9A)	51	10/90 →		→01/94	MVB800R4	4PK800
					→01/94	TB560	136x25.4
					→01/94	TBK019	
					→01/94	SVB10800	10x800
					→01/94	SVB10610	10x610
2.5 D 4x4	CRD93 (U25/661)	54	10/90 →		→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
					→01/94	TBK049	
					→01/94, inj. pump	TBK054	
					→01/94	TB177	62x19
2.5 TD 4x4	CRD93LS (U25/673)	70	10/90 →		→01/94	SVB10800	10x800
					→01/94	SVB10600	10x600
					→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
					→01/94	TBK049	

J5 Bus (280P)

2.0	170B (XN1T)	55	09/81 → 09/90			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
	170 (XN1T)	58	01/83 → 09/90			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
2.5 D	CRD93 (U25/661)	54	09/81 → 09/90			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
						TB177	62x19

J5 Bus (290P)

1.9 D	D9B (XUD9A)	51	10/90 →		→01/94	MVB800R4	4PK800
					→01/94	TB560	136x25.4
					→01/94	TBK019	
					→01/94	SVB10800	10x800
					→01/94	SVB10610	10x610
2.0	170D (XN1TACP)	62	10/90 →		→01/94	SVB10925	10x925
					→01/94	SVB10790	10x790
					→01/94	SVB10888	10x888
2.5 D	CRD93 (U25/661)	54	10/90 →		→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
					→01/94	TBK049	
					→01/94, inj. pump	TBK054	
					→01/94	TB177	62x19



kW



PEUGEOT

...PEUGEOT

...J5 Bus (290P)

2.5 D 4x4	CRD93 (U25/661)	54	10/90 →		→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
					→01/94	TBK049	
					→01/94, inj. pump	TBK054	
					→01/94	TB177	62x19
					→01/94	SVB10800	10x800
2.5 TD	CRD93LS (U25/673)	70	10/90 →		→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
					→01/94	TBK049	
					→01/94, inj. pump	TBK054	
					→01/94	TB177	62x19
					→01/94	SVB10800	10x800
2.5 TD 4x4	CRD93LS (U25/673)	70	10/90 →		→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
					→01/94	TBK049	
					→01/94, inj. pump	TBK054	
					→01/94	TB177	62x19
					→01/94	SVB10800	10x800

J5 Flatbed / Chassis (280L)

2.0	170 (XN1T)	58	01/83 → 11/88			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
	170B (XN1T)	55	01/86 → 11/88			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
2.5 D	CRD93 (U25/661)	54	09/81 → 09/90			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
						TB177	62x19
						SVB10800	10x800

J5 Flatbed / Chassis (290L)

1.9 D	D9B (XUD9A)	51	10/90 →		→01/94	MVB800R4	4PK800
					→01/94	TB560	136x25.4
					→01/94	TBK019	
					→01/94	SVB10800	10x800
2.0	170D (XN1TACP)	62	10/90 →		→01/94	SVB10925	10x925
					→01/94	SVB10790	10x790
					→01/94	SVB10888	10x888
2.5 D	CRD93 (U25/661)	54	10/90 →		→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
					→01/94	TBK049	
					→01/94, inj. pump	TBK054	
					→01/94	TB177	62x19
					→01/94	SVB10800	10x800
2.5 D 4x4	CRD93 (U25/661)	54	10/90 →		→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
					→01/94	TBK049	
					→01/94, inj. pump	TBK054	
					→01/94	TB177	62x19
					→01/94	SVB10800	10x800



kW



...PEUGEOT

...J5 Flatbed / Chassis (290L)

2.5 TD	CRD93LS (U25/673)	70	10/90 →	⊗	→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
2.5 TD 4x4	CRD93LS (U25/673)	70	10/90 →		→01/94	TBK049	
					→01/94	TBK054	
					→01/94, inj. pump	TBK054	
					→01/94	TB177	62x19
				⊗	→01/94	SVB10800	10x800
				⊗	→01/94	SVB10600	10x600
				⊗	→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8
2.5 TD 4x4	CRD93LS (U25/673)	70	10/90 →		→01/94	TBK049	
					→01/94	TBK054	
					→01/94, inj. pump	TBK054	
					→01/94	TB177	62x19
				⊗	→01/94	SVB10800	10x800
				⊗	→01/94	SVB10600	10x600
				⊗	→01/94	SVB10700	10x700
					→01/94	TB227	118x31.8

J9 Box

1.6	XC7P	44	03/80 → 06/87	⊗		SVB10675	10x675
				*		SVB10888	10x888
				⊗	→ Ch. 4110951	SVB101215	10x1215
				⊗	Ch. 4110952 →	SVB101225	10x1225
2.0	XN1P	57	03/80 → 06/87	⊗		SVB10675	10x675
				*		SVB10888	10x888
				⊗	→ Ch. 4110951	SVB101215	10x1215
				⊗	Ch. 4110952 →	SVB101225	10x1225
2.1 D	XDPX90	41	03/80 → 06/87	⊗		SVB10888	10x888
				⊗	08/83 →	SVB10850	10x850
				*		SVB101025	10x1025
				⊗	→ Ch. 4110951	SVB101300	10x1300
				⊗	Ch. 4110952 →	SVB101225	10x1225
				⊗	→05/84	SVB10650	10x650
				⊗	05/84 →	SVB10600	10x600
				⊗		SVB10888	10x888
2.3 D	XD2PX94	49	03/80 → 07/82	⊗	→10/81	SVB10888	10x888
				*	→10/81	SVB101025	10x1025
				⊗	→10/81, → Ch. 4110951	SVB101300	10x1300
				⊗	→10/81, Ch. 4110952 →	SVB101225	10x1225
				⊗	→10/81	SVB10650	10x650
				⊗		SVB10888	10x888
				⊗	08/83 →	SVB10850	10x850
				*		SVB101025	10x1025
2.5 D	XD3P	53	07/82 → 06/87	⊗		SVB10888	10x888
				⊗	08/83 →	SVB10850	10x850
				*		SVB101025	10x1025
				⊗	→ Ch. 4110951	SVB101300	10x1300
				⊗	Ch. 4110952 →	SVB101225	10x1225
				⊗	→05/84	SVB10650	10x650
				⊗	05/84 →	SVB10600	10x600
				⊗		SVB10888	10x888

J9 Bus

2.0	XN1P	57	03/80 → 06/87	⊗		SVB10675	10x675
				*		SVB10888	10x888
				⊗	→ Ch. 4110951	SVB101215	10x1215
				⊗	Ch. 4110952 →	SVB101225	10x1225
2.3 D	XD2PX94	49	03/80 → 07/82	⊗	→10/81	SVB10888	10x888
				*	→10/81	SVB101025	10x1025
				⊗	→10/81, → Ch. 4110951	SVB101300	10x1300
				⊗	→10/81, Ch. 4110952 →	SVB101225	10x1225
2.5 D	XD3P	53	08/82 → 06/87	⊗	→10/81	SVB10650	10x650
				⊗		SVB10888	10x888
				⊗	08/83 →	SVB10850	10x850
				*		SVB101025	10x1025
2.5 D	XD3P	53	08/82 → 06/87	⊗		SVB10888	10x888
				⊗	08/83 →	SVB10850	10x850
				*		SVB101025	10x1025
				⊗	→ Ch. 4110951	SVB101300	10x1300
				⊗	Ch. 4110952 →	SVB101225	10x1225
				⊗	→05/84	SVB10650	10x650
				⊗	05/84 →	SVB10600	10x600
				⊗		SVB10888	10x888



kW



PEUGEOT

...PEUGEOT

J9 Flatbed / Chassis

2.0	XN1P	57	03/80 → 06/87	⊗		SVB10675	10x675
				*		SVB10888	10x888
				⊗	→ Ch. 4110951	SVB101215	10x1215
				⊗	Ch. 4110952 →	SVB101225	10x1225
2.3 D	XD2PX94	49	03/80 → 07/82	⊗	→10/81	SVB10888	10x888
				*	→10/81	SVB101025	10x1025
				⊗	→10/81, → Ch. 4110951	SVB101300	10x1300
				⊗	→10/81, Ch. 4110952 →	SVB101225	10x1225
				⊗	→10/81	SVB10650	10x650
2.5 D	XD3P	53	07/82 → 06/87	⊗		SVB10888	10x888
				*	08/83 →	SVB10850	10x850
				⊗		SVB101025	10x1025
				⊗	→ Ch. 4110951	SVB101300	10x1300
				⊗	Ch. 4110952 →	SVB101225	10x1225
				⊗	→05/84	SVB10650	10x650
				⊗	05/84 →	SVB10600	10x600

PARTNER Box

1.6		66	04/08 →	⊗	A/C(-)	MVB1200R6	6PK1200
				⊗	A/C(+)	MVB1700R6	6PK1700
				⊗		TB700	134x25.4
				⊗		TBK319	
		80	04/08 →	⊗	A/C(-)	MVB1200R6	6PK1200
				⊗	A/C(+)	MVB1700R6	6PK1700
				⊗		TB700	134x25.4
				⊗		TBK319	
1.6 HDi		55	04/08 →	⊗	A/C(-)	MVB1352R6	6PK1352
				⊗	A/C(+)	MVB1708R6	6PK1708
				⊗		TB724	137x25.4
				⊗		TBK302	
		66	04/08 →	⊗	A/C(-)	MVB1352R6	6PK1352
				⊗	A/C(+)	MVB1708R6	6PK1708
				⊗		TB724	137x25.4
				⊗		TBK302	

PARTNER Box (5)

1.1	HDZ (TU1M)	44	06/96 →	⊗	A/C(-), 09/00 → 10/06	MVB1450R6	6PK1450
				⊗	A/C(+), 09/00 → 10/05	MVB1560R6	6PK1560
				⊗	A/C(+), 10/05 → 10/06	MVB1560R6	6PK1560
				⊗	MS, V-belt pulley (+), →10/02	SVB10710	10x710
				⊗	MS, V-ribbed belt pulley (+), →10/02	MVB710R5	5PK710
				⊗	PS, →10/02	MVB855R4	4PK855
				⊗	→07/01, → Eng Nr 3762433, → Ch. 9008	TB304	104x17
				⊗	07/01 → 10/06, Eng Nr 3762434 →	TB699	100x17
				⊗	→07/01, → Eng Nr 3762433, → Ch. 9008	TBK005	
				⊗	07/01 → 10/06, Eng Nr 3762434 →, Ch. 9009 →	TBK316	
				⊗	A/C(-), →10/02	MVB875R5	5PK875
				⊗	A/C(+), →10/02	MVB1255R5	5PK1255



kW



...PEUGEOT

...PARTNER Box (5)

1.4	KFX (TU3JP)	55	06/96 →	⊗	A/C(-), 09/00→10/06	MVB1450R6	6PK1450				
				⊗	A/C(-), MS, →08/00	MVB710R5	5PK710				
				⊗	A/C(-), MS, →08/00	SVB10710	10x710				
				⊗	A/C(+), →08/00	MVB855R4	4PK855				
				⊗	A/C(+), 09/00→10/05	MVB1560R6	6PK1560				
				⊗	A/C(+), 10/05→10/06	MVB1560R6	6PK1560				
					→10/06, → Eng Nr 3666765	TB259	108x17				
					→10/06, Eng Nr 3666766→	TB711	104x17				
					→10/06, → Eng Nr 3666765	TBK007					
					Auto Tensioner, →10/06, Eng Nr 3666766→	TBK312					
1.4 BiFuel	KFW (TU3JP)	55	04/03 →	⊗	A/C(-), →08/00	MVB875R5	5PK875				
				⊗	A/C(+), →08/00	MVB1255R5	5PK1255				
1.4 BiFuel	KFW (TU3JP)	55	04/03 →	⊗	A/C(-), 11/06→	MVB1450R6	6PK1450				
				⊗	A/C(+), 11/06→	MVB1560R6	6PK1560				
					11/06→	TB711	104x17				
1.6 HDi 75		55	02/06 →		11/06→	TBK312					
				⊗	A/C(-), →05/08	MVB1352R6	6PK1352				
				⊗	A/C(+), →05/08	MVB1708R6	6PK1708				
1.6 HDi 75		55	02/06 →		→05/08	TB724	137x25.4				
					→05/08	TBK302					
					→05/08						
1.6 HDi 90	9HX (DV6ATED4)	66	02/06 →	⊗	A/C(-)	MVB1352R6	6PK1352				
				⊗	A/C(+)	MVB1708R6	6PK1708				
						TB724	137x25.4				
1.6 HDi 90	9HX (DV6ATED4)	66	02/06 →			TBK302					
				⊗							
				⊗							
1.8 D	A9A (XUD7)	43	06/96 →	⊗	A/C(-), MS, →08/00	MVB730R6	6PK730				
				⊗	A/C(-), PS, →08/00	MVB1115R6	6PK1115				
				⊗	A/C(+), MS, →08/00	MVB1165R6	6PK1165				
				⊗	A/C(+), PS, →08/00	MVB1740R6	6PK1740				
					→08/00	TB560	136x25.4				
	A9A (XUD7)	43	06/96 →	06/96 →		→08/00	TBK020				
					⊗	44	11/96 → 02/98	⊗	A/C(-), MS	MVB730R6	6PK730
					⊗			⊗	A/C(-), PS	MVB1115R6	6PK1115
					⊗			⊗	A/C(+), MS	MVB1165R6	6PK1165
					⊗			⊗	A/C(+), PS	MVB1740R6	6PK1740
1.8 D	A9A (XUD7)	43	06/96 →			TB560	136x25.4				
						TBK020					
	A9A (XUD7)	43	06/96 →	06/96 →			TBK020				
1.9 D	DJY (XUD9A)	51	06/96 →	⊗	A/C(-), MS, →12/98	MVB730R6	6PK730				
				⊗	A/C(-), PS, →12/98	MVB1115R6	6PK1115				
				⊗	A/C(+), MS, →12/98	MVB1165R6	6PK1165				
				⊗	A/C(+), PS, →12/98	MVB1740R6	6PK1740				
					→12/98	TB560	136x25.4				
	DJY (XUD9A)	51	06/96 →	06/96 →		→12/98	TBK020				
					⊗	A/C(-), 10/99→08/05	MVB1440R6	6PK1440			
					⊗	A/C(-), PS, 01/99→10/99, → Ch. 8374	MVB1388R6	6PK1388			
					⊗	A/C(+), PS, 01/99→10/02	MVB1755R6	6PK1755			
					⊗	A/C(+), PS, 11/02→08/05	MVB1675R6	6PK1675			
DJY (XUD9A)	51	06/96 →	06/96 →	⊗	Eng. DW8B, A/C(-), MS, 01/99→08/05	MVB860R6	6PK860				
				⊗	Eng. DW8B, A/C(+), MS, 01/99→08/05	MVB1045R6	6PK1045				
					01/99→08/05	TB631	140x25.4				
					01/99→08/05	TBK105					
					Eng. DW8B, 01/99→08/05						
1.9 D 4x4	WJY (DW8B)	51	04/04 →	⊗	A/C(-), MS, →08/05	MVB860R6	6PK860				
				⊗	A/C(-), PS, →08/05	MVB1440R6	6PK1440				
				⊗	A/C(+), MS, →08/05	MVB1045R6	6PK1045				
				⊗	A/C(+), PS, →08/05	MVB1675R6	6PK1675				
					→08/05	TB631	140x25.4				
					→08/05	TBK105					
					→08/05						



kW



PEUGEOT

...PEUGEOT

...PARTNER Box (5)

2.0 HDi	RHY (DW10TD)	66	04/00 →	⊗	A/C(-), →08/05	MVB1469R6	6PK1469
				⊗	A/C(+), →10/02	MVB1755R6	6PK1755
				⊗	A/C(+), 11/02→08/05	MVB1740R6	6PK1740
				⊗	→08/05	TB632	141x25.4
				⊗	→10/00, → Ch. 8735	TBK106	
				⊗	10/00→06/05	TBK274	
				⊗	A/C(-), →08/05	MVB1469R6	6PK1469
				⊗	A/C(+), →08/05	MVB1740R6	6PK1740
2.0 HDi 4x4	RHY (DW10TD)	66	04/04 →	⊗	→08/05	TB632	141x25.4
				⊗	→06/05	TBK274	

PARTNER Combispace (5F)

1.1	HDZ (TU1M), HFX (TU1JP)	44	06/96 →	⊗	Eng. TU1JP, A/C(-), 09/00→10/02	MVB1450R6	6PK1450
				⊗	Eng. TU1JP, A/C(+), 09/00→10/02	MVB1560R6	6PK1560
				⊗	Eng. TU1M, MS, V-ribbed belt pulley (+), →08/00	MVB710R5	5PK710
				⊗	Eng. TU1M, PS, →08/00	MVB855R4	4PK855
				⊗	MS, V-belt pulley (+), →08/00	SVB10710	10x710
				⊗	→07/01, → Eng Nr 3762433, → Ch. 9008	TB304	104x17
				⊗	07/01→10/02, Eng Nr 3762434→	TB699	100x17
				⊗	07/01→10/02, Eng Nr 3762434→, Ch. 9009→	TBK316	
				⊗	Eng. TU1JP, →07/01, → Eng Nr 3762433, → Ch. 9008	TBK005	
				⊗	Eng. TU1M, A/C(-), →08/00	MVB875R5	5PK875
1.4	KFW (TU3JP), KFX (TU3JP)	55	06/96 →	⊗	Eng. TU3AMPI, A/C(-), 11/06→	MVB1450R6	6PK1450
				⊗	Eng. TU3AMPI, A/C(+), 11/06→	MVB1560R6	6PK1560
				⊗	11/06→	TB711	104x17
				⊗	11/06→	TBK312	
				⊗	A/C(-)	MVB1450R6	6PK1450
		54	11/02 → 10/06	⊗	A/C(+), →10/05	MVB1560R6	6PK1560
				⊗	A/C(+), 10/05→	MVB1560R6	6PK1560
				⊗	→ Eng Nr 3666765	TB259	108x17
				⊗	Eng Nr 3666766→	TB711	104x17
				⊗	→ Eng Nr 3666765	TBK007	
⊗	Auto Tensioner, Eng Nr 3666766→	TBK312					
1.6 16V	NFU (TU5JP4)	80	07/01 →	⊗	→10/02	MVB855R4	4PK855
				⊗	A/C(-), 11/02→	MVB1450R6	6PK1450
				⊗	A/C(+), 01/05→	MVB1560R6	6PK1560
				⊗	A/C(+), 11/02→01/05	MVB1560R6	6PK1560
				⊗	→ Eng Nr 1806404	TB700	134x25.4
				⊗	11/02→, Eng Nr 1806405→	TBK318	
				⊗	A/C(-), →10/02	TBK319	
				⊗	A/C(+), →10/02	MVB875R5	5PK875
				⊗	A/C(-)	MVB1255R5	5PK1255
				1.6 HDi 75		55	02/06 →
⊗	A/C(+)	MVB1708R6	6PK1708				
⊗		TB724	137x25.4				
⊗		TBK302					
1.6 HDi 90		66	02/06 →	⊗	A/C(-), →05/08, Ch. 10571→	MVB1352R6	6PK1352
				⊗	A/C(+), →05/08	MVB1708R6	6PK1708
				⊗	→05/08	TB724	137x25.4
				⊗	→05/08	TBK302	



kW



...PEUGEOT

...PARTNER Combispace (5F)

1.8	LFX (XU7JB)	66	05/97 →		A/C(-), MS, →10/02	MVB750R6	6PK750		
					A/C(-), PS, →10/02	MVB1080R6	6PK1080		
					A/C(+), PS, →10/02	MVB1660R6	6PK1660		
					→10/02	TB419	114x17		
					→10/02	TBK010			
1.9 D	DJY (XUD9A)	50	06/96 →		A/C(-), MS, →12/98	MVB730R6	6PK730		
					A/C(-), PS, →12/98	MVB1115R6	6PK1115		
					A/C(+), MS, →12/98	MVB1165R6	6PK1165		
					A/C(+), PS, →12/98	MVB1740R6	6PK1740		
					→12/98	TB560	136x25.4		
						→12/98	TBK020		
	WJY (DW8B), WJZ (DW8)		51	12/98 →		A/C(-), PS, →10/99, → Ch. 8374	MVB1388R6	6PK1388	
		A/C(-), PS, 10/99→08/05			MVB1440R6	6PK1440			
		A/C(+), PS, →10/02			MVB1755R6	6PK1755			
		A/C(+), PS, 09/00→08/05			MVB1675R6	6PK1675			
	Eng. DW8B, A/C(-), MS, →08/05	MVB860R6			6PK860				
					Eng. DW8B, A/C(+), MS, →08/05	MVB1045R6	6PK1045		
					→08/05	TB631	140x25.4		
					Eng. DW8B, →07/05	TBK105			
XUD9		51	05/96 → 12/98		A/C(-), MS	MVB730R6	6PK730		
					A/C(-), PS	MVB1115R6	6PK1115		
					A/C(+), MS	MVB1165R6	6PK1165		
					A/C(+), PS	MVB1740R6	6PK1740		
						TB560	136x25.4		
						TBK020			
1.9 D 4x4			51	04/04 → 08/05		A/C(-), MS	MVB860R6	6PK860	
						A/C(-), PS	MVB1440R6	6PK1440	
						A/C(+), MS	MVB1045R6	6PK1045	
						A/C(+), PS	MVB1675R6	6PK1675	
							TB631	140x25.4	
						TBK105			
2.0 HDi	RHY (DW10TD)	66	02/00 →		A/C(-), →08/05	MVB1469R6	6PK1469		
					A/C(+), →10/02	MVB1755R6	6PK1755		
					A/C(+), 11/02→08/05	MVB1740R6	6PK1740		
					→08/05	TB632	141x25.4		
					→10/00, → Ch. 8735	TBK106			
					10/00→06/05	TBK274			

PARTNER Tepee

1.6			66	04/08 →		A/C(-)	MVB1200R6	6PK1200
						A/C(+)	MVB1700R6	6PK1700
							TB700	134x25.4
							TBK319	
			80	04/08 →		A/C(-)	MVB1200R6	6PK1200
						A/C(+)	MVB1700R6	6PK1700
							TB700	134x25.4
							TBK319	
1.6 HDi			55	04/08 →		A/C(-)	MVB1352R6	6PK1352
						A/C(+)	MVB1708R6	6PK1708
							TB724	137x25.4
							TBK302	
			66	04/08 →		A/C(-), Ch. 10571→	MVB1352R6	6PK1352
						A/C(+)	MVB1708R6	6PK1708
							TB724	137x25.4
							TBK302	
			80	04/08 →		A/C(-)	MVB795R6	6PK795
						A/C(+)	MVB975R6	6PK975
						TB724	137x25.4	
						TBK302		



kW



PIAGGIO

PIAGGIO

PORTER Box

1.2 D	LDW12	26	05/95 →		→03/98	SVB10760	10x760
1.3 i 16V		48	05/98 →		→07/02	SVB10775	10x775
					→07/02	TB330	93x25.4
1.3 i 16V 4x4		48	05/98 →		→07/02	SVB10775	10x775
					→07/02	TB330	93x25.4

PORTER Flatbed / Chassis

1.2 D		26	05/95 →		→03/98	SVB10760	10x760
1.3 i 16V		48	05/98 →		→07/02	SVB10775	10x775
					→07/02	TB330	93x25.4
1.3 i 16V 4x4		48	05/98 →		→07/02	SVB10775	10x775
					→07/02	TB330	93x25.4

PORSCHE

911

2.0 L	901.01, 901.05	96	01/63 → 08/67			SVB10710	10x710
		110	08/67 → 11/68			SVB10710	10x710
2.0 T	901.03, 901.13	81	08/68 → 02/72		→08/71	SVB10710	10x710
2.2 T	911.06, 911.07, 911.08	92	01/70 → 12/72		09/70 → 08/71	SVB10710	10x710
2.3 E	911.52, 911.62	121	08/71 → 12/73		→08/73	SVB10710	10x710
2.3 S	911.53, 911.63	140	08/71 → 01/76		→08/73	SVB10710	10x710
2.3 T		96	01/72 → 12/73		→08/73	SVB10710	10x710
2.7		110	09/73 → 08/75		01/74 →	SVB101025	10x1025
					01/74 →	SVB10950	10x950
					01/74 →	SVB10975	10x975
						SVB131100	13x1100
		121	09/75 → 06/77		MAN, Eng Nr 6399202 →	SVB10710	10x710
						SVB101025	10x1025
						SVB10950	10x950
						SVB10975	10x975
						SVB131100	13x1100
						SVB10710	10x710
					AUTO, 01/76 →, → Eng Nr 6393868	SVB10725	10x725
2.7 S Carrera	911.42, 911.47, 911.93, 911.98	129	08/73 → 01/76		01/74 →	SVB101025	10x1025
					01/74 →	SVB10950	10x950
					01/74 →	SVB10975	10x975
						SVB131100	13x1100
						SVB10710	10x710
2.7 SC Carrera RS	911.83	154	08/72 → 01/79		01/74 → 07/77	SVB101025	10x1025
					01/74 → 07/77	SVB10950	10x950
					01/74 → 07/77	SVB10975	10x975
					08/73 → 07/77	SVB131100	13x1100
					AUTO, 01/76 → 07/77, → Eng Nr 6393868	SVB10725	10x725
					AUTO, 08/73 → 07/77, Eng Nr 6393869 →	SVB10710	10x710
3.0 SC		150	08/82 → 07/83			SVB10975	10x975
						SVB131100	13x1100
						SVB131200	13x1200
						SVB10710	10x710
					MAN, → Eng Nr 6399201	SVB10725	10x725



kW



...PORSCHE

...911

3.0 SC Carrera	930.03/13	132	07/77 → 06/80			SVB10975	10x975		
					→12/77			SVB101025	10x1025
					→12/77			SVB10950	10x950
								SVB131100	13x1100
					01/78→			SVB131200	13x1200
								SVB10710	10x710
					MAN, → Eng Nr 6399201			SVB10725	10x725
								SVB10975	10x975
								SVB131100	13x1100
								SVB131200	13x1200
3.0 SC Carrera	930.03/13	138	09/79 → 06/80			SVB10975	10x975		
								SVB131100	13x1100
								SVB131200	13x1200
								SVB10710	10x710
					AUTO, → Eng Nr 6393868			SVB10725	10x725
								SVB101025	10x1025
								SVB10950	10x950
								SVB10975	10x975
								SVB131100	13x1100
								SVB10710	10x710
3.0 SC Carrera	930.03/13	147	09/75 → 06/77			SVB101025	10x1025		
								SVB10950	10x950
								SVB10975	10x975
								SVB131100	13x1100
								SVB10710	10x710
					AUTO, 01/76→,			SVB10725	10x725
					→ Eng Nr 6393868			SVB10975	10x975
					08/75→			SVB101025	10x1025
					08/75→12/77			SVB10950	10x950
					08/75→12/77			SVB131200	13x1200
3.0 SC Carrera	930.03/13	154	03/74 → 10/83			SVB131100	13x1100		
								SVB10950	10x950
								SVB131200	13x1200
					01/78→			SVB131100	13x1100
					08/75→			SVB10710	10x710
					08/75→			SVB10725	10x725
					MAN, 01/76→,			SVB10975	10x975
					→ Eng Nr 6399201			SVB101025	10x1025
								SVB10950	10x950
								SVB131200	13x1200
3.0 Turbo		191	01/75 → 12/77		→07/77	SVB131100	13x1100		
					→07/77	SVB10710	10x710		
3.2	930.25	160	08/86 → 08/89			SVB10975	10x975		
						SVB131150	13x1150		
						SVB10710	10x710		
3.2 SC Carrera	930.20	170	08/83 → 08/89			SVB10975	10x975		
					→12/83	SVB131100	13x1100		
					→12/83	SVB131200	13x1200		
					01/84→	SVB131150	13x1150		
						SVB10710	10x710		
	930.21	152	02/84 → 06/87			SVB10975	10x975		
						SVB131150	13x1150		
						SVB10710	10x710		
3.3 SC Turbo	930.60, 930.66	221	09/77 → 06/87		→12/77	SVB131100	13x1100		
					01/78→	SVB131200	13x1200		
					01/78→12/83	SVB131125	13x1125		
						SVB10710	10x710		
3.3 Turbo	930.66	221	06/86 → 08/89			SVB131200	13x1200		
						SVB10710	10x710		
3.3 Turbo S	930.60	243	09/86 → 11/90		→07/89	SVB131200	13x1200		
					→07/89	SVB10710	10x710		
911 (964)									
3.3 Turbo	M 30.69	235	08/90 → 09/93			MVB1413R6	6PK1413		
						MVB1550R6	6PK1550		
						SVB10790	10x790		
						TB526	78x20		
3.3 Turbo S	M 30.69S	261	06/91 → 12/92			MVB1413R6	6PK1413		
						MVB1550R6	6PK1550		
						SVB10790	10x790		
						TB526	78x20		

PORSCHE



kW



PORSCHE

...PORSCHE

...911 (964)

3.6 Carrera	M 64.01, M 64.02	184	07/89 → 09/93			SVB10975	10x975
					→12/89	SVB131150	13x1150
					01/90→12/92	SVB131075	13x1075
					01/93→	SVB131085	13x1085
						SVB10760	10x760
						SVB10775	10x775
					01/90→	TB526	78x20
3.6 Carrera 4	M 64.01	184	12/88 → 09/93		08/89→	SVB10975	10x975
					01/90→12/92	SVB131075	13x1075
					01/93→	SVB131085	13x1085
					08/89→12/89	SVB131150	13x1150
					08/89→	SVB10760	10x760
					08/89→	SVB10775	10x775
					01/90→	TB526	78x20
3.6 Carrera RS	64.03	191	06/91 → 09/93		→07/92	SVB10975	10x975
					→07/92	SVB10775	10x775
3.6 Turbo	M 64.50	265	01/93 → 09/93			MVB1413R6	6PK1413
						MVB1550R6	6PK1550
						SVB10790	10x790
						TB526	78x20

911 (993)

3.6 Carrera	M 64.05, M 64.06, M 64.07, M 64.08	200	10/93 → 08/95			SVB10975	10x975
						SVB131085	13x1085
						SVB10760	10x760
						SVB10775	10x775
					→12/94	TB526	78x20
	M 64.21, M 64.22, M 64.23, M 64.24	210	08/95 → 09/97			SVB10975	10x975
						SVB131085	13x1085
						SVB10760	10x760
						SVB10775	10x775
3.6 Carrera 4	M 64.05, M 64.07	200	07/94 → 08/95			SVB10975	10x975
						SVB131085	13x1085
						SVB10760	10x760
						SVB10775	10x775
					→12/94	TB526	78x20
	M 64.21, M 64.23	210	08/95 → 09/97			SVB10975	10x975
						SVB131085	13x1085
						SVB10760	10x760
						SVB10775	10x775
3.6 Turbo 4	M 64.60	300	03/95 → 09/97		08/95→	SVB131085	13x1085
					08/95→	SVB10750	10x750
					08/95→	SVB10760	10x760

911 (996)

3.4 Carrera	M 96.01, M 96.04	221	09/97 → 09/01		A/C(-)	MVB1930R6	6PK1930
					A/C(+)	MVB2120R6	6PK2120
		235	05/01 → 08/05		A/C(-), →01/05	MVB1930R6	6PK1930
					A/C(+), →01/05	MVB2120R6	6PK2120
3.4 Carrera 4	M 96.01, M 96.04	221	09/97 → 09/01		A/C(-)	MVB1930R6	6PK1930
					A/C(+)	MVB2120R6	6PK2120
		235	05/01 → 08/05		A/C(-), →01/05	MVB1930R6	6PK1930
					A/C(+), →01/05	MVB2120R6	6PK2120
3.6 Carrera	M 96.03	235	10/01 → 08/05		08/04→	MVB2120R6	6PK2120
3.6 GT2		340	04/01 → 08/05			MVB2280R6	6PK2280
		355	10/03 → 08/05			MVB2280R6	6PK2280
3.6 GT3	M 96.76	265	03/99 → 08/05		A/C(+)	MVB2265R6	6PK2265
		280	03/03 → 08/05		A/C(+)	MVB2265R6	6PK2265
3.6 Turbo 4	M 96.70	309	06/00 → 08/05			MVB2280R6	6PK2280

911 (997)

3.6 Carrera	M 96.05	239	07/04 →			MVB2120R6	6PK2120
3.6 Carrera 4	M 96.05	239	07/04 →			MVB2120R6	6PK2120
3.6 GT 2		390	09/07 →			MVB2280R6	6PK2280





kW



...PORSCHE

...911 (997)

3.6 Turbo		353	03/06 →	⊗	08/06 →	MVB2280R6	6PK2280
3.8 Carrera 4S	M 97.01	261	07/04 →	⊗		MVB2120R6	6PK2120
		280	08/05 →	⊗		MVB2120R6	6PK2120
3.8 Carrera S	M 97.01	261	07/04 →	⊗		MVB2120R6	6PK2120
		280	08/05 →	⊗		MVB2120R6	6PK2120

911 Convertible

3.0 SC		150	08/82 → 07/83	⊗		SVB10975	10x975
				⊗		SVB131100	13x1100
				⊗		SVB131200	13x1200
				⊗		SVB10710	10x710
				⊗	AUTO, → Eng Nr 6393868	SVB10725	10x725
3.1 Carrera Speedster	930.25	160	08/86 → 08/89	⊗		SVB10975	10x975
				⊗		SVB131150	13x1150
				⊗		SVB10710	10x710
	930.20	170	08/86 → 08/89	⊗		SVB10975	10x975
				⊗		SVB131150	13x1150
				⊗		SVB10710	10x710
3.1 SC Carrera	930.21	152	10/84 → 08/89	⊗		SVB10975	10x975
				⊗		SVB131150	13x1150
				⊗		SVB10710	10x710
	930.20	170	08/83 → 08/84	⊗		SVB10975	10x975
				⊗	→12/83	SVB131100	13x1100
				⊗	→12/83	SVB131200	13x1200
				⊗	01/84 →	SVB131150	13x1150
				⊗		SVB10710	10x710

911 Convertible (964)

3.6 Carrera	M 64.01, M 64.02	184	07/89 → 05/94	⊗		SVB10975	10x975
				⊗	→12/89	SVB131150	13x1150
				⊗	01/90 → 12/92	SVB131075	13x1075
				⊗	01/93 →	SVB131085	13x1085
				⊗		SVB10760	10x760
				⊗		SVB10775	10x775
				⊗	01/90 →	TB526	78x20
3.6 Carrera 4	M 64.01	184	05/89 → 05/94	⊗		SVB10975	10x975
				⊗	→12/89	SVB131150	13x1150
				⊗	01/90 → 12/92	SVB131075	13x1075
				⊗	01/93 →	SVB131085	13x1085
				⊗		SVB10760	10x760
				⊗		SVB10775	10x775
				⊗	01/90 →	TB526	78x20

911 Convertible (993)

3.6 Carrera	M 64.05, M 64.06, M 64.07, M 64.08	200	07/94 → 08/95	⊗		SVB10975	10x975
				⊗		SVB131085	13x1085
				⊗		SVB10760	10x760
				⊗		SVB10775	10x775
				⊗	→12/94	TB526	78x20
	M 64.21, M 64.22, M 64.23, M 64.24	210	08/95 → 09/97	⊗		SVB10975	10x975
				⊗		SVB131085	13x1085
				⊗		SVB10760	10x760
				⊗		SVB10775	10x775
3.6 Carrera 4	M 64.05, M 64.07	200	07/94 → 08/95	⊗		SVB10975	10x975
				⊗		SVB131085	13x1085
				⊗		SVB10760	10x760
				⊗		SVB10775	10x775
				⊗	→12/94	TB526	78x20
	M 64.21, M 64.23	210	08/95 → 09/97	⊗		SVB10975	10x975
				⊗		SVB131085	13x1085
				⊗		SVB10760	10x760
				⊗		SVB10775	10x775



kw



PORSCHE

...PORSCHE

911 Convertible (996)

3.4 Carrera	M 96.01, M 96.04	221	02/98 → 09/01	⊗	A/C(-)	MVB1930R6	6PK1930
				⊗	A/C(+)	MVB2120R6	6PK2120
		235	05/01 → 08/05	⊗	A/C(-), →01/05	MVB1930R6	6PK1930
				⊗	A/C(+), →01/05	MVB2120R6	6PK2120
3.4 Carrera 4		235	05/01 → 08/05	⊗	A/C(-), →01/05	MVB1930R6	6PK1930
				⊗	A/C(+), →01/05	MVB2120R6	6PK2120
	M 96.02, M 96.04	221	02/98 → 09/01	⊗	A/C(-)	MVB1930R6	6PK1930
				⊗	A/C(+)	MVB2120R6	6PK2120
3.6 Carrera	M 96.03	235	10/01 → 08/05	⊗		MVB2120R6	6PK2120
3.6 Turbo 4	M 96.70	309	10/03 → 08/05	⊗	08/04→	MVB2280R6	6PK2280

911 Convertible (997)

3.6 Carrera	M 96.05	239	04/05 →	⊗		MVB2120R6	6PK2120
3.6 Carrera 4	M 96.05	239	04/05 →	⊗		MVB2120R6	6PK2120
3.6 Turbo		353	09/07 →	⊗		MVB2280R6	6PK2280
3.8 Carrera 4S	M 97.01	261	04/05 →	⊗		MVB2120R6	6PK2120
3.8 Carrera S	M 97.01	261	04/05 →	⊗		MVB2120R6	6PK2120
		280	08/05 →	⊗		MVB2120R6	6PK2120
3.8 Carrera S S4		280	08/05 →	⊗		MVB2120R6	6PK2120

911 Targa

2.0 E	901.09, 901.11	103	09/68 → 02/72	⊗	→08/71	SVB10710	10x710
2.0 L	901.01, 901.05	96	11/64 → 11/68	⊗		SVB10710	10x710
		110	08/67 → 11/68	⊗		SVB10710	10x710
2.0 S	901.02	118	07/66 → 11/68	⊗		SVB10710	10x710
	901.10	125	07/66 → 02/72	⊗	→08/71	SVB10710	10x710
2.0 T	901.03, 901.13	81	06/67 → 02/72	⊗	→08/71	SVB10710	10x710
2.2 E	911.01, 911.04	114	09/69 → 02/72	⊗	09/70→08/71	SVB10710	10x710
2.2 S	911.02	132	09/69 → 02/72	⊗	09/70→08/71	SVB10710	10x710
2.2 T		92	01/70 → 12/72	⊗	09/70→08/71	SVB10710	10x710
2.3		140	09/71 → 08/73	⊗		SVB10710	10x710
2.3 E	911.52, 911.62	121	08/71 → 12/73	⊗	→08/73	SVB10710	10x710
2.3 T		96	01/72 → 12/73	⊗	→08/73	SVB10710	10x710
2.7		110	09/73 → 08/75	⊗	01/74→	SVB101025	10x1025
				⊗	01/74→	SVB10950	10x950
				⊗	01/74→	SVB10975	10x975
				⊗		SVB131100	13x1100
		121	09/75 → 06/77	⊗	MAN, Eng Nr 6399202→	SVB10710	10x710
				⊗		SVB101025	10x1025
				⊗		SVB10950	10x950
				⊗		SVB10975	10x975
				⊗		SVB131100	13x1100
				⊗		SVB10710	10x710
				⊗	AUTO, 01/76→, → Eng Nr 6393868	SVB10725	10x725
2.7 S	911.42, 911.47, 911.93, 911.98	129	08/73 → 01/76	⊗	01/74→	SVB101025	10x1025
				⊗	01/74→	SVB10950	10x950
				⊗	01/74→	SVB10975	10x975
				⊗		SVB131100	13x1100
				⊗		SVB10710	10x710
2.7 SC Carrera RS	911.83	154	08/72 → 01/79	⊗	01/74→07/77	SVB101025	10x1025
				⊗	01/74→07/77	SVB10950	10x950
				⊗	01/74→07/77	SVB10975	10x975
				⊗	08/73→07/77	SVB131100	13x1100
				⊗	AUTO, 08/73→07/77, Eng Nr 6393869→	SVB10710	10x710
				⊗	MAN, 01/76→07/77, → Eng Nr 6399201	SVB10725	10x725



kW



PORSCHE

...PORSCHE

...911 Targa

3.0 SC Carrera	930.03/13	132	07/77 → 06/80			SVB10975	10x975
					→12/77	SVB101025	10x1025
					→12/77	SVB10950	10x950
						SVB131100	13x1100
					01/78 →	SVB131200	13x1200
						SVB10710	10x710
					AUTO, → Eng Nr 6393868	SVB10725	10x725
						SVB10975	10x975
						SVB131100	13x1100
						SVB131200	13x1200
3.3 Turbo	930.66	221	09/86 → 11/90		→07/89	SVB131200	13x1200
					→07/89	SVB10710	10x710
						SVB10975	10x975
						SVB131100	13x1100
						SVB131200	13x1200
						SVB10710	10x710
					MAN, → Eng Nr 6399201	SVB10725	10x725
						SVB101025	10x1025
						SVB10950	10x950
						SVB10975	10x975
3.6 Carrera	M 64.21, M 64.22, M 64.23, M 64.24	210	08/95 → 09/97			SVB10975	10x975
						SVB131085	13x1085
						SVB10760	10x760
						SVB10775	10x775
						SVB10975	10x975
						SVB131085	13x1085
						SVB10760	10x760
						SVB10775	10x775
						SVB10975	10x975
						SVB131085	13x1085

911 Targa (993)

3.6 Carrera	M 64.21, M 64.22, M 64.23, M 64.24	210	08/95 → 09/97			SVB10975	10x975
						SVB131085	13x1085
						SVB10760	10x760
						SVB10775	10x775

924

2.0	XJ, XK	92	11/75 → 08/89		→07/85	SVB10888	10x888
					Pulley Diam : 66, →12/80	SVB10900	10x900
					→07/85	TB108	121x18
					→07/85	TBK016	
2.0 Carrera GT	M 31.50	154	06/80 → 10/86		→07/85	SVB10888	10x888
					Pulley Diam : 66, →12/80	SVB10900	10x900
					→07/85	TB108	121x18
					→07/85	TBK016	
2.0 Turbo	M 31.01	125	11/78 → 06/80			SVB101050	10x1050
					Pulley Diam : 61	SVB10888	10x888
					Pulley Diam : 66	SVB10900	10x900
						TB108	121x18
	M 31.03	130	06/80 → 10/86		→07/85	SVB101050	10x1050
					→07/85	SVB10888	10x888
					Pulley Diam : 66, →12/80	SVB10900	10x900
					→07/85	TB108	121x18
2.5 S	M 44.07, M 44.08	110	09/85 → 07/87		A/C(-)	MVB735R5	5PK735
					A/C(+)	MVB1000R5	5PK1000
					A/C(+)	MVB1000R6	6PK1000
						TB498	110x15
						TB499	117x19
	M 44.09, M 44.10	118	08/87 → 07/88		A/C(-)	SVB10950	10x950
					A/C(+)	MVB735R5	5PK735
					A/C(+)	MVB1000R5	5PK1000
					A/C(+)	MVB1000R6	6PK1000
						TB498	110x15
		TB499	117x19				
		SVB10950	10x950				



kW



...PORSCHE

944

2.5	M 44.02, M 44.04, M 44.07, M 44.08	110	01/85 → 07/87	⊗	A/C(-), →12/85	MVB735R5	5PK735
				⊗	A/C(-), 01/86→	MVB715R6	6PK715
				⊗	A/C(+), →12/85	MVB1000R5	5PK1000
				⊗	A/C(+), 01/86→	MVB1000R6	6PK1000
				⊕		TB498	110x15
				⊕		TB499	117x19
	M 44.05, M 44.09, M 44.10	118	08/87 → 12/90	⊗	A/C(-)	MVB715R6	6PK715
				⊗	A/C(+)	MVB1000R6	6PK1000
				⊕		TB498	110x15
				⊕		TB499	117x19
				⊕		SVB10950	10x950
				M 44.01, M 44.03, M 44.05, M 44.06	120	06/81 → 07/87	⊗
⊗	A/C(-), 01/86→	MVB715R6	6PK715				
⊗	A/C(+), →12/85	MVB1000R5	5PK1000				
⊗	A/C(+), 01/86→	MVB1000R6	6PK1000				
⊕		TB498	110x15				
⊕		TB499	117x19				
2.5 S	M 44.40	140	08/86 → 07/88	⊗	A/C(-)	MVB715R6	6PK715
				⊗	A/C(+)	MVB1000R6	6PK1000
				⊕		TB498	110x15
				⊕		TB502	119x25.4
				⊕		SVB10950	10x950
				2.5 Turbo	M 44.50, M 44.51	162	08/85 → 07/88
⊗	A/C(-), 01/86→	MVB715R6	6PK715				
⊗	A/C(+), →12/85	MVB1000R5	5PK1000				
⊗	A/C(+), 01/86→	MVB1000R6	6PK1000				
⊕		TB498	110x15				
⊕		TB499	117x19				
M 44.52	184	09/87 → 07/91	⊗		A/C(-)	MVB715R6	6PK715
			⊗		A/C(+)	MVB1000R6	6PK1000
			⊕			TB498	110x15
			⊕			TB499	117x19
			⊕			SVB10950	10x950
			2.7		M 44.11, M 44.12	121	11/88 → 08/89
⊗	A/C(+)	MVB1000R6		6PK1000			
⊕		TB498		110x15			
⊕		TB499		117x19			
⊕		SVB10950		10x950			
3.0 S2	M 44.41	155		12/88 → 07/91			
			⊗		A/C(+)	MVB1000R6	6PK1000
			⊕			TB498	110x15
			⊕			TB502	119x25.4
			⊕			SVB10950	10x950

944 Convertible

3.0 S2	M 44.41	155	12/88 → 07/91	⊗	A/C(-)	MVB715R6	6PK715
				⊗	A/C(+)	MVB1000R6	6PK1000
				⊕		TB498	110x15
				⊕		TB502	119x25.4
				⊕		SVB10950	10x950

968

3.0	M 44.43, M 44.44	176	06/91 → 11/95	⊗	A/C(-), →07/95	MVB715R6	6PK715
				⊗	A/C(+), →07/95	MVB1000R6	6PK1000
				⊕	→07/95	TB498	110x15
				⊕	→07/95	TB502	119x25.4
				⊕	→07/95	SVB10950	10x950



kw



PORSCHE

...PORSCHE

...968

3.0 Turbo S		224	03/93 → 11/95	⊗ ⊗ ⊕ ⊗	A/C(-), →07/95 A/C(+), →07/95 →07/95 →07/95 →07/95	MVB715R6 MVB1000R6 TB498 TB502 SVB10950	6PK715 6PK1000 110x15 119x25.4 10x950
-------------	--	-----	---------------	------------------	--	--	---

968 Convertible

3.0	M 44.43, M 44.44	176	06/91 → 11/95	⊗ ⊗ ⊕ ⊗	A/C(-), →07/95 A/C(+), →07/95 →07/95 →07/95 →07/95	MVB715R6 MVB1000R6 TB498 TB502 SVB10950	6PK715 6PK1000 110x15 119x25.4 10x950
-----	------------------	-----	---------------	------------------	--	--	---

BOXSTER

2.7	M 96.25	176	11/04 →	⊗	→08/06	MVB2120R6	6PK2120
S 3.2		206	11/04 →	⊗	→08/06	MVB2120R6	6PK2120

BOXSTER (986)

2.5	M 96.20	150	09/96 → 08/99	⊗ ⊗	A/C(-) A/C(+)	MVB1930R6 MVB2120R6	6PK1930 6PK2120
2.7	M 96.22	162	08/99 → 07/02	⊗ ⊗	A/C(-) A/C(+)	MVB1930R6 MVB2120R6	6PK1930 6PK2120
	M 96.23	168	07/02 →	⊗ ⊗	A/C(-), →07/04 A/C(+), →07/04	MVB1930R6 MVB2120R6	6PK1930 6PK2120
S 3.2	M 96.24	191	07/02 →	⊗ ⊗	A/C(-), →07/04 A/C(+), →07/04	MVB1930R6 MVB2120R6	6PK1930 6PK2120
S 3.2	M 96.21	185	08/99 → 07/02	⊗ ⊗	A/C(-) A/C(+)	MVB1930R6 MVB2120R6	6PK1930 6PK2120

CARRERA GT

5.7	M 80.01	450	07/03 →	⊗	A/C(+)	MVB1270R5	5PK1270
-----	---------	-----	---------	---	--------	------------------	---------

CAYMAN

2.7		180	07/06 →	⊗		MVB2120R6	6PK2120
S 3.4		217	11/05 →	⊗		MVB2120R6	6PK2120

PROTON

GEN 2 (CM_)

1.6	S4PH	82	06/04 →	⊗	A/C(+), PS	MVB1675R6	6PK1675
-----	------	----	---------	---	------------	------------------	---------

IMPIAN

1.6		76	09/01 →	⊗ ⊗ ⊕	PS	MVB1090R5 MVB865R5 TB786	5PK1090 5PK865 109x25
-----	--	----	---------	-------------	----	---	-----------------------------

PERSONA 300 (C9_M)

1.3		55	08/00 →	⊗ ⊕ ⊗		MVB870R4 TB366 MVB588R4	4PK870 92x22 4PK588
313i	G 13 B	55	03/96 →	⊗ ⊕ ⊗	→09/03 →09/03 →09/03	MVB870R4 TB366 MVB588R4	4PK870 92x22 4PK588
315 GLI/GLSi		66	03/96 →	⊗ ⊕ ⊗	→07/00 →07/00 →07/00	MVB870R4 TB366 MVB588R4	4PK870 92x22 4PK588
315 GLSi	G 15 B	64	09/96 →	⊗ ⊕ ⊗	→07/00 →07/00 →07/00	MVB870R4 TB366 MVB588R4	4PK870 92x22 4PK588
316 GLXi		83	03/96 →	⊗ ⊕ ⊗	→07/00 →07/00 A/C(-), →07/00	MVB775R4 TB379 MVB950R5	4PK775 117x29 5PK950
318 16V GTI	4 G 93	99	03/96 →	⊗ ⊕ ⊗	A/C(+), →07/00 08/98 → 08/98 →	MVB1148R5 MVB775R4 TB380 MVB1110R5	5PK1148 4PK775 156x29 5PK1110



kW



...PROTON

PERSONA 400 (C9_S)

413		55	01/94 →		03/96 →12/02	MVB870R4	4PK870
					03/96 →12/02	TB366	92x22
					03/96 →12/02	MVB588R4	4PK588
415 GLi/GLSi	4 G 15	66	01/94 →			MVB870R4	4PK870
						TB366	92x22
						MVB588R4	4PK588
416 GLXi	4 G 92	83	01/94 →			MVB775R4	4PK775
						TB379	117x29
					A/C(-)	MVB950R5	5PK950
					A/C(+), →07/00	MVB1148R5	5PK1148
418		85	05/96 →		→07/00	MVB775R4	4PK775
					→07/00	TB381	121x29
					A/C(-), →07/00	MVB950R5	5PK950
420 GLS D		48	05/96 →		→01/02	SVB131025	13x1025
					→01/02	TB326	65x12.7
					→01/02	TB671	158x32
					→01/02	MVB640R4	4PK640
420 TD		60	09/96 →		→01/02	SVB131025	13x1025
					→01/02	TB326	65x12.7
					→01/02	TB671	158x32
					→01/02	MVB640R4	4PK640

PERSONA 400 Hatchback (C9_C, C9_S)

413 GLSi	4 G 13	55	01/94 →		03/96 →	MVB870R4	4PK870
					03/96 →	TB366	92x22
					03/96 →	MVB588R4	4PK588
415 GLi/GLSi	4 G 15	66	01/94 →			MVB870R4	4PK870
						TB366	92x22
						MVB588R4	4PK588
416 GLXi	4 G 92	83	01/94 →			MVB775R4	4PK775
						TB379	117x29
					A/C(-)	MVB950R5	5PK950
					A/C(+), →07/00	MVB1148R5	5PK1148
416 i	4 G 92	70	12/95 →			MVB775R4	4PK775
						TB379	117x29
					A/C(-)	MVB950R5	5PK950
					A/C(+), 08/00 →09/05	MVB1148R5	5PK1148
418 GLXi		85	05/96 →		→07/00	MVB775R4	4PK775
					→07/00	TB381	121x29
					A/C(-), →07/00	MVB950R5	5PK950
420 D		60	09/96 →		→01/02	SVB131025	13x1025
					→01/02	TB326	65x12.7
					→01/02	TB671	158x32
					→01/02	MVB640R4	4PK640
420 GLS D		48	05/96 →		→01/02	SVB131025	13x1025
					→01/02	TB326	65x12.7
					→01/02	TB671	158x32
					→01/02	MVB640R4	4PK640

SATRIA (C9_M)

1.3		55	08/00 →			MVB870R4	4PK870
						TB366	92x22
						MVB588R4	4PK588
1.5		64	07/00 →			MVB870R4	4PK870
						TB366	92x22
						MVB588R4	4PK588
1.8 GTi	4 G 93	103	08/00 →			MVB775R4	4PK775
						TB380	156x29
						MVB1110R5	5PK1110



kw



PROTON

...PROTON

WIRA

1.3		55	08/00 →			MVB870R4	4PK870
						TB366	92x22
						MVB588R4	4PK588
1.5		64	08/00 →			MVB870R4	4PK870
						TB366	92x22
						MVB588R4	4PK588
1.6	4 G 92	70	08/00 → 02/02			MVB775R4	4PK775
						TB379	117x29
					A/C(-)	MVB950R5	5PK950
					A/C(+)	MVB1148R5	5PK1148

WIRA Hatchback

1.3		55	08/00 →			MVB870R4	4PK870
						TB366	92x22
						MVB588R4	4PK588
1.5		64	08/00 →			MVB870R4	4PK870
						TB366	92x22
						MVB588R4	4PK588

RENAULT

4 (112_)

0.8		20	01/81 → 09/82			SVB10690	10x690
0.8 (1123)	800, 800 705	19	10/62 → 09/83		06/63 →	SVB10690	10x690
	800 705, B1B 707	21	10/83 → 10/88		→08/86	SVB10690	10x690
	800 01	25	09/71 → 12/88		→08/86	SVB10690	10x690
1.0		31	12/85 → 06/93		09/86 → 12/92	SVB10625	10x625
					09/86 → 12/92	SVB10665	10x665
1.0 (112C)	C1C 708	25	06/87 → 06/93		→12/92	SVB10625	10x625
					→12/92	SVB10665	10x665
1.1		32	06/86 → 06/90			SVB10625	10x625
						SVB10665	10x665
		33	02/78 → 03/84			SVB10625	10x625
						SVB10665	10x665
1.1 (1128, S128)	688 712, C1E 714, C1E 719	25	06/78 → 06/90			SVB10625	10x625
						SVB10665	10x665

4 Box (R21_, R23_)

0.8		19	09/71 → 08/82			SVB10690	10x690
0.8 (2106)	800 01	25	09/66 → 12/88		→08/86	SVB10690	10x690
0.8 (2391)	800 705, B1B 707	21	04/83 → 07/89		→08/86	SVB10690	10x690
1.0	C1C 708	25	06/87 → 12/93		→12/92	SVB10625	10x625
					→12/92	SVB10665	10x665
1.1 (2370, 210B)	688 711, 688 712, C1E 714, C1E 718, C1E 719	25	10/76 → 07/89			SVB10625	10x625
						SVB10665	10x665
1.1 (239B)	C1E 718, C1E 719	26	07/82 → 05/89			SVB10625	10x625
						SVB10665	10x665

5 (122_)

0.8 (1221, 1391)	800 710	27	01/82 → 12/84			SVB10825	10x825
						SVB10700	10x700
0.8 (1221, 1391, 1220)	800 710	26	10/72 → 08/84			SVB10825	10x825
						SVB10700	10x700
1.0 (1222, 1392)	689 710	32	01/72 → 12/85		→03/85	SVB10600	10x600
					→03/85	SVB10650	10x650
					→03/85	SVB10700	10x700
					A/C(-), MS, 04/85 →	SVB101140	10x1140
					A/C(+), 04/85 →	MVB1708R6	6PK1708
					PS, 04/85 →	SVB101150	10x1150
					04/85 →	SVB10800	10x800
					→03/85	SVB10665	10x665



kW



...RENAULT

...5 (122_)

1.1 (1227, 1397)	688 713, C1E 726	33	09/80 → 12/85		A/C(-), MS, 04/85 →	SVB101140	10x1140
					A/C(+), 04/85 →	MVB1708R6	6PK1708
					Eng. 688713, →03/85	SVB10600	10x600
					Eng. 688713, →03/85	SVB10700	10x700
					PS, 04/85 →	SVB101150	10x1150
					04/85 →	SVB10800	10x800
					→03/85	SVB10665	10x665
1.3 (1224, 1394)	810 725	47	09/75 → 09/84			SVB10600	10x600
						SVB10650	10x650
						SVB10665	10x665
1.3 (1225)	810 726	31	09/76 → 09/79			SVB10600	10x600
						SVB10700	10x700
						SVB10665	10x665
1.3 (1225, 1395)	810 719	33	06/79 → 09/84			SVB10600	10x600
						SVB10700	10x700
						SVB10665	10x665
1.3 Automatik (1225, 1395)	810 729	40	06/79 → 09/84			SVB10600	10x600
						SVB10700	10x700
						SVB10665	10x665
1.4 (1229, 1399)	847 725, C2J 713	46	01/82 → 12/85		A/C(-), MS, 04/85 →	SVB101140	10x1140
					A/C(-), PS, 04/85 →	SVB101150	10x1150
					A/C(+), PS, 04/85 →	MVB1708R6	6PK1708
					Eng. C2J713, →03/85	SVB10600	10x600
					Eng. C2J713, PS, →03/85	SVB10700	10x700
					MS, →03/85	SVB10665	10x665
1.4 Alpine A5 (1223)	840 725	68	09/77 → 09/81			SVB10650	10x650
						SVB10725	10x725
						SVB10665	10x665
1.4 Alpine Turbo (122B)	840 726, C6J 750	79	10/81 → 01/85		MS, 04/82 →	SVB10725	10x725
					MS, 04/82 →	SVB10665	10x665
					MS, 04/82 →	SVB10700	10x700
1.4 Automatik (1229, 1399)	847 712	43	06/82 → 09/84			SVB10600	10x600
					AUTO	SVB10710	10x710
					MAN	SVB10700	10x700

5 Box (238_)

0.8 (2381)	800 710	26	10/72 → 08/84			SVB10825	10x825
						SVB10700	10x700
1.0 (2382)	689 710	32	01/72 → 12/85		10/72 → 06/79	SVB10650	10x650
					10/72 → 06/79	SVB10700	10x700
					10/72 → 06/79	SVB10665	10x665
1.1	688 713, C1E 726	33	09/80 → 12/85		Eng. 688713, →03/85	SVB10600	10x600
					Eng. 688713, →03/85	SVB10700	10x700
					→03/85	SVB10665	10x665
1.3 (2387)	810 726	32	03/76 → 08/82		07/76 →	SVB10600	10x600
					07/76 →	SVB10700	10x700
					07/76 →	SVB10665	10x665

6 (118_)

0.8		25	10/69 → 04/80		→08/75	SVB10625	10x625
					→08/75	SVB10700	10x700
					→08/75	SVB10675	10x675
1.1		33	08/70 → 04/87		12/70 → 02/81	SVB10625	10x625
					12/70 → 02/81	SVB10665	10x665
		35	07/71 → 04/80			SVB10625	10x625
						SVB10665	10x665

9 (L42_)

1.1 (L421)	C1E 715, C1E 720	35	09/81 → 05/87		03/82 → 06/86	SVB131025	13x1025
					Eng. C1E715, A/C(-),	SVB101140	10x1140
					03/82 → 06/86		
					Eng. C1E715, A/C(+),	SVB101175	10x1175
					03/82 → 06/86		



kw



RENAULT

...RENAULT

...9 (L42_)

1.2 (L42S)	C1G 700, C1G 710	40	09/85 → 12/88	☼	07/86→	SVB131025	13x1025
				⊗	A/C(-), 07/86→	SVB101140	10x1140
				⊗	A/C(+), 07/86→	SVB101175	10x1175
1.4 (L422, L42C)	C1J 715, C1J 792, C1J 796, C2J 730	44	12/81 → 12/88	☼	04/82→	SVB131025	13x1025
				⊗	A/C(-), 04/82→	SVB101140	10x1140
				⊗	A/C(+), 04/82→	SVB101175	10x1175
1.4 (L423)	C2J 717, C2J 755	53	09/81 → 12/85	☼	04/82→	SVB131025	13x1025
				⊗	A/C(-), 04/82→	SVB101140	10x1140
				⊗	A/C(+), 04/82→	SVB101175	10x1175
1.4 (L423, L42R)	C2J 720, C2J 766, C2J 767, C2J 768	49	09/85 → 12/88	☼		SVB131025	13x1025
				⊗	A/C(-)	SVB101140	10x1140
				⊗	A/C(+)	SVB101175	10x1175
1.4 Automatik (L423)	C2J 718, C2J 757	50	09/81 → 12/85	☼	04/82→	SVB131025	13x1025
				⊗	A/C(-), 04/82→	SVB101140	10x1140
				⊗	A/C(+), 04/82→	SVB101175	10x1175
1.4 Turbo	C1J 760, C1J 764	85	12/86 → 12/89	☼	→04/89	SVB131025	13x1025
				⊗	→04/89	SVB101200	10x1200
				⊗	→04/89	SVB10800	10x800
1.4 Turbo (L425)	C1J 760, C1J 764	77	04/84 → 12/86	☼		SVB131025	13x1025
				⊗		SVB101175	10x1175
				⊗		SVB10800	10x800
1.6 D (L424)	F8M 700, F8M 720, F8M 730	40	10/82 → 12/88	⊗	MS, 08/83→	MVB884R6	6PK884
				⊗	MS, 08/83→	MVB885R4	4PK885
				⊗	MS, 08/83→	MVB887R5	5PK887
				⊗	PS, 08/83→	MVB1173R6	6PK1173
					02/88→	TB258	153x25.4
					08/83→01/88	TB189	153x25.4
					02/88→	TBK038	
1.7 (L426)	F2N 700, F2N 704	59	09/84 → 12/88	⊗	A/C(-), MS, →08/85	MVB869R5	5PK869
				⊗	A/C(-), MS, 09/85→06/86	MVB850R5	5PK850
				⊗	A/C(+), →06/86	MVB1165R6	6PK1165
				⊗	Eng. F2N704, A/C(-), PS, →06/86	MVB1137R6	6PK1137
				⊗	Eng. F2N704, A/C(+), →06/86	MVB1165R5	5PK1165
					→06/86	TB195	124x19
					→06/86	TBK051	
1.7 (L42E)	F3N 708	69	06/87 → 12/88	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1137R6	6PK1137
				⊗	A/C(+), → ch. nr. 000176518	MVB1165R5	5PK1165
				⊗	A/C(+), ch. nr. 000176518→	MVB1165R6	6PK1165
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	
1.7 (L42N)	F2N 708, F2N 710, F2N 798	65	10/86 → 12/88	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1137R6	6PK1137
				⊗	A/C(+), → ch. nr. 000176518	MVB1165R5	5PK1165
				⊗	A/C(+), ch. nr. 000176518→	MVB1165R6	6PK1165
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	
1.7 (L42F)	F3N 718	54	10/86 → 12/88	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1137R6	6PK1137
				⊗	A/C(+), → ch. nr. 000176518	MVB1165R5	5PK1165
				⊗	A/C(+), ch. nr. 000176518→	MVB1165R6	6PK1165
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	
1.7 (L42F)	F3N 718	54	10/86 → 12/88	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1137R6	6PK1137
				⊗	A/C(+), → ch. nr. 000176518	MVB1165R5	5PK1165
				⊗	A/C(+), ch. nr. 000176518→	MVB1165R6	6PK1165
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	
1.7 (L42F)	F3N 718	54	10/86 → 12/88	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1137R6	6PK1137
				⊗	A/C(+), → ch. nr. 000176518	MVB1165R5	5PK1165
				⊗	A/C(+), ch. nr. 000176518→	MVB1165R6	6PK1165
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	
1.7 (L42F)	F3N 718	54	10/86 → 12/88	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1137R6	6PK1137
				⊗	A/C(+), → ch. nr. 000176518	MVB1165R5	5PK1165
				⊗	A/C(+), ch. nr. 000176518→	MVB1165R6	6PK1165
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	



kW



...RENAULT

...9 (L42_)

1.7 (L42L)	F2N 730	55	10/86 → 12/88		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1137R6	6PK1137
					A/C(+), → ch. nr. 000176518	MVB1165R5	5PK1165
					A/C(+), ch. nr. 000176518→	MVB1165R6	6PK1165
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	
					01/88→	TBK017	

11 (B/C37_)

1.1 (B/C371)	C1E 715, C1E 720	35	03/83 → 06/86			SVB131025	13x1025
					Eng. C1E715, A/C(-)	SVB101140	10x1140
					Eng. C1E715, A/C(+)	SVB101175	10x1175
1.2 (B/C37S)	C1G 700, C1G 710	40	10/84 → 12/88		07/86→	SVB131025	13x1025
					Eng. C1G710, A/C(-), 07/86→	SVB101140	10x1140
					Eng. C1G710, A/C(+), 07/86→	SVB101175	10x1175
1.4 (B/C372, B/C37C)	C1J 715, C2J 730	44	03/83 → 12/88			SVB131025	13x1025
					A/C(-)	SVB101140	10x1140
					A/C(+)	SVB101175	10x1175
1.4 (B/C373)	C2J 718, C2J 757	50	03/83 → 12/85			SVB131025	13x1025
					A/C(-)	SVB101140	10x1140
					A/C(+)	SVB101175	10x1175
	C2J 717, C2J 755	53	05/83 → 12/85			SVB131025	13x1025
					A/C(-)	SVB101140	10x1140
					A/C(+)	SVB101175	10x1175
1.4 (B/C373, B/C37R)	C2J 720, C2J 766, C2J 767, C2J 768	49	03/83 → 12/88			SVB131025	13x1025
					A/C(-)	SVB101140	10x1140
					A/C(+)	SVB101175	10x1175
1.4 Turbo (B/C375)	C1J 760, C1J 764	77	04/84 → 12/86			SVB131025	13x1025
						SVB101175	10x1175
						SVB10800	10x800
	C1J 770, C1J 782	85	10/86 → 12/88			SVB131025	13x1025
						SVB101200	10x1200
					→12/86	SVB101175	10x1175
						SVB10800	10x800
1.6 D (B/C374)	F8M 700, F8M 720, F8M 730	40	08/83 → 12/88		Eng. F8M700, MS, 02/84→	MVB884R6	6PK884
					Eng. F8M700, MS, 02/84→	MVB885R4	4PK885
					Eng. F8M700, MS, 02/84→	MVB887R5	5PK887
					Eng. F8M700, PS, 02/84→	MVB1173R6	6PK1173
					02/84→01/88	TB189	153x25.4
					02/88→	TB258	153x25.4
					02/84→01/88	TBK047	
					Eng. F8M700, 02/88→	TBK038	
1.7 (B/C376)	F2N 700, F2N 704	59	10/83 → 12/87		Eng. F2N704, →06/86	MVB850R5	5PK850
					Eng. F2N704, →06/86	MVB869R5	5PK869
					→06/86	TB195	124x19
					→06/86	TBK051	
1.7 (B/C37D)	F2N 732, F2N 742	64	06/87 → 12/88			MVB850R5	5PK850
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	
					01/88→	TBK017	
1.7 (B/C37E)	F3N 708	69	06/87 → 12/88			MVB850R5	5PK850
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	
					01/88→	TBK017	
1.7 (B/C37F)	F3N 718	55	10/84 → 12/88		07/85→	MVB850R5	5PK850
					07/85→	MVB869R5	5PK869
					01/88→	TB256	125x19
					07/85→12/87	TB195	124x19
					01/88→	TBK017	
					07/85→12/87	TBK051	



kw



RENAULT

...RENAULT

...11 (B/C37_)

1.7 (B/C37L)	F2N 730	54	10/86 → 12/88	 	 →12/87 01/88→ →12/87 01/88→	MVB850R5 TB195 TB256 TBK051 TBK017	5PK850 124x19 125x19
1.7 (B/C37N)	F2N 708, F2N 710, F2N 798	65	10/86 → 12/88	 	 →12/87 01/88→ →12/87 01/88→	MVB850R5 TB195 TB256 TBK051 TBK017	5PK850 124x19 125x19

11 Box (S37_)

1.1 (S371)	C1E 715, C1E 720	35	03/83 → 06/86	 	 Eng. C1E715, A/C(-) Eng. C1E715, A/C(+)	SVB131025 SVB101140 SVB101175	13x1025 10x1140 10x1175
1.2 (S37S)	C1G 700, C1G 710	40	10/84 → 12/88	 	 07/86→ Eng. C1G710, A/C(-), 07/86→ Eng. C1G710, A/C(+), 07/86→	SVB131025 SVB101140 SVB101175	13x1025 10x1140 10x1175
1.4 (S372)	C1J 715, C2J 730	44	03/83 → 09/86	 	 A/C(-) A/C(+)	SVB131025 SVB101140 SVB101175	13x1025 10x1140 10x1175
1.4 (S373)	C2J 768	50	03/83 → 12/86	 	 A/C(-) A/C(+)	SVB131025 SVB101140 SVB101175	13x1025 10x1140 10x1175
1.6 D (S374)	F8M 700, F8M 720, F8M 730	40	08/83 → 12/88	 	 Eng. F8M700, MS, 02/84→ Eng. F8M700, MS, 02/84→ Eng. F8M700, MS, 02/84→ Eng. F8M700, PS, 02/84→ 02/84→01/88 02/88→ 02/84→01/88 Eng. F8M700, 02/88→	MVB884R6 MVB885R4 MVB887R5 MVB1173R6 TB189 TB258 TBK047 TBK038	6PK884 4PK885 5PK887 6PK1173 153x25.4 153x25.4

18 (134_)

1.4 (1340)	847 720, 847 722	47	04/78 → 07/86			SVB101300	10x1300
1.6 (1341)	841 717, A2M 723	54	04/82 → 07/86	 	 A/C(-) A/C(+)	SVB13850 SVB101010 SVB10825 SVB10625	13x850 10x1010 10x825 10x625
	841 725, 841 726	58	04/78 → 09/82	 	 A/C(-) A/C(+)	SVB13850 SVB101010 SVB10825 SVB10625	13x850 10x1010 10x825 10x625
1.6 TS (1342)	A6M 725, A6M 726	71	05/82 → 07/86	 	 A/C(-) A/C(+)	SVB13850 SVB101010 SVB10825 SVB10625	13x850 10x1010 10x825 10x625
1.6 Turbo (1345)	807 727	80	10/80 → 09/82	 	 07/81→ A/C(-), 07/81→	SVB101010 SVB10825	10x1010 10x825
	A5L 717, A5L 718	92	10/82 → 07/86	 	 A/C(-)	SVB101010 SVB10825	10x1010 10x825
1.6 Turbo Inj.	A7L 752	82	09/82 → 07/86	 	 A/C(-)	SVB101010 SVB10825	10x1010 10x825
2.0 (1343)	J6R 716	77	05/82 → 07/86	 	 → Eng Nr 24261 Eng Nr 24262→ → Eng Nr 24261 Eng Nr 24262→ A/C(-) A/C(+)	SVB13875 SVB101000 TB114 TB421 TBK015 TBK281 SVB10800 SVB10750	13x875 10x1000 116x19 116x19 10x800 10x750



kW



...RENAULT

...18 (134_)

2.1 Diesel		53	11/81 → 07/86			SVB101010	10x1010
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB13825	13x825
2.1 Diesel (1344)	852 710, J8S 711	49	11/81 → 07/86			SVB101010	10x1010
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB13825	13x825
2.1 TD		65	11/81 → 07/86			SVB101010	10x1010
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB13825	13x825
2.2 i		76	06/84 → 07/86			TB422	118x19
						TBK282	

18 Box

1.4	847 720, 847 722	47	05/79 → 07/86			SVB101300	10x1300
2.1 Diesel	852 710, J8S 711	49	11/81 → 07/86			SVB101010	10x1010
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB13825	13x825

18 Variable (135_)

1.4 (1350)	847 720, 847 722	47	05/79 → 07/86			SVB101300	10x1300
1.6		82	10/83 → 09/86			SVB101010	10x1010
					A/C(-)	SVB10825	10x825
1.6 (1351)	841 717, A2M 723	54	01/82 → 07/86			SVB13850	13x850
						SVB101010	10x1010
					A/C(-)	SVB10825	10x825
					A/C(+)	SVB10625	10x625
	841 725, 841 726	58	05/79 → 09/82			SVB13850	13x850
						SVB101010	10x1010
					A/C(-)	SVB10825	10x825
					A/C(+)	SVB10625	10x625
1.6 4x4	841 717, A2M 723	54	01/83 → 07/86			SVB13850	13x850
						SVB101010	10x1010
					A/C(-)	SVB10825	10x825
					A/C(+)	SVB10625	10x625
		58	02/79 → 06/81			SVB13850	13x850
						SVB101010	10x1010
					A/C(-)	SVB10825	10x825
					A/C(+)	SVB10625	10x625
1.6 TS	A6M 725, A6M 726	71	05/82 → 07/86			SVB13850	13x850
						SVB101010	10x1010
					A/C(-)	SVB10825	10x825
					A/C(+)	SVB10625	10x625
1.6 Turbo	A5L 717, A5L 718	92	10/82 → 07/86			SVB101010	10x1010
					A/C(-)	SVB10825	10x825
1.6 Turbo (1355)	807 727	80	09/82 → 07/86			SVB101010	10x1010
					A/C(-)	SVB10825	10x825
2.0 (1353)	J6R 716	77	10/81 → 07/86			SVB13875	13x875
						SVB101000	10x1000
					→ Eng Nr 24261	TB114	116x19
					Eng Nr 24262→	TB421	116x19
					→ Eng Nr 24261	TBK015	
					Eng Nr 24262→	TBK281	
					A/C(-)	SVB10800	10x800
					A/C(+)	SVB10750	10x750



kw



RENAULT

...RENAULT

...18 Variable (135_)

2.0 All-wheel Drive		76	05/83 → 12/86	 	→ Eng Nr 24261 Eng Nr 24262→ → Eng Nr 24261 Eng Nr 24262→ A/C(-) A/C(+)	SVB13875 SVB101000 TB114 TB421 TBK015 TBK281 SVB10800 SVB10750	13x875 10x1000 116x19 116x19 10x800 10x750
2.1 Diesel		53	05/79 → 07/86	 	incl. guide pulley Manu Tensioner	SVB101010 TB156 TBK123 TBK117 SVB13825	10x1010 148x25.4 13x825
2.1 Diesel (1354)	852 710, J8S 711	49	11/80 → 07/86	 	incl. guide pulley Manu Tensioner	SVB101010 TB156 TBK123 TBK117 SVB13825	10x1010 148x25.4 13x825

19 I (B/C53_)

1.2	C1G 730	40	01/88 → 12/92	 	07/88→ 07/88→	SVB131025 SVB101140	13x1025 10x1140
1.4	E6J 700, E6J 701	59	01/88 → 12/92	 	07/88→ A/C(-), PS, 07/88→ A/C(+), MS, 07/88→ A/C(+), MS, 07/88→06/91 07/88→ 07/88→ A/C(-), 07/88→	SVB13950 SVB10690 MVB715R3 SVB10725 TB257 TBK002 MVB775R3	13x950 10x690 3PK715 10x725 95x17 3PK775
1.4 (B/C532) CAT	C3J 710	43	01/89 → 04/92	 		SVB131025 SVB101140	13x1025 10x1140
1.4 (B/C53P)	C2J 772	43	01/89 → 12/89	 		SVB131025 SVB101140	13x1025 10x1140
1.7 (B/C53B)	F3N 740, F3N 741	54	09/88 → 04/92	 	A/C(-), PS A/C(+), MS A/C(+), PS	MVB1165R6 MVB1460R6 MVB1690R6 TB256 TBK017	6PK1165 6PK1460 6PK1690 125x19
1.7 (B/C53C)	F3N 742, F3N 743	66	09/88 → 04/92	 	A/C(-), PS A/C(+), MS A/C(+), PS	MVB1165R6 MVB1460R6 MVB1690R6 TB256 TBK017	6PK1165 6PK1460 6PK1690 125x19
1.8 16V (B/C53D)	F7P 704	99	06/89 → 04/92	 	A/C(-), MS A/C(-), PS A/C(+), PS	MVB870R6 MVB1413R6 MVB1150R6 TB423	6PK870 6PK1413 6PK1150 148x25.4
1.9 D (B/C534, B/C53J)	F8Q 706, F8Q 742	47	09/88 → 04/92	 	A/C(-), MS A/C(-), PS A/C(+)	MVB870R6 MVB1165R6 MVB1550R6 TB258 TBK038	6PK870 6PK1165 6PK1550 153x25.4

19 I Box (S53_)

1.2	C1G 730	40	01/88 → 12/92	 	07/88→ 07/88→	SVB131025 SVB101140	13x1025 10x1140
1.4		59	01/88 → 12/92	 	07/88→ A/C(-), PS, 07/88→ A/C(+), MS, 07/88→06/91 A/C(+), PS, 07/88→ 07/88→ 07/88→ A/C(-), 07/88→	SVB13950 SVB10690 SVB10725 MVB715R3 TB257 TBK002 MVB775R3	13x950 10x690 10x725 3PK715 95x17 3PK775



kW



...RENAULT

...19 I Box (S53_)

1.9 D	F8Q 706, F8Q 742	48	01/88 → 12/92		A/C(-), MS, 07/88→	MVB870R6	6PK870
					A/C(-), PS, 07/88→	MVB1165R6	6PK1165
					A/C(+), 07/88→	MVB1550R6	6PK1550
					07/88→	TB258	153x25.4
				KIT	07/88→	TBK038	

19 I Cabriolet (D53_)

1.7		55	07/91 → 04/92		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
				KIT		TBK017	
	F3N 742, F3N 743	70	07/91 → 04/92		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
				KIT		TBK017	
1.8 16V (D53D)	F7P 704	101	07/91 → 04/92		A/C(-), MS	MVB870R6	6PK870
					A/C(-), PS	MVB1413R6	6PK1413
					A/C(+), PS	MVB1150R6	6PK1150
						TB423	148x25.4

19 I Chamade (L53_)

1.2	C1G 730	40	01/88 → 12/92		07/88→	SVB131025	13x1025
					07/88→	SVB101140	10x1140
1.4 (L532, L53P)	C2J 772, C3J 710	43	07/88 → 04/92			SVB131025	13x1025
						SVB101140	10x1140
1.7 (L533)	F2N 720, F2N 721	68	09/88 → 12/92		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
				KIT		TBK017	
1.7 (L53B)	F3N 740, F3N 741	54	10/89 → 04/92		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
				KIT		TBK017	
1.7 (L53C)	F3N 742, F3N 743	66	07/88 → 04/92		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
				KIT		TBK017	
1.7 (L53F)	F3N 746	79	08/88 → 12/92		A/C(-), MS, 06/89→	MVB850R5	5PK850
					A/C(-), PS, 06/89→	MVB1165R6	6PK1165
					A/C(+), MS, 06/89→	MVB1460R6	6PK1460
					A/C(+), PS, 06/89→	MVB1690R6	6PK1690
					06/89→	TB256	125x19
				KIT	06/89→	TBK017	
1.8 16V (L53D)	F7P 704	99	10/89 → 04/92		A/C(-), MS	MVB870R6	6PK870
					A/C(-), PS	MVB1413R6	6PK1413
					A/C(+), PS	MVB1150R6	6PK1150
						TB423	148x25.4
1.9 D (L534, L53J)	F8Q 706, F8Q 742	47	10/89 → 04/92		A/C(-), MS	MVB870R6	6PK870
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+)	MVB1550R6	6PK1550
						TB258	153x25.4
				KIT		TBK038	
1.9 TD (L53K)	F8Q 740	68	09/90 → 04/92		A/C(-)	MVB1173R6	6PK1173
					A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1550R6	6PK1550
						TB258	153x25.4
				KIT		TBK038	



kW



RENAULT

...RENAULT

19 II (B/C53_)

1.2	C1G 730	40	04/92 → 12/95		→09/94	SVB131025	13x1025
					→09/94	SVB101140	10x1140
1.4	E6J 700, E7J 706	59	01/92 → 12/95			SVB13950	13x950
					A/C(-), PS	SVB10690	10x690
					A/C(+), PS	MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB775R3	3PK775
1.4 (B/C532)	C3J 710	43	04/92 → 12/95		→09/94	SVB131025	13x1025
					→09/94	SVB101140	10x1140
1.4 (B/C535)	E7J 742	55	01/92 → 12/95			SVB13950	13x950
					A/C(-), PS	SVB10690	10x690
					A/C(+), PS	MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB775R3	3PK775
1.7 (B/C53B)	F3N 740, F3N 741	54	04/92 → 12/95		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.7 (B/C53C)	F3N 743	66	04/92 → 12/95		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (5/353A)	F3P 706, F3P 760	66	04/92 → 12/95		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (5/353F, B/C538)	F3P 682, F3P 765	79	05/94 → 12/95		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (B/C538)	F3P 700	81	04/92 → 05/94		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (B/C53Y)	F3P 706, F3P 707, F3P 708, F3P 760	65	04/92 → 12/95		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 16V (B/C53D)	F7P 704	99	04/92 → 12/95		A/C(-), MS	MVB870R6	6PK870
					A/C(-), PS	MVB1413R6	6PK1413
					A/C(+), PS	MVB1150R6	6PK1150
						TB423	148x25.4
1.9 D (B/C53J)	F8Q 742	47	04/92 → 12/95		A/C(-), MS	MVB870R6	6PK870
					A/C(-), PS, →01/94	MVB1165R6	6PK1165
					A/C(-), PS, 01/94→	MVB1173R6	6PK1173
					A/C(+)	MVB1550R6	6PK1550
						TB258	153x25.4
						TBK038	



kW



...RENAULT

...19 II (B/C53_)

1.9 dT (B/C53T)	F8Q 744	66	04/92 → 12/95		A/C(-)	MVB1173R6	6PK1173
					A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1550R6	6PK1550
						TB258	153x25.4
						TBK038	

19 II Box (S53_)

1.2	C1G 730	40	03/92 → 12/95		→09/94	SVB131025	13x1025
					→09/94	SVB101140	10x1140
1.4		59	03/92 → 12/95		A/C(-), PS	SVB13950	13x950
					A/C(+), MS	SVB10690	10x690
						MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB775R3	3PK775
1.9 D	F8Q 706, F8Q 742	48	03/92 → 12/95		A/C(-), MS	MVB870R6	6PK870
					A/C(-), PS, →01/94	MVB1165R6	6PK1165
					A/C(-), PS, 01/94→	MVB1173R6	6PK1173
					A/C(+)	MVB1550R6	6PK1550
						TB258	153x25.4
						TBK038	
1.9 dT	F8Q 740	68	03/92 → 12/95		A/C(-)	MVB1173R6	6PK1173
					A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1550R6	6PK1550
						TB258	153x25.4
						TBK038	

19 II Cabriolet (D53_, 853_)

1.7 (D53C)	F3N 742, F3N 743	66	04/92 → 09/93		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (853A)	F3P 706, F3P 760	66	09/93 → 06/96		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (D53V, 853F, D53C)	F3P 682, F3P 764, F3P 765	79	07/94 → 06/96		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (D53Y)	F3P 704, F3P 705, F3P 706, F3P 707, F3P 708, F3P 760	65	04/92 → 06/96		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 16V (D53D)	F7P 704	99	04/92 → 06/96		A/C(-), MS	MVB870R6	6PK870
					A/C(-), PS	MVB1413R6	6PK1413
					A/C(+), PS	MVB1150R6	6PK1150
						TB423	148x25.4



kW



RENAULT

...RENAULT
19 II Chamade (L53_)

1.4 (532)	C3J 710	43	04/92 → 12/95		→09/94	SVB131025	13x1025
					→09/94	SVB101140	10x1140
1.4 (L535)	E7J 742	55	11/93 → 12/95			SVB13950	13x950
					A/C(-), MS	SVB10690	10x690
					A/C(+), MS	MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB775R3	3PK775
1.7 (L533)	F2N 720, F2N 721	68	01/93 → 08/95		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.7 (L53B)	F3N 740, F3N 741	54	04/92 → 12/95		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.7 (L53C)	F3N 742, F3N 743	66	04/92 → 12/95		A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (453A/F)	F3P 706, F3P 760	66	04/92 → 12/95		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (L538)	F3P 700	81	04/92 → 05/94		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (L53V, L538)	F3P 682	79	05/94 → 12/95		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 (L53Y)	F3P 704, F3P 705, F3P 706, F3P 707, F3P 708, F3P 760	65	04/92 → 12/95		A/C(-), MS	MVB850R5	5PK850
					A/C(-), PS	MVB1165R6	6PK1165
					A/C(+), MS	MVB1460R6	6PK1460
					A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.8 16V (L53D)	F7P 704	99	04/92 → 12/95		A/C(-), MS	MVB870R6	6PK870
					A/C(-), PS	MVB1413R6	6PK1413
					A/C(+), PS	MVB1150R6	6PK1150
						TB423	148x25.4
1.9 D (L53J)	F8Q 742	47	04/92 → 12/95		A/C(-), MS	MVB870R6	6PK870
					A/C(-), PS, →01/94	MVB1165R6	6PK1165
					A/C(-), PS, 01/94 →	MVB1173R6	6PK1173
					A/C(+)	MVB1550R6	6PK1550
						TB258	153x25.4
						TBK038	
1.9 dT (L53T)	F8Q 744	66	04/92 → 12/95		A/C(-)	MVB1173R6	6PK1173
					A/C(-)	MVB1190R6	6PK1190
					A/C(+)	MVB1550R6	6PK1550
						TB258	153x25.4
						TBK038	



kW



...RENAULT

21 (B48_)

(B48D)	C2J 770	51	09/89 → 05/93	 		MVB1708R6 6PK1708 SVB101140 10x1140 SVB101175 10x1175
1.7 (B48E)	F3N 722, F3N 723	66	09/89 → 06/94	 KIT	A/C(-), MS, →06/93 A/C(-), PS, →06/93 A/C(-), PS, →06/93 A/C(+), MS, →06/93 A/C(+), PS, →06/93 →06/93 →06/93	MVB850R5 5PK850 MVB1137R6 6PK1137 MVB1165R6 6PK1165 MVB1460R6 6PK1460 MVB1690R6 6PK1690 TB256 125x19 TBK017
1.7 (B48F)	F3N 726	54	09/89 → 10/92	 KIT	A/C(-), MS A/C(-), PS A/C(-), PS A/C(+), MS A/C(+), PS	MVB850R5 5PK850 MVB1137R6 6PK1137 MVB1165R6 6PK1165 MVB1460R6 6PK1460 MVB1690R6 6PK1690 TB256 125x19 TBK017
1.9 D (B48H, B48I)	F8Q 710	47	09/89 → 10/93	 KIT	MS, →06/93 PS, →06/93 →06/93 →06/93	MVB870R6 6PK870 MVB1165R6 6PK1165 TB258 153x25.4 TBK038
2.0 (B48C)	J7R 746, J7R 747	88	09/89 → 12/93	 KIT 		MVB875R4 4PK875 SVB101000 10x1000 TB421 116x19 TBK281 SVB12760 12x760
2.0 (B48R/Y)	J7R 740	99	02/90 → 10/92	 KIT 		MVB875R4 4PK875 SVB101000 10x1000 TB421 116x19 TBK281 SVB12760 12x760
2.0 4x4 (B48R/Y)	J7R 740	99	09/90 → 10/92	 KIT 		MVB875R4 4PK875 SVB101000 10x1000 TB421 116x19 TBK281 SVB12760 12x760
2.1 D (B480)	J8S 784	51	04/92 → 06/94	 KIT KIT 	incl. guide pulley Manu Tensioner	MVB875R4 4PK875 SVB121030 12x1030 TB156 148x25.4 TBK123 TBK117 SVB12760 12x760
2.1 D (B48V/B480)	J8S 600, J8S 740	53	09/89 → 12/92	 KIT KIT 	incl. guide pulley Manu Tensioner	MVB875R4 4PK875 SVB121030 12x1030 TB156 148x25.4 TBK123 TBK117 SVB12760 12x760
2.1 Turbo-D (B486, B488, B48V)	J8S 714, J8S 786, J8S 788	65	09/89 → 06/94	 KIT KIT 	incl. guide pulley Manu Tensioner	MVB875R4 4PK875 SVB121030 12x1030 TB156 148x25.4 TBK123 TBK117 SVB12760 12x760
2.2 (B48K)	J7T 754, J7T 755	79	09/89 → 06/94	 KIT 	→06/93 →06/93 →06/93 Pulley Diam : 60, →06/93 →06/93	MVB875R4 4PK875 SVB101000 10x1000 TB422 118x19 TBK282 SVB12760 12x760



kW



RENAULT

...RENAULT

...21 (B48_)

2.2 4x4 (B48K)	J7T 754, J7T 755	79	07/90 → 06/94	☼ ⊗ ☞ ☞ KIT ⊕	→06/93 →06/93 →06/93 Pulley Diam : 60, →06/93 →06/93	MVB875R4 SVB101000 TB422 TBK282 SVB12760	4PK875 10x1000 118x19 12x760
----------------	------------------	----	---------------	----------------------------------	--	---	---

21 Box (S48_)

1.7	F2N 710	65	06/86 → 04/95	⊗ ⊗ ⊗ ⊗ ☞ ☞ ☞ KIT ☞ KIT	A/C(-), MS A/C(-), PS A/C(-), PS A/C(+), MS A/C(+), PS →12/87 01/88→ →12/87 01/88→	MVB850R5 MVB1137R6 MVB1165R6 MVB1460R6 MVB1690R6 TB195 TB256 TBK051 TBK017	5PK850 6PK1137 6PK1165 6PK1460 6PK1690 124x19 125x19 12x760
1.9 D		47	06/86 → 08/94	⊗ ⊗ ☞ ☞ KIT	MS, 07/89→ PS, 07/89→ 07/89→ 07/89→	MVB870R6 MVB1165R6 TB258 TBK038	6PK870 6PK1165 153x25.4 12x760
2.1 D	J8S 704	49	06/86 → 08/94	☼ ⊗ ☞ ☞ KIT ☞ KIT ⊕	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760

21 Estate (K48_)

1.7 (K/S481)	F2N 712	55	06/86 → 03/93	⊗ ⊗ ⊗ ⊗ ⊗ ☞ ☞ ☞ KIT ☞ KIT	A/C(-), MS A/C(-), PS A/C(-), PS A/C(+), MS A/C(+), PS →12/87 01/88→ →12/87 01/88→	MVB850R5 MVB1137R6 MVB1165R6 MVB1460R6 MVB1690R6 TB195 TB256 TBK051 TBK017	5PK850 6PK1137 6PK1165 6PK1460 6PK1690 124x19 125x19 12x760
1.7 (K/S482)	F2N 710	65	10/86 → 12/88	⊗ ⊗ ⊗ ⊗ ⊗ ☞ ☞ ☞ KIT ☞ KIT	A/C(-), MS A/C(-), PS A/C(-), PS A/C(+), MS A/C(+), PS →12/87 01/88→ →12/87 01/88→	MVB850R5 MVB1137R6 MVB1165R6 MVB1460R6 MVB1690R6 TB195 TB256 TBK051 TBK017	5PK850 6PK1137 6PK1165 6PK1460 6PK1690 124x19 125x19 12x760
1.7 (K48E)	F3N 722, F3N 723	69	06/86 → 12/89	⊗ ⊗ ⊗ ⊗ ⊗ ☞ ☞ ☞ KIT ☞ KIT	A/C(-), MS A/C(-), PS A/C(-), PS A/C(+), MS A/C(+), PS →12/87 01/88→ →12/87 01/88→	MVB850R5 MVB1137R6 MVB1165R6 MVB1460R6 MVB1690R6 TB195 TB256 TBK051 TBK017	5PK850 6PK1137 6PK1165 6PK1460 6PK1690 124x19 125x19 12x760
		66	10/89 → 12/93	⊗ ⊗ ⊗ ⊗ ☞ ☞ KIT	A/C(+), PS Eng. F3N722, A/C(+), MS Eng. F3N722, A/C(-), PS Eng. F3N722, A/C(-), PS Eng. F3N722, A/C(+), MS Eng. F3N722	MVB1690R6 MVB850R5 MVB1137R6 MVB1165R6 MVB1460R6 TB256 TBK017	6PK1690 5PK850 6PK1137 6PK1165 6PK1460 125x19 12x760



kW



...RENAULT

...21 Estate (K48_)

1.7 (K48F) CAT	F3N 726	54	05/88 → 06/93	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1137R6	6PK1137
				⊗	A/C(-), PS	MVB1165R6	6PK1165
				⊗	A/C(+), MS	MVB1460R6	6PK1460
				⊗	A/C(+), PS	MVB1690R6	6PK1690
						TB256	125x19
						TBK017	
1.7 (K48M)	F2N 750	54	06/86 → 12/89	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1137R6	6PK1137
				⊗	A/C(-), PS	MVB1165R6	6PK1165
				⊗	A/C(+), MS	MVB1460R6	6PK1460
				⊗	A/C(+), PS	MVB1690R6	6PK1690
						TB195	124x19
					01/88 →	TB256	125x19
					→12/87	TBK051	
					01/88 →	TBK017	
1.7 (K48N)	F2N 752	64	06/87 → 04/89	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1137R6	6PK1137
				⊗	A/C(-), PS	MVB1165R6	6PK1165
				⊗	A/C(+), MS	MVB1460R6	6PK1460
				⊗	A/C(+), PS	MVB1690R6	6PK1690
						TB195	124x19
					01/88 →	TB256	125x19
					→12/87	TBK051	
					01/88 →	TBK017	
1.9 D		47	03/86 → 08/94	⊗	MS, 07/89 →	MVB870R6	6PK870
				⊗	PS, 07/89 →	MVB1165R6	6PK1165
					07/89 →	TB258	153x25.4
					07/89 →	TBK038	
2.0		86	07/89 → 06/92	⊗		MVB875R4	4PK875
				⊗		SVB101000	10x1000
						TB421	116x19
						TBK281	
				⊗		SVB12760	12x760
				⊗		MVB875R4	4PK875
2.0		75	06/91 → 05/93	⊗		MVB875R4	4PK875
				⊗		SVB101000	10x1000
						TB421	116x19
						TBK281	
				⊗		SVB12760	12x760
				⊗		MVB875R4	4PK875
2.0 (K483)	J7R 750, J7R 751	85	06/86 → 12/88	⊗		MVB875R4	4PK875
				⊗		SVB101000	10x1000
						TB421	116x19
						TBK281	
				⊗		SVB12760	12x760
2.0 (K48C)	J7R 746, J7R 747	88	03/86 → 12/93	⊗	08/86 → 05/92	MVB875R4	4PK875
				⊗	08/86 → 05/92	SVB101000	10x1000
					08/86 → 05/92	TB421	116x19
					08/86 → 05/92	TBK281	
				⊗	08/86 → 05/92	SVB12760	12x760
				⊗		MVB875R4	4PK875
2.0 (K48R)	J7R 740	99	06/90 → 02/94	⊗		MVB875R4	4PK875
				⊗		SVB101000	10x1000
						TB421	116x19
						TBK281	
				⊗		SVB12760	12x760
2.0 4x4	J7R 746, J7R 747	88	03/89 → 12/93	⊗	07/89 →	MVB875R4	4PK875
				⊗	07/89 →	SVB101000	10x1000
					07/89 →	TB421	116x19
					07/89 →	TBK281	
				⊗	07/89 →	SVB12760	12x760
				⊗		MVB875R4	4PK875



kw



RENAULT

...RENAULT

...21 Estate (K48_)

2.1 D (K/S486)	J8S 704	48	10/86 → 09/90	 	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760
2.1 D (K/S48V, K/S480)	J8S 600, J8S 740	53	08/89 → 12/92	 	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760
2.1 D (K480)	J8S 784	51	02/92 → 09/95	 	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760
2.1 D 4x4 (K486)	J8S 704	48	10/88 → 05/92	 	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760
2.1 Turbo-D (K48A, K48W, K487, K488)	J8S 714, J8S 786, J8S 788	65	10/86 → 11/93	 	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760
2.2 (K48K)	J7T 754, J7T 755	79	06/86 → 11/93	 	Pulley Diam : 60	MVB875R4 SVB101000 TB422 TBK282 SVB12760	4PK875 10x1000 118x19 12x760
2.2 4x4 (K48K)	J7T 754, J7T 755	79	06/86 → 12/93	 	Pulley Diam : 60	MVB875R4 SVB101000 TB422 TBK282 SVB12760	4PK875 10x1000 118x19 12x760

21 Saloon (L48_)

1.4 (L48D)	C2J 770	51	06/88 → 10/93	 	→05/93 →05/93 →05/93	MVB1708R6 SVB101140 SVB101175	6PK1708 10x1140 10x1175
1.7 (L481)	F2N 712	55	03/86 → 12/87	 	A/C(-), MS A/C(-), PS A/C(-), PS A/C(+), MS A/C(+), PS	MVB850R5 MVB1137R6 MVB1165R6 MVB1460R6 MVB1690R6 TB195 TBK051	5PK850 6PK1137 6PK1165 6PK1460 6PK1690 124x19
1.7 (L482)	F2N 710	65	03/86 → 03/93	 	A/C(-), MS A/C(-), PS A/C(-), PS A/C(+), MS A/C(+), PS →12/87 01/88→ →12/87 01/88→	MVB850R5 MVB1137R6 MVB1165R6 MVB1460R6 MVB1690R6 TB195 TB256 TBK051 TBK017	5PK850 6PK1137 6PK1165 6PK1460 6PK1690 124x19 125x19



kW



...RENAULT

...21 Saloon (L48_)

1.7 (L48E)	F3N 722, F3N 723	69	03/86 → 02/94	⊗	A/C(-), MS, →06/93	MVB850R5	5PK850				
				⊗	A/C(-), PS, →06/93	MVB1137R6	6PK1137				
				⊗	A/C(-), PS, →06/93	MVB1165R6	6PK1165				
				⊗	A/C(+), MS, →06/93	MVB1460R6	6PK1460				
				⊗	A/C(+), PS, →06/93	MVB1690R6	6PK1690				
				⊗	→12/87	TB195	124x19				
				⊗	01/88→06/93	TB256	125x19				
				⊗	→12/87	TBK051					
				⊗	01/88→06/93	TBK017					
				66	09/89 → 02/94	66	09/89 → 02/94	⊗	A/C(-), MS, →06/93	MVB850R5	5PK850
⊗	A/C(-), PS, →06/93	MVB1137R6	6PK1137								
⊗	A/C(-), PS, →06/93	MVB1165R6	6PK1165								
⊗	A/C(+), MS, →06/93	MVB1460R6	6PK1460								
⊗	A/C(+), PS, →06/93	MVB1690R6	6PK1690								
⊗	→06/93	TB256	125x19								
⊗	→06/93	TBK017									
1.7 (L48M, L48F)	F2N 750, F3N 726	54	07/86 → 02/94					⊗	A/C(-), MS, →06/93	MVB850R5	5PK850
								⊗	A/C(-), PS, →06/93	MVB1137R6	6PK1137
								⊗	A/C(-), PS, →06/93	MVB1165R6	6PK1165
				⊗	A/C(+), MS, →06/93	MVB1460R6	6PK1460				
				⊗	A/C(+), PS, →06/93	MVB1690R6	6PK1690				
				⊗	→12/87	TB195	124x19				
				⊗	01/88→06/93	TB256	125x19				
				⊗	→12/87	TBK051					
				⊗	01/88→06/93	TBK017					
				1.7 (L48N)	F2N 752	64	06/87 → 04/89	⊗	A/C(-), MS	MVB850R5	5PK850
⊗	A/C(-), PS	MVB1137R6	6PK1137								
⊗	A/C(-), PS	MVB1165R6	6PK1165								
⊗	A/C(+), MS	MVB1460R6	6PK1460								
⊗	A/C(+), PS	MVB1690R6	6PK1690								
⊗	→12/87	TB195	124x19								
⊗	01/88→	TB256	125x19								
⊗	→12/87	TBK051									
⊗	01/88→	TBK017									
1.9 D (L48H, L48I)	F8Q 710	47	08/89 → 10/93					⊗	MS, →06/93	MVB870R6	6PK870
				⊗	PS, →06/93	MVB1165R6	6PK1165				
				⊗	→06/93	TB258	153x25.4				
				⊗	→06/93	TBK038					
2.0		78	05/91 → 10/93	⊗	→08/92	MVB875R4	4PK875				
				⊗	→08/92	SVB101000	10x1000				
				⊗	→08/92	TB421	116x19				
				⊗	→08/92	SVB12760	12x760				
2.0 (L483)	J7R 750, J7R 751	85	03/86 → 12/88	⊗		MVB875R4	4PK875				
				⊗		SVB101000	10x1000				
				⊗		TB421	116x19				
				⊗		TBK281					
				⊗		SVB12760	12x760				
2.0 (L489)	J6R 758, J6R 759, J6R 792, J6R 793	75	03/86 → 10/93	⊗	04/88→08/92	MVB875R4	4PK875				
				⊗	04/88→08/92	SVB101000	10x1000				
				⊗	04/88→08/92	TB421	116x19				
				⊗	04/88→08/92	SVB12760	12x760				
2.0 (L48C)	J7R 746, J7R 747	88	03/86 → 12/93	⊗		MVB875R4	4PK875				
				⊗		SVB101000	10x1000				
				⊗		TB421	116x19				
				⊗		TBK281					
2.0 (L48R)	J7R 740	99	02/90 → 06/94	⊗	→05/93	MVB875R4	4PK875				
				⊗	→05/93	SVB101000	10x1000				
				⊗	→05/93	TB421	116x19				
				⊗	→05/93	TBK281					
				⊗	→05/93	SVB12760	12x760				



kw



RENAULT

...RENAULT

...21 Saloon (L48_)

2.0 4x4 (L48R)	J7R 740	99	12/89 → 02/94	 	→05/93 →05/93 →05/93 →05/93 →05/93	MVB875R4 SVB101000 TB421 TBK281 SVB12760	4PK875 10x1000 116x19 12x760
2.0 Turbo (L485)	J7R 752	129	04/87 → 03/90	 		MVB875R4 SVB101000 TB420 SVB12760	4PK875 10x1000 115x19 12x760
2.0 Turbo (L48L)	J7R 756	119	02/90 → 10/92	 		MVB875R4 SVB101000 TB420 SVB12760	4PK875 10x1000 115x19 12x760
2.0 Turbo 4x4	J7R 752	129	08/89 → 10/93	 	→06/93 →06/93 →06/93 →06/93	MVB875R4 SVB101000 TB420 SVB12760	4PK875 10x1000 115x19 12x760
2.0 Turbo 4x4 (L48L)	J7R 756	119	02/90 → 10/92	 		MVB875R4 SVB101000 TB420 SVB12760	4PK875 10x1000 115x19 12x760
2.1 D (L480)	J8S 784	51	10/92 → 06/94	 	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760
2.1 D (L486)	J8S 704	48	03/86 → 12/89	 	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760
2.1 D (L48V, L480)	J8S 600, J8S 740	53	05/89 → 06/94	 	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760
2.1 Turbo-D (L48A, L48W, L487, L488)	J8S 714, J8S 786, J8S 788	65	03/86 → 06/94	 	incl. guide pulley Manu Tensioner	MVB875R4 SVB121030 TB156 TBK123 TBK117 SVB12760	4PK875 12x1030 148x25.4 12x760
2.2 (L48K)	J7T 754, J7T 755	79	07/86 → 02/94	 	→06/93 →06/93 →06/93 Pulley Diam : 60, →06/93 →06/93	MVB875R4 SVB101000 TB422 TBK282 SVB12760	4PK875 10x1000 118x19 12x760
2.2 4x4 (L48K)	J7T 754, J7T 755	79	07/90 → 02/94	 	→06/93 →06/93 →06/93 Pulley Diam : 60, →06/93 →06/93	MVB875R4 SVB101000 TB422 TBK282 SVB12760	4PK875 10x1000 118x19 12x760



kW



...RENAULT

25 (B29_)

2.0	J7R 722, J7R 723	88	03/87 → 12/93	☼	→03/92	MVB875R4	4PK875
				☼	→03/92, Eng Nr 112221→	MVB870R4	4PK870
				☼	Eng. J6R, →03/92,	SVB13875	13x875
					→ Eng Nr 112220		
				⊖	→03/92	SVB101025	10x1025
2.0 (B297)	J6R 706, J6R 707, J6R 760, J6R 762, J6R 763	74	04/84 → 12/92	☼	→03/92	MVB875R4	4PK875
				☼	→03/92, Eng Nr 112221→	MVB870R4	4PK870
				☼	Eng. J6R, →03/92,	SVB13875	13x875
					→ Eng Nr 112220		
				⊖	→03/92	SVB101025	10x1025
2.0 12V	J7R 720, J7R 721	103	06/88 → 12/93	☼	→03/92	MVB875R4	4PK875
				⊖	→03/92	SVB101025	10x1025
				☼	→03/92	TB421	116x19
				☼	→03/92	TBK281	
				⊖	→03/92	SVB12760	12x760
2.0 12V (B294)	J7R 726	99	06/89 → 12/92	☼	→03/92	MVB875R4	4PK875
				⊖	→03/92	SVB101025	10x1025
				☼	→03/92	TB421	116x19
				☼	→03/92	TBK281	
				⊖	→03/92	SVB12760	12x760
2.1 Diesel (B296)	J8S 706	46	04/84 → 05/89	☼		MVB875R4	4PK875
				⊖		SVB121030	12x1030
				☼		TB156	148x25.4
				☼	incl. guide pulley	TBK123	
				☼	Manu Tensioner	TBK117	
	J8S 736	51	06/89 → 12/92	☼	→03/92	MVB875R4	4PK875
				⊖	→03/92	SVB121030	12x1030
				☼	→03/92	TB156	148x25.4
				☼	→03/92, incl. guide pulley	TBK123	
				☼	Manu Tensioner, →03/92	TBK117	
2.1 Turbo-D (B290, B29W)	J8S 708, J8S 738	63	04/84 → 12/92	☼	→03/92	MVB875R4	4PK875
				⊖	→03/92	SVB121030	12x1030
				☼	→03/92	TB156	148x25.4
				☼	→03/92, incl. guide pulley	TBK123	
				☼	Manu Tensioner, →03/92	TBK117	
2.2 (B29)		76	11/85 → 03/89	☼	→ Eng Nr 57146	SVB13875	13x875
				☼	Eng Nr 57147→	MVB875R4	4PK875
				⊖		SVB101025	10x1025
				☼		TB422	118x19
				☼	Pulley Diam : 60	TBK282	
2.2 (B29B)	J7T 708, J7T 732, J7T 733	79	09/86 → 12/92	☼	→03/92, → Eng Nr 57146	SVB13875	13x875
				☼	→03/92, Eng Nr 57147→	MVB875R4	4PK875
				⊖	→03/92	SVB101025	10x1025
				☼	→03/92	TB422	118x19
				☼	Pulley Diam : 60, →03/92	TBK282	
			→03/92	SVB12760	12x760		



kw



RENAULT

...RENAULT

...25 (B29_)

2.2 (B29E)	J7T 706, J7T 707, J7T 714, J7T 715	89	04/84 → 12/89	 	→ Eng Nr 57146 Eng Nr 57147→	SVB13875 13x875 MVB875R4 4PK875 SVB101025 10x1025 TB422 118x19 TBK282 SVB12760 12x760
	J7T 730, J7T 731	91	04/84 → 12/89	 	→ Eng Nr 57146 Eng Nr 57147→	SVB13875 13x875 MVB875R4 4PK875 SVB101025 10x1025 TB422 118x19 TBK282 SVB12760 12x760
2.5 V6 Turbo (B29G)	Z7U 700	151	01/90 → 12/92		A/C(-), →03/92	SVB13925 13x925
2.7 V6 Injection (B298)	Z7V 708, Z7V 709, Z7V 711	104	04/84 → 08/89	 	→05/88 →05/88 →05/88	SVB13925 13x925 MVB1330R5 5PK1330 SVB12760 12x760
2.8 V6 (B293)	Z7W 700	115	06/87 → 02/90	 	Cat(+) A/C(+)	SVB13925 13x925 MVB1330R5 5PK1330 SVB13725 13x725
2.8 V6 Injection (B29A)	Z7W 702	100	06/86 → 02/88	 	02/87→ Cat(+), 02/87→ A/C(+), 02/87→	SVB13925 13x925 MVB1330R5 5PK1330 SVB13725 13x725
2.8 V6 Injection (B29F)	Z7W 706, Z7W 707, Z7W 709	110	06/87 → 12/92	 	→03/92 Eng. Z7W.702, Cat(+), →12/89 A/C(+), →03/92	SVB13925 13x925 MVB1330R5 5PK1330 SVB13725 13x725

AVANTIME (DE0_)

2.0 16V Turbo (DE0U, DE0V)	F4R 760, F4R 761	120	11/01 → 05/03	 		MVB1795R6 6PK1795 TB652 126x27
2.2 dCi (DE01)	G9T 712	110	05/02 → 05/03	 		MVB1775R6 6PK1775 TB710 89x25
3.0 V6 (DE04, DE0T)	L7X 720, L7X 721	152	09/01 → 05/03	 		MVB1580R6 6PK1580 TB727 259x32

CLIO Grandtour (KR0/1_)

1.5 dCi (KR0F)	K9K 766	63	02/08 →	 		MVB1200R6 6PK1200 TB713 123x27 TBK301
1.5 dCi (KR0G)	K9K 768	50	02/08 →	 		MVB1200R6 6PK1200 TB713 123x27 TBK301
1.5 dCi (KR0H)	K9K 764	78	02/08 →	 		MVB1200R6 6PK1200 TB713 123x27 TBK301
1.5 dCi (KR1C, KR1N)		76	02/08 →	 		MVB1200R6 6PK1200 TB713 123x27 TBK301

CLIO I (B/C57_, 5/357_)

1.1	C1E 700	34	01/91 → 09/98		→05/94	SVB101140 10x1140
1.2 (5/357Y, 5/357K)	D7F 730	43	01/96 → 09/98	 	05/96→02/98 05/96→02/98 05/96→02/98 05/96→02/98 05/96→02/98 05/96→02/98 05/96→02/98 05/96→02/98	MVB906R5 5PK906 MVB735R4 4PK735 TB482 87x17 TBK092 MVB875R5 5PK875 MVB906R5 5PK906 MVB735R4 4PK735 TB482 87x17 TBK092 MVB875R5 5PK875



kW



...RENAULT

...CLIO I (B/C57_, 5/357_)

1.2 (B/C/S572)	E5F 710	44	05/90 → 03/96	 KIT 	MS A/C(-), PS A/C(-), PS, →06/91 A/C(+), MS	MVB1070R4 SVB10690 MVB705R3 MVB715R3 TB257 TBK002 MVB813R3 MVB1215R4	4PK1070 10x690 3PK705 3PK715 95x17 3PK813 4PK1215
1.2 (B/C/S577)	C3G 720	40	01/96 → 12/96		→04/96	SVB101140	10x1140
1.2 (B/C/S57A, B/C57S, 5/357F, 5/357J, 5/357L, 5/357R)	E7F 700, E7F 708, E7F 750	43	05/90 → 09/98	 KIT 	Eng. E7F708, MS, →02/98 A/C(-), →02/98 A/C(-), PS, →06/91 Eng. E7F708, A/C(+), →02/98 →02/98 Eng. E7F750, →02/98 A/C(-), →02/98 A/C(-), 06/94→02/98 Eng. E7F708, A/C(+), →02/98	MVB1070R4 SVB10690 MVB705R3 MVB715R3 TB257 TBK002 MVB813R3 MVB775R3 MVB1215R4	4PK1070 10x690 3PK705 3PK715 95x17 3PK813 3PK775 4PK1215
1.2 (B/C57R)	E7F 706	40	01/91 → 01/96	 KIT 	MS A/C(-), PS A/C(-), PS, →06/91 A/C(+), PS	MVB1070R4 SVB10690 MVB705R3 MVB715R3 TB257 TBK002 MVB813R3 MVB1215R4	4PK1070 10x690 3PK705 3PK715 95x17 3PK813 4PK1215
1.4	E7J 710, E7J 711	59	01/91 → 09/98	 KIT 	MS, →04/96 A/C(-), PS, →04/96 A/C(-), PS, →06/91 A/C(+), PS, →04/96 →04/96 →04/96 A/C(-), →04/96 A/C(-), →04/96 A/C(+), →04/96	MVB1070R4 SVB10690 MVB705R3 MVB715R3 TB257 TBK002 MVB775R3 MVB813R3 MVB1215R4	4PK1070 10x690 3PK705 3PK715 95x17 3PK775 3PK813 4PK1215
1.4 (B/C57T, B/C57Y)	E7J 718, E7J 719, E7J 754	58	01/91 → 09/98	 KIT 	Eng. E6J760, MS, →02/98 A/C(-), →02/98 A/C(-), PS, →06/91 Eng. E6J760, A/C(+), →02/98 →02/98 Eng. E6J760, →02/98 A/C(-), →04/96 Eng. E6J760, A/C(-), →02/98 Eng. E6J760, A/C(+), →02/98	MVB1070R4 SVB10690 MVB705R3 MVB715R3 TB257 TBK002 MVB813R3 MVB775R3 MVB1215R4	4PK1070 10x690 3PK705 3PK715 95x17 3PK813 3PK775 4PK1215
1.4 (B57J, C57J)	E7J 756, E7J 757	55	01/91 → 09/98	 KIT KIT 	MS, →04/96 A/C(-), PS, →04/96 A/C(-), PS, →06/91 A/C(+), PS, →04/96 Eng. E7J780, 03/98→ →04/96 03/98→ →04/96 Eng. E7J780, 03/98→ A/C(-), →04/96 A/C(-), →04/96 A/C(-), 03/98→ A/C(+), →04/96 Eng. E7J780, A/C(+), 03/98→	MVB1070R4 SVB10690 MVB705R3 MVB715R3 MVB1035R3 TB257 TB529 TBK002 TBK096 MVB775R3 MVB813R3 MVB995R4 MVB1215R4 MVB1238R4	4PK1070 10x690 3PK705 3PK715 3PK1035 95x17 96x17 3PK775 3PK813 4PK995 4PK1215 4PK1238



kw



RENAULT

...RENAULT

...CLIO I (B/C57_, 5/357_)

1.7 (B/C574)	F2N 770	68	01/91 → 12/93	⊗	A/C(-), MS, →10/92	MVB850R5	5PK850
				⊗	A/C(-), PS, →10/92	MVB1100R6	6PK1100
				⊗	A/C(+), →10/92	MVB1190R6	6PK1190
					→10/92	TB256	125x19
					→10/92	TBK017	
1.8	F3P 710	70	01/91 → 09/98	⊗	A/C(-), MS, →02/98	MVB850R5	5PK850
				⊗	A/C(-), PS, →02/98	MVB1100R6	6PK1100
				⊗	A/C(+), →12/92	MVB1190R6	6PK1190
				⊗	A/C(+), 01/93→02/98	MVB1165R6	6PK1165
					→02/98	TB256	125x19
					→02/98	TBK017	
		66	08/90 → 04/96	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1100R6	6PK1100
				⊗	A/C(+), →12/92	MVB1190R6	6PK1190
				⊗	A/C(+), 01/93→	MVB1165R6	6PK1165
						TB256	125x19
						TBK017	
1.8 (B/C578)	F3P 754, F3P 755	66	08/94 → 09/98	⊗	A/C(-), MS, →02/98	MVB850R5	5PK850
				⊗	A/C(-), PS, →02/98	MVB1100R6	6PK1100
				⊗	A/C(+), →02/98	MVB1165R6	6PK1165
					→02/98	TB256	125x19
					→02/98	TBK017	
1.8 (B/C57C, B/C57U)	F3P 710, F3P 714	65	01/91 → 09/98	⊗	A/C(-), MS, →02/98	MVB850R5	5PK850
				⊗	A/C(-), PS, →02/98	MVB1100R6	6PK1100
				⊗	A/C(+), →12/92	MVB1190R6	6PK1190
				⊗	A/C(+), 01/93→02/98	MVB1165R6	6PK1165
					→02/98	TB256	125x19
					→02/98	TBK017	
1.8 16V (C57D)	F7P 722	99	01/91 → 03/96	⊗		MVB1015R6	6PK1015
						TB423	148x25.4
1.8 Rsi (B/C579)	F3P 712	80	01/93 → 08/95	⊗	A/C(-), MS	MVB850R5	5PK850
				⊗	A/C(-), PS	MVB1100R6	6PK1100
				⊗	A/C(+)	MVB1165R6	6PK1165
						TB256	125x19
						TBK017	
1.8 Rsi (B/C57H)	F3P 758	79	08/95 → 09/98	⊗	A/C(-), MS, →02/98	MVB850R5	5PK850
				⊗	A/C(-), PS, →02/98	MVB1100R6	6PK1100
				⊗	A/C(+), →02/98	MVB1165R6	6PK1165
					→02/98	TB256	125x19
					→02/98	TBK017	
1.9 D (B/C/S576, B/C/S57L)	F8Q 730, F8Q 732	47	01/91 → 09/98	⊗	→04/94	MVB900R6	6PK900
				⊗	04/94→02/98	MVB890R6	6PK890
					→08/96	TB292	151x25.4
					09/96→02/98	TB735	151x25.4
					→09/96	TBK097	
					09/96→02/98	TBK280	
Williams (B/C57M)	F7R 700	108	01/94 → 09/98	⊗	→04/96	MVB1015R6	6PK1015
					→04/96	TB423	148x25.4

CLIO I Box (S57_)

1.1		34	01/91 → 09/98	⊗	→05/95	SVB101140	10x1140
1.2	E7F 750	44	01/91 → 09/98	⊗	MS, →02/98	MVB1070R4	4PK1070
				⊗	A/C(-), →02/98	SVB10690	10x690
				⊗	A/C(-), PS, →06/91	MVB705R3	3PK705
				⊗	A/C(+), →02/98	MVB715R3	3PK715
					→02/98	TB257	95x17
					→02/98	TBK002	
				⊗	A/C(-), →02/98	MVB813R3	3PK813
				⊗	A/C(-), 06/94→02/98	MVB775R3	3PK775
				⊗	A/C(+), →02/98	MVB1215R4	4PK1215



kW



...RENAULT

...CLIO I Box (S57_)

...1.2	E7F 706	40	01/91 → 09/98	⚙	MS, →02/98	MVB1070R4	4PK1070
				⚙	A/C(-), PS, →02/98	SVB10690	10x690
				⚙	A/C(-), PS, →06/91	MVB705R3	3PK705
				⚙	A/C(+), PS, →02/98	MVB715R3	3PK715
				🔌	→02/98	TB257	95x17
				🔌KIT	→02/98	TBK002	
				⚡	A/C(-), →02/98	MVB813R3	3PK813
				⚡	A/C(+), →02/98	MVB1215R4	4PK1215
1.9 D	F8Q 730, F8Q 732	48	01/91 → 09/98	⚙		SVB101140	10x1140
				⚙	→04/94	MVB900R6	6PK900
				⚙	04/94 →02/98	MVB890R6	6PK890
				🔌	→02/98	TB292	151x25.4
				🔌KIT	→02/98	TBK097	

CLIO II (BB0/1/2_, CB0/1/2_)

1.2 (B/CB0F, B/CB0A, B/CB10, B/CB1K, B/CB2D, B/CB2H)	D7F 710, D7F 720, D7F 726	43	09/98 →	⚙	Eng. D7F726, MS, →04/00	MVB906R5	5PK906
				⚙	Eng. D7F726, MS, 04/00 →	MVB925R4	4PK925
				⚙	Eng. D7F726, PS, →04/00	MVB1515R5	5PK1515
				⚙	Eng. D7F726, PS, 04/00 →	MVB1540R4	4PK1540
				⚙	A/C(+), 04/04 →	MVB753R3	3PK753
				⚙	Eng. D7F726, →04/00	MVB735R4	4PK735
				⚙	Eng. D7F726, 04/00 →	MVB735R3	3PK735
				🔌		TB482	87x17
				🔌	05/00 →	TB712	95x23.4
				🔌KIT	05/00 →	TBK315	
						🔌KIT	
		⚡	Eng. D7F726	TBK092			
		⚡	Eng. D7F726, →04/00	MVB875R5	5PK875		
		⚡	Eng. D7F726, 04/00 →	MVB905R4	4PK905		
1.2 16V (B/CB05)	D4F 712, D4F 714	55	06/01 →	⚙	Eng. D4F712, PS	MVB1540R4	4PK1540
				⚙	MS	MVB925R4	4PK925
				⚙	A/C(+)	MVB753R3	3PK753
				⚙	Eng. D4F712	MVB735R3	3PK735
				🔌		TB712	95x23.4
				🔌KIT	Eng. D4F712	TBK315	
				⚡	Eng. D4F712	MVB905R4	4PK905
1.4 (B/CB0C)	E7J 780	55	09/98 → 05/05	⚙	→01/00	MVB1035R3	3PK1035
				⚙	A/C(-), →05/01	MVB1110R5	5PK1110
				⚙	A/C(+), →05/01	MVB1750R5	5PK1750
				⚙	A/C(+), →05/01	MVB1755R6	6PK1755
				🔌	→05/01	TB529	96x17
				🔌KIT	→05/01	TBK096	
				⚡	A/C(-), →01/00	MVB995R4	4PK995
		⚡	A/C(+), →01/00	MVB1238R4	4PK1238		
1.4 16V (B/CB0L)	K4J 712, K4J 713	70	10/99 → 08/00	⚙	A/C(-), 02/00 →	MVB1110R5	5PK1110
				🔌	02/00 →	TB636	132x27
				🔌KIT	02/00 →	TBK267	
1.4 16V (B/CB0P)	K4J 700, K4J 712, K4J 713	72	08/00 →	⚙	A/C(-)	MVB1110R5	5PK1110
				⚙	A/C(+), 04/04 →	MVB1200R5	5PK1200
				⚙	A/C(+), 06/01 →08/04	MVB1750R5	5PK1750
				🔌		TB636	132x27
				🔌KIT		TBK267	
				⚡	A/C(-)	MVB1135R5	5PK1135
1.5 dCi	K9K 712	74	01/04 →	⚙	A/C(+), →01/05	MVB1200R5	5PK1200
				⚙	A/C(+), 01/05 →	MVB1200R6	6PK1200
				🔌		TB713	123x27
				🔌KIT		TBK301	
1.5 dCi (B/CB07)	K9K 700, K9K 704	48	06/01 →	⚙	A/C(-)	MVB1135R5	5PK1135
				⚙	A/C(-), 08/04 →	MVB1200R6	6PK1200
				⚙	A/C(+)	MVB1200R5	5PK1200
				🔌		TB713	123x27
				🔌KIT	→08/03	TBK273	
				🔌KIT	08/03 →	TBK301	



kw



RENAULT

...RENAULT

...CLIO II (BBO/1/2_, CBO/1/2_)

1.5 dCi (B/CB08)	K9K 702	60	06/01 →		A/C(-)	MVB1135R5	5PK1135
					A/C(+), →01/05	MVB1200R5	5PK1200
					A/C(+), 01/05→	MVB1200R6	6PK1200
						TB713	123x27
					→08/03	TBK273	
					08/03→	TBK301	
1.6 (B/CB0D)	K7M 744, K7M 745	66	09/98 → 05/05		→01/00	MVB1035R3	3PK1035
					Eng. K7M746, A/C(-), →05/01	MVB1110R5	5PK1110
					Eng. K7M746, A/C(+), →05/01	MVB1755R6	6PK1755
					→05/01	TB529	96x17
					→05/01	TBK096	
					A/C(-), →01/00	MVB995R4	4PK995
					A/C(+), →01/00	MVB1238R4	4PK1238
1.6 16V (CB0T, CB0H)	K4M 708, K4M 748	79	09/98 →		A/C(+), 04/04→	MVB1200R5	5PK1200
					A/C(+), 06/01→04/02	MVB1755R6	6PK1755
					Eng. K4M740, A/C(-), 03/99→	MVB1110R5	5PK1110
					Eng. K4M740, A/C(+), 03/99→	MVB1750R5	5PK1750
					03/99→	TB636	132x27
					Eng. K4M740, 03/99→	TBK267	
1.9 D (B/CB0E)	F8Q 630	47	09/98 → 05/05		A/C(-), MS, →05/01	MVB890R6	6PK890
					A/C(-), PS, →05/01	MVB1400R6	6PK1400
					A/C(+), →05/01	MVB1190R6	6PK1190
					→05/01	TB735	151x25.4
					→05/01	TBK280	
1.9 dTi (B/CB0U)	F9Q 780	59	02/00 → 05/05		A/C(-)	MVB1130R6	6PK1130
					A/C(+)	MVB1215R6	6PK1215
						TB654	153x26
2.0 16V Sport	F4R 738	132	01/04 →		A/C(-)	MVB1130R6	6PK1130
					A/C(+)	MVB1660R6	6PK1660
						TB644	128x27
2.0 16V Sport (CB0M)	F4R 730	124	02/00 →		A/C(-)	MVB1130R6	6PK1130
					A/C(+)	MVB1660R6	6PK1660
						TB644	128x27
3.0 V6 Sport (CB1A)	L7X 760	166	11/00 → 12/02		06/01→	MVB1580R6	6PK1580
					06/01→	TB727	259x32
3.0 V6 Sport (CB1H, CB2S)	L7X 762	187	12/02 →		→06/04	MVB1580R6	6PK1580
					05/04→	MVB1588R6	6PK1588
						TB727	259x32

CLIO II Box (SB0/1/2_)

1.1 (SB0A)	D7F 720, D7F 722	43	09/98 →		Eng. D7F726, MS, 04/00→	MVB925R4	4PK925
					Eng. D7F726, PS, 04/00→	MVB1540R4	4PK1540
					MS, →04/00	MVB906R5	5PK906
					→04/00	MVB735R4	4PK735
					Eng. D7F726, 04/00→	MVB735R3	3PK735
						TB482	87x17
						TBK092	
					A/C(-), →04/00	MVB875R5	5PK875
					A/C(+), →04/00	MVB1515R5	5PK1515
					Eng. D7F726, 04/00→	MVB905R4	4PK905



kW



...RENAULT

...CLIO II Box (SB0/1/2_)

1.5 dCi	K9K 700, K9K 704	48	06/01 →	⊗	A/C(-)	MVB1135R5	5PK1135
				⊗	A/C(+)	MVB1200R5	5PK1200
						TB713	123x27
				KIT	→08/03	TBK273	
				KIT	08/03 →	TBK301	
		60	11/03 →	⊗	A/C(-)	MVB1135R5	5PK1135
				⊗	A/C(-), 08/04 →	MVB1200R6	6PK1200
				⊗	A/C(+)	MVB1200R5	5PK1200
						TB713	123x27
				KIT		TBK301	
		59	06/01 → 10/04	⊗	A/C(-)	MVB1135R5	5PK1135
				⊗	A/C(+)	MVB1200R5	5PK1200
						TB713	123x27
				KIT	→08/03	TBK273	
				KIT	08/03 →	TBK301	
1.9 D (SB0E)	F8Q 630	47	09/98 →	⊗	A/C(-), MS, →10/03	MVB890R6	6PK890
				⊗	A/C(-), PS, →10/03	MVB1400R6	6PK1400
				⊗	A/C(+), →10/03	MVB1190R6	6PK1190
					→10/03	TB735	151x25.4
				KIT	→10/03	TBK280	
1.9 DTi		59	02/00 → 05/01	⊗	A/C(-)	MVB1130R6	6PK1130
				⊗	A/C(+)	MVB1215R6	6PK1215
						TB654	153x26

CLIO III (BR0/1, CR0/1)

1.2 16V	D4F 740	55	06/05 →	⊗	A/C(-)	MVB880R7	7PK880				
				⊗	A/C(+)	MVB1035R7	7PK1035				
						TB712	95x23.4				
				KIT		TBK315					
				D4F 764	57	06/05 →	⊗	A/C(-)	MVB880R7	7PK880	
							⊗	A/C(+)	MVB1035R7	7PK1035	
							TB712	95x23.4			
				KIT			TBK315				
1.2 16V (C/BR1J, C/BR1Q)		48	06/05 →	⊗	A/C(-)	MVB880R7	7PK880				
				⊗	A/C(+)	MVB1035R7	7PK1035				
						TB712	95x23.4				
				KIT			TBK315				
1.4 16V	K4J 780	72	06/05 →	⊗	A/C(-)	MVB1200R6	6PK1200				
				⊗	A/C(-), →05/06	MVB1135R5	5PK1135				
						TB636	132x27				
				KIT		TBK267					
1.5 dCi	K9K 766	63	06/05 →	⊗		MVB1200R6	6PK1200				
				⊗	A/C(-), →09/05	MVB1135R5	5PK1135				
						TB713	123x27				
				KIT		TBK301					
					K9K 764	78	06/05 →	⊗	A/C(-), →09/05	MVB1135R5	5PK1135
								⊗	A/C(+)	MVB1200R6	6PK1200
								TB713	123x27		
					KIT			TBK301			
		76	06/05 →	⊗	08/06 →10/07	MVB1200R6	6PK1200				
					08/06 →10/07	TB713	123x27				
				KIT	08/06 →10/07	TBK301					
				⊗	→09/05	MVB1135R5	5PK1135				
		47	06/05 →	⊗	A/C(+), →10/07	MVB1200R6	6PK1200				
					→10/07	TB713	123x27				
				KIT	→10/07	TBK301					
				⊗							
1.5 dCi (C/BR1G)	K9K 768	50	06/05 →	⊗	A/C(-), →09/05	MVB1135R5	5PK1135				
				⊗	A/C(+)	MVB1200R6	6PK1200				
						TB713	123x27				
				KIT		TBK301					



kW



RENAULT

...RENAULT

...CLIO III (BR0/1, CR0/1)

1.6 16V	K4M 804	65	06/05 →		A/C(-)	MVB1135R5	5PK1135
					A/C(+)	MVB1200R6	6PK1200
						TB636	132x27
	K4M 800, K4M 801	82	06/05 →		A/C(-), →05/06	MVB1135R5	5PK1135
					A/C(-), →10/07	MVB1200R6	6PK1200
					→10/07	TB636	132x27
2.0 16V		102	09/06 →			MVB1215R6	6PK1215
2.0 16V Sport	F4R 830	145	02/06 →			TB652	126x27

ESPACE I (J11_)

2.0 (J/S112)	J6R 234, J6R 236	80	07/84 → 12/90			SVB101000	10x1000
						TB421	116x19
						TBK281	
						SVB13825	13x825
	J6R 734	74	01/88 → 12/90			SVB101000	10x1000
						TB421	116x19
						TBK281	
						SVB13825	13x825
2.0 i (J116)	J7R 760	87	01/89 → 12/90			MVB875R4	4PK875
						SVB101000	10x1000
						TB421	116x19
						TBK281	
						SVB13825	13x825
2.0 i Quadra (J116)	J7R 760	87	03/88 → 12/92		→12/90	MVB875R4	4PK875
					→12/90	SVB101000	10x1000
					→12/90	TB421	116x19
					→12/90	TBK281	
					→12/90	SVB13825	13x825
2.1 TD (J/S115)	J8S 240, J8S 774	65	10/84 → 12/90		Eng. J8S240	SVB121030	12x1030
						TB156	148x25.4
						TBK123	
					Eng. J8S240, incl. guide pulley		
					Eng. J8S240, Manu Tensioner	TBK117	
					Eng. J8S240	SVB13825	13x825
2.2 (J117)	J7T 770	79	07/86 → 12/90			MVB875R4	4PK875
						SVB101000	10x1000
						TB422	118x19
						TBK282	
						SVB13825	13x825
2.2 Quadra (J117)	J7T 770	79	01/88 → 12/90			MVB875R4	4PK875
						SVB101000	10x1000
						TB422	118x19
						TBK282	
						SVB13825	13x825

ESPACE II (J/S63_)

2.0 (J636)	J7R 768	76	01/91 → 10/96			MVB875R4	4PK875
						SVB101000	10x1000
						TB421	116x19
						SVB12760	12x760
2.1 TD (J633, J634, J/S635, J/S63D)	J8S 610, J8S 772, J8S 776, J8S 778	65	01/91 → 10/96			MVB875R4	4PK875
						SVB121030	12x1030
						TB156	148x25.4
						TBK123	
					incl. guide pulley	TBK117	
					Manu Tensioner	SVB12760	12x760
2.1 TD (J63E)	J8S 612	66	11/94 → 10/96			MVB875R4	4PK875
						SVB121030	12x1030
						TB156	148x25.4
						TBK123	
					incl. guide pulley	TBK117	
					Manu Tensioner	SVB12760	12x760



kW



...RENAULT

...ESPACE II (J/S63_)

2.2 (J/S637, J63G)	J7T 772, J7T 773, J7T 776	79	01/91 → 10/96	 	Eng. J7T772	MVB875R4 SVB101000 TB422 SVB12760	4PK875 10x1000 118x19 12x760
2.2 4x4 (J/S637, J63G)	J7T 772, J7T 773	79	03/91 → 12/96	 	Eng. J7T772	MVB875R4 SVB101000 TB422 SVB12760	4PK875 10x1000 118x19 12x760
2.8 V6 (J638, J63J)	Z7W 712, Z7W 713, Z7W 717	110	01/91 → 10/96	 	A/C(+)	SVB13925 SVB13725	13x925 13x725

ESPACE III (JEO_)

1.9 dTi (JEO0)	F9Q 722	72	02/99 → 10/02	 	A/C(-), →08/01 A/C(+), →03/01 A/C(+), 03/01 →08/01 →10/00 10/00 →08/01 →10/00, check kit comp. →10/00, check kit comp. 10/00 →08/01	MVB1137R6 MVB1642R6 MVB1600R6 TB546 TB654 TBK099 TBK114 TBK323	6PK1137 6PK1642 6PK1600 153x26 153x26
2.0	F4R 700, F4R 701	102	09/01 → 10/02	 	A/C(-) A/C(+)	MVB1120R5 MVB1750R5 TB644	5PK1120 5PK1750 128x27
2.0 (JEOA)	F3R 728, F3R 729, F3R 742, F3R 768, F3R 769	84	11/96 → 10/00	 	A/C(-), →01/00 A/C(+), →01/00 →01/00	MVB1125R6 MVB1660R6 TB431	6PK1125 6PK1660 127x19
2.0 16V (JEO0, JEO1, JEO2)	F4R 700, F4R 701	103	10/98 → 10/02	 	A/C(-) A/C(+)	MVB1120R5 MVB1750R5 TB644	5PK1120 5PK1750 128x27
2.2 12V TD (JEOE, JEOH, JEOP)	G8T 714, G8T 716	83	11/96 → 10/00	 	A/C(-), →01/00 A/C(+), →01/00 →01/00 →01/00	MVB1015R6 MVB1950R6 TB489 TBK090	6PK1015 6PK1950 163x25.4
2.2 D		84	11/97 → 01/00	 	A/C(-) A/C(+)	MVB1015R6 MVB1950R6 TB489 TBK090	6PK1015 6PK1950 163x25.4
2.2 dCi (JEOK, JEOS)	G9T 710	95	10/00 → 10/02	 		MVB1775R6 TB710	6PK1775 89x25
3.0 (JEO0)	Z7X 775	123	11/96 → 10/98	 	A/C(-) A/C(+)	MVB960R4 MVB1375R5 MVB650R5	4PK960 5PK1375 5PK650
3.0 V6 24V (JEOG, JEOR)	L7X 727	140	10/98 → 10/02	 	A/C(+)	MVB1600R6 TB727	6PK1600 259x32

ESPACE IV (JK0/1_)

1.9 dCi	F9Q 820	85	04/03 → 02/05	 		MVB1785R7 TB653 TBK275	7PK1785 132x26
1.9 dCi (JKOU, JKOG)	F9Q 680, F9Q 820, F9Q 826	88	11/02 →	 	Eng. F9Q820	MVB1785R7 TB653 TBK275	7PK1785 132x26
2.0		125	04/05 →	 		MVB1785R7 TB652	7PK1785 126x27
		98	11/02 → 02/05	 		MVB1785R7 TB652	7PK1785 126x27
2.0 (JKOKA6)	F4R 790, F4R 791	100	11/02 →	 		MVB1785R7 TB652	7PK1785 126x27
2.0 dCi	M9R 740	110	01/06 →	 		MVB1969R7	7PK1969
	M9R 760	127	01/06 →	 		MVB1969R7	7PK1969
		96	01/06 →	 		MVB1969R7	7PK1969
2.0 Turbo (JKOBA6, JKOBC6, JKOBAB, JKOBCB)	F4R 794, F4R 795, F4R 797	120	11/02 →	 	→02/05 →02/05	MVB1785R7 TB652	7PK1785 126x27



kW



RENAULT

...RENAULT

...ESPACE IV (JK0/1_)

2.2 dCi		102	02/06 →			MVB1775R7	7PK1775
2.2 dCi (JK0HA6, JK0HC6, JK0HAB, JK0HCB)	G9T 742, G9T 743	110	11/02 →		→08/06	MVB1775R7	7PK1775
					→08/06	TB710	89x25
3.0 dCi		133	01/06 →			TB750	116x25
3.0 dCi (JK0JAB, JK0JCB)	P9X 701	130	11/02 →		→08/06	MVB1920R6	6PK1920
					→08/06	TB750	116x25
3.5 V6 (JK0FAB, JK0FCB)	V4Y 711	177	11/02 →			MVB775R4	4PK775
						MVB1100R6	6PK1100

FUEGO (136_)

1.4 TL/GTL	847 720	47	02/80 → 10/85			SVB101300	10x1300
1.6 TS/GTS (1362)	843 723, 843 724, A6M 725, A6M 726	71	10/80 → 10/85			SVB13850	13x850
						SVB101010	10x1010
					A/C(-)	SVB10825	10x825
					A/C(+)	SVB10625	10x625
1.6 Turbo (1365)	A5L 750	97	08/83 → 10/85			SVB101010	10x1010
						SVB10825	10x825
2.0 TX/GTX (1363)	829 710, J6R 710, J6R 712, J6R 713, J6R 715, J6R 726	81	10/80 → 10/85		10/81 →	SVB13875	13x875
					10/81 →	SVB101010	10x1010
					10/81 →	TB114	116x19
					10/81 →	TBK015	
					A/C(-), 10/81 →	SVB10800	10x800
					A/C(+), 10/81 →	SVB12760	12x760
2.1 TD	J8S 712	65	08/82 → 10/85			SVB101010	10x1010
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB13825	13x825

GRAND SCENIC (JMO/1_)

1.5 dCi	K9K 728, K9K 729	74	04/04 →		A/C(-), →09/05	MVB1135R5	5PK1135
					A/C(-), 01/05 →	MVB1200R6	6PK1200
					A/C(+), →01/05	MVB1200R5	5PK1200
						TB713	123x27
						TBK301	
1.6	K4M 761, K4M 782	83	04/04 →		06/06 →	MVB1200R6	6PK1200
					A/C(-)	MVB1135R5	5PK1135
					A/C(+)	MVB1200R5	5PK1200
						TB636	132x27
					Eng. K4M788, 06/06 →	TBK267	
1.9 dCi	F9Q 812	88	04/04 →			MVB1125R7	7PK1125
						TB756	133x26
						TBK322	
		81	05/05 →			MVB1125R7	7PK1125
						TB756	133x26
						TBK322	
		96	05/05 →			MVB1125R7	7PK1125
						TB756	133x26
						TBK322	
2.0	F4R 770, F4R 771	99	04/04 →			MVB1125R7	7PK1125
						TB652	126x27
	F4R 776	120	04/04 →			MVB1125R7	7PK1125
						TB652	126x27

KANGOO

1.9 RXED		48	09/99 → 06/01		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1400R6	6PK1400
					A/C(+)	MVB1190R6	6PK1190
						TB735	151x25.4
						TBK097	
						TBK280	



kW



...RENAULT

KANGOO (KC0/1_)

1.2 (KC0A, KC0K, KC0F, KC01)	D7F 710, D7F 720, D7F 722, D7F 726, D7F 744, D7F 746	43	03/98 →	⚙️	Eng. D4D700, MS, 04/00→09/07	MVB925R4	4PK925
				⚙️	Eng. D4D700, PS, 04/00→09/07	MVB1540R4	4PK1540
				⚙️	MS, →04/00	MVB906R5	5PK906
				⚙️	PS, →04/00	MVB1515R5	5PK1515
				⚙️	→04/00	MVB735R4	4PK735
				⚙️	Eng. D4D700, 07/98→09/07	MVB735R3	3PK735
				⚙️	→06/03	TB482	87x17
				⚙️	07/03→09/07	TB712	95x23.4
				⚙️	→06/03	TBK092	
				⚙️	Eng. D4D700, 07/03→09/07	TBK315	
				⚙️	→04/00	MVB875R5	5PK875
				1.2 16V (KC03, KC05, KC06, KC0T, KC0W)	D4F 712, D4F 714, D4F 716	55	06/01 →
⚙️	PS, →09/07	MVB1540R4	4PK1540				
⚙️	→09/07	MVB735R3	3PK735				
⚙️	→09/07	TB712	95x23.4				
⚙️	→09/07	TBK315					
1.4 (KC0C, KC0H, KC0B, KC0M)	E7J 634, E7J 635, E7J 780, K7J 700, K7J 701	55	03/98 →	⚙️	A/C(-), 07/98→09/07	MVB1110R5	5PK1110
				⚙️	A/C(+), 07/98→06/01	MVB1755R6	6PK1755
				⚙️	A/C(+), 09/99→09/07	MVB1750R5	5PK1750
				⚙️	Eng. E7J780, →06/01	MVB1035R3	3PK1035
				⚙️	→09/07	TB529	96x17
				⚙️	→09/07	TBK096	
				⚙️	A/C(-), →06/01	MVB995R4	4PK995
1.5 dCi		42	07/03 →	⚙️	Eng. E7J780, A/C(+), →06/01	MVB1238R4	4PK1238
				⚙️	A/C(-)	MVB1135R5	5PK1135
				⚙️	A/C(+)	MVB1200R5	5PK1200
				⚙️	→08/03	TB713	123x27
1.5 dCi (KC07)	K9K 700, K9K 704	48	12/01 →	⚙️	→08/03	TBK273	
				⚙️	08/03→	TBK301	
				⚙️	A/C(-)	MVB1135R5	5PK1135
				⚙️	A/C(+)	MVB1200R5	5PK1200
1.5 dCi (KC08, KC09)	K9K 702, K9K 710	60	07/02 →	⚙️	→08/03	TB713	123x27
				⚙️	08/03→	TBK273	
				⚙️	08/03→	TBK301	
				⚙️	A/C(-), 07/03→	MVB1135R5	5PK1135
1.6 16V	K4M 750, K4M 752, K4M 753	70	06/01 →	⚙️	A/C(+), 07/03→	MVB1200R5	5PK1200
				⚙️	07/03→	TB713	123x27
				⚙️	07/03→08/03	TBK273	
				⚙️	08/03→	TBK301	
1.6 16V 4x4 (KC0P, KC0S, KC0L)	K4M 750, K4M 752, K4M 753	70	10/01 →	⚙️	Eng. K4M730, A/C(-)	MVB1110R5	5PK1110
				⚙️	Eng. K4M730, A/C(+)	MVB1750R5	5PK1750
				⚙️	Eng. K4M730	TB636	132x27
				⚙️		TBK267	
1.6 16V bivalent		60	06/05 →	⚙️	Eng. K4M750, A/C(-)	MVB1110R5	5PK1110
				⚙️	Eng. K4M750, A/C(+)	MVB1750R5	5PK1750
				⚙️		TB636	132x27
				⚙️	Eng. K4M750	TBK267	
1.9 dCi 4x4		62	10/03 →	⚙️	A/C(-)	MVB1110R5	5PK1110
				⚙️	A/C(+)	MVB1750R5	5PK1750
				⚙️		TB636	132x27
				⚙️		TBK267	
1.9 dCi 4x4 (KC0V)	F9Q 782, F9Q 790	59	10/01 →	⚙️	A/C(-), →09/07	MVB1130R6	6PK1130
				⚙️	A/C(+), →09/07	MVB1215R6	6PK1215
				⚙️	→09/07	TB546	153x26
				⚙️	→09/07, check kit comp.	TBK099	
1.9 dCi 4x4 (KC0V)	F9Q 782, F9Q 790	59	10/01 →	⚙️	→09/07, check kit comp.	TBK114	
				⚙️	A/C(-), →06/03	MVB1130R6	6PK1130
				⚙️	A/C(+), →06/03	MVB1215R6	6PK1215
				⚙️	→06/03	TB654	153x26



kw



RENAULT

...RENAULT

...KANGOO (KC0/1_)

1.9 dTi (KC0U)	F9Q 780	59	02/00 →		A/C(-), →09/07	MVB1130R6	6PK1130
					A/C(+), →09/07	MVB1215R6	6PK1215
					→06/03	TB654	153x26
					07/03→09/07	TB546	153x26
					07/03→09/07, check kit comp.	TBK099	
					07/03→09/07, check kit comp.	TBK114	
D 55 1.9 (KC0D)	F8Q 662	40	03/98 →		A/C(-), MS, →10/03	MVB890R6	6PK890
					A/C(-), PS, →10/03	MVB1400R6	6PK1400
					A/C(+), →10/03	MVB1190R6	6PK1190
					→10/03	TB735	151x25.4
					→10/03	TBK280	
D 65 1.9 (KCOE, KC02, KC0J, KCON)	F8Q 630, F8Q 632	47	03/98 →		A/C(-), MS, →10/03	MVB890R6	6PK890
					A/C(-), PS, →10/03	MVB1400R6	6PK1400
					A/C(+), →10/03	MVB1190R6	6PK1190
					→10/03	TB735	151x25.4
					→10/03	TBK280	

KANGOO Express (FC0/1_)

1.2 (FC01, FCOA, FCOF)	D7F 710, D7F 720, D7F 722, D7F 726, D7F 744, D7F 746	43	03/98 →		Eng. D4D720, MS, 04/00→06/08	MVB925R4	4PK925
					Eng. D4D720, PS, 04/00→06/08	MVB1540R4	4PK1540
					Eng. D7D700, MS, →04/00	MVB906R5	5PK906
					Eng. D7F726, PS, →04/00	MVB1515R5	5PK1515
					Eng. D4D720, 04/00→06/08	MVB735R3	3PK735
					Eng. D7D700, →04/00	MVB735R4	4PK735
					→06/03	TB482	87x17
					07/03→06/08	TB712	95x23.4
					→06/03	TBK092	
					Eng. D4D720, 07/03→06/08	TBK315	
					Eng. D4D720, 04/00→06/08	MVB905R4	4PK905
					Eng. D7F726, →04/00	MVB875R5	5PK875
1.2 16V (FC05)	D4F 712, D4F 714	55	10/01 →		Eng. D4F730, →06/08	MVB925R4	4PK925
					Eng. D4F730, A/C(-), MS, →06/08	MVB735R3	3PK735
					Eng. D4F730, A/C(+), PS, →06/08	MVB1540R4	4PK1540
					→06/08	TB712	95x23.4
					Eng. D4F730, →06/08	TBK315	
					Eng. D4F712, →06/08	MVB905R4	4PK905
1.4 (FC0C, FC0B, FCOH, FCOM)	E7J 634, E7J 635, E7J 780, K7J 701	55	03/98 →		A/C(-), →06/08	MVB1110R5	5PK1110
					A/C(+), →06/08	MVB1750R5	5PK1750
					A/C(+), 07/98→07/01	MVB1755R6	6PK1755
					Eng. E7J780, →06/01	MVB1035R3	3PK1035
					→06/08	TB529	96x17
					→06/08	TBK096	
					A/C(-), →06/01	MVB995R4	4PK995
					Eng. E7J780, A/C(+), →06/01	MVB1238R4	4PK1238
1.5 dCi		42	12/02 →		A/C(-)	MVB1135R5	5PK1135
					A/C(+)	MVB1200R5	5PK1200
						TB713	123x27
					→08/03	TBK273	
					08/03→	TBK301	
1.5 dCi (FC07)	K9K 700	48	12/01 →		A/C(-)	MVB1135R5	5PK1135
					A/C(+)	MVB1200R5	5PK1200
						TB713	123x27
					→08/03	TBK273	
					08/03→	TBK301	
1.5 dCi (FC08, FC09)	K9K 702, K9K 710	60	04/03 →		A/C(-)	MVB1135R5	5PK1135
					A/C(+)	MVB1200R5	5PK1200
						TB713	123x27
					→08/03	TBK273	
					08/03→	TBK301	



kW



...RENAULT

...KANGOO Express (FC0/1_)

1.6 16V	K4M 752	70	10/01 →		A/C(-)	MVB1110R5	5PK1110
					A/C(+)	MVB1750R5	5PK1750
						TB636	132x27
						TBK267	
1.6 16V 4x4 (FCOL, FCOP, FCOS)	K4M 750, K4M 752, K4M 753	70	10/01 →		A/C(-)	MVB1110R5	5PK1110
					A/C(+)	MVB1750R5	5PK1750
						TB636	132x27
						TBK267	
1.9 dCi		62	07/03 →		A/C(-), →06/08	MVB1130R6	6PK1130
					A/C(+), →06/08	MVB1215R6	6PK1215
					→06/08	TB546	153x26
					→06/08, check kit comp.	TBK099	
					→06/08, check kit comp.	TBK114	
1.9 dCi 4x4		62	07/03 →		A/C(-), →06/08	MVB1130R6	6PK1130
					A/C(+), →06/08	MVB1215R6	6PK1215
					→06/08	TB546	153x26
					→06/08, check kit comp.	TBK099	
					→06/08, check kit comp.	TBK114	
1.9 dCi 4x4 (FCOV)	F9Q 782, F9Q 790	59	10/01 →		Eng. F9Q790, A/C(-), →06/08	MVB1130R6	6PK1130
					Eng. F9Q790, A/C(+), →06/08	MVB1215R6	6PK1215
					→06/08	TB546	153x26
					Eng. F9Q790, →06/08, check kit comp.	TBK099	
					Eng. F9Q790, →06/08, check kit comp.	TBK114	
1.9 dTi (FCOU)	F9Q 780, F9Q 782	59	02/00 →		Eng. F9Q782, A/C(-), →06/03	MVB1130R6	6PK1130
					Eng. F9Q782, A/C(+), →06/03	MVB1215R6	6PK1215
					→06/03	TB654	153x26
D 55 1.9 (FCOD)	F8Q 662	40	03/98 →		A/C(-), MS, →10/03	MVB890R6	6PK890
					A/C(-), PS, →10/03	MVB1400R6	6PK1400
					A/C(+), →10/03	MVB1190R6	6PK1190
					→10/03	TB735	151x25.4
					→10/03	TBK280	
D 65 1.9 (FCOE, FC02, FC0J, FCON)	F8Q 630, F8Q 632	47	03/98 →		A/C(-), MS, →10/02	MVB890R6	6PK890
					A/C(-), PS, →10/02	MVB1400R6	6PK1400
					A/C(+), →10/02	MVB1190R6	6PK1190
					→10/02	TB735	151x25.4
					→12/01	TBK280	

LAGUNA (B56_, 556_)

1.6 16V (B568, B561)	K4M 720, K4M 724	79	11/97 → 03/01		A/C(-), 07/98 →	MVB1110R5	5PK1110
					A/C(+), 07/98 →	MVB1750R5	5PK1750
					07/98 →	TB636	132x27
					07/98 →	TBK267	
1.8 (B56A/B)	F3P 720, F3P 724	66	11/93 → 03/01		A/C(-), Auto Tensioner	MVB1428R6	6PK1428
					A/C(-), Manu Tensioner	MVB1125R6	6PK1125
					A/C(+)	MVB1660R6	6PK1660
						TB256	125x19
						TBK017	
1.8 (B56S/T/0)	F3P 670, F3P 678	66	08/95 → 03/01		A/C(-), Auto Tensioner	MVB1428R6	6PK1428
					A/C(-), Manu Tensioner	MVB1125R6	6PK1125
					A/C(+)	MVB1660R6	6PK1660
						TB256	125x19
						TBK017	
1.8 (B56Z)	F3P 720, F3P 724	69	08/95 → 03/01		A/C(-), Auto Tensioner	MVB1428R6	6PK1428
					A/C(-), Manu Tensioner	MVB1125R6	6PK1125
					A/C(+)	MVB1660R6	6PK1660
						TB256	125x19
						TBK017	
1.8 16V (B563, B564)	F4P 760	88	04/98 → 03/01		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1750R5	5PK1750
						TB644	128x27



kw



RENAULT

...RENAULT

...LAGUNA (B56_, 556_)

1.9 dCi (B56W)	F9Q 718	79	09/99 → 03/01			MVB1795R6	6PK1795
						TB653	132x26
						TBK275	
1.9 dTi (B56J)	F9Q 710, F9Q 716	72	10/97 → 03/01		Eng. F9Q717, A/C(-), 07/98→	MVB1137R6	6PK1137
					Eng. F9Q717, A/C(+), 07/98→	MVB1642R6	6PK1642
					07/98→10/00	TB546	153x26
					09/99→	TB654	153x26
					07/98→10/00, check kit comp.	TBK099	
					07/98→10/00, check kit comp.	TBK114	
					10/00→	TBK323	
2.0		70	11/93 → 03/01		A/C(-), Auto Tensioner	MVB1428R6	6PK1428
					A/C(-), Manu Tensioner	MVB1125R6	6PK1125
					A/C(+)	MVB1660R6	6PK1660
						TB256	125x19
						TBK017	
		80	03/99 → 03/01		A/C(-), Auto Tensioner	MVB1428R6	6PK1428
					A/C(-), Manu Tensioner	MVB1125R6	6PK1125
					A/C(+)	MVB1660R6	6PK1660
						TB431	127x19
2.0 (B56C/H/N)	F3R 722, F3R 723	83	11/93 → 03/01		A/C(-), Auto Tensioner	MVB1428R6	6PK1428
					A/C(-), Manu Tensioner	MVB1125R6	6PK1125
					A/C(+)	MVB1660R6	6PK1660
						TB431	127x19
2.0 16V (556A/B)	F4R 780	103	09/99 → 03/01			MVB1750R5	5PK1750
						TB644	128x27
2.0 16V (B56D/M)	N7Q 700, N7Q 704	102	06/95 → 03/01		Eng. N7Q700, A/C(-)	MVB1238R6	6PK1238
					Eng. N7Q700, A/C(+)	MVB1600R6	6PK1600
					→06/98	TB434	148x23
					12/97→	TB643	142x23
2.2 D (B56F/2)	G8T 706, G8T 752, G8T 790, G8T 794	61	11/93 → 03/01		A/C(+), →06/98	MVB1950R6	6PK1950
					Eng. G8T706, →06/98	MVB1685R6	6PK1685
					Eng. G8T752, A/C(-), →06/98	MVB1015R6	6PK1015
					→06/98	TB437	157x25.4
					→06/98	TB489	163x25.4
					Eng. G8T752, →06/98	TBK090	
					A/C(-), 04/94→06/98	TB516	107x18
					A/C(+), 04/94→06/98	TB516	107x18
2.2 dT (B569)	G8T 760	83	03/96 → 03/01		A/C(-)	MVB1015R6	6PK1015
					A/C(+)	MVB1950R6	6PK1950
						TB489	163x25.4
						TBK090	
3.0 (B56E/R, B565)	Z7X 760, Z7X 765	123	11/93 → 03/01		A/C(-), →06/98	MVB960R4	4PK960
					A/C(+), →06/98	MVB1375R5	5PK1375
					→06/98	MVB650R5	5PK650
					→06/98	MVB775R5	5PK775
3.0 24V (B56V)	L7X 700, L7X 701	140	03/97 → 03/01		A/C(+)	MVB1600R6	6PK1600
						TB727	259x32

LAGUNA Grandtour (K56_)

1.6 16V (K568)	K4M 720, K4M 724	79	11/97 → 03/01		A/C(-), 07/98→	MVB1110R5	5PK1110
					A/C(+), 07/98→	MVB1750R5	5PK1750
					07/98→	TB636	132x27
					07/98→	TBK267	
1.8 (K56S/T/O)	F3P 670, F3P 678	66	09/95 → 03/01		A/C(-), Auto Tensioner	MVB1428R6	6PK1428
					A/C(-), Manu Tensioner	MVB1125R6	6PK1125
					A/C(+)	MVB1660R6	6PK1660
						TB256	125x19
						TBK017	
1.8 (K56Z)	F3P 720, F3P 724	69	09/95 → 03/01		A/C(-), Auto Tensioner	MVB1428R6	6PK1428
					A/C(-), Manu Tensioner	MVB1125R6	6PK1125
					A/C(+)	MVB1660R6	6PK1660
						TB256	125x19
						TBK017	



kW



...RENAULT

...LAGUNA Grandtour (K56_)

1.8 16V (K563, K564)	F4P 760	88	04/98 → 03/01	⊗	A/C(-)	MVB1120R5	5PK1120
				⊗	A/C(+)	MVB1750R5	5PK1750
				⊗		TB644	128x27
1.9 dCi (K56W)	F9Q 718	79	09/99 → 03/01	⊗		MVB1795R6	6PK1795
				⊗		TB653	132x26
				⊗		TBK275	
1.9 dTi (K56J)	F9Q 710, F9Q 716	72	10/97 → 03/01	⊗	Eng. F9Q717, A/C(-), 07/98 →	MVB1137R6	6PK1137
				⊗	Eng. F9Q717, A/C(+), 07/98 →	MVB1642R6	6PK1642
				⊗	07/98 → 10/00	TB546	153x26
				⊗	09/99 →	TB654	153x26
				⊗	07/98 → 10/00, check kit comp.	TBK099	
				⊗	07/98 → 10/00, check kit comp.	TBK114	
				⊗	10/00 →	TBK323	
2.0 (K56C/H)	F3R 722, F3R 723	83	09/95 → 03/01	⊗	A/C(-)	MVB1125R6	6PK1125
				⊗	A/C(-), Auto Tensioner,	MVB1428R6	6PK1428
				⊗	→ 10/95		
				⊗	A/C(+)	MVB1660R6	6PK1660
				⊗		TB431	127x19
2.0 16V (A56A/B)	F4R 780	103	09/99 → 03/01	⊗		MVB1750R5	5PK1750
				⊗		TB644	128x27
2.0 16V (K56D/M)	N7Q 700, N7Q 704	102	09/95 → 03/01	⊗	Eng. N7Q700, A/C(-)	MVB1238R6	6PK1238
				⊗	Eng. N7Q700, A/C(+)	MVB1600R6	6PK1600
				⊗	→ 06/98	TB434	148x23
				⊗	12/97 →	TB643	142x23
2.2 D (K56F/2, S56F)	G8T 706, G8T 752, G8T 790, G8T 794	61	09/95 → 03/01	⊗		MVB1685R6	6PK1685
				⊗	Eng. G8T794, A/C(-), → 11/99	MVB1015R6	6PK1015
				⊗	Eng. G8T794, A/C(+), → 11/99	MVB1950R6	6PK1950
				⊗		TB437	157x25.4
				⊗	→ 11/99	TB489	163x25.4
				⊗	Eng. G8T794, → 11/99	TBK090	
				⊗	A/C(-)	TB516	107x18
				⊗	A/C(+)	TB516	107x18
2.2 dT (K569)	G8T 760	83	03/96 → 03/01	⊗	A/C(-), → 11/99	MVB1015R6	6PK1015
				⊗	A/C(+), → 11/99	MVB1950R6	6PK1950
				⊗	→ 11/99	TB489	163x25.4
				⊗	→ 11/99	TBK090	
3.0 (K56R, K565)	Z7X 765	123	02/96 → 03/01	⊗	A/C(-), → 06/98	MVB960R4	4PK960
				⊗	A/C(+), → 06/98	MVB1375R5	5PK1375
				⊗	→ 06/98	MVB650R5	5PK650
				⊗	→ 06/98	MVB775R5	5PK775
3.0 24V (K56V)	L7X 700, L7X 701	140	03/97 → 03/01	⊗		MVB1600R6	6PK1600
				⊗		TB727	259x32

LAGUNA II (BG0/1_)

1.6 16V		82	02/05 →	⊗		MVB1820R6	6PK1820
				⊗		TB636	132x27
1.6 16V (BG0A, BG0L)	K4M 710, K4M 711	79	03/01 →	⊗	08/04 →	MVB1820R6	6PK1820
				⊗	A/C(-), → 05/05	MVB1110R5	5PK1110
				⊗	A/C(+), → 05/05	MVB1750R5	5PK1750
				⊗		TB636	132x27
				⊗		TBK267	
1.8 16V (BG06, BG0J, BG0M)	F4P 770, F4P 771, F4P 773, F4P 774, F4P 775	85	03/01 →	⊗	→ 05/05	MVB1805R6	6PK1805
				⊗	Eng. F4P773, → 05/05	MVB1795R6	6PK1795
				⊗		TB652	126x27
1.8 16V (BG0B, BG0M)	F4P 770, F4P 773	88	03/01 →	⊗	→ 05/05	MVB1805R6	6PK1805
				⊗	→ 05/05	TB652	126x27
1.8 16V (BG0C, BG0V)	F4P 770, F4P 774	89	03/01 →	⊗	→ 05/05	MVB1805R6	6PK1805
				⊗	→ 05/05	TB652	126x27



kW



RENAULT

...RENAULT

...LAGUNA II (BG0/1_)

1.9 dCi	F9Q 664	68	03/04 →		→05/05	MVB1788R7	7PK1788
					→05/05	TB756	133x26
		81	01/05 →		→05/05	TBK322	
					→05/05		
	F9Q 758, F9Q 759	96	05/05 →		→08/07	MVB1788R7	7PK1788
					→08/07	TB756	133x26
					→08/07	TBK322	
		79	03/01 →		09/01→10/03	MVB1788R7	7PK1788
					09/01→12/04	MVB1795R6	6PK1795
					09/01→10/03	TB653	132x26
					09/01→10/03	TBK275	
1.9 dCi (BG0E)		77	06/01 →		A/C(-), →05/05	MVB1120R5	5PK1120
					A/C(+), →05/05	MVB1795R6	6PK1795
					→05/05	TB653	132x26
					→05/05	TBK275	
1.9 dCi (BG0G)	F9Q 750, F9Q 756	88	03/01 →		→10/03	MVB1795R6	6PK1795
					06/03→12/04	MVB1788R7	7PK1788
					→12/04	TB653	132x26
		74	10/01 →		Eng. F9Q670, →12/04	TBK275	
					→05/05	MVB1795R6	6PK1795
					→05/05	TB653	132x26
2.0 16V		125	01/05 →		→05/05	MVB1795R6	6PK1795
					→05/05	TB653	132x26
					→05/05	TBK275	
2.0 16V (BG00, BG0K, BG0P, BG0W)	F4R 712, F4R 713, F4R 714, F4R 715	99	08/02 →		→10/03	MVB1788R7	7PK1788
					06/03→12/04	MVB1795R6	6PK1795
					→12/04	TB653	132x26
2.0 16V IDE (BG0N)	F5R 700	103	04/01 →		Eng. F9Q670, →12/04	TBK275	
					→05/05	MVB1795R6	6PK1795
					→05/05	TB653	132x26
2.0 16V Turbo (BG0S, BG0Z, BG1L, BG1M)	F4R 764, F4R 765, F4R 786, F4R 787	120	01/03 →		→05/05	MVB1795R6	6PK1795
					→05/05	MVB1788R7	7PK1788
					→05/05	TB652	126x27
2.0 dCi	M9R 740	110	08/05 →		09/01→10/03	MVB1805R6	6PK1805
					09/01→10/03	TB704	131x27
2.0 dCi	M9R 760	127	01/06 →		09/03→03/05	MVB1795R6	6PK1795
					09/03→03/05	TB652	126x27
2.2 dCi		102	05/05 →		→05/05	MVB1969R7	7PK1969
					→05/05	MVB1969R7	7PK1969
2.2 dCi (BG0F)	G9T 702	110	10/01 →		→08/07	MVB1775R6	6PK1775
					→10/05	TB710	89x25
3.0 V6 24V (BG0D)	L7X 731	152	03/01 →		→08/06	MVB1775R6	6PK1775
					→08/06	TB710	89x25
					→05/04	MVB1588R6	6PK1588
					→05/04	MVB1580R6	6PK1580
						TB727	259x32

LAGUNA II Grandtour (KG0/1_)

1.6 16V		82	02/05 →		A/C(-)	MVB1110R5	5PK1110
					A/C(+)	MVB1750R5	5PK1750
		79	03/01 →		→05/05	TB636	132x27
					→05/05	TBK267	
					08/04→05/05	MVB1820R6	6PK1820
					Eng. K4M714, A/C(-)	MVB1110R5	5PK1110
	K4M 710, K4M 711				Eng. K4M714, A/C(+)	MVB1750R5	5PK1750
					→05/05	TB636	132x27
					→05/05	TBK267	
					→05/05		
1.8 16V	F4P 770, F4P 774	89	03/01 →		→05/05	MVB1795R6	6PK1795
1.8 16V (KG0B, KG0M)	F4P 770, F4P 773	88	03/01 →		→05/05	TB652	126x27
					→05/05	MVB1795R6	6PK1795
1.8 16V (KG0J)	F4P 771, F4P 773, F4P 774	85	03/01 →		→05/05	MVB1805R6	6PK1805
					→05/05	MVB1795R6	6PK1795
					→05/05	MVB1805R6	6PK1805
					→05/05	TB652	126x27



kW



...RENAULT

...LAGUNA II Grandtour (KG0/1_)

1.9 dCi	F9Q 664	68	03/04 →		→05/05	MVB1788R7	7PK1788
					→05/05	TB756	133x26
					→05/05	TBK322	
		81	01/05 →		→12/07	MVB1788R7	7PK1788
					→12/07	TB756	133x26
					→12/07	TBK322	
F9Q 758, F9Q 759		96	05/05 →		→12/07	MVB1788R7	7PK1788
					→12/07	TB756	133x26
					→12/07	TBK322	
1.9 dCi (KG0E)		77	06/01 →		09/01→10/03	MVB1795R6	6PK1795
					09/01→12/07	MVB1788R7	7PK1788
					09/01→10/03	TB653	132x26
					09/01→10/03	TBK275	
					→10/03	MVB1120R5	5PK1120
1.9 dCi (KG0G)	F9Q 750, F9Q 756	88	03/01 →		A/C(+), →10/03	MVB1795R6	6PK1795
					→10/03	TB653	132x26
					→10/03	TBK275	
					→10/03	MVB1795R6	6PK1795
					09/01→10/05	MVB1788R7	7PK1788
1.9 dCi (KG0R)		74	10/01 →		→10/05	MVB1788R7	7PK1788
					→10/05	TB653	132x26
					→10/05	TBK275	
					→10/05	MVB1795R6	6PK1795
					Eng. F9Q670, →10/05	MVB1788R7	7PK1788
2.0 16V		125	01/05 →		→10/03	MVB1795R6	6PK1795
					→10/03	TB653	132x26
					→10/03	TBK275	
		150	01/05 →		→10/03	MVB1795R6	6PK1795
					→10/03	TB652	126x27
					→10/03	TBK275	
2.0 16V (KG00, KG0K, KG0W)	F4R 712, F4R 713, F4R 714, F4R 715	99	08/02 →		→05/05	MVB1788R7	7PK1788
					→05/05	TB652	126x27
2.0 16V IDE (KG0N, KG0P)	F5R 700	103	04/01 →		→05/05	MVB1795R6	6PK1795
					→05/05	TB652	126x27
2.0 16V Turbo (KG0S, KG0Z, KG1L, KG1M)	F4R 764, F4R 765, F4R 786, F4R 787	120	01/03 →		09/01→10/03	MVB1805R6	6PK1805
					09/01→10/03	TB704	131x27
2.0 dCi	M9R 740	110	08/05 →		→08/05	MVB1795R6	6PK1795
					→08/05	TB652	126x27
2.0 dCi	M9R 760	127	01/06 →		→08/05	MVB1969R7	7PK1969
					→08/05	TB652	126x27
2.2 dCi	G9T 600	102	05/05 →		→12/07	MVB1969R7	7PK1969
					→12/07	TB652	126x27
2.2 dCi (KG0F)	G9T 702	110	10/01 →		→10/05	MVB1775R6	6PK1775
					→10/05	TB710	89x25
3.0 V6 24V (KG0D)	L7X 731	152	03/01 →		→08/06	MVB1775R6	6PK1775
					→08/06	TB710	89x25
					→05/04	MVB1588R6	6PK1588
					→05/04	MVB1580R6	6PK1580
					→05/04	TB727	259x32

LOGAN (LS_)

1.4	K7J 710	55	09/04 →		A/C(-), MS	MVB715R4	4PK715
					A/C(-), PS	MVB1110R5	5PK1110
					A/C(+), PS	MVB1750R5	5PK1750
						TB529	96x17
						TBK096	
1.5 dCi		50	04/07 →		A/C(-)	MVB1135R5	5PK1135
					A/C(+)	MVB1200R6	6PK1200
						TB713	123x27
1.6		64	09/04 →			TBK301	
					A/C(-), MS, 08/05→	MVB715R4	4PK715
					A/C(-), PS, 08/05→	MVB1110R5	5PK1110
					A/C(+), PS, 08/05→	MVB1750R5	5PK1750
					08/05→	TB529	96x17
	08/05→	TBK096					



kw



RENAULT

...RENAULT

MASTER I Box (T__)

2.0		60	06/85 → 10/89	 		SVB101000 TB421 SVB12760	10x1000 116x19 12x760
2.4 D		52	07/83 → 08/86	 	For OE 5000814593 For OE 7701043483	SVB10950 TB135 TB368	10x950 152x30 152x30
		53	09/86 → 12/92	 	For OE 5000814593 For OE 7701043483	SVB10950 TB135 TB368	10x950 152x30 152x30
28-35 2,5 D	8140.67.2510, S8U 742	55	08/89 → 07/98	 	08/93→02/98 08/93→02/98 08/93→02/98	SVB10950 TB368 TBK037	10x950 152x30
28-35 2,5 TD	8140.27.2580, S9U 702	72	08/89 → 07/98	 	08/93→02/98 08/93→02/98 08/93→02/98	SVB10950 TB701 TBK039	10x950 153x30
28-35 2.0	J5R 718	58	10/86 → 07/98	 	→12/95 →12/95 →07/89	SVB101000 TB421 TBK281	10x1000 116x19
	829 731	59	08/80 → 10/86	 	→12/95 →06/85 →07/84	SVB12760 SVB101000 TB114	12x760 10x1000 116x19
				 	07/84→06/85 →07/84	TB421 TBK015	116x19
					→06/85	SVB12760	12x760
28-35 2.1 D	J8S 330	44	08/80 → 07/98	 	→04/95 →04/95 →04/95, incl. guide pulley	SVB101025 TB156 TBK123	10x1025 148x25.4
				 	Manu Tensioner, →04/95	TBK117	
28-35 2.4 D	8140.61.2300, S8U 731	52	08/80 → 08/89	 	07/86→ 07/86→ 07/86→	SVB10950 TB135 TBK045	10x950 152x30
30 2,2	J7T 782, J7T 788	67	08/80 → 07/98	 	07/85→02/98 07/85→02/98 07/85→02/98	SVB101000 TB422 SVB12760	10x1000 118x19 12x760
					→02/98	SVB10950	10x950
35 2,5 TD	8140.27.2500, 8140.27.2510, S9U 714	69	08/89 → 07/98	 	→02/98 →02/98 →02/98	SVB10950 TB701 TBK039	10x950 153x30

MASTER I Bus (T__)

2.0		60	06/85 → 10/89	 		SVB101000 TB421 SVB12760	10x1000 116x19 12x760
2.4 D		53	09/86 → 10/89	 	For OE 5000814593 For OE 7701043483	SVB10950 TB135 TB368	10x950 152x30 152x30
	28-35 2,5 TD	8140.27.2580, S9U 702	72	08/89 → 07/98	 	08/93→02/98 08/93→02/98 08/93→02/98	SVB10950 TB701 TBK039
28-35 2.0	J5R 718	58	10/86 → 07/98	 	→07/93 →07/93 →07/89	SVB101000 TB421 TBK281	10x1000 116x19
				 	→07/93	SVB12760	12x760
28-35 2.1 D	J8S 330	44	08/80 → 07/98	 	→04/95 →04/95 →04/95, incl. guide pulley	SVB101025 TB156 TBK123	10x1025 148x25.4
				 	Manu Tensioner, →04/95	TBK117	
28-35 2.4 D	8140.61.2300, S8U 731	52	08/80 → 08/89	 	07/86→ 07/86→ 07/86→	SVB10950 TB135 TBK045	10x950 152x30



kW



...RENAULT

...MASTER I Bus (T__)

28-35 2.5 D	8140.67.2510, S8U 742	55	08/89 → 07/98	 	08/93 → 02/98 08/93 → 02/98 08/93 → 02/98	SVB10950 TB368 TBK037	10x950 152x30
30 2,2	J7T 782, J7T 788	67	08/80 → 07/98	 	07/85 → 02/98 07/85 → 02/98 07/85 → 02/98	SVB101000 TB422 SVB12760	10x1000 118x19 12x760
35 2,5 TD	8140.27.2500, 8140.27.2510, S9U 714	69	08/89 → 07/98	 	→ 02/98 → 02/98 → 02/98	SVB10950 TB701 TBK039	10x950 153x30

MASTER I Flatbed / Chassis (P__)

2.0		59	07/80 → 06/85	 	→ 07/84 07/84 → → 07/84	SVB101000 TB114 TB421 TBK015 SVB12760 SVB101000 TB421 SVB12760 SVB101000 TB421 SVB12760	10x1000 116x19 116x19 12x760 10x1000 116x19 12x760 10x1000 116x19 12x760
2.1 D		46	11/89 → 07/93	 	incl. guide pulley Manu Tensioner	SVB121030 TB156 TBK123 TBK117	12x1030 148x25.4
2.2		71	08/93 → 02/98	 		SVB101000 TB422 SVB12760	10x1000 118x19 12x760
2.5 D		55	07/80 → 10/89	 		SVB10950 TB135 TBK045	10x950 152x30
2.5 DT		70	08/93 → 02/98	 		SVB10950 TB701 TBK039 SVB10950 TB701 TBK039	10x950 153x30 10x950 153x30
28-35 2.0	829 730	59	10/82 → 09/86	 	→ 07/84 07/84 → → 07/84	SVB101000 TB114 TB421 TBK015 SVB12760	10x1000 116x19 116x19 12x760
	J5R 728	58	10/86 → 07/98	 	→ 07/93 → 07/93 → 07/89 → 07/93	SVB101000 TB421 TBK281 SVB12760	10x1000 116x19 12x760
28-35 2.5 D	8140.61.2300, S8U 731	52	09/80 → 07/98	 	07/83 → 12/92 07/83 → 12/92, For OE 5000814593 07/83 → 12/92, For OE 7701043483	SVB10950 TB135 TB368	10x950 152x30 152x30

MASTER II Box (FD)

1.9 dCi 80	F9Q 772	60	11/01 →	 	A/C(-), → 08/06 A/C(+), → 08/06 → 08/06 → 08/06	MVB1120R5 MVB1795R6 TB653 TBK275	5PK1120 6PK1795 132x26
1.9 dTI	F9Q 770	59	09/00 →	 	A/C(-), → 08/06 A/C(+), → 08/06 → 08/06 → 08/06	MVB1120R5 MVB1795R6 TB653 TBK275	5PK1120 6PK1795 132x26



kW



RENAULT

...RENAULT

...MASTER II Box (FD)

2.2 dCi 90	G9T 722	66	09/00 →		A/C(-), eng. PTO shaft (-), →08/06	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), 09/03→11/04	MVB1150R7	7PK1150
					A/C(-), eng. PTO shaft (+), →08/06	MVB1795R6	6PK1795
					A/C(-), eng. PTO shaft (+), →08/06	MVB1833R6	6PK1833
					A/C(+), eng. PTO shaft (-), 09/03→08/06	MVB1788R7	7PK1788
					→08/06	TB710	89x25
2.5 D	S8U 770	59	07/98 → 01/01		→07/00	MVB1200R5	5PK1200
					→03/00	MVB860R6	6PK860
					03/00→07/00	MVB870R6	6PK870
					→07/00	TB368	152x30
					→07/00	TBK037	
					→07/00	TBK037	
2.5 dCi 120	G9U 720, G9U 754	84	10/01 →		A/C(-), eng. PTO shaft (-), →08/06	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), →11/04	MVB1150R7	7PK1150
					A/C(+), →08/06	MVB1788R7	7PK1788
					Eng. G9U754, A/C(-), eng. PTO shaft (+), →08/06	MVB1795R6	6PK1795
					eng. PTO shaft (+), →08/03 →08/06	MVB1833R6	6PK1833
					→08/06	TB710	89x25
2.8 dTi	S9W 702	84	07/98 → 10/01			MVB1200R5	5PK1200
					→06/00	MVB838R6	6PK838
					06/00→	MVB850R6	6PK850
						TB558	154x30
						TBK102	

MASTER II Bus (JD/ND)

1.9 dCi 80	F9Q 772	60	11/01 →		A/C(-), →08/06	MVB1120R5	5PK1120
					A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB653	132x26
					→08/06	TBK275	
					→08/06	TBK275	
1.9 dTi	F9Q 770	59	09/00 →		A/C(-), →08/06	MVB1120R5	5PK1120
					A/C(+), →08/06	MVB1795R6	6PK1795
					→08/06	TB653	132x26
					→08/06	TBK275	
					→08/06	TBK275	
2.2 dCi 90	G9T 722	66	09/00 →		A/C(-), eng. PTO shaft (-), →08/06	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), 09/03→11/04	MVB1150R7	7PK1150
					A/C(-), eng. PTO shaft (+), →08/06	MVB1795R6	6PK1795
					A/C(-), eng. PTO shaft (+), →08/06	MVB1833R6	6PK1833
					A/C(+), eng. PTO shaft (-), 09/03→08/06	MVB1788R7	7PK1788
					→08/06	TB710	89x25
2.5 D	S8U 770	59	07/98 → 01/01		→07/00	MVB1200R5	5PK1200
					→03/00	MVB860R6	6PK860
					03/00→07/00	MVB870R6	6PK870
					→07/00	TB368	152x30
					→07/00	TBK037	



kW



...RENAULT

...MASTER II Bus (JD/ND)

2.5 dCi 120	G9U 720, G9U 754	84	10/01 →		A/C(-), eng. PTO shaft (-), →08/06	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), →11/04	MVB1150R7	7PK1150
					A/C(-), eng. PTO shaft (+), →08/06	MVB1795R6	6PK1795
					A/C(+), →08/06	MVB1788R7	7PK1788
					Eng. G9U750, A/C(-), eng. PTO shaft (+), →08/06	MVB1833R6	6PK1833
2.8 dTI	S9W 702	84	07/98 → 10/01		→08/06	TB710	89x25
					→06/00	MVB838R6	6PK838
					03/00→	MVB850R6	6PK850
					A/C(+)	MVB1200R5	5PK1200
					TB558	154x30	
					TBK102		

MASTER II Flatbed / Chassis (ED/HD/UD)

2.2 dCi 90	G9T 722	66	09/00 →		A/C(-), eng. PTO shaft (-), →08/06	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), 09/03→11/04	MVB1150R7	7PK1150
					A/C(-), eng. PTO shaft (+), →08/06	MVB1795R6	6PK1795
					A/C(-), eng. PTO shaft (+), →08/06	MVB1833R6	6PK1833
					A/C(+), eng. PTO shaft (-), 09/03→08/06	MVB1788R7	7PK1788
2.5 D	S8U 770	59	07/98 → 01/01		→08/06	TB710	89x25
					→07/00	MVB1200R5	5PK1200
					→03/00	MVB860R6	6PK860
					03/00→07/00	MVB870R6	6PK870
					→07/00	TB368	152x30
					TBK037		
2.5 dCi 120	G9U 720, G9U 754	84	10/01 →		A/C(-), eng. PTO shaft (-), →08/03	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), →11/04	MVB1150R7	7PK1150
					A/C(+), eng. PTO shaft (+), →08/03	MVB1833R6	6PK1833
					Eng. G9U754, A/C(-), eng. PTO shaft (+), →08/06	MVB1795R6	6PK1795
					Eng. G9U754, A/C(+), →08/06	MVB1788R7	7PK1788
2.8 dTI	S9W 702	84	07/98 → 10/01		→08/06	TB710	89x25
					→06/00	MVB1200R5	5PK1200
					06/00→	MVB838R6	6PK838
						MVB850R6	6PK850
						TB558	154x30
					TBK102		

MASTER III Box (HD, FD)

2.5 dCi		88	08/06 →		A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115		
					A/C(+)	MVB1788R7	7PK1788		
				107	08/06 →		A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
							A/C(+)	MVB1788R7	7PK1788



kW



RENAULT

...RENAULT

...MASTER III Box (HD, FD)

2.5 dCi 100 (HDOU, FDOU, HDOV, FDOV)	G9U 754	73	10/03 →	②	A/C(-), eng. PTO shaft (-), →11/04	MVB1150R7	7PK1150
				②	A/C(-), eng. PTO shaft (-), 09/06→	MVB1115R7	7PK1115
				②	A/C(-), eng. PTO shaft (+), →08/06	MVB1795R6	6PK1795
				②	A/C(+), →08/06	MVB1788R7	7PK1788
				②		TB710	89x25
3.0 dCi 140 (HD0S, FDO0S, HD1S)	ZD3 202	100	10/03 →	②	→08/06	MVB1920R7	7PK1920

MASTER III Bus (JD)

2.5 dCi	G9U 754	74	08/06 →	②	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
				②	A/C(+)	MVB1788R7	7PK1788
		88	08/06 →	②	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
				②	A/C(+)	MVB1788R7	7PK1788
		107	08/06 →	②	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
				②	A/C(+)	MVB1788R7	7PK1788
2.5 dCi 100 (JDCV)	G9U 754	73	10/03 →	②	A/C(-), eng. PTO shaft (-), →11/04	MVB1150R7	7PK1150
				②	A/C(-), eng. PTO shaft (-), 09/06→	MVB1115R7	7PK1115
				②	A/C(-), eng. PTO shaft (+), →08/06	MVB1795R6	6PK1795
				②	A/C(+), →08/06	MVB1788R7	7PK1788
				②		TB710	89x25
3.0 dCi 140 (JD0T)	ZD3 200, ZD3 202	100	10/03 →	②	→08/06	MVB1920R7	7PK1920

MASTER III Flatbed / Chassis (ED, UD)

2.5 dCi	G9U 754	74	08/06 →	②	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
				②	A/C(+)	MVB1788R7	7PK1788
		88	08/06 →	②	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
				②	A/C(+)	MVB1788R7	7PK1788
		107	08/06 →	②	A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
				②	A/C(+)	MVB1788R7	7PK1788
2.5 dCi 100 (ED4V, ED8V)	G9U 754	73	10/03 →	②	A/C(-), eng. PTO shaft (-), →11/04	MVB1150R7	7PK1150
				②	A/C(-), eng. PTO shaft (-), 09/06→	MVB1115R7	7PK1115
				②	A/C(-), eng. PTO shaft (+), →08/06	MVB1795R6	6PK1795
				②	A/C(+), →08/06	MVB1788R7	7PK1788
				②		TB710	89x25
3.0 dCi 140 (ED0S, UD0S)	ZD3 202	100	10/03 →	②	→08/06	MVB1920R7	7PK1920

MEGANE Cabriolet (EA0/1_)

1.4 16V (EA0D, EA1H, EA0W, EA10)	K4J 714, K4J 750	70	03/99 →	②	Eng. K4J750, A/C(-), →07/03	MVB1110R5	5PK1110
				②	Eng. K4J750, A/C(+), →07/03	MVB1750R5	5PK1750
				②	→07/03	TB636	132x27
				②	Eng. K4J750, →07/03	TBK267	
1.6 16V (EA0B, EA04, EA11)	K4M 700, K4M 701, K4M 708	79	03/99 →	②	A/C(-), →07/03	MVB1110R5	5PK1110
				②	A/C(+), →07/03	MVB1750R5	5PK1750
				②	→07/03	TB636	132x27
				②	→07/03	TBK267	
1.6 e (EA0F)	K7M 702, K7M 703	66	10/96 → 03/99	②	Eng. K7M702, 02/97→	MVB715R3	3PK715
				②	02/97→	TB257	95x17
				②	Eng. K7M702, 02/97→	TBK002	
				②	A/C(+), 02/97→06/97	MVB1260R4	4PK1260
				②	A/C(+), 07/97→	MVB1272R4	4PK1272
				②	Eng. K7M702, A/C(-), 02/97→	MVB838R3	3PK838
2.0 16V	F4R 770	102	01/02 →	②	08/03→	MVB1125R7	7PK1125
				②	08/03→	TB652	126x27



kW



...RENAULT

...MEGANE Cabriolet (EA0/1_)

2.0 16V (EA0H)	F7R 710, F7R 714	108	10/96 → 11/99		Eng. F7R714, A/C(-), 02/97→01/99	MVB1125R6	6PK1125
					Eng. F7R714, A/C(+), 02/97→01/99	MVB1642R6	6PK1642
					02/97→01/99	TB423	148x25.4
2.0 16V IDE (EA03, EA0P, EA14)	F5R 740	103	11/99 →		→07/03	MVB1750R5	5PK1750
					→07/03	TB796	134x27

MEGANE Classic (LA0/1_)

1.4 (LA0E, LA0V)	E7J 626, E7J 764	55	09/96 →		Eng. E7J626, A/C(-), 03/99→09/00	MVB1110R5	5PK1110
					Eng. E7J626, A/C(+), 03/99→09/00	MVB1750R5	5PK1750
					Eng. E7J764, 02/97→02/99	MVB715R3	3PK715
					02/97→02/99	TB257	95x17
					03/99→09/00	TB529	96x17
					Eng. E7J626, 03/99→09/00	TBK096	
					Eng. E7J764, 02/97→02/99	TBK002	
					A/C(+), 02/97→06/97	MVB1260R4	4PK1260
					A/C(+), 07/97→02/99	MVB1272R4	4PK1272
					Eng. E7J764, A/C(-), 02/97→02/99	MVB838R3	3PK838
1.4 16V (LA0D, LA1H, IA0W, LA10)	K4J 714, K4J 750	70	03/99 →		Eng. K4J750, A/C(-), 10/00→07/03	MVB1110R5	5PK1110
					Eng. K4J750, A/C(+), 10/00→07/03	MVB1750R5	5PK1750
					10/00→07/03	TB636	132x27
					Eng. K4J750, 10/00→07/03	TBK267	
1.6 16V (La04, LA11, LA0B, LA1C, LA1J)	K4M 700, K4M 701, K4M 708	79	03/99 →		04/05→	MVB1200R6	6PK1200
					08/03→04/05	MVB1200R5	5PK1200
					A/C(-), →07/03	MVB1110R5	5PK1110
					A/C(+), →07/03	MVB1750R5	5PK1750
						TB636	132x27
						TBK267	
1.6 e (LA0F, LA0S)	K7M 702, K7M 703, K7M 790	66	09/96 → 03/99			MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB838R3	3PK838
					A/C(+), →06/97	MVB1260R4	4PK1260
					A/C(+), 07/97→	MVB1272R4	4PK1272
1.6 i (LA0L)	K7M 720	55	09/96 → 03/99			MVB715R3	3PK715
						TB529	96x17
						TBK096	
					A/C(-)	MVB838R3	3PK838
					A/C(+)	MVB1263R5	5PK1263
1.8 16V (LA06, LA12, LA1A, LA1M, LA1R)	F4P 720, F4P 722	85	01/01 →		→07/03	MVB1750R5	5PK1750
					→07/03	TB644	128x27
1.9 D (LA0A, LA0U)	F8Q 620, F8Q 624	47	09/96 →		Eng. F8Q622, A/C(-), →09/00	MVB1137R6	6PK1137
					Eng. F8Q622, A/C(+), →09/00	MVB1642R6	6PK1642
					→09/00	TB545	153x25.4
					→09/00	TBK098	
1.9 dCi (LA05, LA1F)	F9Q 732, F9Q 733	75	02/01 →		A/C(+), →03/01	MVB1642R6	6PK1642
					Eng. F9Q733, A/C(-), →07/03	MVB1137R6	6PK1137
					Eng. F9Q733, A/C(+), →07/03	MVB1600R6	6PK1600
					→07/03	TB546	153x26
					→07/03, check kit comp.	TBK114	
					Eng. F9Q733, →07/03, check kit comp.	TBK099	
1.9 dT (LA0K, LA0Y)	F8Q 784, F8Q 786	66	09/96 →		A/C(-), →02/99	MVB1137R6	6PK1137
					A/C(+), →02/99	MVB1642R6	6PK1642
					→02/99	TB545	153x25.4
					→02/99	TBK098	



kw



RENAULT

...RENAULT

...MEGANE Classic (LA0/1_)

1.9 dTi (LA08, LA0N)	F9Q 730, F9Q 731, F9Q 734, F9Q 736	72	03/97 → 02/01		Eng. F9Q731, A/C(-), →09/00	MVB1137R6	6PK1137
					Eng. F9Q731, A/C(+), →09/00	MVB1642R6	6PK1642
					→09/00	TB546	153x26
					03/99→08/00, Eng. F9Q731	TB654	153x26
1.9 dTi (LA1U)	F9Q 744	59	02/01 →		A/C(-), →07/03	MVB1137R6	6PK1137
					A/C(+), →03/02	MVB1600R6	6PK1600
					A/C(+), →07/03	MVB1642R6	6PK1642
					→03/02	TB654	153x26
1.9 TDI	F8Q 784	69	09/96 →		A/C(-), →02/99	MVB1137R6	6PK1137
					A/C(+), →02/99	MVB1642R6	6PK1642
					→02/99	TB545	153x25.4
					→02/99	TBK098	
2.0 i	F3R 752	80	03/99 →		A/C(-), →08/00	MVB1125R6	6PK1125
					A/C(+), →08/00	MVB1660R6	6PK1660
					→08/00	TB431	127x19
2.0 i (LA07, LA0G)	F3R 750, F3R 751	84	09/96 →		A/C(-), →04/97	MVB1155R6	6PK1155
					A/C(-), 04/97→08/00	MVB1125R6	6PK1125
					A/C(+), →08/00	MVB1660R6	6PK1660
					→08/00	TB431	127x19

MEGANE Coach (DA0/1_)

1.4 16V (DA0D, DA1H, DA0W, DA10)	K4J 714, K4J 750	70	03/99 →		A/C(-), →07/03	MVB1110R5	5PK1110
					A/C(+), →07/03	MVB1750R5	5PK1750
					→07/03	TB636	132x27
					→07/03	TBK267	
1.6 16V (DA0B, DA04, DA11)	K4M 700, K4M 701, K4M 708	79	03/99 →		A/C(-), →07/03	MVB1110R5	5PK1110
					A/C(+), →07/03	MVB1750R5	5PK1750
					→07/03	TB636	132x27
					→07/03	TBK267	
1.6 e (DA0F)	K7M 702, K7M 703	66	03/96 → 03/99			MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB838R3	3PK838
					A/C(+), →06/96	MVB1263R5	5PK1263
1.9 dCi (DA05, DA1F)	F9Q 732, F9Q 733	75	02/01 →		A/C(+), →06/97	MVB1260R4	4PK1260
					A/C(+), 07/97→	MVB1272R4	4PK1272
					A/C(+), →03/01	MVB1642R6	6PK1642
					Eng. F9Q733, A/C(-), →07/03	MVB1137R6	6PK1137
1.9 dTi (DA0N)	F9Q 731, F9Q 734, F9Q 736	72	03/97 → 02/01		Eng. F9Q733, A/C(+), →07/03	MVB1600R6	6PK1600
					→07/03	TB546	153x26
					→07/03, check kit comp.	TBK114	
					Eng. F9Q733, →07/03, check kit comp.	TBK099	
					Eng. F9Q734, A/C(-)	MVB1137R6	6PK1137
2.0 16V	F7R 710, F7R 714	102	01/02 →		Eng. F9Q734, A/C(+)	MVB1642R6	6PK1642
					check kit comp.	TB546	153x26
					Eng. F9Q734, check kit comp.	TBK114	
					→07/03	TBK099	
2.0 16V (DA0H)	F7R 710, F7R 714	108	03/96 → 11/99		→07/03	MVB1750R5	5PK1750
					→07/03	TB796	134x27
					Eng. F7R714, A/C(-), 05/97→01/99	MVB1125R6	6PK1125
					Eng. F7R714, A/C(+), 05/97→01/99	MVB1642R6	6PK1642
2.0 16V IDE (DA03, DA0P, DA14)	F5R 740	103	11/99 →		05/97→01/99	TB423	148x25.4
					→07/03	MVB1750R5	5PK1750
					→07/03	TB796	134x27



kW



...RENAULT

...MEGANE Coach (DAO/1_)

2.0 i		80	03/99 →		→07/03	MVB1750R5	5PK1750
					→07/03	TB796	134x27
2.0 i (DAOG)	F3R 750, F3R 751	84	03/96 →		A/C(-), →04/97	MVB1155R6	6PK1155
					A/C(-), 04/97 →02/99	MVB1125R6	6PK1125
					A/C(+), →02/99	MVB1660R6	6PK1660
					→02/99	TB431	127x19

MEGANE Grandtour (KAO/1_)

1.4 16V (KAO0, KA1H, KA0W, KA10)	K4J 714, K4J 750	70	03/99 →		Eng. K4J750, A/C(-), →07/03	MVB1110R5	5PK1110
					Eng. K4J750, A/C(+), →07/03	MVB1750R5	5PK1750
					→07/03	TB636	132x27
					Eng. K4J750, →07/03	TBK267	
1.4 e (KAOV)	E7J 626	55	03/99 →		A/C(-), →09/00	MVB1110R5	5PK1110
					A/C(+), →09/00	MVB1750R5	5PK1750
					→09/00	TB529	96x17
					→09/00	TBK096	
1.6 16V (KAOB, KA04, KA11)	K4M 700, K4M 701, K4M 704, K4M 708	79	03/99 →		05/05 →	MVB1200R6	6PK1200
					A/C(-), →07/03	MVB1110R5	5PK1110
					A/C(+), →07/03	MVB1750R5	5PK1750
						TB636	132x27
						TBK267	
1.6 e (KAOF)	K7M 702, K7M 703	66	03/99 →		→01/00	MVB715R3	3PK715
					→01/00	TB257	95x17
					→01/00	TBK002	
					A/C(-), →01/00	MVB838R3	3PK838
					A/C(+), →01/00	MVB1272R4	4PK1272
1.8 16V (KAO5, KA12, KA1A, KA1M, KA1R)	F4P 720, F4P 722	85	01/01 →		→07/03	MVB1750R5	5PK1750
					→07/03	TB644	128x27
1.9 D (KAOJ, KA0R)	F8Q 622, F8Q 790	47	04/99 →		Eng. F8Q622, A/C(-), →05/01	MVB1137R6	6PK1137
					Eng. F8Q622, A/C(+), →05/01	MVB1642R6	6PK1642
					→05/01	TB545	153x25.4
					→05/01	TBK098	
1.9 dCi (KAO5, KA1F)	F9Q 732, F9Q 733	75	02/01 →		A/C(-), →07/03	MVB1137R6	6PK1137
					A/C(+), →03/01	MVB1642R6	6PK1642
					A/C(+), →07/03	MVB1600R6	6PK1600
					→07/03	TB546	153x26
					→07/03, check kit comp.	TBK099	
					→07/03, check kit comp.	TBK114	
1.9 dTi (KAO0)	F9Q 731, F9Q 736	72	03/99 → 02/01		Eng. F9Q731, A/C(-)	MVB1137R6	6PK1137
					Eng. F9Q731, A/C(+)	MVB1642R6	6PK1642
					Eng. F9Q731	TB654	153x26
					Eng. F9Q736	TB546	153x26
					Eng. F9Q736, check kit comp.	TBK099	
					Eng. F9Q736, check kit comp.	TBK114	
1.9 dTi (KA1U)	F9Q 744	59	02/01 →		A/C(-), →07/03	MVB1137R6	6PK1137
					A/C(+), →07/03	MVB1600R6	6PK1600
					A/C(+), →07/03	MVB1642R6	6PK1642
					→07/03	TB546	153x26
					→07/03	TBK114	
					→07/03, check kit comp.	TBK099	

MEGANE I (BA0/1_)

1.4 16V (BA0D, BA1H, BA0W, BA10)	K4J 714, K4J 750	70	03/99 →		Eng. K4J714, A/C(-), →08/02	MVB1110R5	5PK1110
					Eng. K4J714, A/C(+), →08/02	MVB1750R5	5PK1750
					→08/02	TB636	132x27
					Eng. K4J714, →08/02	TBK267	



kw



RENAULT

...RENAULT

...MEGANE I (BA0/1_)

1.4 e (BA0E, BA0V)	E7J 626, E7J 764	55	01/96 →		→02/99	MVB715R3	3PK715
					Eng. E7J626, A/C(-), 03/99→09/00	MVB1110R5	5PK1110
					Eng. E7J626, A/C(+), 03/99→09/00	MVB1750R5	5PK1750
					→02/99	TB257	95x17
					03/99→09/00	TB529	96x17
					→02/99	TBK002	
					Eng. E7J626, 03/99→09/00	TBK096	
1.4 Eco (BA0T)	E7J 624	52	01/96 → 03/99			MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB838R3	3PK838
					A/C(+), →06/96	MVB1263R5	5PK1263
					A/C(+), 06/96→06/97	MVB1260R4	4PK1260
					A/C(+), 07/97→	MVB1272R4	4PK1272
1.6 16V (BA11, BA04, BA0B, BA1J)	K4M 700, K4M 701, K4M 704, K4M 708	79	03/99 →		A/C(-), →08/02	MVB1110R5	5PK1110
					A/C(+), →08/02	MVB1750R5	5PK1750
					→08/02	TB636	132x27
					→08/02	TBK267	
1.6 e (BA0F, BA0S)	K7M 702, K7M 703, K7M 790	66	01/96 → 03/99			MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB838R3	3PK838
					A/C(+), →06/96	MVB1263R5	5PK1263
1.6 i (BA0L)	K7M 720	55	01/96 → 03/99		A/C(+), 06/96→06/97	MVB1260R4	4PK1260
					A/C(+), 07/97→	MVB1272R4	4PK1272
					A/C(-)	MVB715R3	3PK715
						TB529	96x17
						TBK096	
1.8 16V (BA06, BA12, BA1A, BA1M, BA1R)	F4P 720, F4P 722	85	01/01 →		→08/02	MVB1750R5	5PK1750
					→08/02	TB644	128x27
1.9 D Eco (B/SA0U, BA0A)	F8Q 620, F8Q 624	47	01/96 →		A/C(-), →09/00	MVB1137R6	6PK1137
					A/C(+), →09/00	MVB1642R6	6PK1642
					→09/96	TB258	153x25.4
					09/96→09/00	TB545	153x25.4
					→09/96	TBK038	
					09/96→09/00	TBK098	
1.9 dCi (BA05, BA1F)	F9Q 732, F9Q 733	75	02/01 →		A/C(+), →03/01	MVB1642R6	6PK1642
					Eng. F9Q732, A/C(-), →07/03	MVB1137R6	6PK1137
					Eng. F9Q732, A/C(+), →07/03	MVB1600R6	6PK1600
					→07/03	TB546	153x26
					→07/03, check kit comp.	TBK114	
					Eng. F9Q732, →07/03, check kit comp.	TBK099	
1.9 dT (B/SA0K, B/SA0Y)	F8Q 784, F8Q 786	66	01/96 →		A/C(-), →02/99	MVB1137R6	6PK1137
					A/C(+), →02/99	MVB1642R6	6PK1642
					→09/96	TB258	153x25.4
					09/96→02/99	TB545	153x25.4
					→09/96	TBK038	
					09/96→02/99	TBK098	



kW



...RENAULT

...MEGANE I (BA0/1_)

1.9 dTi (BA08, BA0N)	F9Q 730, F9Q 731, F9Q 734, F9Q 736	72	03/97 → 02/01	⊗	Eng. F9Q734, A/C(-)	MVB1137R6	6PK1137			
				⊗	Eng. F9Q734, A/C(+)	MVB1642R6	6PK1642			
					→09/00	TB546	153x26			
					Eng. F9Q731	TB654	153x26			
				KIT	→09/00, check kit comp.	TBK114				
1.9 dTi (BA1U)	F9Q 744	59	02/01 →	⊗	A/C(-), →07/03	MVB1137R6	6PK1137			
				⊗	A/C(+), →07/03	MVB1600R6	6PK1600			
				⊗	A/C(+), →08/02	MVB1642R6	6PK1642			
					→08/02	TB546	153x26			
				KIT	→08/02, check kit comp.	TBK099				
1.9 TDI	F8Q 784	69	09/96 →	⊗	A/C(-), →02/99	MVB1137R6	6PK1137			
				⊗	A/C(+), →02/99	MVB1642R6	6PK1642			
					→02/99	TB545	153x25.4			
				KIT	→02/99	TBK098				
				2.0 16V (BA0H)	F7R 710, F7R 714	108	07/96 →	⊗	Eng. F7R714, A/C(-), →01/99	MVB1125R6
⊗	Eng. F7R714, A/C(+), →01/99	MVB1642R6	6PK1642							
	→01/99	TB423	148x25.4							
2.0 i	80	03/99 →	⊗					A/C(-), →04/00	MVB1125R6	6PK1125
			⊗					A/C(+), →04/00	MVB1660R6	6PK1660
2.0 i (BA0G)	F3R 750, F3R 751	84	01/96 →		→04/00	TB431	127x19			
				⊗	A/C(-), →04/97	MVB1155R6	6PK1155			
				⊗	A/C(-), 04/97→04/00	MVB1125R6	6PK1125			
				⊗	A/C(+), →04/00	MVB1660R6	6PK1660			
					→04/00	TB431	127x19			

MEGANE II (BM0/1_, CM0/1_)

1.4 16V	K4J 732	60	10/03 →	⊗	A/C(-)	MVB1135R5	5PK1135			
				⊗	A/C(+)	MVB1200R5	5PK1200			
						TB636	132x27			
				KIT		TBK267				
1.4 16V (BM0B, CM0B)	K4J 730	72	11/02 →	⊗	A/C(-)	MVB1135R5	5PK1135			
				⊗	A/C(-)	MVB1200R6	6PK1200			
				⊗	A/C(+)	MVB1200R5	5PK1200			
						TB636	132x27			
				KIT		TBK267				
1.5 dCi	K9K 729	74	10/03 →	⊗	A/C(-), →08/05	MVB1135R5	5PK1135			
				⊗	A/C(+), →01/05	MVB1200R5	5PK1200			
				⊗	A/C(+), 01/05→08/05	MVB1200R6	6PK1200			
					→08/05	TB713	123x27			
				KIT	→08/05	TBK301				
1.5 dCi	K9K 724	63	05/05 →	⊗	A/C(-)	MVB1200R6	6PK1200			
				⊗	A/C(-), →09/05	MVB1135R5	5PK1135			
						TB713	123x27			
				KIT		TBK301				
				1.5 dCi	K9K 722	60	11/02 →	⊗	A/C(-)	MVB1200R6
⊗	A/C(-), →09/05	MVB1135R5	5PK1135							
⊗	A/C(+), →01/05	MVB1200R5	5PK1200							
		TB713	123x27							
KIT	→08/03	TBK273								
1.6		77	06/05 →	⊗		MVB1200R6	6PK1200			
						TB636	132x27			
				KIT		TBK267				
				1.6	77	06/05 →	⊗		MVB1200R6	6PK1200
									TB636	132x27



kW



RENAULT

...RENAULT

...MEGANE II (BMO/1_, CMO/1_)

1.6 16V (BMOG, CMOG)	K4M 760	83	11/02 →	⊗	→04/05	MVB1200R5	5PK1200
				⊗	A/C(-)	MVB1135R5	5PK1135
				⊗	A/C(-), 04/05 →	MVB1200R6	6PK1200
				⌘		TB636	132x27
				⌘		TBK267	
1.9 dCi	F9Q 800	68	03/04 →	⊗		MVB1125R7	7PK1125
				⌘		TB756	133x26
				⌘		TBK322	
	F4R 770	96	05/05 →	⊗		MVB1125R7	7PK1125
				⌘		TB756	133x26
				⌘		TBK322	
F4R 774	81	05/05 →	⊗		MVB1125R7	7PK1125	
			⌘		TB756	133x26	
			⌘		TBK322		
1.9 dCi (BMOG, CMOG)	F9Q 800	88	11/02 →	⊗		MVB1125R7	7PK1125
				⌘		TB756	133x26
				⌘		TBK322	
2.0 16V (BMOU, CMOU)	F4R 770	99	11/02 →	⊗		MVB1125R7	7PK1125
				⌘		TB652	126x27
2.0 16V Turbo	F4R 776	120	05/04 →	⊗		MVB1125R7	7PK1125
				⌘		TB652	126x27
2.0 Renault Sport	F4R 774	165	05/04 →	⊗		MVB1125R7	7PK1125
				⌘		TB652	126x27

MEGANE II CoupÚ-Cabriolet (EMO/1_)

1.5 dCi	K9K 724	63	05/05 →	⊗	A/C(-)	MVB1200R6	6PK1200
				⊗	A/C(-), →09/05	MVB1135R5	5PK1135
				⌘		TB713	123x27
	K9K 732	78	03/06 →	⊗	→06/08	MVB1200R6	6PK1200
				⌘	→06/08	TB713	123x27
		76	01/07 →	⊗	→06/08	MVB1200R6	6PK1200
⌘	→06/08			TB713	123x27		
⌘	→06/08			TBK301			
1.6	K4M 760, K4M 761	83	09/03 →	⊗	A/C(-), →05/06	MVB1135R5	5PK1135
				⊗	A/C(-), 04/05 →	MVB1200R6	6PK1200
				⊗	A/C(+), →04/05	MVB1200R5	5PK1200
				⌘		TB636	132x27
1.6 16V	K4M 760, K4M 761	82	01/07 →	⊗	A/C(+)	MVB1200R6	6PK1200
				⌘		TB636	132x27
1.9 dCi	F9Q 800	88	09/03 →	⊗		MVB1125R7	7PK1125
				⌘		TB756	133x26
	F9Q 803	96	05/05 →	⊗		MVB1125R7	7PK1125
⌘					TB756	133x26	
⌘					TBK322		
2.0	F4R 770, F4R 771	99	09/03 →	⊗		MVB1125R7	7PK1125
				⌘		TB652	126x27
2.0 16V Turbo	F4R 776	120	05/04 →	⊗		MVB1125R7	7PK1125
				⌘		TB652	126x27

MEGANE II Estate (KMO/1_)

1.4	K4J 730	72	08/03 →	⊗	A/C(-)	MVB1135R5	5PK1135
				⊗	A/C(+)	MVB1200R5	5PK1200
				⊗	A/C(+), 09/06 →	MVB1200R6	6PK1200
				⌘		TB636	132x27
				⌘		TBK267	



kW



...RENAULT

...MEGANE II Estate (KMO/1_)

1.5 dCi	K9K 722	60	08/03 →	⊗	A/C(-)	MVB1200R6	6PK1200	
				⊗	A/C(-), →09/05	MVB1135R5	5PK1135	
				⊗	A/C(+), →01/05	MVB1200R5	5PK1200	
						TB713	123x27	
						TBK301		
	74	02/04 →		⊗	A/C(-), →03/06	MVB1135R5	5PK1135	
				⊗	A/C(-), 01/05 →	MVB1200R6	6PK1200	
				⊗	A/C(+), →01/05	MVB1200R5	5PK1200	
						TB713	123x27	
						TBK301		
78	05/05 →		⊗	A/C(-)	MVB1200R6	6PK1200		
			⊗	A/C(-), →09/05	MVB1135R5	5PK1135		
					TB713	123x27		
					TBK301			
K9K 724	63	05/05 →		⊗	A/C(-)	MVB1200R6	6PK1200	
				⊗	A/C(-), →09/05	MVB1135R5	5PK1135	
						TB713	123x27	
						TBK301		
76	01/07 →			⊗	A/C(-)	MVB1200R6	6PK1200	
						TB713	123x27	
						TBK301		
1.6	K4M 760, K4M 761	83	08/03 →	⊗	A/C(-), →05/06	MVB1135R5	5PK1135	
				⊗	A/C(-), 02/05 →	MVB1200R6	6PK1200	
				⊗	A/C(+), →05/05	MVB1200R5	5PK1200	
						TB636	132x27	
						TBK267		
1.6 Flex-Fuel		77	02/08 →			MVB1200R6	6PK1200	
						TB636	132x27	
						TBK267		
1.9 dCi	F9Q 800	88	08/03 →			MVB1125R7	7PK1125	
						TB756	133x26	
						TBK322		
	68	03/04 →					MVB1125R7	7PK1125
							TB756	133x26
							TBK322	
F9Q 803	96	05/05 →				MVB1125R7	7PK1125	
						TB756	133x26	
						TBK322		
81	05/05 →					MVB1125R7	7PK1125	
						TB756	133x26	
						TBK322		
2.0	F4R 770, F4R 771	99	08/03 →			MVB1125R7	7PK1125	
						TB652	126x27	

MEGANE II Saloon (LMO/1_)

1.4	K4J 732	60	09/03 →			A/C(-)	MVB1135R5	5PK1135
						A/C(+)	MVB1200R5	5PK1200
							TB636	132x27
							TBK267	
K4J 730	72	09/03 →				A/C(-)	MVB1135R5	5PK1135
						A/C(-)	MVB1200R6	6PK1200
						A/C(+)	MVB1200R5	5PK1200
							TB636	132x27
							TBK267	



kW



RENAULT

...RENAULT

...MEGANE II Saloon (LMO/1_)

1.5 dCi		60	09/03 →	⊗	A/C(-)	MVB1200R6	6PK1200				
				⊗	A/C(-), →09/05	MVB1135R5	5PK1135				
1.5 dCi		74	02/04 →	⊗	A/C(+), →01/05	MVB1200R5	5PK1200				
				⊗		TB713	123x27				
				⊗		TBK301					
				⊗	A/C(-), →08/05	MVB1135R5	5PK1135				
				⊗	A/C(+), →01/05	MVB1200R5	5PK1200				
				⊗	A/C(+), 01/05→08/05	MVB1200R6	6PK1200				
				⊗	→08/05	TB713	123x27				
				⊗	→08/05	TBK301					
				K9K 724	63	05/05 →	⊗	A/C(-)	MVB1200R6	6PK1200	
							⊗	A/C(-), →09/05	MVB1135R5	5PK1135	
K9K 732	78	05/05 →	⊗	A/C(-)	MVB1200R6	6PK1200					
					⊗	A/C(-), →09/05	MVB1135R5	5PK1135			
					⊗		TB713	123x27			
					⊗		TBK301				
	76	01/07 →	⊗	A/C(+)	MVB1200R6	6PK1200					
			⊗		TB713	123x27					
			⊗		TBK301						
1.6	K4M 760, K4M 761	83	09/03 →	⊗	A/C(-)	MVB1135R5	5PK1135				
					⊗	A/C(-), 04/05→	MVB1200R6	6PK1200			
					⊗	A/C(+), →04/05	MVB1200R5	5PK1200			
					⊗		TB636	132x27			
			⊗		TBK267						
1.9 dCi	F9Q 800	88	09/03 →	⊗		MVB1125R7	7PK1125				
					⊗		TB756	133x26			
					⊗		TBK322				
					68	03/04 →	⊗		MVB1125R7	7PK1125	
								⊗		TB756	133x26
								⊗		TBK322	
								96	05/05 →	⊗	
					⊗		TB756				133x26
⊗		TBK322									
81	05/05 →	⊗		MVB1125R7	7PK1125						
			⊗		TB756	133x26					
			⊗		TBK322						
2.0	F4R 770, F4R 771	99	09/03 →	⊗		MVB1125R7	7PK1125				
					⊗		TB652	126x27			

MEGANE Scenic (JAO/1_)

1.4 i (JAOE)	E7J 764	55	01/97 → 09/99	⊗		MVB715R3	3PK715	
					⊗		TB257	95x17
					⊗		TBK002	
					⊗	A/C(-)	MVB838R3	3PK838
					⊗	A/C(+), →06/97	MVB1260R4	4PK1260
1.6 e (JAOE)	K7M 702, K7M 703	66	01/97 → 09/99	⊗	⊗	MVB1272R4	4PK1272	
					⊗		MVB715R3	3PK715
					⊗		TB257	95x17
					⊗		TBK002	
					⊗	A/C(-)	MVB838R3	3PK838
1.6 i (JAOE)	K7M 720	55	01/97 → 09/99	⊗	⊗	MVB1260R4	4PK1260	
					⊗	A/C(+), →06/97	MVB1272R4	4PK1272
					⊗	A/C(+), 07/97→	MVB715R3	3PK715
					⊗		TB529	96x17
					⊗		TBK096	
1.9 D (JAOJ)	F8Q 790	47	03/97 → 09/99	⊗	⊗	MVB838R3	3PK838	
					⊗	A/C(-)	MVB1263R5	5PK1263
					⊗	A/C(+)	MVB1137R6	6PK1137
					⊗	A/C(-)	MVB1642R6	6PK1642
					⊗		TB545	153x25.4
			⊗		TBK098			



kW



...RENAULT

...MEGANE Scenic (JAO/1_)

1.9 dT (JAOK, JAOY)	F8Q 784, F8Q 786	66	01/97 → 09/99	⊗	A/C(-)	MVB1137R6	6PK1137
				⊗	A/C(+)	MVB1642R6	6PK1642
						TB545	153x25.4
						TBK098	
1.9 dTi (JAON)	F9Q 730, F9Q 734	72	04/97 → 09/99	⊗	A/C(-)	MVB1137R6	6PK1137
				⊗	A/C(+)	MVB1642R6	6PK1642
						TB545	153x25.4
						TBK098	
2.0 i (JA0G)	F3R 750, F3R 751	84	01/97 → 09/99	⊗	Eng. F3R750, A/C(-)	MVB1125R6	6PK1125
				⊗	Eng. F3R750, A/C(+)	MVB1660R6	6PK1660
						TB431	127x19
F3R 796	80	01/99 → 09/99		⊗	A/C(-)	MVB1125R6	6PK1125
				⊗	A/C(+)	MVB1660R6	6PK1660
						TB431	127x19

MODUS (F/JPO_)

1.2		48	05/05 →	⊗	A/C(-)	MVB880R7	7PK880
				⊗	A/C(+)	MVB1035R7	7PK1035
						TB712	95x23.4
						TBK315	
		58	12/04 →	⊗	A/C(-)	MVB880R7	7PK880
				⊗	A/C(+)	MVB1035R7	7PK1035
						TB712	95x23.4
						TBK315	
1.2 (JPOC, JPOK)	D4F 740	55	12/04 →	⊗	A/C(-)	MVB880R7	7PK880
				⊗	A/C(+)	MVB1035R7	7PK1035
						TB712	95x23.4
						TBK315	
1.2 16V		74	05/07 →	⊗	A/C(-)	MVB880R7	7PK880
				⊗	A/C(+)	MVB1035R7	7PK1035
						TB712	95x23.4
						TBK315	
1.4 (JP01, JP0J)	K4J 770	72	12/04 →	⊗	A/C(-), →05/06	MVB1135R5	5PK1135
				⊗	A/C(-), 04/05→10/07	MVB1200R6	6PK1200
				⊗	A/C(+), →04/05	MVB1200R5	5PK1200
						TB636	132x27
						TBK267	
1.5 dCi	K9K 768	50	12/04 →	⊗		MVB1200R6	6PK1200
				⊗	A/C(-), →09/05	MVB1135R5	5PK1135
						TB713	123x27
						TBK301	
		63	12/04 →	⊗		MVB1200R6	6PK1200
				⊗	A/C(-), →09/05	MVB1135R5	5PK1135
				⊗	A/C(+), →01/05	MVB1200R5	5PK1200
						TB713	123x27
						TBK301	
		76	05/07 →	⊗		MVB1200R6	6PK1200
						TB713	123x27
						TBK301	
		48	12/04 →	⊗	A/C(-), →10/07	MVB1135R5	5PK1135
				⊗	A/C(-), →10/07	MVB1200R6	6PK1200
				⊗	A/C(+), →01/05	MVB1200R5	5PK1200
						TB713	123x27
						TBK301	
1.5 dCi (JPOG, JPOH)		78	05/05 →	⊗		MVB1200R6	6PK1200
				⊗	A/C(-), →10/07	MVB1135R5	5PK1135
						TB713	123x27
						TBK301	
1.6		65	12/04 →	⊗	A/C(-), 08/05→	MVB1200R6	6PK1200
				⊗	A/C(-), 08/05→05/06	MVB1135R5	5PK1135
						TB636	132x27



kw



RENAULT

...RENAULT

...MODUS (F/JPO_)

1.6 (JP0B)	K4M 790, K4M 791	82	12/04 →		A/C(-), →05/06	MVB1135R5	5PK1135
					A/C(-), 08/05 →	MVB1200R6	6PK1200
					A/C(+)	MVB1200R5	5PK1200
						TB636	132x27

RAPID Box (F40_, G40_)

1.0		27	02/86 → 05/92		→08/91	SVB101140	10x1140
1.1 (F401)	C1E 750, C1E 752, C1E 754, C1E 760, C1E 762, C1E 792	33	07/85 → 04/95			SVB101140	10x1140
1.1 (F40H)	C1E 756	33	06/87 → 09/91			SVB101140	10x1140
1.2 (F406, G40A)	C3G 710, C3G 712	40	09/91 → 03/98			SVB101140	10x1140
1.4		59	05/95 → 08/97		MS	MVB1190R4	4PK1190
					A/C(-)	SVB10690	10x690
					A/C(+)	MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB813R3	3PK813
					A/C(+)	MVB1215R4	4PK1215
		54	09/91 → 08/93		MS	MVB1190R4	4PK1190
					A/C(-)	SVB10690	10x690
					A/C(+)	MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB813R3	3PK813
					A/C(+)	MVB1215R4	4PK1215
1.4 (F402)	C1J 768, C1J 780	43	07/85 → 08/91			SVB101140	10x1140
1.4 (F407) CAT	C3J 700, C3J 702, C3J 760, C3J 762	43	08/88 → 03/98		→04/95	SVB101140	10x1140
1.4 (F40D)	E7J 728	58	01/94 → 03/98		MS	MVB1190R4	4PK1190
					A/C(-)	SVB10690	10x690
					A/C(+)	MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB813R3	3PK813
					A/C(+)	MVB1215R4	4PK1215
1.4 (F40M)	C2J 784	44	03/86 → 08/91			SVB101140	10x1140
1.4 (F40U, F40V)	E7J 720, E7J 724, E7J 726, E7J 773	55	09/91 → 03/98		MS	MVB1190R4	4PK1190
					A/C(-)	SVB10690	10x690
					A/C(+)	MVB715R3	3PK715
						TB257	95x17
						TBK002	
					A/C(-)	MVB813R3	3PK813
					A/C(+)	MVB1215R4	4PK1215
1.6 D (F404)	F8M 720, F8M 730, F8M 736, F8M 760	40	03/86 → 08/98		→05/95	MVB887R5	5PK887
					→01/88	TB189	153x25.4
					02/88 → 05/95	TB258	153x25.4
					→01/88	TBK047	
					02/88 → 05/95	TBK038	
1.9 D (F40P, F40N, F40E)	F8Q 722, F8Q 724, F8Q 774, F8Q 776	47	09/91 → 03/98		→04/94	MVB900R6	6PK900
					04/94 →	MVB890R6	6PK890
					→08/96	TB292	151x25.4
					09/96 →	TB735	151x25.4
					→08/96	TBK097	
					09/96 →	TBK280	
1.9 D (F40R)	F8Q 640, F8Q 682	40	09/94 → 03/98		→08/96	MVB890R6	6PK890
					09/96 →	TB292	151x25.4
					→08/96	TB735	151x25.4
					→08/96	TBK097	
					09/96 →	TBK280	

RODEO 5

1.1		35	11/81 → 12/87			SVB10625	10x625
						SVB10665	10x665



kW



...RENAULT

SAFRANE I (B54_)

2.0 (B540)	J7R 732, J7R 733	77	11/92 → 07/96	 	A/C(-) A/C(+)	MVB887R3 MVB1215R4 TB421 SVB101250	3PK887 4PK1215 116x19 10x1250
2.0 12V (B542, B54E)	J7R 734, J7R 735	97	04/92 → 07/96	 	A/C(-) A/C(+)	MVB887R3 MVB1215R4 TB421 SVB101250	3PK887 4PK1215 116x19 10x1250
2.1 dT (B546)	J8S 760	65	11/93 → 07/96	 	A/C(-) A/C(-) A/C(+)	MVB1050R4 MVB1065R4 MVB1740R6 TB156 TBK033	4PK1050 4PK1065 6PK1740 148x25.4
				 	A/C(-) A/C(+)	SVB12760 MVB735R4	12x760 4PK735
2.2 (B541)	J7T 762	79	04/92 → 07/96	 	A/C(-) A/C(+)	MVB887R3 MVB1215R4 TB422 SVB101250	3PK887 4PK1215 118x19 10x1250
2.2 (B543)	J7T 760, J7T 761	101	04/92 → 07/96	 	A/C(-) A/C(+)	MVB887R3 MVB1215R4 TB422 SVB101250	3PK887 4PK1215 118x19 10x1250
2.5 dT (B548)	S8U 762, S8U 763	83	12/92 → 07/96	 	MAN, →09/94 MAN, 04/93→	MVB825R5 MVB563R4 TB448 MVB850R5 MVB925R5	5PK825 4PK563 95x19 5PK850 5PK925
3.0 Biturbo 4x4 (B545)	Z7X 726	193	02/93 → 07/96	 	A/C(-) A/C(+) MAN	MVB1025R6 MVB1238R6 MVB1125R4	6PK1025 6PK1238 4PK1125
3.0 V6 (B54B, B544)	Z7X 721, Z7X 722, Z7X 723	123	12/92 → 07/96	 	A/C(-) A/C(+) MAN	MVB1025R6 MVB1238R6 MVB1125R4	6PK1025 6PK1238 4PK1125
3.0 V6 4x4 (B54B, B544)	Z7X 721, Z7X 722, Z7X 723	123	12/92 → 07/96	 	A/C(-) A/C(+) MAN	MVB1025R6 MVB1238R6 MVB1125R4	6PK1025 6PK1238 4PK1125

SAFRANE II (B54_)

2.0 16V (B54L)	N7Q 710, N7Q 711	100	07/96 → 12/00	 	A/C(-), 11/96→04/00 A/C(+), 11/96→04/00 11/96→12/97 12/97→04/00	MVB1238R6 MVB1600R6 TB434 TB643	6PK1238 6PK1600 148x23 142x23
2.2 dT (B54G)	G8T 740	83	07/96 → 12/00	 	A/C(-), 11/96→04/00 A/C(+), 11/96→04/00 11/96→04/00 11/96→04/00	MVB1015R6 MVB1950R6 TB489 TBK090	6PK1015 6PK1950 163x25.4
2.5 20V (B54F)	N7U 700, N7U 701	121	07/96 → 12/00	 	A/C(-), 11/96→04/00 A/C(+), 11/96→04/00 11/96→12/97 12/97→04/00	MVB1238R6 MVB1600R6 TB434 TB643	6PK1238 6PK1600 148x23 142x23
2.9 24V (B54N)	L7X 713	140	03/99 → 12/00	 	→04/00 →04/00	MVB1600R6 TB727	6PK1600 259x32
3.0 V6	Z7X 721, Z7X 722, Z7X 723	123	07/96 → 12/00		11/96→04/00	MVB1238R6	6PK1238

SCENIC (JA0/1_)

1.4 16V (JA0D, JA1H, Ja0W, JA10)	K4J 714, K4J 750	70	09/99 → 08/03	 	Eng. K4J750, A/C(-) Eng. K4J750, A/C(+) Eng. K4J750	MVB1110R5 MVB1750R5 TB636 TBK267	5PK1110 5PK1750 132x27
----------------------------------	------------------	----	---------------	--------------	---	---	------------------------------



kw



RENAULT

...RENAULT

...SCENIC (JA0/1_)

1.6		75	03/01 → 08/03	 	A/C(-) A/C(+)	MVB1110R5 MVB1750R5 TB636 TBK267	5PK1110 5PK1750 132x27
1.6 16V (JA0B, JA04, JA11)	K4M 700, K4M 701, K4M 704, K4M 708	79	09/99 → 08/03	 	A/C(-) A/C(+)	MVB1110R5 MVB1750R5 TB636 TBK267	5PK1110 5PK1750 132x27
1.8 4x4		85	07/00 → 04/01	 		MVB1750R5 TB644	5PK1750 128x27
1.8 16V (JA12, JA1R, JA1M, JA1A)	F4P 720, F4P 722	85	01/01 → 08/03	 		MVB1750R5 TB644	5PK1750 128x27
1.9 dCi (JA05, JA1F)	F9Q 732, F9Q 733	75	11/00 → 08/03	 	03/01 → A/C(-) A/C(+), →03/01	MVB1600R6 MVB1137R6 MVB1642R6 TB546 TBK114 TBK099	6PK1600 6PK1137 6PK1642 153x26
1.9 dCi RX4	F9Q 740	75	11/00 → 08/03	 	03/01 → A/C(-) A/C(+), →03/01	MVB1600R6 MVB1137R6 MVB1642R6 TB546 TBK099 TBK114	6PK1600 6PK1137 6PK1642 153x26
1.9 dTi (JA0N)	F9Q 731, F9Q 734, F9Q 736	72	09/99 → 08/03	 	Eng. F9Q736, A/C(-), →03/01 Eng. F9Q736, A/C(+), →03/01 →03/01, Eng. F9Q 734/736 10/00 →03/01 →03/01, check kit comp. 10/00 →03/01 Eng. F9Q734, →03/01, check kit comp.	MVB1137R6 MVB1642R6 TB546 TB654 TBK114 TBK323 TBK099	6PK1137 6PK1642 153x26 153x26
1.9 dTi (JA1U)	F9Q 744	59	02/01 → 08/03	 	A/C(-) A/C(+)	MVB1137R6 MVB1600R6 TB654	6PK1137 6PK1600 153x26
2.0 16V (JA1B, JA1D)	F4R 740, F4R 741	102	07/00 → 08/03	 		MVB1750R5 TB644	5PK1750 128x27
2.0 16V IDE	F4R 740, F4R 741, F4R 744	103	09/99 → 08/03	 		MVB1750R5 TB644	5PK1750 128x27
2.0 16V RX4	F4R 744	102	06/00 → 08/03	 	A/C(+)	MVB1750R5 TB644	5PK1750 128x27

SCENIC II (JMO/1_)

1.4	K4J 730	72	06/03 →	 	A/C(-) A/C(-), →05/06 A/C(+), →05/06	MVB1200R6 MVB1135R5 MVB1200R5 TB636 TBK267	6PK1200 5PK1135 5PK1200 132x27
1.5 dCi	K9K 722	60	06/03 →	 	A/C(-) A/C(-), →09/05 A/C(+), →01/05	MVB1200R6 MVB1135R5 MVB1200R5 TB713 TBK273 TBK301	6PK1200 5PK1135 5PK1200 123x27
	K9K 728, K9K 729	74	11/03 →	 	A/C(-), →08/05 A/C(+), →01/05 A/C(+), 01/05 →08/05 →08/05 →08/05	MVB1135R5 MVB1200R5 MVB1200R6 TB713 TBK301	5PK1135 5PK1200 6PK1200 123x27



kW



...RENAULT

...SCENIC II (JM0/1_)

...1.5 dCi		63	05/05 →		A/C(-)	MVB1200R6	6PK1200
					A/C(-), →09/05	MVB1135R5	5PK1135
						TB713	123x27
						TBK301	
		78	05/05 →			MVB1200R6	6PK1200
						TB713	123x27
						TBK301	
		76	01/07 →			MVB1200R6	6PK1200
						TB713	123x27
						TBK301	
1.6 (JM0C, JM0J, JM1B)	K4M 761, K4M 782	83	06/03 →		A/C(-)	MVB1200R6	6PK1200
					A/C(-), →05/06	MVB1135R5	5PK1135
					A/C(+), →04/05	MVB1200R5	5PK1200
						TB636	132x27
1.6 16V		82	01/07 →		A/C(+)	MVB1200R6	6PK1200
						TB636	132x27
1.9 dCi		96	05/05 →			MVB1125R7	7PK1125
						TB756	133x26
						TBK322	
		81	05/05 →			MVB1125R7	7PK1125
						TB756	133x26
						TBK322	
1.9 dCi (JM12)	F9Q 812	88	06/03 →			MVB1125R7	7PK1125
						TB756	133x26
						TBK322	
2.0 (JM05, JM1N)	F4R 770, F4R 771	99	06/03 →			MVB1125R7	7PK1125
						TB652	126x27
2.0 16V Turbo (JM0W)	F4R 776	120	05/04 →			MVB1125R7	7PK1125
						TB652	126x27

SPORT SPIDER (EF0_)

2.0 16V		110	03/95 → 10/99		12/95 →	MVB825R6	6PK825
					12/95 →	TB423	148x25.4

SUPER 5 (B/C40_)

1.0 (B/C400)	C1C 700	30	10/84 → 10/88		A/C(-), MS, 04/85 →	SVB101140	10x1140
					A/C(+), 04/85 →	MVB1708R6	6PK1708
					PS, 04/85 →	SVB101150	10x1150
					04/85 →	SVB10800	10x800
1.1		35	10/89 → 12/90		A/C(-), MS	SVB101140	10x1140
					A/C(+)	MVB1708R6	6PK1708
					PS	SVB101150	10x1150
						SVB10800	10x800
1.1 (B/C401)	C1E 750, C1E 752, C1E 754	34	10/84 → 10/88		A/C(-), MS, 04/85 →	SVB101140	10x1140
					A/C(+), 04/85 →	MVB1708R6	6PK1708
					PS, 04/85 →	SVB101150	10x1150
					04/85 →	SVB10800	10x800
1.1 (B/C401, B/C40H)	C1E 750, C1E 752, C1E 756, C1E 760	33	01/86 → 03/95		A/C(-), MS	SVB101140	10x1140
					A/C(+)	MVB1708R6	6PK1708
					PS	SVB101150	10x1150
						SVB10800	10x800
1.2 (B/C40F)	C1G 702, C1G 720, C1G 722	40	01/87 → 08/90		A/C(-), MS, 07/87 → 06/89	SVB101140	10x1140
					A/C(+), 07/87 → 06/89	MVB1708R6	6PK1708
					PS, 07/87 → 06/89	SVB101150	10x1150
					07/87 → 06/89	SVB10800	10x800
1.4 (B/C407) CAT	C3J 700, C3J 702, C3J 760	43	10/85 → 12/96		A/C(-), MS, →08/94	SVB101140	10x1140
					A/C(+), →08/94	MVB1708R6	6PK1708
					PS, →08/94	SVB101150	10x1150
					→08/94	SVB10800	10x800
1.4 (B/C402)	C1J 768, C1J 780	43	10/84 → 06/88		A/C(-), MS, →08/85 →	SVB101140	10x1140
					A/C(+), 04/85 →	MVB1708R6	6PK1708
					PS, 04/85 →	SVB101150	10x1150
					04/85 →	SVB10800	10x800



kw



RENAULT

...RENAULT

...SUPER 5 (B/C40_)

1.4 (B/C403)	C2J 700, C2J 780, C2J 781, C2J 788, C2J 789, C2J 798	52	10/84 → 07/89	 	A/C(-), MS, 04/85→ A/C(+), 04/85→ PS, 04/85→ 04/85→	SVB101140 MVB1708R6 SVB101150 SVB10800	10x1140 6PK1708 10x1150 10x800
1.4 (B/C40J)	C2J 782	49	06/87 → 07/89	 	A/C(-), MS A/C(+) PS 04/85→	SVB101140 MVB1708R6 SVB101150 SVB10800	10x1140 6PK1708 10x1150 10x800
1.4 (B/C40M)	C2J 784	44	06/87 → 08/90	 	A/C(-), MS A/C(+) PS 04/85→	SVB101140 MVB1708R6 SVB101150 SVB10800	10x1140 6PK1708 10x1150 10x800
1.4 Turbo (C405)	C1J 782, C1J 784, C1J 788	88	04/85 → 08/90	 	A/C(-), MS 04/85→	SVB101175 SVB10800	10x1175 10x800
1.4 Turbo GT (C405)	840 730	118	01/85 → 05/91	 	A/C(-), MS 04/85→	SVB101175 SVB10800	10x1175 10x800
1.6 D		40	04/85 → 12/90	 	04/85→ 04/85→ 02/88→ →01/88 02/88→ →01/88 02/88→	MVB885R4 MVB887R5 TB189 TB258 TBK047 TBK038	4PK885 5PK887 153x25.4 153x25.4
1.6 D (B/C/404)	F8M 720, F8M 730	40	08/85 → 12/96	 	→04/96 →04/96 →01/88 02/88→04/96 →01/88 02/88→04/96	MVB885R4 MVB887R5 TB189 TB258 TBK047 TBK038	4PK885 5PK887 153x25.4 153x25.4
1.7 (B/C408)	F3N 716, F3N 717	54	10/86 → 03/95	 	MS, 02/87→01/92 PS, 02/87→01/92 01/88→01/92 02/87→12/87 01/88→01/92 02/87→12/87	MVB850R5 MVB1100R6 TB256 TB195 TBK017 TBK051	5PK850 6PK1100 125x19 124x19
1.7 (B/C40K, B/C40G)	F2N 740, F2N 742	64	06/87 → 03/95	 	MS, →01/92 PS, →01/92 →12/87 01/88→01/92 →12/87 01/88→01/92	MVB850R5 MVB1100R6 TB195 TB256 TBK051 TBK017	5PK850 6PK1100 124x19 125x19
1.7 i (C409)	F3N 702, F3N 722	69	10/86 → 08/91	 	MS, 02/87→ PS, 02/87→ 01/88→ 02/87→12/87 01/88→ 02/87→12/87	MVB850R5 MVB1100R6 TB256 TB195 TBK017 TBK051	5PK850 6PK1100 125x19 124x19

SUPER 5 Box (S40_)

1.0 (S400)	C1C 700	30	10/84 → 10/88	 	A/C(-), MS, 04/85→ A/C(+), 04/85→ PS, 04/85→ 04/85→	SVB101140 MVB1708R6 SVB101150 SVB10800	10x1140 6PK1708 10x1150 10x800
1.1 (S401)	C1E 750, C1E 752, C1E 754	34	10/84 → 12/96	 	A/C(-), MS, 04/85→04/96 A/C(+), 04/85→04/96 PS, 04/85→04/96 04/85→04/96	SVB101140 MVB1708R6 SVB101150 SVB10800	10x1140 6PK1708 10x1150 10x800
1.2 (S40F, S407)		44	01/87 → 12/96	 	A/C(-), MS, 07/87→06/89 A/C(+), 07/87→06/89 PS, 07/87→06/89 07/87→06/89	SVB101140 MVB1708R6 SVB101150 SVB10800	10x1140 6PK1708 10x1150 10x800



kW



...RENAULT

...SUPER 5 Box (S40_)

1.4		85	04/85 → 10/87	⊗	A/C(-), MS	SVB101140	10x1140
				⊗	A/C(+)	MVB1708R6	6PK1708
				⊗	PS	SVB101150	10x1150
44		09/85 → 07/86	⊗	⊗	A/C(-), MS	SVB10800	10x800
				⊗	A/C(+)	SVB101140	10x1140
				⊗	A/C(+)	MVB1708R6	6PK1708
				⊗	PS	SVB101150	10x1150
1.6 D (S404)		40	10/84 → 12/96	⊗	04/85→04/96	MVB885R4	4PK885
				⊗	04/85→04/96	MVB887R5	5PK887
					02/88→04/96	TB258	153x25.4
					04/85→01/88	TB189	153x25.4
					02/88→04/96	TBK038	
					04/85→01/88	TBK047	

THALIA (LBO/1/2_)

1.2 16V	D4F 712	55	04/02 →	⊗	MS, →09/05	MVB925R4	4PK925
				⊗	PS, →09/05	MVB1540R4	4PK1540
				⊗	→09/05	MVB735R3	3PK735
				⊗	→09/05	MVB753R3	3PK753
					→09/05	TB712	95x23.4
					→09/05	TBK315	
1.4	K7J 700	55	08/00 →	⊗	A/C(-), 08/02 →	MVB1110R5	5PK1110
				⊗	A/C(+), 08/02 →	MVB1755R6	6PK1755
					08/02 →	TB529	96x17
1.4 16V	K4J 712	72	08/00 →	⊗	08/02 →	TBK096	
				⊗	A/C(-), →10/03	MVB1110R5	5PK1110
				⊗	A/C(+), →10/03	MVB1750R5	5PK1750
1.5 dCi	K9K 700	48	04/02 →	⊗	→10/03	TB636	132x27
				⊗	→10/03	TBK267	
					→10/03	MVB1135R5	5PK1135
	K9K 702	60	06/01 →	⊗	A/C(-), →10/03	MVB1200R5	5PK1200
				⊗	A/C(+), →10/03	MVB1200R5	5PK1200
					→10/03	TB713	123x27
1.6 16V	K4M 740	79	04/02 →	⊗	→08/03	TBK273	
				⊗	08/03→10/03	TBK301	
					08/03→10/03	MVB1135R5	5PK1135
	K9K 702	50	02/03 →	⊗	A/C(-), →10/03	MVB1200R5	5PK1200
				⊗	A/C(+), →10/03	MVB1200R5	5PK1200
					→10/03	TB713	123x27
1.9 D	847 700, 847 701, C1J 700	35	03/80 → 04/89	⊗	→08/03	TBK273	
				⊗	08/03→10/03	TBK301	
					08/03→10/03	MVB1135R5	5PK1135
1.6 4x4	A1M 707	48	08/85 → 06/86	⊗	A/C(-)	MVB1110R5	5PK1110
				⊗	A/C(+)	MVB1750R5	5PK1750
						TB636	132x27
1.9 D	A1M 707	48	02/98 → 05/01	⊗		TBK267	
				⊗	A/C(-), MS	MVB890R6	6PK890
				⊗	A/C(-), PS	MVB1400R6	6PK1400
1.6	A1M 707	48	01/83 → 06/86	⊗	A/C(+)	MVB1190R6	6PK1190
				⊗		TB735	151x25.4
						TBK280	

TRAFIC Box (T1, T3, T4)

1.4	847 700, 847 701, C1J 700	35	03/80 → 04/89	⊗	07/80 →	SVB101225	10x1225
1.6	A1M 707, A1M 708	48	01/83 → 06/86	⊗	Eng. A1M707	SVB101010	10x1010
1.6 4x4	A1M 707	48	08/85 → 06/86	⊗	Eng. A1M707	SVB101025	10x1025
				⊗		SVB101010	10x1010
				⊗		SVB101025	10x1025



kW



RENAULT

...RENAULT

...TRAFIC Box (T1, T3, T4)

1.7	F1N 724	50	06/86 → 04/89			MVB850R5	5PK850
					→12/87	TB195	124x19
					01/88→	TB256	125x19
					→12/87	TBK051	
					01/88→	TBK017	
2.0	J5R 716, J5R 722, J5R 726	59	06/86 → 04/89			SVB101000	10x1000
						TB421	116x19
		60	05/85 → 02/89			SVB101000	10x1000
						TB421	116x19
		58	07/80 → 04/85			SVB101000	10x1000
					→ Eng Nr 376908	TB114	116x19
					Eng Nr 376909→	TB421	116x19
					→ Eng Nr 376908	TBK015	
						SVB101000	10x1000
					→ Eng Nr 376908	TB114	116x19
					Eng Nr 376909→	TB421	116x19
					→ Eng Nr 376908	TBK015	
2.0 4x4	J5R 716, J5R 722, J5R 726	59	06/86 → 04/89			SVB101000	10x1000
						TB421	116x19
2.1 D	852 750	43	09/80 → 04/89			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
		43	05/86 → 02/89			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
2.1 D 4x4	852 750	43	11/86 → 04/89			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760

TRAFIC Box (TXX)

1.4	C1J 700	35	05/89 → 06/91			SVB101225	10x1225
1.7	F1N 720	50	08/92 → 08/94			MVB850R6	6PK850
						TB256	125x19
						TBK017	
1.9 D	F8Q 606	44	06/97 → 03/01		03/00→	MVB1150R6	6PK1150
					05/98→	MVB1137R6	6PK1137
					05/98→	TB545	153x25.4
					05/98→	TBK098	
2.0	J5R 716	59	05/89 → 08/90			SVB101000	10x1000
					Eng Nr 376909→	TB421	116x19
2.1 D	852 750	43	05/89 → 06/94			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
	J8S 620, J8S 758	47	06/94 → 10/97			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
2.2	J7T 780	70	05/89 → 06/94			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760
	J7T 600	74	06/94 → 10/97			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760



kW



...RENAULT

...TRAFIC Box (TXX)

2.2 4x4	J7T 780	70	05/89 → 06/94			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760
	J7T 600	74	06/94 → 10/97			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760
2.5 D	8140.67.2500, 8140.67.2550, 8140.67.2580, S8U 750, S8U 752, S8U 758	55	05/89 → 03/01			SVB10950	10x950
						TB368	152x30
						TBK037	
2.5 D 4x4	8140.67.2500, 8140.67.2580, S8U 750, S8U 752	55	05/89 → 03/01			SVB10950	10x950
						TB368	152x30
						TBK037	

TRAFIC Bus (T5, T6, T7)

1.4	847 700, 847 701, C1J 700	35	03/80 → 04/89		07/80 →	SVB101225	10x1225
1.6	841 705, A1M 707, A1M 708	48	01/84 → 06/86		Eng. A1M707	SVB101010	10x1010
					Eng. A1M707	SVB101025	10x1025
1.6 4x4	A1M 707	48	03/80 → 08/86		07/80 →	SVB101010	10x1010
					07/80 →	SVB101025	10x1025
1.7	F1N 724	50	06/86 → 04/89			MVB850R5	5PK850
						TB256	125x19
					→12/87	TB195	124x19
						TBK017	
					→12/87	TBK051	
2.0	J5R 716, J5R 722, J5R 726	59	06/86 → 04/89			SVB101000	10x1000
		58	07/80 → 04/85			TB421	116x19
					→ Eng Nr 376908	SVB101000	10x1000
					Eng Nr 376909 →	TB114	116x19
					→ Eng Nr 376908	TB421	116x19
						TBK015	
2.0 4x4	J5R 716, J5R 722, J5R 726	59	06/86 → 04/89			SVB101000	10x1000
						TB421	116x19
2.1 D	852 750	43	03/80 → 04/89		07/80 →	SVB121030	12x1030
					07/80 →	TB156	148x25.4
					07/80 → , incl. guide pulley	TBK123	
					Manu Tensioner, 07/80 →	TBK117	
					07/80 →	SVB12760	12x760
2.1 D 4x4		43	05/85 → 02/89			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760

TRAFIC Bus (TXW)

1.7	F1N 724	50	08/92 → 08/94			MVB850R6	6PK850
						TB256	125x19
						TBK017	
1.9 D	F8Q 606	44	06/97 → 03/01		03/00 →	MVB1150R6	6PK1150
					05/98 →	MVB1137R6	6PK1137
					05/98 →	TB545	153x25.4
					05/98 →	TBK098	
2.1 D	J8S 620, J8S 758	47	06/94 → 10/97			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
2.2	J7T 780	70	05/89 → 06/94			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760
	J7T 600	74	06/94 → 10/97			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760



kW



RENAULT

...RENAULT

...TRAFIC Bus (TXW)

2.2 4x4	J7T 780	70	05/89 → 06/94			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760
	J7T 600	74	06/94 → 10/97			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760
2.5 D	8140.67.2500, 8140.67.2550, 8140.67.2580, S8U 750, S8U 752, S8U 758	55	05/89 → 03/01			SVB10950	10x950
						TB368	152x30
						TBK037	
2.5 D 4x4	8140.67.2500, 8140.67.2550, 8140.67.2580, S8U 750, S8U 752, S8U 758	55	08/89 → 03/01		09/94 →	SVB10950	10x950
					09/94 →	TB368	152x30
					09/94 →	TBK037	

TRAFIC Flatbed / Chassis (P6)

1.4	847 700, C1J 700	35	03/80 → 04/89		07/80 →	SVB101225	10x1225
1.6	841 705, A1M 705	48	03/80 → 06/86		Eng. A1M707, 07/80 →	SVB101010	10x1010
					Eng. A1M707, 07/80 →	SVB101025	10x1025
1.7	F1N 722	50	06/86 → 04/89			MVB850R5	5PK850
					→12/87	TB195	124x19
					01/88 →	TB256	125x19
					→12/87	TBK051	
					01/88 →	TBK017	
2.0	829 720, 829 721	63	03/80 → 12/86		07/80 →	SVB101000	10x1000
					07/80 →	TB421	116x19
					07/80 → 04/85, → Eng Nr 376908	TB114	116x19
					07/80 → 04/85, → Eng Nr 376908	TBK015	
	J5R 726	59	03/80 → 04/89		05/85 →	SVB101000	10x1000
					05/85 →	TB421	116x19
2.0 4x4		60	05/85 → 02/89			SVB101000	10x1000
						TB421	116x19
2.1 D	852 720	43	03/80 → 04/89		03/89 →	SVB121030	12x1030
					03/89 →	TB156	148x25.4
					03/89 →, incl. guide pulley	TBK123	
					Manu Tensioner, 03/89 →	TBK117	
					03/89 →	SVB12760	12x760
		44	05/85 → 02/89			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
		43	07/80 → 04/85			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
2.1 D 4x4		43	05/85 → 02/89			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
2.5 D	8140.61.240, S8U 720, S8U 722	51	03/80 → 04/89		10/80 →	SVB10950	10x950
					10/80 →	TB135	152x30
					10/80 →	TBK045	

TRAFIC Flatbed / Chassis (PXX)

2.0		60	03/89 → 12/91			SVB101000	10x1000
					Eng Nr 376909 →	TB421	116x19
2.0 [RWD]	J5R 726	59	05/89 → 10/97		→08/94	SVB101000	10x1000
					→08/94	TB421	116x19



kW



...RENAULT

...TRAFIC Flatbed / Chassis (PXX)

2.1 D		47	09/94 → 04/98			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
2.1 D [RWD]	852 720	43	05/89 → 06/94			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
	J8S 620, J8S 758	47	06/94 → 10/97			SVB121030	12x1030
						TB156	148x25.4
					incl. guide pulley	TBK123	
					Manu Tensioner	TBK117	
						SVB12760	12x760
2.2		74	09/94 → 04/98			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760
2.2 4x4		74	09/94 → 04/98			SVB101000	10x1000
						TB422	118x19
						SVB12760	12x760
2.5 D	8140.61.240, S8U 720, S8U 722	51	05/89 → 03/01		→04/94	SVB10950	10x950
					→04/94	TB135	152x30
					→04/94	TBK045	
		58	09/94 → 04/98			SVB10950	10x950
						TB368	152x30
						TBK037	
		56	03/89 → 08/94			SVB10950	10x950
						TB368	152x30
						TBK037	
2.5 D 4x4		58	09/94 → 01/99			SVB10950	10x950
						TB368	152x30
						TBK037	
		56	03/89 → 08/94			SVB10950	10x950
						TB368	152x30
						TBK037	

TRAFIC II Box (FL)

1.9 dCi 100	F9Q 760	74	03/01 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1120R5	5PK1120
					A/C(-), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
1.9 dCi 80	F9Q 762	60	03/01 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1120R5	5PK1120
					A/C(-), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
2.0 (FLOA)	F4R 720, F4R 722	88	03/01 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.0 16V	F4R 820	86	08/06 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.0 dCi 115	M9R 780	84	08/06 →		A/C(+)	MVB1969R7	7PK1969
2.0 dCi 90	M9R 780	66	08/06 →		A/C(+)	MVB1969R7	7PK1969



kW



RENAULT

...RENAULT

...TRAFIC II Box (FL)

2.5 dCi 135 (FLOD)	G9U 730	99	05/03 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1150R6	6PK1150
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB710	89x25
2.5 dCi 145	G9U 630	107	08/06 →		A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
					A/C(+)	MVB1788R7	7PK1788

TRAFIC II Bus (JL)

1.9 dCi 100	F9Q 760	74	03/01 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1120R5	5PK1120
					A/C(-), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
1.9 dCi 80	F9Q 762	60	03/01 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1120R5	5PK1120
					A/C(-), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
2.0 (JLOA)	F4R 720, F4R 722	88	03/01 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.0 16V	F4R 820	86	08/06 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.0 dCi 115	M9R 780	84	08/06 →		A/C(+)	MVB1969R7	7PK1969
2.0 dCi 90	M9R 780	66	08/06 →		A/C(+)	MVB1969R7	7PK1969
2.5 dCi 135 (JLOD)	G9U 730	99	05/03 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1150R6	6PK1150
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB710	89x25
2.5 dCi 145	G9U 630	107	08/06 →		A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
					A/C(+)	MVB1788R7	7PK1788

TRAFIC II Flatbed / Chassis (EL)

1.9 dCi 100 (ELOC)	F9Q 760	74	03/01 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1120R5	5PK1120
					A/C(-), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
1.9 dCi 80 (ELOB)	F9Q 762	60	03/01 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1120R5	5PK1120
					A/C(-), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
2.0 (ELOA)	F4R 720	88	03/01 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.0 dCi 115	M9R 780	84	08/06 →		A/C(+)	MVB1969R7	7PK1969
2.0 dCi 90	M9R 780	66	08/06 →		A/C(+)	MVB1969R7	7PK1969
2.5 dCi 135 (ELOD)	G9U 730	99	03/01 →		A/C(-), eng. PTO shaft (-), 03/03→07/06	MVB1150R6	6PK1150
					A/C(+), 03/03→07/06	MVB1795R6	6PK1795
					03/03→07/06	TB710	89x25
2.5 dCi 145	G9U 630	107	08/06 →		A/C(-), eng. PTO shaft (-)	MVB1115R7	7PK1115
					A/C(+)	MVB1788R7	7PK1788



kW



...RENAULT

TWINGO (C06_)

1.2 (C063, C064)	C3G 700, C3G 702	40	03/93 → 10/96	 	→06/96 A/C(-), →06/96 A/C(+), →06/96	MVB900R5 SVB101150 MVB1165R4	5PK900 10x1150 4PK1165
1.2 (C066, C068)	D7F 700, D7F 701, D7F 702, D7F 703, D7F 704	43	05/96 →	 	→04/00 Eng. D4D712, 09/98 →06/07 →04/00 Eng. D4D712, 09/98 →06/07 →06/07 05/02 →04/04 Eng. D4D712, 05/02 →04/04 Eng. D7F702, →06/07 09/00 →06/07	MVB906R5 MVB925R4 MVB735R4 MVB735R3 TB482 TB712 TBK315 TBK092 MVB905R4	5PK906 4PK925 4PK735 3PK735 87x17 95x23.4 4PK905
1.2 (C067)	D7F 700, D7F 701	40	05/96 →	 	→04/00 04/00 →08/00 →04/00 04/00 →08/00 →08/00 →08/00	MVB906R5 MVB925R4 MVB735R4 MVB735R3 TB482 TBK092	5PK906 4PK925 4PK735 3PK735 87x17
1.2 16V (C060)	D4F 708	44	08/04 →	 	→06/07 →06/07 →06/07 →06/07	MVB925R4 MVB735R3 TB482 TBK092	4PK925 3PK735 87x17
1.2 16V (C06C, C06D, C06K)	D4F 702, D4F 704	55	01/01 →	 	→06/07 →06/07 →06/07 →06/07	MVB925R4 MVB735R3 TB712 TBK315	4PK925 3PK735 95x23.4

TWINGO (CNO_)

1.2 (CNO D)	D7F 800	43	03/07 →	 	A/C(+), 08/07 → 08/07 → 08/07 →	MVB1035R7 TB482 TBK092	7PK1035 87x17
1.2 16V (CNO A)	D4F 772	56	03/07 →	 	A/C(+), 08/07 → 08/07 → 08/07 →	MVB1035R7 TB712 TBK315	7PK1035 95x23.4
1.2 Turbo (CNO C)	D4F 780	74	03/07 →	 	A/C(+), 08/07 → 08/07 → 08/07 →	MVB1035R7 TB712 TBK315	7PK1035 95x23.4
1.5 dCi (CNO E)		47	03/07 →	 	08/07 → 08/07 → 08/07 →	MVB1200R6 TB713 TBK301	6PK1200 123x27

TWINGO Box (S06_)

1.2 (S063, S064)	C3G 700, C3G 702	40	03/93 → 05/96	 	A/C(-) A/C(+)	MVB900R5 SVB101150 MVB1165R4	5PK900 10x1150 4PK1165
1.2 (S066, S068)	D7F 700, D7F 701, D7F 702, D7F 703, D7F 704, D7F 706	43	05/96 →	 	→04/00 Eng. D7F702, 09/98 →06/07 →04/00 Eng. D7F702, 09/98 →06/07 →06/07 →06/07 09/00 →06/07	MVB906R5 MVB925R4 MVB735R4 MVB735R3 TB482 TBK092 MVB905R4	5PK906 4PK925 4PK735 3PK735 87x17 4PK905

VEL SATIS (BJO_)

2.0		108	04/05 →	 		MVB1788R7 TB652	7PK1788 126x27
2.0 16 V Turbo		125	04/04 →	 		MVB1788R7 TB652	7PK1788 126x27
2.0 16V Turbo (BJOK)	F4R 762, F4R 763	120	06/02 →	 	→06/06 →06/06	MVB1795R6 TB652	6PK1795 126x27
2.0 dCi		110	08/05 →			MVB1969R7	7PK1969
	M9R 760	127	01/06 →			MVB1969R7	7PK1969



kW



RENAULT

...RENAULT

...VEL Satis (BJO_)

2.2 dCi		102	09/04 →			MVB1775R6	6PK1775
						TB710	89x25
2.2 dCi (BJOE)	G9T 702	110	06/02 →			MVB1775R6	6PK1775
						TB710	89x25
2.2 dCi (BJOH)		85	04/04 →			MVB1775R6	6PK1775
						TB710	89x25
3.0 dCi		133	06/06 →			TB750	116x25
3.0 dCi (BJOJOB)	P9X 701	130	06/02 →		→06/06	MVB1920R6	6PK1920
					→06/06	TB750	116x25
3.5 V6 (BJOV, BJOU)	V4Y 701	177	06/02 →			MVB775R4	4PK775
						MVB1100R6	6PK1100

ROVER

25 (RF)

1.1		55	09/99 → 06/01		A/C(-)	MVB735R5	5PK735
					A/C(+)	MVB1148R5	5PK1148
					A/C(+), Ch. YD471565→	MVB1165R5	5PK1165
						TB640	261x26
						TBK347	
						MVB753R3	3PK753
		44	07/01 → 05/04		A/C(-)	MVB735R5	5PK735
					A/C(+), → Ch. YD471564	MVB1148R5	5PK1148
					A/C(+), Ch. YD471565→	MVB1165R5	5PK1165
						TB234	126x23
						MVB753R3	3PK753
1.1 16V	11 K4F	55	01/04 →		A/C(-), →05/04	MVB735R5	5PK735
					A/C(+), →05/04	MVB1148R5	5PK1148
					A/C(+), →05/04, Ch. YD471565→	MVB1165R5	5PK1165
					→05/04	TB640	261x26
					→05/04	TBK347	
					→05/04	MVB753R3	3PK753
1.4 16V	14 K4M	62	10/99 →		A/C(-), →05/04	MVB735R5	5PK735
					A/C(+), →05/04, → Ch. YD471564	MVB1148R5	5PK1148
					A/C(+), →05/04, Ch. YD471565→	MVB1165R5	5PK1165
					Auto Tensioner, →05/04, Eng Nr 153523, 154155→	TB640	261x26
					Manu Tensioner, →05/04, → Eng Nr 153522, 154154	TB295	143x23
					Auto Tensioner, →05/04, Eng Nr 153523, 154155→	TBK347	
					Manu Tensioner, →05/04, → Eng Nr 153522, 154154	TBK071	
					→05/04	MVB753R3	3PK753



kW



...ROVER

...25 (RF)

...1.4 16V	14 K4F	76	10/99 →		A/C(-), →05/04	MVB735R5	5PK735
					A/C(+), →05/04, → Ch. YD471564	MVB1148R5	5PK1148
					A/C(+), →05/04, Ch. YD471565 →	MVB1165R5	5PK1165
					Auto Tensioner, →05/04, Eng Nr 153523, 154155 →	TB640	261x26
					Manu Tensioner, →05/04, → Eng Nr 153522, 154154	TB295	143x23
					Auto Tensioner, →05/04, Eng Nr 153523, 154155 →	TBK347	
					Manu Tensioner, →05/04, → Eng Nr 153522, 154154	TBK071	
					→05/04	MVB753R3	3PK753
1.6 16V	16 K4F	80	10/99 →		A/C(-), →05/04	MVB735R5	5PK735
					A/C(+), →05/04, → Ch. YD471564	MVB1148R5	5PK1148
					A/C(+), →05/04, Ch. YD471565 →	MVB1165R5	5PK1165
					Auto Tensioner, →05/04, Eng Nr 16K4FL34-149203 →	TB640	261x26
					Manu Tensioner, →05/04, → Eng Nr 16K4FL34-149202	TB295	143x23
					Auto Tensioner, →05/04, Eng Nr 16K4FL34-149203 →	TBK347	
					Manu Tensioner, →05/04, → Eng Nr 16K4FL34-149202	TBK071	
					→05/04	MVB753R3	3PK753
1.8 16V	18 K4F	85	10/99 →		A/C(-), →05/04	MVB735R5	5PK735
					A/C(+), →05/04, → Ch. YD471564	MVB1148R5	5PK1148
					A/C(+), →05/04, Ch. YD471565 →	MVB1165R5	5PK1165
					→05/04, Eng Nr 18K4FL66-148134 →	TB640	261x26
					Manu Tensioner, →05/04, → Eng Nr 18K4FL66-148133	TB295	143x23
					Auto Tensioner, →05/04, Eng Nr 18K4FL66-148134 →	TBK347	
					Manu Tensioner, →05/04, → Eng Nr 18K4FL66-148133	TBK071	
					→05/04	MVB753R3	3PK753
	18 K4K (VVC)	107	02/00 →		A/C(-), →05/04	MVB735R5	5PK735
					A/C(+), →05/04, → Ch. YD471564	MVB1148R5	5PK1148
					A/C(+), →05/04, Ch. YD471565 →	MVB1165R5	5PK1165
					→05/04	TB534	143x26
					→05/04	TB547	68x23
					→05/04	MVB753R3	3PK753
2.0 iDT	20 T2N	74	10/99 →		A/C(-), →05/04	MVB1180R6	6PK1180
					A/C(+), →05/04 →05/04, → Ch. YD471564	MVB1460R6	6PK1460
					→05/04, Ch. YD471565 →	TB477	112x28
					→05/04, → Ch. YD471564	TB651	112x30
					→05/04, Ch. YD471565 →	TB513	78x22
					→05/04, Ch. YD471565 →	TB650	78x24



kW



...ROVER

45 (RT)

ROVER

1.4	14 K4F	76	02/00 →		A/C(-), →05/04	MVB735R5	5PK735				
					A/C(+), →05/04, → Ch. YD471063	MVB1148R5	5PK1148				
					A/C(+), →05/04, Ch. YD471064→	MVB1165R5	5PK1165				
					Auto Tensioner, →05/04, Ch. 655217,646037→	TB640	261x26				
					Manu Tensioner, →05/04, → Ch. 646036,655216	TB295	143x23				
					Auto Tensioner, →05/04, Ch. 655217,646037→	TBK347					
					Manu Tensioner, →05/04, → Ch. 646036,655216	TBK071					
					→05/04	MVB753R3	3PK753				
				1.6	16 K4F	80	02/00 →		A/C(-), MAN, →05/04	MVB735R5	5PK735
									A/C(+), MAN, →05/04, → Ch. YD471063	MVB1148R5	5PK1148
	A/C(+), MAN, →05/04, Ch. YD471064→	MVB1200R5	5PK1200								
	Auto Tensioner, →05/04, Eng Nr 654923, 655077→	TB640	261x26								
	Manu Tensioner, →05/04, → Eng Nr 654922, 655076	TB295	143x23								
	Auto Tensioner, →05/04, Eng Nr 654923, 655077→	TBK347									
	Manu Tensioner, →05/04, → Eng Nr 654922, 655076	TBK071									
	→05/04	MVB753R3	3PK753								
1.8	18 K4F	86	02/00 →						A/C(-), →05/04	MVB735R5	5PK735
									A/C(+), →05/04	MVB1165R5	5PK1165
					A/C(+), →05/04, → Ch. YD471063	MVB1148R5	5PK1148				
					A/C(+), →05/04, Ch. YD471064→	MVB1200R5	5PK1200				
					→05/04	TB640	261x26				
					→05/04	TBK347					
					→05/04, Ch. YD471064→	MVB753R3	3PK753				
				2.0 iDT	20 T2N	74	02/00 →		A/C(-), PS, →05/04	MVB1180R6	6PK1180
									A/C(+), PS, →05/04	MVB1460R6	6PK1460
									→05/04, → Ch. YD471063	TB477	112x28
	→05/04, Ch. YD471064→	TB651	112x30								
	→05/04, → Ch. YD471063	TB513	78x22								
	→05/04, Ch. YD471064→	TB650	78x24								
2.0 V6	20 K4F	110	02/00 →		A/C(+), →05/04	MVB1560R6	6PK1560				
					→05/04	TB812	176x28				
					→05/04, 2 belts	TB811	58x22				



kW



...ROVER

45 Saloon (RT)

1.4	14 K4F	76	02/00 →		A/C(-), →05/04	MVB735R5	5PK735
					A/C(+), →05/04, → Ch. YD471063	MVB1148R5	5PK1148
					A/C(+), →05/04, Ch. YD471064 →	MVB1165R5	5PK1165
					Auto Tensioner, →05/04, Ch. 655217,646037 →	TB640	261x26
					Manu Tensioner, →05/04, → Ch. 646036,655216	TB295	143x23
					Auto Tensioner, →05/04, Ch. 655217,646037 →	TBK347	
					Manu Tensioner, →05/04, → Ch. 646036,655216	TBK071	
1.6	16 K4F	80	02/00 →		A/C(-), MAN, →05/04	MVB735R5	5PK735
					A/C(+), MAN, →05/04, → Ch. YD471063	MVB1148R5	5PK1148
					A/C(+), MAN, →05/04, Ch. YD471064 →	MVB1200R5	5PK1200
					Auto Tensioner, →05/04, Eng Nr 654923, 655077 →	TB640	261x26
					Manu Tensioner, →05/04, → Eng Nr 654922, 655076	TB295	143x23
					Auto Tensioner, →05/04, Eng Nr 654923, 655077 →	TBK347	
					Manu Tensioner, →05/04, → Eng Nr 654922, 655076	TBK071	
1.8	18 K4F	86	02/00 →		A/C(-), →05/04	MVB735R5	5PK735
					A/C(+), →05/04	MVB1165R5	5PK1165
					A/C(+), →05/04, → Ch. YD471063	MVB1148R5	5PK1148
					A/C(+), →05/04, Ch. YD471064 →	MVB1200R5	5PK1200
					→05/04	TB640	261x26
					→05/04	TBK347	
					→05/04, Ch. YD471064 →	MVB753R3	3PK753
2.0 iDT	20 T2N	74	02/00 →		A/C(-), PS, →05/04	MVB1180R6	6PK1180
					A/C(+), PS, →05/04	MVB1460R6	6PK1460
					→05/04, → Ch. YD471063	TB477	112x28
					→05/04, Ch. YD471064 →	TB651	112x30
					→05/04, → Ch. YD471063	TB513	78x22
					→05/04, Ch. YD471064 →	TB650	78x24
						TB811	58x22
2.0 V6	20 K4F	110	02/00 →		A/C(+), →05/04	MVB1560R6	6PK1560
					→05/04	TB812	176x28
					→05/04, 2 belts	TB811	58x22

75 (RJ)

1.8	K 1.8	88	02/99 →		A/C(-), →04/05	MVB735R5	5PK735
					A/C(+), →04/05	MVB1200R5	5PK1200
					→04/05	TB640	261x26
					→04/05	TBK347	
					→04/05	MVB735R3	3PK735



kW



ROVER

...ROVER

...75 (RJ)

1.8 Turbo		110	05/03 →	 	A/C(-), →04/05 A/C(+), →04/05 →04/05 →04/05 →04/05 →04/05	MVB735R5 MVB1200R5 TB640 TBK347 MVB735R3	5PK735 5PK1200 261x26 3PK735
2.0 CDT	M 47 R	85	02/99 →	 	→04/05 →04/05	MVB869R5 MVB2025R5	5PK869 5PK2025
2.0 CDTi	204D2	96	02/03 →	 	→04/05 →04/05	MVB869R5 MVB2025R5	5PK869 5PK2025
2.0 V6	20 K4F	110	02/99 →	 	A/C(+), →03/03 →03/03 →03/03, 2 belts	MVB1560R6 TB812 TB811	6PK1560 176x28 58x22
2.5 V6	KV 6	129	02/99 → 10/01	 	A/C(+) 2 belts	MVB1560R6 TB812 TB811	6PK1560 176x28 58x22
	25 K4F	130	10/01 →	 	A/C(+), →04/05 →04/05 →04/05, 2 belts	MVB1560R6 TB812 TB811	6PK1560 176x28 58x22

75 Tourer (RJ)

1.8	K 1.8	88	08/01 →	 	A/C(-), →04/05 A/C(+), →04/05 →04/05 →04/05 →04/05	MVB735R5 MVB1200R5 TB640 TBK347 MVB735R3	5PK735 5PK1200 261x26 3PK735
1.8 Turbo		110	05/03 →	 	A/C(-), →04/05 A/C(+), →04/05 →04/05 →04/05 →04/05	MVB735R5 MVB1200R5 TB640 TBK347 MVB735R3	5PK735 5PK1200 261x26 3PK735
2.0 CDT	M 47 R	85	08/01 →	 	→04/05 →04/05	MVB869R5 MVB2025R5	5PK869 5PK2025
2.0 CDTi	204D2	96	02/03 →	 	→04/05 →04/05	MVB869R5 MVB2025R5	5PK869 5PK2025
2.0 V6	20 K4F	110	08/01 →	 	A/C(+), →04/05 →04/05 →04/05, 2 belts	MVB1560R6 TB812 TB811	6PK1560 176x28 58x22
2.5 V6	KV 6	130	08/01 →	 	A/C(+), →04/05 →04/05 →04/05, 2 belts	MVB1560R6 TB812 TB811	6PK1560 176x28 58x22

100 (METRO) (XP)

111 C/L/S	11 K2A, 11 K2D	44	03/90 → 12/98	 	Carb SPI	MVB775R4 MVB747R4 TB234	4PK775 4PK747 126x23
114 D	TUD 3	38	10/92 → 12/94	 		SVB10700 TB245 TBK030	10x700 143x25.4
114 GSi	14 K4F	76	10/94 → 10/95	 		MVB747R4 TB295 TBK071	4PK747 143x23
114 GTI 16V	14 K4F	76	08/91 → 12/98	 		MVB747R4 TB295 TBK071	4PK747 143x23
	14 K4C, 14 K4D	69	03/90 → 08/91	 		MVB747R4 TB295 TBK071	4PK747 143x23
114 GTI/GT 16V CAT	14 K4C, 14 K4D	66	03/90 → 12/98	 	→12/94 →12/94	MVB747R4 MVB735R5 TB295 TB234 TBK071	4PK747 5PK735 143x23 126x23





kW



...ROVER

...100 (METRO) (XP)

114 S/L/GTA	14 K2A, 14 K2D	55	03/90 → 12/98	 	Carb MPI SPI	MVB775R4 MVB735R5 MVB747R4 TB234	4PK775 5PK735 4PK747 126x23
115 D	TUD 5	42	12/94 → 12/98	 		MVB775R5 TB457 TBK041	5PK775 136x25.4

100 Convertible (XP)

111	11 K2D	44	04/94 →	 	→04/99 →04/99	MVB747R4 TB234	4PK747 126x23
114	14 K2A, 14 K2D	55	04/94 →	 	MPI, →04/99 SPI, →04/99 →04/99	MVB735R5 MVB747R4 TB234	5PK735 4PK747 126x23
	14 K4F	75	03/97 → 10/98	 		MVB747R4 TB295 TBK071	4PK747 143x23

200 (RF)

211	11 K2D	44	01/98 → 03/00	 	A/C(-), →06/99 A/C(+), →06/99, → Ch. YD471564 A/C(+), →06/99, Ch. YD471565 → →06/99 →06/99	MVB735R5 MVB1148R5 MVB1165R5 TB234 MVB753R3	5PK735 5PK1148 5PK1165 126x23 3PK753
214 i	14 K2F	55	11/95 → 03/00	 	A/C(-), →06/99 A/C(+), →06/99, → Ch. YD471564 A/C(+), →06/99, Ch. YD471565 → →06/99 →06/99	MVB735R5 MVB1148R5 MVB1165R5 TB234 MVB753R3	5PK735 5PK1148 5PK1165 126x23 3PK753
214 Si	14 K4F	76	11/95 → 03/00	 	A/C(-), →06/99 A/C(+), →06/99, → Ch. YD 471564 A/C(+), →06/99, Ch. YD 471565 → Auto Tensioner, →06/99, Eng Nr 154155, 153523 → Manu Tensioner, →06/99, → Eng Nr 154154, 153522 Auto Tensioner, →06/99, Eng Nr 154155, 153523 → Manu Tensioner, →06/99, → Eng Nr 154154, 153522 →06/99	MVB735R5 MVB1148R5 MVB1165R5 TB640 TB295 TBK347 TBK071 MVB753R3	5PK735 5PK1148 5PK1165 261x26 143x23 3PK753
216 Si	16 K4F	82	11/95 → 03/00	 	A/C(+), →06/99 Auto Tensioner, →06/99 Manu Tensioner, →06/99 Manu Tensioner, →06/99 →06/99	MVB1148R5 TB640 TB295 TBK071 MVB753R3	5PK1148 261x26 143x23 3PK753



kw



ROVER

...ROVER

...200 (RF)

218 K Vi	18 K4K (VVC)	107	11/95 → 03/00		A/C(-), 03/96→06/99	MVB735R5	5PK735
					A/C(+), 03/96→06/99, → Ch. YD471564	MVB1148R5	5PK1148
					A/C(+), 03/96→06/99, Ch. YD471565→	MVB1165R5	5PK1165
					03/96→06/99	TB534	143x26
					03/96→06/99	TB547	68x23
					03/96→06/99	MVB753R3	3PK753
220 D/SD	20 T2R	63	11/95 → 03/00		A/C(-), →06/99	MVB1180R6	6PK1180
					A/C(+), →06/99	MVB1460R6	6PK1460
					→06/99, → Ch. YD 471564	TB477	112x28
					→06/99, Ch. YD 471565→	TB651	112x30
					→06/99, → Ch. YD 471564	TB513	78x22
					→06/99, Ch. YD 471565→	TB650	78x24
220 SDi	20 T2N	77	11/95 → 03/00		A/C(-), →06/99	MVB1180R6	6PK1180
					A/C(+), →06/99	MVB1460R6	6PK1460
					→06/99, → Ch. YD471564	TB477	112x28
					→06/99, Ch. YD471565→	TB651	112x30
					→06/99, → Ch. YD471564	TB513	78x22
					→06/99, Ch. YD471565→	TB650	78x24

200 (XH)

213 S	EV 2	54	09/85 → 09/89		A/C(-), → Eng Nr EV2-1240801	MVB735R3	3PK735
					A/C(-), Eng Nr EV2-1240802→	MVB760R3	3PK760
					A/C(+)	MVB753R3	3PK753
						TB203	101x24
216	16 H	61	03/85 → 09/89		A/C(-)	MVB735R4	4PK735
					A/C(-)	MVB755R4	4PK755
					A/C(+)	MVB920R4	4PK920
						TB204	110x17
						TBK059	
216 Vitesse	16 H	75	03/85 → 09/89		A/C(-)	MVB735R4	4PK735
					A/C(-)	MVB755R4	4PK755
					A/C(+)	MVB920R4	4PK920
						TB204	110x17
						TBK059	

200 Coupe (XW)

216	D 16 A8	90	10/92 → 06/99		→02/96	MVB810R4	4PK810
					→02/96, → Ch. AD 605481	MVB760R3	3PK760
					→02/96, Ch. AD 605482→	MVB785R3	3PK785
					→02/96	TB272	124x24
					→02/96	SVB10940	10x940
220 GSi	20 T4H	100	05/94 → 06/99		A/C(-), →09/97	MVB1165R5	5PK1165
					A/C(+), →09/97	MVB1450R6	6PK1450
					→09/97	TB367	132x23
220 Turbo	20 T4G	147	10/92 → 06/99		A/C(-), →09/97	MVB1165R5	5PK1165
					A/C(+), →09/97	MVB1450R6	6PK1450
					→09/97	TB367	132x23

200 Hatchback (XW)

214	14 K2A, 14 K2D	55	09/93 → 10/95		A/C(+)	MVB1148R5	5PK1148
					Eng. 14K2A, A/C(-)	MVB747R4	4PK747
						TB234	126x23
					Eng. 14K2A	MVB753R3	3PK753



kW



...ROVER

...200 Hatchback (XW)

214 GSi/Si	14 K4F	76	12/92 → 10/95	 	A/C(-) A/C(+)	MVB747R4 MVB1148R5 TB295 TBK071 MVB753R3	4PK747 5PK1148 143x23 3PK753
	14 K4C	70	01/90 → 10/95	 	A/C(-), →09/92 A/C(+), →09/92 →09/92 →09/92 →09/92	MVB747R4 MVB1148R5 TB295 TBK071 MVB753R3	4PK747 5PK1148 143x23 3PK753
214 Si/Gsi	14 K4C, 14 K4D	66	10/89 → 10/95	 	A/C(-) A/C(+)	MVB747R4 MVB1148R5 TB295 TBK071 MVB753R3	4PK747 5PK1148 143x23 3PK753
216 GSi	D 16 Z2	82	10/89 → 10/95	 	→ Ch. AD 605481 Ch. AD 605482 →	MVB810R4 MVB760R3 MVB785R3 TB317 TBK070 SVB10888	4PK810 3PK760 3PK785 107x24 10x888
	D 16 A7	85	10/89 → 10/95	 	→ Ch. AD 605481 Ch. AD 605482 →	MVB810R4 MVB760R3 MVB785R3 TB317 TBK070 SVB10888	4PK810 3PK760 3PK785 107x24 10x888
216 GTi	D 16 A8	90	09/90 → 10/95	 	→09/92 10/92 → → Ch. AD 605481 Ch. AD 605482 →	MVB870R4 MVB810R4 MVB760R3 MVB785R3 TB272 SVB10940	4PK870 4PK810 3PK760 3PK785 124x24 10x940
	D 16 A9	96	09/90 → 10/95	 	→09/92 10/92 → → Ch. AD 605481 Ch. AD 605482 →	MVB870R4 MVB810R4 MVB760R3 MVB785R3 TB272 SVB10940	4PK870 4PK810 3PK760 3PK785 124x24 10x940
218 D		52	09/91 → 10/95	 	→10/92 10/92 →	MVB700R5 TB560 TBK019 TBK020 SVB10710	5PK700 136x25.4 10x710
218 TD	XUD 7TE	65	09/91 → 10/95	 	→10/92 10/92 →	MVB700R5 TB560 TBK019 TBK020 SVB10710	5PK700 136x25.4 10x710
220 GTi	20 T4H	100	01/93 → 10/95	 	A/C(-) A/C(+)	MVB1165R5 MVB1450R6 TB367	5PK1165 6PK1450 132x23
	20 M4F	103	09/91 → 10/95	 	A/C(-), →10/92 A/C(-), 10/92 → A/C(+) →10/92 10/92 →	MVB1148R5 MVB1165R5 MVB1450R6 TB308 TB367	5PK1148 5PK1165 6PK1450 157x23 132x23
220 Turbo	20 T4G	147	01/93 → 10/95	 	A/C(-) A/C(+)	MVB1165R5 MVB1450R6 TB367	5PK1165 6PK1450 132x23

ROVER



kw



...ROVER

400 (RT)

ROVER

414 Si	14 K4F	76	05/95 → 03/00	⊗	A/C(-), →02/96	MVB747R4	4PK747			
				⊗	A/C(-), 03/96→06/99	MVB735R5	5PK735			
				⊗	A/C(+), →06/99, → Ch. YD 471063	MVB1148R5	5PK1148			
				⊗	A/C(+), 03/96→06/99, Ch. YD 471064→	MVB1200R5	5PK1200			
					Auto Tensioner, 03/96→06/99, Ch. 655217, 646037→	TB640	261x26			
					Manu Tensioner, →06/99, → Ch. 646036,655216	TB295	143x23			
				KIT	Auto Tensioner, 03/96→06/99, Ch. 655217, 646037→	TBK347				
				KIT	Manu Tensioner, →06/99, → Ch. 646036, 655216	TBK071				
				⊕	→06/99	MVB753R3	3PK753			
				416 Si	16 K4F	82	05/95 → 03/00	⊗	A/C(-), 03/96→06/99	MVB735R5
⊗	A/C(+), Auto Tensioner, 03/96→06/99, Ch. YD471064→	MVB1165R5	5PK1165							
⊗	A/C(+), Manu Tensioner, 03/96→06/99, → Ch. YD471063	MVB1148R5	5PK1148							
	Auto Tensioner, 09/98→06/99, Eng Nr 16K4FK79654923→	TB640	261x26							
	Manu Tensioner, 03/96→08/98, → Eng Nr 16K4FK79654922	TB295	143x23							
KIT	Auto Tensioner, 09/98→06/99, Eng Nr 16K4FK79654923→	TBK347								
KIT	Manu Tensioner, 03/96→08/98, → Eng Nr 16K4FK79654922	TBK071								
⊕	03/96→06/99	MVB753R3	3PK753							
D 16 Y2	83	05/95 → 03/00	⊗					→ Ch. AD250028	MVB800R4	4PK800
			⊗					Ch. AD250029→	MVB825R4	4PK825
			⊗	→02/96, → Ch. AD605481	MVB790R4	4PK790				
			⊗	→02/96, Ch. AD605482→	MVB760R3	3PK760				
			⊗	A/C(-), MAN	MVB785R3	3PK785				
			⊗	A/C(+), MAN, → Ch. YD471063	MVB735R5	5PK735				
			⊗	A/C(+), MAN, Ch. 471064→	MVB1148R5	5PK1148				
			⊗	A/C(+), MAN, Ch. YD471064→	MVB1200R5	5PK1200				
				→06/99, → Eng Nr D16Y3-E299999	MVB1165R5	5PK1165				
				03/96→06/99, Eng Nr D16B2-E100001→	TB317	107x24				
	Eng Nr D16B2-E100001→	TB450	103x24							
	→06/99, → Eng Nr D16Y3-E299999	TB451	104x24							
KIT		TBK297								
KIT		TBK070								
⊕	→ Ch. AD250028	MVB810R4	4PK810							
⊕	→02/96	SVB10888	10x888							
⊕	Ch. AD250029→	MVB870R4	4PK870							
⊕	MAN	MVB753R3	3PK753							
420 D	20 T2R	63	11/95 → 03/00	⊗	A/C(-), →06/99	MVB1180R6	6PK1180			
				⊗	A/C(+), →06/99	MVB1460R6	6PK1460			
					→06/99, → Ch. YD471063	TB477	112x28			
					→06/99, Ch. YD471064→	TB651	112x30			
					→06/99, → Ch. YD471063	TB513	78x22			
					→06/99, Ch. YD471064→	TB650	78x24			



kW



...ROVER

...400 (RT)

420 Di	20 T2N	77	05/95 → 03/00	 	A/C(-), →06/99 A/C(+), →06/99 →06/99, → Ch. YD471063 →06/99, Ch. YD471064 → →06/99, → Ch. YD471063 →06/99, Ch. YD471064 →	MVB1180R6 MVB1460R6 TB477 TB651 TB513 TB650	6PK1180 6PK1460 112x28 112x30 78x22 78x24
420 Si Lux	20 T4H	100	12/95 → 03/00	 	A/C(-), PS, →06/99 A/C(+), PS, →06/99 →06/99	MVB1165R5 MVB1450R6 TB367	5PK1165 6PK1450 132x23

400 (XW)

414	14 K4C	70	01/93 → 04/95	 	A/C(-) A/C(+)	MVB747R4 MVB1148R5 TB295 TBK071 MVB753R3	4PK747 5PK1148 143x23 3PK753
414 GSI/SI	14 K4C, 14 K4D	66	04/90 → 04/95	 	A/C(-) A/C(+)	MVB747R4 MVB1148R5 TB295 TBK071 MVB753R3	4PK747 5PK1148 143x23 3PK753
414 GSI/SI CAT	14 K4F	76	01/93 → 04/95	 	A/C(-) A/C(+)	MVB747R4 MVB1148R5 TB295 TBK071 MVB753R3	4PK747 5PK1148 143x23 3PK753
416 GSI	D 16 Z2	82	04/90 → 04/95	 	→09/92 10/92 → → Ch. AD605481 Ch. AD605482 →	MVB870R4 MVB810R4 MVB760R3 MVB785R3 TB317 TBK070 SVB10888	4PK870 4PK810 3PK760 3PK785 107x24 10x888
416 GTI	D 16 A8	90	04/90 → 04/95	 	→09/92 10/92 → → Ch. AD605481 Ch. AD605482 →	MVB870R4 MVB810R4 MVB760R3 MVB785R3 TB272 SVB10940	4PK870 4PK810 3PK760 3PK785 124x24 10x940
416 GTI/GTE	D 16 A9	96	04/90 → 04/95	 	→09/92 10/92 → → Ch. AD605481 Ch. AD605482 →	MVB870R4 MVB810R4 MVB760R3 MVB785R3 TB272 SVB10940	4PK870 4PK810 3PK760 3PK785 124x24 10x940
418 D		49	09/91 → 04/95	 	→09/92 →09/92 →09/92 →09/92	MVB700R5 TB560 TBK019 SVB10710	5PK700 136x25.4 10x710
418 TD	XUD 7TE	65	09/91 → 04/95	 	→10/92 10/92 →	MVB700R5 TB560 TBK019 TBK020 SVB10710	5PK700 136x25.4 10x710
420 GSI/SLI/GTI/Vite	20 T4H	100	01/93 → 04/95	 	A/C(-) A/C(+), PS	MVB1165R5 MVB1450R6 TB367	5PK1165 6PK1450 132x23
420 GTI/GSI/Vitesse	20 M4F	103	02/92 → 04/95	 	A/C(-), →09/92 A/C(-), 10/92 → A/C(+), PS →09/92 10/92 →	MVB1148R5 MVB1165R5 MVB1450R6 TB308 TB367	5PK1148 5PK1165 6PK1450 157x23 132x23



kw



ROVER

...ROVER

...400 (XW)

420 Turbo	20 T4G	147	01/93 → 04/95		A/C(-)	MVB1165R5	5PK1165
					A/C(+), PS	MVB1450R6	6PK1450
						TB367	132x23

400 Hatchback (RT)

414		55	03/96 → 12/97		A/C(-)	MVB735R5	5PK735
					A/C(+), → Ch. YD 471063	MVB1148R5	5PK1148
					A/C(+), Ch. YD 471064 →	MVB1200R5	5PK1200
						TB234	126x23
						MVB753R3	3PK753

414 Si	14 K4F	76	05/95 → 03/00		A/C(-), →02/96	MVB747R4	4PK747
					A/C(-), 03/96 →06/99	MVB735R5	5PK735
					A/C(+), →06/99, → Ch. YD 471063	MVB1148R5	5PK1148
					A/C(+), 03/96 →06/99, Ch. YD 471064 →	MVB1200R5	5PK1200
					Auto Tensioner, 03/96 →06/99, Ch. 655217, 646037 →	TB640	261x26
					Manu Tensioner, →06/99, → Ch. 646036,655216	TB295	143x23
					Auto Tensioner, 03/96 →06/99, Ch. 655217, 646037 →	TBK347	
					Manu Tensioner, →06/99, → Ch. 646036, 655216	TBK071	
					→06/99	MVB753R3	3PK753

416 Si	16 K4F	82	05/95 → 03/00		A/C(-), 03/96 →06/99	MVB735R5	5PK735
					A/C(+), Auto Tensioner, 03/96 →06/99, Ch. YD471064 →	MVB1165R5	5PK1165
					A/C(+), Manu Tensioner, 03/96 →06/99, → Ch. YD471063	MVB1148R5	5PK1148
					Auto Tensioner, 09/98 →06/99, Eng Nr 16K4FK79654923 →	TB640	261x26
					Manu Tensioner, 03/96 →08/98, → Eng Nr 16K4FK79654922	TB295	143x23
					Auto Tensioner, 09/98 →06/99, Eng Nr 16K4FK79654923 →	TBK347	
					Manu Tensioner, 03/96 →08/98, → Eng Nr 16K4FK79654922	TBK071	

	D 16 Y2	83	06/95 → 03/00		03/96 →06/99, → Ch. AD250028	MVB753R3	3PK753
					03/96 →06/99, Ch. AD250029 →	MVB800R4	4PK800
					03/96 →06/99	MVB825R4	4PK825
					03/96 →06/99, → Eng Nr D16Y3-E299999	MVB790R4	4PK790
					03/96 →06/99, Eng Nr D16B2-E100001 →	TB317	107x24
					03/96 →06/99, Eng Nr D16B2-E100001 →	TB450	103x24
					03/96 →06/99, Eng Nr D16B2-E100001 →	TB451	104x24
					03/96 →06/99, → Eng Nr D16Y3-E299999	TBK070	
					03/96 →06/99, → Ch. AD250028	MVB810R4	4PK810
					03/96 →06/99, Ch. AD250029 →	MVB870R4	4PK870

420 D	20 T2R	63	11/95 → 03/00		A/C(-), →06/99	MVB1180R6	6PK1180
					A/C(+), →06/99 →06/99, → Ch. YD471063	MVB1460R6	6PK1460
					→06/99, Ch. YD471064 →	TB477	112x28
					→06/99, → Ch. YD471063	TB651	112x30
					→06/99, Ch. YD471064 →	TB513	78x22
					→06/99, Ch. YD471064 →	TB650	78x24



kW



...ROVER

...400 Hatchback (RT)

420 Di	20 T2N	77	05/95 → 03/00		A/C(-), →06/99	MVB1180R6	6PK1180
					A/C(+), →06/99	MVB1460R6	6PK1460
					→06/99, → Ch. YD471063	TB477	112x28
					→06/99, Ch. YD471064→	TB651	112x30
					→06/99, → Ch. YD471063	TB513	78x22
					→06/99, Ch. YD471064→	TB650	78x24
420 Si Lux	20 T4H	100	12/95 → 03/00		A/C(-), PS, →06/99	MVB1165R5	5PK1165
					A/C(+), PS, →06/99	MVB1450R6	6PK1450
					→06/99	TB367	132x23

400 Tourer (XW)

1.6 i	D 16 Z2	82	05/94 → 11/98		10/94→	MVB810R4	4PK810
					10/94→, → Ch. 605481	MVB760R3	3PK760
					10/94→, Ch. 605482→	MVB785R3	3PK785
					A/C(-), 10/94→	MVB735R5	5PK735
					A/C(+),	MVB1165R5	5PK1165
					Auto Tensioner, 10/94→, Ch. YD471064→		
					A/C(+),	MVB1148R5	5PK1148
					Manu Tensioner, 10/94→, → Ch. YD471063		
					10/94→	TB317	107x24
					Auto Tensioner, 09/98→,	TB640	261x26
					Eng Nr 16K4FK79654923→		
					Manu Tensioner, 10/94→,	TB295	143x23
					→ Eng Nr 16K4FK79654922		
					10/94→	TBK070	
					Auto Tensioner, 09/98→,	TBK347	
					Eng Nr 16K4FK79654923→		
					Manu Tensioner, 10/94→,	TBK071	
					→ Eng Nr 16K4FK79654922		
					10/94→	MVB753R3	3PK753
					10/94→	SVB10888	10x888
	D 16 A8	90	05/94 → 11/98		10/94→	MVB810R4	4PK810
					10/94→, → Ch. 605481	MVB760R3	3PK760
					10/94→, Ch. 605482→	MVB785R3	3PK785
					A/C(-), 10/94→	MVB735R5	5PK735
					A/C(+),	MVB1165R5	5PK1165
					Auto Tensioner, 10/94→, Ch. YD471064→		
					A/C(+),	MVB1148R5	5PK1148
					Manu Tensioner, 10/94→, → Ch. YD471063		
					10/94→	TB317	107x24
					Auto Tensioner, 09/98→,	TB640	261x26
					Eng Nr 16K4FK79654923→		
					Manu Tensioner, 10/94→,	TB295	143x23
					→ Eng Nr 16K4FK79654922		
					10/94→	TBK070	
					Auto Tensioner, 09/98→,	TBK347	
					Eng Nr 16K4FK79654923→		
					Manu Tensioner, 10/94→,	TBK071	
					→ Eng Nr 16K4FK79654922		
					10/94→	MVB753R3	3PK753
					10/94→	SVB10888	10x888
1.8 i	18 K4K (VVC)	107	06/96 → 11/98		A/C(-)	MVB735R5	5PK735
					A/C(+)	MVB1148R5	5PK1148
						TB534	143x26
						TB547	68x23
						MVB753R3	3PK753



kW



ROVER

...ROVER

...400 Tourer (XW)

1.8 TD	XUD 7TE	65	09/93 → 11/98	 	10/94 → 10/94 → 10/94 → 10/94 →	MVB700R5 TB560 TBK020 SVB10710	5PK700 136x25.4 10x710
2.0 i	20 T4H	100	05/94 → 11/98	 	A/C(-), PS, 10/94 → 02/96 A/C(+), PS, 10/94 → 02/96 10/94 → 02/96	MVB1165R5 MVB1450R6 TB367	5PK1165 6PK1450 132x23

600 (RH)

618 i/Si	F 18 A3	85	03/96 → 02/99	 	A/C(-) A/C(+)	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1070R4	5PK950 5PK1100 70x16 113x24 4PK1070
620 i	F 20 Z2	85	08/93 → 06/96	 	A/C(-) A/C(+)	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1070R4	5PK950 5PK1100 70x16 113x24 4PK1070
620 Sdi	20 T2N	77	12/94 → 02/99	 	A/C(-) A/C(+)	MVB1180R6 MVB1460R6 TB477 TB513	6PK1180 6PK1460 112x28 78x22
620 Si	F 20 Z1	96	08/93 → 02/99	 	A/C(-) A/C(+)	MVB950R5 MVB1100R5 TB354 TB353 TBK290 MVB1070R4	5PK950 5PK1100 70x16 113x24 4PK1070
620 Ti Vitesse	20 T4G	147	07/94 → 02/99	 	A/C(-) A/C(+)	MVB1165R5 MVB1450R6 TB367	5PK1165 6PK1450 132x23
623 Si	H 23 A3	116	08/93 → 02/99	 	A/C(-) A/C(+)	MVB950R5 MVB1100R5 TB354 TB378 MVB1070R4	5PK950 5PK1100 70x16 127x24 4PK1070

800 (XS)

820		74	10/88 → 10/91	 	A/C(-) A/C(+)	MVB800R4 MVB1450R6 TB287 MVB638R5	4PK800 6PK1450 146x19 5PK638
820 16 V I/SI (XS)	20 HD	103	10/86 → 10/88	 	A/C(-) A/C(+)	MVB1200R5 MVB1165R5 TB308 MVB638R5	5PK1200 5PK1165 157x23 5PK638
820 16V Turbo (RS)	T 16	132	01/92 → 02/99	 	A/C(-), →10/98 A/C(+), →10/98 →10/98	MVB1165R5 MVB1413R6 TB367	5PK1165 6PK1413 132x23
820 I/SI (RS)	20 T4H	100	01/92 → 02/99	 	A/C(-), →10/98 A/C(+), →10/98 →10/98	MVB1165R5 MVB1413R6 TB367	5PK1165 6PK1413 132x23
820 SE/SI	20 HS	88	10/86 → 12/91	 	A/C(-) A/C(+), →10/88 A/C(+), 10/88 →	MVB1200R5 MVB1165R5 MVB1450R6 TB308 MVB638R5	5PK1200 5PK1165 6PK1450 157x23 5PK638



kW



...ROVER

...800 (XS)

820 SI (XS)	20 HD M 16	98	10/88 → 12/91	 	A/C(-) A/C(+)	MVB1200R5 MVB1450R6 TB308 MVB638R5	5PK1200 6PK1450 157x23 5PK638
820 Sport		145	04/94 → 03/96	 	A/C(-) A/C(+)	MVB1165R5 MVB1413R6 TB367	5PK1165 6PK1413 132x23
820e	20 HS	88	10/86 → 10/91	 	A/C(-) A/C(+), →10/88 A/C(+), 10/88→	MVB1200R5 MVB1165R5 MVB1450R6 TB308 MVB638R5	5PK1200 5PK1165 6PK1450 157x23 5PK638
825 D/SD (XS)	425 SL1RR, 492 4 SHIRG	87	01/90 → 02/99	 	A/C(-), →10/98 A/C(+), →10/98 →10/98	MVB1500R5 MVB1790R5 SVB10740	5PK1500 5PK1790 10x740
825 Si Lux (RS)	25 K4F	129	04/96 → 02/99	 	A/C(+), →10/98 →10/98 →10/98, 2 belts	MVB1550R6 TB812 TB811	6PK1550 176x28 58x22
825 Si/Sterling (XS)	C 25 A2	123	10/86 → 10/88	 		MVB915R4 TB312 SVB101050	4PK915 192x28 10x1050
		127	01/87 → 12/91	 		MVB915R4 TB312 SVB101050	4PK915 192x28 10x1050
825 Si/Sterling (XS) CAT	C 25 A1	110	10/86 → 12/91	 		MVB915R4 TB312 SVB101050	4PK915 192x28 10x1050
827 Si/Sterling (XS)	C 27 A2	130	02/88 → 12/91	 		MVB915R4 TB312 SVB101075	4PK915 192x28 10x1075
827 Si/Sterling (XS) CAT	C 27 A1	124	02/88 → 02/99	 	Cat(-) →01/96 →01/96	MVB915R4 TB312	4PK915 192x28

800 Coupe

825 SD	425 SL1RR, 492 4 SHIRG	87	09/93 → 02/99	 	A/C(-), 02/96→10/98 A/C(+), 02/96→10/98 02/96→10/98	MVB1500R5 MVB1790R5 SVB10740	5PK1500 5PK1790 10x740
825 Si (RS)	25 K4F	129	04/96 → 02/99	 	A/C(+), →10/98 →10/98 →10/98, 2 belts	MVB1550R6 TB812 TB811	6PK1550 176x28 58x22
827 24V (RS)	C 27 A1	124	08/92 → 02/99	 	→01/96 →01/96 Cat(-), →01/96	MVB915R4 TB312 SVB101075	4PK915 192x28 10x1075

800 Hatchback (XS)

2.0		74	08/87 → 10/91	 	A/C(-) A/C(+), →10/88 A/C(+), 10/88→	MVB800R4 MVB1165R5 MVB1450R6 TB287 MVB638R5	4PK800 5PK1165 6PK1450 146x19 5PK638
		120	10/88 → 10/91	 	A/C(-) A/C(+)	MVB1200R5 MVB1450R6 TB308 MVB638R5	5PK1200 6PK1450 157x23 5PK638
2.5		129	02/96 → 10/98	 	A/C(+) 2 belts	MVB1550R6 TB812 TB811	6PK1550 176x28 58x22
2.5 Si		129	02/96 → 10/98	 	A/C(+) 2 belts	MVB1550R6 TB812 TB811	6PK1550 176x28 58x22
820 16V Turbo (RS)	T 16	132	01/92 → 02/99	 	A/C(-), →10/98 A/C(+), →10/98 →10/98	MVB1165R5 MVB1413R6 TB367	5PK1165 6PK1413 132x23



kW



ROVER

...ROVER

...800 Hatchback (XS)

820 i/Si (XS)	20 HD	103	10/88 → 12/91	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1200R5 MVB1450R6 TB308 MVB638R5	5PK1200 6PK1450 157x23 5PK638
	20 T4H	100	01/93 → 02/99	⊗ ⊗ ⊗ ⊗	A/C(-), →10/98 A/C(+), →10/98 →10/98	MVB1165R5 MVB1413R6 TB367	5PK1165 6PK1413 132x23
820 SE/SI	20 HS	88	10/86 → 12/91	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+), →10/88 A/C(+), 10/88→	MVB1200R5 MVB1165R5 MVB1450R6 TB308 MVB638R5	5PK1200 5PK1165 6PK1450 157x23 5PK638
820 SI (XS)	20 HD M 16	98	10/88 → 12/91	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1200R5 MVB1450R6 TB308 MVB638R5	5PK1200 6PK1450 157x23 5PK638
820 Sport		145	04/94 → 03/96	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1165R5 MVB1413R6 TB367	5PK1165 6PK1413 132x23
825 D/SD (XS)	425 SL1RR, 492 4 SHIRG	87	01/92 → 02/99	⊗ ⊗ ⊗ ⊗	A/C(-), →01/96 A/C(+), →01/96 →01/96	MVB1500R5 MVB1790R5 SVB10740	5PK1500 5PK1790 10x740
827 24V I/SI (RS) CAT	C 27 A1	124	01/92 → 02/99	⊗ ⊗ ⊗ ⊗	→01/96 →01/96	MVB915R4 TB312	4PK915 192x28
827 Vitesse (XS) CAT	C 27 A1	124	10/88 → 12/91	⊗ ⊗ ⊗ ⊗		MVB915R4 TB312	4PK915 192x28
827 Vitesse/SLI	C 27 A2	130	10/88 → 12/91	⊗ ⊗ ⊗ ⊗	Cat(-)	MVB915R4 TB312 SVB101075	4PK915 192x28 10x1075

2000-3500 Hatchback (SD1)

2000		74	10/82 → 10/86	⊗ ⊗ ⊗ ⊗		SVB10925 TB124 SVB101100	10x925 104x17 10x1100
2300		88	09/77 → 10/86	⊗ ⊗ ⊗ ⊗		SVB131075 SVB10940 SVB10975	13x1075 10x940 10x975
2400 TD		67	05/82 → 10/86	⊗ ⊗ ⊗ ⊗		SVB101050 SVB10913	10x1050 10x913
2600	12 C, 13 C	99	09/77 → 10/82	⊗ ⊗ ⊗ ⊗		SVB131075 SVB10940 SVB10975	13x1075 10x940 10x975
2600 S	12 C, 13 C	93	10/82 → 10/86	⊗ ⊗ ⊗ ⊗		SVB131075 SVB10940 SVB10975	13x1075 10x940 10x975
3500	38 A, 39 A	115	06/76 → 10/86	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	SVB131175 SVB101125 SVB13850	13x1175 10x1125 13x850
3500 Vitesse	30 A, 31 A	142	10/82 → 10/86	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	SVB131175 SVB101125 SVB13850	13x1175 10x1125 13x850

CABRIOLET (XW)

214 1.4	14 K4C, 14 K4D	66	01/92 → 11/99	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), →09/97 A/C(+), →09/97 →09/97 →09/97 →09/97	MVB747R4 MVB1148R5 TB295 TBK071 MVB753R3	4PK747 5PK1148 143x23 3PK753
	14 K4C	70	04/90 → 09/92	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB747R4 MVB1148R5 TB295 TBK071 MVB753R3	4PK747 5PK1148 143x23 3PK753



kW



...ROVER

...CABRIOLET (XW)

214 1.4i 16V	14 K4F	76	01/93 → 11/99	⊗	A/C(-), →09/97	MVB747R4	4PK747
				⊗	A/C(+), →09/97	MVB1148R5	5PK1148
				⊗	→09/97	TB295	143x23
				⊗	→09/97	TBK071	
216 1.6i	D 16 A8	90	01/92 → 11/99	⊗	→09/97	MVB753R3	3PK753
				⊗	→09/92	MVB870R4	4PK870
				⊗	10/92→02/96	MVB810R4	4PK810
				⊗	→02/96, → Ch. AD 605481	MVB760R3	3PK760
216 1.6i 16V	16 K4F	82	01/96 → 11/99	⊗	→02/96, Ch. AD 605482→	MVB785R3	3PK785
				⊗	→02/96	TB272	124x24
				⊗	→02/96	SVB10940	10x940
				⊗	→02/96	MVB810R4	4PK810
216 1.6i 16V	16 K4F	82	01/96 → 11/99	⊗	→02/96, → Ch. AD 605481	MVB760R3	3PK760
				⊗	→02/96, Ch. AD 605482→	MVB785R3	3PK785
				⊗	A/C(-), →06/99	MVB735R5	5PK735
				⊗	A/C(+), →06/99	MVB1148R5	5PK1148
				⊗	→02/96	TB317	107x24
				⊗	→06/99	TB295	143x23
				⊗	→02/96	TBK070	
				⊗	→06/99	TBK071	
				⊗	→02/96	SVB10888	10x888
				⊗	→06/99	MVB753R3	3PK753

CITYROVER

1.4	62	01/04 →	⊗	→05/04	MVB725R4	4PK725
			⊗	→05/04	MVB1073R5	5PK1073
			⊗	→05/04	TB746	106x24

COUPE

1.6 16 V	82	03/96 → 11/99	⊗	A/C(-), →06/99	MVB735R5	5PK735	
			⊗	A/C(+), →06/99	MVB1148R5	5PK1148	
			⊗	→06/99	TB295	143x23	
			⊗	→06/99	TBK071		
1.8 16 V	18 K4K (VVC)	107	03/96 → 11/99	⊗	→06/99	MVB753R3	3PK753
				⊗	A/C(-), →06/99	MVB735R5	5PK735
				⊗	A/C(+), →06/99	MVB1148R5	5PK1148
				⊗	→06/99	TB534	143x26
1.8 16 V	18 K4K (VVC)	107	03/96 → 11/99	⊗	→06/99	TB547	68x23
				⊗	→06/99	MVB753R3	3PK753

MAESTRO

1.3	51	09/90 → 01/95	⊗		SVB10775	10x775
			⊗		SVB10875	10x875
			⊗		SVB10775	10x775
			⊗		SVB10875	10x875
1.6	63	09/90 → 01/95	⊗		MVB810R4	4PK810
			⊗		MVB960R4	4PK960
			⊗		TB204	110x17
			⊗	→12/93, Eng. 1600S	TBK059	
2.0 D	44	09/90 → 10/92	⊗		SVB10710	10x710
			⊗	Pulley Diam : 68	SVB10925	10x925
			⊗	Pulley Diam : 83	SVB10940	10x940
			⊗		TB219	143x30
2.0 TD	60	09/90 → 01/95	⊗		MVB788R5	5PK788
			⊗	Pulley Diam : 68	SVB10925	10x925
			⊗	Pulley Diam : 83	SVB10940	10x940
			⊗		TB219	143x30
2.0 TD	60	09/90 → 01/95	⊗		MVB788R5	5PK788
			⊗		MVB788R5	5PK788

MINI MK I

1000	99 HD 81	30	01/92 → 06/93	⊗	AUTO, →09/92	SVB10813	10x813
				⊗	MAN, →09/92	SVB10840	10x840



kw



ROVER

...ROVER

...MINI MK I

1300	12 A2A	45	01/91 → 12/91	⊗	AUTO	SVB10813	10x813
				⊗	MAN	SVB10840	10x840
				⊗	V-belt pulley (+)	SVB10825	10x825
				⊗	V-ribbed belt pulley (+)	MVB830R5	5PK830
	12 A2D	39	01/92 → 04/95	⊗	AUTO	SVB10813	10x813
				⊗	MAN	SVB10840	10x840
				⊗	V-belt pulley (+)	SVB10825	10x825
				⊗	V-ribbed belt pulley (+)	MVB830R5	5PK830
	12 A2E, 12 A2L	46	01/92 →	⊗	AUTO, →05/01	SVB10813	10x813
				⊗	MAN, →05/01	SVB10840	10x840
				⊗	V-belt pulley (+), →05/01	SVB10825	10x825
				⊗	V-ribbed belt pulley (+), →05/01	MVB830R5	5PK830
	12 A2B	37	10/92 →	⊗	AUTO, →05/01	SVB10813	10x813
				⊗	MAN, →05/01	SVB10840	10x840
				⊗	V-belt pulley (+), →05/01	SVB10825	10x825
				⊗	V-ribbed belt pulley (+), →05/01	MVB830R5	5PK830

MINI MK I Convertible (XN)

1300	12 A2E	46	09/92 → 04/95	⊗	AUTO	SVB10813	10x813
				⊗	MAN	SVB10840	10x840
				⊗	V-belt pulley (+)	SVB10825	10x825
				⊗	V-ribbed belt pulley (+)	MVB830R5	5PK830

MONTEGO

1.6		61	10/90 → 09/92	⊗		MVB763R4	4PK763
				⊗		TB204	110x17
				⊗		SVB10710	10x710
				⊗			
2.0 D Turbo	BB	60	10/88 → 10/95	⊗	Pulley Diam : 68, →09/94	SVB10925	10x925
				⊗	Pulley Diam : 83, →09/94	SVB10940	10x940
				⊗	→09/94	TB219	143x30
				⊗	→09/94	MVB788R5	5PK788
2.0 GTi		86	10/88 → 10/91	⊗	→06/91	MVB887R4	4PK887
				⊗	07/91 →	MVB887R5	5PK887
				⊗		TB231	104x17
				⊗		SVB10750	10x750
2.0 i CAT	20 H	75	12/90 → 10/94	⊗	→06/91	MVB887R4	4PK887
				⊗	07/91 →	MVB887R5	5PK887
				⊗		TB231	104x17
				⊗		SVB10750	10x750

MONTEGO Estate (XE)

1.3		50	10/84 → 10/88	⊗		SVB10875	10x875
				⊗			
1.6		61	10/90 → 09/92	⊗		MVB763R4	4PK763
				⊗		TB204	110x17
				⊗		SVB10710	10x710
				⊗			
2.0 GTi		86	10/88 → 10/91	⊗	→06/91	MVB887R4	4PK887
				⊗	07/91 →	MVB887R5	5PK887
				⊗		TB231	104x17
				⊗		SVB10750	10x750
2.0 GTi/LXI	20 H	75	12/90 → 12/93	⊗	→06/91	MVB887R4	4PK887
				⊗	07/91 →	MVB887R5	5PK887
				⊗		TB231	104x17
				⊗		SVB10750	10x750
2.0 Turbo-D	BB	60	01/93 → 12/93	⊗	Pulley Diam : 68	SVB10925	10x925
				⊗	Pulley Diam : 83	SVB10940	10x940
				⊗		TB219	143x30
				⊗		MVB788R5	5PK788



kW



...ROVER

STREETWISE

1.4	14 K4F	76	08/03 →		A/C(-), →05/05	MVB735R5	5PK735			
					A/C(+), →05/05, → Ch. YD471564	MVB1148R5	5PK1148			
					A/C(+), →05/05, Ch. YD471565 →	MVB1165R5	5PK1165			
					Auto Tensioner, →05/05, Eng Nr 153523, 154155 →	TB640	261x26			
					Manu Tensioner, →05/05, → Eng Nr 153522, 154154	TB295	143x23			
					Auto Tensioner, →05/05, Eng Nr 153523, 154155 →	TBK347				
					Manu Tensioner, →05/05, → Eng Nr 153522, 154154	TBK071				
					→05/05	MVB753R3	3PK753			
				14 K4M	62	08/03 →		A/C(-), →05/05	MVB735R5	5PK735
								A/C(+), →05/05, → Ch. YD471564	MVB1148R5	5PK1148
	A/C(+), →05/05, Ch. YD471565 →	MVB1165R5	5PK1165							
	Auto Tensioner, →05/05, Eng Nr 153523, 154155 →	TB640	261x26							
	Manu Tensioner, →05/05, → Eng Nr 153522, 154154	TB295	143x23							
	Auto Tensioner, →05/05, Eng Nr 153523, 154155 →	TBK347								
	Manu Tensioner, →05/05, → Eng Nr 153522, 154154	TBK071								
	→05/05	MVB753R3	3PK753							
2.0 TD	20 T2N	74	08/03 →					A/C(-), →05/05	MVB1180R6	6PK1180
								A/C(+), →05/05	MVB1460R6	6PK1460
					→05/05, → Ch. YD471564	TB477	112x28			
					→05/05, Ch. YD471565 →	TB651	112x30			
					→05/05, → Ch. YD471564	TB513	78x22			
					→05/05, Ch. YD471565 →	TB650	78x24			
					→05/05	MVB753R3	3PK753			
					→05/05	MVB1180R6	6PK1180			

SAAB

9-3 (YS3D)

2.0 i	B204I	96	02/98 → 09/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
2.0 SE Turbo	B204R	147	02/98 → 09/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
2.0 Turbo	B204L	136	02/98 → 09/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
	B204E	113	10/98 → 09/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
	B205R	151	10/99 → 09/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
	B205E	110	01/01 → 09/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
2.2 TiD	D223L, X 22 DTH	85	02/98 → 11/00		Eng. D223L, A/C(-)	MVB1805R6	6PK1805
					Eng. D223L, A/C(+)	MVB1904R6	6PK1904
	D223L	92	11/00 → 09/02		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB1904R6	6PK1904



kW



SAAB

...SAAB

...9-3 (YS3D)

2.3 i	B234I	110	02/98 → 09/02		A/C(-), →01/02	MVB1805R6	6PK1805
					A/C(+), →01/02	MVB2350R6	6PK2350
2.3 Turbo	B235R	165	10/98 → 09/02		A/C(-), →01/02	MVB1805R6	6PK1805
					A/C(+), →01/02	MVB2350R6	6PK2350

9-3 (YS3F)

1.8 i	Z18XE	90	01/04 →			MVB1240R5	5PK1240
						TB638	162x20
						TBK240	
1.8 t	B207E	110	09/02 →			MVB1030R5	5PK1030
1.9 TiD	Z19DT	88	09/04 →		→ Ch. 51024443	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
	Z19DTH	110	09/04 →		→ Ch. 51024443	MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
2.0 T	B207R	154	09/02 →			MVB1030R5	5PK1030
	B207L	129	09/02 →			MVB1030R5	5PK1030
2.0 t BioPower		129	01/07 →			MVB1030R5	5PK1030
2.2 TiD	D223L	92	09/02 →		→10/04	MVB1904R6	6PK1904

9-3 Cabriolet (YS3D)

2.0 i	B204I	96	02/98 → 08/03		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
2.0 SE Turbo	B204R	147	02/98 → 08/03		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
2.0 Turbo	B204L	136	02/98 → 08/03		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
	B204E	113	10/98 → 08/03		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
	B205R	151	10/99 → 08/03		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
	B205E	110	01/01 → 08/03		A/C(-)	MVB1805R6	6PK1805
					A/C(+)	MVB2350R6	6PK2350
2.3 i	B234I	110	02/98 → 08/03		A/C(-), →01/02	MVB1805R6	6PK1805
					A/C(+), →01/02	MVB2350R6	6PK2350
2.3 Turbo	B235R	165	10/99 → 08/03		A/C(-), →01/02	MVB1805R6	6PK1805
					A/C(+), →01/02	MVB2350R6	6PK2350

9-3 Convertible (YS3F)

1.8 t	B207E	110	08/03 →			MVB1030R5	5PK1030
1.9 TiD	Z19DTH	110	01/06 →			MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
2.0 t	B207L	129	08/03 →			MVB1030R5	5PK1030
	B207R	154	08/03 →			MVB1030R5	5PK1030
2.0 t BioPower		129	01/07 →			MVB1030R5	5PK1030

9-3 Estate

1.8 i	Z18XE	90	03/05 →			MVB1240R5	5PK1240
						TB638	162x20
						TBK240	
1.9 TiD		88	03/05 →		→ Ch. 51024443	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
	Z19DTH	110	03/05 →		→ Ch. 51024443	MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
2.0 t	B207E	110	03/05 →			MVB1030R5	5PK1030
	B207L	129	03/05 →			MVB1030R5	5PK1030
	B207R	154	03/05 →			MVB1030R5	5PK1030
2.0 t BioPower		129	01/07 →			MVB1030R5	5PK1030



kW



...SAAB

9-5 (YS3E)

1.9 TiD	Z19DTH	110	01/06 →	 KIT		MVB1725R6 TB790 TBK306	6PK1725 199x24
2.0	B205L	136	07/00 →	 	A/C(-), AUTO, →08/05 A/C(-), MAN, →08/05 A/C(+), →08/05, → Ch. 43505871 A/C(+), →08/05, Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415
2.0 t	B205E	110	09/97 →	 	A/C(-), AUTO A/C(-), MAN A/C(+), → Ch. 43505871 A/C(+), Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415
2.0 T Biopower		132	09/05 →	 	A/C(-), AUTO A/C(-), MAN A/C(+), → Ch. 43505871 A/C(+), Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415
2.2 TiD	D223L	88	03/02 →		→08/05	MVB1904R6	6PK1904
2.3 t	B235E	125	09/97 →	 	A/C(-), AUTO, →08/05 A/C(-), MAN, →08/05 A/C(+), →08/05, → Ch. 43505871 A/C(+), →08/05, Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415
		136	01/01 →	 	A/C(-), AUTO A/C(-), MAN A/C(+), → Ch. 43505871 A/C(+), Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415
2.3 Turbo	B235R	169	10/99 → 09/01	 	A/C(-), AUTO A/C(-), MAN A/C(+), → Ch. 43505871 A/C(+), Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415
		184	09/01 →	 	A/C(-), AUTO, →08/05 A/C(-), MAN, →08/05 A/C(+), →08/05, → Ch. 43505871 A/C(+), →08/05, Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415
	B235L	162	07/03 →	 	A/C(-), AUTO A/C(-), MAN A/C(+), → Ch. 43505871 A/C(+), Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415
	B235R	191	11/05 →	 	A/C(-), AUTO A/C(-), MAN A/C(+), → Ch. 43505871 A/C(+), Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415
3.0 TiD	D308L	130	07/01 →	 KIT	→08/05 →08/05	MVB1920R6 TB750	6PK1920 116x25
3.0 V6t	B308E	147	01/98 →	 KIT	→08/05 →08/05	MVB2020R6 TB481	6PK2020 225x30

9-5 Estate (YS3E)

1.9 TiD	Z19DTH	110	01/06 →	 KIT		MVB1725R6 TB790 TBK306	6PK1725 199x24
2.0	B205L	136	07/00 → 07/01	 	A/C(-), AUTO A/C(-), MAN A/C(+), → Ch. 43505871 A/C(+), Ch. 43505872→	MVB1980R6 MVB1995R6 MVB2613R6 MVB2415R6	6PK1980 6PK1995 6PK2613 6PK2415



kw



...SAAB

...9-5 Estate (YS3E)

SAAB

2.0 t	B205E	110	10/98 →	⊗	A/C(-), AUTO	MVB1980R6	6PK1980
				⊗	A/C(-), MAN	MVB1995R6	6PK1995
				⊗	A/C(+), → Ch. 43505871	MVB2613R6	6PK2613
				⊗	A/C(+), Ch. 43505872→	MVB2415R6	6PK2415
	141	10/98 →	⊗	A/C(-), AUTO, →08/05	MVB1980R6	6PK1980	
			⊗	A/C(-), MAN, →08/05	MVB1995R6	6PK1995	
			⊗	A/C(+), →08/05, → Ch. 43505871	MVB2613R6	6PK2613	
			⊗	A/C(+), →08/05, Ch. 43505872→	MVB2415R6	6PK2415	
2.2 TiD	D223L	88	03/02 →	⊗	→08/05	MVB1904R6	6PK1904
2.3 t	B235E	125	10/98 →	⊗	A/C(-), AUTO, →08/05	MVB1980R6	6PK1980
				⊗	A/C(-), MAN, →08/05	MVB1995R6	6PK1995
				⊗	A/C(+), →08/05, → Ch. 43505871	MVB2613R6	6PK2613
				⊗	A/C(+), →08/05, Ch. 43505872→	MVB2415R6	6PK2415
	136	01/01 →	⊗	A/C(-), AUTO	MVB1980R6	6PK1980	
			⊗	A/C(-), MAN	MVB1995R6	6PK1995	
			⊗	A/C(+), → Ch. 43505871	MVB2613R6	6PK2613	
			⊗	A/C(+), Ch. 43505872→	MVB2415R6	6PK2415	
2.3 Turbo	B235R	169	10/99 → 09/01	⊗	A/C(-), AUTO	MVB1980R6	6PK1980
				⊗	A/C(-), MAN	MVB1995R6	6PK1995
				⊗	A/C(+), → Ch. 43505871	MVB2613R6	6PK2613
				⊗	A/C(+), Ch. 43505872→	MVB2415R6	6PK2415
	184	09/01 →	⊗	A/C(-), AUTO, →08/05	MVB1980R6	6PK1980	
			⊗	A/C(-), MAN, →08/05	MVB1995R6	6PK1995	
			⊗	A/C(+), →08/05, → Ch. 43505871	MVB2613R6	6PK2613	
			⊗	A/C(+), →08/05, Ch. 43505872→	MVB2415R6	6PK2415	
	B235L	162	07/03 →	⊗	A/C(-), AUTO	MVB1980R6	6PK1980
				⊗	A/C(-), MAN	MVB1995R6	6PK1995
				⊗	A/C(+), → Ch. 43505871	MVB2613R6	6PK2613
				⊗	A/C(+), Ch. 43505872→	MVB2415R6	6PK2415
B235R	191	01/06 →	⊗	A/C(-), AUTO	MVB1980R6	6PK1980	
			⊗	A/C(-), MAN	MVB1995R6	6PK1995	
			⊗	A/C(+), → Ch. 43505871	MVB2613R6	6PK2613	
			⊗	A/C(+), Ch. 43505872→	MVB2415R6	6PK2415	
3.0 TiD	D308L	130	07/01 →	⊗	→08/05	MVB1920R6	6PK1920
				⊗	→08/05	TB750	116x25
3.0 V6t	B308E	147	10/98 →	⊗	→08/05	MVB2020R6	6PK2020
				⊗	→08/05	TB481	225x30

9-7X

4.2		213	12/05 →	⊗	Alt. 130A	MVB2300R6	6PK2300
5.3		220	12/05 →	⊗		MVB925R4	4PK925
				⊗		MVB2350R6	6PK2350

90

2.0	B 20 I	74	08/84 → 08/87	⊗		SVB10975	10x975
-----	--------	----	---------------	---	--	-----------------	--------

99

2.0	B 20 P	70	10/72 → 08/74	⊗	→ Ch. 99014259	SVB10825	10x825
				⊗	→08/73, Ch. 99736000001→	SVB10975	10x975
				⊗	Ch. 99020001→99726008665	SVB10775	10x775
2.0 EMS	B 20 I	87	09/74 → 12/78	⊗		SVB10975	10x975
				⊗		SVB10813	10x813
	81	04/72 → 08/74	⊗	→ Ch. 99014259	SVB10825	10x825	
			⊗	→08/73, Ch. 99736000001→	SVB10975	10x975	
2.0 GL	B 20 C, B 20 I	74	09/74 → 12/84	⊗	Ch. 99020001→99726008665	SVB10775	10x775
				⊗		SVB10975	10x975
				⊗	→04/81	SVB10813	10x813



kW



...SAAB

99 Combi Coupe

1.85		65	10/70 → 05/74	⊗ ⊗ ⊗ ⊗	→ Ch. 99014259 →08/73, Ch. 99736000001→ Ch. 99020001→99726008665	SVB10825 SVB10975 SVB10775	10x825 10x975 10x775
1.85 i		71	10/71 → 09/72	⊗ ⊗ ⊗	→ Ch. 99014259 Ch. 99020001→99722031968 Ch. 99736000001→	SVB10825 SVB10775 SVB10975	10x825 10x775 10x975
2.0		79	03/76 → 05/78	⊗ ⊗		SVB10975 SVB10813	10x975 10x813

900 I (AC4, AM4)

2.0	B20I	98	10/87 → 10/91	⊗ ⊗ ⊗ ⊗ ⊗	Inj. → Ch. G2024751 Inj, Ch. G3014892,H7004142→	SVB131200 SVB131175 SVB10975 SVB101175 SVB10825	13x1200 13x1175 10x975 10x1175 10x825
2.0 -16	B20I	93	01/89 → 12/93	⊗ ⊗ ⊗ ⊗	Ch. G3014892,H7004142→ → Ch. J3040028,J7050311 Ch. J3040029,J7050312→	SVB131175 SVB10975 SVB101175 SVB10825	13x1175 10x975 10x1175 10x825
	B202XI	92	01/86 → 12/88	⊗ ⊗ ⊗ ⊗ ⊗	→ Ch. G2024751 Ch. G3014892,H7004142→ → Ch. K3000505,K7000622 Ch. J3040029,J7050312→	SVB131200 SVB131175 SVB10975 SVB101175 SVB10825	13x1200 13x1175 10x975 10x1175 10x825
2.0 c	B20T, BT 20	79	11/80 → 08/84	⊗ ⊗ ⊗ ⊗	Inj, Ch. G2024752→ 01/82→, Ch. C3007693, C6002219→K3010693,K7015707 01/82→, Ch. K3010694, K7015708→	SVB131175 SVB10975 SVB101175 SVB10825	13x1175 10x975 10x1175 10x825
	B 20, B201XC	74	07/82 → 12/88	⊗ ⊗ ⊗ ⊗ ⊗	→ Ch. C1022811,C2008119 Ch. C3007693, C6002219→K3010693,K7015707 Ch. K3010694,K7015708→	SVB10975 SVB101250 SVB101175 SVB10825	10x975 10x1250 10x1175 10x825
2.0 EMS	BI 20	87	01/79 → 12/80	⊗ ⊗ ⊗	Ch. G3014892,H7004142→	SVB131175 SVB10975 SVB101250	13x1175 10x975 10x1250
2.0 i	B201	81	09/85 → 08/90	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	Inj. → Ch. G2024751 Inj, Ch. G3014892,H7004142→ → Ch. C1022811,C2008119 Ch. C3007693, C6002219→K3010693,K7015707 Ch. K3010694,K7015708→	SVB131200 SVB131175 SVB10975 SVB101250 SVB101175 SVB10825	13x1200 13x1175 10x975 10x1250 10x1175 10x825
	B201XI, BI 20	85	11/80 → 08/90	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→ Ch. G3014891,H7004141 Ch. G2024752→ → Ch. C3007692,C6002218 01/82→, Ch. C3007693, C6002219→K3010693,K7015707 01/82→, Ch. K3010694, K7015708→	SVB131200 SVB131175 SVB10975 SVB101250 SVB101175 SVB10825	13x1200 13x1175 10x975 10x1250 10x1175 10x825

SAAB



kw



...SAAB

...900 I (AC4, AM4)

SAAB

2.0 S Turbo-16	B202S	104	07/91 → 12/93	☼ ⚙️ ⚙️ ⚙️	Ch. G3014892,H7004142→	SVB131175	13x1175
					→ Ch. J3040028,J7050311	SVB10975	10x975
		107	01/92 → 12/93	☼ ☼ ⚙️ ⚙️	Ch. K3000506,K7000623→ → Ch. G3014891,H7004141	SVB101175	10x1175
					Ch. G2024752→	SVB10825	10x825
					→ Ch. G3014892,H7004142→	SVB131200	13x1200
					→ Ch. G2024751	SVB10975	10x975
2.0 Turbo	B201S, BSI 20	107	10/80 → 07/85	☼ ☼ ⚙️ ⚙️	Ch. G3014892,H7004142→	SVB131175	13x1175
					→ Ch. C3007692,C6002218 01/82→,	SVB101250	10x1250
					Ch. C3007693, C6002219→K3010693,K7015707	SVB101175	10x1175
					01/82→, Ch. K3010694, K7015708→	SVB10825	10x825
	B201XL	103	10/86 → 12/91	☼ ☼ ⚙️ ⚙️	→ Ch. G3014891,H7004141	SVB131200	13x1200
					Ch. G2024752→	SVB131175	13x1175
					→ Ch. C1022811,C2008119	SVB10975	10x975
					Ch. C3007693, C6002219→K3010693,K7015707	SVB101250	10x1250
		110	01/86 → 12/88	☼ ☼ ⚙️ ⚙️	Ch. K3010694,K7015708→	SVB101175	10x1175
					→ Ch. G3014891,H7004141	SVB131200	13x1200
					Ch. G2024752→	SVB131175	13x1175
					→ Ch. C1022811,C2008119	SVB10975	10x975
					Ch. C3007693, C6002219→K3010693,K7015707	SVB101250	10x1250
					Ch. K3010694,K7015708→	SVB101175	10x1175
2.0 Turbo-16	B202XL	118	11/85 → 12/93	☼ ⚙️ ⚙️ ⚙️	Ch. G3014892,H7004142→	SVB10825	10x825
					→ Ch. J3040028,J7050311	SVB131175	13x1175
					Ch. J3040029,J7050312→	SVB10975	10x975
					→ Ch. J3040028,J7050311	SVB101175	10x1175
					Ch. J3040029,J7050312→	SVB10825	10x825
2.0 Turbo-16 S	B202XL	129	01/84 → 12/88	☼ ⚙️ ⚙️ ⚙️	Ch. G3014892,H7004142→	SVB131175	13x1175
					→ Ch. J3040028,J7050311	SVB10975	10x975
					Ch. J3040029,J7050312→	SVB101175	10x1175
					→ Ch. G3014892,H7004142→	SVB10825	10x825
					→ Ch. G3014892,H7004142→	SVB131175	13x1175
					→ Ch. J3040028,J7050311	SVB10975	10x975
					Ch. K3000506,K7000623→	SVB101175	10x1175
					→07/92, → Ch. G2024751	SVB10825	10x825
					→07/92, Ch. G3014892, H7004142→	SVB131200	13x1200
					→07/92	SVB131175	13x1175
					→07/92, → Ch. K3000505, K7000622	SVB10975	10x975
					→07/92, Ch. J3040029, J7050312→	SVB101175	10x1175
						SVB10825	10x825

900 I Combi Coupe

2.0 -16	B202I	93	01/89 → 08/92	☼ ⚙️ ⚙️ ⚙️	Ch. G3014892,H7004142→	SVB131175	13x1175
					→ Ch. K3000505,K7000622	SVB10975	10x975
					Ch. J3040029,J7050312→	SVB101175	10x1175
					→ Ch. G2024751	SVB10825	10x825
	B202XI	92	01/86 → 12/88	☼ ☼ ⚙️ ⚙️	Ch. G3014892,H7004142→	SVB131200	13x1200
					→ Ch. G2024751	SVB131175	13x1175
					→ Ch. G3014892,H7004142→	SVB10975	10x975
					→ Ch. K3000505,K7000622	SVB101175	10x1175
					Ch. K3000506,K7000623→	SVB10825	10x825
						SVB101175	10x1175



kW



...SAAB

...900 I Combi Coupe

2.0 c	B 20, B201XC	74	09/79 → 12/88	 	→08/80	SVB131200	13x1200
						SVB10875	10x875
	B20T, BT 20	79	09/78 → 08/84	 	→ Ch. C1022811,C2008119 01/82→, Ch. C3007693, C6002219→K3010693,K7015707 Ch. K3010694,K7015708→	SVB10975	10x975
						SVB101250	10x1250
	BI 20	87	09/78 → 08/79	 	→08/80	SVB101175	10x1175
						SVB10825	10x825
2.0 EMS	B201	81	09/85 → 08/90	 	→ Ch. G3014892,H7004142→	SVB131175	13x1175
						SVB10975	10x975
2.0 i	B201	81	09/85 → 08/90	 	→ Ch. C1022811,C2008119 Ch. C3007693, C6002219→K3010693,K7015707 Ch. K3010694,K7015708→	SVB101250	10x1250
						SVB101175	10x1175
	B201XI, BI 20	85	11/80 → 12/88	 	→ Ch. C1022811,C2008119 01/82→, Ch. C3007693, C6002219→K3010693,K7015707 01/82→, Ch. K3010694, K7015708→	SVB10825	10x825
						SVB131175	13x1175
2.0 S Turbo-16	B202S	104	09/91 → 07/93	 	→ Ch. G3014892,H7004142→	SVB10975	10x975
						SVB101175	10x1175
2.0 Turbo	B201S, BSI 20	107	09/78 → 07/85	 	→ Ch. J3040028,J7050311 Ch. J3040029,J7050312→	SVB10825	10x825
						SVB10875	10x875
	B201S, BSI 20	107	09/78 → 07/85	 	→ Ch. G3014892,H7004142→	SVB131175	13x1175
						SVB10975	10x975
	B201XL	103	10/86 → 12/91	 	→ Ch. C3007692,C6002218 Ch. C1022812, C2008120→K3010693,K7015707 Ch. K3010694,K7015708→	SVB101250	10x1250
						SVB101175	10x1175
	B201XL	110	01/86 → 12/88	 	→ Ch. G3014892,H7004142→	SVB10825	10x825
						SVB131175	13x1175
	B201XL	110	01/86 → 12/88	 	→ Ch. C3007692,C6002218 Ch. C1022812, C2008120→K3010693,K7015707 Ch. K3010694,K7015708→	SVB10975	10x975
						SVB101250	10x1250
	B201XL	110	01/86 → 12/88	 	→ Ch. C3007692,C6002218 Ch. C1022812, C2008120→K3010693,K7015707 Ch. K3010694,K7015708→	SVB101175	10x1175
						SVB10825	10x825

SAAB



kW



...SAAB

...900 I Combi Coupe

2.0 Turbo-16	B202XL	118	11/85 → 06/94	 	→10/93, → Ch. G2024751 →10/93, Ch. G3014892, H7004142→ →10/93 →10/93, → Ch. K3000505, K7000622 →10/93, Ch. K3000506, K7000623→	SVB131200 SVB131175 SVB10975 SVB101175 SVB10825	13x1200 13x1175 10x975 10x1175 10x825
	B202L	132	01/93 → 06/94	 	→10/93, Ch. G3014892, H7004142→ →10/93 →10/93, → Ch. K3000505, K7000622 →10/93, Ch. J3040029, J7050312→	SVB131175 SVB10975 SVB101175 SVB10825	13x1175 10x975 10x1175 10x825
2.0 Turbo-16 S	B202XL	129	02/84 → 12/88	 	Ch. G3014892,H7004142→ → Ch. J3040028,J7050311 Ch. K3000506,K7000623→	SVB131175 SVB10975 SVB101175 SVB10825	13x1175 10x975 10x1175 10x825
2.0 Turbo-16 S CAT	B202XL	125	01/89 → 12/93	 	Ch. G3014892,H7004142→ → Ch. K3000505,K7000622 Ch. J3040029,J7050312→	SVB131175 SVB10975 SVB101175 SVB10825	13x1175 10x975 10x1175 10x825
2.1 -16	B212I	100	09/90 → 07/93		→07/92, → Ch. G3014891, H7004141	SVB131200	13x1200
				 	→07/92, Ch. G2024752→ →07/92	SVB131175 SVB10975	13x1175 10x975
				 	→07/92, → Ch. K3000505, K7000622	SVB101175	10x1175
					→07/92, Ch. K3000506, K7000623→	SVB10825	10x825

900 I Convertible

2.0 -16	B202I	93	01/90 → 06/94		→10/93, Ch. G3014892, H7004142→	SVB131175	13x1175
				 	→10/93 →10/93, → Ch. J3040028, J7050311	SVB10975 SVB101175	10x975 10x1175
					→10/93, Ch. J3040029, J7050312→	SVB10825	10x825
2.0 S Turbo-16	B202S	104	09/91 → 06/94		→10/93, Ch. G3014892, H7004142→	SVB131175	13x1175
				 	→10/93 →10/93, → Ch. J3040028, J7050311	SVB10975 SVB101175	10x975 10x1175
					→10/93, Ch. J3040029, J7050312→	SVB10825	10x825
2.0 Turbo-16	B202XL	118	11/86 → 06/94		→10/93, Ch. G3014892, H7004142→	SVB131175	13x1175
				 	→10/93 →10/93, → Ch. J3040028, J7050311	SVB10975 SVB101175	10x975 10x1175
					→10/93, Ch. K3000506, K7000623→	SVB10825	10x825
2.0 Turbo-16 S	B202XL	129	11/86 → 06/94		→10/93, → Ch. G3014891, H7004141	SVB131200	13x1200
				 	→10/93, Ch. G2024752→ →10/93	SVB131175 SVB10975	13x1175 10x975
				 	→10/93, → Ch. K3000505, K7000622	SVB101175	10x1175
					→10/93, Ch. J3040029, J7050312→	SVB10825	10x825



kW



SAAB

...SAAB

...900 I Convertible

2.1 -16	B212I	100	08/90 → 06/94	⚙️	→07/92, → Ch. G3014891, H7004141	SVB131200	13x1200
				⚙️	→07/92, Ch. G2024752→	SVB131175	13x1175
				⚙️	→07/92	SVB10975	10x975
				⚙️	→07/92, → Ch. K3000505, K7000622	SVB101175	10x1175
				⚙️	→07/92, Ch. K3000506, K7000623→	SVB10825	10x825

900 II

2.0 -16 Turbo	B204L	136	07/93 → 02/98	⚙️	A/C(-), 11/93→	MVB2013R6	6PK2013
				⚙️	A/C(+), 11/93→	MVB2625R6	6PK2625
2.0 i	B204I	96	08/94 → 02/98	⚙️	A/C(-)	MVB2013R6	6PK2013
				⚙️	A/C(+)	MVB2625R6	6PK2625
2.3 -16	B234I	110	07/93 → 02/98	⚙️	A/C(-), 11/93→	MVB2013R6	6PK2013
				⚙️	A/C(+), 11/93→	MVB2625R6	6PK2625
2.5 -24 V6	B258I	125	07/93 → 02/98	⚙️	A/C(-), 11/93→	MVB1904R6	6PK1904
				⚙️	A/C(+), 11/93→	MVB2300R6	6PK2300
				⚙️	11/93→	TB481	225x30
				⚙️	11/93→	TBK091	

900 II Convertible

2.0 -16 Turbo	B204L	136	12/93 → 02/98	⚙️	A/C(-)	MVB2013R6	6PK2013
				⚙️	A/C(+)	MVB2625R6	6PK2625
2.0 i	B204I	96	12/93 → 02/98	⚙️	A/C(-)	MVB2013R6	6PK2013
				⚙️	A/C(+)	MVB2625R6	6PK2625
2.3 -16	B234I	110	12/93 → 02/98	⚙️	A/C(-)	MVB2013R6	6PK2013
				⚙️	A/C(+)	MVB2625R6	6PK2625
2.5 -24 V6	B258I	125	12/93 → 02/98	⚙️	A/C(-)	MVB1904R6	6PK1904
				⚙️	A/C(+)	MVB2300R6	6PK2300
				⚙️		TB481	225x30
				⚙️		TBK091	

900 II Coupe

2.0 -16 Turbo	B204L	136	12/93 → 02/98	⚙️	A/C(-)	MVB2013R6	6PK2013
				⚙️	A/C(+)	MVB2625R6	6PK2625
2.0 i	B206I	98	12/93 → 07/94	⚙️	A/C(-)	MVB2013R6	6PK2013
				⚙️	A/C(+)	MVB2625R6	6PK2625
	B204I	96	08/94 → 02/98	⚙️	A/C(-)	MVB2013R6	6PK2013
				⚙️	A/C(+)	MVB2625R6	6PK2625
2.3 -16	B234I	110	12/93 → 02/98	⚙️	A/C(-)	MVB2013R6	6PK2013
				⚙️	A/C(+)	MVB2625R6	6PK2625
2.5 -24 V6	B258I	125	12/93 → 02/98	⚙️	A/C(-)	MVB1904R6	6PK1904
				⚙️	A/C(+)	MVB2300R6	6PK2300
				⚙️		TB481	225x30
				⚙️		TBK091	

9000

2.0 -16	B202I	94	01/89 → 01/93	⚙️		SVB131275	13x1275
				⚙️	Alt. 70,8A, → Ch. J1028860	MVB1610R5	5PK1610
				⚙️	Alt. 115A	MVB1590R5	5PK1590
2.0 -16 CD	B204I	96	09/93 → 12/98	⚙️		SVB131250	13x1250
				⚙️	A/C(-), 01/94→	MVB2325R6	6PK2325
				⚙️	A/C(+), 01/94→	MVB2553R6	6PK2553
				⚙️	Alt. 70,8A, → Ch. J1028860	MVB1610R5	5PK1610
				⚙️	Alt. 115A, →12/93	MVB1590R5	5PK1590
	B204E	110	09/93 → 12/98	⚙️		SVB131250	13x1250
				⚙️	A/C(-), 01/94→	MVB2325R6	6PK2325
				⚙️	A/C(+), 01/94→	MVB2553R6	6PK2553
				⚙️	Alt. 70,8A, → Ch. J1028860	MVB1610R5	5PK1610
				⚙️	Alt. 115A, →12/93	MVB1590R5	5PK1590



kW



...SAAB

...9000

2.0 -16 Turbo	B202XL	118	05/88 → 08/93	☀ ☀ Ⓢ	→12/92 01/93→ Alt. 70,8A, → Ch. J2017104, J8001696	SVB131275 SVB131250 MVB1610R5	13x1275 13x1250 5PK1610			
		129	04/85 → 12/91	Ⓢ ☀ Ⓢ	Alt. 115A Alt. 70,8A, → Ch. J2017104, J8001696	MVB1590R5 SVB131275 MVB1610R5	5PK1590 13x1275 5PK1610			
2.0 -16 Turbo CD	B202S, B204E	108	09/92 → 12/98	☀ ☀ Ⓢ Ⓢ	→12/92 01/93→ A/C(-), 01/94→ A/C(+), 01/94→ Alt. 70,8A, → Ch. J2017104, J8001696	SVB131275 SVB131250 MVB2325R6 MVB2553R6 MVB1610R5	13x1275 13x1250 6PK2325 6PK2553 5PK1610			
				Ⓢ	Alt. 115A, →12/93	MVB1590R5	5PK1590			
				B202XL	120	09/88 → 08/93	☀ ☀ Ⓢ	→12/92 01/93→ Alt. 70,8A, → Ch. J2017104, J8001696	SVB131275 SVB131250 MVB1610R5	13x1275 13x1250 5PK1610
							Ⓢ	Alt. 70,8A, Ch. J1028861→	MVB1590R5	5PK1590
B202L	136	09/89 → 12/98	☀ ☀ Ⓢ Ⓢ	→12/92 01/93→ A/C(-), 01/94→ A/C(+), 01/94→ Alt. 70,8A, → Ch. J1028860	SVB131275 SVB131250 MVB2325R6 MVB2553R6 MVB1610R5	13x1275 13x1250 6PK2325 6PK2553 5PK1610				
			Ⓢ	Alt. 115A, →12/93	MVB1590R5	5PK1590				
			2.3 -16 CD	B234I	107	08/89 → 12/98	Ⓢ Ⓢ	A/C(-) A/C(+)	MVB2325R6 MVB2553R6	6PK2325 6PK2553
							2.3 -16 CD Turbo	B234L	147	07/90 → 12/98
2.3 -16 CDE	B234I	108	09/93 → 12/98	Ⓢ Ⓢ	A/C(-) A/C(+)	MVB2325R6 MVB2553R6				
				2.3 -16 CDE Eco-Power	B234E	125	09/93 → 12/98	Ⓢ Ⓢ	A/C(-) A/C(+)	MVB2325R6 MVB2553R6
2.3 -16 Turbo	B234L	143	09/90 → 08/93					Ⓢ Ⓢ	A/C(-) A/C(+)	MVB2325R6 MVB2553R6
				3.0 -24 V6 CD/CDE	B308I	155	07/94 → 12/98	Ⓢ Ⓢ	A/C(-) A/C(+)	MVB1885R6 MVB2225R6
Ⓢ Ⓢ		TB481 TBK091	225x30							

9000 Hatchback

2.0 -16	B202XI (KAT)	92	12/85 → 12/88	☀ Ⓢ	Alt. 70,8A, → Ch. J2017104, J8001696	SVB131275 MVB1610R5	13x1275 5PK1610
		Ⓢ	Alt. 115A	MVB1590R5	5PK1590		
	B202XI	94	12/85 → 08/88	☀ Ⓢ	Alt. 70,8A, → Ch. J2017104, J8001696	SVB131275 MVB1610R5	13x1275 5PK1610
				Ⓢ	Alt. 115A	MVB1590R5	5PK1590



kW



...SAAB

...9000 Hatchback

2.0 -16 CS	B202I	94	01/89 → 12/98	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→12/92 01/93→ A/C(-), 01/94→ A/C(+), 01/94→ Alt. 70,8A, → Ch. J2017104, J8001696 Alt. 115A, →12/93	SVB131275 SVB131250 MVB2325R6 MVB2553R6 MVB1610R5 MVB1590R5	13x1275 13x1250 6PK2325 6PK2553 5PK1610 5PK1590
	B204I	96	09/93 → 12/98	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	A/C(-), 01/94→ A/C(+), 01/94→ Alt. 70,8A, → Ch. J2017104, J8001696 Alt. 70,8A, →12/93, Ch. J1028861→	SVB131250 MVB2325R6 MVB2553R6 MVB1610R5 MVB1590R5	13x1250 6PK2325 6PK2553 5PK1610 5PK1590
2.0 -16 ND Turbo	B202S, B204E	110	09/93 → 12/98	⚙️ ⚙️ ⚙️ ⚙️	A/C(-), 01/94→ A/C(+), 01/94→ Alt. 70,8A, → Ch. J2017104, J8001696 Alt. 115A, →12/93	SVB131250 MVB2325R6 MVB2553R6 MVB1610R5 MVB1590R5	13x1250 6PK2325 6PK2553 5PK1610 5PK1590
2.0 -16 Turbo	B202XL	118	09/84 → 08/93	⚙️ ⚙️ ⚙️	→12/92 01/93→ Alt. 70,8A, → Ch. J2017104, J8001696 Alt. 115A	SVB131275 SVB131250 MVB1610R5 MVB1590R5	13x1275 13x1250 5PK1610 5PK1590
		129	09/84 → 12/91	⚙️ ⚙️	Alt. 70,8A, → Ch. J2017104, J8001696 Alt. 115A	SVB131275 MVB1610R5 MVB1590R5	13x1275 5PK1610 5PK1590
	120	05/88 → 08/93	⚙️ ⚙️ ⚙️	→12/92 01/93→ Alt. 70,8A, → Ch. J2017104, J8001696 Alt. 115A	SVB131275 SVB131250 MVB1610R5 MVB1590R5	13x1275 13x1250 5PK1610 5PK1590	
	B202	127	06/89 → 12/92	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→ Ch. G2024751 Ch. G3014892,H7004142→ → Ch. J3040028,J7050311 Ch. K3000506,K7000623→	SVB131200 SVB131175 SVB10975 SVB101175 SVB10825	13x1200 13x1175 10x975 10x1175 10x825
2.0 -16 Turbo CS	B202L	136	09/88 → 12/98	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→12/92 01/93→ A/C(-), 01/94→ A/C(+), 01/94→ Alt. 70,8A, → Ch. J2017104, J8001696 Alt. 115A, →12/93	SVB131275 SVB131250 MVB2325R6 MVB2553R6 MVB1610R5 MVB1590R5	13x1275 13x1250 6PK2325 6PK2553 5PK1610 5PK1590
2.3 -16 Aero CS	B234R	162	02/93 → 12/98	⚙️ ⚙️	A/C(-) A/C(+)	MVB2325R6 MVB2553R6	6PK2325 6PK2553
		165	02/93 → 12/98	⚙️ ⚙️	A/C(-) A/C(+)	MVB2325R6 MVB2553R6	6PK2325 6PK2553
2.3 -16 CS	B234I	107	09/89 → 12/98	⚙️ ⚙️	A/C(-) A/C(+)	MVB2325R6 MVB2553R6	6PK2325 6PK2553
2.3 -16 CSE	B234I	108	09/93 → 12/98	⚙️ ⚙️	A/C(-) A/C(+)	MVB2325R6 MVB2553R6	6PK2325 6PK2553
2.3 -16 CSE Eco Power	B234E	125	09/93 → 12/98	⚙️ ⚙️	A/C(-) A/C(+)	MVB2325R6 MVB2553R6	6PK2325 6PK2553
2.3 -16 Turbo	B234L	143	09/90 → 12/98	⚙️ ⚙️	A/C(-) A/C(+)	MVB2325R6 MVB2553R6	6PK2325 6PK2553
2.3 -16 Turbo CSE	B234L	147	09/93 → 12/98	⚙️ ⚙️	A/C(-) A/C(+)	MVB2325R6 MVB2553R6	6PK2325 6PK2553

SAAB



kW



SAAB

...SAAB

...9000 Hatchback

3.0 -24 V6 CS/CSE	B308I	155	07/94 → 12/98		A/C(-)	MVB1885R6	6PK1885
					A/C(+)	MVB2225R6	6PK2225
						TB481	225x30
						TBK091	

SEAT

ALHAMBRA (7V8, 7V9)

1.8 T 20V	AJH, AWC	110	10/97 →		05/98 →	MVB1200R6D	6DPK1200
					A/C(-), 05/98 → 07/00	MVB1125R6	6PK1125
					05/98 →	TB554	150x23
					05/98 → 07/00	TBK101	
					08/00 →	TBK115	
1.9 TDI	1Z, AHU, ANU	66	04/96 →		08/00 →	MVB1200R6D	6DPK1200
					A/C(-), Auto Tensioner, → 07/00, → Ch. 7M-Y-509291	MVB1045R6	6PK1045
					A/C(-), Auto Tensioner, → 07/00, Ch. 7M-Y-509292 →	MVB1050R6	6PK1050
					A/C(-), Manu Tensioner, → 07/00	MVB925R6	6PK925
					A/C(+), → 07/00	MVB1150R6	6PK1150
					→ 07/00	TB384	137x25.4
					08/00 →	TB680	120x30
					→ 07/00	TBK305	
					07/02 →	TBK270	
					08/00 → 07/02	TBK225	
					08/00 → 07/02, VD(+)	TBK269	
					A/C(-), → 07/00	SVB12735	12x735
					A/C(+), → 07/00	SVB11790	11x790
AFN		81	08/96 → 06/00		A/C(-), Auto Tensioner, → Ch. 7M-Y-509291	MVB1045R6	6PK1045
					A/C(-), Auto Tensioner, Ch. 7M-Y-509292 →	MVB1050R6	6PK1050
					A/C(-), Manu Tensioner	MVB925R6	6PK925
					A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
						TBK305	
					A/C(-)	SVB12735	12x735
					A/C(+)	SVB11790	11x790
AUY, BVK		85	06/00 →			MVB1200R6D	6DPK1200
						TB680	120x30
					→ 07/02	TBK225	
					→ 07/02, VD(+)	TBK269	
					07/02 →	TBK270	
ASZ		96	11/02 →			MVB1200R6D	6DPK1200
						TB680	120x30
						TBK270	
ARL, BTB		110	05/05 →			MVB1200R6D	6DPK1200
						TB680	120x30
						TBK270	
1.9 TDI 4motion	AUY	85	02/01 →			MVB1200R6D	6DPK1200
						TB680	120x30
					→ 07/02	TBK225	
					→ 07/02, VD(+)	TBK269	
					07/02 →	TBK270	



kW



...SEAT

...ALHAMBRA (7V8, 7V9)

2.0 i	ADY, ATM	85	04/96 →	⊗	08/00 →	MVB1200R6D	6DPK1200
				⊗	A/C(-), Manu Tensioner, →07/00	MVB890R6	6PK890
				⊗	Eng. ADY, A/C(-), Auto Tensioner, →07/00	MVB1035R6	6PK1035
				⊗	Eng. ADY, A/C(+), →07/00	MVB1155R6	6PK1155
					→07/00	TB506	124x18
					08/00 →	TB552	138x23
					→07/00	TBK076	
					08/00 →	TBK100	
				⊗	Eng. ADY, A/C(-), →07/00	SVB12675	12x675
				⊗	Eng. ADY, A/C(+), →07/00	SVB12760	12x760
2.0 TDI	BRT	103	11/05 →	⊗		MVB1215R6D	6DPK1215
						TB680	120x30
						TBK270	

ALTEA (5P1)

1.4 16V	BXW	63	05/06 →	⊗	A/C(-)	MVB736R6	6PK736
				⊗	A/C(+)	MVB1100R6	6PK1100
						TB634	58x17
1.6	BGU, BSE, BSF	75	03/04 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
1.8 TFSI	BYT	118	01/07 →	⊗		MVB1115R6	6PK1115
1.9 TDI	BJB, BKC, BLS, BXE	77	04/04 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0 FSI	BLR, BLY, BVY, BVZ	110	05/04 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
						TB753	148x23
2.0 TDI	AZV	100	03/04 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
	BMN	125	03/06 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
BMM	103	11/05 →	⊗	A/C(-)	MVB946R6	6PK946	
			⊗	A/C(+)	MVB1050R6	6PK1050	
					TB680	120x30	
2.0 TDI 16V	BKD	103	03/04 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
						TBK262	
2.0 TFSI	BWA	147	04/06 →	⊗	A/C(-)	MVB955R6	6PK955
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB753	148x23

ALTEA XL (5P5)

1.4		63	10/06 →	⊗	A/C(-)	MVB736R6	6PK736
				⊗	A/C(+)	MVB1100R6	6PK1100
						TB634	58x17
1.6	BSE, BSF	75	10/06 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
1.8 TFSI	BYT	118	01/07 →	⊗		TBK100	
				⊗		MVB1115R6	6PK1115



kW



SEAT

...SEAT

...ALTEA XL (5P5)

1.9 TDI	BLS, BXE	77	10/06 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0 FSI	BVY, BVZ	110	10/06 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
						TB753	148x23
2.0 TDI	BMM	103	10/06 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
	BMN	125	06/07 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
2.0 TDI 4WD	BMM	103	06/07 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0 TDI 16V	BKD	103	10/06 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
	AZV	100	11/06 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
						TBK262	
2.0 TDI 4WD	BMN	125	06/07 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
2.0 TFSI 4WD	BWA	147	06/07 →	⊗	A/C(-)	MVB955R6	6PK955
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB753	148x23

AROSA (6H)

1.0	AER, AHT, ALD, ALL, ANV, AUC	37	05/97 → 06/04	⊗	A/C(-), MS	MVB750R6	6PK750
				⊗	Eng. AUC, A/C(-), PS	MVB1065R6	6PK1065
				⊗	Eng. AUC, A/C(+), PS	MVB1125R6	6PK1125
						TB466	135x19
					→07/01, → Ch. 6H-Y-014000	TBK087	
					Eng. AUC, 07/99→	TBK320	
1.4	AEX, AKK, AKV, ANW, APQ, AUD	44	05/97 → 06/04	⊗	A/C(-), MS	MVB750R6	6PK750
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(+), PS	MVB1125R6	6PK1125
						TB466	135x19
					→ Ch. 6H-Y-014000	TBK087	
					07/99→, Ch. 6H-Y-014001→	TBK320	
1.4 16V	AFK, ANM, AQQ, AUB	74	01/00 → 06/04	⊗	A/C(-)	MVB1065R6	6PK1065
				⊗	A/C(+)	MVB1125R6	6PK1125
						TB634	58x17
						TB658	130x20
						TBK246	
1.4 TDI	AMF	55	01/00 → 06/04	⊗	A/C(-)	MVB1125R6	6PK1125
				⊗	A/C(+)	MVB1188R6D	6DPK1188
						TB680	120x30
					Ch. 6H-2-023001→	TBK270	
					Eng Nr 011495→,	TBK225	
					→ Ch. 6H-2-023000		
					Eng Nr 011495→,	TBK269	
					→ Ch. 6H-2-023000, VD(+)		
1.7 SDI	AKU	44	08/97 → 06/04	⊗	→12/01	MVB1225R5	5PK1225
					→12/01	TB657	137x23
					→12/01	TBK112	



kW



...SEAT

CORDOBA (6K2/C2)

1.0 i	AER	37	09/96 → 06/99	⊗	A/C(-), MS, 07/97→	MVB750R6	6PK750
				⊗	A/C(-), PS, 07/97→	MVB1065R6	6PK1065
				⊗	A/C(+), PS, 07/97→	MVB1180R6	6PK1180
					07/97→	TB466	135x19
				KIT	07/97→	TBK087	
1.4 i	ABD, AEX, AKV, ANX, APQ	44	06/94 → 06/99	⊗	A/C(+)	MVB1180R6	6PK1180
				⊗	A/C(+), 09/95→12/96	MVB1125R6	6PK1125
				⊗	Eng. ABD, A/C(-), MS, →06/96	MVB736R6	6PK736
				⊗	Eng. ABD, A/C(-), PS, →06/96	MVB1100R6	6PK1100
				⊗	Eng. AKV, A/C(-), MS, 09/95→	MVB750R6	6PK750
				⊗	Eng. AKV, A/C(-), PS, 09/95→	MVB1065R6	6PK1065
					→06/96	TB283	128x19
				KIT	09/95→	TB466	135x19
1.4 i 16V	AFH	74	09/96 → 06/99	⊗	A/C(-), MS, 06/97→	MVB750R6	6PK750
				⊗	A/C(-), PS, 06/97→	MVB1065R6	6PK1065
				⊗	A/C(+), 06/97→	MVB1180R6	6PK1180
					06/97→	TB553	149x25
1.6 i	ABU, AEE, ALM	55	02/93 → 06/99	⊗	A/C(-), MS, 05/97→	MVB750R6	6PK750
				⊗	A/C(-), MS, 10/93→06/96	MVB736R6	6PK736
				⊗	A/C(-), PS, 05/97→	MVB1065R6	6PK1065
				⊗	A/C(+), PS, 10/93→	MVB1180R6	6PK1180
				⊗	Eng. ABU, A/C(-), PS, 10/93→06/96	MVB1100R6	6PK1100
		05/97→	TB467	137x19			
		10/93→06/96	TB442	133x19			
	KIT	05/97→	TBK088				
	AFT	74	07/96 → 06/99	⊗	A/C(-)	MVB890R6	6PK890
				⊗	A/C(+)	MVB1155R6	6PK1155
1F	55	05/94 → 06/99			TB463	121x18	
			KIT		TBK086		
			⊗	A/C(-)	SVB12685	12x685	
			⊗	A/C(+)	SVB12760	12x760	
			⊗	A/C(-), 07/96→	MVB890R6	6PK890	
1.8 i	ABS, ADZ	66	02/93 → 06/99	⊗	A/C(+), 07/96→	MVB1155R6	6PK1155
					07/96→	TB108	121x18
				KIT	07/96→	TBK016	
				⊗	A/C(-), 07/96→	SVB12685	12x685
				⊗	A/C(+), 07/96→	SVB12760	12x760
1.8 i 16V	ADL	95	10/93 → 08/96	⊗	A/C(-), 10/93→	MVB890R6	6PK890
				⊗	A/C(+), 10/93→	MVB1155R6	6PK1155
					10/93→	TB108	121x18
				KIT	10/93→	TBK016	
				⊗	A/C(-), 10/93→	SVB12685	12x685
1.8 i 16V	ADL	95	10/93 → 08/96	⊗	A/C(+), 10/93→	SVB12760	12x760
				⊗	A/C(-), 02/94→	MVB975R6	6PK975
				⊗	A/C(+), 02/94→	MVB1155R6	6PK1155
					02/94→	TB505	147x25.4
1.8 i 16V	ADL	95	10/93 → 08/96	⊗	A/C(-), 02/94→	SVB12685	12x685
				⊗	A/C(+), 02/94→	SVB12760	12x760



kw



...SEAT

...CORDOBA (6K2/C2)

SEAT

1.9 D	1Y	50	02/93 → 08/96	⊗	A/C(-), Auto Tensioner,	MVB1045R6	6PK1045
					10/93→		
				⊗	A/C(-), Manu Tensioner,	MVB925R6	6PK925
					10/93→		
				⊗	A/C(+), 10/93→	MVB1150R6	6PK1150
					10/93→	TB384	137x25.4
				⊗	07/94→, Eng Nr 1Y378365→	TBK025	
					10/93→07/94,	TBK024	
					→ Eng Nr 1Y378364		
						SVB12735	12x735
47	01/96 → 08/96	⊗	A/C(-), 10/93→	SVB11790	11x790		
		⊗	A/C(+), 10/93→	MVB1045R6	6PK1045		
		⊗	A/C(-), Auto Tensioner	MVB925R6	6PK925		
		⊗	A/C(-), Manu Tensioner	MVB1150R6	6PK1150		
			A/C(+)	TB384	137x25.4		
				TBK305			
			Eng Nr 1Y378365→	TBK025			
			A/C(-)	SVB12735	12x735		
			A/C(+)	SVB11790	11x790		
		1.9 SDI	AEY	47	08/96 → 06/99	⊗	A/C(-), Auto Tensioner
⊗	A/C(-), Manu Tensioner					MVB925R6	6PK925
⊗	A/C(+)					MVB1150R6	6PK1150
						TB384	137x25.4
						TBK305	
						SVB12735	12x735
1.9 TD	AAZ	55	02/93 → 08/96	⊗	A/C(-)	SVB11790	11x790
				⊗	A/C(+)	MVB1045R6	6PK1045
				⊗	A/C(-), Auto Tensioner,	MVB925R6	6PK925
					08/94→		
1.9 TDI	1Z, AHU	66	08/96 → 06/99	⊗	A/C(-), Manu Tensioner,	MVB1150R6	6PK1150
					08/94→		
				⊗	A/C(+), 08/94→	TB384	137x25.4
					08/94→	TBK025	
					08/94→, Eng Nr 552766→	SVB12735	12x735
					A/C(-), 08/94→	SVB11790	11x790
					A/C(+), 08/94→		
						MVB1045R6	6PK1045
						MVB925R6	6PK925
						MVB1150R6	6PK1150
2.0 i	2E, AGG	85	02/93 → 06/99	⊗	A/C(-), Auto Tensioner	TB384	137x25.4
				⊗	A/C(-), Manu Tensioner	TBK026	
				⊗	A/C(+)	SVB12735	12x735
						SVB11790	11x790
						MVB1045R6	6PK1045
						MVB925R6	6PK925
						MVB1150R6	6PK1150
						TB384	137x25.4
						TBK026	
						SVB12735	12x735
2.0 i 16V	ABF	110	08/96 → 06/99	⊗	A/C(-)	SVB11790	11x790
				⊗	A/C(+)	MVB1045R6	6PK1045
				⊗	A/C(-), Auto Tensioner	MVB925R6	6PK925
				⊗	A/C(-), Manu Tensioner	MVB1150R6	6PK1150
					A/C(+)	TB384	137x25.4
						TBK026	
2.0	2E, AGG	85	02/93 → 06/99	⊗	A/C(-)	SVB12735	12x735
				⊗	A/C(+)	SVB11790	11x790
				⊗	A/C(-), 10/93→	MVB890R6	6PK890
				⊗	A/C(+), 10/93→	MVB1155R6	6PK1155
					10/93→	TB506	124x18
					10/93→	TBK076	
2.0 i 16V	ABF	110	08/96 → 06/99	⊗	A/C(-), 10/93→	SVB12685	12x685
				⊗	A/C(+), 10/93→	SVB12760	12x760
				⊗	A/C(-)	MVB1035R6	6PK1035
				⊗	A/C(+)	MVB1155R6	6PK1155
2.0 i 16V	ABF	110	08/96 → 06/99	⊗		TB441	151x25.4
				⊗		SVB12685	12x685
				⊗		SVB12760	12x760
				⊗			



kW



...SEAT

CORDOBA (6L2)

1.2	AZQ, BME	47	10/02 →	⊗	A/C(+), →10/04, → Ch. 6L-3-207000	MVB1875R6	6PK1875	
				⊗	Eng. BME, A/C(-)	MVB1450R6	6PK1450	
				⊗	Eng. BME, A/C(+), → Ch. 6L-6-053000	MVB1875R6	6PK1875	
1.2 12V	BXV	51	05/06 →	⊗	A/C(-)	MVB1450R6	6PK1450	
				⊗	A/C(+)	MVB1875R6	6PK1875	
1.4 16V	BBY	55	09/02 →	⊗	A/C(-)	MVB736R6	6PK736	
				⊗	A/C(+)	MVB1080R6	6PK1080	
				⊗		TB634	58x17	
					⊗		TB658	130x20
					⊗		TBK246	
	BBZ	74	10/02 →	⊗	A/C(-)	MVB736R6	6PK736	
				⊗	A/C(+)	MVB1080R6	6PK1080	
				⊗		TB634	58x17	
					⊗		TB658	130x20
					⊗		TBK246	
	BXW	63	05/06 →	⊗	A/C(-)	MVB736R6	6PK736	
				⊗	A/C(+)	MVB1080R6	6PK1080	
⊗					TB634	58x17		
				⊗		TB658	130x20	
				⊗		TBK246		
1.4 TDI	AMF	55	10/02 →	⊗	A/C(-)	MVB860R6	6PK860	
				⊗	A/C(+)	MVB1000R6	6PK1000	
				⊗		TB680	120x30	
					⊗		TBK270	
	BNM	51	05/05 →	⊗	A/C(-)	MVB825R6	6PK825	
				⊗	A/C(+)	MVB1000R6	6PK1000	
⊗					TB680	120x30		
				⊗		TBK270		
BMS, BNV	59	06/05 →	⊗	A/C(+)	MVB1000R6	6PK1000		
			⊗	A/C(+), 06/06 →	MVB1180R6	6PK1180		
			⊗	Eng. BMS, A/C(-)	MVB825R6	6PK825		
			⊗		TB680	120x30		
				⊗		TBK270		
1.6	BAH	74	04/03 →	⊗	A/C(-)	MVB750R6	6PK750	
				⊗	A/C(+)	MVB1080R6	6PK1080	
				⊗		TB466	135x19	
				⊗		TBK320		
1.6 16V	BTS	77	11/06 →	⊗	A/C(-)	MVB1088R6	6PK1088	
				⊗	A/C(+)	MVB1740R6	6PK1740	
1.9 SDI	ASY	47	09/02 →	⊗	A/C(-), →07/05	MVB780R6	6PK780	
				⊗	A/C(+), →07/05	MVB1100R6	6PK1100	
				⊗	→07/05	TB659	141x26	
1.9 TDI	ASZ, BLT	96	10/02 →	⊗	A/C(-)	MVB780R6	6PK780	
				⊗	A/C(+)	MVB1180R6	6PK1180	
				⊗		TB680	120x30	
					⊗		TBK270	
	ATD, AXR, BMT	74	09/02 →	⊗	A/C(-)	MVB780R6	6PK780	
				⊗	A/C(-), 06/06 →	MVB825R6	6PK825	
⊗				Eng. BMT, A/C(+)	MVB1180R6	6PK1180		
				⊗		TB680	120x30	
				⊗		TBK270		
2.0	AZL, BBX	85	09/02 →	⊗	A/C(-)	MVB925R6	6PK925	
				⊗	A/C(+)	MVB1035R6	6PK1035	
				⊗		TB552	138x23	
				⊗		TBK100		

SEAT



kW



...SEAT

CORDOBA Hatchback (6K2)

1.0	ALD, ANV, AUC	37	06/99 → 10/02		A/C(-), MS	MVB750R6	6PK750
					Eng. AUC, A/C(-), PS	MVB1065R6	6PK1065
					Eng. AUC, A/C(+), PS	MVB1180R6	6PK1180
						TB466	135x19
						TBK087	
						TBK320	
1.4	AKK, ANW, AUD	44	06/99 → 10/02		A/C(-), MS	MVB750R6	6PK750
					Eng. AKK, A/C(-), PS	MVB1065R6	6PK1065
					Eng. AKK, A/C(+)	MVB1180R6	6PK1180
						TB466	135x19
					Eng. AKK, → Eng Nr 127806	TBK087	
					Eng. AKK, Eng Nr 127807→	TBK320	
1.4 16V	APE, AUA	55	05/00 → 10/02		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1180R6	6PK1180
						TB634	58x17
						TB658	130x20
						TBK246	
	AQQ, AUB	74	02/00 → 10/02		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1080R6	6PK1080
						TB634	58x17
						TB658	130x20
						TBK246	
1.6	ALM	55	06/99 → 10/02		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1180R6	6PK1180
						TB467	137x19
						TBK088	
	AEH, AKL, APF, AUR	74	06/99 → 10/02		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
1.8 T 20V Cupra	AQX	115	07/00 → 10/02		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
						TBK115	
1.9 SDI	AGP, AQM	50	06/99 → 10/02		Eng. AGP, A/C(-)	MVB906R6	6PK906
					Eng. AGP, A/C(+)	MVB1660R6	6PK1660
					Eng. AGP, → Eng Nr 595000	TB533	141x25
					Eng. AGP, Eng Nr 595001→	TB659	141x26
					→ Eng Nr 229903	TBK116	
					Eng. AGP,	TBK107	
					Eng Nr 229904→595000		
					Eng. AGP, Eng Nr 595001→	TBK272	
1.9 TDI	AGR, ALH	66	06/99 → 10/02		Eng. ALH, A/C(-), →05/01	MVB906R6	6PK906
					Eng. ALH, A/C(+), →05/01	MVB1660R6	6PK1660
					Eng. ALH, →05/01,	TB533	141x25
					→ Eng Nr 500000		
					Eng. ALH, →05/01,	TB659	141x26
					Eng Nr 500001→		
					Eng. ALH, →05/01,	TBK107	
					→ Eng Nr 500000		
					Eng. ALH, →05/01,	TBK272	
					Eng Nr 500001→		
	ASK, ASV	81	06/99 → 10/02		Eng. ASV, A/C(-)	MVB906R6	6PK906
					Eng. ASV, A/C(+)	MVB1660R6	6PK1660
					Eng. ASV, → Eng Nr 150000	TB533	141x25
					Eng. ASV, Eng Nr 150001→	TB659	141x26
					Eng. ASV, → Eng Nr 150000	TBK107	
					Eng. ASV, Eng Nr ASV150001→	TBK272	



kW



...SEAT

CORDOBA Vario (6K5)

SEAT

1.4	AKK, ANW, AUD	44	06/99 →		A/C(-), MS, →12/02	MVB750R6	6PK750
					Eng. AKK, A/C(-), PS, →12/02	MVB1065R6	6PK1065
					Eng. AKK, A/C(+), →12/02	MVB1180R6	6PK1180
					→12/02	TB466	135x19
					Eng. AKK, →12/02, → Eng Nr 127806	TBK087	
1.4 16V	APE	55	06/99 →		A/C(-), MS, →12/02	MVB750R6	6PK750
					A/C(-), PS, →12/02	MVB1065R6	6PK1065
					A/C(+), PS, →12/02	MVB1180R6	6PK1180
					→12/02	TB634	58x17
					→12/02	TB658	130x20
1.4 i	AEX, AKV, ANX, APQ	44	09/96 → 06/99		A/C(-), MS, 05/97→	MVB750R6	6PK750
					Eng. AKV, A/C(-), PS, 05/97→	MVB1065R6	6PK1065
					Eng. AKV, A/C(+), 05/97→	MVB1180R6	6PK1180
					05/97→	TB466	135x19
					05/97→	TBK087	
1.6	ALM	55	06/99 →		A/C(-), MS, →12/02	MVB750R6	6PK750
					A/C(-), PS, →12/02	MVB1065R6	6PK1065
					A/C(+), PS, →12/02	MVB1180R6	6PK1180
					→12/02	TB467	137x19
					→12/02	TBK088	
	AEH, AKL, APF, AUR	74	06/99 →		A/C(-), →12/02	MVB1125R6	6PK1125
					A/C(+), →12/02	MVB1200R6D	6DPK1200
					→12/02	TB552	138x23
					→12/02	TBK100	
				1.6 i	AFT	74	09/96 → 06/99
	A/C(+), 05/97→	MVB1155R6	6PK1155				
	05/97→	TB463	121x18				
	05/97→	TBK086					
	A/C(-), 05/97→	SVB12685	12x685				
AEE, ALM	55	09/96 → 06/99			A/C(-), MS, 05/97→	MVB750R6	6PK750
					A/C(-), PS, 05/97→	MVB1065R6	6PK1065
					A/C(+), PS, 05/97→	MVB1180R6	6PK1180
					05/97→	TB467	137x19
					05/97→	TBK088	
1F	55	05/97 → 06/99		A/C(-)	MVB890R6	6PK890	
				A/C(+)	MVB1155R6	6PK1155	
					TB108	121x18	
					TBK016		
				A/C(-)	SVB12685	12x685	
	A/C(+)	SVB12760	12x760				



kW



...SEAT

...CORDOBA Vario (6K5)

SEAT

1.9 SDI	AEY	47	09/96 → 06/99	⊗	A/C(-), Auto Tensioner, 05/97→	MVB1045R6	6PK1045				
				⊗	A/C(-), Manu Tensioner, 05/97→	MVB925R6	6PK925				
				⊗	A/C(+), 05/97→	MVB1150R6	6PK1150				
				⊗	05/97→	TB384	137x25.4				
				⊗	05/97→	TBK305					
	AGP, AQM	50	06/99 →	⊗	⊗	A/C(-), 05/97→	SVB12735	12x735			
					⊗	A/C(+), 05/97→	SVB11790	11x790			
					⊗	Eng. AGP, A/C(-), →12/02	MVB906R6	6PK906			
					⊗	Eng. AGP, A/C(+), →12/02	MVB1660R6	6PK1660			
					⊗	Eng. AGP, →12/02, → Eng Nr 595000	TB533	141x25			
					⊗	Eng. AGP, →12/02, Eng Nr 595001→	TB659	141x26			
					⊗	→12/02, → Eng Nr 229903	TBK116				
					⊗	Eng. AGP, →12/02, Eng Nr 229904→595000	TBK107				
					⊗	Eng. AGP, →12/02, Eng Nr 595001→	TBK272				
					1.9 TDI	1Z, AHU	66	08/96 → 06/99	⊗	A/C(-), Auto Tensioner, 05/97→	MVB1045R6
⊗	A/C(-), Manu Tensioner, 05/97→	MVB925R6	6PK925								
⊗	A/C(+), 05/97→	MVB1150R6	6PK1150								
⊗	05/97→	TB384	137x25.4								
⊗	05/97→	TBK026									
AFN	81	07/97 → 06/99	⊗	⊗		A/C(-), 05/97→	SVB12735	12x735			
				⊗		A/C(+), 05/97→	SVB11790	11x790			
				⊗		A/C(-), Auto Tensioner	MVB1045R6	6PK1045			
				⊗		A/C(-), Manu Tensioner	MVB925R6	6PK925			
				⊗		A/C(+)	MVB1150R6	6PK1150			
				⊗			TB384	137x25.4			
				⊗			TBK026				
				⊗		A/C(-)	SVB12735	12x735			
				⊗		A/C(+)	SVB11790	11x790			
				AGR, ALH		66	06/99 →	⊗	⊗	Eng. AGR, A/C(-), →12/02	MVB906R6
⊗	Eng. AGR, A/C(+), →12/02	MVB1660R6	6PK1660								
⊗	Eng. AGR, →12/02, → Eng Nr 565000	TB533	141x25								
⊗	Eng. AGR, →12/02, Eng Nr 565001→	TB659	141x26								
⊗	Eng. AGR, →12/02, → Eng Nr 565000	TBK107									
⊗	Eng. AGR, →12/02, Eng Nr 565001→	TBK272									
ASK, ASV	81	06/99 →	⊗		⊗				Eng. ASV, A/C(-), →12/02	MVB906R6	6PK906
					⊗				Eng. ASV, A/C(+), →12/02	MVB1660R6	6PK1660
					⊗				Eng. ASV, →12/02, → Eng Nr 150000	TB533	141x25
					⊗				Eng. ASV, →12/02, Eng Nr 150001→	TB659	141x26
				⊗	Eng. ASV, →12/02, → Eng Nr 150000	TBK107					
			⊗	⊗	Eng. ASV, →12/02, Eng Nr 150001→	TBK272					
				⊗							

FURA (025A)

0.9	09 NCA, 100 GL 7000	29	03/84 → 12/86	⊗		SVB10800	10x800
	HB 90	31	01/82 → 06/86	⊗		SVB10800	10x800
		33	01/82 → 06/86	⊗		SVB10800	10x800
1.4	127 B.7000	55	01/82 → 06/86	⊗	→08/84	SVB10800	10x800
				⊗	→08/84	TB115	54x19



kW



SEAT

...SEAT

IBIZA I (021A)

0.9	146 A 000	32	08/86 → 05/93		→01/93	SVB10813	10x813	
	09 NCA, 146 A 000	29	08/90 → 05/93		→01/93	SVB10813	10x813	
1.2	021 A 1000	44	11/84 → 12/93		→01/93	SVB13950	13x950	
					→01/93	SVB10750	10x750	
					→01/93	TB197	112x19	
				KIT	→01/93	TBK055		
					47	11/84 → 12/93		→01/93
				→01/93	SVB10750	10x750		
				→01/93	TB197	112x19		
			KIT	→01/93	TBK055			
1.2 i	021 C.1000	52	01/89 → 05/93		→01/93	SVB13950	13x950	
					→01/93	SVB10750	10x750	
					→01/93	TB197	112x19	
			KIT	→01/93	TBK055			
1.5	021 A 2000	63	11/84 → 05/93		→01/93	SVB13950	13x950	
					→01/93	SVB10750	10x750	
					→01/93	TB197	112x19	
				KIT	→01/93	TBK055		
1.5 i	021 B.2000	74	10/86 → 05/93		→01/93	SVB13950	13x950	
					→01/93	SVB10750	10x750	
					→01/93	TB197	112x19	
				KIT	→01/93	TBK055		
					021 D.2000	65	10/86 → 05/93	
	→01/93	SVB10750	10x750					
				→01/93	TB197	112x19		
			KIT	→01/93	TBK055			
1.5 i CAT	021 C.2000	66	10/86 → 05/93		→01/93	SVB13950	13x950	
					→01/93	SVB10750	10x750	
					→01/93	TB197	112x19	
			KIT	→01/93	TBK055			
1.7	021 B.3000	76	01/91 → 05/93		07/91→01/93	SVB13950	13x950	
					07/91→01/93	SVB10750	10x750	
					07/91→01/93	TB197	112x19	
				KIT	07/91→01/93	TBK055		
		021 A.3000	72	01/91 → 05/93		07/91→01/93	SVB13950	13x950
					07/91→01/93	SVB10750	10x750	
					07/91→01/93	TB197	112x19	
			KIT	07/91→01/93	TBK055			
1.7 D	022 A.5000	40	06/84 → 05/93		→08/85	SVB10825	10x825	
					09/85→01/93	SVB10840	10x840	
		42	08/90 → 05/93		→01/93	TB150	138x25.4	
					→01/93	SVB10840	10x840	
				→01/93	TB150	138x25.4		

IBIZA II (6K1)

1.0	AAU	33	03/93 → 09/96		MS	SVB12710	12x710
					PS	MVB1100R6	6PK1100
						TB283	128x19
1.0 i	AER	37	09/96 → 08/99		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1180R6	6PK1180
						TB466	135x19
				KIT	→ Eng Nr 037979	TBK087	
			KIT	05/99→, Eng Nr 037980→	TBK320		
1.3 i	AAV	40	03/93 → 08/99		→06/96	SVB12710	12x710
					→06/96	TB283	128x19



kw



...SEAT

...IBIZA II (6K1)

SEAT

1.4 i	ABD, AEX, AKV, APQ	44	09/93 → 08/99	⊗	A/C(+)	MVB1180R6	6PK1180
				⊗	A/C(+), 08/94→12/96	MVB1125R6	6PK1125
				⊗	Eng. ABD, A/C(-), MS, →06/96	MVB736R6	6PK736
				⊗	Eng. ABD, A/C(-), PS, →06/96	MVB1100R6	6PK1100
				⊗	Eng. ANW, A/C(-), MS, 08/94→	MVB750R6	6PK750
				⊗	Eng. ANW, A/C(-), PS, 08/94→	MVB1065R6	6PK1065
				⊗	→06/96	TB283	128x19
				⊗	08/94→	TB466	135x19
				⊗	08/94→, → Eng Nr 127806	TBK087	
				⊗	Eng. ANW, 05/99→	TBK320	
1.4 i 16V	AFH	74	09/96 → 08/99	⊗	A/C(-), MS, →04/99	MVB750R6	6PK750
				⊗	A/C(-), PS, →04/99	MVB1065R6	6PK1065
				⊗	A/C(+), →04/99	MVB1180R6	6PK1180
				⊗	→04/99	TB553	149x25
1.6 i	ABU, AEE, ALM	55	03/93 → 08/99	⊗	A/C(-), MS, 07/96→	MVB750R6	6PK750
				⊗	A/C(-), PS, 07/96→	MVB1065R6	6PK1065
				⊗	A/C(+), PS	MVB1180R6	6PK1180
				⊗	Eng. ABU, A/C(-), MS, →07/94	MVB736R6	6PK736
				⊗	Eng. ABU, A/C(-), PS, →07/94	MVB1100R6	6PK1100
	⊗	→07/94	TB442	133x19			
	⊗	07/96→	TB467	137x19			
	⊗	07/96→	TBK088				
	AFT	74	04/96 → 08/99	⊗	A/C(-), →04/99	MVB890R6	6PK890
				⊗	A/C(-), 05/99→	MVB1125R6	6PK1125
⊗				A/C(+), →04/99	MVB1155R6	6PK1155	
⊗				A/C(+), 05/99→	MVB1200R6D	6DPK1200	
⊗				→04/99	TB463	121x18	
⊗				05/99→	TB552	138x23	
⊗				→04/99	TBK086		
1F	55	09/94 → 06/99	⊗	05/99→	TBK100		
			⊗	A/C(-), →04/99	SVB12685	12x685	
			⊗	A/C(+), →04/99	SVB12760	12x760	
			⊗	A/C(-)	MVB890R6	6PK890	
1.8 i	ABS, ADZ	66	03/93 → 08/99	⊗	A/C(+)	MVB1155R6	6PK1155
				⊗	A/C(-)	MVB890R6	6PK890
				⊗	A/C(+), →04/99	MVB1155R6	6PK1155
				⊗	→04/99	TB108	121x18
				⊗	→04/99	TBK016	
				⊗	A/C(-), →04/99	SVB12685	12x685
				⊗	A/C(+), →04/99	SVB12760	12x760
1.8 i 16V	ADL	95	11/93 → 08/96	⊗	A/C(-)	MVB975R6	6PK975
				⊗	A/C(+)	MVB1155R6	6PK1155
				⊗		TB505	147x25.4
				⊗	A/C(-)	SVB12685	12x685
				⊗	A/C(+), → Ch. S...	SVB12760	12x760



kW



...SEAT

...IBIZA II (6K1)

1.9 D	1Y	50	10/94 → 08/96	⊗	A/C(-), Auto Tensioner	MVB1045R6	6PK1045				
				⊗	A/C(-), Manu Tensioner	MVB925R6	6PK925				
				⊗	A/C(+)	MVB1150R6	6PK1150				
						TB384	137x25.4				
				KIT	Eng Nr 1Y378365 →	TBK025					
				⊗	A/C(-)	SVB12735	12x735				
				⊗	A/C(+)	SVB11790	11x790				
				47	04/93 → 08/96	47	04/93 → 08/96	⊗	A/C(-), Auto Tensioner	MVB1045R6	6PK1045
								⊗	A/C(-), Manu Tensioner	MVB925R6	6PK925
								⊗	A/C(+)	MVB1150R6	6PK1150
		TB384	137x25.4								
KIT	→07/94, → Eng Nr 1Y378364	TBK024									
KIT	07/94 →, Eng Nr 1Y378365 →	TBK025									
⊗	A/C(-)	SVB12735	12x735								
⊗	A/C(+)	SVB11790	11x790								
1.9 SDI	AEY	47	08/96 → 08/99					⊗	A/C(-), Auto Tensioner, →04/99	MVB1045R6	6PK1045
								⊗	A/C(-), Manu Tensioner, →04/99	MVB925R6	6PK925
				⊗	A/C(+), →04/99	MVB1150R6	6PK1150				
					→04/99	TB384	137x25.4				
				KIT	→04/99	TBK305					
				KIT	→04/99, Eng Nr 1Y378365 →	TBK025					
				⊗	A/C(-), →04/99	SVB12735	12x735				
				⊗	A/C(+), →04/99	SVB11790	11x790				
				1.9 TD	AAZ	55	03/93 → 08/96	⊗	A/C(-), Auto Tensioner	MVB1045R6	6PK1045
								⊗	A/C(-), Manu Tensioner	MVB925R6	6PK925
⊗	A/C(+)	MVB1150R6	6PK1150								
		TB384	137x25.4								
KIT	→07/94, → Eng Nr 552765	TBK024									
KIT	07/94 →, Eng Nr 552766 →	TBK025									
⊗	A/C(-)	SVB12735	12x735								
⊗	A/C(+)	SVB11790	11x790								
1.9 TDI	1Z, AHU	66	08/96 → 08/99					⊗	A/C(-), Auto Tensioner, →04/99	MVB1045R6	6PK1045
								⊗	A/C(-), Manu Tensioner, →04/99	MVB925R6	6PK925
				⊗	A/C(+), →04/99	MVB1150R6	6PK1150				
					→04/99	TB384	137x25.4				
				KIT	→04/99	TBK026					
				⊗	A/C(-), →04/99	SVB12735	12x735				
				⊗	A/C(+), →04/99	SVB11790	11x790				
				AFN	81	02/97 → 08/99	02/97 → 08/99	⊗	A/C(-), Auto Tensioner, →04/99	MVB1045R6	6PK1045
								⊗	A/C(-), Manu Tensioner, →04/99	MVB925R6	6PK925
								⊗	A/C(+), →04/99	MVB1150R6	6PK1150
	→04/99	TB384	137x25.4								
KIT	→04/99	TBK026									
⊗	A/C(-), →04/99	SVB12735	12x735								
⊗	A/C(+), →04/99	SVB11790	11x790								
2.0 i	2E, AGG	85	03/93 → 08/99					⊗	A/C(-), →04/99	MVB890R6	6PK890
								⊗	A/C(+), →04/99	MVB1155R6	6PK1155
									→04/99	TB506	124x18
				KIT	→04/99	TBK076					
				⊗	A/C(-), →04/99	SVB12685	12x685				
				⊗	A/C(+), →04/99	SVB12760	12x760				
				2.0 i 16V	ABF	110	08/96 → 08/99	⊗	A/C(-), →04/99	MVB1035R6	6PK1035
								⊗	A/C(+), →04/99	MVB1155R6	6PK1155
									→04/99	TB441	151x25.4
								⊗	A/C(-), →04/99	SVB12685	12x685
⊗	A/C(+), →04/99	SVB12760	12x760								



kW



...SEAT

IBIZA III (6K1)

1.0	ALD, ANV, AUC	37	08/99 → 02/02		A/C(-), MS, 07/00→	MVB750R6	6PK750
					Eng. AUC, A/C(-), PS, 07/00→	MVB1065R6	6PK1065
					Eng. AUC, A/C(+), PS, 07/00→	MVB1180R6	6PK1180
					07/00→	TB466	135x19
					Eng. AUC, 07/00→	TBK320	
					A/C(-), MS	MVB750R6	6PK750
					Eng. AUD, A/C(-), PS	MVB1065R6	6PK1065
					Eng. AUD, A/C(+)	MVB1180R6	6PK1180
1.4	AKK, ANW, AUD	44	08/99 → 02/02		Eng. AKK, → Eng Nr 127806	TBK087	
					Eng. AUD, Ch. 6K-X-400000→	TBK320	
					A/C(-), MS	MVB750R6	6PK750
					Eng. AUD, A/C(-), PS	MVB1065R6	6PK1065
1.4 16V	APE, AUA	55	05/00 → 02/02		Eng. AUD, A/C(+)	MVB1180R6	6PK1180
					A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1180R6	6PK1180
	AQQ, AUB	74	08/99 → 02/02			TB634	58x17
						TB658	130x20
					A/C(-), MS	MVB750R6	6PK750
					Eng. AUB, A/C(-)	MVB1065R6	6PK1065
1.6	AEH, AKL, APF, AUR	74	08/99 → 02/02		Eng. AUB, A/C(+)	MVB1180R6	6PK1180
						TB634	58x17
						TB658	130x20
						TBK246	
	ALM	55	08/99 → 02/02		Eng. APF, A/C(-)	MVB1125R6	6PK1125
					Eng. APF, A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
1.8 T 20V Cupra	AQX, AYP	115	07/00 → 02/02		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1180R6	6PK1180
						TB467	137x19
1.9 SDI	AGP, AQM	50	08/99 → 02/02			TBK088	
					A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
1.9 TDI	AGR, ALH	66	08/99 → 02/02			TBK115	
					Eng. AGP, A/C(-)	MVB906R6	6PK906
					Eng. AGP, A/C(+)	MVB1660R6	6PK1660
					→ Eng Nr AGR565000/ALH500000	TB533	
141x25	ASK, ASV	81	08/99 → 02/02		Eng. AGP, → Eng Nr 595000	TB533	141x25
					Eng. AGP, Eng Nr 595001→	TB659	141x26
					→ Eng Nr 229903	TBK116	
					Eng. AGP,	TBK107	
2.0	AZL	85	04/02 →		Eng Nr 229904→595000		
					Eng. AGP, Eng Nr 595001→	TBK272	
					Eng. AGR, A/C(-)	MVB906R6	6PK906
					Eng. AGR, A/C(+)	MVB1660R6	6PK1660
					→ Eng Nr AGR565000/ALH500000	TB533	
					Eng Nr AGR565001/ALH500001→	TB659	141x26
					→ Eng Nr AGR565000/ALH500000	TBK107	
					Eng Nr AGR565001/ALH500001→	TBK272	
					Eng. ASV, A/C(-)	MVB906R6	6PK906
					Eng. ASV, A/C(+)	MVB1660R6	6PK1660
					Eng. ASV, → Eng Nr 150000	TB533	141x25
					Eng. ASV, Eng Nr 150001→	TB659	141x26
					Eng. ASV, → Eng Nr 150000	TBK107	
					Eng. ASV, → Eng Nr 150001→	TBK272	
					A/C(-), →04/05	MVB925R6	6PK925
					A/C(+), →04/05	MVB1035R6	6PK1035
					→04/05	TB552	138x23
					→04/05	TBK100	



kW



...SEAT

IBIZA IV (6L1)

1.2	AZQ	47	02/02 →		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1875R6	6PK1875
					A/C(+), →06/06, → Ch. 6L-3-207000	MVB1875R6	6PK1875
1.2 12V	BXV	51	05/06 →		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1875R6	6PK1875
1.4 16V	AUB, BBZ	74	02/02 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1080R6	6PK1080
					Eng. AUB, A/C(-), →05/02	MVB1065R6	6PK1065
					Eng. AUB, A/C(+), →05/02	MVB1180R6	6PK1180
						TB634	58x17
			TB658	130x20			
			TBK246				
	BBY	55	02/02 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1080R6	6PK1080
						TB634	58x17
		TB658	130x20				
		TBK246					
BXW	63	05/06 →		A/C(-)	MVB736R6	6PK736	
				A/C(+)	MVB1080R6	6PK1080	
					TB634	58x17	
					TB658	130x20	
		TBK246					
1.4 TDI	AMF	55	05/02 →		A/C(-)	MVB860R6	6PK860
					A/C(+)	MVB1000R6	6PK1000
						TB680	120x30
			TBK270				
	BNM	51	05/05 →		A/C(-)	MVB825R6	6PK825
				A/C(+)	MVB1000R6	6PK1000	
					TB680	120x30	
		TBK270					
BMS, BNV	59	06/05 →		A/C(+)	MVB1000R6	6PK1000	
				A/C(+), 06/06 →	MVB1180R6	6PK1180	
				Eng. BMS, A/C(-)	MVB825R6	6PK825	
					TB680	120x30	
					TBK270		
1.6	BAH	74	02/03 →		A/C(-)	MVB750R6	6PK750
					A/C(+)	MVB1080R6	6PK1080
						TB466	135x19
						TBK320	
1.6 16V	BTS	77	11/06 →		A/C(-)	MVB1088R6	6PK1088
					A/C(+)	MVB1740R6	6PK1740
1.8 T Cupra R	BBU	132	01/04 →		A/C(-), →03/08	MVB925R6	6PK925
					A/C(+), →03/08	MVB1035R6	6PK1035
					→03/08	TB554	150x23
1.8 T FR	BJX, BKV	110	12/03 →		A/C(-), →03/08	MVB925R6	6PK925
					A/C(+), →03/08	MVB1035R6	6PK1035
					→03/08	TB554	150x23
1.9 SDI	ASY	47	02/02 →		A/C(-), →12/05	MVB780R6	6PK780
					A/C(+), →12/05	MVB1100R6	6PK1100
					→12/05	TB659	141x26
1.9 TDI	ATD, AXR, BMT	74	02/02 →		A/C(-), 09/06 →	MVB825R6	6PK825
					Eng. AXR, A/C(-)	MVB780R6	6PK780
					Eng. BMT, A/C(+)	MVB1180R6	6PK1180
						TB680	120x30
						TBK270	
	ASZ, BLT	96	02/02 →		A/C(-)	MVB780R6	6PK780
				A/C(+)	MVB1180R6	6PK1180	
					TB680	120x30	
		TBK270					

SEAT



kW



SEAT

...SEAT

...IBIZA IV (6L1)

1.9 TDI Cupra R	ARL	110	01/04 →	⊗ ⊗ ⊗ ⊗ ⊗ KIT	A/C(-) A/C(+)	MVB1125R6 MVB1200R6D TB680 TBK270	6PK1125 6DPK1200 120x30
	BPX	118	03/04 →	⊗ ⊗ ⊗ ⊗ ⊗ KIT	A/C(-) A/C(+)	MVB780R6 MVB1180R6 TB680 TBK270	6PK780 6PK1180 120x30
2.0	AZL	85	04/02 →	⊗ ⊗ ⊗ ⊗ KIT	A/C(-), →03/08	MVB925R6	6PK925
					A/C(+), →03/08 →03/08 →03/08	MVB1035R6 TB552 TBK100	6PK1035 138x23

IBIZA V (6J5)

1.4	BXW	63	03/08 →	⊗ ⊗ ⊗ ⊗ ⊗ KIT	A/C(-) A/C(+)	MVB736R6 MVB1080R6 TB634 TB658 TBK246	6PK736 6PK1080 58x17 130x20
					1.4 TDI	BMS	59

IBIZA V SPORTCOUPE (6J1)

1.4	BXW	63	07/08 →	⊗ ⊗ ⊗ ⊗ ⊗ KIT	A/C(-) A/C(+)	MVB736R6 MVB1080R6 TB634 TB658 TBK246	6PK736 6PK1080 58x17 130x20
					1.4 TDI	BMS	59

INCA (6K9)

1.4 16V	AUA	55	04/00 →	⊗ ⊗ ⊗ ⊗ ⊗ KIT	A/C(-), 09/00→06/03 A/C(+), 09/00→06/03 09/00→06/03 09/00→06/03 09/00→06/03	MVB1065R6 MVB1180R6 TB634 TB658 TBK246	6PK1065 6PK1180 58x17 130x20
					1.4 i	AEX, AKV, APQ, AUD	44
1.6 i	1F	55	11/95 → 05/98	⊗ ⊗ ⊗ ⊗ ⊗ KIT ⊗ ⊗ KIT	A/C(-), →05/97 A/C(+), →05/97 →05/97 →05/97	MVB890R6 MVB1155R6 TB108 TBK016	6PK890 6PK1155 121x18
					AEE	55	11/95 → 05/98
1.7 D	AHB	42	09/96 →	⊗ ⊗ ⊗ ⊗ ⊗ KIT ⊗ ⊗ KIT	A/C(-), →08/00 A/C(+), →08/00 →08/00 →08/00	MVB1045R6 MVB1150R6 TB384 TBK305	6PK1045 6PK1150 137x25.4
					A/C(-), →08/00 A/C(+), →08/00	SVB12735 SVB11790	12x735 11x790





kW



...SEAT

...INCA (6K9)

1.9 D	1Y	47	11/95 →		A/C(-), →06/03	MVB925R6	6PK925
					A/C(+), →06/03	MVB1150R6	6PK1150
					→06/03	TB384	137x25.4
					→06/03	TBK025	
					A/C(-), →06/03	SVB12735	12x735
					A/C(+), →06/03	SVB11790	11x790
1.9 SDI	AEY, AYQ	47	11/95 →		Eng. AEY, A/C(-), →08/00	MVB1045R6	6PK1045
					Eng. AEY, A/C(+), →08/00	MVB1150R6	6PK1150
					Eng. AYQ, A/C(-), 09/00→06/03	MVB906R6	6PK906
					Eng. AYQ, A/C(+), 09/00→06/03	MVB1660R6	6PK1660
					→08/00	TB384	137x25.4
					Eng. AYQ, 09/00→06/03, → Eng Nr 005517	TB533	141x25
					Eng. AYQ, 09/00→06/03, Eng Nr 005518→	TB659	141x26
					→08/00	TBK305	
					Eng. AYQ, 09/00→06/03, → Eng Nr 005517	TBK107	
					Eng. AYQ, 09/00→06/03, Eng Nr 005518→	TBK272	
					Eng. AEY, A/C(-), →08/00	SVB12735	12x735
					Eng. AEY, A/C(+), →08/00	SVB11790	11x790

LEON (1M1)

1.4 16V	AHW, APE, AXP, BCA	55	11/99 →		Eng. BCA, A/C(-), →10/05	MVB1080R6	6PK1080
					Eng. BCA, A/C(+), →10/05	MVB1550R6	6PK1550
					→10/05	TB634	58x17
					→10/05	TB658	130x20
					→07/05, → Eng Nr 160000	TBK263	
					→10/05	TBK246	
1.6	AEH, AKL	74	11/99 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
1.6 16 V	AUS, AZD, BCB	77	09/00 →		A/C(-), →07/05	MVB1080R6	6PK1080
					A/C(+), →07/05	MVB1550R6	6PK1550
					→07/05	TB634	58x17
					→07/05	TB658	130x20
					→07/05	TBK246	
1.8 20V	AGN, APG	92	11/99 →		A/C(-), →07/05	MVB1125R6	6PK1125
					A/C(+), →07/05	MVB1200R6D	6DPK1200
					→07/05	TB554	150x23
					→07/05, → Ch. 1M-YB088000/YR016500	TBK101	
					→07/05, Ch. 1M-YB088001/YR016501→	TBK115	
1.8 20V T	APP, AUQ	132	11/99 →		A/C(-), →07/05	MVB1125R6	6PK1125
					A/C(+), →07/05	MVB1200R6D	6DPK1200
					→07/05	TB554	150x23
					→07/05, → Ch. 1M-YR016500/YB088000	TBK101	
					→07/05, Ch. 1M-YB088001/YR016501→	TBK115	
1.8 20V T 4	AJQ, ARY	132	11/99 →		A/C(-), →07/05	MVB1125R6	6PK1125
					A/C(+), →07/05	MVB1200R6D	6DPK1200
					→07/05	TB554	150x23
					→07/05, → Ch. 1M-YR016500/YB088000	TBK101	
					→07/05, Ch. 1M-YB088001/YR016501→	TBK115	



kw



...SEAT

...LEON (1M1)

SEAT

1.8 T Cupra R	AMK	154	02/02 →	 	A/C(-), →07/05 A/C(+), →07/05 →07/05 →07/05	MVB1125R6 MVB1200R6D TB554 TBK115	6PK1125 6DPK1200 150x23
	BAM	165	07/03 →	 	A/C(-), →07/05 A/C(+), →07/05 →07/05 →07/05	MVB1125R6 MVB1200R6D TB554 TBK115	6PK1125 6DPK1200 150x23
1.9 SDI	AQM	50	11/99 →	 	A/C(-), →06/04 A/C(+), →06/04 →06/04, → Eng Nr 045000 →06/04, Eng Nr 045001→ →06/04, → Eng Nr 030000	MVB906R6 MVB1660R6 TB533 TB659 TBK116	6PK906 6PK1660 141x25 141x26
				 	→06/04, Eng Nr 030001→045000 →06/04, Eng Nr 045001→	TBK107 TBK272	
1.9 TDI	AGR, ALH	66	11/99 →	 	Eng. ALH, A/C(-), →07/05 Eng. ALH, A/C(+), →07/05 Eng. ALH, →07/05, → Eng Nr 500000 Eng. ALH, →07/05, Eng Nr 500001→	MVB906R6 MVB1660R6 TB533 TB659 TBK272	6PK906 6PK1660 141x25 141x26
				 	Eng. ALH, →07/05, Eng Nr 500001→	TBK107	
				 	Eng. ALH, MAN, →07/05, → Eng Nr 500000		
AHF, ASV	81	11/99 →	 	Eng. ASV, A/C(-), →06/04 Eng. ASV, A/C(+), →06/04 Eng. ASV, →06/04, → Eng Nr 150000 Eng. ASV, →06/04, Eng Nr 150001→	MVB906R6 MVB1660R6 TB533 TB659 TBK107	6PK906 6PK1660 141x25 141x26	
			 	Eng. ASV, →06/04, → Eng Nr 150000	TBK272		
			 	Eng. ASV, →06/04, Eng Nr 150001→			
ARL	110	02/01 →	 	A/C(-), →07/05 A/C(+), →07/05 →07/05 →08/01 →08/01, VD(+) 08/01→07/05	MVB1125R6 MVB1200R6D TB680 TBK225 TBK269 TBK270	6PK1125 6DPK1200 120x30	
ASZ	96	05/03 →	 	A/C(-), →07/05 A/C(+), →07/05 →07/05 →07/05	MVB1125R6 MVB1200R6D TB680 TBK270	6PK1125 6DPK1200 120x30	
AXR	74	10/05 →	 	A/C(-), →06/06 A/C(+), →06/06 →06/06 →06/06	MVB1125R6 MVB1200R6D TB680 TBK270	6PK1125 6DPK1200 120x30	
1.9 TDI Syncro	ARL	110	05/02 →	 	A/C(-), →07/05 A/C(+), →07/05 →07/05 →07/05	MVB1125R6 MVB1200R6D TB680 TBK270	6PK1125 6DPK1200 120x30
2.8 Cupra 4	AUE	150	02/01 →		A/C(-), →06/04	MVB1260R6	6PK1260



kW



...SEAT

LEON (1P1)

1.4 16V		55	09/05 →		A/C(-), →10/05	MVB1080R6	6PK1080
					A/C(+), →10/05	MVB1550R6	6PK1550
					→10/05	TB634	58x17
					→10/05	TB658	130x20
					→10/05	TBK246	
	BXW	63	06/06 →			TB634	58x17
						TB658	130x20
						TBK246	
1.6	BSE, BSF, CCSA	75	09/05 →		A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
						TBK100	
1.6 16V		77	09/05 →		A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
						TBK100	
1.8 TSI	BZB	118	06/07 →			MVB1115R6	6PK1115
1.9 TDI	BKC, BLS, BXE	77	09/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
	BXF	66	06/07 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0 D		100	08/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
2.0 FSI	BLR, BLY, BVY, BVZ	110	09/05 →		Eng. BVY, A/C(-)	MVB900R6	6PK900
					Eng. BVY, A/C(+)	MVB1045R6	6PK1045
						TB753	148x23
2.0 TDI	BMN	125	02/06 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1045R6	6PK1045
						TB743	141x30
	BMM	103	10/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1045R6	6PK1045
						TB680	120x30
						TBK270	
2.0 TDI 16V	BKD	103	09/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
2.0 TFSI		136	09/05 →		A/C(-)	MVB955R6	6PK955
					A/C(+)	MVB1050R6	6PK1050
						TB753	148x23
	BWA	147	09/05 →		A/C(-)	MVB955R6	6PK955
					A/C(+)	MVB1050R6	6PK1050
						TB753	148x23
	BWJ	177	11/06 →		A/C(-)	MVB955R6	6PK955
					A/C(+)	MVB1050R6	6PK1050
						TB753	148x23

MALAGA (023A)

1.2	021 A 1000	44	05/85 → 12/93		→07/92	SVB13950	13x950
					→07/92	SVB10750	10x750
					→07/92	TB197	112x19
					→07/92	TBK055	
		47	11/84 → 12/93		06/85 → 07/92	SVB13950	13x950
					06/85 → 07/92	SVB10750	10x750
					06/85 → 07/92	TB197	112x19
					06/85 → 07/92	TBK055	



kW



...SEAT

...MALAGA (023A)

1.2 i	021 C.1000	52	12/89 → 12/93	⊗	→07/92	SVB13950	13x950
				⊗	→07/92	SVB10750	10x750
				⊗	→07/92	TB197	112x19
				⊗	→07/92	TBK055	
1.5	021 A 2000	63	05/85 → 12/93	⊗	→07/92	SVB13950	13x950
				⊗	→07/92	SVB10750	10x750
				⊗	→07/92	TB197	112x19
				⊗	→07/92	TBK055	
1.5 i	021 B.2000	74	01/87 → 12/93	⊗	→07/92	SVB13950	13x950
				⊗	→07/92	SVB10750	10x750
				⊗	→07/92	TB197	112x19
				⊗	→07/92	TBK055	
1.5 i CAT	021 A 2000, 021 C.2000, 021 D.2000	66	10/86 → 12/93	⊗	→07/92	SVB13950	13x950
				⊗	→07/92	SVB10750	10x750
				⊗	→07/92	TB197	112x19
				⊗	→07/92	TBK055	
1.7 D	022 A.5000	40	05/85 → 12/93	⊗	→08/85	SVB10825	10x825
				⊗	09/85 → 07/92	SVB10840	10x840
				⊗	→07/92	TB150	138x25.4
		42	05/90 → 12/93	⊗	→07/92	SVB10840	10x840
				⊗	→07/92	TB150	138x25.4

MARBELLA (28)

0.8	08 NCA	25	08/86 → 12/93	⊗		SVB10813	10x813
0.9	09 NCA	29	01/87 → 12/93	⊗		SVB10813	10x813
	08 NCB	32	07/97 → 10/98	⊗		SVB10813	10x813
0.9 CAT	09 NCB	29	01/90 → 11/96	⊗		SVB10813	10x813
	08 NCB	30	11/96 → 10/98	⊗		SVB10813	10x813

MARBELLA Box (028A)

0.8	08 NCA	25	01/87 → 12/93	⊗		SVB10813	10x813
0.9	09 NCA	29	01/87 → 12/93	⊗		SVB10813	10x813
0.9 CAT	09 NCB	29	01/87 → 12/93	⊗		SVB10813	10x813

PANDA (141A)

0.9	100 GL 3000	31	10/80 → 12/86	⊗		SVB10800	10x800
-----	-------------	----	---------------	---	--	-----------------	--------

RONDA (022A)

1.2	021 A 1000	44	10/84 → 12/86	⊗		SVB10800	10x800
				⊗	10/86 →	SVB10750	10x750
				⊗		TB115	54x19
				⊗	10/86 →	TB197	112x19
				⊗	10/86 →	TBK055	
	021 A 1000, 124 B6.000	47	08/83 → 05/85	⊗		SVB10800	10x800
				⊗		TB115	54x19
1.4	124 B 7000	54	06/82 → 11/88	⊗	→08/84	SVB10800	10x800
				⊗	→08/84	TB115	54x19
1.5	021 A 2000	63	09/84 → 12/86	⊗		SVB10750	10x750
				⊗		TB197	112x19
				⊗		TBK055	
1.6	022 A 000, 138 AR 6000	68	08/83 → 09/85	⊗		SVB13775	13x775
				⊗	A/C(-)	SVB10875	10x875
				⊗	A/C(+)	SVB101075	10x1075
				⊗		TB113	146x19
1.7 Diesel	022 A.5000	40	06/82 → 12/86	⊗	01/86 →	SVB10840	10x840
				⊗	02/83 → 12/85	SVB10825	10x825
				⊗	02/83 →	TB150	138x25.4
		41	06/82 → 12/86	⊗	01/86 →	SVB10840	10x840
				⊗	02/83 → 12/85	SVB10825	10x825
				⊗	02/83 →	TB150	138x25.4



kW



SEAT

...SEAT

TERRA (24)

0.9	09 NCA	29	02/87 → 12/96		→10/95	SVB10800	10x800
0.9 CAT	09 NCB	29	02/92 → 12/94			SVB10800	10x800
1.3 D	MN	33	03/90 → 12/94	 	→08/90	SVB10675	10x675
					→08/90	TB255	107x20
					→08/90	TB254	71x17.8
1.4 D	1 W	35	10/90 → 12/95	 		SVB12710	12x710
						TB255	107x20
						TB254	71x17.8

TERRA Box (024A)

0.9	09 NCA	29	01/87 → 12/95			SVB10800	10x800
0.9 CAT	09 NCB	29	01/90 → 12/95			SVB10800	10x800
1.3 D	MN	33	03/90 → 02/92	 	→08/90	SVB10675	10x675
					→08/90	TB255	107x20
					→08/90	TB254	71x17.8
1.4 D	1 W	35	10/90 → 02/92	 		SVB12710	12x710
						TB255	107x20
						TB254	71x17.8

TOLEDO I (1L)

1.6 i	1F, ABN, EZ	54	05/91 → 03/99		→10/93, → Ch. 1L-ZD304850	SVB13950	13x950	
						A/C(-), 11/93→10/98, Ch. 1L-ZD304851→	MVB890R6	6PK890
						A/C(-), MS, →10/93, → Ch. 1L-ZD304850	SVB10950	10x950
						A/C(-), PS, →10/93, → Ch. 1L-ZD304850	SVB10865	10x865
						A/C(+), 11/93→10/98, Ch. 1L-ZD304851→	MVB1155R6	6PK1155
						→10/98	TB108	121x18
					 KIT	→10/98	TBK016	
						A/C(-), →10/93, → Ch. 1L-ZD304850	SVB10735	10x735
						A/C(-), 11/93→10/98, Ch. 1L-ZD304851→	SVB12685	12x685
						A/C(+), →10/93, → Ch. 1L-ZD304850	SVB10625	10x625
						A/C(+), 11/93→10/98, Ch. 1L-ZD304851→	SVB12760	12x760



kw



...SEAT

...TOLEDO I (1L)

SEAT

Model	Engine	Power (kw)	Year Range	Accessories	Part Numbers	Dimensions		
...1.6 i	1F	52	05/91 → 12/93	☼	→ Ch. 1L-ZD304850	SVB13950	13x950	
				⊗	A/C(-), 11/93→,	MVB890R6	6PK890	
					Ch. 1L-ZD304851→			
				⊗	A/C(-), MS, → Ch. 1L-ZD304850	SVB10950	10x950	
				⊗	A/C(-), PS, → Ch. 1L-ZD304850	SVB10865	10x865	
				⊗	A/C(+), → Ch. 1L-ZD304850	SVB10625	10x625	
				⊗	A/C(+), 11/93→,	MVB1155R6	6PK1155	
			Ch. 1L-ZD304851→					
				TB108	121x18			
				TBK016				
			A/C(-), → Ch. 1L-ZD304850	SVB10735	10x735			
			A/C(-), 11/93→,	SVB12685	12x685			
			Ch. 1L-ZD304851→					
			A/C(+), 11/93→,	SVB12760	12x760			
55	01/93 → 03/99	52	05/91 → 12/93	☼	→ Ch. 1L-ZD304850	SVB13950	13x950	
				⊗	A/C(-), 11/93→10/98,	MVB890R6	6PK890	
					Ch. 1L-ZD304851→			
				⊗	A/C(-), MS, →10/93,	SVB10950	10x950	
				⊗	→ Ch. 1L-ZD304850			
				⊗	A/C(-), PS, →10/93,	SVB10865	10x865	
				⊗	→ Ch. 1L-ZD304850			
			A/C(+), 11/93→10/98,	MVB1155R6	6PK1155			
			Ch. 1L-ZD304851→					
			→10/98	TB108	121x18			
			→10/98	TBK016				
			A/C(-), →10/93,	SVB10735	10x735			
			→ Ch. 1L-ZD304850					
			A/C(-), 11/93→10/98,	SVB12685	12x685			
	Ch. 1L-ZD304851→							
	A/C(+), →10/93,	SVB10625	10x625					
	→ Ch. 1L-ZD304850							
	A/C(+), 11/93→10/98,	SVB12760	12x760					
	Ch. 1L-ZD304851→							
AFT	74	11/96 → 03/99	⊗	A/C(-), →10/98	MVB890R6	6PK890		
			⊗	A/C(+), →10/98	MVB1155R6	6PK1155		
				→10/98	TB463	121x18		
				→10/98	TBK086			
				A/C(-), →10/98	SVB12685	12x685		
				A/C(+), →10/98	SVB12760	12x760		
1.8 16V	KR	98	05/91 → 03/99	☼	→04/94	SVB13950	13x950	
				⊗	A/C(-), →04/94	SVB10950	10x950	
					→04/94	TB505	147x25.4	
					→04/94	TBK066		
					A/C(-), →04/94	SVB10735	10x735	
			A/C(+), →04/94	SVB10625	10x625			
		PL	92	05/91 → 03/99	☼	→04/94	SVB13950	13x950
					⊗	A/C(-), →04/94	SVB10950	10x950
						→04/94	TB505	147x25.4
						→04/94	TBK066	
	A/C(-), →04/94				SVB10735	10x735		
	A/C(+), →04/94	SVB10625	10x625					



kW



...SEAT

...TOLEDO I (1L)

Engine	Code	kW	Period	Accessories	Options	Part Numbers	Dimensions				
1.8 i	RP	65	05/91 → 12/96	⚙️	→08/94	SVB13950	13x950				
				⚙️	A/C(-), MS, →08/94	SVB10950	10x950				
				⚙️	A/C(-), PS, →08/94	SVB10865	10x865				
				🔌	→08/94	TB108	121x18				
				🔌KIT	→08/94	TBK016					
				⚙️	A/C(-), →08/94	SVB10735	10x735				
				⚙️	A/C(+), →08/94	SVB10625	10x625				
				ABS, ADZ	66	11/93 → 12/96	⚙️	A/C(-)	MVB890R6	6PK890	
				⚙️	A/C(+)	MVB1155R6	6PK1155				
				🔌	TB108	121x18					
1.9 D	1Y	50	05/91 → 03/99	⚙️	→10/93	SVB13950	13x950				
				⚙️	A/C(-), →10/93	SVB12950	12x950				
				⚙️	A/C(-), 10/93→10/98	MVB925R6	6PK925				
				⚙️	A/C(+), →10/93	SVB10700	10x700				
				⚙️	A/C(+), 10/93→10/98	MVB1150R6	6PK1150				
				🔌	→10/98	TB384	137x25.4				
				🔌KIT	→05/97, → Eng Nr 1Y705902	TBK024					
				🔌KIT	05/97→10/98, Eng Nr 1Y705903→	TBK025					
				⚙️	A/C(-), →10/93	SVB12650	12x650				
				⚙️	A/C(-), →10/98	SVB12735	12x735				
1.9 D	1Y	47	12/95 → 03/99	⚙️	A/C(+), →10/98	SVB11790	11x790				
				⚙️	A/C(-), →10/98	MVB925R6	6PK925				
				⚙️	A/C(+), →10/98	MVB1150R6	6PK1150				
				🔌	→10/98	TB384	137x25.4				
				🔌KIT	→05/97, → Eng Nr 1Y705902	TBK024					
				🔌KIT	05/97→10/98, Eng Nr 1Y705903→	TBK025					
				⚙️	A/C(-), →10/98	SVB12735	12x735				
				⚙️	A/C(+), →10/98	SVB11790	11x790				
				1.9 SDI	1Y	47	12/95 → 03/99	⚙️	A/C(-), →10/98	MVB925R6	6PK925
								⚙️	A/C(+), →10/98	MVB1150R6	6PK1150
🔌	→10/98	TB384	137x25.4								
🔌KIT	→05/97, → Eng Nr 1Y705902	TBK024									
🔌KIT	05/97→10/98, Eng Nr 1Y705903→	TBK025									
⚙️	A/C(-), →10/98	SVB12735	12x735								
1.9 TD	AAZ	55	05/91 → 03/99	⚙️	A/C(+), →10/98	SVB11790	11x790				
				⚙️	→10/93	SVB13950	13x950				
				⚙️	A/C(-), →10/93	SVB12950	12x950				
				⚙️	A/C(-), 10/93→10/98	MVB925R6	6PK925				
				⚙️	A/C(+), →10/93	SVB10700	10x700				
				⚙️	A/C(+), 10/93→10/98	MVB1150R6	6PK1150				
🔌	→10/98	TB384	137x25.4								
🔌KIT	→05/97, → Eng Nr 634078	TBK024									
🔌KIT	05/97→10/98, Eng Nr 634079→	TBK025									
⚙️	A/C(-), →10/93	SVB12650	12x650								
⚙️	A/C(-), →10/98	SVB12735	12x735								
⚙️	A/C(+), →10/98	SVB11790	11x790								



kw



...SEAT

...TOLEDO I (1L)

1.9 TDI	1Z, AHU	66	08/95 → 03/99	 	A/C(-), →10/98 Eng. AHU, A/C(+), →10/98 →10/98 Eng. AHU, →10/98, → Eng Nr 136385 Eng. AHU, →10/98, Eng Nr 136386 → Eng. AHU, A/C(-), →10/98 Eng. AHU, A/C(+), →10/98	MVB925R6 MVB1150R6 TB384 TBK119 TBK026 SVB12735 SVB11790	6PK925 6PK1150 137x25.4 12x735 11x790
	AFN	81	11/96 → 03/99	 	A/C(-), →10/98 A/C(+), →10/98 →10/98 →10/98, → Eng Nr 136733 →10/98, Eng Nr 136734 → A/C(-), →10/98 A/C(+), →10/98	MVB925R6 MVB1150R6 TB384 TBK119 TBK026 SVB12735 SVB11790	6PK925 6PK1150 137x25.4 12x735 11x790
2.0 i	2E, AGG	85	05/91 → 03/99	 	→10/93, → Ch. 1L-ZD304850 A/C(-), 11/93 →10/98, Ch. 1L-ZD304851 →	SVB13950 MVB890R6	13x950 6PK890
					A/C(-), MS, →10/93, → Ch. 1L-ZD304850	SVB10950	10x950
					A/C(-), PS, →10/93, → Ch. 1L-ZD304850	SVB10865	10x865
					A/C(+), 11/93 →10/98, Ch. 1L-ZD304851 → →10/98	MVB1155R6 TB506	6PK1155 124x18
				 	→10/98	TBK076	
					A/C(-), →10/93, → Ch. 1L-ZD304850	SVB10735	10x735
					A/C(-), 11/93 →10/98, Ch. 1L-ZD304851 →	SVB12685	12x685
					A/C(+), →10/93, → Ch. 1L-ZD304850	SVB10625	10x625
					A/C(+), 11/93 →10/98, Ch. 1L-ZD304851 →	SVB12760	12x760
				2.0 i 16V	ABF	110	11/93 → 03/99
	A/C(+), 03/94 →10/98	MVB1155R6	6PK1155				
	03/94 →10/98	TB441	151x25.4				
	A/C(-), 03/94 →10/98	SVB12685	12x685				
	A/C(+), 03/94 →10/98	SVB12760	12x760				

TOLEDO II (1M2)

1.4 16V	AHW, AXP	55	07/99 → 05/06		A/C(-), 01/00 →10/02	MVB1080R6	6PK1080
					A/C(+), 01/00 →10/02	MVB1550R6	6PK1550
					01/00 →10/02	TB634	58x17
					01/00 →10/02	TB658	130x20
1.6	AEH, AKL	74	04/99 → 09/00	 	01/00 →05/02, → Eng Nr 160000	TBK263	
					01/00 →10/02	TBK246	
					A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
1.6 16V	AUS, AZD	77	09/00 → 05/06			TB552	138x23
						TBK100	
					A/C(-), →06/04	MVB1080R6	6PK1080
					A/C(-), →06/04	MVB1125R6	6PK1125
					A/C(+), →06/04	MVB1200R6D	6DPK1200
					A/C(+), →06/04	MVB1550R6	6PK1550
					→06/04	TB634	58x17
					→06/04	TB658	130x20
					→06/04	TBK246	
					→06/04		



kW



...SEAT

...TOLEDO II (1M2)

1.8 20V	AGN, APG	92	04/99 → 05/06		A/C(-), →10/05	MVB1125R6	6PK1125
					A/C(+), →10/05	MVB1200R6D	6DPK1200
					→10/05	TB554	150x23
					→10/05,	TBK101	
1.8 20VT	AUQ	132	05/01 → 05/06		A/C(-), →10/05	MVB1125R6	6PK1125
					A/C(+), →10/05	MVB1200R6D	6DPK1200
					→10/05	TB554	150x23
					→10/05,	TBK101	
1.9 SDI		50	11/99 → 06/04		A/C(-)	MVB906R6	6PK906
					A/C(+)	MVB1660R6	6PK1660
					→ Eng Nr 045000	TB533	141x25
					Eng Nr 045001 →	TB659	141x26
1.9 TDI	AGR, ALH	66	04/99 → 05/06		Eng. ALH, A/C(-), →06/04	MVB906R6	6PK906
					Eng. ALH, A/C(+), →06/04	MVB1660R6	6PK1660
					Eng. ALH, →06/04,	TB533	141x25
					→ Eng Nr 500000	TB659	141x26
1.9 TDI	AHF, ASV	81	04/99 → 05/06		Eng. ALH, →06/04,	TB659	141x26
					Eng Nr 500001 →	TBK272	
					Eng. ALH, →06/04,	TBK107	
					Eng Nr 500001 →	TBK272	
1.9 TDI	ARL	110	10/00 → 05/06		Eng. ALH, MAN, →06/04,	TBK107	
					→ Eng Nr 500000	TBK107	
					Eng. ASV, A/C(-), →06/04	MVB906R6	6PK906
					Eng. ASV, A/C(+), →06/04	MVB1660R6	6PK1660
1.9 TDI	ASZ	96	05/03 → 05/06		Eng. ASV, →06/04,	TB533	141x25
					→ Eng Nr 150000	TB659	141x26
					Eng. ASV, →06/04,	TBK107	
					Eng Nr 150001 →	TBK272	
2.3 V5 20V	AQN	125	05/01 → 05/06		Eng. ASV, →06/04,	TBK107	
					→ Eng Nr 150000	TBK272	
					Eng. ASV, →06/04,	MVB1125R6	6PK1125
					Eng Nr 150001 →	MVB1200R6D	6DPK1200
TOLEDO III (5P2)	1.6	75	10/04 →		A/C(-), 05/01 →06/04	MVB1125R6	6PK1125
					A/C(+), 05/01 →06/04	MVB1200R6D	6DPK1200
					05/01 →06/04	TB680	120x30
					05/01 →06/04	TBK225	
1.8 TFSI	BZB	118	01/07 →		05/01 →06/04, VD(+)	TBK269	
					A/C(-), →06/04	MVB1125R6	6PK1125
					A/C(+), →06/04	MVB1200R6D	6DPK1200
					→06/04	TB680	120x30
1.9 TDI	BJB, BKC, BLS, BXE	77	10/04 →		→06/04	TBK270	
					A/C(-), →11/03	MVB1260R6	6PK1260
					A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
1.8 TFSI	BZB	118	01/07 →			TB552	138x23
						TBK100	
						MVB1115R6	6PK1115
					A/C(-)	MVB946R6	6PK946
1.9 TDI	BJB, BKC, BLS, BXE	77	10/04 →		A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
					A/C(-)	MVB946R6	6PK946



kw



...SEAT

...TOLEDO III (5P2)

2.0 FSI	BLR, BLY, BVY, BVZ	110	10/04 →		A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
						TB753	148x23
2.0 TDI	BMN	125	01/06 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1045R6	6PK1045
						TB743	141x30
	BMM	103	01/06 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1045R6	6PK1045
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0 TDI 16V	BKD	103	10/04 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
						TBK262	
2.0 TFSI	BWA	147	11/05 → 02/06		A/C(-)	MVB955R6	6PK955
					A/C(+)	MVB1050R6	6PK1050
						TB753	148x23

SKODA

100

1.0	OHV	31	01/70 → 12/77		→02/77	SVB101000	10x1000
					→02/77	SVB10925	10x925
					→02/77	SVB101050	10x1050
		29	01/70 → 12/77		→02/77	SVB101000	10x1000
					→02/77	SVB10925	10x925
					→02/77	SVB101050	10x1050

105,120 (742)

1.0 105 S,L	742,10	34	08/76 → 12/90		→12/89	SVB101000	10x1000
1.0 105 S,L,GL	742,10	33	08/76 → 08/83			SVB101000	10x1000
1.2 120 L		38	08/76 → 12/90		→12/89	SVB101000	10x1000
1.2 120 LS	742,12 X	43	08/76 → 12/90		→12/89	SVB101000	10x1000

105,120 (744)

1.0 105 S,L	742,10	32	02/88 → 12/90		→12/89	SVB101000	10x1000
1.0 105 S,L,LS	742,10	33	10/83 → 12/90		→12/89	SVB101000	10x1000
1.2 120 GLS		43	02/83 → 12/90		→12/89	SVB101000	10x1000
1.2 120 L	742,12	38	10/83 → 12/90		→12/89	SVB101000	10x1000
		35	08/87 → 12/90		→12/89	SVB101000	10x1000

110

1.1 L		33	12/69 → 03/82		04/70 → 10/77	SVB101000	10x1000
					04/70 → 10/77	SVB10925	10x925
					04/70 → 10/77	SVB101050	10x1050
		35	12/69 → 03/82		04/70 → 10/77	SVB101000	10x1000
					04/70 → 10/77	SVB10925	10x925
					04/70 → 10/77	SVB101050	10x1050
1.1 LS	OHV	38	07/70 → 03/82		→10/77	SVB101000	10x1000
					→10/77	SVB10925	10x925
					→10/77	SVB101050	10x1050

110 Coupe

1.1 R	OHV	38	07/70 → 03/82		→10/77	SVB101000	10x1000
					→10/77	SVB10925	10x925
					→10/77	SVB101050	10x1050

130

G,GL (S136)		46	05/88 → 10/91		→12/89	SVB101000	10x1000
GL		39	08/87 → 10/91		→12/89	SVB101000	10x1000
GL (S135)	135/8	43	05/88 → 10/91		→12/89	SVB101000	10x1000
L,GL	742,13	45	02/85 → 10/91		→12/89	SVB101000	10x1000



kW



...SKODA

FABIA

1.2	BBM	44	12/06 →		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1875R6	6PK1875
	BZG, CEVA	51	01/07 →		Eng. BZG, A/C(-)	MVB1450R6	6PK1450
					Eng. BZG, A/C(+)	MVB1875R6	6PK1875
1.4	BXW	63	01/07 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1080R6	6PK1080
						TB634	58x17
1.4 TDI	BNM	51	02/07 →		A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1000R6	6PK1000
						TB680	120x30
						TBK270	
	BMS, BNV	59	01/07 →		Eng. BMS, A/C(-)	MVB825R6	6PK825
					Eng. BMS, A/C(+)	MVB1180R6	6PK1180
						TB680	120x30
						TBK270	
1.6	BTS	77	04/07 →		A/C(-)	MVB1088R6	6PK1088
					A/C(+)	MVB1740R6	6PK1740
1.9 TDI	BLS, BSW	77	04/07 →		A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180
						TB680	120x30
						TBK270	

FABIA (6Y2)

1.0	AQV, ARV, ATY	37	12/99 → 08/02		A/C(-)	MVB1225R5	5PK1225
					A/C(+)	MVB1740R6	6PK1740
1.2	AWY, BMD	40	08/02 →		A/C(+), →04/04, → Ch. 6Y-4-893311	MVB1875R6	6PK1875
					Eng. BMD, A/C(-)	MVB1450R6	6PK1450
					Eng. BMD, A/C(+)	MVB1875R6	6PK1875
	AZQ, BME	47	01/03 →		A/C(-), →07/05, → Ch. 6Y-3-893311	MVB1460R6	6PK1460
					Eng. BME, A/C(-)	MVB1450R6	6PK1450
					Eng. BME, A/C(+)	MVB1875R6	6PK1875
1.4	AME, AQW, ATZ	50	08/99 →		MS, →04/04	MVB1225R5	5PK1225
					PS, →04/04	MVB1740R6	6PK1740
	AZE, AZF	44	08/00 → 08/02		MS	MVB1225R5	5PK1225
					PS	MVB1740R6	6PK1740
1.4 16V	AUB, BBZ	74	12/99 →		A/C(-), →08/03, → Ch. 6Y-2-389395	MVB750R6	6PK750
					A/C(+), →08/03, → Ch. 6Y-2-389395	MVB1088R6	6PK1088
					Eng. BBZ, A/C(-), Ch. 6Y-2-389396 →	MVB736R6	6PK736
					Eng. BBZ, A/C(+), Ch. 6Y-2-389396 →	MVB1080R6	6PK1080
						TB634	58x17
						TB658	130x20
						TBK246	
	AUA, BBY, BKY	55	12/99 →		A/C(-), →08/03, → Ch. 6Y-2-389395	MVB750R6	6PK750
					A/C(+), →08/03, → Ch. 6Y-2-389395	MVB1088R6	6PK1088
					Eng. BKY, A/C(-), Ch. 6Y-2-389396 →	MVB736R6	6PK736
					Eng. BKY, A/C(+), Ch. 6Y-2-389396 →	MVB1080R6	6PK1080
						TB634	58x17
						TB658	130x20
						TBK246	

SKODA



kw



SKODA

...SKODA

...FABIA (6Y2)

1.4 TDI	AMF	55	04/03 →		A/C(-), →07/05	MVB860R6	6PK860
					A/C(+), →07/05	MVB1000R6	6PK1000
					→07/05	TB680	120x30
	BNM	51	10/05 →		A/C(-)	MVB825R6	6PK825
					A/C(-), → Ch. 6Y-5-331600	MVB860R6	6PK860
					A/C(+)	MVB1000R6	6PK1000
	BNV	59	10/05 →		→07/05	TB680	120x30
					A/C(-)	MVB825R6	6PK825
					A/C(-), → Ch. 6Y-5-331600	MVB860R6	6PK860
1.9 SDI	ASY	47	12/99 →		A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1100R6	6PK1100
					→ Eng Nr 021000	TB533	141x25
	ATD, AXR	74	01/00 →		Eng Nr 021001 →	TB659	141x26
					A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180
	ASZ, BLT	96	06/03 →		→ Eng Nr 021000	TBK116	
					A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180
2.0	AQY, AZL	85	12/99 →		Eng. ATD, →07/05, → Ch. 6Y-2-407000/2X032050	TBK225	
					A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180
	BZG, CEVA	51	10/07 →		Eng. ATD, →07/05, → Ch. 6Y-2-407000/2X032050, VD(+)	TBK269	
					A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180
	BBM	44	10/07 →		→07/05	TB680	120x30
					A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180
1.9 TDI RS	BXW	63	10/07 →		Eng. AZL, A/C(-), 07/01 →	MVB925R6	6PK925
					A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1080R6	6PK1080
	BMS, BNV	59	10/07 →		Eng. AZL, A/C(+), 07/01 →	MVB1035R6	6PK1035
					A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1000R6	6PK1000
	BLS, BSW	77	10/07 →		07/01 →	TB552	138x23
					A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180

FABIA Combi

1.2	BZG, CEVA	51	10/07 →		Eng. BZG, A/C(-)	MVB1450R6	6PK1450
					Eng. BZG, A/C(+)	MVB1875R6	6PK1875
1.4	BBM	44	10/07 →		A/C(-)	MVB1450R6	6PK1450
					A/C(+)	MVB1875R6	6PK1875
1.4 TDI	BNM	51	10/07 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1080R6	6PK1080
						TB634	58x17
1.6	BTS	77	10/07 →		A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1000R6	6PK1000
						TB680	120x30
1.9 TDI	BMS, BNV	59	10/07 →		A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1000R6	6PK1000
						TB680	120x30
1.9 TDI	BLS, BSW	77	10/07 →		Eng. BMS, A/C(-)	MVB825R6	6PK825
					Eng. BMS, A/C(+)	MVB1180R6	6PK1180
						TB680	120x30
1.9 TDI	BMS, BNV	59	10/07 →		A/C(-)	MVB825R6	6PK825
					A/C(+)	MVB1000R6	6PK1000
						TB680	120x30
1.9 TDI	BLS, BSW	77	10/07 →		A/C(-)	MVB1088R6	6PK1088
					A/C(+)	MVB1740R6	6PK1740
1.9 TDI	BLS, BSW	77	10/07 →		A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180
						TB680	120x30
1.9 TDI	BLS, BSW	77	10/07 →		A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180
						TB680	120x30



kW



...SKODA

FABIA Combi (6Y5)

1.2	AZQ, BME	47	01/03 →		A/C(-), →07/05,	MVB1460R6	6PK1460
					→ Ch. 6Y-3-893311	MVB1450R6	6PK1450
	AWY, BMD	40	07/01 →		Eng. BME, A/C(-)	MVB1875R6	6PK1875
					Eng. BME, A/C(+)	MVB1875R6	6PK1875
1.4	AME, AQW, ATZ	50	04/00 →		A/C(+), →04/04,	MVB1450R6	6PK1450
					→ Ch. 6Y-4-893311	MVB1875R6	6PK1875
	AZE, AZF	44	04/00 →		Eng. BMD, A/C(-)	MVB1225R5	5PK1225
					Eng. BMD, A/C(+)	MVB1740R6	6PK1740
1.4 16V	AUA, BBY, BKY	55	05/00 →		MS, →04/04	MVB1225R5	5PK1225
					PS, →04/04	MVB1740R6	6PK1740
					A/C(-), →08/03,	MVB750R6	6PK750
					→ Ch. 6Y-2-389395	MVB1088R6	6PK1088
					A/C(+), →08/03,	MVB736R6	6PK736
					→ Ch. 6Y-2-389395	MVB1080R6	6PK1080
					Eng. BKY, A/C(-),	TB634	58x17
					Ch. 6Y-2-389396 →	TB658	130x20
					Eng. BKY, A/C(+),	TBK246	
					Ch. 6Y-2-389396 →	MVB750R6	6PK750
AUB, BBZ	74	04/00 →		A/C(-), →08/03,	MVB1088R6	6PK1088	
				→ Ch. 6Y-2-389395	MVB736R6	6PK736	
				A/C(+), →08/03,	MVB1080R6	6PK1080	
				→ Ch. 6Y-2-389395	TB634	58x17	
				Eng. BBZ, A/C(-),	TB658	130x20	
				Ch. 6Y-2-389396 →	TBK246		
				Eng. BBZ, A/C(+),	MVB736R6	6PK736	
				Ch. 6Y-2-389396 →	MVB1080R6	6PK1080	
BUD	59	04/06 →		A/C(-)	TB634	58x17	
				A/C(+)	TB658	130x20	
1.4 TDI	AMF	55	04/03 →		A/C(-), →07/05	MVB860R6	6PK860
					A/C(+), →07/05	MVB1000R6	6PK1000
	BNM	51	10/05 →		→07/05	TB680	120x30
					→07/05	TBK270	
BNV	59	10/05 →		A/C(-), → Ch. 6Y-5-331600	MVB860R6	6PK860	
				A/C(-), Ch. 6Y-5-331601 →	MVB825R6	6PK825	
				A/C(+)	MVB1000R6	6PK1000	
					TB680	120x30	
1.9 SDI	ASY	47	04/00 →		TBK270		
					A/C(-), → Ch. 6Y-5-331600	MVB860R6	6PK860
					A/C(-), Ch. 6Y-5-331601 →	MVB825R6	6PK825
					A/C(+)	MVB1000R6	6PK1000
				TB680	TB680	120x30	
				TBK270	TBK270		
				A/C(-), → Ch. 6Y-5-331600	MVB860R6	6PK860	
				A/C(-), Ch. 6Y-5-331601 →	MVB825R6	6PK825	
				A/C(+)	MVB1000R6	6PK1000	
					TB680	120x30	
1.9 SDI	ASY	47	04/00 →		TBK270		
					A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1100R6	6PK1100
					→ Eng Nr 021000	TB533	141x25
				Eng Nr 021001 →	TB659	141x26	
				→ Eng Nr 021000	TBK116		



kW



SKODA

...SKODA

...FABIA Combi (6Y5)

1.9 TDI	ATD, AXR	74	04/00 →		A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1180R6	6PK1180
						TB680	120x30
						TBK270	
					Eng. ATD, →07/05, → Ch. 6Y-2-407000/2X032050	TBK225	
					Eng. ATD, →07/05, → Ch. 6Y-2-407000/2X032050, VD(+)	TBK269	
2.0	AZL	85	04/00 →		A/C(-), 07/01 →	MVB925R6	6PK925
					A/C(+), 07/01 →	MVB1035R6	6PK1035
					07/01 →	TB552	138x23
					07/01 →	TBK100	

FABIA Praktik

1.2	AZQ, BME	47	01/03 →		A/C(+), →07/05	MVB1875R6	6PK1875
					Eng. AZQ, A/C(-), →07/05, → Ch. 6Y-3-893311	MVB1460R6	6PK1460
					Eng. AZQ, A/C(-), →07/05, Ch. 6Y-4-893312 →	MVB1450R6	6PK1450
	AWY, BMD	40	05/03 →		A/C(+), →04/04, → Ch. 6Y-4-893311	MVB1875R6	6PK1875
				Eng. BMD, A/C(-)	MVB1450R6	6PK1450	
				Eng. BMD, A/C(+)	MVB1875R6	6PK1875	
1.4	AME, AQW, ATZ	50	04/02 →		MS, →04/04	MVB1225R5	5PK1225
					PS, →04/04	MVB1740R6	6PK1740
1.4 TDI	BNM	51	10/05 →		A/C(-), → Ch. 6Y-5-331600	MVB860R6	6PK860
					A/C(-), Ch. 6Y-5-331601 →	MVB825R6	6PK825
					A/C(+)	MVB1000R6	6PK1000
						TB680	120x30
						TBK270	
1.9 SDI	ASY	47	04/02 →		A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1100R6	6PK1100
					→ Eng Nr 021000	TB533	141x25
					Eng Nr 021001 →	TB659	141x26
					→ Eng Nr 021000	TBK116	

FABIA Saloon (6Y3)

1.2	AZQ, BME	47	01/03 →		A/C(-), →07/05, → Ch. 6Y-3-893311	MVB1460R6	6PK1460
					Eng. BME, A/C(-)	MVB1450R6	6PK1450
					Eng. BME, A/C(+)	MVB1875R6	6PK1875
	AWY, BMD	40	07/01 →		A/C(+), →04/04, → Ch. 6Y-4-893311	MVB1875R6	6PK1875
				Eng. BMD, A/C(-)	MVB1450R6	6PK1450	
				Eng. BMD, A/C(+)	MVB1875R6	6PK1875	
1.4	AME, AQW	50	07/01 →		MS, →04/04	MVB1225R5	5PK1225
					PS, →04/04	MVB1740R6	6PK1740
	AZE, AZF	44	04/00 → 08/02		MS	MVB1225R5	5PK1225
					PS	MVB1740R6	6PK1740



kW



...SKODA

...FABIA Saloon (6Y3)

Power	Model	kW	Year	Accessories	Notes	Part Numbers	Dimensions
1.4 16V	AUA, BBY, BKY	55	10/99 →	⊗	A/C(-), →08/03, → Ch. 6Y-2-389395	MVB750R6	6PK750
				⊗	A/C(+), →08/03, → Ch. 6Y-2-389395	MVB1088R6	6PK1088
				⊗	Eng. BKY, A/C(-), Ch. 6Y-2-389396 →	MVB736R6	6PK736
				⊗	Eng. BKY, A/C(+), Ch. 6Y-2-389396 →	MVB1080R6	6PK1080
	AUB, BBZ	74	12/99 →	⊗	Eng. BBZ, A/C(-), 05/02 →, Ch. 6Y-2-389396 →	MVB736R6	6PK736
				⊗	Eng. BBZ, A/C(+), 05/02 →, Ch. 6Y-2-389396 →	MVB1080R6	6PK1080
				⊗	05/02 →	TB634	58x17
				⊗	05/02 →	TB658	130x20
				⊗	05/02 →	TBK246	
				⊗	A/C(-)	MVB736R6	6PK736
				⊗	A/C(+)	MVB1080R6	6PK1080
				⊗		TB634	58x17
1.4 TDI	AMF	55	04/03 →	⊗	A/C(-), →07/05	MVB860R6	6PK860
				⊗	A/C(+), →07/05	MVB1000R6	6PK1000
				⊗	→07/05	TB680	120x30
	BNM	51	10/05 →	⊗	A/C(-), → Ch. 6Y-5-331600	MVB860R6	6PK860
				⊗	A/C(-), Ch. 6Y-5-331601 →	MVB825R6	6PK825
				⊗	A/C(+)	MVB1000R6	6PK1000
BNV	59	10/05 →	⊗	A/C(-), → Ch. 6Y-5-331600	MVB860R6	6PK860	
			⊗	A/C(-), Ch. 6Y-5-331601 →	MVB825R6	6PK825	
			⊗	A/C(+)	MVB1000R6	6PK1000	
1.9 SDI	ASY	47	11/99 →	⊗	A/C(-)	MVB780R6	6PK780
				⊗	A/C(+)	MVB1100R6	6PK1100
				⊗	→ Eng Nr 021000	TB533	141x25
				⊗	Eng Nr 021001 →	TB659	141x26
				⊗	→ Eng Nr 021000	TBK116	
1.9 TDI	ATD, AXR	74	01/00 →	⊗	A/C(-)	MVB780R6	6PK780
				⊗	A/C(+)	MVB1180R6	6PK1180
				⊗		TB680	120x30
				⊗		TBK270	
				⊗	Eng. ATD, →07/05, → Ch. 6Y-2-407000/2X032050	TBK225	
				⊗	Eng. ATD, →07/05, → Ch. 6Y-2-407000/2X032050, VD(+)	TBK269	
				⊗		TBK270	
2.0	AZL	85	12/99 →	⊗	A/C(-), 07/01 →	MVB925R6	6PK925
				⊗	A/C(+), 07/01 →	MVB1035R6	6PK1035
				⊗	07/01 →	TB552	138x23
				⊗	07/01 →	TBK100	

SKODA



kw



...SKODA

FAVORIT (781)

1.3 (781)	136B	50	01/94 → 09/94		V-ribbed belt pulley (+)	MVB950R4	4PK950
1.3 135 (781)	781.135	44	10/90 → 09/94		V-belt pulley (+), →08/92	SVB10975	10x975
					V-ribbed belt pulley (+), 08/92 →	MVB950R4	4PK950
		42	12/91 → 09/94		V-belt pulley (+), →08/92	SVB10975	10x975
					V-ribbed belt pulley (+), 08/92 →	MVB950R4	4PK950
		43	12/91 → 09/94		V-belt pulley (+), →08/92	SVB10975	10x975
					V-ribbed belt pulley (+), 08/92 →	MVB950R4	4PK950
1.3 135 X,LX,GLX (781)	781.135E	40	01/90 → 09/94		V-belt pulley (+), →08/92	SVB10975	10x975
					V-ribbed belt pulley (+), 08/92 →	MVB950R4	4PK950
1.3 135L (781)	781.135	43	05/89 → 09/94		V-belt pulley (+), →08/92	SVB10975	10x975
					V-ribbed belt pulley (+), 08/92 →	MVB950R4	4PK950
1.3 136 (781)	136 L	45	10/90 → 09/94		V-belt pulley (+), →08/92	SVB10975	10x975
					V-ribbed belt pulley (+), 08/92 →	MVB950R4	4PK950

FAVORIT Forman (785)

1.3	136B	50	01/94 → 06/95		V-ribbed belt pulley (+)	MVB950R4	4PK950
1.3 (135 E)	781.135E	40	09/91 → 06/95		V-belt pulley (+), →08/92	SVB10975	10x975
					V-ribbed belt pulley (+), 08/92 →	MVB950R4	4PK950
1.3 (135)	781.135	44	12/91 → 06/95		V-belt pulley (+), →08/92	SVB10975	10x975
					V-ribbed belt pulley (+), 08/92 →	MVB950R4	4PK950
1.3 (136)	OHC	45	08/91 → 06/95		V-belt pulley (+), →08/92	SVB10975	10x975
					V-ribbed belt pulley (+), 08/92 →	MVB950R4	4PK950

FAVORIT Pickup (787)

1.3	136B	50	12/92 → 06/97		V-ribbed belt pulley (+), →10/96	MVB950R4	4PK950
	135B	40	12/92 → 06/97		V-ribbed belt pulley (+), →10/96	MVB950R4	4PK950
	781.135	42	12/92 → 06/97		V-ribbed belt pulley (+), →08/95	MVB950R4	4PK950

FELICIA I (6U1)

1.3	135B, AMG	40	10/94 → 03/98		A/C(-), Carb	MVB950R4	4PK950
					A/C(+)	MVB1675R6	6PK1675
					Inj	SVB10950	10x950
	136B, AMH	50	10/94 → 03/98		A/C(-), Carb	MVB950R4	4PK950
					A/C(+)	MVB1675R6	6PK1675
					Inj	SVB10950	10x950
	135 L, AMJ	43	10/94 → 03/98		A/C(-), →07/96	MVB950R4	4PK950
					Eng. 135L, →07/96	SVB10950	10x950
1.6 LX	AEE	55	08/95 → 03/98		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), MS	MVB1080R6	6PK1080
					A/C(+), PS	MVB1125R6	6PK1125
						TB467	137x19
						TBK088	
1.9 D	AEF	47	10/95 → 03/98		08/96 →	MVB1225R5	5PK1225
					08/96 →	TB657	137x23
					08/96 →	TBK093	



kW



...SKODA

FELICIA I Estate (6U5)

1.3	135 L, AMJ	43	08/95 → 03/98		A/C(-)	MVB950R4	4PK950
					A/C(+)	MVB1675R6	6PK1675
1.3 LX	135B, AMG	40	08/95 → 03/98		A/C(-), Carb	MVB950R4	4PK950
					A/C(+)	MVB1675R6	6PK1675
					Inj	SVB10950	10x950
1.3 LXI	136B, AMH	50	08/95 → 03/98		A/C(-), Carb	MVB950R4	4PK950
					A/C(+)	MVB1675R6	6PK1675
					Inj	SVB10950	10x950
1.6 GLX	AEE	55	08/95 → 03/98		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), MS	MVB1080R6	6PK1080
					A/C(+), PS	MVB1125R6	6PK1125
						TB467	137x19
						TBK088	
1.9 D	AEF	47	10/95 → 03/98		08/96 →	MVB1225R5	5PK1225
					08/96 →	TB657	137x23
					08/96 →	TBK093	

FELICIA I Fun (797)

1.3	136B, 136M	50	06/97 →		->04/02	SVB10950	10x950
					A/C(+), ->04/02	MVB1675R6	6PK1675
	135B, 135M	40	06/97 →		->04/02	SVB10950	10x950
					A/C(+), ->04/02	MVB1675R6	6PK1675
1.6	AEE	55	06/97 →		A/C(-), MS, ->03/01	MVB750R6	6PK750
					A/C(-), PS, ->03/01	MVB1065R6	6PK1065
					A/C(+), MS, ->03/01	MVB1080R6	6PK1080
					A/C(+), PS, ->03/01	MVB1125R6	6PK1125
					->03/01	TB467	137x19
					->03/01	TBK088	
1.9 D	AEF	47	06/97 →		->04/02	MVB1225R5	5PK1225
					->04/02	TB657	137x23
					->04/02	TBK093	

FELICIA II (6U1)

1.3	AMG	40	01/98 → 06/01		->11/00	SVB10950	10x950
					A/C(+), ->11/00	MVB1675R6	6PK1675
	AMH	50	01/98 → 06/01		->11/00	SVB10950	10x950
					A/C(+), ->11/00	MVB1675R6	6PK1675
	AMJ	43	01/98 → 06/01		A/C(-), Carb, ->11/00	MVB950R4	4PK950
					A/C(+), ->11/00	MVB1675R6	6PK1675
					Inj, ->11/00	SVB10950	10x950
1.6	AEE	55	01/98 → 06/01		A/C(-), MS, ->11/00	MVB750R6	6PK750
					A/C(-), PS, ->11/00	MVB1065R6	6PK1065
					A/C(+), MS, ->11/00	MVB1080R6	6PK1080
					A/C(+), PS, ->11/00	MVB1125R6	6PK1125
					->11/00	TB467	137x19
					->11/00	TBK088	
1.9 D	AEF	47	01/98 → 06/01		->11/00	MVB1225R5	5PK1225
					->11/00	TB657	137x23
					->11/00	TBK093	

FELICIA II Estate (6U5)

1.3	AMH	50	01/98 → 06/01		->11/00	SVB10950	10x950
					A/C(+), ->11/00	MVB1675R6	6PK1675
1.6	AEE	55	01/98 → 06/01		A/C(-), MS, ->11/00	MVB750R6	6PK750
					A/C(-), PS, ->11/00	MVB1065R6	6PK1065
					A/C(+), MS, ->11/00	MVB1080R6	6PK1080
					A/C(+), PS, ->11/00	MVB1125R6	6PK1125
					->11/00	TB467	137x19
					->11/00	TBK088	
1.9 D	AEF	47	01/98 → 06/01		->11/00	MVB1225R5	5PK1225
					->11/00	TB657	137x23
					->11/00	TBK093	



kW



SKODA

...SKODA

OCTAVIA (1U2)

1.4	AMD	44	04/99 →		→07/03	MVB1520R6	6PK1520
1.4 16V	AXP, BCA	55	09/00 →		Eng. BCA, A/C(-), →09/04	MVB1080R6	6PK1080
					Eng. BCA, A/C(+), →09/04	MVB1550R6	6PK1550
					→09/04	TB634	58x17
					→09/04	TB658	130x20
					→09/04	TBK246	
1.6	AEE	55	09/96 → 09/00		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1550R6	6PK1550
						TB467	137x19
						TBK088	
	AEH, AKL	74	02/97 →		A/C(-), →05/02	MVB1125R6	6PK1125
					A/C(+), →05/02	MVB1200R6D	6DPK1200
					→05/02	TB552	138x23
					→05/02	TBK100	
	AVU, BFQ	75	11/00 →		A/C(-), →09/04	MVB1125R6	6PK1125
					A/C(+), →09/04	MVB1200R6D	6DPK1200
					→09/04	TB552	138x23
					→09/04	TBK100	
1.8	AGN	92	09/96 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
					→ Ch. 1U-Y-390000	TBK101	
					Ch. 1U-Y-390001→	TBK115	
1.8 T	AGU, ARX, ARZ, AUM	110	08/97 →		Eng. ARX, A/C(-)	MVB1125R6	6PK1125
					Eng. ARX, A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
					→ Ch. 1U-Y-390000	TBK101	
					Eng. ARX	TBK115	
1.8 T 4x4	AGU, ARX, AUM	110	05/01 →		Eng. ARX, A/C(-), →02/06	MVB1125R6	6PK1125
					Eng. ARX, A/C(+), →02/06	MVB1200R6D	6DPK1200
					→02/06	TB554	150x23
					→02/06	TBK115	
1.9 SDI	AGP, AQM	50	06/97 →		Eng. AQM, A/C(-), →12/03	MVB906R6	6PK906
					Eng. AQM, A/C(+), →12/03	MVB1660R6	6PK1660
					Eng. AQM, →12/03,	TB533	141x25
					→ Eng Nr 045000		
					Eng. AQM, →12/03,	TB659	141x26
					Eng Nr 045001→		
					08/00→12/03,	TBK107	
					Eng Nr 030001→045000		
					Eng. AQM, →12/03,	TBK116	
					→ Eng Nr 030000		
					Eng. AQM, →12/03,	TBK272	
					Eng Nr 045001→		



kW



...SKODA

...OCTAVIA (1U2)

1.9 TDI	AGR, ALH	66	09/96 →	⊗	Eng. ALH, A/C(-), →02/06	MVB906R6	6PK906
				⊗	Eng. ALH, A/C(+), →02/06	MVB1660R6	6PK1660
					Eng. ALH, →02/06,	TB533	141x25
					→ Eng Nr 500000		
					Eng. ALH, →02/06,	TB659	141x26
					Eng Nr 500001 →		
					→07/03, → Eng Nr 04441	TBK116	
					Eng. ALH, →02/06,	TBK272	
					Eng Nr 500001 →		
					Eng. ALH, MAN, →02/06,	TBK107	
	→ Eng Nr 500000						
AHF, ASV	81	08/97 →	⊗	Eng. ASV, A/C(-), →02/06	MVB906R6	6PK906	
			⊗	Eng. ASV, A/C(+), →02/06	MVB1660R6	6PK1660	
				Eng. ASV, →02/06,	TB533	141x25	
				→ Eng Nr 150000			
				Eng. ASV, →02/06,	TB659	141x26	
				Eng Nr 150001 →			
				→07/01, → Eng Nr 006065	TBK116		
				Eng. ASV, →02/06,	TBK107		
				→ Eng Nr 150000			
				Eng. ASV, →02/06,	TBK272		
	Eng Nr 150001 →						
ASZ	96	01/03 →	⊗	A/C(-), →09/04	MVB1125R6	6PK1125	
			⊗	A/C(+), →09/04	MVB1200R6D	6DPK1200	
				→09/04	TB680	120x30	
				→09/04	TBK270		
AXR	74	10/05 →	⊗	A/C(-), →02/06	MVB1125R6	6PK1125	
			⊗	A/C(+), →02/06	MVB1200R6D	6DPK1200	
				→02/06	TB680	120x30	
				→02/06	TBK270		
				→02/06, → Eng Nr 211245	TBK225		
				→02/06, → Eng Nr 211245,	TBK269		
	VD(+)						
2.0	AEG, APK, AQY, AZH	85	04/99 →	⊗	Eng. AZJ, A/C(-)	MVB1125R6	6PK1125
				⊗	Eng. AZJ, A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
RS 1.8 T	AUQ	132	05/01 →	⊗	A/C(-), →02/06	MVB1125R6	6PK1125
				⊗	A/C(+), →02/06	MVB1200R6D	6DPK1200
					→02/06	TB554	150x23
					→02/06	TBK115	
OCTAVIA (1Z3)							
1.4	BCA	55	05/04 →	⊗	A/C(-), →09/06	MVB736R6	6PK736
				⊗	A/C(+), →09/06	MVB1100R6	6PK1100
					→09/06	TB634	58x17
					→09/06	TB658	130x20
					→09/06	TBK246	
BUD	59	06/04 →	⊗	A/C(-), 05/06 →	MVB736R6	6PK736	
			⊗	A/C(+), 05/06 →	MVB1100R6	6PK1100	
				05/06 →	TB634	58x17	
				05/06 →	TBK246		
1.6	BGU, BSE, BSF, CCSA	75	06/04 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
						TBK100	
1.6 FSI	BLF	85	02/04 →	⊗	A/C(-)	MVB1088R6	6PK1088
				⊗	A/C(+)	MVB1740R6	6PK1740
1.9 TDI	BJB, BKC, BLS, BXE	77	06/04 →	⊗	Eng. BLS, A/C(-)	MVB946R6	6PK946
				⊗	Eng. BLS, A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	



kw



SKODA

...SKODA

...OCTAVIA (1Z3)

2.0 FSI	BLR, BLY, BVX, BVY, BVZ	110	11/04 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(-), 10/05→	MVB955R6	6PK955
				⊗	A/C(+)	MVB1045R6	6PK1045
				⊗	A/C(+), 10/05→	MVB1050R6	6PK1050
						TB753	148x23
		110	11/04 → 11/05	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
						TB753	148x23
2.0 RS	BWA	147	10/05 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(-)	MVB955R6	6PK955
				⊗	A/C(+)	MVB1045R6	6PK1045
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB753	148x23
2.0 TDI	BMM	103	11/05 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TB743	141x30
					KIT	TBK262	
					KIT	TBK270	
	BMN, CEGA	125	04/06 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TB743	141x30
					KIT	TBK262	
					KIT	TBK270	
2.0 TDI 16V	BKD	103	02/04 →	⊗	A/C(-)	MVB946R6	6PK946
				⊗	A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TB743	141x30
					KIT	TBK262	
					KIT	TBK270	

OCTAVIA Combi (1U5)

1.4 16V	AXP, BCA	55	08/00 →	⊗	Eng. BCA, A/C(-), →09/04	MVB1080R6	6PK1080
				⊗	Eng. BCA, A/C(+), →09/04	MVB1550R6	6PK1550
					→09/04	TB634	58x17
					→09/04	TB658	130x20
					KIT	TBK246	
1.6	AEH, AKL	74	07/98 →	⊗	A/C(-), →05/02	MVB1125R6	6PK1125
				⊗	A/C(+), →05/02	MVB1200R6D	6DPK1200
					→05/02	TB552	138x23
					→05/02	TBK100	
	AEE	55	07/98 →	⊗	A/C(-), →09/04	MVB1080R6	6PK1080
				⊗	A/C(+), →09/04	MVB1550R6	6PK1550
					→09/04	TB467	137x19
					→09/04	TBK088	
	AVU, BFQ	75	09/00 →	⊗	A/C(-), →09/04	MVB1125R6	6PK1125
				⊗	A/C(+), →09/04	MVB1200R6D	6DPK1200
					→09/04	TB552	138x23
					→09/04	TBK100	
1.8 20V	AGN	92	07/98 →	⊗	A/C(-)	MVB1125R6	6PK1125
				⊗	A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
					→ Ch. 1U-Y-390000	TBK101	
					Ch. 1U-Y-390001→	TBK115	
1.8 T	AGU, ARX, ARZ, AUM	110	07/98 →	⊗	Eng. ARX, A/C(-)	MVB1125R6	6PK1125
				⊗	Eng. ARX, A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
					→ Ch. 1U-Y-390000	TBK101	
					Eng. ARX	TBK115	



kW



...SKODA

...OCTAVIA Combi (1U5)

1.8 T 4x4	AGU, ARX, AUM	110	05/01 →		Eng. ARX, A/C(-), →02/06	MVB1125R6	6PK1125
					Eng. ARX, A/C(+), →02/06	MVB1200R6D	6DPK1200
					→02/06	TB554	150x23
1.9 SDI	AGP, AQM	50	07/98 →		→02/06	TBK115	
					→02/06		
					→02/06		
					→02/06		
					→02/06		
					→02/06		
1.9 TDI	AGR, ALH	66	07/98 →		Eng. AQM, A/C(-), →12/03	MVB906R6	6PK906
					Eng. AQM, A/C(+), →12/03	MVB1660R6	6PK1660
					Eng. AQM, →12/03,	TB533	141x25
					→ Eng Nr 045000		
					Eng. AQM, →12/03,	TB659	141x26
					Eng Nr 045001→		
					08/00→12/03,	TBK107	
					Eng Nr 030001→045000		
					Eng. AQM, →12/03,	TBK116	
					→ Eng Nr 030000		
					Eng. AQM, →12/03,	TBK272	
					Eng Nr 045001→		
1.9 TDI	AGR, ALH	66	07/98 →		Eng. ALH, A/C(-), →02/06	MVB906R6	6PK906
					Eng. ALH, A/C(+), →02/06	MVB1660R6	6PK1660
					Eng. ALH, →02/06,	TB533	141x25
					→ Eng Nr 500000		
					Eng. ALH, →02/06,	TB659	141x26
					Eng Nr 500001→		
					→07/03, → Eng Nr 04441	TBK116	
					Eng. ALH, →02/06,	TBK272	
					Eng Nr 500001→		
					Eng. ALH, MAN, →02/06,	TBK107	
					→ Eng Nr 500000		
				1.9 TDI	AHF, ASV	81	07/98 →
	Eng. ALH, A/C(+), →02/06	MVB1660R6	6PK1660				
	Eng. ASV, →02/06,	TB533	141x25				
	→ Eng Nr 150000						
	Eng. ASV, →02/06,	TB659	141x26				
	Eng Nr 150001→						
1.9 TDI	ASZ	96	01/03 →		→07/01, → Eng Nr 006065	TBK116	
					Eng. ASV, →02/06,	TBK107	
					→ Eng Nr 150000		
					Eng. ASV, →02/06,	TBK272	
					Eng Nr 150001→		
					Eng Nr 150000→		
1.9 TDI	ATD, AXR	74	08/00 →		A/C(-), →09/04	MVB1125R6	6PK1125
					A/C(+), →09/04	MVB1200R6D	6DPK1200
					→09/04	TB680	120x30
1.9 TDI	ATD, AXR	74	08/00 →		→09/04	TBK270	
					→02/06		
					→02/06		
					→02/06		
					→02/06		
					→02/06		
1.9 TDI	ATD, AXR	74	08/00 →		Eng. AXR, A/C(-), →02/06	MVB1125R6	6PK1125
					Eng. AXR, A/C(+), →02/06	MVB1200R6D	6DPK1200
					→02/06	TB680	120x30
					→02/06	TBK270	
					→02/06	TBK225	
					Eng. ATD, →02/06,	TBK269	
	→ Eng Nr 211245						
	Eng. ATD,						
	→02/06, → Eng Nr 211245,						
	VD(+)						



kw



SKODA

...SKODA

...OCTAVIA Combi (1U5)

1.9 TDI 4x4	AGR	66	11/99 → 09/00	⊗	A/C(-)	MVB906R6	6PK906
				⊗	A/C(+)	MVB1660R6	6PK1660
					→ Eng Nr 500000	TB533	141x25
					Eng Nr 500001 →	TB659	141x26
					→ Eng Nr 04441	TBK116	
ATD	74	09/00 →	⊗	A/C(-), →02/06	MVB1125R6	6PK1125	
			⊗	A/C(+), →02/06	MVB1200R6D	6DPK1200	
				→02/06	TB680	120x30	
				→02/06, → Eng Nr 211245	TBK225		
				→02/06, → Eng Nr 211245, VD(+)	TBK269		
2.0	AEG, APK, AQY, AZH, AZJ	85	04/99 →	⊗	Eng. AZJ, A/C(-)	MVB1125R6	6PK1125
				⊗	Eng. AZJ, A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
				ATF	88	01/00 →	⊗
2.0 4x4	AEG, AQY, AZH, AZJ	85	05/01 →	⊗	A/C(+)	MVB1200R6D	6DPK1200
				⊗		TB552	138x23
						TBK100	
					Eng. AZJ, A/C(-)	MVB1125R6	6PK1125
					Eng. AZJ, A/C(+)	MVB1200R6D	6DPK1200
RS 1.8 T	AUQ	132	08/02 →	⊗	A/C(-), →02/06	MVB1125R6	6PK1125
				⊗	A/C(+), →02/06	MVB1200R6D	6DPK1200
					→02/06	TB554	150x23
					→02/06	TBK115	

OCTAVIA Combi (1Z5)

1.4	BUD	59	05/06 →	⊗	A/C(-)	MVB736R6	6PK736
				⊗	A/C(+)	MVB1100R6	6PK1100
						TB634	58x17
						TBK246	
1.6	BGU, BSE, BSF, CCSA	75	09/04 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
						TBK100	
1.6 FSI	BLF	85	02/04 →	⊗	A/C(-)	MVB1088R6	6PK1088
1.9 TDI	BJB, BKC, BLS, BXE	77	09/04 →	⊗	A/C(+)	MVB1740R6	6PK1740
				⊗	Eng. BLS, A/C(-)	MVB946R6	6PK946
				⊗	Eng. BLS, A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
1.9 TDI 4x4	BKC, BLS, BXE	77	11/04 →			TBK270	
				⊗	Eng. BLS, A/C(-)	MVB946R6	6PK946
				⊗	Eng. BLS, A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
2.0 FSI	BLR, BLY, BVX, BVY, BVZ	110	11/04 →	⊗		TBK270	
				⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(-), 10/05 →	MVB955R6	6PK955
				⊗	A/C(+)	MVB1045R6	6PK1045
2.0 FSI 4x4	BLX, BLY, BVX	110	11/04 →	⊗	A/C(+), 10/05 →	MVB1050R6	6PK1050
						TB753	148x23
				⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(-), 10/05 →	MVB955R6	6PK955
				⊗	A/C(+)	MVB1045R6	6PK1045
				⊗	A/C(+), 10/05 →	MVB1050R6	6PK1050
						TB753	148x23



kW



SKODA

...SKODA

...OCTAVIA Combi (1Z5)

2.0 RS	BWA	147	10/05 →		A/C(-)	MVB900R6	6PK900			
					A/C(-)	MVB955R6	6PK955			
					A/C(+)	MVB1045R6	6PK1045			
					A/C(+)	MVB1050R6	6PK1050			
						TB753	148x23			
2.0 TDI	BMM	103	11/05 →		A/C(-)	MVB946R6	6PK946			
					A/C(+)	MVB1050R6	6PK1050			
									TB680	120x30
									TBK270	
						MVB946R6	6PK946			
						MVB1050R6	6PK1050			
						TB743	141x30			
						TBK262				
2.0 TDI 4x4	BMM	103	07/06 →		A/C(-)	MVB946R6	6PK946			
					A/C(+)	MVB1050R6	6PK1050			
									TB680	120x30
									TBK270	
2.0 TDI 16V	BKD	103	02/04 →		A/C(-)	MVB946R6	6PK946			
					A/C(+)	MVB1050R6	6PK1050			
									TB743	141x30
									TBK262	

PRAKTIK

1.2	BZG	51	03/07 →		A/C(-)	MVB1450R6	6PK1450			
					A/C(+)	MVB1875R6	6PK1875			
1.4	BXW	63	03/07 →		A/C(-)	MVB736R6	6PK736			
					A/C(+)	MVB1080R6	6PK1080			
									TB634	58x17
									TBK246	
1.4 TDI	BMS, BNV	59	03/07 →		Eng. BMS, A/C(-)	MVB825R6	6PK825			
					Eng. BMS, A/C(+)	MVB1180R6	6PK1180			
									TB680	120x30
									TBK270	
1.4 TDI	BNM	51	03/07 →		A/C(-), 10/07 →	MVB825R6	6PK825			
					A/C(+), 10/07 →	MVB1000R6	6PK1000			
									TB680	120x30
									TBK270	

ROOMSTER (5J)

1.2	BME	47	05/06 → 01/07		A/C(-)	MVB1450R6	6PK1450			
					A/C(+)	MVB1875R6	6PK1875			
1.2	BZG	51	01/07 →		A/C(-)	MVB1450R6	6PK1450			
					A/C(+)	MVB1875R6	6PK1875			
1.4	BXW	63	09/06 →		A/C(-)	MVB736R6	6PK736			
					A/C(+)	MVB1080R6	6PK1080			
									TB634	58x17
									TBK246	
1.4 TDI	BNM	51	07/06 →		A/C(-)	MVB825R6	6PK825			
					A/C(+)	MVB1000R6	6PK1000			
									TB680	120x30
									TBK270	
1.4 TDI	BMS, BNV	59	09/06 →		A/C(+)	MVB1000R6	6PK1000			
					Eng. BMS, A/C(-)	MVB825R6	6PK825			
					Eng. BMS, A/C(+)	MVB1180R6	6PK1180			
									TB680	120x30
					TBK270					
1.6	BTS	77	09/06 →		A/C(-)	MVB1088R6	6PK1088			
					A/C(+)	MVB1740R6	6PK1740			
1.9 TDI	BLS, BSW	77	09/06 →		A/C(-)	MVB780R6	6PK780			
					A/C(+)	MVB1180R6	6PK1180			
									TB680	120x30
									TBK270	



kw



SKODA

...SKODA

SUPERB (3U4)

1.8 T	AWT	110	02/02 →	 		MVB855R4 4PK855 MVB1300R5 5PK1300 TB554 150x23 TBK341
1.9 TDI	AVF, AWX	96	02/02 →	 	Eng. AVF	MVB855R4 4PK855 MVB1432R5 5PK1432 TB680 120x30 TBK270
				 	→04/08, → Ch. 3U-3-009506	TBK225
				 	→04/08, → Ch. 3U-3-009506, VD(+)	TBK269
1.9 TDI	AVB	74	08/02 →	 	→04/08	MVB855R4 4PK855 MVB1432R5 5PK1432 TB680 120x30 TBK225
				 	→04/08, → Ch. 3U-3-009506	TBK270
				 	→04/08, → Ch. 3U-3-009506, VD(+)	TBK269
1.9 TDI	BPZ	85	01/07 →	 	→04/08, Ch. 3U-3-009507 →	TBK270
				 		MVB855R4 4PK855 MVB1432R5 5PK1432 TB680 120x30 TBK270
				 		MVB855R4 4PK855 MVB1432R5 5PK1432 TB680 120x30 TBK270
2.0	AZM	85	02/02 →	 	→04/08	MVB855R4 4PK855 MVB1300R5 5PK1300 TB552 138x23 TBK100
				 	→04/08	
				 	→04/08	
2.0 TDI	BSS	103	10/05 →	 		MVB855R4 4PK855 MVB1432R5 5PK1432 TB680 120x30 TBK270
2.5 TDI	AYM	114	02/02 →	 	→08/03	MVB1238R4 4PK1238 MVB2403R6 6PK2403 TB738 207x30 TBK348
				 	→08/03, VD(+)	TBK354
				 	→08/03	TB641 87x25
2.5 TDI	BDG	120	06/03 →	 	→04/08	MVB1238R4 4PK1238 MVB2403R6 6PK2403 TB738 207x30 TBK348
				 	→04/08, VD(+)	TBK354
				 	→04/08	TB641 87x25
2.8 V6	AMX	142	02/02 →	 	→04/08	MVB1875R6 6PK1875 TB556 253x30 TBK357
				 	→04/08, VD(+)	TBK353

SMART

CABRIO

0.6		52	06/02 → 01/04	 	→06/03	MVB850R3 3PK850 MVB790R4 4PK790
0.6 (S10LA1)	M 160 E6AL B03	40	03/00 → 01/04		→06/03	MVB850R3 3PK850 MVB790R4 4PK790
					→06/03	
0.6 (S10LD2)	M 160 E6AL B05	45	01/01 → 01/04	 	→06/03	MVB850R3 3PK850 MVB790R4 4PK790



kW



SMART

...SMART

...CABRIO

0.7		45	01/03 → 01/04	☼ ⌚		MVB850R3	3PK850
		55	01/03 → 01/04	☼ ⌚		MVB790R4	4PK790
0.8 CDI (S10LC1)	OM 660 DE 8LA	30	03/01 → 01/04	☼ ⌚		MVB850R3	3PK850
						MVB768R5	5PK768

CITY-COUPÉ (MC01)

0.6	M 160 E6AL B05	45	01/01 → 01/04	☼ ⌚	→06/03	MVB850R3	3PK850
		52	06/02 → 01/04	☼ ⌚	→06/03	MVB790R4	4PK790
0.6 (S1CLA1)	M 160 E6AL B03	40	07/98 → 01/04	☼ ⌚	→06/03	MVB850R3	3PK850
0.6 (S1CLB1)	M 160 E6AL B04	33	07/98 → 01/04	☼ ⌚	→06/03	MVB790R4	4PK790
0.7		37	01/03 → 01/04	☼ ⌚	→06/03	MVB850R3	3PK850
		45	01/03 → 01/04	☼ ⌚	→06/03	MVB790R4	4PK790
		55	01/03 → 01/04	☼ ⌚	→06/03	MVB850R3	3PK850
						MVB790R4	4PK790
0.8 CDI (S1CLC1)	OM 660 DE 8LA	30	11/99 → 01/04	☼ ⌚		MVB850R3	3PK850
						MVB768R5	5PK768

CROSSBLADE

0.6		52	06/02 →	☼ ⌚	03/03 → 12/06	MVB850R3	3PK850
					03/03 → 12/06	MVB790R4	4PK790

FORFOUR

1.1		47	02/05 →	☼ ⌚	→08/06	MVB1225R5	5PK1225
					→08/06	MVB915R5	5PK915
1.1 (454.030)		55	01/04 →	☼ ⌚	→08/06	MVB1225R5	5PK1225
					→08/06	MVB915R5	5PK915
1.3 (454.031)		70	01/04 →	☼ ⌚	→08/06	MVB1225R5	5PK1225
					→08/06	MVB915R5	5PK915
1.5		90	01/04 →	⌚	A/C(-), →08/06	MVB915R5	5PK915
				⌚	A/C(+), →08/06	MVB1225R5	5PK1225
1.5 (454.032)		80	01/04 →	⌚	A/C(-), →08/06	MVB915R5	5PK915
				⌚	A/C(+), →08/06	MVB1225R5	5PK1225
1.5 BRABUS (454.034)		130	05/05 →	⌚	→08/06	MVB800R4	4PK800
1.5 CDI (454.000)		50	09/04 →	☼ ⌚	→08/06	MVB1225R5	5PK1225
					→08/06	MVB915R5	5PK915
1.5 CDI (454.001)		70	09/04 →	☼ ⌚	→08/06	MVB1225R5	5PK1225
					→08/06	MVB915R5	5PK915

FORTWO cabrio

0.7 (450.432)		45	01/04 →	⌚	A/C(-), →12/06	MVB790R4	4PK790
				⌚	A/C(+), →12/06	MVB850R3	3PK850
0.7 (450.433)		55	01/04 →	⌚	A/C(-), →12/06	MVB790R4	4PK790
				⌚	A/C(+), →12/06	MVB850R3	3PK850
0.8 CDI (450.400)	OM 660 DE 8LA	30	01/04 →	☼ ⌚	→12/06	MVB850R3	3PK850
					→12/06	MVB768R5	5PK768
1.0 (451.431)	M132.910	52	01/07 →	⌚		MVB800R4	4PK800
1.0 Brabus (451.433)	M132.930	72	01/08 →	⌚		MVB800R4	4PK800
1.0 Turbo (451.432)	M132.930	62	01/07 →	⌚		MVB800R4	4PK800

FORTWO Coupe

0.7 (450.330)		37	01/04 →	☼ ⌚	→12/06	MVB850R3	3PK850
					→12/06	MVB790R4	4PK790
0.7 (450.332)		45	01/04 →	☼ ⌚	→12/06	MVB850R3	3PK850
					→12/06	MVB790R4	4PK790
0.7 (450.333)		55	01/04 →	☼ ⌚	→12/06	MVB850R3	3PK850
					→12/06	MVB790R4	4PK790



kw



SMART

...SMART

...FORTWO Coupe

0.8 CDI (450.300)	OM 660 DE 8LA	30	01/04 →		→12/06	MVB850R3	3PK850
					→12/06	MVB768R5	5PK768
1.0 (451.330)	M132.910	45	01/07 →			MVB800R4	4PK800
1.0 (451.331)	M132.910	52	01/07 →			MVB800R4	4PK800
1.0 Brabus (451.333)	M132.930	72	01/08 →			MVB800R4	4PK800
1.0 Turbo (451.332)	M132.930	62	01/07 →			MVB800R4	4PK800

ROADSTER

0.7 (452.432)		45	04/03 →			MVB850R3	3PK850
						MVB790R4	4PK790
0.7 (452.434)		60	04/03 →			MVB850R3	3PK850
						MVB790R4	4PK790
0.7 Brabus (452.437)		74	12/03 →			MVB850R3	3PK850
						MVB790R4	4PK790

ROADSTER Coupe

0.7 (452.332)		45	06/03 →			MVB850R3	3PK850
						MVB790R4	4PK790
0.7 (452.334)		60	04/03 →			MVB850R3	3PK850
						MVB790R4	4PK790
0.7 Brabus (452.337)		74	12/03 →			MVB850R3	3PK850
						MVB790R4	4PK790

SUBARU

1800 XT COUPE (XT)

Turbo 4WD	EA82	88	01/88 → 12/90			MVB985R4	4PK985
					MS, V-belt pulley (+)	SVB131100	13x1100
					PS, V-belt pulley (+)	SVB131150	13x1150
					A/C(-)	MVB950R4	4PK950
					A/C(-), MS, V-belt pulley (+)	SVB13925	13x925
					A/C(-), PS, V-belt pulley (+)	SVB13975	13x975
					A/C(+)	MVB1125R4	4PK1125
					A/C(+), MS, V-belt pulley (+)	SVB13950	13x950
					Left	TB324	119x19
					Right	TB323	98x19
		96	01/87 → 12/90			MVB985R4	4PK985
					MS, V-belt pulley (+)	SVB131100	13x1100
					PS, V-belt pulley (+)	SVB131150	13x1150
					A/C(-)	MVB950R4	4PK950
					A/C(-), MS, V-belt pulley (+)	SVB13925	13x925
					A/C(+)	MVB1125R4	4PK1125
					A/C(+), MS, V-belt pulley (+)	SVB13950	13x950
					A/C(+), PS, V-belt pulley (+)	SVB13975	13x975
					Left	TB324	119x19
					Right	TB323	98x19
		100	11/84 → 12/90		06/85 →	MVB985R4	4PK985
					MS, V-belt pulley (+), 06/85 →	SVB131100	13x1100
					PS, V-belt pulley (+), 06/85 →	SVB131150	13x1150
					06/85 → 12/85	SVB10913	10x913
					A/C(-), MS, V-belt pulley (+),	SVB13925	13x925
					01/86 →		
					A/C(-), PS, V-belt pulley (+),	SVB13975	13x975
					01/86 →		
					A/C(-),	MVB950R4	4PK950
					V-ribbed belt pulley (+),		
					11/85 →		
					A/C(+), MS, V-belt pulley (+),	SVB13950	13x950
					01/86 →		
					A/C(+),	MVB1125R4	4PK1125
					V-ribbed belt pulley (+),		
					11/85 →		
					Left, 11/85 →	TB324	119x19
					Right, 11/85 →	TB323	98x19



kW



...SUBARU

FORESTER (SF)

2.0	EJ20	90	08/97 → 09/02	☼ ⌚ 🌀 🌀	→08/98 →08/98 →08/98	MVB900R4 MVB875R5 TB339	4PK900 5PK875 211x30
		92	06/98 → 09/02	☼ ⌚ 🌀 🌀	→05/02 →05/02	MVB900R4 MVB875R5	4PK900 5PK875
2.0 S Turbo	EJ20	125	06/98 → 04/01	☼ ⌚ 🌀 🌀		MVB900R4 MVB875R5 TB758	4PK900 5PK875 281x30
		130	04/01 → 09/02	☼ ⌚ 🌀 🌀	→05/02 →05/02 →05/02	MVB900R4 MVB875R5 TB758	4PK900 5PK875 281x30

FORESTER (SG)

2.0	EJ20	92	09/02 →	☼ ⌚ 🌀 🌀	→05/05 →05/05	MVB900R4 MVB875R5	4PK900 5PK875
2.0 S Turbo	EJ20	130	09/02 →	☼ ⌚ 🌀 🌀	→05/05 →05/05 →05/05	MVB900R4 MVB875R5 TB758	4PK900 5PK875 281x30
2.0 X		116	09/05 →	☼ ⌚ 🌀 🌀	→05/08 →05/08	MVB855R4 MVB869R5	4PK855 5PK869
2.5	EJ25	155	12/03 →	☼ ⌚ 🌀 🌀	→05/05 →05/05 →05/05	MVB900R4 MVB875R5 TB758	4PK900 5PK875 281x30
2.5 XT		169	09/05 →	☼ ⌚ 🌀 🌀	→05/08 →05/08 →05/08	MVB900R4 MVB875R5 TB758	4PK900 5PK875 281x30

IMPREZA Coupe (GFC)

1.6		66	12/96 → 12/00	☼ ⌚ 🌀 🌀 🌀	MS PS	MVB900R4 MVB688R5 MVB875R5 TB339	4PK900 5PK688 5PK875 211x30
1.6 4WD		66	12/96 → 12/00	☼ ⌚ 🌀 🌀	09/98 → MS, 09/98 → PS, 09/98 →	MVB885R4 MVB688R5 MVB875R5	4PK885 5PK688 5PK875
2.0 4WD	EJ20	85	12/95 → 12/00	☼ ⌚ 🌀 🌀 🌀	MS PS	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
2.0 Turbo 4WD	EJ20G	155	12/96 → 12/00	☼ ⌚ 🌀 🌀 🌀		MVB885R4 MVB845R4 MVB875R5 TB551	4PK885 4PK845 5PK875 281x30

IMPREZA Estate (GD, GG)

1.6	EJ16	70	12/00 →	☼ ⌚ 🌀 🌀	→09/05 MS, →09/05 PS, →09/05	MVB885R4 MVB688R5 MVB875R5	4PK885 5PK688 5PK875
2.0	EJ20	92	12/00 →	☼ ⌚ 🌀 🌀	→09/05 MS, →09/05 PS, →09/05	MVB885R4 MVB688R5 MVB875R5	4PK885 5PK688 5PK875

IMPREZA Estate (GF)

1.6 i		70	06/98 → 12/00	☼ ⌚ 🌀 🌀	MS PS	MVB885R4 MVB688R5 MVB875R5	4PK885 5PK688 5PK875
1.6 i 4WD		70	06/98 → 12/00	☼ ⌚ 🌀 🌀	MS PS	MVB885R4 MVB688R5 MVB875R5	4PK885 5PK688 5PK875



kw



SUBARU

...SUBARU

...IMPREZA Estate (GF)

1.6 i 4WD	EJ16	66	08/92 → 12/00	☼ ☼ ⌚ ⌚ 🌀	01/93→07/95 08/95→08/98 MS, 01/93→08/98 PS, 01/93→08/98 01/93→08/98	MVB855R4 MVB900R4 MVB688R5 MVB875R5 TB339	4PK855 4PK900 5PK688 5PK875 211x30
1.8		76	11/95 → 06/96	☼ ⌚ ⌚ 🌀	MS PS	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
1.8 i 4WD	EJ18	76	08/92 → 12/00	☼ ⌚ ⌚ 🌀	01/93→06/96 MS, 01/93→06/96 PS, 01/93→06/96 01/93→06/96	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
2.0 4WD	EJ20	85	12/95 → 12/00	☼ ⌚ ⌚ 🌀	→08/98 MS, →08/98 PS, →08/98 →08/98	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
2.0 16V AWD		92	06/98 → 12/00	☼ ⌚ ⌚	MS PS	MVB885R4 MVB688R5 MVB875R5	4PK885 5PK688 5PK875
2.0 i Turbo 4WD	EJ20 (Turbo)	155	03/94 → 12/00	☼ ⌚ 🌀	→08/98 →08/98 →08/98	MVB885R4 MVB875R5 TB551	4PK885 5PK875 281x30
2.0 Turbo GT 4WD		160	06/98 → 12/00	☼ ⌚ 🌀		MVB885R4 MVB875R5 TB758	4PK885 5PK875 281x30

IMPREZA Saloon (GC)

1.6 i	EJ16	66	08/92 → 12/00	☼ ☼ ⌚ ⌚ 🌀	01/93→07/95 08/95→ MS, 01/93→ PS, 01/93→ 01/93→	MVB855R4 MVB900R4 MVB688R5 MVB875R5 TB339	4PK855 4PK900 5PK688 5PK875 211x30
		70	06/98 → 12/00	☼ ⌚ ⌚	MS PS	MVB885R4 MVB688R5 MVB875R5	4PK885 5PK688 5PK875
1.6 i 4WD		70	06/98 → 12/00	☼ ⌚ ⌚	MS PS	MVB885R4 MVB688R5 MVB875R5	4PK885 5PK688 5PK875
1.6 i 4WD	EJ16	66	08/92 → 12/00	☼ ☼ ⌚ ⌚ 🌀	01/93→07/95 08/95→ MS, 01/93→ PS, 01/93→ 01/93→	MVB855R4 MVB900R4 MVB688R5 MVB875R5 TB339	4PK855 4PK900 5PK688 5PK875 211x30
1.8 i 4WD	EJ18, EJ18E	76	08/92 → 12/00	☼ ☼ ⌚ ⌚ 🌀	01/93→02/95 02/95→06/96 Eng. EJ18E, MS, 01/93→06/96 Eng. EJ18E, PS, 01/93→06/96 01/93→06/96	MVB885R4 MVB900R4 MVB688R5 MVB875R5 TB339	4PK885 4PK900 5PK688 5PK875 211x30
2.0 i 4WD	EJ20	85	10/95 → 12/00	☼ ⌚ ⌚ 🌀	MS PS	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
		92	06/98 → 12/00	☼ ⌚ ⌚	MS PS	MVB885R4 MVB688R5 MVB875R5	4PK885 5PK688 5PK875
2.0 Turbo GT 4WD	EJ20 (Turbo)	155	03/94 → 12/00	☼ ⌚ ⌚ 🌀		MVB885R4 MVB845R4 MVB875R5 TB551	4PK885 4PK845 5PK875 281x30
		160	06/98 → 12/00	☼ ⌚ 🌀		MVB885R4 MVB875R5 TB758	4PK885 5PK875 281x30





kW



...SUBARU

IMPREZA Saloon (GD, GG)

1.5		77	05/06 →		→08/07	MVB900R4	4PK900
					→08/07	MVB869R5	5PK869
					→08/07	TB758	281x30
1.6	EJ16	70	12/00 →		→09/05	MVB885R4	4PK885
					MS, →09/05	MVB688R5	5PK688
					PS, →09/05	MVB875R5	5PK875
2.0	EJ20	92	12/00 →		→09/05	MVB885R4	4PK885
					MS, →09/05	MVB688R5	5PK688
					PS, →09/05	MVB875R5	5PK875

JUSTY I (KAD)

1000	EF10	40	11/84 → 06/89		→12/88	SVB10675	10x675
					Cat(-), 01/89→	SVB10690	10x690
					Cat(+), 01/89→	MVB725R4	4PK725
						TB171	88x19
						MVB660R3	3PK660
		37	05/87 → 10/95		→12/88	SVB10675	10x675
					Cat(-), 01/89→	SVB10690	10x690
					Cat(+), 01/89→	MVB725R4	4PK725
						TB171	88x19
						MVB660R3	3PK660
1000 4WD (KAD-A)	EF10	40	11/84 → 12/90		→12/88	SVB10675	10x675
					Cat(-), 01/89→	SVB10690	10x690
					Cat(+), 01/89→	MVB725R4	4PK725
						TB171	88x19
						MVB660R3	3PK660
		37	05/87 → 11/94		→12/88	SVB10675	10x675
					Cat(-), 01/89→	SVB10690	10x690
					Cat(+), 01/89→	MVB725R4	4PK725
						TB171	88x19
						MVB660R3	3PK660
1200	EF12	49	05/87 → 10/95		→12/88	SVB10675	10x675
					01/89→	MVB725R4	4PK725
						TB322	89x19
						MVB660R3	3PK660
1200 4WD	EF12	55	10/90 → 12/94			MVB725R4	4PK725
						TB322	89x19
						MVB660R3	3PK660
		50	10/86 → 12/90		→12/88	SVB10675	10x675
					01/89→	MVB725R4	4PK725
						TB322	89x19
						MVB660R3	3PK660
1200 4WD (KAD-A)	EF12	49	05/87 → 05/91		→12/88	SVB10675	10x675
					01/89→	MVB725R4	4PK725
						TB322	89x19
						MVB660R3	3PK660

JUSTY II (JMA, MS)

1.3 4x4	G13BB	63	04/01 → 11/03		MS	MVB790R4	4PK790
						MVB810R4	4PK810
						TB456	89x25.4
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB950R4	4PK950
1.3 GX 4x4	EF13	50	10/95 → 11/03		MS, 05/96→	MVB790R4	4PK790
					01/97→	MVB810R4	4PK810
					05/96→12/96	MVB813R3	3PK813
					01/97→	TB456	89x25.4
					05/96→12/96	TB322	89x19
					A/C(-), 05/96→	MVB850R4	4PK850
					A/C(+), 05/96→	MVB950R4	4PK950



kW



SUBARU

...SUBARU

JUSTY III (G3X)

1.3		69	09/03 →			→08/07	MVB800R4	4PK800
-----	--	----	---------	--	--	--------	-----------------	--------

LEGACY I (BC)

1800	EJ18 SPI	76	01/89 → 12/93	 		05/89 → MS, 05/89 → PS, 05/89 → 05/89 →	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
1800 4WD	EJ18 SPI	76	01/89 → 09/91	 		05/89 → MS, 05/89 → PS, 05/89 → 05/89 →	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
2000 4WD	EJ20 EMPI	85	08/91 → 07/94	 		→12/93 MS, →12/93 PS, →12/93 →12/93	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
2000 Turbo 4WD	EJ20-GN	147	05/92 → 07/94	 		→12/93 →12/93 →12/93	MVB885R4 MVB875R5 TB551	4PK885 5PK875 281x30
2200 4WD	EJ22 EMPI	100	01/89 → 07/94	 		05/89 →12/93 MS, 05/89 →12/93 PS, 05/89 →12/93 05/89 →12/93	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30

LEGACY I Estate (BJF)

1800	EJ18 SPI	76	01/89 → 07/94	 		05/89 →12/93 MS, 05/89 →12/93 PS, 05/89 →12/93 05/89 →12/93	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
1800 4WD	EJ18 SPI	76	01/89 → 07/94	 		05/89 →12/93 MS, 05/89 →12/93 PS, 05/89 →12/93 05/89 →12/93	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
2000	EJ20 EMPI	85	09/91 → 12/93	 		MS PS	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
2000 4WD	EJ20 EMPI	85	09/91 → 07/94	 		→12/93 MS, →12/93 PS, →12/93 →12/93	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30
2000 Turbo Super 4WD	EJ20-GN	147	05/92 → 07/94	 		→12/93 →12/93 →12/93	MVB885R4 MVB875R5 TB551	4PK885 5PK875 281x30
2200 Super 4WD	EJ22 EMPI	100	01/89 → 07/94	 		05/89 →12/93 MS, 05/89 →12/93 PS, 05/89 →12/93 05/89 →12/93	MVB885R4 MVB688R5 MVB875R5 TB339	4PK885 5PK688 5PK875 211x30

LEGACY II (BD, BG)

2.0 i	EJ20E	85	09/94 → 03/99	 		→09/98 →09/98 →09/98	MVB885R4 MVB875R5 TB339	4PK885 5PK875 211x30
2.0 i 4WD	EJ20	85	09/94 → 03/99	 		→09/98 →09/98 →09/98	MVB885R4 MVB875R5 TB339	4PK885 5PK875 211x30
2.2 i 4WD	EJ22 EMPI	94	09/94 → 03/99	 		→09/98 →09/98 →09/98	MVB885R4 MVB875R5 TB339	4PK885 5PK875 211x30
		96	06/96 → 03/99	 		→09/98 →09/98 →09/98	MVB885R4 MVB875R5 TB339	4PK885 5PK875 211x30
2.5 i 4WD	EJ25D	110	06/96 → 03/99	 		→09/98 →09/98 →09/98	MVB885R4 MVB875R5 TB551	4PK885 5PK875 281x30





kW



...SUBARU

LEGACY II Estate (BD, BG)

2.0 i	EJ20 EMPI	85	09/94 → 11/98	 	MVB885R4 MVB875R5 TB339	4PK885 5PK875 211x30
2.0 i 4WD	EJ20	85	09/94 → 11/98	 	MVB885R4 MVB875R5 TB339	4PK885 5PK875 211x30
2.2 i 4WD	EJ22 EMPI	94	09/94 → 11/98	 	MVB885R4 MVB875R5 TB339	4PK885 5PK875 211x30
		96	06/96 → 11/98	 	MVB885R4 MVB875R5 TB339	4PK885 5PK875 211x30
2.5 i 4WD	EJ25D	110	06/96 → 11/98	 	MVB885R4 MVB875R5 TB551	4PK885 5PK875 281x30

LEGACY III (BE, BH)

2.0	EJ20	92	04/99 → 08/03	 	MVB885R4 MVB875R5	4PK885 5PK875
2.5		115	10/98 → 08/03	 	MVB885R4 MVB875R5	4PK885 5PK875

LEGACY III Estate (BE, BH)

2.0	EJ20	92	12/98 → 08/03	 	MVB885R4 MVB875R5	4PK885 5PK875
2.5	EJ25	115	12/98 → 08/03	 	MVB885R4 MVB875R5	4PK885 5PK875

LEGACY IV

2.0		101	09/03 →		→10/05	MVB845R4	4PK845
3.0	EZ30	180	09/03 →			MVB1588R6	6PK1588

LEGACY IV Estate (B13_)

2.0	EJ20	101	09/03 →		→10/05	MVB845R4	4PK845
2.0 Turbo R AWD		121	06/05 →	 		MVB845R4 MVB869R5 TB758	4PK845 5PK869 281x30
3.0	EZ30	180	09/03 →			MVB1588R6	6PK1588

LEONE II

1.8		77	06/85 → 07/86		MS, V-belt pulley (+)	SVB131100	13x1100
					PS, V-belt pulley (+)	SVB131150	13x1150
					V-ribbed belt pulley (+)	MVB985R4	4PK985
					→12/85	SVB10913	10x913
					A/C(-), MS, V-belt pulley (+), 01/86→	SVB13925	13x925
					A/C(-), V-ribbed belt pulley (+), 01/86→	MVB950R4	4PK950
					A/C(+), MS, V-belt pulley (+), 01/86→	SVB13950	13x950
					A/C(+), PS, V-belt pulley (+), 01/86→	SVB13975	13x975
					A/C(+), V-ribbed belt pulley (+), 01/86→	MVB1125R4	4PK1125
				 	Left, 01/86→ Right, 01/86→	TB324 TB323	119x19 98x19
1600	EA71	55	11/84 → 09/91	 	→12/85 MS, 01/86→07/90 PS, 01/86→07/90	SVB10900 SVB13925 SVB13975	10x900 13x925 13x975



kW



SUBARU

...SUBARU

...LEONE II

Model	Engine	Power (kW)	Year Range	Timing	Accessories	Part Number	Dimensions					
1800 4WD	EA82	66	11/84 → 12/90		MS, V-belt pulley (+), 06/85→	SVB131100	13x1100					
					PS, V-belt pulley (+), 06/85→	SVB131150	13x1150					
					V-ribbed belt pulley (+), 06/85→	MVB985R4	4PK985					
					06/85→							
					06/85→12/85	SVB10913	10x913					
					A/C(-), MS, V-belt pulley (+), 01/86→	SVB13925	13x925					
					A/C(-), V-ribbed belt pulley (+), 01/86→	MVB950R4	4PK950					
					A/C(+), MS, V-belt pulley (+), 01/86→	SVB13950	13x950					
					A/C(+), PS, V-belt pulley (+), 01/86→	SVB13975	13x975					
					A/C(+), V-ribbed belt pulley (+), 01/86→	MVB1125R4	4PK1125					
					Left, 01/86→	TB324	119x19					
					Right, 01/86→	TB323	98x19					
					88	01/88 → 12/90	88	01/88 → 12/90		MS, V-belt pulley (+)	SVB131100	13x1100
										PS, V-belt pulley (+)	SVB131150	13x1150
										V-ribbed belt pulley (+)	MVB985R4	4PK985
A/C(-), MS, V-belt pulley (+)	SVB13925	13x925										
A/C(-), V-ribbed belt pulley (+)	MVB950R4	4PK950										
A/C(+), MS, V-belt pulley (+)	SVB13950	13x950										
A/C(+), PS, V-belt pulley (+)	SVB13975	13x975										
A/C(+), V-ribbed belt pulley (+)	MVB1125R4	4PK1125										
Left	TB324	119x19										
Right	TB323	98x19										
1800 4WD CAT		70	07/86 → 09/91							MS, V-belt pulley (+)	SVB131100	13x1100
										PS, V-belt pulley (+)	SVB131150	13x1150
										V-ribbed belt pulley (+)	MVB985R4	4PK985
										A/C(-), MS, V-belt pulley (+)	SVB13925	13x925
										A/C(-), V-ribbed belt pulley (+)	MVB950R4	4PK950
					A/C(+), MS, V-belt pulley (+)	SVB13950	13x950					
					A/C(+), PS, V-belt pulley (+)	SVB13975	13x975					
					A/C(+), V-ribbed belt pulley (+)	MVB1125R4	4PK1125					
					Left	TB324	119x19					
					Right	TB323	98x19					



kW



...SUBARU

...LEONE II

1800 Turbo 4WD	EA82	96	03/89 → 12/90	☼	MS, V-belt pulley (+)	SVB131100	13x1100
				☼	PS, V-belt pulley (+)	SVB131150	13x1150
				☼	V-ribbed belt pulley (+)	MVB985R4	4PK985
				⊖	A/C(-), MS, V-belt pulley (+)	SVB13925	13x925
				⊖	A/C(-), V-ribbed belt pulley (+)	MVB950R4	4PK950
				⊖	A/C(+), MS, V-belt pulley (+)	SVB13950	13x950
				⊖	A/C(+), PS, V-belt pulley (+)	SVB13975	13x975
				⊖	A/C(+), V-ribbed belt pulley (+)	MVB1125R4	4PK1125
					Left	TB324	119x19
					Right	TB323	98x19
		100	11/84 → 12/90	☼	MS, V-belt pulley (+), 06/85→	SVB131100	13x1100
				☼	PS, V-belt pulley (+), 06/85→	SVB131150	13x1150
				☼	V-ribbed belt pulley (+), 06/85→	MVB985R4	4PK985
				⊖	06/85→12/85	SVB10913	10x913
				⊖	A/C(-), MS, V-belt pulley (+), 01/86→	SVB13925	13x925
				⊖	A/C(-), V-ribbed belt pulley (+), 01/86→	MVB950R4	4PK950
				⊖	A/C(+), MS, V-belt pulley (+), 01/86→	SVB13950	13x950
				⊖	A/C(+), PS, V-belt pulley (+), 01/86→	SVB13975	13x975
				⊖	A/C(+), V-ribbed belt pulley (+), 01/86→	MVB1125R4	4PK1125
					Left, 01/86→	TB324	119x19
					Right, 01/86→	TB323	98x19

LEONE II Estate

1800 4WD	EA82	66	11/84 → 12/90	☼	MS, V-belt pulley (+), 06/85→	SVB131100	13x1100
				☼	PS, V-belt pulley (+), 06/85→	SVB131150	13x1150
				☼	V-ribbed belt pulley (+), 06/85→	MVB985R4	4PK985
				⊖	A/C(-), MS, V-belt pulley (+), 06/85→	SVB13925	13x925
				⊖	A/C(-), V-ribbed belt pulley (+), 06/85→	MVB950R4	4PK950
				⊖	A/C(+), MS, V-belt pulley (+), 06/85→	SVB13950	13x950
				⊖	A/C(+), PS, V-belt pulley (+), 06/85→	SVB13975	13x975
				⊖	A/C(+), V-ribbed belt pulley (+), 06/85→	MVB1125R4	4PK1125
					Left, 06/85→	TB324	119x19
					Right, 06/85→	TB323	98x19
		88	01/88 → 12/90	☼	MS, V-belt pulley (+)	SVB131100	13x1100
				☼	PS, V-belt pulley (+)	SVB131150	13x1150
				☼	V-ribbed belt pulley (+)	MVB985R4	4PK985
				⊖	A/C(-), MS, V-belt pulley (+)	SVB13925	13x925
				⊖	A/C(-), V-ribbed belt pulley (+)	MVB950R4	4PK950
				⊖	A/C(+), MS, V-belt pulley (+)	SVB13950	13x950
				⊖	A/C(+), PS, V-belt pulley (+)	SVB13975	13x975
				⊖	A/C(+), V-ribbed belt pulley (+)	MVB1125R4	4PK1125
					Left	TB324	119x19
					Right	TB323	98x19



kW



SUBARU

...SUBARU

...LEONE II Estate

1800 Super 4WD	EA82	96	03/89 → 12/90	☼	MS, V-belt pulley (+)	SVB131100	13x1100
				☼	PS, V-belt pulley (+)	SVB131150	13x1150
				☼	V-ribbed belt pulley (+)	MVB985R4	4PK985
				⌚	A/C(-), MS, V-belt pulley (+)	SVB13925	13x925
				⌚	A/C(-),	MVB950R4	4PK950
					V-ribbed belt pulley (+)		
				⌚	A/C(+), MS, V-belt pulley (+)	SVB13950	13x950
				⌚	A/C(+), PS, V-belt pulley (+)	SVB13975	13x975
				⌚	A/C(+),	MVB1125R4	4PK1125
					V-ribbed belt pulley (+)		
	Left	TB324	119x19				
	Right	TB323	98x19				
1800 Super 4WD CAT		70	07/86 → 02/92	☼	MS, V-belt pulley (+)	SVB131100	13x1100
				☼	PS, V-belt pulley (+)	SVB131150	13x1150
				☼	V-ribbed belt pulley (+)	MVB985R4	4PK985
				⌚	A/C(-), MS, V-belt pulley (+)	SVB13925	13x925
				⌚	A/C(-),	MVB950R4	4PK950
					V-ribbed belt pulley (+)		
				⌚	A/C(+), MS, V-belt pulley (+)	SVB13950	13x950
				⌚	A/C(+), PS, V-belt pulley (+)	SVB13975	13x975
				⌚	A/C(+),	MVB1125R4	4PK1125
					V-ribbed belt pulley (+)		
	Left	TB324	119x19				
	Right	TB323	98x19				
1800 Super Turbo 4WD	EA82	100	11/84 → 12/90	☼	MS, V-belt pulley (+), 06/85→	SVB131100	13x1100
				☼	PS, V-belt pulley (+), 06/85→	SVB131150	13x1150
				☼	V-ribbed belt pulley (+),	MVB985R4	4PK985
					06/85→		
				⌚	A/C(-), MS, V-belt pulley (+),	SVB13925	13x925
					06/85→		
				⌚	A/C(-),	MVB950R4	4PK950
					V-ribbed belt pulley (+),		
					06/85→		
				⌚	A/C(+), MS, V-belt pulley (+),	SVB13950	13x950
	06/85→						
⌚	A/C(+), PS, V-belt pulley (+),	SVB13975	13x975				
	06/85→						
⌚	A/C(+),	MVB1125R4	4PK1125				
	V-ribbed belt pulley (+),						
	06/85→						
	Left, 06/85→	TB324	119x19				
	Right, 06/85→	TB323	98x19				

LIBERO Bus (E10, E12)

1.0 4WD (E10, KJ6)	EF10	37	01/83 → 12/87	⌚	01/84→	SVB10700	10x700
					01/84→	TB171	88x19
1.2 4WD (E12, KJ8)	EF12	38	08/86 → 02/00	⌚	08/87→07/94	SVB10700	10x700
				⌚	A/C(-), 10/93→09/97	MVB706R4	4PK706
				⌚	A/C(+), 10/93→09/97	MVB970R4	4PK970
					08/87→07/94	TB328	91x19
1.2 i 4WD (E12, FA)	EF12	40	08/91 → 02/00	⌚	→07/94	SVB10700	10x700
				⌚	A/C(-), 10/93→09/97	MVB706R4	4PK706
				⌚	A/C(+), 10/93→09/97	MVB970R4	4PK970
					→07/94	TB328	91x19

OUTBACK

2.5		121	11/03 →	☼		MVB845R4	4PK845
				⌚		MVB869R5	5PK869
3.0	EZ30	180	11/03 →	⌚		MVB1588R6	6PK1588

OUTBACK (BE, BH)

2.5	EJ25	115	10/00 → 08/03	☼		MVB885R4	4PK885
				⌚		MVB875R5	5PK875
3.0 H6		154	10/00 → 08/03	⌚		MVB1642R6	6PK1642



kW



SUZUKI

...SUBARU

REX II

700	EK42	27	08/82 → 06/89			SVB10675	10x675
						TB171	88x19

REX III

0.5 Kompressor	EN05	45	06/89 → 07/90			SVB10675	10x675
0.7		47	07/90 → 02/92			SVB10675	10x675
						TB171	88x19
0.7 Kompressor 4WD	EN07 Super Charger	47	07/90 → 02/92			SVB10675	10x675
						TB171	88x19
0.8	EN08	31	06/89 → 03/92		01/91 →	SVB10610	10x610
						TB443	107x16

SVX (CX)

3.3 i 24V 4WD (CXW)	EG33 DOHC	169	09/92 → 09/94			MVB850R4	4PK850
		162	09/94 → 12/97			MVB875R5	5PK875
						MVB850R4	4PK850
						MVB875R5	5PK875

VIVIO

660 4WD	EN07E	32	03/92 → 10/95		08/92 →	MVB735R3	3PK735
					08/92 →	SVB10625	10x625

SUZUKI

ALTO II (EC)

0.8 (SB308/CA)	F8B	29	01/86 → 11/93			SVB10825	10x825
						TB171	88x19

ALTO III (EF)

1.0	G10B	39	09/94 → 06/02		→09/00	MVB810R4	4PK810
					→09/00	TB456	89x25.4
					→09/00	MVB835R4	4PK835
		43	01/00 →		10/00 → 03/02	TB456	89x25.4

ALTO IV (FF)

1.1		46	06/02 →			MVB753R3	3PK753
						TB171	88x19

BALENO (EG)

1.3	G13BA	52	09/96 → 05/02		MS	MVB835R4	4PK835
						MVB810R4	4PK810
						TB455	97x25.4
					A/C(-)	MVB900R4	4PK900
					A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB1000R4	4PK1000
1.3 i 16V	G13B	63	07/95 → 05/02		MS	MVB835R4	4PK835
						MVB810R4	4PK810
						TB455	97x25.4
					A/C(-)	MVB900R4	4PK900
					A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB1000R4	4PK1000
1.6 i 16V	G16B	72	07/95 → 05/02		MS	MVB835R4	4PK835
						MVB810R4	4PK810
						TB281	103x25.4
						TBK294	
					A/C(-)	MVB900R4	4PK900
					A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB1000R4	4PK1000
1.6 i 16V 4x4	G16B	72	07/95 → 05/02		MS	MVB835R4	4PK835
						MVB810R4	4PK810
						TB281	103x25.4
						TBK294	
					A/C(-)	MVB900R4	4PK900
					A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB1000R4	4PK1000



kw



SUZUKI

...SUZUKI

...BALENO (EG)

1.8 GT	J18A	89	03/96 → 05/02		A/C(-)	MVB1550R5	5PK1550
					A/C(+)	MVB1638R5	5PK1638
1.9 TD		55	04/98 → 05/02		A/C(-), 02/99→	MVB1155R6	6PK1155
					A/C(+), 02/99→, → Ch. 180000	MVB1740R6	6PK1740
					A/C(+), 02/99→, Ch. 180001→	MVB1725R6	6PK1725
					02/99→	TB560	136x25.4
					02/99→	TBK020	

BALENO Estate (EG)

1.3 16V	G13BB	63	03/97 → 05/02		MS	MVB835R4	4PK835
						MVB810R4	4PK810
						TB455	97x25.4
					A/C(-)	MVB900R4	4PK900
					A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB1000R4	4PK1000
1.6 i 16V	G16B	72	08/96 → 05/02		MS, →10/01	MVB835R4	4PK835
					→10/01	MVB810R4	4PK810
					→10/01	TB281	103x25.4
					→10/01	TBK294	
					A/C(-), →10/01	MVB900R4	4PK900
					A/C(-), →10/01	MVB915R4	4PK915
					A/C(+), →10/01	MVB1000R4	4PK1000
1.6 i 16V 4x4	G16B	72	08/96 → 05/02		MS, →10/01	MVB835R4	4PK835
					→10/01	MVB810R4	4PK810
					→10/01	TB281	103x25.4
					→10/01	TBK294	
					A/C(-), →10/01	MVB900R4	4PK900
					A/C(-), →10/01	MVB915R4	4PK915
					A/C(+), →10/01	MVB1000R4	4PK1000
1.8 i 16V	J18A	89	08/96 → 05/02		A/C(-)	MVB1550R5	5PK1550
					A/C(+)	MVB1638R5	5PK1638
1.9 TD		55	04/98 → 05/02		A/C(-), 02/99→	MVB1155R6	6PK1155
					A/C(+), 02/99→	MVB1740R6	6PK1740
					02/99→	TB560	136x25.4
					02/99→	TBK020	

BALENO Hatchback (EG)

1.3	G13BA	52	09/96 → 05/02		MS	MVB835R4	4PK835
						MVB810R4	4PK810
						TB455	97x25.4
					A/C(-)	MVB900R4	4PK900
					A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB1000R4	4PK1000
1.3 i 16V	G13B	63	07/95 → 05/02		MS	MVB835R4	4PK835
						MVB810R4	4PK810
						TB455	97x25.4
					A/C(-)	MVB900R4	4PK900
					A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB1000R4	4PK1000
1.6 i 16V	G16B	72	07/95 → 05/02		MS	MVB835R4	4PK835
						MVB810R4	4PK810
						TB281	103x25.4
						TBK294	
					A/C(-)	MVB900R4	4PK900
					A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB1000R4	4PK1000
1.6 i 16V 4x4	G16B	72	07/95 → 05/02		MS	MVB835R4	4PK835
						MVB810R4	4PK810
						TB281	103x25.4
						TBK294	
					A/C(-)	MVB900R4	4PK900
					A/C(-)	MVB915R4	4PK915
					A/C(+)	MVB1000R4	4PK1000



kW



...SUZUKI

...BALENO Hatchback (EG)

1.8 GT	J18A	89	03/96 → 05/02	⊗	A/C(-)	MVB1550R5	5PK1550
				⊗	A/C(+)	MVB1638R5	5PK1638
1.9 TD		55	04/98 → 05/02	⊗	A/C(-), 02/99→	MVB1155R6	6PK1155
				⊗	A/C(+), 02/99→, → Ch. 180000	MVB1740R6	6PK1740
				⊗	A/C(+), 02/99→, Ch. 180001→	MVB1725R6	6PK1725
					02/99→	TB560	136x25.4
				KIT	02/99→	TBK020	

CAPPUCINO

0.7	F6A	47	02/92 → 08/95	⊗	08/92→	SVB10760	10x760
				⊗	08/92→	SVB10610	10x610

CARRY Box (FD)

1.3	G13B	58	03/99 →	⊗	→09/04	SVB10775	10x775
				⊗	→09/04	MVB810R4	4PK810
					→09/04	TB455	97x25.4
1.3 16 V	G13BB	58	03/00 →	⊗	→09/04	SVB10775	10x775
				⊗	→09/04	MVB810R4	4PK810
					→09/04	TB455	97x25.4

CARRY Box (ST90V)

0.8	F8A	27	11/80 → 10/85	⊗	03/81→03/85	SVB10750	10x750
					03/81→03/85	TB123	84x19

GRAND VITARA

1.6	M16A	78	04/05 →	⊗	PS	MVB995R4	4PK995
				⊗	A/C(-), 10/05→	MVB836R5	5PK836
				⊗	10/05→	MVB887R4	4PK887
1.9 DDiS		95	10/05 →		03/06→	TB756	133x26
				KIT	03/06→	TBK322	
2.0		103	10/05 →	⊗	A/C(-)	MVB1550R5	5PK1550
				⊗	A/C(+)	MVB1638R5	5PK1638
				*		MVB500R3	3PK500

GRAND VITARA (FT, GT)

1.6	G16B	69	03/98 →	⊗	→04/05	MVB810R4	4PK810
					→04/05	TB281	103x25.4
				KIT	→04/05	TBK294	
				⊗	A/C(-), →04/05	MVB790R4	4PK790
2.0	J20A	94	03/98 →	⊗	A/C(+), →04/05	MVB950R4	4PK950
				⊗	A/C(-), →04/05	MVB1550R5	5PK1550
2.0 HDI 110	RHW, RHZ	80	07/01 →	⊗	A/C(+), →04/05	MVB1638R5	5PK1638
				*	→04/05	MVB500R3	3PK500
				⊗	Eng. RHW, →09/05	MVB800R4	4PK800
				⊗	06/03→08/06	MVB1635R6	6PK1635
				⊗	Eng. RHW, →09/05	MVB1469R6	6PK1469
2.0 TD Intercooler	RF	64	03/98 →		→10/03	TB632	141x25.4
					06/03→08/06	TB720	114x25.4
				⊗	→01/01	SVB13850	13x850
				⊗	→01/01	SVB131175	13x1175
2.5 V6 24V	H 25 A	116	08/04 →		→01/01	TB590	162x25.4
				⊗	→01/01	SVB13925	13x925
				⊗	→04/05	MVB925R4	4PK925
2.5 V6 24V (FT)	H 25 A	106	04/98 →	⊗	A/C(-), →04/05	MVB1020R4	4PK1020
				⊗	A/C(+), →04/05	MVB1080R4	4PK1080
				⊗	→04/05	MVB925R4	4PK925
2.7 V6		127	09/01 →	⊗	A/C(-), →04/05	MVB1020R4	4PK1020
				⊗	A/C(+), →04/05	MVB1080R4	4PK1080
				⊗	→08/06	MVB1090R4	4PK1090
2.7 XL-7		135	04/03 →	⊗	→08/06	MVB925R4	4PK925
				⊗	→08/06	MVB1020R4	4PK1020
				⊗	→08/06	MVB1090R4	4PK1090
				⊗		MVB925R4	4PK925
				⊗		MVB1020R4	4PK1020
				⊗		MVB1090R4	4PK1090



kw



SUZUKI

...SUZUKI

IGNIS (FH)

1.3	M13A	61	10/00 → 09/03	☀ ⌚		MVB810R4	4PK810
						MVB835R4	4PK835
1.3 4WD	M13A	61	10/00 → 09/03	☀ ⌚		MVB810R4	4PK810
						MVB835R4	4PK835

IGNIS II

1.3 DDiS	Z13DT	51	09/03 →	☀ ⌚		MVB1318R6	6PK1318
						MVB1180R6	6PK1180
1.5	M15A	73	09/03 →	☀ ⌚	Water pump (+)	MVB800R4	4PK800
						MVB835R4	4PK835
1.5 4x4	M15A	73	09/03 →	☀ ⌚	Water pump (+)	MVB800R4	4PK800
						MVB835R4	4PK835
1.5 Sport	M15A	80	12/03 →	☀ ⌚	Water pump (+)	MVB800R4	4PK800
						MVB835R4	4PK835

JIMNY (FJ)

1.3 16V	G13BB	59	09/98 →	☀	MS, →07/04	MVB810R4	4PK810
				☀	PS, →07/04	MVB900R4	4PK900
				☀	→07/04	TB455	97x25.4
1.3 16V 4WD	M13A	60	02/01 →	☀	08/04 →	MVB950R4	4PK950
				☀	PS, →07/04	MVB900R4	4PK900
				⌚	08/04 →	MVB835R4	4PK835
				☀	→07/04	TB455	97x25.4
1.3 16V 4WD	G13BB	59	09/98 →	☀	A/C(-), →07/04	MVB810R4	4PK810
				☀	PS, →07/04	MVB900R4	4PK900
				☀	→07/04	TB455	97x25.4
				☀	A/C(-), →07/04	MVB810R4	4PK810
1.5 DDiS 4WD	M13A	60	02/01 →	☀	MS, →07/04	MVB810R4	4PK810
				☀	PS, →07/04	MVB900R4	4PK900
				☀	→07/04	TB455	97x25.4
1.5 DDiS 4x4		48	12/03 →	⌚		MVB1960R6	6PK1960
				☀		TB713	123x27
1.5 DDiS 4x4		63	08/05 →	⌚		MVB1960R6	6PK1960
				☀		TB713	123x27

LIANA (ER)

1.3	M13A	66	03/02 →	☀	→08/06	MVB1015R4	4PK1015			
				⌚	→08/06	MVB835R4	4PK835			
				☀	→08/06	MVB940R4	4PK940			
1.4 DDiS	8HY	66	03/05 →	⌚	A/C(-), →08/06	MVB1370R6	6PK1370			
				⌚	A/C(+), →08/06	MVB1715R6	6PK1715			
				☀	→08/06	TB721	135x25.4			
1.6		76	03/02 →	☀	→08/07	MVB1015R4	4PK1015			
				⌚	→08/07	MVB835R4	4PK835			
				☀	→08/07	MVB940R4	4PK940			
				M16A	78	04/02 →	☀	→08/07	MVB1015R4	4PK1015
							⌚	→08/07	MVB835R4	4PK835
1.6 4WD		76	03/02 →	☀	→08/07	MVB1015R4	4PK1015			
				⌚	→08/07	MVB835R4	4PK835			
				☀	→08/07	MVB940R4	4PK940			
				M16A	78	04/02 →	☀	→08/07	MVB1015R4	4PK1015
							⌚	→08/07	MVB835R4	4PK835
				☀	→08/07	MVB940R4	4PK940			

LIANA Estate (ER)

1.3		66	07/01 →	☀	→08/06	MVB1015R4	4PK1015
				⌚	→08/06	MVB835R4	4PK835
				☀	→08/06	MVB940R4	4PK940
1.4 DDiS	8HY	66	03/05 →	⌚	A/C(-), →08/06	MVB1370R6	6PK1370
				⌚	A/C(+), →08/06	MVB1715R6	6PK1715
				☀	→08/06	TB721	135x25.4



kW



...SUZUKI

...LIANA Estate (ER)

1.6		76	07/01 →	⚙️ ⚙️ ⚙️	→08/07 →08/07 →08/07	MVB1015R4 MVB835R4 MVB940R4	4PK1015 4PK835 4PK940
	M16A	78	04/02 →	⚙️ ⚙️ ⚙️	→08/07 →08/07 →08/07	MVB1015R4 MVB835R4 MVB940R4	4PK1015 4PK835 4PK940
1.6 4WD		76	07/01 →	⚙️ ⚙️ ⚙️	→08/07 →08/07 →08/07	MVB1015R4 MVB835R4 MVB940R4	4PK1015 4PK835 4PK940
	M16A	78	04/02 →	⚙️ ⚙️ ⚙️	→08/07 →08/07 →08/07	MVB1015R4 MVB835R4 MVB940R4	4PK1015 4PK835 4PK940

SAMURAI (SJ)

1.0 (SJ 410)	F10A	33	11/88 →	⚙️ ⚙️	→10/94 →10/94	SVB10750 TB171	10x750 88x19
1.3 (SJ 413)	G13BA	51	11/88 →	⚙️ ⚙️ ⚙️ ⚙️	→08/00 →08/00 →07/93 07/93→08/00	SVB10760 SVB10840 TB222 TB322	10x760 10x840 89x19 89x19
	G13A	44	11/88 →	⚙️ ⚙️ ⚙️ ⚙️	→08/00 →08/00 →07/93 07/93→08/00	SVB10760 SVB10840 TB222 TB322	10x760 10x840 89x19 89x19
		47	11/88 →	⚙️ ⚙️ ⚙️ ⚙️	→08/00 →08/00 →07/93 07/93→08/00	SVB10760 SVB10840 TB222 TB322	10x760 10x840 89x19 89x19
1.9 TD	XUD9	46	11/98 →	⚙️ ⚙️ ⚙️ ⚙️ ⚙️	→08/00 →08/00 →08/00 →08/00 →08/00	MVB1115R6 TB560 TBK020 SVB10600	6PK1115 136x25.4 10x600
		47	11/98 →	⚙️ ⚙️	09/00→ 09/00→	MVB1137R6 TB545	6PK1137 153x25.4

SJ 410

1.0	F10A	33	09/81 → 12/88	⚙️ ⚙️ ⚙️	04/82→03/88 01/86→03/88 04/82→12/85	SVB10750 TB171 TB123	10x750 88x19 84x19
-----	-------------	----	---------------	----------------	---	---	--------------------------

SJ 410 Cabrio

1.0	F10A	33	09/81 → 12/88	⚙️ ⚙️ ⚙️	04/82→03/88 01/86→03/88 04/82→12/85	SVB10750 TB171 TB123	10x750 88x19 84x19
-----	-------------	----	---------------	----------------	---	---	--------------------------

SJ 413

1.3	G13A	44	08/86 → 08/90	⚙️ ⚙️ ⚙️	→03/88 →03/88 →03/88	SVB10760 SVB10840 TB222	10x760 10x840 89x19
		47	09/84 → 12/88	⚙️ ⚙️ ⚙️	→03/88 →03/88 →03/88	SVB10760 SVB10840 TB222	10x760 10x840 89x19

SPLASH

1.2		63	01/08 →	⚙️	A/C(+)	MVB1318R6	6PK1318
1.3 CDTI		55	01/08 →	⚙️ ⚙️	A/C(-) A/C(+)	MVB1180R6 MVB1318R6	6PK1180 6PK1318

SUPER CARRY Bus (ED)

1.0	F10A	31	10/92 → 03/99	⚙️ ⚙️		SVB10750 TB171	10x750 88x19
		33	10/85 → 03/99	⚙️ ⚙️		SVB10750 TB171	10x750 88x19
		30	09/94 → 03/99	⚙️ ⚙️		SVB10750 TB171	10x750 88x19



kW



SUZUKI

...SUZUKI

SWIFT Convertible (SF413)

1.3 (SF413, AK35)	G13B	50	09/91 → 10/96		MS	MVB790R4	4PK790
						MVB813R3	3PK813
					08/92 →	MVB813R3	3PK813
					→12/93, → Eng Nr G13B-253432	TB222	89x19
					01/94 →, Eng Nr G13BA-339761 →	TB322	89x19
					08/92 →	MVB850R4	4PK850
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB950R4	4PK950

SWIFT I (AA)

1.0 (SA310, AA41/43)	G10, G10A	37	10/83 → 03/89		10/84 →	SVB10840	10x840
					10/84 →	TB222	89x19
1.0 Turbo (SA310)		52	02/85 → 12/89		→02/89	SVB10840	10x840
					→02/89	TB222	89x19
1.3 (SA413, AA51)	G13A	50	10/84 → 03/89		AUTO, 08/85 →	SVB10825	10x825
					MAN, 08/85 →	SVB10840	10x840
					08/85 →	TB222	89x19
1.3 (SA413, AA51/53)	G13A	54	10/84 → 03/89		AUTO, 08/85 →	SVB10825	10x825
					MAN, 08/85 →	SVB10840	10x840
					08/85 →	TB222	89x19
1.3 (SA413, AA53)	G13A	47	08/86 → 03/89		AUTO	SVB10825	10x825
					MAN	SVB10840	10x840
						TB222	89x19
1.3 GTI/GXi (SA413, AA33)	G13B	74	08/86 → 03/89			MVB810R4	4PK810
						TB426	119x19

SWIFT II (AH, AJ)

1.3 (SF413, AH35)	G13A	52	03/89 → 12/91		MS	MVB790R4	4PK790
						MVB813R3	3PK813
					→ Eng Nr G13BA-339760	TB222	89x19
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB950R4	4PK950
1.3 (SF413, AH35, MA)	G13A	50	03/89 → 05/01		MS	MVB790R4	4PK790
					→10/96	MVB813R3	3PK813
					11/96 →	MVB810R4	4PK810
					→12/93,	TB222	89x19
					→ Eng Nr G13BA-339760		
					01/93 →10/96,	TB322	89x19
					Eng Nr G13BA-339761 →		
					11/96 →	TB456	89x25.4
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB950R4	4PK950
1.6 (SF416, AH14)	G16B	70	11/89 → 12/91			MVB810R4	4PK810
						TB281	103x25.4
						TBK294	
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB950R4	4PK950
1.6 4WD (SF416, AJ14)	G16B	70	11/89 → 12/91			MVB810R4	4PK810
						TB281	103x25.4
						TBK294	
					A/C(-)	MVB850R4	4PK850
					A/C(+)	MVB950R4	4PK950
1.6 i (SF416, AH14)	G16B	68	01/90 → 05/01		→10/96	MVB810R4	4PK810
					→10/96	TB281	103x25.4
					→10/96	TBK294	
					A/C(-), →10/96	MVB850R4	4PK850
					A/C(+), →10/96	MVB950R4	4PK950
1.6 i 4WD (SF416, AJ14)	G16B	68	01/90 → 05/01		→10/96	MVB810R4	4PK810
					→10/96	TB281	103x25.4
					→10/96	TBK294	
					A/C(-), →10/96	MVB850R4	4PK850
					A/C(+), →10/96	MVB950R4	4PK950



kW



...SUZUKI

SWIFT II Hatchback (EA, MA)

Model	Engine	kW	Period	Icons	MS	Accessories	Part No.	
1.0 (SF310, AA44)	G10A	37	03/89 → 05/01		MS		MVB763R4	4PK763
					MS		MVB790R4	4PK790
							MVB810R4	4PK810
							MVB813R3	3PK813
							TB455	97x25.4
						→ Eng Nr 176378 (3doors), 147246 (5doors)	TB181	97x19
						Eng Nr 176379 (3doors), 147247 (5doors)→	TB535	97x19
						A/C(-)	MVB825R4	4PK825
						A/C(+)	MVB920R4	4PK920
					1.0 i (SF310, AA44)	G10A	39	09/91 → 05/01
MS		MVB790R4	4PK790					
		MVB810R4	4PK810					
		MVB813R3	3PK813					
		TB455	97x25.4					
	→ Eng Nr 176378 (3doors), 147246 (5doors)	TB181	97x19					
	Eng Nr 176379 (3doors), 147247 (5doors)→	TB535	97x19					
	A/C(-)	MVB825R4	4PK825					
	A/C(+)	MVB920R4	4PK920					
1.3	G10A	40	03/89 → 12/91					
					MS		MVB790R4	4PK790
							MVB810R4	4PK810
							MVB813R3	3PK813
							TB455	97x25.4
			→ Eng Nr 147246	TB181	97x19			
			Eng Nr 147247→	TB535	97x19			
			A/C(-)	MVB825R4	4PK825			
			A/C(+)	MVB920R4	4PK920			
		1.3 (SF413, AB35)	G13A	50	03/89 → 05/01		MS, 11/96→	
11/96→							MVB810R4	4PK810
1.3 4WD (SF413, AA35)	G13A	50	03/89 → 05/01		11/96→		TB456	89x25.4
					A/C(-), 11/96→		MVB850R4	4PK850
1.3 4WD (SF413, AF35)	G13A	52	10/89 → 12/91		A/C(+), 11/96→		MVB950R4	4PK950
					MS, →10/96		MVB790R4	4PK790
1.3 GTi (SF413, AA34)	G13B	74	03/89 → 05/01		→10/96		MVB813R3	3PK813
					→12/93, → Eng Nr G13B-253432		TB222	89x19
					01/93→10/96, Eng Nr G13BA-339761→		TB322	89x19
					A/C(-), →10/96		MVB850R4	4PK850
					A/C(+), →10/96		MVB950R4	4PK950
1.3 4WD (SF413, AA35)	G13A	50	03/89 → 05/01		MS		MVB790R4	4PK790
							MVB813R3	3PK813
1.3 4WD (SF413, AF35)	G13A	52	10/89 → 12/91		→ Eng Nr G13B-253432		TB222	89x19
					A/C(-)		MVB850R4	4PK850
					A/C(+)		MVB950R4	4PK950
1.3 GTi (SF413, AA34)	G13B	74	03/89 → 05/01		MS, 09/89→10/96		MVB763R4	4PK763
					09/89→10/96		MVB810R4	4PK810
					09/89→10/96		TB502	119x25.4
					A/C(-), 09/89→10/96		MVB825R4	4PK825
					A/C(+), 09/89→10/96		MVB920R4	4PK920



kW



SUZUKI

...SUZUKI

SWIFT III (SG)

1.3	M13A	68	02/05 →	☀ ☀ Ⓢ		MVB800R4 MVB810R4 MVB835R4	4PK800 4PK810 4PK835
1.3 4x4	M13A	66	01/06 →	☀ ☀ Ⓢ		MVB800R4 MVB810R4 MVB835R4	4PK800 4PK810 4PK835
1.3 DDiS	Z13DT	51	08/05 →	Ⓢ	A/C(+), →09/07	MVB1318R6	6PK1318
		55	08/05 →	Ⓢ	A/C(-), 02/08 →	MVB1180R6	6PK1180
				Ⓢ	A/C(+), 02/08 →	MVB1318R6	6PK1318
1.5	M15A	75	02/05 →	☀ Ⓢ		MVB800R4 MVB836R5	4PK800 5PK836
1.6		92	05/06 →	Ⓢ		MVB836R5	5PK836

SX4

1.5	M15A	73	06/06 →	☀ Ⓢ		MVB800R4 MVB836R5	4PK800 5PK836
1.6 VVT	M16A	79	06/06 →	☀ Ⓢ		MVB810R4 MVB836R5	4PK810 5PK836
1.6 VVT 4x4	M16A	79	06/06 →	☀ Ⓢ		MVB810R4 MVB836R5	4PK810 5PK836
1.9 DDiS	D19AA	88	06/06 →	Ⓢ	A/C(-)	MVB1050R6	6PK1050
				Ⓢ	A/C(+)	MVB1388R6	6PK1388
1.9 DDiS 4x4	D19AA	88	06/06 →	Ⓢ	A/C(-)	MVB1050R6	6PK1050
				Ⓢ	A/C(+)	MVB1388R6	6PK1388

VITARA (ET, TA)

1.6 (ET)	G16A	60	07/88 → 12/91	☀	MS, LHD	MVB800R4	4PK800
				☀	MS, RHD	MVB825R4	4PK825
				☀	PS, LHD	MVB920R4	4PK920
				☀	PS, RHD	MVB940R4	4PK940
				Ⓢ		TB669	95x19
				Ⓢ		MVB790R4	4PK790
1.6 (TA)	G16A	59	07/88 → 01/95	☀	MS, LHD	MVB800R4	4PK800
				☀	MS, RHD	MVB825R4	4PK825
				☀	PS, LHD	MVB920R4	4PK920
				☀	PS, RHD	MVB940R4	4PK940
				Ⓢ		MVB810R4	4PK810
				Ⓢ		TB669	95x19
1.6 16V (ET)	G16B	71	07/90 → 03/98	☀	MS, LHD, 06/91 →	MVB825R4	4PK825
				☀	MS, RHD, 06/91 →	MVB835R4	4PK835
				☀	PS, 3 doors, LHD, 06/91 →	MVB940R4	4PK940
				☀	PS, 5 doors, LHD, 06/91 →	MVB925R4	4PK925
				☀	PS, RHA(+), 06/91 →	MVB950R4	4PK950
				Ⓢ	06/91 →	MVB800R4	4PK800
1.9 D (ET)	XUD9A	50	01/95 → 03/98	Ⓢ	A/C(-), PS, 11/95 →	MVB1150R6	6PK1150
				Ⓢ	11/95 →	TB560	136x25.4
				Ⓢ	11/95 →	TBK020	
		55	08/96 → 03/98	Ⓢ	11/95 →	SVB10600	10x600
				Ⓢ	A/C(-), PS	MVB1150R6	6PK1150
				Ⓢ		TB560	136x25.4
2.0 16V (ET)	J20A	97	12/96 → 03/98	Ⓢ	A/C(-), 04/97 →	MVB1550R5	5PK1550
				Ⓢ	A/C(+), 04/97 →	MVB1638R5	5PK1638
				Ⓢ	04/97 →	MVB500R3	3PK500



kW



...SUZUKI

...VITARA (ET, TA)

2.0 TD (ET)	RF	52	12/94 → 03/98	⊛	04/95 →	SVB13850	13x850
				⊗	04/95 →	SVB131175	13x1175
				⊕	04/95 →	TB590	162x25.4
				⊘	04/95 →	SVB13925	13x925
2.0 TD Intercooler (ET)	RF	64	12/95 → 03/98	⊛		MVB800R4	4PK800
				⊗		MVB1635R6	6PK1635
2.0 V6 24V (ET)	H 20 A	100	12/94 → 03/98	⊗		MVB925R4	4PK925
				⊘	A/C(-)	MVB1020R4	4PK1020
				⊘	A/C(+)	MVB1080R4	4PK1080

VITARA Cabrio (ET, TA)

1.6 (TA)	G16A	59	07/88 → 01/95	⊛	MS, LHD	MVB800R4	4PK800
				⊗	MS, RHD	MVB825R4	4PK825
				⊘	PS, LHD	MVB920R4	4PK920
				⊘	PS, RHD	MVB940R4	4PK940
				⊗		MVB810R4	4PK810
				⊕		TB669	95x19
1.6 16V (ET)	G16B	71	07/90 → 03/99	⊛	MS, LHD, 06/91 →	MVB825R4	4PK825
				⊗	MS, RHD, 06/91 →	MVB835R4	4PK835
				⊘	PS, 3 doors, LHD, 06/91 →	MVB940R4	4PK940
				⊘	PS, 5 doors, LHD, 06/91 →	MVB925R4	4PK925
				⊗	06/91 →	MVB800R4	4PK800
				⊗	06/91 →	MVB810R4	4PK810
				⊕	06/91 →	TB281	103x25.4
				⊕	06/91 →	TBK294	
				⊘	A/C(-), 01/98 →	MVB790R4	4PK790
				⊘	A/C(+), 06/91 →	MVB950R4	4PK950
1.9 D (ET)		55	08/96 → 03/99	⊗	A/C(-), PS	MVB1150R6	6PK1150
				⊕		TB560	136x25.4
				⊕		TBK020	
				⊕		SVB10600	10x600
	XUD9A	50	01/95 → 03/98	⊗	A/C(-), PS, 11/95 →	MVB1150R6	6PK1150
				⊕	11/95 →	TB560	136x25.4
				⊕	11/95 →	TBK020	
				⊕	11/95 →	SVB10600	10x600
2.0 16V (ET)	J20A	97	12/96 → 03/99	⊗	A/C(-), 04/97 →	MVB1550R5	5PK1550
				⊗	A/C(+), 04/97 →	MVB1638R5	5PK1638
				⚡	04/97 →	MVB500R3	3PK500

WAGON R+ (EM)

1.0		48	02/98 → 05/00	⊛	→01/00	SVB10775	10x775
				⊗	→01/00	MVB855R4	4PK855
1.2		51	02/98 → 05/00	⊗	→01/00	MVB855R4	4PK855
				Z 12 XEP	59	06/04 →	⊗
		⊗	A/C(+)	MVB1360R5			5PK1360
1.2 4WD		51	02/98 → 05/00	⊗	→01/00	MVB855R4	4PK855

WAGON R+ (MM)

1.3	G13BB	56	05/00 →	⊛	→08/03	MVB790R4	4PK790
				⊗	→08/03	MVB810R4	4PK810
				⊕	→08/03	TB455	97x25.4
	M13A	69	09/03 →	⊛		MVB810R4	4PK810
				⊗		MVB835R4	4PK835
				⊕		MVB790R4	4PK790
				⊕		MVB810R4	4PK810
1.3 4WD		56	10/01 →	⊛	→08/03	MVB790R4	4PK790
				⊗	→08/03	MVB810R4	4PK810
				⊕	→08/03	TB455	97x25.4
	M13A	69	09/03 →	⊛		MVB810R4	4PK810
				⊗		MVB835R4	4PK835
				⊕		MVB1318R6	6PK1318
1.3 DDiS	Z13DT	51	09/03 →	⊗	→04/08	MVB1180R6	6PK1180
				⊗	→04/08	MVB1180R6	6PK1180



kW



SUZUKI

...SUZUKI

X-90 (EL)

1.6 i 16V	G16B	71	09/95 →	 	RHA(+), →10/97 →10/97 →10/97 A/C(-), →10/97 A/C(+), →10/97	MVB950R4 TB281 TBK294 MVB810R4 MVB940R4	4PK950 103x25.4 4PK810 4PK940
1.6 i 16V 4x4	G16B	71	09/95 →	 	RHA(+), →10/97 →10/97 →10/97 A/C(-), →10/97 A/C(+), →10/97	MVB950R4 TB281 TBK294 MVB810R4 MVB940R4	4PK950 103x25.4 4PK810 4PK940

TALBOT

EXPRESS 1000 -1500 Bus

1.8	XM7T	51	07/83 → 10/90	 		SVB10925 SVB10790 SVB10888	10x925 10x790 10x888
1.9 D	XUD9A	51	07/87 → 10/90	 		MVB800R4 TB560 TBK019 SVB10800 SVB10610	4PK800 136x25.4 10x800 10x610
2.0	XN1TA	57	07/82 → 10/90	 		SVB10925 SVB10888	10x925 10x888
2.5 D	CRD93	54	07/82 → 10/94	 	inj. pump	SVB10700 TB227 TBK049 TBK054 TB177 SVB10800 SVB10600	10x700 118x31.8 62x19 10x800 10x600
2.5 TD	CRD93LS	70	06/87 → 10/94	 	inj. pump	SVB10700 TB227 TBK049 TBK054 TB177 SVB10800 SVB10600	10x700 118x31.8 62x19 10x800 10x600

EXPRESS 1000 -1500 Flatbed / Chassis

2.0	XN1TA	57	07/82 → 10/94	 	11/88 → 11/88 → 11/88 →	SVB10925 SVB10790 SVB10888	10x925 10x790 10x888
2.5 D	CRD93	54	07/82 → 10/94	 	inj. pump	SVB10700 TB227 TBK049 TBK054 TB177 SVB10800 SVB10600	10x700 118x31.8 62x19 10x800 10x600
2.5 D All-wheel Drive	CRD93	54	11/88 → 10/94	 	inj. pump	SVB10700 TB227 TBK049 TBK054 TB177 SVB10800 SVB10600	10x700 118x31.8 62x19 10x800 10x600



kW



...TALBOT

...EXPRESS 1000 -1500 Flatbed / Chassis

2.5 TD	CRD93LS	70	06/87 → 10/94			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
						TB177	62x19
						SVB10800	10x800
						SVB10600	10x600
2.5 TD All-wheel Drive	CRD93LS	70	11/88 → 10/94			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
						TB177	62x19
						SVB10800	10x800
						SVB10600	10x600

EXPRESS 1000 -1800 Box

1.8	XM7T	51	07/81 → 10/90			SVB10925	10x925
						SVB10790	10x790
						SVB10888	10x888
1.9 D	XUD9A	51	07/87 → 10/90			MVB800R4	4PK800
						TB560	136x25.4
						TBK019	
						SVB10800	10x800
						SVB10610	10x610
2.0	XN1TA	57	07/82 → 10/90		11/88 →	SVB10925	10x925
					11/88 →	SVB10790	10x790
					11/88 →	SVB10888	10x888
2.5 D	CRD93	54	07/82 → 10/94			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
						TB177	62x19
						SVB10800	10x800
						SVB10600	10x600
2.5 D All-wheel Drive	CRD93	54	11/88 → 10/94			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
						TB177	62x19
						SVB10800	10x800
						SVB10600	10x600
2.5 TD	CRD93LS	70	06/87 → 10/94			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
						TB177	62x19
						SVB10800	10x800
						SVB10600	10x600
2.5 TD All-wheel Drive	CRD93LS	70	11/88 → 10/94			SVB10700	10x700
						TB227	118x31.8
						TBK049	
					inj. pump	TBK054	
						TB177	62x19
						SVB10800	10x800
						SVB10600	10x600

HORIZON

1.1	E1B	40	01/79 → 09/84		→12/80	SVB10790	10x790
					01/81 →	SVB10775	10x775
						SVB10975	10x975
		43	01/79 → 09/84		→12/80	SVB10790	10x790
					01/81 →	SVB10775	10x775
						SVB10975	10x975



kw



TALBOT

...TALBOT

...HORIZON

1.3	2G1-BTC	40	09/81 → 06/86	⊗	→07/85	SVB10775	10x775	
				⊗	→07/85	SVB10975	10x975	
		43	09/78 → 09/84	⊗	→12/80	SVB10790	10x790	
				⊗	01/81→	SVB10775	10x775	
				⊗		SVB10975	10x975	
		2G1	50	02/78 → 01/80	⊗		SVB10790	10x790
				⊗		SVB10975	10x975	
	47		02/78 → 01/80	⊗		SVB10790	10x790	
				⊗		SVB10975	10x975	
				⊗		SVB10790	10x790	
1.4	2Y2, Y2	61	07/79 → 06/86	⊗	08/81→	SVB10775	10x775	
			⊗	08/81→	SVB10975	10x975		
1.6	6J2A, J2A	66	07/82 → 06/86	⊗		SVB10775	10x775	
				⊗		SVB10975	10x975	
		54	08/83 → 07/85	⊗		SVB10775	10x775	
1.9 Diesel	XUD9	47	07/84 → 06/86	⊗		MVB700R4	4PK700	
				⊗		TB560	136x25.4	
				⊗		TBK019		
				⊗		SVB10700	10x700	
				⊗		SVB10550	10x550	
				⊗	→09/84	SVB10610	10x610	
		48	07/82 → 06/86	⊗		MVB700R4	4PK700	
				⊗		TB560	136x25.4	
				⊗		TBK019		
				⊗	→09/84	SVB10700	10x700	
		⊗	→09/84	SVB10610	10x610			
		⊗	10/84→	SVB10550	10x550			

SAMBA (51A)

0.9	5C1(XV5), 5C1(XV8)	31	01/81 → 12/85	⊗		SVB10913	10x913
1.1	XW7	37	01/81 → 06/86	⊗		SVB10913	10x913
1.2 Rallye	129 D	65	01/83 → 10/86	⊗		SVB10913	10x913
1.4	XY7, XY8	53	01/81 → 06/86	⊗		SVB10913	10x913
	150 D	44	06/83 → 10/86	⊗		SVB10913	10x913
1.4 Rallye	XY8	58	01/83 → 10/86	⊗		SVB10913	10x913

SAMBA Convertible (51E)

1.4	XY8	58	01/81 → 06/86	⊗		SVB10913	10x913
-----	-----	----	---------------	---	--	-----------------	--------

SOLARA

1.6	J1B	51	07/82 → 04/84	⊗		SVB10775	10x775
				⊗		SVB10975	10x975
	6J1	54	09/81 → 10/84	⊗	→12/81	SVB10790	10x790
				⊗	01/82→	SVB10775	10x775
				⊗		SVB10975	10x975
				⊗		SVB10790	10x790
	6J2, J1, J2	65	02/80 → 06/81	⊗		SVB10790	10x790
				⊗		SVB10975	10x975
	J1B	66	09/81 → 07/86	⊗	→12/81	SVB10790	10x790
				⊗	01/82→02/85	SVB10775	10x775
			⊗	→02/85	SVB10975	10x975	
			⊗		SVB10790	10x790	

TAGORA

2.1	5N2	85	06/80 → 12/83	⊗	→07/83	SVB10913	10x913
				⊗	→07/83	SVB10865	10x865
2.3 Turbo Diesel	XD2S	59	08/81 → 12/87	⊗	→07/83	SVB10750	10x750
				⊗	→07/83	SVB101125	10x1125
				⊗	→07/83	SVB101050	10x1050
				⊗	→07/83	SVB10650	10x650

TATA (TELCO)

INDICA (40_V2)

1.4 D	475 DL	39	10/98 →	⊗	MS, →06/03	MVB715R4	4PK715
				⊗	PS, →06/03	MVB875R4	4PK875



kW



...TATA (TELCO)

INDIGO (4_V2)

1.4		62	01/03 →	⊗ ⊗ ⊗	MS, 07/03 → PS, 07/03 → 07/03 →	MVB715R4 MVB875R4 TB746	4PK715 4PK875 106x24
-----	--	----	---------	-------------	---------------------------------------	-------------------------------	----------------------------

INDIGO MARINA (4_V2)

1.4		62	01/03 →	⊗ ⊗ ⊗	MS, 07/03 → PS, 07/03 → 07/03 →	MVB715R4 MVB875R4 TB746	4PK715 4PK875 106x24
-----	--	----	---------	-------------	---------------------------------------	-------------------------------	----------------------------

SAFARI (42_FD)

1.9 D	483 DL	66	04/00 →	⊗ ⊗ ⊗	→06/03 →06/03 →06/03	SVB131075 MVB1080R4 SVB10725	13x1075 4PK1080 10x725
-------	--------	----	---------	-------------	----------------------------	------------------------------------	------------------------------

TOYOTA

4 RUNNER

3.0 Turbo-D	1KZ-T	92	11/95 →	⊗ ⊗ ⊗	→07/02 →07/02 →07/02	SVB131175 SVB131000 TB447	13x1175 13x1000 102x25
-------------	-------	----	---------	-------------	----------------------------	---------------------------------	------------------------------

4 RUNNER (_N130)

2.4 (RN61)	22REC	82	08/87 → 03/96	⊗ ⊗	→07/89 →07/89	SVB10875 SVB131125	10x875 13x1125
2.7 i	3RZ-FE	112	11/95 → 03/96	⊗ ⊗ ⊗ ⊗		MVB915R4 MVB887R5 MVB1100R4 MVB1110R4	4PK915 5PK887 4PK1100 4PK1110
3.0 Turbo-D (KZN 130)	1KZ-T	92	10/93 → 03/96	⊗ ⊗ ⊗		SVB131175 SVB131000 TB447	13x1175 13x1000 102x25
3.0 V6 (VZN 130)	3VZ-E	105	07/90 → 11/95	⊗ ⊗ ⊗		SVB13900 MVB1190R4 TB692 SVB131200	13x900 4PK1190 193x36 13x1200
3.4 i	5VZ-FE	136	11/95 → 03/96	⊗ ⊗ ⊗ ⊗		MVB870R4 MVB1050R4 TB729 MVB1070R4	4PK870 4PK1050 191x36 4PK1070

AURIS

1.4 D-4D		66	03/07 →	⊗	A/C(+)	MVB1238R6	6PK1238
1.4 VVTi	4ZZ-FE	71	03/07 →	⊗	A/C(-)	MVB1400R6	6PK1400
				⊗	A/C(+)	MVB1700R6	6PK1700
1.6 VVTi	1ZR-FE	91	03/07 →	⊗	A/C(-)	MVB915R6	6PK915
				⊗	A/C(+)	MVB1230R6	6PK1230
2.0 D-4D	1AD-FTV	93	03/07 →	⊗	A/C(+)	MVB1870R7	7PK1870
2.2 D	2AD-FHV	130	03/07 →	⊗		MVB1870R7	7PK1870

AVENSIS (_T22_)

1.6 (AT220_)	4A-FE	74	09/97 → 10/00	⊗ ⊗ ⊗ ⊗	→06/00 →06/00 →06/00 →06/00	MVB835R4 MVB860R4 MVB970R5 TB445	4PK835 4PK860 5PK970 117x21
		81	09/97 → 10/00	⊗ ⊗ ⊗ ⊗	→06/00 →06/00 →06/00 →06/00	MVB630R3 MVB835R4 MVB860R4 MVB970R5	3PK630 4PK835 4PK860 5PK970
				⊗	→06/00	TB445	117x21
				⊗	→06/00	MVB630R3	3PK630
1.6 VVT-i	3ZZ-FE	81	10/00 → 02/03	⊗ ⊗ ⊗	A/C(-) A/C(+), →08/02 A/C(+), 08/02 →	MVB1560R6 MVB1913R6 MVB1904R6	6PK1560 6PK1913 6PK1904



kw



TOYOTA

...TOYOTA

...AVENSIS (_ T22_)

1.8 (AT221_)	7A-FE	81	09/97 → 10/00	☼ ⊗ ☼ ☼	→06/00 →06/00 →06/00 →06/00	MVB860R4 MVB970R5 TB435 MVB630R3	4PK860 5PK970 121x21 3PK630
1.8 VVT-i	1ZZ-FE	95	10/00 → 02/03	⊗ ⊗ ⊗	A/C(-) A/C(+), →08/02 A/C(+), 08/02→	MVB1560R6 MVB1913R6 MVB1904R6	6PK1560 6PK1913 6PK1904
2.0 (ST220_)	3S-FE	94	09/97 → 10/00	⊗ ⊗ ☼ ☼ ☼ ☼	A/C(-), →06/00 A/C(+), →06/00 →06/00 →06/00 →06/00 →06/00	MVB1030R5 MVB1135R5 TB311 TBK360 MVB760R3	5PK1030 5PK1135 163x26.7 3PK760
2.0 D-4D (CDT220_)	1CD-FTV	81	10/99 → 02/03	⊗ ☼ ☼ ☼	A/C(-), →07/00 A/C(-), 07/00→ A/C(+), →07/00	SVB13975 TB655 MVB1135R5 MVB1110R5 MVB1225R5	13x975 178x25 5PK1135 5PK1110 5PK1225
2.0 TD (CT220_)	2C-TE	66	09/97 → 02/03	⊗ ☼ ☼ ☼ ☼	→06/00 →06/00 →06/00 A/C(-), →06/00 A/C(+), →06/00	SVB13950 TB473 TBK052 MVB1110R5 MVB1215R5	13x950 177x25.4 5PK1110 5PK1215
2.0 VVT-i	1AZ-FSE	110	10/00 → 02/03	⊗ ⊗	A/C(-) A/C(+)	MVB1588R7 MVB1969R7	7PK1588 7PK1969

AVENSIS (T25)

1.6 VVT-i	3ZZ-FE	81	04/03 →	⊗ ⊗	A/C(-) A/C(+)	MVB1420R6 MVB1725R6	6PK1420 6PK1725
1.8	1ZZ-FE	95	04/03 →	⊗ ⊗	A/C(-) A/C(+)	MVB1420R6 MVB1725R6	6PK1420 6PK1725
2.0	1AZ-FSE	108	04/03 →	⊗		MVB1933R7	7PK1933
2.0 D-4D	1CD-FTV	85	04/03 →	⊗ ☼ ☼ ☼	A/C(-) A/C(+)	MVB887R5 TB655 MVB1110R5 MVB1255R5	5PK887 178x25 5PK1110 5PK1255
	1AD-FTV	93	03/06 →	⊗		MVB2000R7	7PK2000
2.2 D-4D	2AD-FTV	110	10/05 →	⊗		MVB2000R7	7PK2000
2.2 D-CAT	2AD-FHV	130	07/05 →	⊗		MVB2000R7	7PK2000
2.4	2AZ-FSE	125	09/03 →	⊗		MVB1933R7	7PK1933
		120	10/03 →	⊗		MVB1933R7	7PK1933

AVENSIS Estate (T25)

1.6 VVT-i	3ZZ-FE	81	04/03 →	⊗ ⊗	A/C(-) A/C(+)	MVB1420R6 MVB1725R6	6PK1420 6PK1725
1.8	1ZZ-FE	95	04/03 →	⊗ ⊗	A/C(-) A/C(+)	MVB1420R6 MVB1725R6	6PK1420 6PK1725
2.0	1AZ-FSE	108	04/03 →	⊗		MVB1933R7	7PK1933
2.0 D-4D	1CD-FTV	85	04/03 →	⊗ ☼ ☼ ☼	A/C(-) A/C(+)	MVB887R5 TB655 MVB1110R5 MVB1255R5	5PK887 178x25 5PK1110 5PK1255
	1AD-FTV	93	03/06 →	⊗		MVB2000R7	7PK2000
2.2 D-4D	2AD-FTV	110	10/05 →	⊗		MVB2000R7	7PK2000
2.2 D-CAT	2AD-FHV	130	07/05 →	⊗		MVB2000R7	7PK2000
2.4	2AZ-FSE	125	09/03 →	⊗		MVB1933R7	7PK1933
		120	10/03 →	⊗		MVB1933R7	7PK1933



kW



...TOYOTA

AVENSIS Liftback (_T22_)

1.6 (AT220_)	4A-FE	74	09/97 → 10/00	☼ ☼ ⊗ ☼ ☼ ⊗ ☼ ☼ ⊗	→06/00 →06/00 →06/00 →06/00 →06/00 →06/00 →06/00 →06/00 →06/00	MVB835R4 MVB860R4 MVB970R5 TB445 MVB630R3 MVB835R4 MVB860R4 MVB970R5 TB445 MVB630R3	4PK835 4PK860 5PK970 117x21 3PK630 4PK835 4PK860 5PK970 117x21 3PK630
1.6 VVT-i	3ZZ-FE	81	10/00 → 02/03	⊗ ⊗ ⊗	A/C(-) A/C(+), →08/02 A/C(+), 08/02→	MVB1560R6 MVB1913R6 MVB1904R6	6PK1560 6PK1913 6PK1904
1.8 (AT221_)	7A-FE	81	09/97 → 10/00	☼ ⊗ ☼ ☼ ⊗	→06/00 →06/00 →06/00 →06/00	MVB860R4 MVB970R5 TB435 MVB630R3	4PK860 5PK970 121x21 3PK630
1.8 VVT-i	1ZZ-FE	95	10/00 → 02/03	⊗ ⊗ ⊗	A/C(-) A/C(+), →08/02 A/C(+), 08/02→	MVB1560R6 MVB1913R6 MVB1904R6	6PK1560 6PK1913 6PK1904
2.0 (ST220_)	3S-FE	94	09/97 → 10/00	⊗ ⊗ ☼ ☼ ⊗	A/C(-), →06/00 A/C(+), →06/00 →06/00 →06/00 →06/00	MVB1030R5 MVB1135R5 TB311 TBK360 MVB760R3	5PK1030 5PK1135 163x26.7 3PK760
2.0 D-4D (CDT220_)	1CD-FTV	81	10/99 → 02/03	⊗ ☼ ☼ ☼ ☼ ⊗	A/C(-), →07/00 A/C(-), 07/00→ A/C(+), →07/00	SVB13975 TB655 MVB1135R5 MVB1110R5 MVB1225R5	13x975 178x25 5PK1135 5PK1110 5PK1225
2.0 TD (CT220_)	2C-TE	66	09/97 → 02/03	⊗ ☼ ☼ ☼ ⊗ ⊗	→06/00 →06/00 →06/00 A/C(-), →06/00 A/C(+), →06/00	SVB13950 TB473 TBK052 MVB1110R5 MVB1215R5	13x950 177x25.4 5PK1110 5PK1215
2.0 VVT-i	1AZ-FSE	110	10/00 → 02/03	⊗ ⊗	A/C(-) A/C(+)	MVB1588R7 MVB1969R7	7PK1588 7PK1969

AVENSIS Saloon (T25)

1.6 VVT-i	3ZZ-FE	81	04/03 →	⊗ ⊗	A/C(-) A/C(+)	MVB1420R6 MVB1725R6	6PK1420 6PK1725
1.8	1ZZ-FE	95	04/03 →	⊗ ⊗	A/C(-) A/C(+)	MVB1420R6 MVB1725R6	6PK1420 6PK1725
2.0	1AZ-FSE	108	04/03 →	⊗		MVB1933R7	7PK1933
2.0 D-4D	1CD-FTV	85	04/03 →	⊗ ☼ ☼ ⊗	A/C(-) A/C(+)	MVB887R5 TB655 MVB1110R5 MVB1255R5	5PK887 178x25 5PK1110 5PK1255
	1AD-FTV	93	03/06 →	⊗		MVB2000R7	7PK2000
2.2 D-4D	2AD-FTV	110	10/05 →	⊗		MVB2000R7	7PK2000
2.2 D-CAT	2AD-FHV	130	07/05 →	⊗		MVB2000R7	7PK2000
2.4	2AZ-FSE	125	09/03 →	⊗		MVB1933R7	7PK1933
		120	10/03 →	⊗		MVB1933R7	7PK1933



kw



TOYOTA

...TOYOTA

AVENSIS Station Wagon (_T22_)

1.6 (AT220_)	4A-FE	74	09/97 → 10/00	☀ ☀ ⊖ ☀ ☀ ⊖ ☀ ☀ ⊖		MVB835R4 MVB860R4 MVB970R5 TB445 MVB630R3 MVB835R4 MVB860R4 MVB970R5 TB445 MVB630R3	4PK835 4PK860 5PK970 117x21 3PK630 4PK835 4PK860 5PK970 117x21 3PK630
1.6 VVT-i	3ZZ-FE	81	10/00 → 02/03	⊖ ⊖ ⊖	A/C(-) A/C(+), →08/02 A/C(+), 08/02→	MVB1560R6 MVB1913R6 MVB1904R6	6PK1560 6PK1913 6PK1904
1.8 (AT221_)	7A-FE	81	09/97 → 10/00	☀ ⊖ ☀ ☀ ⊖	→06/00 →06/00 →06/00 →06/00	MVB860R4 MVB970R5 TB435 MVB630R3	4PK860 5PK970 121x21 3PK630
1.8 VVT-i	1ZZ-FE	95	10/00 → 02/03	⊖ ⊖ ⊖	A/C(-) A/C(+), →08/02 A/C(+), 08/02→	MVB1560R6 MVB1913R6 MVB1904R6	6PK1560 6PK1913 6PK1904
2.0 (ST220_)	3S-FE	94	09/97 → 10/00	⊖ ⊖ ☀ ☀ ⊖ ☀ ⊖	A/C(-), →06/00 A/C(+), →06/00 →06/00 →06/00 →06/00 →06/00	MVB1030R5 MVB1135R5 TB311 TBK360 MVB760R3	5PK1030 5PK1135 163x26.7 3PK760
2.0 D-4D (CDT220_)	1CD-FTV	81	10/99 → 02/03	⊖ ☀ ☀ ☀ ☀	A/C(-), →07/00 A/C(-), 07/00→ A/C(+), →07/00	SVB13975 TB655 MVB1135R5 MVB1110R5 MVB1225R5	13x975 178x25 5PK1135 5PK1110 5PK1225
2.0 TD (CT220_)	2C-TE	66	09/97 → 02/03	⊖ ☀ ☀ ☀ ⊖ ☀ ⊖	→06/00 →06/00 →06/00 A/C(-), →06/00 A/C(+), →06/00	SVB13950 TB473 TBK052 MVB1110R5 MVB1215R5	13x950 177x25.4 5PK1110 5PK1215
2.0 VVT-i	1AZ-FSE	110	10/00 → 02/03	⊖ ⊖	A/C(-) A/C(+)	MVB1588R7 MVB1969R7	7PK1588 7PK1969

AVENSIS VERSO (AC_)

2.0 D-4D	1CD-FTV	85	08/01 →	⊖ ☀ ☀ ☀	→07/05 →07/05 A/C(-), →07/05 A/C(+), →07/05	MVB887R5 TB655 MVB1148R5 MVB1240R5	5PK887 178x25 5PK1148 5PK1240
2.0 VVT-i	1AZ-FE	110	08/01 →	⊖ ⊖	A/C(-), →07/05 A/C(+), →07/05	MVB1588R7 MVB1920R7	7PK1588 7PK1920

AYGO

1.0	1KR-FE	50	07/05 →	⊖ ⊖	A/C(-) A/C(+)	MVB850R6 MVB1215R6	6PK850 6PK1215
1.4 HDi		40	07/05 →	⊖ ⊖ ☀ ☀ ⊖ ☀ ⊖	A/C(-) A/C(+)	MVB795R6 MVB962R6 TB720 TBK230	6PK795 6PK962 114x25.4

CAMRY (_V1_)

2.2 (SXV10)	5S-FE	100	06/91 → 08/96	⊖ ⊖ ☀ ☀ ⊖ ☀ ⊖	A/C(-) A/C(+) →03/92 03/92→	MVB1000R5 MVB1110R5 TB311 TBK360 MVB760R3 MVB753R3	5PK1000 5PK1110 163x26.7 3PK760 3PK753
-------------	-------	-----	---------------	---------------------------------	--------------------------------------	---	--



kW



...TOYOTA

...CAMRY (_V1_)

3.0 (VCV10)	3VZ-FE	138	06/91 → 08/96			MVB1050R6 MVB938R6 TB436 MVB800R4	6PK1050 6PK938 191x32 4PK800
-------------	--------	-----	---------------	--	--	--	---------------------------------------

CAMRY (_V2_)

1.8 i (SV20_)	1S-L	66	10/86 → 08/88		A/C(-) A/C(+)	MVB1000R5 MVB1110R5 TB186 MVB760R3	5PK1000 5PK1110 139x25.4 3PK760
2.0 (SV21_, SV25_)	3S-FE	94	11/86 → 05/91		A/C(-) A/C(+) AUTO, 05/88→	MVB1000R5 MVB1110R5 MVB1015R5 TB311 TBK360 MVB760R3	5PK1000 5PK1110 5PK1015 163x26.7 3PK760
2.0 Gli 16V (SV21_, SV25_)	3S-FE	89	11/86 → 05/91		A/C(-) A/C(+) AUTO, 05/88→	MVB1000R5 MVB1110R5 MVB1015R5 TB311 TBK360 MVB760R3	5PK1000 5PK1110 5PK1015 163x26.7 3PK760
2.0 Turbo-D (CV20_)	2C-T	62	11/86 → 05/91			SVB13950 TB473 TBK052	13x950 177x25.4
		63	11/88 → 05/91		A/C(-), →05/89 A/C(-), 05/89→ A/C(+)	MVB1120R5 MVB1100R5 MVB1215R5 SVB13950 TB473 TBK052	5PK1120 5PK1100 5PK1215 13x950 177x25.4
					A/C(-), →05/89 A/C(-), 05/89→ A/C(+)	MVB1120R5 MVB1100R5 MVB1215R5	5PK1120 5PK1100 5PK1215
2.5 V6 GXI (VZV21_)	2VZ-FE	118	02/88 → 05/91		A/C(-) A/C(+)	MVB938R6 MVB1050R6 TB444 MVB760R3	6PK938 6PK1050 179x32 3PK760

CAMRY (_V20)

2.2	5S-FE	93	11/00 → 11/01		→07/01 →07/01 →07/01 →07/01	MVB1100R5 TB311 TBK360 MVB753R3	5PK1100 163x26.7 3PK753
2.2 (SXV20_)	5S-FE	96	08/96 → 11/01		→07/01 →07/01 →07/01 →07/01	MVB1100R5 TB311 TBK360 MVB753R3	5PK1100 163x26.7 3PK753
3.0 24V (MCV20_)	1MZ-FE	140	08/96 → 11/01		→07/01 →07/01 →07/01	MVB1035R6 TB696 MVB875R4	6PK1035 211x32 4PK875
3.0 V6	1MZ-FE	135	08/96 → 11/01		→07/01 →07/01 →07/01	MVB1035R6 TB696 MVB875R4	6PK1035 211x32 4PK875

CAMRY (_V30)

2.4 VVT-i	2AZ-FE	112	11/01 →		→12/05	MVB1933R7	7PK1933
3.0 V6	1MZ-FE	137	11/01 →		→02/06 →02/06 →02/06	MVB1035R6 TB696 MVB875R4	6PK1035 211x32 4PK875



kW



TOYOTA

...TOYOTA

CAMRY Liftback (V1)

1.8	1S-L	66	02/83 → 10/86	 	A/C(-) A/C(+)	MVB1000R5 5PK1000 MVB1110R5 5PK1110 TB186 139x25.4 MVB760R3 3PK760
1.8 Turbo-D	1C-TL	54	10/84 → 01/88	 	MS, →07/86 PS, →07/86 →07/86 →07/86 →07/86	MVB1120R5 5PK1120 MVB1215R5 5PK1215 SVB13850 13x850 TB473 177x25.4 TBK052
2.0		73	04/86 → 01/88	 	A/C(-) A/C(+)	MVB1000R5 5PK1000 MVB1110R5 5PK1110 TB186 139x25.4 MVB760R3 3PK760

CAMRY Saloon (V1)

1.8	1S-L	66	02/83 → 10/86	 	A/C(-) A/C(+)	MVB1000R5 5PK1000 MVB1110R5 5PK1110 TB186 139x25.4 MVB760R3 3PK760
1.8 Turbo-D	1C-TL	54	11/83 → 01/88	 	MS, →07/86 PS, →07/86 →07/86 →07/86 →07/86	MVB1120R5 5PK1120 MVB1215R5 5PK1215 SVB13850 13x850 TB473 177x25.4 TBK052
2.0	2S-E, 2S-ELC	73	04/86 → 01/88	 	A/C(-) A/C(+)	MVB1000R5 5PK1000 MVB1110R5 5PK1110 TB186 139x25.4 MVB760R3 3PK760
2.0 GLI	2S-EL	79	03/83 → 10/86	 	A/C(-) A/C(+)	MVB1000R5 5PK1000 MVB1110R5 5PK1110 TB186 139x25.4 MVB760R3 3PK760

CAMRY Station Wagon (_V2_)

1.8 (SV20_)	1S	66	11/86 → 08/88	 	A/C(-) A/C(+)	MVB1000R5 5PK1000 MVB1110R5 5PK1110 TB186 139x25.4 MVB760R3 3PK760
2.0 (SV21_)	3S-FE	94	11/86 → 05/91	 	AUTO, 05/88 → MAN	MVB1110R5 5PK1110 MVB1015R5 5PK1015 MVB1000R5 5PK1000 TB311 163x26.7 TBK360 MVB760R3 3PK760
2.0 GLi 16V (SV21_)	3S-FE	89	11/86 → 05/91	 	AUTO, 05/88 → MAN	MVB1110R5 5PK1110 MVB1015R5 5PK1015 MVB1000R5 5PK1000 TB311 163x26.7 TBK360 MVB760R3 3PK760
2.0 GLi 4x4		94	08/88 → 05/91	 	AUTO MAN	MVB1110R5 5PK1110 MVB1015R5 5PK1015 MVB1000R5 5PK1000 TB311 163x26.7 TBK360 MVB760R3 3PK760



kW



...TOYOTA

...CAMRY Station Wagon (_V2_)

2.0 Turbo-D (CV20_)	2C-T	62	11/86 → 05/91			SVB13950 TB473 TBK052 MVB1120R5 MVB1100R5 MVB1215R5	13x950 177x25.4 5PK1120 5PK1100 5PK1215
		63	11/88 → 05/91		A/C(-), →05/89 A/C(-), 05/89→ A/C(+) A/C(-), →05/89 A/C(-), 05/89→ A/C(+) A/C(-) A/C(+) 	SVB13950 TB473 TBK052 MVB1120R5 MVB1100R5 MVB1215R5 MVB938R6 MVB1050R6 TB444 MVB760R3	13x950 177x25.4 5PK1120 5PK1100 5PK1215 6PK938 6PK1050 179x32 3PK760
2.5 (VZV21_)	2VZ-FE	118	01/90 → 05/91		A/C(-) A/C(+) 	MVB938R6 MVB1050R6 TB444 MVB760R3	6PK938 6PK1050 179x32 3PK760

CAMRY Station Wagon (_V10)

2.2 (SXV10)	5S-FE	100	03/92 → 07/96		A/C(-) A/C(+) 	MVB1000R5 MVB1110R5 TB311 TBK360 MVB753R3	5PK1000 5PK1110 163x26.7 3PK753
3.0 (VCV10)	3VZ-FE	138	03/92 → 07/96		A/C(-) A/C(+) 	MVB938R6 MVB1050R6 TB436 MVB800R4	6PK938 6PK1050 191x32 4PK800

CARINA E (_T19_)

1.6 (AT190)	4A-FE	73	12/93 → 09/97			MVB850R4 MVB870R4 MVB970R5 TB445 MVB630R3 MVB850R4 MVB870R4 MVB970R5 TB445 MVB630R3	4PK850 4PK870 5PK970 117x21 3PK630 4PK850 4PK870 5PK970 117x21 3PK630
1.6 16V	4A-FE	78	10/95 → 09/97			MVB850R4 MVB870R4 MVB970R5 TB445 MVB630R3	4PK850 4PK870 5PK970 117x21 3PK630
1.6 GLI (AT190)	4A-FE	79	04/92 → 09/97			MVB850R4 MVB870R4 MVB970R5 TB445 MVB630R3	4PK850 4PK870 5PK970 117x21 3PK630
1.8 (AT191)	7A-FE	79	01/95 → 09/97			MVB850R4 MVB870R4 MVB970R5 TB435 MVB630R3	4PK850 4PK870 5PK970 121x21 3PK630
2.0 D (CT190)	2C	54	04/92 → 01/96		MS A/C(-) 	MVB1215R5 SVB13950 TB473 TBK052 MVB1110R5	5PK1215 13x950 177x25.4 5PK1110



kW



TOYOTA

...TOYOTA

...CARINA E (_T19_)

2.0 GLI (ST191)	3S-FE	98	04/92 → 09/97	⊖	A/C(-), 12/93→	MVB1030R5	5PK1030
				⊖	A/C(-), MAN, →12/93	MVB1015R5	5PK1015
				⊖	A/C(+)	MVB1110R5	5PK1110
				⊖	A/C(+)	MVB1135R5	5PK1135
						TB311	163x26.7
2.0 GTi (ST191)	3S-GE	116	04/92 → 02/94			TBK360	
						MVB760R3	3PK760
				⊖	A/C(-)	MVB1015R5	5PK1015
				⊖	A/C(+)	MVB1100R5	5PK1100
						TB309	178x25.4
2.0 GTi 16V (ST191_)	3S-GE	129	03/94 → 09/97			MVB760R3	3PK760
				⊖	A/C(-)	MVB1030R5	5PK1030
				⊖	A/C(+)	MVB1100R5	5PK1100
						TB446	177x25
						MVB760R3	3PK760
2.0 i (ST191)	3S-FE	93	12/93 → 09/97	⊖	A/C(-)	MVB1030R5	5PK1030
				⊖	A/C(+)	MVB1110R5	5PK1110
				⊖	A/C(+)	MVB1135R5	5PK1135
						TB311	163x26.7
						TBK360	
2.0 TD (CT190)	2C-T	61	01/96 → 09/97			MVB760R3	3PK760
						SVB13950	13x950
						TB473	177x25.4
						TBK052	
				⊖	A/C(-)	MVB1110R5	5PK1110
⊖	A/C(+)	MVB1215R5	5PK1215				

CARINA E Saloon (_T19_)

1.6 (AT190)	4A-FE	79	01/93 → 09/97			MVB850R4	4PK850
						MVB870R4	4PK870
				⊖		MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
73	01/95 → 09/97	73	01/95 → 09/97			MVB850R4	4PK850
						MVB870R4	4PK870
				⊖		MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
78	10/95 → 09/97	78	10/95 → 09/97			MVB850R4	4PK850
						MVB870R4	4PK870
				⊖		MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
1.6 16V (AT190_)	4A-FE	85	12/94 → 09/97			MVB850R4	4PK850
						MVB870R4	4PK870
				⊖		MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
1.6 GLI (AT190)	4A-FE	79	04/92 → 09/97			MVB850R4	4PK850
						MVB870R4	4PK870
				⊖		MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
1.8 i 16V (AT191)	7A-FE	79	01/95 → 09/97			MVB850R4	4PK850
						MVB870R4	4PK870
				⊖		MVB970R5	5PK970
						TB435	121x21
						MVB630R3	3PK630



kW



...TOYOTA

...CARINA E Saloon (_T19_)

2.0 (ST191)	3S-FE	98	01/93 → 09/97	⊗	A/C(-), 12/93→	MVB1030R5	5PK1030
				⊗	A/C(-), MAN, →12/93	MVB1015R5	5PK1015
				⊗	A/C(+)	MVB1110R5	5PK1110
				⊗	A/C(+)	MVB1135R5	5PK1135
						TB311	163x26.7
2.0 D (CT190)	2C	54	08/92 → 01/96			TBK360	
						MVB760R3	3PK760
						SVB13950	13x950
						TB473	177x25.4
						TBK052	
2.0 GLI (ST191)	3S-FE	98	04/92 → 09/97	⊗	A/C(-), 12/93→	MVB1030R5	5PK1030
				⊗	A/C(-), MAN, →12/93	MVB1015R5	5PK1015
				⊗	A/C(+)	MVB1110R5	5PK1110
				⊗	A/C(+)	MVB1135R5	5PK1135
						TB311	163x26.7
2.0 GTi (ST191_)	3S-GE	116	04/92 → 02/94			TBK360	
						MVB760R3	3PK760
						MVB1015R5	5PK1015
						MVB1100R5	5PK1100
						TB309	178x25.4
2.0 GTi 16V (ST191_)	3S-GE	129	03/94 → 09/97			MVB760R3	3PK760
						MVB1030R5	5PK1030
						MVB1100R5	5PK1100
						TB446	177x25
						MVB760R3	3PK760
2.0 i (ST191)	3S-FE	93	12/92 → 09/97	⊗	A/C(-), 12/93→	MVB1030R5	5PK1030
				⊗	A/C(-), AUTO, →12/93	MVB1015R5	5PK1015
				⊗	A/C(+)	MVB1110R5	5PK1110
				⊗	A/C(+)	MVB1135R5	5PK1135
						TB311	163x26.7
2.0 TD (CT190_)	2C-T	61	01/96 → 09/97			TBK360	
						MVB760R3	3PK760
						SVB13950	13x950
						TB473	177x25.4
						TBK052	
2.0 TD (CT190_)	2C-T	61	01/96 → 09/97			MVB1110R5	5PK1110
						MVB1215R5	5PK1215

CARINA E Sportswagon (_T19_)

1.6 GLI (AT190_)	4A-FE	79	01/93 → 09/97	⊗		MVB850R4	4PK850
				⊗		MVB870R4	4PK870
				⊗		MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
1.6 i (AT190_)	4A-FE	73	02/95 → 09/97	⊗		MVB850R4	4PK850
				⊗		MVB870R4	4PK870
				⊗		MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
1.8 i (AT191_)	7A-FE	79	02/95 → 09/97	⊗		MVB850R4	4PK850
				⊗		MVB870R4	4PK870
				⊗		MVB970R5	5PK970
						TB435	121x21
						MVB630R3	3PK630
2.0 D (CT190_)	2C	54	01/93 → 01/96	⊗		MVB760R3	3PK760
						SVB13950	13x950
						TB473	177x25.4
						TBK052	
						MVB1110R5	5PK1110
2.0 D (CT190_)	2C	54	01/93 → 01/96			MVB1215R5	5PK1215



kw



TOYOTA

...TOYOTA

...CARINA E Sportswagon (_T19_)

2.0 GLI (ST191_)	3S-FE	98	01/93 → 09/97	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-), 12/93→ A/C(-), AUTO, →12/93 A/C(+) A/C(+)	MVB1030R5 MVB1015R5 MVB1110R5 MVB1135R5 TB311 TBK360 MVB760R3	5PK1030 5PK1015 5PK1110 5PK1135 163x26.7 3PK760
2.0 i (ST191_)	3S-FE	93	05/95 → 09/97	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+) A/C(+)	MVB1030R5 MVB1110R5 MVB1135R5 TB311 TBK360 MVB760R3	5PK1030 5PK1110 5PK1135 163x26.7 3PK760
2.0 TD (CT190_)	2C-T	61	01/96 → 09/97	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	SVB13950 TB473 TBK052 MVB1110R5 MVB1215R5	13x950 177x25.4 5PK1110 5PK1215

CARINA II (_T15_)

1.6 (AT151)	4A-LC	55	10/83 → 11/87	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		SVB13875 MVB970R5 TB171 MVB630R3	13x875 5PK970 88x19 3PK630
	4A-L	62	10/83 → 11/87	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		SVB13875 MVB970R5 TB171 MVB630R3	13x875 5PK970 88x19 3PK630
		63	10/86 → 11/87	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		SVB13875 MVB970R5 TB171 MVB630R3	13x875 5PK970 88x19 3PK630
1.8 GLI (ST150)	1S-L	74	10/83 → 11/87	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1000R5 MVB1110R5 TB186 MVB760R3	5PK1000 5PK1110 139x25.4 3PK760
2.0 D	2C-L	50	02/84 → 05/88	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→11/87 →11/87 →11/87 A/C(-), →11/87 A/C(+), →11/87	SVB13850 TB473 TBK052 MVB1120R5 MVB1215R5	13x850 177x25.4 5PK1120 5PK1215
2.0 D (CT150)	2C-L	51	12/85 → 11/87	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	SVB13850 TB473 TBK052 MVB1120R5 MVB1215R5	13x850 177x25.4 5PK1120 5PK1215

CARINA II (_T17_)

1.6 (AT171)	4A-F	66	12/87 → 11/89	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		MVB835R4 MVB850R4 MVB970R5 TB161 MVB630R3	4PK835 4PK850 5PK970 94x19 3PK630
	4A-FE	75	12/87 → 03/92	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		MVB835R4 MVB850R4 MVB970R5 TB161 MVB630R3	4PK835 4PK850 5PK970 94x19 3PK630
		72	12/87 → 03/92	⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗ ⊗		MVB835R4 MVB850R4 MVB970R5 TB161 MVB630R3	4PK835 4PK850 5PK970 94x19 3PK630





kW



...TOYOTA

...CARINA II (_T17_)

2.0 D	2C-L	54	03/88 → 06/93	⊗	→11/89	SVB13850	13x850
				⊗	11/89→03/92	SVB13950	13x950
					→03/92	TB473	177x25.4
				KIT	→03/92	TBK052	
				⊗	A/C(-), →11/89	MVB1120R5	5PK1120
				⊗	A/C(-), 11/89→03/92	MVB1100R5	5PK1100
				⊗	A/C(+), →03/92	MVB1215R5	5PK1215
2.0 GLI (ST171)	3S-FE	89	12/87 → 03/92	⊗	A/C(-)	MVB1000R5	5PK1000
				⊗	A/C(+)	MVB1110R5	5PK1110
						TB311	163x26.7
				KIT		TBK360	
				⊗		MVB760R3	3PK760

CARINA II Saloon (_T15_)

1.6 (AT151)	4A-LC	55	10/83 → 11/87	⊗		SVB13875	13x875
				⊗		MVB970R5	5PK970
						TB171	88x19
				⊗		MVB630R3	3PK630
	4A-L	62	10/83 → 11/87	⊗		SVB13875	13x875
⊗					MVB970R5	5PK970	
					TB171	88x19	
				⊗		MVB630R3	3PK630
1.8 GLI (ST150)	1S-EL	74	10/83 → 11/87	⊗		MVB1110R5	5PK1110
				⊗		MVB1000R5	5PK1000
						TB186	139x25.4
				⊗		MVB760R3	3PK760
2.0 D	2C-L	50	02/84 → 05/88	⊗		SVB13850	13x850
						TB473	177x25.4
				KIT	→11/87	TBK052	
				⊗	A/C(-)	MVB1120R5	5PK1120
				⊗	A/C(+)	MVB1215R5	5PK1215

CARINA II Saloon (_T17_)

1.6 (AT171)	4A-F	66	12/87 → 08/90	⊗		MVB835R4	4PK835	
				⊗		MVB850R4	4PK850	
				⊗		MVB970R5	5PK970	
						TB161	94x19	
				⊗		MVB630R3	3PK630	
		4A-FE	75	12/87 → 03/92	⊗		MVB835R4	4PK835
	⊗					MVB850R4	4PK850	
	⊗					MVB875R4	4PK875	
	⊗					MVB970R5	5PK970	
						TB161	94x19	
				⊗		MVB630R3	3PK630	
				⊗		MVB760R3	3PK760	
				⊗		MVB835R4	4PK835	
				⊗		MVB850R4	4PK850	
				⊗		MVB970R5	5PK970	
						TB161	94x19	
				⊗		MVB630R3	3PK630	
2.0 D	2C	54	03/88 → 06/93	⊗	→11/89	SVB13850	13x850	
				⊗	11/89→03/92	SVB13950	13x950	
					→03/92	TB473	177x25.4	
				KIT	→03/92	TBK052		
				⊗	A/C(-), →11/89	MVB1120R5	5PK1120	
				⊗	A/C(-), 11/89→03/92	MVB1100R5	5PK1100	
				⊗	A/C(+), →03/92	MVB1215R5	5PK1215	
2.0 GLI (ST171)	3S-FE	89	12/87 → 03/92	⊗	A/C(-)	MVB1000R5	5PK1000	
				⊗	A/C(+)	MVB1110R5	5PK1110	
						TB311	163x26.7	
				KIT		TBK360		
				⊗		MVB760R3	3PK760	



kW



TOYOTA

...TOYOTA

CARINA II Station Wagon (_T17_)

1.6 (AT171)	4A-F	66	12/87 → 12/89	☼ ⊗ ⊖ ☞ ☺		MVB835R4 MVB850R4 MVB970R5 TB161 MVB630R3	4PK835 4PK850 5PK970 94x19 3PK630
	4A-FE	75	12/87 → 03/92	☼ ☼ ☼ ⊖ ☞ ☺ ☼ ☼ ⊖ ☞ ☺		MVB835R4 MVB850R4 MVB875R4 MVB970R5 TB161 MVB630R3 MVB760R3 MVB835R4 MVB850R4 MVB970R5 TB161 MVB630R3	4PK835 4PK850 4PK875 5PK970 94x19 3PK630 3PK760 4PK835 4PK850 5PK970 94x19 3PK630
		72	12/87 → 03/92	☼ ☼ ⊖ ☞ ☺		MVB835R4 MVB850R4 MVB970R5 TB161 MVB630R3	4PK835 4PK850 5PK970 94x19 3PK630
2.0	3S-FE	89	12/87 → 04/92	⊖ ⊖ ☞ ☞ KIT ☺	A/C(-) A/C(+)	MVB1000R5 MVB1110R5 TB311 TBK360 MVB760R3	5PK1000 5PK1110 163x26.7 3PK760
2.0 D (CT170)	2C-L	54	12/87 → 01/92	⊖ ⊖ ☞ ☞ KIT ☺ ☺ ☺	→11/89 11/89→ A/C(-), →11/89 A/C(-), 11/89→ A/C(+)	SVB13850 SVB13950 TB473 TBK052 MVB1120R5 MVB1100R5 MVB1215R5	13x850 13x950 177x25.4 5PK1120 5PK1100 5PK1215

CARINA Station Wagon (TA4K, TA6K)

1.6 (TA4K)	2T	54	03/81 → 01/82	⊖	08/81→	SVB10888	10x888
1.6 (TA4K, TA60LG)	2T	55	04/78 → 09/83	☼ ⊖	→12/81	SVB13975 SVB10888	13x975 10x888
1.8 D	1C	48	04/82 → 09/83	⊖ ☞ ☞ KIT		SVB10960 TB473 TBK052	10x960 177x25.4

CELICA (_T20_)

1.8 i 16V (AT200/ST)	7A-FE	85	11/93 → 11/99	☼ ⊖ ☞ ☺	→12/97 →12/97 →12/97 →12/97	MVB860R4 MVB970R5 TB435 MVB630R3	4PK860 5PK970 121x21 3PK630
2.0 i 16V	3S-GE	125	04/96 → 11/99	⊖ ⊖ ☞ ☺	A/C(-) A/C(+)	MVB1030R5 MVB1120R5 TB446 MVB760R3	5PK1030 5PK1120 177x25 3PK760
2.0 i 16V (ST202/GT)	3S-GE	129	11/93 → 11/99	⊖ ⊖ ☞ ☺	A/C(-) A/C(+)	MVB1030R5 MVB1120R5 TB446 MVB760R3	5PK1030 5PK1120 177x25 3PK760
2.0 i Turbo 4WD (ST205)	3S-GTE	178	02/94 → 11/99	⊖ ⊖ ☞ ☺	A/C(-) A/C(+)	MVB1030R5 MVB1120R5 TB446 MVB760R3	5PK1030 5PK1120 177x25 3PK760

CELICA (ST16_)

1.6	4A-L	63	04/86 → 02/90	☼ ⊖ ☞ ☺	→08/89 →08/89 →08/89 →08/89	SVB13875 MVB970R5 TB171 MVB630R3	13x875 5PK970 88x19 3PK630
-----	------	----	---------------	------------------	--------------------------------------	---	-------------------------------------



kW



...TOYOTA

...CELICA (ST16_)

1.6 GT 16V	4A-GEL	91	04/86 → 08/89	⚙️ ⚙️ ⚙️ ⚙️	→03/88 03/88→	SVB13875 MVB825R5 MVB830R5 TB198 MVB915R5	13x875 5PK825 5PK830 113x19 5PK915
2.0	3S-GEL	110	01/87 → 08/90	⚙️ ⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760

CELICA (TA60, RA40, RA6_)

1.6		91	08/83 → 07/85	⚙️ ⚙️ ⚙️		MVB788R5 MVB825R5 TB198	5PK788 5PK825 113x19
1.6 ST (TA60)	2TB	63	08/77 → 08/85	⚙️ ⚙️	→07/81	SVB13950 SVB10888	13x950 10x888
	2T	66	02/79 → 08/83	⚙️	08/81→	SVB10888	10x888
2.0 GT (RA63)	18R-G	90	02/78 → 08/83	⚙️ ⚙️	→07/81 →07/81	SVB131175 SVB10840	13x1175 10x840
2.0 XT (RA40)	18R	65	01/80 → 12/82	⚙️ ⚙️	→07/81 →07/81	SVB131250 SVB10850	13x1250 10x850
		66	02/79 → 07/85	⚙️ ⚙️	→07/81 →07/81	SVB131250 SVB10850	13x1250 10x850
2.0 XT (RA61)	21R-C	77	02/82 → 08/85	⚙️	→07/81	SVB10875	10x875

CELICA (ZZT23_)

1.8 16V TS (ZZT231_)	2ZZ-GE	141	11/99 →	⚙️	→09/05	MVB1930R6	6PK1930
1.8 16V VT-i (ZZT230_)	1ZZ-FE	105	11/99 →	⚙️ ⚙️	A/C(-), →09/05 A/C(+), →09/05	MVB1538R6 MVB1885R6	6PK1538 6PK1885

CELICA Convertible (_T16_)

2.0 GT (ST162)	3S-GELC	103	10/86 → 08/90	⚙️ ⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760
	3S-GEL	110	10/86 → 08/90	⚙️ ⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760

CELICA Convertible (_T18_)

2.0 GTi (ST182)	3S-GE	115	05/91 → 01/94	⚙️ ⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760
-----------------	-------	-----	---------------	----------------------	------------------	---	--

CELICA Convertible (_T20_)

2.0 i 16V	3S-GE	125	04/96 → 11/99	⚙️ ⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB1030R5 MVB1120R5 TB446 MVB760R3	5PK1030 5PK1120 177x25 3PK760
-----------	-------	-----	---------------	----------------------	------------------	---	--

CELICA Coupe (_T18_)

1.6 STi (AT180)	4A-FE	77	10/89 → 01/94	⚙️ ⚙️ ⚙️ ⚙️		MVB850R4 MVB970R5 TB161 MVB630R3 MVB760R3	4PK850 5PK970 94x19 3PK630 3PK760
2.0 GTi (ST182)	3S-GE	115	10/89 → 01/94	⚙️ ⚙️ ⚙️ ⚙️	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760



kW



TOYOTA

...TOYOTA

...CELICA Coupe (_T18_)

2.0 Turbo 4WD (ST185)	3S-GTE	150	10/89 → 01/94	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760
		153	10/89 → 01/94	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760

CELICA Coupe (RA6)

1.6	4A-GE	91	12/83 → 10/86	⊗ ⊗ ⊗	→07/85 →07/85 →07/85	MVB788R5 MVB825R5 TB198	5PK788 5PK825 113x19
2.0	21R-U	77	01/82 → 10/86	⊗	→07/85	SVB10875	10x875
	18R-G	88	01/82 → 10/86	⊗	→07/83	SVB10850	10x850

CELICA Coupe (T16F)

2.0 Turbo 4x4	3S-GTE	136	03/88 → 08/90	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760
---------------	--------	-----	---------------	------------------	------------------	---	--

CELICA Coupe (TA4C, TA60)

1.6 GT (TA4C)	2T-G	80	04/78 → 02/82	⊗ ⊗ ⊗ ⊗	→07/81 →07/81 →07/81 →07/81	SVB13950 SVB10888	13x950 10x888
		81	04/80 → 02/82	⊗ ⊗ ⊗	→07/81 →07/81 →07/81	SVB13950 SVB10888	13x950 10x888
1.6 LT (TA4C)	2TB	55	02/79 → 07/83	⊗ ⊗	→07/81 →07/81	SVB13950 SVB10888	13x950 10x888
1.6 ST (TA4C, TA60)	2TB, 4A-L	63	08/77 → 08/85	⊗ ⊗	→07/81	SVB13950 SVB10888	13x950 10x888
1.6 ST (TA60)	2T	66	02/79 → 08/83	⊗	08/81→	SVB10888	10x888

CELICA Hatchback (T16)

1.6	4A-L	63	04/86 → 02/90	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→08/89 →08/89 →08/89 →08/89	SVB13875 MVB970R5 TB171 MVB630R3	13x875 5PK970 88x19 3PK630
1.6 GT	4A-GELC	85	08/87 → 08/89	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→03/88 03/88→	SVB13875 MVB825R5 MVB830R5 TB198 MVB915R5	13x875 5PK825 5PK830 113x19 5PK915
1.6 GT 16V	4A-GEL	91	09/85 → 08/89	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	→03/88 03/88→	SVB13875 MVB825R5 MVB830R5 TB198 MVB915R5	13x875 5PK825 5PK830 113x19 5PK915
2.0 GT	3S-GEL	110	08/85 → 08/89	⊗ ⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760
	3S-GELC	103	09/85 → 08/89	⊗ ⊗ ⊗ ⊗ ⊗	A/C(-) A/C(+)	MVB1015R5 MVB1100R5 TB309 MVB760R3	5PK1015 5PK1100 178x25.4 3PK760

CELICA SUPRA (MA61)

2.8 i	5M-GE	125	05/82 → 10/86	⊗ ⊗ ⊗	→12/85 →08/83 08/83→12/85	MVB920R7 TB188 TB310	7PK920 142x25.4 169x25.4
-------	-------	-----	---------------	-------------	---------------------------------	----------------------------	--------------------------------



kW



...TOYOTA

COASTER Bus

4.2 D		59	10/87 → 01/93	☼	AUTO, 01/90 → MAN	SVB101400	10x1400	
				⊖		SVB101060	10x1060	
				⊖		SVB101000	10x1000	
				⌘		TB285	94x25.4	
4.2 TD		92	10/87 → 01/93	☼		SVB101400	10x1400	
				⊖		SVB101060	10x1060	
				⌘		TB285	94x25.4	
		96	02/93 → 10/03	☼		→07/99	SVB101375	10x1375
				☼		07/99 →	MVB1360R7	7PK1360
				⊖			SVB101060	10x1060
		⌘	→05/97	TB285	94x25.4			
		⌘	05/97 →	TB695	92x25			

COROLLA (_E8_)

1.3 (AE80)	2A-L	51	06/83 → 10/84	⊖		MVB975R5	5PK975
				⌘		TB171	88x19
1.3 (AE80/EE80)	2E-L, 2E-LC	55	10/84 → 08/87	⊖	→04/87	MVB810R4	4PK810
				⌘	→04/86	TB667	123x20
				⌘	04/86 → 04/87	TB263	123x24
				⌘ KIT	04/86 → 04/87	TBK359	
1.6	4A-LC	54	12/85 → 05/88	⊖	→09/87	MVB975R5	5PK975
				⌘	→09/87	TB171	88x19
1.6 (AE82)	4A-L	62	06/83 → 08/87	⊖		MVB975R5	5PK975
				⌘		TB171	88x19
	4A-LC	53	08/85 → 08/87	⊖		MVB975R5	5PK975
				⌘		TB171	88x19
1.8 D	1C	43	06/83 → 05/88	☼	MS	MVB775R5	5PK775
				☼	PS	MVB1215R5	5PK1215
				⊖		SVB13850	13x850
				⌘		TB473	177x25.4
				⌘ KIT	→04/87	TBK052	
				⊕		MVB1120R5	5PK1120
		47	07/85 → 05/88	☼	MS, 05/87 →	MVB788R5	5PK788
				☼	PS, 05/87 →	MVB1215R5	5PK1215
				⊖	05/87 →	SVB13850	13x850
				⌘	05/87 →	TB473	177x25.4
		⌘ KIT	05/87 →	TBK052			
		⊕	A/C(-), 05/87 →	MVB1120R5	5PK1120		

COROLLA (_E9_)

1.3 i (EE90)	2E, 2E-E	55	08/87 → 12/92	☼	→10/88	MVB865R5	5PK865
				☼	10/88 → 04/92	MVB875R5	5PK875
				☼	Eng. 2E, →06/91	MVB1050R5	5PK1050
				☼	Eng. 2E, →06/91	MVB1060R5	5PK1060
				⊖	→04/92	MVB810R4	4PK810
				⊖	Eng. 2E, AUTO, →06/91	MVB825R4	4PK825
				⌘	→04/92	TB263	123x24
				⌘ KIT	→04/92	TBK359	
				⊕	A/C(-), →04/92	MVB915R5	5PK915
				⊕	A/C(+), →04/92	MVB1073R5	5PK1073
				⊕	Eng. 2E, →06/91	MVB887R5	5PK887
				1.6 (AE92)	4A-F	66	08/87 → 12/89
☼		MVB860R4	4PK860				
⊖		MVB970R5	5PK970				
⌘		TB161	94x19				
		⊕		MVB630R3	3PK630		
1.6 i	4A-FE	77	11/89 → 06/93	☼	→05/92	MVB835R4	4PK835
				☼	→05/92	MVB860R4	4PK860
				⊖	→05/92	MVB970R5	5PK970
				⌘	→05/92	TB161	94x19
				⊕	→05/92	MVB630R3	3PK630

TOYOTA



kW



TOYOTA

...TOYOTA

...COROLLA (_E9_)

1.6 i 4WD	4A-FE	77	10/87 → 08/90	☼		MVB835R4	4PK835
				☼		MVB845R4	4PK845
				☼		MVB860R4	4PK860
				⊖		MVB970R5	5PK970
				⊖	AUTO, 05/89 →	MVB975R5	5PK975
				🌀		TB161	94x19
				🌀		MVB630R3	3PK630
				☼		MVB788R5	5PK788
1.8 D	1C	49	11/89 → 06/93	☼	MS, →04/92	MVB788R5	5PK788
				⊖	→04/92	SVB13950	13x950
				🌀	→04/92	TB473	177x25.4
				🌀	→04/92	TBK052	
				☼	A/C(-), →04/92	MVB1100R5	5PK1100
				☼	A/C(-), →09/91	MVB1110R5	5PK1110
		47	07/87 → 06/93	☼	A/C(+), →04/92	MVB1215R5	5PK1215
				☼	MS, →04/92	MVB788R5	5PK788
				⊖	→08/89	SVB13850	13x850
				⊖	05/89→04/92	SVB13950	13x950
				🌀	→04/92	TB473	177x25.4
				🌀	→04/92	TBK052	
☼	A/C(-), →08/89	MVB1120R5	5PK1120				
☼	A/C(-), 05/89→09/91	MVB1110R5	5PK1110				
☼	A/C(-), 08/89→04/92	MVB1100R5	5PK1100				
☼	A/C(+), →04/92	MVB1215R5	5PK1215				

COROLLA (_E10_)

1.3 12V (EE100_)	2E	53	07/92 → 04/97	☼	MS, →05/93	MVB875R5	5PK875				
				☼	MS, 05/93→	MVB887R5	5PK887				
				⊖		MVB825R4	4PK825				
				🌀		TB263	123x24				
				🌀		TBK359					
				☼	A/C(-)	MVB915R5	5PK915				
				☼	A/C(+), →05/93	MVB1073R5	5PK1073				
				☼	A/C(+), 05/93→	MVB1090R5	5PK1090				
1.3 XLI (EE101_)	4E-FE	55	09/95 → 04/97	☼	MS	MVB887R5	5PK887				
				⊖		MVB825R4	4PK825				
				🌀		TB428	124x26				
				☼	A/C(-), →05/96	MVB915R5	5PK915				
				☼	A/C(-), 05/96→	MVB906R5	5PK906				
				☼	A/C(+)	MVB1090R5	5PK1090				
1.3 XLI 16V (EE101)	4E-FE	65	07/92 → 09/95	☼	MS	MVB869R5	5PK869				
				☼	MS	MVB875R5	5PK875				
				☼	MS	MVB887R5	5PK887				
				☼	PS	MVB1050R5	5PK1050				
				⊖		MVB825R4	4PK825				
				⊖		MVB920R4	4PK920				
				🌀		TB428	124x26				
				☼	A/C(-)	MVB915R5	5PK915				
				☼	A/C(+), →05/93	MVB1073R5	5PK1073				
				☼	A/C(+), 05/93→	MVB1090R5	5PK1090				
				1.6 Si (AE101_)	4A-FE	84	09/95 → 04/97	☼		MVB850R4	4PK850
								☼		MVB860R4	4PK860
⊖		MVB970R5	5PK970								
🌀		TB445	117x21								
☼		MVB630R3	3PK630								
☼		MVB1120R5	5PK1120								
2.0 D (CE100_)	2C	53	07/92 → 04/97	☼	MS	MVB1188R5	5PK1188				
				☼	PS	SVB13950	13x950				
				⊖		TB473	177x25.4				
				🌀		TBK052					
				☼		MVB1110R5	5PK1110				
				☼	A/C(-)	MVB1100R5	5PK1100				



kW



...TOYOTA

COROLLA (_E11_)

1.4 (EE111_)	4E-FE	63	04/97 → 02/00	☼ ⊗ ☞ ⊗ ⊗	MS, →09/98 →09/99 →09/99 A/C(-), →09/99 A/C(+), →09/99	MVB875R5 MVB825R4 TB428 MVB887R5 MVB1050R5	5PK875 4PK825 124x26 5PK887 5PK1050
1.4 16V (ZZE111_)	4ZZ-FE	71	02/00 → 01/02	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(-) A/C(+) A/C(+)	MVB1538R6 MVB1560R6 MVB1820R6 MVB1842R6	6PK1538 6PK1560 6PK1820 6PK1842
1.6 (AE111_)	4A-FE	81	04/97 → 02/00	☼ ☼ ⊗ ☞ ⊗ ⊗	→09/99 →09/99 →09/99 →09/99 →09/99 →09/99	MVB850R4 MVB860R4 MVB970R5 TB445 MVB630R3	4PK850 4PK860 5PK970 117x21 3PK630
1.6 16V (ZZE112_)	3ZZ-FE	81	02/00 → 01/02	⊗ ⊗ ⊗ ⊗	A/C(-) A/C(-) A/C(+) A/C(+)	MVB1538R6 MVB1560R6 MVB1820R6 MVB1842R6	6PK1538 6PK1560 6PK1820 6PK1842
1.6 Aut. (AE111_)	4A-FE	79	04/97 → 02/00	☼ ☼ ⊗ ☞ ⊗ ⊗	→09/99 →09/99 →09/99 →09/99 →09/99 →09/99	MVB850R4 MVB860R4 MVB970R5 TB445 MVB630R3	4PK850 4PK860 5PK970 117x21 3PK630
1.9 D (WZE110_)	1WZ	51	02/00 → 01/02	⊗ ⊗ ☞ ⊗ KIT	A/C(-) A/C(+)	MVB1488R6 MVB1775R6 TB631 TBK105	6PK1488 6PK1775 140x25.4
2.0 D (CE110_)	2C-E	53	04/97 → 02/00	⊗ ☞ ☞ KIT ⊗ ⊗	→09/99 →09/99 →03/99 A/C(-), →09/99 A/C(+), →09/99	SVB13950 TB473 TBK052 MVB1110R5 MVB1188R5	13x950 177x25.4
2.0 D-4D	1CD-FTV	66	09/00 → 01/02	⊗ ☞ ⊗	05/01 → 05/01 → 05/01 →	MVB887R5 TB655 MVB1110R5	5PK887 178x25 5PK1110

COROLLA (_E12U_, _E12J_)

1.4 D	1ND-TV	66	07/04 →	⊗	A/C(+)	MVB1215R6	6PK1215
1.4 VVT-i	4ZZ-FE	71	01/02 →	⊗ ⊗	A/C(-) A/C(+)	MVB1400R6 MVB1675R6	6PK1400 6PK1675
1.6 VVT-i	3ZZ-FE	81	01/02 →	⊗ ⊗	A/C(-), →10/06 A/C(+), →10/06	MVB1400R6 MVB1675R6	6PK1400 6PK1675
1.8 VVT-i TS	2ZZ-GE	141 165	01/02 → 02/05 →	⊗ ⊗	→10/06 →10/06	MVB1690R6 MVB1690R6	6PK1690 6PK1690
2.0 D-4D	1CD-FTV	66	01/02 →	⊗ ☞ ⊗ ⊗		MVB887R5 TB655 MVB1110R5	5PK887 178x25 5PK1110
		81	01/02 →	⊗ ☞ ⊗ ⊗		MVB887R5 TB655 MVB1110R5	5PK887 178x25 5PK1110
		85	05/03 →	⊗ ☞ ⊗		MVB887R5 TB655 MVB1110R5	5PK887 178x25 5PK1110



kw



TOYOTA

...TOYOTA

COROLLA Compact (_E9_)

1.3 (EE90)	2E	55	08/87 → 12/89	☼		MVB1050R5	5PK1050
				☼		MVB1060R5	5PK1060
				☼	→10/88	MVB865R5	5PK865
				☼	10/88→	MVB875R5	5PK875
				⊗	AUTO	MVB825R4	4PK825
				⊗	MAN	MVB810R4	4PK810
				☞☞☞		TB263	123x24
				☞☞☞KIT		TBK359	
				☼		MVB887R5	5PK887
				☼	A/C(-)	MVB915R5	5PK915
	A/C(+)	MVB1073R5	5PK1073				
1.3 i (EE90)	2E-E	55	06/89 → 04/92	☼		MVB875R5	5PK875
				☼	→06/91	MVB1050R5	5PK1050
				☼	→06/91	MVB1060R5	5PK1060
				⊗	AUTO, →06/91	MVB825R4	4PK825
				⊗	MAN	MVB810R4	4PK810
				☞☞☞		TB263	123x24
				☞☞☞KIT		TBK359	
				☼	→06/91	MVB887R5	5PK887
				☼	A/C(-)	MVB915R5	5PK915
				☼	A/C(+)	MVB1073R5	5PK1073
1.6 (AE92)	4A-F	66	08/87 → 04/92	☼		MVB835R4	4PK835
				☼		MVB860R4	4PK860
				⊗		MVB970R5	5PK970
				☞☞☞		TB161	94x19
				☼		MVB630R3	3PK630
	4A-FE	77	08/89 → 04/92	☼		MVB835R4	4PK835
				☼		MVB860R4	4PK860
				⊗		MVB970R5	5PK970
				☞☞☞		TB161	94x19
				☼		MVB630R3	3PK630
1.6 GTi (AE92)	4A-GE	85	08/87 → 04/92	☼	MS	MVB850R5	5PK850
				⊗		MVB830R5	5PK830
				☞☞☞		TB198	113x19
1.8 D (CE90)	1C	47	08/87 → 04/92	☼	MS	MVB915R5	5PK915
				☼	MS	MVB788R5	5PK788
				☼	PS	MVB1215R5	5PK1215
				⊗	→08/89	SVB13850	13x850
				⊗	05/89→	SVB13950	13x950
		49	08/89 → 04/92	☞☞☞		TB473	177x25.4
				☞☞☞KIT		TBK052	
				☼	A/C(-), →08/89	MVB1120R5	5PK1120
				☼	A/C(-), 05/89→09/91	MVB1110R5	5PK1110
				☼	A/C(-), 08/89→	MVB1100R5	5PK1100
☼	MS	MVB788R5	5PK788				
☼	PS	MVB1215R5	5PK1215				
⊗		SVB13950	13x950				
☞☞☞		TB473	177x25.4				
☞☞☞KIT		TBK052					
☼	A/C(-)	MVB1100R5	5PK1100				
☼	A/C(-), →09/91	MVB1110R5	5PK1110				

COROLLA Compact (_E10_)

1.3 12V (EE100_)	2E	53	07/92 → 05/95	☼	MS, →05/93	MVB875R5	5PK875
				☼	MS, 05/93→	MVB887R5	5PK887
				⊗		MVB825R4	4PK825
				☞☞☞		TB263	123x24
				☞☞☞KIT		TBK359	
				☼	A/C(-)	MVB915R5	5PK915
				☼	A/C(+), →05/93	MVB1073R5	5PK1073
				☼	A/C(+), 05/93→	MVB1090R5	5PK1090



kW



...TOYOTA

...COROLLA Compact (_E10_)

1.3 XLI (EE101_)	4E-FE	55	09/95 → 04/97	 	MS	MVB887R5 5PK887 MVB825R4 4PK825 TB428 124x26 MVB915R5 5PK915 MVB906R5 5PK906 MVB1090R5 5PK1090
1.3 XLI 16V (EE101)	4E-FE	65	07/92 → 09/95	 	MS MS MS PS	MVB869R5 5PK869 MVB875R5 5PK875 MVB887R5 5PK887 MVB1050R5 5PK1050 MVB825R4 4PK825 MVB920R4 4PK920 TB428 124x26 MVB915R5 5PK915 MVB1073R5 5PK1073 MVB1090R5 5PK1090
1.6 Si (AE101_)	4A-FE	84	07/92 → 04/97	 		MVB845R4 4PK845 MVB850R4 4PK850 MVB860R4 4PK860 MVB970R5 5PK970 TB445 117x21 MVB630R3 3PK630
1.8 GT (AE102_)	7A-FE	86	11/92 → 05/95	 		MVB860R4 4PK860 MVB970R5 5PK970 TB435 121x21 MVB630R3 3PK630
1.8 GTi 4x4		92	05/92 → 07/95	 		MVB860R4 4PK860 MVB970R5 5PK970 TB435 121x21 MVB630R3 3PK630
2.0 D (CE100_)	2C	53	07/92 → 04/97	 	MS PS	MVB1120R5 5PK1120 MVB1188R5 5PK1188 SVB13950 13x950 TB473 177x25.4 TBK052 MVB1110R5 5PK1110 MVB1100R5 5PK1100

COROLLA Compact (_E11_)

1.4 (EE111_)	4E-FE	63	04/97 → 02/00	 	MS, →09/98 →09/99 →09/99	MVB875R5 5PK875 MVB825R4 4PK825 TB428 124x26 MVB887R5 5PK887 MVB1050R5 5PK1050
1.4 (ZZE111_)	4ZZ-FE	71	02/00 → 01/02	 	A/C(-) A/C(-) A/C(+) A/C(+)	MVB1538R6 6PK1538 MVB1560R6 6PK1560 MVB1820R6 6PK1820 MVB1842R6 6PK1842
1.6 (AE111_)	4A-FE	81	04/97 → 02/00	 	→09/99 →09/99 →09/99 →09/99	MVB850R4 4PK850 MVB860R4 4PK860 MVB970R5 5PK970 TB445 117x21 MVB630R3 3PK630
1.6 (ZZE112_)	3ZZ-FE	81	02/00 → 01/02	 	A/C(-) A/C(-) A/C(+) A/C(+)	MVB1538R6 6PK1538 MVB1560R6 6PK1560 MVB1820R6 6PK1820 MVB1842R6 6PK1842
1.6 Aut. (AE111_)	4A-FE	79	04/97 → 02/00	 	→09/99 →09/99 →09/99 →09/99	MVB850R4 4PK850 MVB860R4 4PK860 MVB970R5 5PK970 TB445 117x21 MVB630R3 3PK630



kw



TOYOTA

...TOYOTA

...COROLLA Compact (_E11_)

1.9 D (WZE110_)	1WZ	51	02/00 → 01/02	⊗	A/C(-)	MVB1488R6	6PK1488
				⊗	A/C(+)	MVB1775R6	6PK1775
				☞		TB631	140x25.4
				☞		TBK105	
2.0 D (CE110_)	2C-E	53	04/97 → 02/00	⊗	→09/99	SVB13950	13x950
				☞	→09/99	TB473	177x25.4
				☞	→03/99	TBK052	
				⊗	A/C(-), →09/99	MVB1110R5	5PK1110
				⊗	A/C(+), →09/99	MVB1188R5	5PK1188
2.0 D-4D	1CD-FTV	66	09/00 → 01/02	⊗	05/01→	MVB887R5	5PK887
				☞	05/01→	TB655	178x25
				⊗	05/01→	MVB1110R5	5PK1110

COROLLA Coupe (AE86)

1.6 16V	4A-GEC	85	12/85 → 04/87	☼		MVB800R5	5PK800
				⊗		MVB825R5	5PK825
				☞		TB198	113x19
				⊗		SVB13800	13x800
1.6 GT 16V (AE86)	4A-GE	91	08/83 → 07/87	☼	MS	MVB800R5	5PK800
				☼	PS	MVB1035R5	5PK1035
				⊗		MVB825R5	5PK825
				⊗		MVB830R5	5PK830
				☞		TB198	113x19
				⊗		MVB906R5	5PK906
1.6 SR 16V	4A-C	57	05/83 → 04/87	⊗	→07/83	SVB10850	10x850
				⊗	→07/83	SVB10888	10x888

COROLLA Estate (_E12J_, _E12T_)

1.4 D	1ND-TV	66	07/04 →	⊗	A/C(+)	MVB1215R6	6PK1215		
1.4 VVT-i	4ZZ-FE	71	01/02 →	⊗	A/C(-), →10/06	MVB1400R6	6PK1400		
				⊗	A/C(+), →10/06	MVB1675R6	6PK1675		
1.6 VVT-i	3ZZ-FE	81	01/02 →	⊗	A/C(-), →10/06	MVB1400R6	6PK1400		
				⊗	A/C(+), →10/06	MVB1675R6	6PK1675		
2.0 D-4D	1CD-FTV	66	01/02 →	⊗		MVB887R5	5PK887		
				☞		TB655	178x25		
				⊗		MVB1110R5	5PK1110		
				85	04/04 →	⊗		MVB887R5	5PK887
				☞		☞		TB655	178x25
				⊗		MVB1110R5	5PK1110		

COROLLA FX Compact (E8B)

1.3	2E-L	55	08/85 → 08/87	☼	05/87→	MVB1050R5	5PK1050
				☼	05/87→	MVB1060R5	5PK1060
				☼	05/87→	MVB865R5	5PK865
				⊗	AUTO, 05/87→	MVB825R4	4PK825
				⊗	MAN, 05/87→	MVB810R4	4PK810
				☞	05/87→	TB263	123x24
				☞	05/87→	TBK359	
				⊗	05/87→	MVB887R5	5PK887
				⊗	A/C(-), 05/87→	MVB915R5	5PK915
				⊗	A/C(+), 05/87→	MVB1073R5	5PK1073
1.6 GT 16V	4A-GEL	89	08/85 → 08/87	⊗	→04/87	MVB825R5	5PK825
				☞	→04/87	TB198	113x19
				⊗	oil cooler (-), →04/87	MVB915R5	5PK915
				⊗	oil cooler (+), →04/87	MVB630R3	3PK630



kW



...TOYOTA

...COROLLA FX Compact (E8B)

1.8 D	1C-L	47	08/85 → 08/87	⊗	MS, 05/87→	MVB788R5	5PK788
				⊗		05/87→	SVB13850
				⊗	05/87→	TB473	177x25.4
				⊗	05/87→	TBK052	
				⊗	A/C(-), 05/87→	MVB1120R5	5PK1120
				⊗	A/C(+), 05/87→	MVB1215R5	5PK1215
	1C	43	01/85 → 05/88	⊗	MS	MVB775R5	5PK775
				⊗		PS	MVB1215R5
				⊗		SVB13850	13x850
				⊗		TB473	177x25.4
				⊗	→04/87	TBK052	
				⊗		MVB1120R5	5PK1120

COROLLA Liftback (_E8_)

1.3 (AE80)	2A-L	51	06/83 → 09/84	⊗		MVB975R5	5PK975	
				⊗		TB171	88x19	
1.3 (EE80)	2E-L, 2E-LC	55	01/85 → 08/87	⊗	→04/87	MVB810R4	4PK810	
				⊗	→04/86	TB667	123x20	
				⊗	04/86→04/87	TB263	123x24	
				⊗	04/86→04/87	TBK359		
1.6	4A-L	63	07/85 → 05/88	⊗	→09/87	MVB975R5	5PK975	
				⊗	→09/87	TB171	88x19	
1.6 (AE82)	4A-LC	54	08/85 → 08/87	⊗		MVB975R5	5PK975	
				⊗		TB171	88x19	
	4A-L	62	06/83 → 08/87	⊗		MVB975R5	5PK975	
				⊗		TB171	88x19	
1.8 D	1C	43	06/83 → 05/88	⊗	MS	MVB775R5	5PK775	
				⊗		PS	MVB1215R5	5PK1215
				⊗			SVB13850	13x850
				⊗			TB473	177x25.4
				⊗		→04/87	TBK052	
				⊗			MVB1120R5	5PK1120
1.8 D (CE80)	1C-L	47	06/83 → 08/87	⊗	MS, 05/87→	MVB788R5	5PK788	
				⊗		05/87→	SVB13850	13x850
				⊗		05/87→	TB473	177x25.4
				⊗		05/87→	TBK052	
				⊗		A/C(-), 05/87→	MVB1120R5	5PK1120
				⊗		A/C(+), 05/87→	MVB1215R5	5PK1215

COROLLA Liftback (_E9_)

1.3 i (EE90)	2E, 2E-E	55	08/87 → 04/92	⊗	→10/88	MVB865R5	5PK865
				⊗	10/88→	MVB875R5	5PK875
				⊗	Eng. 2E, →06/91	MVB1050R5	5PK1050
				⊗	Eng. 2E, →06/91	MVB1060R5	5PK1060
				⊗	Eng. 2E, AUTO, →06/91	MVB825R4	4PK825
				⊗	MAN	MVB810R4	4PK810
				⊗		TB263	123x24
				⊗		TBK359	
				⊗	A/C(-)	MVB915R5	5PK915
				⊗	A/C(+)	MVB1073R5	5PK1073
			Eng. 2E, →06/91	MVB887R5	5PK887		
1.6	4A-F	70	08/87 → 04/92	⊗		MVB835R4	4PK835
				⊗		MVB860R4	4PK860
				⊗		MVB970R5	5PK970
				⊗		TB161	94x19
				⊗		MVB630R3	3PK630



kw



...TOYOTA

...COROLLA Liftback (_E9_)

TOYOTA

1.6 (AE92)	4A-F	66	08/87 → 04/92			MVB835R4	4PK835
						MVB860R4	4PK860
						MVB970R5	5PK970
						TB161	94x19
						MVB630R3	3PK630
	4A-FE	77	08/89 → 04/92			MVB835R4	4PK835
						MVB860R4	4PK860
						MVB970R5	5PK970
						TB161	94x19
						MVB630R3	3PK630
1.6 GTI	4A-GE	92	07/87 → 06/93		MS, →04/92	MVB850R5	5PK850
					MS, →04/92	MVB875R5	5PK875
					PS, →04/92	MVB1050R5	5PK1050
					→04/92	MVB830R5	5PK830
					→04/92	TB198	113x19
					→04/92	MVB915R5	5PK915
1.8 D (CE90)	1C	47	08/87 → 04/92		MS	MVB788R5	5PK788
					PS	MVB1215R5	5PK1215
					→08/89	SVB13850	13x850
					05/89→	SVB13950	13x950
						TB473	177x25.4
						TBK052	
					A/C(-), →08/89	MVB1120R5	5PK1120
					A/C(-), 05/89→09/91	MVB1110R5	5PK1110
					A/C(-), 08/89→	MVB1100R5	5PK1100
		49	08/89 → 04/92		MS	MVB788R5	5PK788
					PS	MVB1215R5	5PK1215
						SVB13950	13x950
						TB473	177x25.4
						TBK052	
					A/C(-)	MVB1100R5	5PK1100
					A/C(-), →09/91	MVB1110R5	5PK1110

COROLLA Liftback (_E10_)

1.3 12V (EE100_)	2E	53	07/92 → 05/95		MS, →05/93	MVB875R5	5PK875
					MS, 05/93→	MVB887R5	5PK887
						MVB825R4	4PK825
						TB263	123x24
						TBK359	
					A/C(-)	MVB915R5	5PK915
					A/C(+), →05/93	MVB1073R5	5PK1073
					A/C(+), 05/93→	MVB1090R5	5PK1090
1.6 GLI (AE101_)	4A-FE	84	07/92 → 04/97			MVB845R4	4PK845
						MVB850R4	4PK850
						MVB860R4	4PK860
						MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
1.8 GT (AE102_)	7A-FE	86	11/92 → 05/95			MVB860R4	4PK860
						MVB970R5	5PK970
						TB435	121x21
						MVB630R3	3PK630
1.8 GTi 4x4		92	05/92 → 07/95			MVB860R4	4PK860
						MVB970R5	5PK970
						TB435	121x21
						MVB630R3	3PK630
2.0 D (CE100_)	2C	53	07/92 → 04/97		MS	MVB1120R5	5PK1120
					PS	MVB1188R5	5PK1188
						SVB13950	13x950
						TB473	177x25.4
						TBK052	
						MVB1110R5	5PK1110
					A/C(-)	MVB1100R5	5PK1100



kW



...TOYOTA

COROLLA Liftback (_E11_)

1.4 (EE111_)	4E-FE	63	04/97 → 02/00	 	MS, →09/98 →09/99 →09/99 A/C(-), →09/99 A/C(+), →09/99	MVB875R5 MVB825R4 TB428 MVB887R5 MVB1050R5	5PK875 4PK825 124x26 5PK887 5PK1050
1.4 (ZZE111_)	4ZZ-FE	71	02/00 → 01/02	 	A/C(-) A/C(-) A/C(+) A/C(+)	MVB1538R6 MVB1560R6 MVB1820R6 MVB1842R6	6PK1538 6PK1560 6PK1820 6PK1842
1.6 (AE111_)	4A-FE	81	04/97 → 02/00	 	→09/99 →09/99 →09/99 →09/99 →09/99	MVB850R4 MVB860R4 MVB970R5 TB445 MVB630R3	4PK850 4PK860 5PK970 117x21 3PK630
1.6 (ZZE112_)	3ZZ-FE	81	02/00 → 01/02	 	A/C(-) A/C(-) A/C(+) A/C(+)	MVB1538R6 MVB1560R6 MVB1820R6 MVB1842R6	6PK1538 6PK1560 6PK1820 6PK1842
1.6 Aut. (AE111_)	4A-FE	79	04/97 → 02/00	 	→09/99 →09/99 →09/99 →09/99 →09/99	MVB850R4 MVB860R4 MVB970R5 TB445 MVB630R3	4PK850 4PK860 5PK970 117x21 3PK630
1.9 D (WZE110_)	1WZ	51	02/00 → 01/02	 	A/C(-) A/C(+)	MVB1488R6 MVB1775R6 TB631 TBK105	6PK1488 6PK1775 140x25.4 3PK630
2.0 D (CE110)	2C-E	53	04/97 → 02/00	 	→09/99 →09/99 →03/99 A/C(-), →09/99 A/C(+), →09/99	SVB13950 TB473 TBK052 MVB1110R5 MVB1188R5	13x950 177x25.4 177x25.4 5PK1110 5PK1188
2.0 D-4D	1CD-FTV	66	09/00 → 01/02	 	05/01 → 05/01 → 05/01 →	MVB887R5 TB655 MVB1110R5	5PK887 178x25 5PK1110

COROLLA Saloon (_E12J_, _E12T_)

1.4 D	1ND-TV	66	07/04 →	 	A/C(+) A/C(+), 11/06 →	MVB1215R6 MVB1238R6	6PK1215 6PK1238
1.4 VVT-i	4ZZ-FE	71	08/02 →	 	A/C(-) A/C(+) A/C(+), 11/06 →	MVB1400R6 MVB1675R6 MVB1700R6	6PK1400 6PK1675 6PK1700
1.6 VVT-i	3ZZ-FE	81	08/02 →	 	A/C(-), →10/06 A/C(+), →10/06	MVB1400R6 MVB1675R6	6PK1400 6PK1675
2.0 D4d	1CD-FTV	85	06/04 →	 		MVB887R5 TB655 MVB1110R5	5PK887 178x25 5PK1110
2.0 D-4D	1CD-FTV	66	08/02 →	 		MVB887R5 TB655 MVB1110R5	5PK887 178x25 5PK1110

COROLLA Station Wagon (_E7_)

1.3 (KE70)	4K-C	44	12/79 → 01/82	 	→07/81 08/81 →	SVB10875 SVB10888	10x875 10x888
	4K	48	02/82 → 08/87		→07/83	SVB10888	10x888
1.8 D (CE70)	1C	44	05/83 → 08/87	 	→04/87 →04/87 →04/87	SVB13850 TB473 TBK052 MVB1120R5	13x850 177x25.4 177x25.4 5PK1120



kW



TOYOTA

...TOYOTA

COROLLA Station Wagon (_E9_)

1.3 (EE90)	2E	55	12/87 → 12/89	☼	→10/88	MVB865R5	5PK865
				☼	10/88→	MVB875R5	5PK875
1.3 i (EE90)	2E-E	55	06/89 → 06/92	☼		MVB810R4	4PK810
				☼		TB263	123x24
				☼		TBK359	
				☼	A/C(-)	MVB915R5	5PK915
				☼	A/C(+)	MVB1073R5	5PK1073
				☼		MVB875R5	5PK875
1.6 (AE92)	4A-F	66	02/88 → 05/92	☼		MVB835R4	4PK835
				☼		MVB860R4	4PK860
				☼		MVB970R5	5PK970
		70	12/87 → 04/92	☼		TB161	94x19
				☼		MVB630R3	3PK630
				☼		MVB835R4	4PK835
1.6 XLI	4A-FE	77	11/89 → 06/92	☼		MVB860R4	4PK860
				☼		MVB970R5	5PK970
				☼		TB161	94x19
		77	08/88 → 06/92	☼		MVB630R3	3PK630
				☼		MVB835R4	4PK835
				☼		MVB860R4	4PK860
1.6 XLI 4x4 (AE95)	4A-FE	77	08/88 → 06/92	☼		MVB970R5	5PK970
				☼		TB161	94x19
				☼		MVB630R3	3PK630
		47	12/87 → 06/92	☼	MS	MVB788R5	5PK788
				☼	→08/89	SVB13850	13x850
				☼	08/89→	SVB13950	13x950
1.8 D (CE90)	1C	47	12/87 → 06/92	☼		TB473	177x25.4
				☼		TBK052	
				☼	A/C(-), →08/89	MVB1120R5	5PK1120
				☼	A/C(-), 08/89→	MVB1100R5	5PK1100
				☼	A/C(+)	MVB1215R5	5PK1215
				☼		MVB788R5	5PK788
		49	08/89 → 06/92	☼	MS	SVB13950	13x950
				☼		TB473	177x25.4
				☼		TBK052	
				☼	A/C(-)	MVB1100R5	5PK1100
☼		MVB1215R5	5PK1215				

COROLLA Verso (_E12J_)

1.4 VVT-i	4ZZ-FE	71	01/02 → 05/04	☼	A/C(-)	MVB1400R6	6PK1400
				☼	A/C(+)	MVB1675R6	6PK1675
1.6 VVT-i	3ZZ-FE	81	01/02 → 05/04	☼		MVB1538R6	6PK1538
				☼	→03/02	MVB1820R6	6PK1820
1.8 VVT-i	1ZZ-FE	99	01/02 → 05/04	☼		MVB1530R6	6PK1530
				☼	→03/02	MVB1820R6	6PK1820
2.0 D-4D	1CD-FTV	66	01/02 → 05/04	☼		MVB887R5	5PK887
				☼		TB655	178x25
				☼	A/C(-)	MVB1110R5	5PK1110
				☼	A/C(+)	MVB1188R5	5PK1188



kW



...TOYOTA

COROLLA Verso (ZER_, ZZE_)

1.6	3ZZ-FE	81	04/04 →		A/C(-)	MVB1560R6	6PK1560
					A/C(+)	MVB1875R6	6PK1875
1.8	1ZZ-FE	95	04/04 →		A/C(-)	MVB1560R6	6PK1560
					A/C(+)	MVB1875R6	6PK1875
2.0 D-4D	1CD-FTV	85	04/04 →		->08/05	MVB887R5	5PK887
					->08/05	TB655	178x25
					A/C(-), ->08/05	MVB1110R5	5PK1110
					A/C(+), ->08/05	MVB1255R5	5PK1255
2.2 D-4D	2AD-FHV	130	10/05 →			MVB2000R7	7PK2000
	2AD-FTV	100	10/05 →			MVB2000R7	7PK2000

COROLLA Wagon (_E11_)

1.4 (EE111_)	4E-FE	63	04/97 → 02/00		->09/99	MVB825R4	4PK825
					->09/99	TB428	124x26
					A/C(-), ->09/99	MVB887R5	5PK887
					A/C(+), ->09/99	MVB1050R5	5PK1050
1.4 16V (ZZE111_)	4ZZ-FE	71	02/00 → 01/02		A/C(-)	MVB1538R6	6PK1538
					A/C(-)	MVB1560R6	6PK1560
					A/C(+)	MVB1820R6	6PK1820
					A/C(+)	MVB1842R6	6PK1842
1.6 (AE111_)	4A-FE	81	04/97 → 02/00			MVB850R4	4PK850
						MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
1.6 16V (ZZE112_)	3ZZ-FE	81	02/00 → 01/02		A/C(-)	MVB1538R6	6PK1538
					A/C(-)	MVB1560R6	6PK1560
					A/C(+)	MVB1820R6	6PK1820
					A/C(+)	MVB1842R6	6PK1842
1.6 Aut. (AE111_)	4A-FE	79	04/97 → 02/00			MVB850R4	4PK850
						MVB970R5	5PK970
						TB445	117x21
						MVB630R3	3PK630
1.8 AWD (AE115_)	7A-FE	81	04/97 → 01/02		10/97 →	MVB850R4	4PK850
					10/97 →	MVB970R5	5PK970
					10/97 →	TB435	121x21
					10/97 →	MVB630R3	3PK630
1.9 D (WZE110_)	1WZ	51	02/00 → 01/02		A/C(-)	MVB1488R6	6PK1488
					A/C(+)	MVB1775R6	6PK1775
						TB631	140x25.4
						TBK105	
2.0 D (CE110_)	2C-E	53	04/97 → 02/00		->09/99	SVB13950	13x950
					->09/99	TB473	177x25.4
					->03/99	TBK052	
					A/C(-), ->09/99	MVB1110R5	5PK1110
					A/C(+), ->09/99	MVB1188R5	5PK1188
2.0 D-4D	1CD-FTV	66	09/00 → 01/02		11/01 →	MVB887R5	5PK887
					11/01 →	TB655	178x25
					11/01 →	MVB1110R5	5PK1110

COROLLA Wagon (_E10_)

1.3 12V (EE100_)	2E	53	07/92 → 05/95		MS, ->05/93	MVB875R5	5PK875
					MS, 05/93 →	MVB887R5	5PK887
						MVB825R4	4PK825
						TB263	123x24
						TBK359	
					A/C(-)	MVB915R5	5PK915
					A/C(+), ->05/93	MVB1073R5	5PK1073
					A/C(+), 05/93 →	MVB1090R5	5PK1090



kw



TOYOTA

...TOYOTA

...COROLLA Wagon (_E10_)

1.3 XLI (EE101_)	4E-FE	55	09/95 → 04/97	☼ ⊖ ☺ ☺ ☺	MS A/C(-), →05/96 A/C(-), 05/96→ A/C(+)	MVB887R5 MVB825R4 TB428 MVB915R5 MVB906R5 MVB1090R5	5PK887 4PK825 124x26 5PK915 5PK906 5PK1090
1.3 XLI 16V (EE101_)	4E-FE	65	07/92 → 09/95	☼ ☼ ⊖ ☺ ☺ ☺ ☺	MS, →05/93 MS, 05/93→ A/C(-) A/C(+), →05/93 A/C(+), 05/93→	MVB875R5 MVB887R5 MVB825R4 TB428 MVB915R5 MVB1073R5 MVB1090R5	5PK875 5PK887 4PK825 124x26 5PK915 5PK1073 5PK1090
1.6 Si (AE101_)	4A-FE	84	07/92 → 04/97	☼ ⊖ ☺ ☺		MVB860R4 MVB970R5 TB445 MVB630R3	4PK860 5PK970 117x21 3PK630
1.8 16V 4WD (AE103_)	7A-FE	81	09/95 → 04/97	☼ ⊖ ☺ ☺		MVB860R4 MVB970R5 TB435 MVB630R3	4PK860 5PK970 121x21 3PK630
2.0 D (CE100_)	2C	53	07/92 → 04/97	☼ ⊖ ☺ ☺ ☺ ☺ ☺	MS A/C(-) A/C(+)	MVB1120R5 SVB13950 TB473 TBK052 MVB1100R5 MVB1188R5	5PK1120 13x950 177x25.4 5PK1100 5PK1188

CRESSIDA Saloon (_X6_)

2.0 (RX60)	21R, 21R-C	77	05/81 → 03/85	☼ ⊖ ☺		SVB13825 SVB10875 SVB131125	13x825 10x875 13x1125
2.0 GLI	1G-E	80	11/82 → 12/84	⊖ ⊖ ☺	08/83→	SVB101125 MVB1100R4 TB567	10x1125 4PK1100 111x25.4
2.2 D (LX60)	L	49	09/80 → 07/84	⊖ ☺ ☺ ☺ ☺ ☺	→05/82 05/82→ 05/82→	SVB131000 TB172 TB187 TBK064 SVB13825	13x1000 127x25.4 130x25.4 13x825

CRESSIDA Station Wagon (X6K)

2.0	21R	77	02/81 → 03/85	☼ ⊖ ☺		SVB13825 SVB10875 SVB131125	13x825 10x875 13x1125
2.2 D	L	49	06/81 → 03/85	⊖ ☺ ☺ ☺ ☺ ☺	→07/84 →05/82 05/82→07/84 05/82→07/84 →07/84	SVB131000 TB172 TB187 TBK064 SVB13825	13x1000 127x25.4 130x25.4 13x825

CROWN Saloon (_S1_)

2.2 D (LS110_)		53	04/80 → 07/83	☼ ⊖ ☺ ☺ ☺ ☺	→05/82 05/82→ 05/82→	SVB131275 SVB131000 TB172 TB187 TBK064 SVB13825	13x1275 13x1000 127x25.4 130x25.4 13x825
2.8 i Super Saloon (S12)	5M-GE	125	02/84 → 03/85	☼ ⊖ ☺		SVB131400 SVB13950 MVB920R7 TB310 SVB131200	13x1400 13x950 7PK920 169x25.4 13x1200





kW



...TOYOTA

...CROWN Saloon (_S1_)

2.8 SI (MS112)	5M, 5M-E	107	04/80 → 07/83	⚙ ⚙ ⚙		SVB13950	13x950
						SVB10925	10x925
						SVB131225	13x1225

DYNA Bus

3.4 D	13B	66	08/77 → 08/87	⚙ ⚙	09/84 →	SVB131025	13x1025
					09/84 →	SVB171205	17x1205

DYNA Flatbed / Chassis

2.0	5R	72	08/77 → 08/84	⚙	Alt. 30A	SVB13925	13x925
				⚙	Alt. 40A	SVB13950	13x950
	3Y	79	09/84 → 08/87	⚙		SVB13875	13x875
				⚙ ⚙	08/85 →	MVB825R5	5PK825
2.4 D	2J	55	09/84 → 08/87	⚙	08/85 →	MVB830R5	5PK830
				⚙	08/85 →	SVB131100	13x1100
				⚙ ⚙ ⚙ ⚙	08/85 →	SVB131250	13x1250
				⚙ ⚙ ⚙ ⚙	08/85 →	SVB10975	10x975
3.4 D	13B	66	09/84 → 08/87	⚙	08/85 →	TB187	130x25.4
				⚙ ⚙ ⚙ ⚙	08/85 →	TBK064	
				⚙	RHD, 08/85 →	SVB13850	13x850
				⚙		SVB131025	13x1025
				⚙		SVB171205	17x1205

HIACE II Box (H5_)

1.8	2Y	58	03/83 → 11/89	⚙	→07/87	SVB13925	13x925
				⚙	→07/87	SVB13950	13x950
				⚙	→07/87	MVB835R4	4PK835
				⚙	→07/87	SVB131050	13x1050
2.0	3Y	65	01/84 → 11/89	⚙		SVB13925	13x925
				⚙		SVB13950	13x950
				⚙		MVB835R4	4PK835
				⚙		SVB131050	13x1050
2.2 D	L	49	03/83 → 11/89	⚙	→03/84	SVB131250	13x1250
				⚙	→03/84	SVB10975	10x975
				⚙ ⚙ ⚙ ⚙	→08/85	TB187	130x25.4
				⚙ ⚙ ⚙ ⚙	→03/84	TBK064	
2.4 D	2L	55	05/84 → 11/89	⚙	→03/84	SVB13825	13x825
				⚙		SVB131250	13x1250
				⚙		SVB10975	10x975
				⚙ ⚙ ⚙ ⚙		SVB10990	10x990
				⚙		TB187	130x25.4
				⚙ ⚙ ⚙ ⚙		TBK064	
				⚙		SVB13825	13x825
				⚙		SVB13875	13x875

HIACE II Wagon (H5_)

1.8 (H5G)	2Y	58	03/83 → 11/89	⚙	→07/87	SVB13925	13x925
				⚙	→07/87	SVB13950	13x950
				⚙	→07/87	MVB835R4	4PK835
				⚙	→07/87	SVB131050	13x1050
2.0 (H5G)	3Y	65	01/85 → 08/89	⚙		SVB13925	13x925
				⚙		SVB13950	13x950
				⚙		MVB835R4	4PK835
				⚙		SVB131050	13x1050
2.2 D (H5G)	L	49	03/83 → 11/89	⚙	→03/84	SVB131250	13x1250
				⚙	→03/84	SVB10975	10x975
				⚙ ⚙ ⚙ ⚙	→08/85	TB187	130x25.4
				⚙ ⚙ ⚙ ⚙	→03/84	TBK064	
				⚙	→03/84	SVB13825	13x825



kW



TOYOTA

...TOYOTA

...HIACE II Wagon (H5_)

2.4 D (H5G)	2L	55	08/84 → 08/89	 	SVB131250 SVB10975 SVB10990 TB187 TBK064 SVB13825 SVB13875	13x1250 10x975 10x990 130x25.4 13x825 13x875
2.4 D 4WD (H5F)		54	01/87 → 01/88	 	SVB131250 SVB10975 SVB10990 TB187 TBK064 SVB13825 SVB13875	13x1250 10x975 10x990 130x25.4 13x825 13x875

HIACE III Box (_H10_)

2.0	1RZ	74	02/90 → 08/95	 	MVB865R5 SVB131125	5PK865 13x1125
2.4	2RZ-E	88	08/89 → 08/95	 	MVB865R5 SVB131125	5PK865 13x1125
2.4 4WD	2RZ-E	88	08/89 → 08/95	 	MVB865R5 SVB131125	5PK865 13x1125
2.4 D 4WD	2L	55	08/89 → 08/95	 	TB314 TBK068 MVB835R4	129x31 4PK835
2.4 Diesel	2L	55	02/90 → 08/95	 	SVB131050 TB314 TBK068 SVB13850	13x1050 129x31 13x850

HIACE III Wagon (_H10_)

2.0 (RZH102)	1RZ	74	08/89 → 08/95	 	MVB865R5 SVB131125	5PK865 13x1125
2.4 (RZH103)	2RZ-E	88	08/89 → 08/95	 	MVB865R5 SVB131125	5PK865 13x1125
2.4 4WD	2RZ-E	88	08/89 → 08/95	 	MVB865R5 SVB131125	5PK865 13x1125
2.4 D	2L	57	10/93 → 08/95	 	SVB131050 TB314 TBK068 SVB13850	13x1050 129x31 13x850
2.4 D (LH102)	2L	55	08/89 → 08/95	 	SVB131050 TB314 TBK068 SVB13850	13x1050 129x31 13x850
2.4 D 4WD	2L	55	08/89 → 08/95	 	SVB131050 TB314 TBK068 MVB835R4	13x1050 129x31 4PK835

HIACE IV Box (_H1_, _H2_)

2.4 (RCH12_, RCH22_)	2RZ-E	85	08/95 → 04/98	 	MVB860R4 MVB865R5 SVB131125	4PK860 5PK865 13x1125	
2.4 4WD (RCH18_, RCH28_)	2RZ-E	85	08/95 → 04/98	 	MVB860R4 MVB865R5 SVB131125	4PK860 5PK865 13x1125	
2.4 D (LXH12_, LXH22_)	2L	58	08/95 →	 	→08/01 →08/01 →08/01 →08/01 →08/01	SVB131225 SVB131050 TB314 TBK068 MVB775R4	13x1225 13x1050 129x31 4PK775





kW



TOYOTA

...TOYOTA

...HIACE IV Box (_H1_, _H2_)

2.4 TD (LXH12_, LXH22_)	2L-T	66	08/95 →	⊛	→08/01	SVB131225	13x1225
				⊗	→08/01	SVB131050	13x1050
				⊞	→08/01	TB314	129x31
				⊞KIT	→08/01	TBK068	
				⊛	→08/01	MVB775R4	4PK775
2.4 TD 4WD (LXH18_, LXH28_)	2L-T	66	08/95 →	⊛	→08/01	SVB131225	13x1225
				⊗	→08/01	SVB131050	13x1050
				⊞	→08/01	TB314	129x31
				⊞KIT	→08/01	TBK068	
				⊛	→08/01	MVB775R4	4PK775
2.5 D-4D	2KD-FTV	65	11/01 →	⊗	A/C(-), →08/06	MVB1090R7	7PK1090
				⊗	A/C(+), →08/06	MVB1475R7	7PK1475
				⊞	→08/06	TB687	97x25
		75	11/01 →	⊗	A/C(-), →08/06	MVB1090R7	7PK1090
				⊗	A/C(+), →08/06	MVB1475R7	7PK1475
				⊞	→08/06	TB687	97x25
2.5 D-4D 4WD		75	11/01 →	⊗	A/C(-), →08/06	MVB1090R7	7PK1090
				⊗	A/C(+), →08/06	MVB1475R7	7PK1475
				⊞	→08/06	TB687	97x25
2.7 (RCH13_, RCH23_)	3RZ-FE	105	04/98 →	⊛	→06/05	MVB940R4	4PK940
				⊗	→06/05	MVB865R5	5PK865
				⊛	→06/05	MVB1100R4	4PK1100
2.7 4WD (RCH19_, RCH29_)	3RZ-FE	105	04/98 →	⊛	→06/05	MVB940R4	4PK940
				⊗	→06/05	MVB865R5	5PK865
				⊛	→06/05	MVB1100R4	4PK1100

HIACE IV Wagon (_H1_, _H2_)

2.4 (RCH12_, RCH22_)	2RZ-E	85	08/95 → 04/98	⊛		MVB860R4	4PK860
				⊗		MVB865R5	5PK865
				⊛		SVB131125	13x1125
2.4 4WD (RCH18_)	2RZ-E	85	08/95 → 04/98	⊛		MVB860R4	4PK860
				⊗		MVB865R5	5PK865
				⊛		SVB131125	13x1125
2.4 D	2L	58	08/95 →	⊛	→08/01	SVB131225	13x1225
				⊗	→08/01	SVB131050	13x1050
				⊞	→08/01	TB314	129x31
				⊞KIT	→08/01	TBK068	
				⊛	→08/01	MVB775R4	4PK775
		55	07/99 →	⊛	→08/01	SVB131225	13x1225
				⊗	→08/01	SVB131050	13x1050
				⊞	→08/01	TB314	129x31
				⊞KIT	→08/01	TBK068	
				⊛	→08/01	MVB775R4	4PK775
2.4 TD (LXH12_, LXH22_)	2L-T	66	08/95 →	⊛	→08/01	SVB131225	13x1225
				⊗	→08/01	SVB131050	13x1050
				⊞	→08/01	TB314	129x31
				⊞KIT	→08/01	TBK068	
				⊛	→08/01	MVB775R4	4PK775
2.4 TD 4WD (H18/28)	2L-T	66	08/95 →	⊛	→08/01	SVB131225	13x1225
				⊗	→08/01	SVB131050	13x1050
				⊞	→08/01	TB314	129x31
				⊞KIT	→08/01	TBK068	
				⊛	→08/01	MVB775R4	4PK775



kW



TOYOTA

...TOYOTA

...HIACE IV Wagon (_H1_, _H2_)

2.5 D-4D	2KD-FTV	65	11/01 →		A/C(-), →08/06	MVB1090R7	7PK1090
					A/C(+), →08/06	MVB1475R7	7PK1475
					→08/06	TB687	97x25
		75	11/01 →		A/C(-), →08/06	MVB1090R7	7PK1090
					A/C(+), →08/06	MVB1475R7	7PK1475
					→08/06	TB687	97x25
		70	08/06 →		A/C(-)	MVB1090R7	7PK1090
					A/C(+)	MVB1475R7	7PK1475
						TB687	97x25
		86	08/06 →		A/C(-)	MVB1090R7	7PK1090
					A/C(+)	MVB1475R7	7PK1475
						TB687	97x25
2.7	3RZ-FE	106	11/01 →		→06/05	MVB940R4	4PK940
					→06/05	MVB865R5	5PK865
					→06/05	MVB1100R4	4PK1100
2.7 (RCH13_, RCH23_)	3RZ-FE	105	04/98 → 11/01			MVB940R4	4PK940
						MVB865R5	5PK865
						MVB1100R4	4PK1100
2.7 4WD (RCH19_)	3RZ-FE	105	04/98 →		→06/05	MVB940R4	4PK940
					→06/05	MVB865R5	5PK865
					→06/05	MVB1100R4	4PK1100

HILUX Pickup

2.5 D		88	12/07 →		A/C(-)	MVB1090R7	7PK1090
						TB687	97x25
2.5 D 4x4		75	08/05 →		A/C(-)	MVB1090R7	7PK1090
						TB687	97x25
		88	12/07 →		A/C(-)	MVB1090R7	7PK1090
						TB687	97x25
3.0 D 4x4		126	12/07 →		A/C(-)	MVB1090R7	7PK1090
						TB687	97x25

HILUX Pickup (_N_)

1.8 (YN85_, YN90_)	2Y	61	08/88 → 07/94			SVB13875	13x875
						MVB835R4	4PK835
						SVB131050	13x1050
2.0	3Y	65	01/84 → 12/86			SVB13875	13x875
						MVB835R4	4PK835
						SVB131050	13x1050
2.2 4WD (YN106_, YN110_)	4Y	69	01/87 → 12/89			SVB13875	13x875
						MVB835R4	4PK835
						SVB131050	13x1050



kW



...TOYOTA

...HILUX Pickup (_N_)

2.4 D	2L	59	01/92 →	⊗	MS, →07/97	SVB131275	13x1275		
				⊗	PS, →07/97	SVB131200	13x1200		
				⊗	→07/97	SVB131050	13x1050		
				⊗	→07/97	TB314	129x31		
				⊗ KIT	→07/97	TBK068			
				⊗	LHD, →07/97	SVB13875	13x875		
	58	03/95 →	58	03/95 →	⊗	RHD, →07/97	SVB13825	13x825	
					⊗	MS, →07/97	SVB131275	13x1275	
					⊗	PS, →07/97	SVB131200	13x1200	
					⊗	→07/97	SVB131050	13x1050	
					⊗	→07/97	TB314	129x31	
					⊗ KIT	→07/97	TBK068		
61	08/88 →	61	08/88 →	⊗	LHD, →07/97	SVB13875	13x875		
				⊗	RHD, →07/97	SVB13825	13x825		
				⊗	MS, →07/97	SVB131275	13x1275		
				⊗	PS, →07/97	SVB131200	13x1200		
				⊗	→07/97	SVB131050	13x1050		
				⊗	→07/97	TB314	129x31		
55	07/98 → 01/02	55	07/98 → 01/02	⊗ KIT	→07/97	TBK068			
				⊗	LHD, →07/97	SVB13875	13x875		
				⊗	RHD, →07/97	SVB13825	13x825		
				⊗	MS, →07/97	SVB131275	13x1275		
				⊗	PS, →07/97	SVB131200	13x1200		
				⊗	→07/97	SVB131050	13x1050		
2.4 D 4WD	2L	58	01/94 →	⊗	→07/01	SVB131200	13x1200		
				⊗	→07/01	SVB131050	13x1050		
				⊗	→07/01	TB314	129x31		
				⊗ KIT	→07/01	TBK068			
				⊗	LHD, →07/01	SVB13875	13x875		
				⊗	RHD, →07/01	SVB13825	13x825		
	61	08/88 →	61	08/88 →	⊗	MS, →07/97	SVB131275	13x1275	
					⊗	PS, →07/97	SVB131200	13x1200	
					⊗	→07/97	SVB131050	13x1050	
					⊗	→07/97	TB314	129x31	
					⊗ KIT	→07/97	TBK068		
					⊗	LHD, →07/97	SVB13875	13x875	
2.4 D AWD	2L	55	01/84 → 08/88	⊗	RHD, →07/97	SVB13825	13x825		
				⊗	MS, →07/97	SVB131275	13x1275		
				⊗	PS, →07/97	SVB131200	13x1200		
				⊗	→07/97	SVB131050	13x1050		
				⊗	→07/97	TB314	129x31		
				⊗ KIT	→07/97	TBK068			
	2.4 i 4WD	22R	84	06/89 →	⊗	LHD, →07/97	SVB13875	13x875	
					⊗	RHD, →07/97	SVB13825	13x825	
					⊗	MS, →07/97	SVB131275	13x1275	
		2RZ-FE	103	08/97 →	08/97 →	⊗	PS, →07/97	SVB131200	13x1200
						⊗	→07/97	SVB131050	13x1050
						⊗	→07/97	TB314	129x31
2.4 TD 4WD	2L-T	66	08/98 → 01/02	⊗ KIT	→07/97	TBK068			
				⊗	LHD, →07/97	SVB13875	13x875		
				⊗	RHD, →07/97	SVB13825	13x825		
				⊗	MS, →07/97	SVB131275	13x1275		
				⊗	PS, →07/97	SVB131200	13x1200		
				⊗	→07/97	SVB131050	13x1050		
2.5 D-4D	2KD-FTV	65	11/01 →	⊗	→07/01	TB314	129x31		
				⊗	→07/01	TBK068			
				⊗	→07/01	SVB131200	13x1200		
				⊗	→07/01	SVB131050	13x1050		
				⊗	→07/01	SVB131275	13x1275		
				⊗	→07/01	SVB131200	13x1200		
2.5 D-4D	2KD-FTV	65	11/01 →	⊗	→07/01	SVB131050	13x1050		
				⊗	→07/01	TB314	129x31		
				⊗ KIT	→07/01	TBK068			
2.5 D-4D	2KD-FTV	65	11/01 →	⊗	LHD, →07/01	SVB13875	13x875		
				⊗	RHD, →07/01	SVB13825	13x825		
				⊗	A/C(-)	MVB1090R7	7PK1090		
2.5 D-4D	2KD-FTV	65	11/01 →	⊗	A/C(+), →07/05	MVB1475R7	7PK1475		
				⊗		TB687	97x25		



kW



TOYOTA

...TOYOTA

...HILUX Pickup (_N_)

2.5 D-4D 4WD	2KD-FTV	75	11/01 →		A/C(-), →07/05	MVB1090R7	7PK1090
					A/C(+), →07/05	MVB1475R7	7PK1475
					→07/05	TB687	97x25

LAND CRUISER (_J4_)

3.0 D (BJ40_V, BJ43_)	B	59	02/74 → 10/84		→07/80	SVB171205	17x1205
3.4 D (BJ42_V, BJ45_V, BJ46_)	3B	66	08/80 → 10/84		→10/83	SVB171205	17x1205
3.9 (FJ40_, FJ43_, FJ45_, FJ55_V)	F	96	03/69 → 01/75		Not Alt. 55A, 03/72 →	SVB171055	17x1055
4.2 (FJ40_V, FJ43_, FJ45_V, FJ55_)	2F	89	01/75 → 04/86		→07/80	SVB131075	13x1075

LAND CRUISER (_J6_)

3.4 Diesel (BJ60_V)	3B	66	10/81 → 08/87		11/84 →	SVB131025	13x1025
					11/84 →	SVB171500	17x1500
4.0 (FJ62_G)	3F-E	115	08/87 → 12/89			SVB131175	13x1175
						SVB171055	17x1055
4.0 Diesel (HJ60)	2H	74	01/82 → 12/85			SVB131400	13x1400
					11/84 →	SVB131375	13x1375
					AUTO	SVB171115	17x1115
						SVB17850	17x850
		76	01/85 → 12/87		→10/85	SVB131375	13x1375
					10/85 →	SVB131400	13x1400
					AUTO	SVB171115	17x1115
					→10/85	SVB17850	17x850
4.0 Turbo-D (HJ61_V)	12HT	100	10/85 → 12/89		08/87 →	SVB131400	13x1400
					08/87 →	SVB171115	17x1115

LAND CRUISER (_J7_)

2.4 (RJ70_V, RJ73_V)	22RE	84	12/88 → 12/96		→03/96	SVB10875	10x875
					→03/96	SVB131125	13x1125
2.4 (RJ70_, RJ73_)	22R	77	11/84 → 05/93			SVB10875	10x875
						SVB131125	13x1125
		81	11/84 → 05/93			SVB10875	10x875
						SVB131125	13x1125
2.4 D (LJ70_)	2L	53	11/84 → 10/85			SVB131200	13x1200
						SVB10975	10x975
						TB187	130x25.4
						TBK064	
						SVB13875	13x875
2.4 TD (LJ70)	2L-T	66	01/90 → 05/93			SVB131200	13x1200
						SVB131050	13x1050
						TB314	129x31
						TBK068	
						SVB13875	13x875
2.4 TD (LJ70_, LJ73_)	2L-T	63	10/85 → 05/90			SVB131200	13x1200
					→01/90	SVB10975	10x975
					01/90 →	SVB131050	13x1050
					→01/90	TB187	130x25.4
					01/90 →	TB314	129x31
					→01/90	TBK064	
					01/90 →	TBK068	
						SVB13875	13x875
3.0 TD (KZJ70_, KZJ73_, KZJ77_)	1KZ-T	92	05/93 → 05/96			SVB131175	13x1175
						SVB131000	13x1000
						TB447	102x25
3.4 D (BJ70_V, BJ73_)	3B	70	11/84 → 12/96		→08/88	SVB131025	13x1025
					08/88 → 12/89	SVB131050	13x1050
					→12/89	SVB171500	17x1500
3.4 TD (BJ71_V)	13BT	91	10/85 → 08/86			SVB131025	13x1025
						SVB171205	17x1205
						SVB171500	17x1500



kW



...TOYOTA

...LAND CRUISER (_J7_)

4.2 TD (HZJ7_V)	1H-Z	96	01/90 →	⚙️ ⚙️ ⚙️ ⚙️	→08/01 →08/01 →05/98 04/96→08/01	SVB131275 SVB101000 TB285 TB695	13x1275 10x1000 94x25.4 92x25
-----------------	------	----	---------	----------------------	---	--	--

LAND CRUISER (J12)

3.0 D-4D	1KD-FTV	120	01/03 →	⚙️	A/C(-), extra heating (-)	MVB1150R7	7PK1150
				⚙️	A/C(-), extra heating (+)	MVB1813R7	7PK1813
				⚙️	A/C(+), extra heating (-)	MVB1638R7	7PK1638
				⚙️	A/C(+), extra heating (+)	MVB1933R7	7PK1933
122	01/05 →	⚙️ ⚙️ ⚙️ ⚙️	⚙️	A/C(-), extra heating (-)	MVB1150R7	7PK1150	
			⚙️	A/C(-), extra heating (+)	MVB1813R7	7PK1813	
			⚙️	A/C(+), extra heating (-)	MVB1638R7	7PK1638	
			⚙️	A/C(+), extra heating (+)	MVB1933R7	7PK1933	
127	01/07 →	⚙️ ⚙️ ⚙️ ⚙️	⚙️	A/C(-), extra heating (-)	MVB1150R7	7PK1150	
			⚙️	A/C(-), extra heating (+)	MVB1813R7	7PK1813	
			⚙️	A/C(+), extra heating (-)	MVB1638R7	7PK1638	
			⚙️	A/C(+), extra heating (+)	MVB1933R7	7PK1933	
				⚙️	TB687	97x25	

LAND CRUISER 80 (_J8_)

4.0 (FJ80_)	3F-E	115	01/90 → 08/92	⚙️ ⚙️		SVB131175 SVB171055	13x1175 17x1055
4.2 D (HZJ80_)	1H-Z	99	01/90 → 12/97	⚙️ ⚙️ ⚙️		SVB131275 SVB101000 TB285	13x1275 10x1000 94x25.4
4.2 TD (HDJ80)	1HD-T	123	01/90 → 12/97	⚙️ ⚙️		SVB131275 SVB101000	13x1275 10x1000
				⚙️ ⚙️		TB285 TB285	94x25.4 94x25.4
118	10/92 → 12/97	⚙️ ⚙️	⚙️		SVB131275	13x1275	
			⚙️		SVB101000	10x1000	
				⚙️		TB285	94x25.4
4.2 TD 24V (HDJ80_)	1HD-FT	125	03/95 → 12/97	⚙️ ⚙️		SVB131275 SVB101000	13x1275 10x1000

LAND CRUISER 90 (_J9_)

3.0 D-4D	1KD-FTV	120	10/00 →	⚙️	A/C(-), extra heating (-), →08/02	MVB1150R7	7PK1150
				⚙️	A/C(-), extra heating (+), →08/02	MVB1813R7	7PK1813
				⚙️	A/C(+), extra heating (-), →08/02	MVB1638R7	7PK1638
				⚙️	A/C(+), extra heating (+), →08/02	MVB1933R7	7PK1933
				⚙️	→08/02	TB687	97x25
3.0 TD (KZJ90_, KZJ95_)	1KZ-TE	92	04/96 →	⚙️	→07/00	SVB131175	13x1175
				⚙️	→07/00	SVB131000	13x1000
				⚙️	→07/00	TB447	102x25
3.4 i 24V (VZJ90_, VZJ95_)	5VZ-FE	131	04/96 →	⚙️	→08/02	MVB870R4	4PK870
				⚙️	→08/02	MVB1050R4	4PK1050
				⚙️	→08/02	TB729	191x36
				⚙️	→08/02	MVB1070R4	4PK1070

LAND CRUISER 100 (_J10_)

4.2 TD (HDJ100_)	1HD-FTE	150	01/98 →	⚙️ ⚙️	extra heating (-), →08/03 →08/03	MVB1238R4 SVB101000	4PK1238 10x1000
4.7	2UZ-FE	175	02/02 →	⚙️	A/C(+)	MVB2250R6	6PK2250
4.7 (UZJ100_)	2UZ-FE	173	01/98 →	⚙️	A/C(+)	MVB2250R6	6PK2250



kw



TOYOTA

...TOYOTA

LAND CRUISER Hardtop (_J7_)

2.4 TD (LJ77)	2L-T	66	07/90 → 05/96	☼ ⊖ ☼ ☼ ☼ ☼	→01/95 →01/95 →01/95 →01/95 →01/95	SVB131200 SVB131050 TB314 TBK068 SVB13875	13x1200 13x1050 129x31 13x875
3.0 TD	1KZ-T	92	05/93 → 05/96	☼ ⊖ ☼		SVB131175 SVB131000 TB447	13x1175 13x1000 102x25

LAND CRUISER Pickup (_J4_)

3.4 D (BJ45_P)	3B	66	08/80 → 10/84	⊖	→10/83	SVB171205	17x1205
3.9 (FJ45_P)	F	96	03/69 → 01/75	⊖	Not Alt. 55A, 03/72→	SVB171055	17x1055
4.2 (FJ45_P)	2F	89	01/75 → 04/86	⊖	→07/80	SVB131075	13x1075

LITEACE Box (_R2_V)

1.5 (KR27_V)	5K	52	01/92 → 01/95	⊖		SVB10875	10x875
2.0 D (CR27_V)	2C	51	01/92 → 05/94	⊖ ☼ ☼ ☼		SVB131000 TB473 TBK052 MVB800R3	13x1000 177x25.4 3PK800
2.2 (YR29LV)	4Y-EC	72	01/92 → 01/95	⊖ ☼	→03/93 03/93→	MVB838R3 MVB825R5 SVB131050	3PK838 5PK825 13x1050

LITEACE Box (CM3_V, KM3_V)

1.5 (KM31_V, KM36_V)	5K	51	05/86 → 09/91	☼ ⊖ ⊖		SVB13975 SVB10875 SVB10850	13x975 10x875 10x850
1.8 D (CM35_V)	1C	46	10/85 → 08/88	⊖ ⊖ ☼ ☼ ☼	Alt. 30A, →08/88 →08/86 08/86→	SVB13975 SVB131000 TB473 TBK052	13x975 13x1000 177x25.4
2.0 D (CM36_V)	2C	53	08/88 → 01/92	⊖ ☼ ☼ ☼		SVB131000 TB473 TBK052	13x1000 177x25.4

LITEACE Box (M2_V)

1.3	4K, 4K-C	42	10/79 → 10/86	⊖ ⊖	→10/82 10/82→09/85	SVB10840 SVB10875	10x840 10x875
-----	----------	----	---------------	--------	-----------------------	----------------------	------------------

LITEACE Bus (_R2_LG)

1.5 (KR21LG)	5K	52	01/92 → 01/95	⊖		SVB10875	10x875
2.0 D (CR21LG)	2C	53	01/92 → 05/94	⊖ ☼ ☼ ☼		SVB131000 TB473 TBK052 MVB800R3	13x1000 177x25.4 3PK800
2.2 (YR22LG)	4Y-EC	72	01/92 → 01/95	⊖ ☼	→03/93 03/93→	MVB838R3 MVB825R5 SVB131050	3PK838 5PK825 13x1050

LITEACE Bus (CM30_G, KM30_G)

1.5 (KM30LG)	5K	51	10/85 → 08/89	☼ ⊖ ⊖ ☼ ⊖		SVB13975 SVB10875 SVB10850 SVB13975 SVB10875	13x975 10x875 10x850 13x975 10x875
2.0 D (CM30LG)	2C	53	08/88 → 01/92	⊖ ☼ ☼ ☼		SVB131000 TB473 TBK052	13x1000 177x25.4

LITEACE Wagon (M2_G)

1.3	4K	43	10/79 → 09/85	⊖ ⊖	→10/82 10/82→	SVB10840 SVB10875	10x840 10x875
1.8 D	1C	41	10/82 → 09/85	☼ ☼ ☼		TB473 TBK052	177x25.4



kw



TOYOTA

...TOYOTA

MODELL F Bus (_R2_, 31)

1.8 4x4		58	11/82 → 07/86	 	08/83 → 08/83 → 08/85 08/85 → 08/83 →	SVB13900 MVB835R4 MVB825R5 SVB131050	13x900 4PK835 5PK825 13x1050
1.8 De Luxe (YR20)	2Y, 2Y-C	58	11/82 → 08/84	 	Eng. 2Y, 08/83 → 08/83 → Eng. 2Y, 08/83 →	SVB13900 MVB835R4 SVB131050	13x900 4PK835 13x1050
2.0 (YR21_G)	3Y	66	08/88 → 01/90	 		SVB13900 MVB825R5 SVB131050	13x900 5PK825 13x1050
2.0 D		49	04/85 → 08/88	 	LHD RHD → 08/86 08/86 →	SVB13825 MVB800R4 SVB13975 SVB131000 TB473 TBK052 MVB800R3	13x825 4PK800 13x975 13x1000 177x25.4 3PK800
2.0 Super (YR21)	3Y, 3Y-C	65	08/84 → 08/88	 	→ 08/85 08/85 →	SVB13900 MVB835R4 MVB825R5 SVB131050	13x900 4PK835 5PK825 13x1050
2.2 (YR22LG, YR31LG)	4Y-EC	72	08/87 → 01/90	 	08/88 → 08/88 → 08/88 →	SVB13900 MVB825R5 SVB131050	13x900 5PK825 13x1050

MR 2 (_W1_)

1.6 16V (AW11)	4A-GELC	85	11/84 → 06/90	 	→ 10/89 → 10/89 → 10/89	MVB790R4 MVB825R5 TB198	4PK790 5PK825 113x19
	4A-GEL	91	11/84 → 06/90	 	→ 10/89 → 10/89 → 10/89	MVB790R4 MVB825R5 TB198	4PK790 5PK825 113x19

MR 2 (_W2_)

2.0 16V	3S-GE	129	12/89 → 05/00	 	12/93 → 09/99 12/93 → 09/99 12/93 → 09/99	MVB875R4 MVB825R4 TB446	4PK875 4PK825 177x25
		125	12/89 → 05/00	 	12/93 → 09/99 12/93 → 09/99 12/93 → 09/99	MVB875R4 MVB825R4 TB446	4PK875 4PK825 177x25
2.0 16V (SW20)	3S-GE	115	12/89 → 05/00	 	→ 11/93 → 11/93 → 11/93	MVB875R4 MVB825R4 TB309	4PK875 4PK825 178x25.4

MR 2 (_W3_)

1.8 16V VT-i (ZZW30)	1ZZ-FE	103	04/00 →	 	A/C(-), → 09/05 A/C(+), → 09/05	MVB1400R6 MVB1690R6	6PK1400 6PK1690
----------------------	---------------	-----	---------	------	------------------------------------	--------------------------------------	--------------------

PASEO Convertible (EL54)

1.5 16V	5E-FE	66	10/96 → 03/99	 	AUTO MAN	MVB1080R4 MVB1100R4 MVB825R4 TB527 MVB940R4	4PK1080 4PK1100 4PK825 128x26 4PK940
---------	--------------	----	---------------	--------------	-------------	--	--

PASEO Coupe (EL54)

1.5 16V	5E-FE	66	08/95 → 07/99	 	AUTO, → 08/96 AUTO, 08/96 → MAN	MVB1125R4 MVB1080R4 MVB1100R4 MVB825R4 TB527 MVB940R4	4PK1125 4PK1080 4PK1100 4PK825 128x26 4PK940
---------	--------------	----	---------------	------------------	---------------------------------------	--	---



kw



TOYOTA

...TOYOTA

PICNIC (_XM10)

2.0	3S-FE	90	01/01 → 12/01	 	 A/C(-) A/C(+) 	MVB1225R5 MVB1000R5 MVB1090R5 TB311 TBK360 MVB760R3	5PK1225 5PK1000 5PK1090 163x26.7 3PK760
2.0 16V (SXM10_)	3S-FE	94	05/96 → 12/01	 	 A/C(-) A/C(+), →07/98 A/C(+), 07/98→ 	MVB1225R5 MVB1000R5 MVB1090R5 MVB1090R5 TB311 TBK360 MVB760R3	5PK1225 5PK1000 5PK1090 5PK1090 163x26.7 3PK760
2.2 D (GMX10_)	3C-TE	66	08/97 → 12/01	 	 →04/01 →04/01 →04/01 A/C(-), →04/01 A/C(+), →04/01	SVB13950 TB473 TBK052 MVB1110R5 MVB1225R5	13x950 177x25.4 5PK1110 5PK1225

PREVIA (ACR3_)

2.0 D-4D	1CD-FTV	85	03/01 →	 	 →09/05 →09/05 A/C(-), →09/05 A/C(+), →09/05	MVB887R5 TB655 MVB1148R5 MVB1240R5	5PK887 178x25 5PK1148 5PK1240
2.4 16V	2AZ-FE	115	08/00 →	 	 A/C(-), →09/05 A/C(+), →09/05	MVB1588R7 MVB1920R7	7PK1588 7PK1920

PREVIA (TCR1_, 2_)

2.4	2TZ-FE	97	05/90 → 08/00	 	 →01/00 →01/00	MVB715R4 MVB825R6	4PK715 6PK825
2.4 4WD	2TZ-FE	97	05/90 → 08/00	 	 →01/00 →01/00	MVB715R4 MVB825R6	4PK715 6PK825

RAV 4 I (SXA1_)

2.0 16V	3S-FE	95	06/94 → 06/00	 	 A/C(-) A/C(+), →09/97 A/C(+), 09/97→ 	MVB1000R5 MVB1110R5 MVB1090R5 TB311 TBK360 MVB760R3	5PK1000 5PK1110 5PK1090 163x26.7 3PK760
---------	-------	----	---------------	----------------------	--	--	---

RAV 4 I Cabrio (SXA1_)

2.0 16V	3S-FE	94	12/97 → 06/00	 	 A/C(-) A/C(+) 	MVB1000R5 MVB1090R5 TB311 TBK360 MVB760R3	5PK1000 5PK1090 163x26.7 3PK760
---------	-------	----	---------------	------------------	----------------------------------	--	--

RAV 4 II (XA2)

1.8 VVTi	1ZZ-FE	92	02/01 →	 	 A/C(-), →10/05 A/C(+), →10/05	MVB1538R6 MVB1885R6	6PK1538 6PK1885
2.0 D-4D 4WD	1CD-FTV	85	09/01 →	 	 →10/05 →10/05 A/C(-), →10/05 A/C(+), →10/05	MVB887R5 TB655 MVB1120R5 MVB1188R5	5PK887 178x25 5PK1120 5PK1188
2.0 VVTi 4WD	1AZ-FE	110	06/00 →	 	 A/C(-), →10/05 A/C(+), →10/05	MVB1588R7 MVB1933R7	7PK1588 7PK1933

RAV 4 III (ACA_, ACE_)

2.0 VVT-i	1AZ-FE	112	03/06 →	 	 A/C(-) A/C(+)	MVB1588R7 MVB1920R7	7PK1588 7PK1920
2.2 D-4D	2AD-FTV	100	03/06 →		 A/C(+)	MVB1870R7	7PK1870
2.2 D-CAT	2AD-FHV	130	03/06 →		 A/C(+)	MVB1870R7	7PK1870
2.4 VVTi 4x4		125	11/05 →		 	MVB1910R7	7PK1910



kW



...TOYOTA

STARLET (_P7_)

1.0 (EP70L)	1E-L	40	10/84 → 12/89	 	→03/86 03/86→	MVB835R4 MVB810R4 TB362 TB334	4PK835 4PK810 121x20 121x24
1.3 (EP71L)	2E-LC	55	10/84 → 12/89	 KIT	→03/86 03/86→ 03/86→	MVB835R4 MVB810R4 TB667 TB263 TBK359	4PK835 4PK810 123x20 123x24
1.5 D (NP70L)	1N	40	12/86 → 12/89	 		SVB10775 TB262	10x775 127x25.4

STARLET (_P8_)

1.0 (EP80_)	1E	40	12/89 → 12/92	 		MVB860R4 MVB810R4 TB334	4PK860 4PK810 121x24
1.3 12V (EP81) CAT	2E-E	55	12/89 → 03/96	 KIT 	→12/93 12/93→	MVB860R4 MVB870R4 MVB810R4 TB263 TBK359 MVB925R4	4PK860 4PK870 4PK810 123x24
1.3 12V (EP81_)	2E, 2E-E	55	12/89 → 12/92	 KIT 		MVB860R4 MVB810R4 TB263 TBK359 MVB925R4	4PK860 4PK810 123x24
1.5 D (NP80_)	1N	40	12/89 → 03/96	 		SVB10775 TB262	10x775 127x25.4

STARLET (EP91)

1.3	4E-FE	55	04/96 → 03/99	 	MS A/C(-) A/C(+)	MVB875R4 MVB825R4 TB428 MVB920R4 MVB1090R4	4PK875 4PK825 124x26 4PK920 4PK1090
-----	-------	----	---------------	--------------	------------------------	---	---

SUPRA (JZA80)

3.0 i Bi-Turbo	2JZ-GTE	243	05/93 → 08/98	 		MVB1930R6 TB762	6PK1930 143x25.4
----------------	---------	-----	---------------	------	--	----------------------------------	---------------------

SUPRA (MA70)

3.0 24V	7M-GE	150	01/86 → 08/88	 		MVB920R4 MVB1285R5 MVB1300R5 TB597 MVB835R4	4PK920 5PK1285 5PK1300 159x25.4 4PK835
3.0 Turbo	7M-GTE	173	09/87 → 04/93	 		MVB920R4 MVB1285R5 MVB1300R5 TB597 MVB835R4	4PK920 5PK1285 5PK1300 159x25.4 4PK835
		175	08/88 → 05/93	 		MVB920R4 MVB1285R5 MVB1300R5 TB597 MVB835R4	4PK920 5PK1285 5PK1300 159x25.4 4PK835



kw



TOYOTA

...TOYOTA

TERCEL (_L1_, _L2_)

1.3 (AL20, AL11)	2A	48	03/79 → 01/88		→10/85	SVB13975	13x975
					A/C(-), V-belt pulley (+), →10/85	SVB10990	10x990
					A/C(+), V-belt pulley (+), →10/85	SVB101075	10x1075
					V-ribbed belt pulley (+), →10/85	MVB975R3	3PK975
					→10/85	TB171	88x19
					→10/85	SVB13800	13x800

TERCEL (AL2_)

1.5 4WD	3A	52	10/82 → 01/88			SVB13975	13x975
						MVB975R3	3PK975
					A/C(-)	SVB10990	10x990
					A/C(+)	SVB101075	10x1075
						TB171	88x19
						SVB13800	13x800
1.5 4WD (AL25)	3A-C	50	05/86 → 01/88			SVB13975	13x975
						MVB975R3	3PK975
					A/C(-)	SVB10990	10x990
					A/C(+)	SVB101075	10x1075
						TB171	88x19
						SVB13800	13x800

YARIS

1.0 VVT-i	1KR-FE	51	01/06 →		A/C(-)	MVB870R6	6PK870
					A/C(+)	MVB1215R6	6PK1215
1.3 VVT-i	2SZ-FE	64	01/06 →		A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1760R6	6PK1760
1.8 VVTi	2ZR-FE	98	01/07 →		A/C(+)	MVB915R6	6PK915

YARIS (_CP10)

1.0 16V	1SZ-FE	48	03/03 →		A/C(-), MS, →08/05	MVB780R6	6PK780
					A/C(-), PS, →08/05	MVB1708R4	4PK1708
					A/C(+), →08/05	MVB1775R4	4PK1775
1.0 16V (SCP10_)	1SZ-FE	50	04/99 →		A/C(-), MS, →08/05	MVB780R6	6PK780
					A/C(-), PS, →08/05	MVB1708R4	4PK1708
					A/C(+), →08/05	MVB1775R4	4PK1775
1.3	2SZ-FE	64	04/02 →		A/C(-), →08/05	MVB780R6	6PK780
					A/C(+), →08/05	MVB1768R6	6PK1768
1.3 16V (NCP10_)	2NZ-FE	63	11/99 →		A/C(-), →10/04	MVB920R4	4PK920
					A/C(+), →10/04	MVB1190R4	4PK1190
					→10/04	MVB850R3	3PK850
1.4 D-4D	1ND-TV	55	12/01 →		A/C(-), →08/05	MVB938R5	5PK938
					A/C(+), →08/05	MVB1188R5	5PK1188
					→08/05	MVB850R3	3PK850
1.5 TS (NCP13)	1NZ-FE	77	01/03 →		A/C(-), →08/05	MVB920R4	4PK920
					A/C(+), →06/03	MVB1190R4	4PK1190
					A/C(+), 06/03→08/05	MVB1165R4	4PK1165
					→08/05	MVB850R3	3PK850
1.5 VVT-i TS	1NZ-FE	78	04/01 →		A/C(-)	MVB920R4	4PK920
					A/C(+)	MVB1190R4	4PK1190
					→03/03	MVB850R3	3PK850

YARIS VERSO (NC/LP2_)

1.3 (NCP22)	2NZ-FE	63	11/99 →		A/C(-), →03/03	MVB920R4	4PK920
					A/C(+), →03/03	MVB1190R4	4PK1190
					→03/03	MVB850R3	3PK850
		62	01/03 →		A/C(-), →09/05	MVB920R4	4PK920
					A/C(+), →06/03	MVB1190R4	4PK1190
					A/C(+), 06/03→09/05	MVB1173R6	6PK1173
					→09/05	MVB850R3	3PK850



kW



...TOYOTA

...YARIS VERSO (NC/LP2_)

1.4 D-4D (NLP22)	1ND-TV	55	12/01 →		A/C(-), →09/05	MVB938R5	5PK938
					A/C(+), →09/05	MVB1188R5	5PK1188
					→09/05	MVB850R3	3PK850
1.5 (NCP21)	1NZ-FE	78	03/00 →		A/C(-), →03/03	MVB920R4	4PK920
					A/C(+), →03/03	MVB1190R4	4PK1190
					→03/03	MVB850R3	3PK850
		77	05/03 →		A/C(-), →09/05	MVB920R4	4PK920
					A/C(+), →06/03	MVB1190R4	4PK1190
					A/C(+), →09/05	MVB1165R4	4PK1165

UAZ

3160

2.4 i		76	01/94 →		→08/00	SVB101050	10x1050
-------	--	----	---------	--	--------	------------------	---------

31512

2.1 D		61	01/98 →		→02/02	TB319	144x25.4
					→02/02	TBK013	

VAUXHALL

AGILA

1.0 12V	Z 10 XE	43	09/00 →		A/C(-), →07/03	MVB1230R5	5PK1230
					A/C(+), →07/03	MVB1360R5	5PK1360
	Z 10 XEP	44	08/03 →		A/C(-), →04/08	MVB1230R5	5PK1230
					A/C(+), →04/08	MVB1360R5	5PK1360
1.2 16V	Z 12 XE	55	09/00 →		A/C(-), →07/04	MVB1230R5	5PK1230
					A/C(+), →07/04	MVB1360R5	5PK1360
1.2 16V Twinport	Z 12 XEP	59	07/04 →		A/C(-), →04/08	MVB1230R5	5PK1230
					A/C(+), →04/08	MVB1360R5	5PK1360
1.3 CDTI		55	01/08 →		A/C(-), 05/08 →	MVB1180R6	6PK1180
					A/C(+), 05/08 →	MVB1318R6	6PK1318

ANTARA

2.0 CDTI	Z 20 DMH	110	11/06 →			MVB2063R6	6PK2063
						TB800	151x22
2.4	Z 24 XED	104	11/06 →		A/C(+), PS	MVB1885R6	6PK1885
						TB524	171x24
3.2 V6	Z 32 SEE	165	11/06 →			MVB2403R6	6PK2403

ARENA Combi

1.9 D	F8Q 600, F8Q 606	44	03/98 → 08/01		09/98 → 04/01, → Eng Nr C014196	MVB1137R6	6PK1137
					09/98 → 04/01	TB545	153x25.4
					09/98 → 04/01	TBK098	
2.5 D	S8U 758, S8U 780, S8U 782	55	03/98 → 08/01		09/98 → 04/01	TB368	152x30
					09/98 → 04/01	TBK037	

ARENA Van

1.9 D	F8Q 600, F8Q 606	44	03/98 → 08/01		09/98 → 04/01, → Eng Nr C018102	MVB1137R6	6PK1137
					09/98 → 04/01	TB545	153x25.4
					09/98 → 04/01	TBK098	
2.5 D	S8U 758, S8U 780, S8U 782	55	03/98 → 08/01		09/98 → 04/01	TB368	152x30
					09/98 → 04/01	TBK037	

ASTRA Estate

1.3 S	13 S	55	09/79 → 08/84		05/80 →	SVB10875	10x875
					05/80 →	TB190	101x17



kW



VAUXHALL

...VAUXHALL

...ASTRA Estate

1.6 D	16 D	40	02/82 → 08/86		07/83 →	SVB10913	10x913
					AUTO, 07/83 →, → Eng Nr 14503756	TB178	147x24
					MAN, 07/83 →, Eng Nr 14498631 →	TB224	146x24
					AUTO, 07/83 →, → Eng Nr 14503756	TBK046	
					AUTO, 07/83 →, Eng Nr 14503757 →	TBK031	
					AUTO, 07/83 →, → Eng Nr 14503744	SVB10760	10x760
					AUTO, 07/83 →, Eng Nr 14503745 →	SVB10813	10x813
1.6 S	16 SH	66	09/81 → 08/86		MS, 07/82 →	SVB10888	10x888
					PS, 07/82 →	SVB10925	10x925
					07/82 →	TB155	111x20
					07/82 →	SVB10760	10x760

ASTRA Hatchback

1.2 S	12 S	44	02/82 → 08/84			SVB10950	10x950
1.3 S	13 S	55	09/79 → 08/84		05/80 →	SVB10875	10x875
					05/80 →	TB190	101x17
1.6 D	16 D	40	03/82 → 08/86		07/83 →	SVB10913	10x913
					AUTO, 07/83 →, → Eng Nr 14503756	TB178	147x24
					MAN, 07/83 →, Eng Nr 14498631 →	TB224	146x24
					AUTO, 07/83 →, → Eng Nr 14503756	TBK046	
					AUTO, 07/83 →, Eng Nr 14503757 →	TBK031	
					AUTO, 07/83 →, → Eng Nr 14503744	SVB10760	10x760
					AUTO, 07/83 →, Eng Nr 14503745 →	SVB10813	10x813
1.6 S	16 SH	66	09/81 → 08/86		MS, 07/82 →	SVB10888	10x888
					PS, 07/82 →	SVB10925	10x925
					07/82 →	TB155	111x20
					07/82 →	SVB10760	10x760
1.8 GTE	18 E	85	03/83 → 08/86			SVB101100	10x1100
						TB155	111x20
						SVB10800	10x800

ASTRA Mk II Belmont

1.3	13 S	55	09/85 → 08/91		01/86 →	SVB10875	10x875
					01/86 →	TB129	104x15
					01/86 →	SVB10760	10x760
1.6	16 SH	66	09/85 → 08/91		MS, 01/86 →	SVB10888	10x888
					PS, 01/86 →	SVB10925	10x925
					01/86 →	TB155	111x20
					01/86 →	SVB10760	10x760



kW



...VAUXHALL

...ASTRA Mk II Belmont

1.6 D	16 DA	40	09/85 → 08/91		01/86 → 08/88	SVB10913	10x913
					AUTO, 01/86 → 08/88, → Eng Nr 14503756	TB178	147x24
					AUTO, 01/86 → 08/88, Eng Nr 14503757 →	TB224	146x24
					AUTO, 01/86 → 08/88, → Eng Nr 14503756	TBK046	
					AUTO, 01/86 → 08/88, Eng Nr 14503757 →	TBK031	
					AUTO, 01/86 → 08/88, → Eng Nr 14503744	SVB10760	10x760
					AUTO, 01/86 → 08/88, Eng Nr 14503745 →	SVB10813	10x813
1.6 S	16 SV	60	01/89 → 12/91		MS, 09/89 → 08/91, → Ch. H2517837	SVB10913	10x913
					MS, 09/89 → 08/91, Ch. H2517838 →	SVB10925	10x925
					PS, 09/89 → 08/91	MVB1015R5	5PK1015
					PS, 09/89 → 08/91	MVB970R5	5PK970
					09/89 → 08/91, → Eng Nr 16-02J22349	TB218	104x17
					09/89 → 08/91, Eng Nr 16-02J22350 →	TB336	111x17
					09/89 → 08/91, Eng Nr 16-02J22350 →	TBK008	
1.7 D	17 D	42	01/89 → 12/91		→ 08/91	SVB10913	10x913
					→ 08/91, → Eng Nr 14363650	TB224	146x24
					→ 08/91, Eng Nr 14363651 →	TB509	176x24
					→ 08/91, → Eng Nr 14363650	TBK031	
					→ 08/91, Eng Nr 14363651 →	TBK081	
					→ 08/91	SVB10813	10x813
1.8	18 SE	82	01/86 → 12/90			SVB10800	10x800
						TB155	111x20
						SVB101100	10x1100
1.8 i	18 E, 18 SE	85	09/85 → 08/91		Eng. 18SE, 01/86 →	SVB10800	10x800
					01/86 →	TB155	111x20
					Eng. 18SE, 01/86 →	SVB101100	10x1100

ASTRA Mk II Convertible

1.6 i	16 SV	60	01/87 → 12/91		MS, 09/87 → 08/91, → Ch. H2517837	SVB10913	10x913
					MS, 09/87 → 08/91, Ch. H2517838 →	SVB10925	10x925
					PS, 09/87 → 08/91	MVB1015R5	5PK1015
					PS, 09/87 → 08/91	MVB970R5	5PK970
					09/87 → 08/91, → Eng Nr 16-02J22349	TB218	104x17
					09/87 → 08/91, Eng Nr 16-02J22350 →	TB336	111x17
					09/87 → 08/91, Eng Nr 16-02J22350 →	TBK008	
2.0 i	20 NE	85	01/87 → 12/91		09/87 → 08/91	SVB10913	10x913
					09/87 → 08/91	TB155	111x20
					09/87 → 08/91	SVB10800	10x800
2.0 i CAT	C 20 NE	85	01/91 → 08/93		A/C(-), PS, 09/92 →	MVB1725R6	6PK1725
					A/C(-), PS, 10/91 →	SVB10925	10x925
					A/C(+), PS, 10/91 →	MVB1904R6	6PK1904
					10/91 →, → Eng Nr 14608700	TB155	111x20
					10/91 →, Eng Nr 14608701 →	TB508	146x20
					10/91 →, Eng Nr 14608701 →	TBK032	
					10/91 → 08/92	SVB10790	10x790



kW



VAUXHALL

...VAUXHALL

ASTRA Mk II Estate

1.2	12 S	44	09/84 → 12/88			SVB10875	10x875
						TB190	101x17
1.3	13 S	55	09/84 → 08/91			SVB10875	10x875
						TB129	104x15
						SVB10760	10x760
1.4 S	14 NV	55	01/89 → 08/91		07/89→	SVB10875	10x875
					07/89→, → Eng Nr 19311737	TB218	104x17
					07/89→, Eng Nr 19307806, 14-02J22350→	TB336	111x17
					07/89→, Eng Nr 19311738→	TBK008	
1.6	16 SV	60	09/84 → 08/91		MS, 09/86→, → Ch. H2517837	SVB10913	10x913
					MS, 09/86→, Ch. H2517838→	SVB10925	10x925
					PS, 09/86→	MVB1015R5	5PK1015
					PS, 09/86→	MVB970R5	5PK970
					09/86→, → Eng Nr 16-02J22349	TB218	104x17
					09/86→, Eng Nr 16-02J22350→	TB336	111x17
					09/86→, Eng Nr 16-02J22350→	TBK008	
1.6 D	16 DA	40	09/84 → 12/89			SVB10913	10x913
					AUTO, → Eng Nr 14503756	TB178	147x24
					AUTO, Eng Nr 14503757→	TB224	146x24
					AUTO, → Eng Nr 14503756	TBK046	
					AUTO, Eng Nr 14503757→	TBK031	
					AUTO, → Eng Nr 14503744	SVB10760	10x760
					AUTO, Eng Nr 14503745→	SVB10813	10x813
1.6 S	16 SH	66	09/84 → 08/86		MS	SVB10888	10x888
					PS	SVB10925	10x925
						TB155	111x20
						SVB10760	10x760
1.7 D	17 D	42	02/89 → 08/91			SVB10913	10x913
						TB224	146x24
					Eng Nr 14363651→	TB509	176x24
						TBK031	
					Eng Nr 14363651→	TBK081	
						SVB10813	10x813
1.8 i	18 E	83	01/90 → 08/91			SVB101100	10x1100
						TB155	111x20
						SVB10800	10x800

ASTRA Mk II Hatchback

1.2	12 S	44	09/84 → 08/91			SVB10875	10x875
						TB190	101x17
1.3	13 S	55	09/84 → 08/91			SVB10875	10x875
						TB129	104x15
						SVB10760	10x760
		44	09/84 → 08/91			SVB10875	10x875
						TB129	104x15
						SVB10760	10x760
1.4 i	C 14 NZ	44	01/90 → 08/91			SVB10875	10x875
					→ Eng Nr 19307805,14-02J22349	TB218	
104x17					Eng Nr 19307806,14-02J22350→	TB336	111x17
					Eng Nr 19311738→	TBK008	
1.4 S	14 NV	55	01/90 → 08/91			SVB10875	10x875
					→ Eng Nr 19307805,14-02J22349	TB218	
104x17					Eng Nr 19311738→	TB336	111x17
					Eng Nr 19311738→	TBK008	



kW



...VAUXHALL

...ASTRA Mk II Hatchback

1.6	16 SV	60	09/84 → 08/91		MS, 09/86 →, → Ch. H2517837	SVB10913	10x913
					MS, 09/86 →, Ch. H2517838 →	SVB10925	10x925
					PS, 09/86 →	MVB1015R5	5PK1015
					PS, 09/86 →	MVB970R5	5PK970
					09/86 →, → Eng Nr 16-02J22349	TB218	104x17
1.6 D	16 DA	40	09/84 → 12/89		09/86 →, Eng Nr 16-02J22350 →	TB336	111x17
					09/86 →, Eng Nr 16-02J22350 →	TBK008	
					AUTO, → Eng Nr 14503756	TB178	147x24
					MAN, Eng Nr 14498631 →	TB224	146x24
					AUTO, → Eng Nr 14503756	TBK046	
1.6 S	16 SH	66	09/84 → 08/86		AUTO, Eng Nr 14503757 →	TBK031	
					AUTO, Eng Nr 14503745 →	SVB10813	10x813
					MAN, → Eng Nr 14478630	SVB10760	10x760
					MS	SVB10888	10x888
					PS	SVB10925	10x925
1.7 D	17 DR	42	01/89 → 08/91			TB155	111x20
						SVB10760	10x760
					→ Eng Nr 14363650	SVB10913	10x913
					Eng Nr 14363651 →	TB224	146x24
					→ Eng Nr 14363650	TB509	176x24
1.8 GTE	18 E, 18 SE	82	09/84 → 08/91		Eng Nr 14363651 →	TBK031	
					Eng Nr 14363651 →	TBK081	
						SVB10813	10x813
						SVB101100	10x1100
						TB155	111x20
2.0 GTE	20 SEH	95	09/86 → 08/91			SVB10800	10x800
						SVB10913	10x913
						TB155	111x20
2.0 GTE 16V	20 XE	115	05/88 → 08/91			SVB10800	10x800
						SVB13875	13x875
						SVB10913	10x913

ASTRA Mk III

1.4 i	C 14 NZ	44	09/91 → 09/98		A/C(-), MS, →02/98, → Ch. S2500015	SVB10913	10x913
					A/C(-), MS, →02/98, Ch. S2500016 →	SVB10925	10x925
					A/C(-), PS, →08/92	MVB985R5	5PK985
					A/C(-), PS, 09/92 →02/98	MVB1460R6	6PK1460
					A/C(+), PS, →02/98	MVB1805R6	6PK1805
	C 14 SE	60	03/92 → 09/98		→02/98	TB336	111x17
					→02/98	TBK008	
					A/C(-), MS, →02/98, → Ch. S2500015	SVB10913	10x913
					A/C(-), MS, →02/98, Ch. S2500016 →	SVB10925	10x925
					A/C(-), PS, →08/92	MVB985R5	5PK985
1.4 i 16V	X 14 XE	66	02/96 → 09/98		A/C(-), PS, 09/92 →02/98	MVB1460R6	6PK1460
					A/C(+), PS, →02/98	MVB1805R6	6PK1805
					→02/98	TB336	111x17
					→02/98	TBK008	
					A/C(-), MS, →01/98	MVB890R6	6PK890
					A/C(-), PS, →01/98	MVB1530R6	6PK1530
					A/C(+), →01/98	MVB1805R6	6PK1805
					→01/98	TB780	169x20
					→01/98	TBK260	



kw



VAUXHALL

...VAUXHALL

...ASTRA Mk III

1.6 i	X 16 SZ	52	08/94 → 07/96	⊗	A/C(-), MS, → Ch. S2500015	SVB10913	10x913
				⊗	A/C(-), MS, Ch. S5000001, R8000001→	SVB10925	10x925
				⊗	A/C(-), PS	MVB1460R6	6PK1460
				⊗	A/C(+), PS	MVB1805R6	6PK1805
				⊗		TB336	111x17
				⊗		TBK008	
				⊗			
				⊗			
				⊗			
				⊗			
C 16 NZ, X 16 SZR	55	03/92 → 09/98	⊗	Eng. X16SZR, A/C(-), 09/96→01/98	MVB1460R6	6PK1460	
			⊗	Eng. X16SZR, A/C(+), 09/96→01/98	MVB1805R6	6PK1805	
			⊗	Eng. X16SZR, 09/96→01/98	TB336	111x17	
			⊗		TBK008		
			⊗				
			⊗				
			⊗				
			⊗				
			⊗				
			⊗				
C 16 SE	74	05/92 → 12/94	⊗	A/C(-), MS, →08/94	SVB10913	10x913	
			⊗	A/C(-), PS, →08/92	MVB985R5	5PK985	
			⊗	A/C(-), PS, 09/92→08/94	MVB1460R6	6PK1460	
			⊗	A/C(+), PS, →08/94	MVB1805R6	6PK1805	
			⊗	→08/94	TB336	111x17	
			⊗	→08/94	TBK008		
			⊗				
			⊗				
			⊗				
			⊗				
1.6 i 16V	X 16 XEL	74	08/94 → 09/98	⊗	A/C(-), MS, →01/98	MVB890R6	6PK890
				⊗	A/C(-), PS, →01/98	MVB1530R6	6PK1530
				⊗	A/C(+), →01/98	MVB1805R6	6PK1805
				⊗	→01/98	TB780	169x20
				⊗	→01/98	TBK260	
				⊗			
				⊗			
				⊗			
				⊗			
				⊗			
1.7 D	17 D	42	03/92 → 09/92	⊗		SVB10925	10x925
				⊗	→ Eng Nr 14363650	TB224	146x24
				⊗	Eng Nr 14363651→	TB509	176x24
				⊗	→ Eng Nr 14363650	TBK031	
				⊗	Eng Nr 14363651→	TBK081	
				⊗		SVB10813	10x813
				⊗			
				⊗			
				⊗			
				⊗			
17 DR	44	07/92 → 09/98	⊗	→08/94	SVB10925	10x925	
			⊗	→08/94, → Eng Nr 14363650	TB224	146x24	
			⊗	→08/94, Eng Nr 14363651→	TB509	176x24	
			⊗	→08/94, → Eng Nr 14363650	TBK031		
			⊗	→08/94, Eng Nr 14363651→	TBK081		
			⊗	→08/94	SVB10813	10x813	
			⊗				
			⊗				
			⊗				
			⊗				
1.7 TD	X 17 DTL	50	11/94 → 09/98	⊗	→01/98	SVB10925	10x925
				⊗	→01/98	TB509	176x24
				⊗	→01/98	TBK081	
				⊗	→01/98	SVB10813	10x813
				⊗			
				⊗			
				⊗			
				⊗			
				⊗			
				⊗			
17 DT (TC4EE1)	60	12/91 → 09/98	⊗	→08/96	SVB13925	13x925	
			⊗	→08/96	TB413	136x25.4	
			⊗	→08/94, → Ch. R...	TBK022		
			⊗	09/94→08/96	TBK023		
			⊗	→08/96	SVB10950	10x950	
			⊗				
			⊗				
			⊗				
			⊗				
			⊗				
1.8 i	C 18 NZ	66	03/92 → 09/98	⊗	A/C(-), PS	SVB10925	10x925
				⊗	A/C(-), PS, 09/92→	MVB1725R6	6PK1725
				⊗	A/C(+), PS	MVB1904R6	6PK1904
				⊗	→12/92, → Eng Nr 14254438	TB155	111x20
				⊗	01/93→, Eng Nr 14254439→	TB508	146x20
				⊗	01/93→, Eng Nr 14254439→	TBK032	
				⊗	→08/92	SVB10800	10x800
				⊗			
				⊗			
				⊗			
1.8 i 16V	C 18 XE	92	06/93 → 10/94	⊗	A/C(-)	MVB1725R6	6PK1725
				⊗	A/C(+)	MVB1904R6	6PK1904
				⊗		TB783	169x24
				⊗		TBK261	
				⊗			
				⊗			
				⊗			
				⊗			
				⊗			
				⊗			
C 18 XEL	85	01/94 → 12/96	⊗	A/C(-), →08/96	MVB1725R6	6PK1725	
			⊗	A/C(+), →08/96	MVB1904R6	6PK1904	
			⊗	→08/96	TB783	169x24	
			⊗	→08/96	TBK261		
			⊗				
			⊗				
			⊗				
			⊗				
			⊗				
			⊗				



kW



...VAUXHALL

...ASTRA Mk III

2.0 i	C 20 NE	85	03/92 → 09/98	⊗	A/C(-), MS, →08/94	SVB10925	10x925
				⊗	A/C(-), PS, 09/92→08/94	MVB1725R6	6PK1725
				⊗	A/C(+), PS, →08/94	MVB1904R6	6PK1904
					→12/92, → Eng Nr 14608700	TB155	111x20
					01/93→08/94,	TB508	146x20
					Eng Nr 14608701→		
					01/93→08/94,	TBK032	
					Eng Nr 14608701→		
				⊕	→08/92	SVB10800	10x800
2.0 i 16V	X 20 XEV	100	02/95 → 09/98	⊗	A/C(-)	MVB1725R6	6PK1725
				⊗	A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
						TBK261	

ASTRA Mk III Convertible

1.6 i	X 16 SZ	52	03/93 → 08/96	⊗	A/C(-), MS, 09/94→, → Ch. R5999999, R8999999	SVB10913	10x913
				⊗	A/C(-), MS, 09/94→, Ch. S5000001, R8000001→	SVB10925	10x925
				⊗	A/C(-), PS, 09/94→	MVB1460R6	6PK1460
				⊗	A/C(+), PS, 09/94→	MVB1805R6	6PK1805
					09/94→	TB336	111x17
					09/94→	TBK008	
	X 16 SZR	55	01/96 → 03/01	⊗	A/C(-), 09/96→08/98	MVB1460R6	6PK1460
				⊗	A/C(-), 09/98→	MVB938R5	5PK938
				⊗	A/C(+), 09/96→08/98	MVB1805R6	6PK1805
				⊗	A/C(+), 09/98→	MVB1215R5	5PK1215
					09/96→	TB336	111x17
					09/96→	TBK008	
1.8 16V	C 18 XEL, X 18 XE	85	11/94 → 03/01	⊗	Eng. X18XEL, A/C(-)	MVB1725R6	6PK1725
				⊗	Eng. X18XEL, A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
						TBK261	
2.0 i	C 20 NE	85	03/93 → 10/94	⊗	A/C(-), MS	SVB10925	10x925
				⊗	A/C(-), PS	MVB1725R6	6PK1725
				⊗	A/C(+), PS	MVB1904R6	6PK1904
					→ Eng Nr 14608700	TB155	111x20
					Eng Nr 14608701→	TB508	146x20
					Eng Nr 14608701→	TBK032	

ASTRA Mk III Estate

1.4 i	C 14 NZ	44	09/91 → 02/98	⊗	A/C(-), MS, → Ch. S2500015	SVB10913	10x913
				⊗	A/C(-), MS, Ch. S2500016→	SVB10925	10x925
				⊗	A/C(-), PS, →08/92	MVB985R5	5PK985
				⊗	A/C(-), PS, 09/92→	MVB1460R6	6PK1460
				⊗	A/C(+), PS	MVB1805R6	6PK1805
						TB336	111x17
						TBK008	
	X 14 SE	60	03/91 → 02/98	⊗	A/C(-), MS, 09/91→, → Ch. S2500015	SVB10913	10x913
				⊗	A/C(-), MS, 09/91→, Ch. S2500016→	SVB10925	10x925
				⊗	A/C(-), PS, 09/91→08/92	MVB985R5	5PK985
				⊗	A/C(-), PS, 09/92→	MVB1460R6	6PK1460
				⊗	A/C(+), PS, 09/91→	MVB1805R6	6PK1805
					09/91→	TB336	111x17
					09/91→	TBK008	



kw



VAUXHALL

...VAUXHALL

...ASTRA Mk III Estate

Engine	Model	Power (kw)	Year Range	Options	Accessories	Part Number	Part Number			
1.4 i 16V	X 14 XE	66	02/96 → 01/98	⊗	A/C(-), MS	MVB890R6	6PK890			
				⊗	A/C(-), PS	MVB1530R6	6PK1530			
				⊗	A/C(+)	MVB1805R6	6PK1805			
				⊗		TB780	169x20			
				⊗		TBK260				
1.6 i	C 16 NZ, E 16 NZ	55	09/91 → 02/98	⊗	A/C(-), MS, 09/94 → 08/95	SVB10913	10x913			
				⊗	A/C(-), PS, 09/94 → 08/95	MVB1460R6	6PK1460			
				⊗	A/C(+), PS, 09/94 → 08/95	MVB1805R6	6PK1805			
				⊗	09/94 → 08/95	TB336	111x17			
				⊗	09/94 → 08/95	TBK008				
		X 16 SZ	52	07/94 → 02/98	⊗	A/C(-)	MVB1460R6	6PK1460		
					⊗	A/C(-), 09/96 →	MVB1725R6	6PK1725		
					⊗	A/C(-),	SVB10913	10x913		
						MS, →08/96, → Ch. R59999999,				
						R89999999				
				⊗	A/C(-),	SVB10925	10x925			
					MS, →08/96, Ch. S5000001,					
					R8000001 →					
				⊗	A/C(+)	MVB1805R6	6PK1805			
				⊗	A/C(+), 09/96 →	MVB1904R6	6PK1904			
				⊗		TB336	111x17			
				⊗		TB508	146x20			
				⊗		TBK008				
				⊗		TBK032				
					09/96 →					
1.6 i 16V	X 16 XEL	74	01/94 → 02/98	⊗	A/C(-), MS, 09/94 →	MVB890R6	6PK890			
				⊗	A/C(-), PS, 09/94 →	MVB1530R6	6PK1530			
				⊗	A/C(+), 09/94 →	MVB1805R6	6PK1805			
				⊗	09/94 →	TB780	169x20			
				⊗	09/94 →	TBK260				
1.6 Si	C 16 SE	74	03/91 → 12/94	⊗	A/C(-), MS, 09/91 → 08/94	SVB10913	10x913			
				⊗	A/C(-), PS, 09/91 → 08/92	MVB985R5	5PK985			
				⊗	A/C(-), PS, 09/92 → 08/94	MVB1460R6	6PK1460			
				⊗	A/C(+), PS, 09/91 → 08/94	MVB1805R6	6PK1805			
				⊗	09/91 → 08/94	TB336	111x17			
				⊗	09/91 → 08/94	TBK008				
1.7 D	17 D	42	12/91 → 02/98	⊗	→08/94	SVB10925	10x925			
				⊗	→08/94, → Eng Nr 14363650	TB224	146x24			
				⊗	→08/94, Eng Nr 14363651 →	TB509	176x24			
				⊗	→08/94, → Eng Nr 14363650	TBK031				
				⊗	→08/94, Eng Nr 14363651 →	TBK081				
					⊗	→08/94	SVB10813	10x813		
		17 DR	44	03/91 → 12/94	⊗	09/93 →	SVB10925	10x925		
					⊗	09/93 →	TB509	176x24		
					⊗	09/93 →	TBK081			
					⊗	09/93 →	SVB10813	10x813		
1.7 TD	17 DT (TC4EE1)	60	12/91 → 02/98	⊗	→08/96	SVB13925	13x925			
				⊗	→08/96	TB413	136x25.4			
				⊗	→08/94, → Ch. R...	TBK022				
				⊗	09/94 → 08/96, Ch. S... →	TBK023				
				⊗	→08/96	SVB10950	10x950			
	X 17 DTL	50	01/94 → 02/98	⊗		SVB10925	10x925			
				⊗		TB509	176x24			
				⊗		TBK081				
				⊗		SVB10813	10x813			
1.8 i	C 18 NZ	66	09/91 → 02/98	⊗	A/C(-), PS, 05/92 →	SVB10925	10x925			
				⊗	A/C(-), PS, 09/92 →	MVB1725R6	6PK1725			
				⊗	A/C(+), PS, 05/92 →	MVB1904R6	6PK1904			
				⊗	01/93 →, Eng Nr 14254439 →	TB508	146x20			
				⊗	05/92 → 12/92,	TB155	111x20			
									→ Eng Nr 14254438	
								⊗	01/93 →, Eng Nr 14254439 →	TBK032
				⊗	05/92 → 08/92	SVB10800	10x800			



kW



...VAUXHALL

...ASTRA Mk III Estate

2.0 i	C 20 NE	85	09/91 → 02/98		A/C(-), MS, →08/94	SVB10925	10x925
					A/C(-), PS, 09/92→08/94	MVB1725R6	6PK1725
					A/C(+), PS, →08/94	MVB1904R6	6PK1904
					→12/92, → Eng Nr 14608700	TB155	111x20
					01/93→08/94, Eng Nr 14608701→	TB508	146x20
2.0 i 16V	X 20 XEV	100	01/94 → 02/98		01/93→08/94, Eng Nr 14608701→	TBK032	
					01/93→08/94, Eng Nr 14608701→	SVB10800	10x800
					→08/92	MVB1725R6	6PK1725
					A/C(-), 09/94→	MVB1904R6	6PK1904
					A/C(+), 09/94→	TB783	169x24
					09/94→	TBK261	

ASTRA Mk III Hatchback

1.4 i	C 14 NZ	44	09/91 → 02/98		A/C(-), MS, → Ch. S2500015	SVB10913	10x913
					A/C(-), MS, Ch. S2500016→	SVB10925	10x925
					A/C(-), PS, →08/92	MVB985R5	5PK985
					A/C(-), PS, 09/92→	MVB1460R6	6PK1460
					A/C(+), PS	MVB1805R6	6PK1805
	C 14 SE	60	03/92 → 02/98			TB336	111x17
						TBK008	
					A/C(-), MS, → Ch. R5999999, R8999999	SVB10913	10x913
					A/C(-), MS, Ch. S2500016→	SVB10925	10x925
					A/C(-), PS, →08/92	MVB985R5	5PK985
1.4 i 16V	X 14 XE	66	02/96 → 02/98		A/C(-), PS, 09/92→	MVB1460R6	6PK1460
					A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	
1.6 i	C 16 NZ, E 16 NZ	55	09/91 → 02/98		A/C(-), PS	MVB1805R6	6PK1805
					A/C(+), 09/96→	MVB1460R6	6PK1460
					09/96→	TB336	111x17
					09/96→	TBK008	
					09/96→	MVB890R6	6PK890
	C 16 SE	74	03/92 → 02/98		A/C(-), MS, 09/94→	MVB1530R6	6PK1530
					A/C(-), PS, 09/94→	MVB1805R6	6PK1805
					A/C(+), 09/94→	MVB1805R6	6PK1805
					09/94→	TB780	169x20
					09/94→	TBK260	
	X 16 SZ	52	07/94 → 02/98		A/C(-), MS, →08/96, → Ch. S2500015	SVB10913	10x913
					A/C(-), MS, →08/96, Ch. S2500016→	SVB10925	10x925
					A/C(-), PS, →08/96	MVB1460R6	6PK1460
					A/C(+), PS, →08/96	MVB1805R6	6PK1805
					→08/96	TB336	111x17
					→08/96	TBK008	
1.6 i 16V	X 16 XEL	74	01/94 → 02/98		A/C(-), MS, 09/94→	MVB890R6	6PK890
					A/C(-), PS, 09/94→	MVB1530R6	6PK1530
					A/C(+), 09/94→	MVB1805R6	6PK1805
					09/94→	TB780	169x20
					09/94→	TBK260	



kW



VAUXHALL

...VAUXHALL

...ASTRA Mk III Hatchback

1.7 D	17 D	42	12/91 → 02/98	 	→08/94 →08/94, → Eng Nr 14363650 →08/94, Eng Nr 14363651→ →08/94, → Eng Nr 14363650 →08/94, Eng Nr 14363651→ →08/94	SVB10925 TB224 TB509 TBK031 TBK081 SVB10813	10x925 146x24 176x24 10x813			
	17 DR	44	09/91 → 12/94	 	→08/94 →08/94, → Eng Nr 14363650 →08/94, Eng Nr 14363651→ →08/94, → Eng Nr 14363650 →08/94, Eng Nr 14363651→ →08/94	SVB10925 TB224 TB509 TBK031 TBK081 SVB10813	10x925 146x24 176x24 10x813			
1.7 TD	17 DT (TC4EE1)	60	12/91 → 02/98	 	→08/96 →08/96 →08/94, → Ch. R... 09/94→08/96 →08/96	SVB13925 TB413 TBK022 TBK023 SVB10950	13x925 136x25.4 10x950			
	X 17 DTL	50	11/94 → 02/98	 	→08/96 →08/96 →08/94, → Ch. R... 09/94→08/96 →08/96	SVB10925 TB509 TBK081 SVB10813	10x925 176x24 10x813			
1.8 i	C 18 NZ	66	09/91 → 02/98		A/C(-), PS, 05/92→	SVB10925	10x925			
					A/C(-), PS, 09/92→	MVB1725R6	6PK1725			
					A/C(+), PS, 05/92→	MVB1904R6	6PK1904			
					01/93→, Eng Nr 14254439→	TB508	146x20			
					05/92→12/92, → Eng Nr 14254438	TB155	111x20			
	01/93→, Eng Nr 14254439→	TBK032								
	05/92→08/92	SVB10800	10x800							
2.0 i	C 20 NE	85	09/91 → 02/98		A/C(-), MS, →08/94	SVB10925	10x925			
					A/C(-), PS, 09/92→08/94	MVB1725R6	6PK1725			
					A/C(+), PS, →08/94	MVB1904R6	6PK1904			
					→12/92, → Eng Nr 14608700	TB155	111x20			
					01/93→08/94, Eng Nr 14608701→	TB508	146x20			
					01/93→08/94, Eng Nr 14608701→	TBK032				
					→08/92	SVB10800	10x800			
2.0 i 16V	C 20 XE	110	09/91 → 02/98		A/C(-), →08/92	SVB10925	10x925			
					A/C(-), 09/92→08/94	MVB1725R6	6PK1725			
					A/C(+), →08/94	MVB1904R6	6PK1904			
					→12/92, → Eng Nr 14142838	TB221	141x24			
					01/93→08/94, Eng Nr 14142839→	TB509	176x24			
					→12/92, → Eng Nr 14142838	TBK028				
					01/93→08/94, Eng Nr 14142839→	TBK111				
					→08/92	SVB10790	10x790			
				X 20 XEV	100	01/94 → 02/98		A/C(-), 09/94→	MVB1725R6	6PK1725
								A/C(+), 09/94→	MVB1904R6	6PK1904
	09/94→	TB783	169x24							
	09/94→	TBK261								

ASTRA Mk IV

1.4 16V	X 14 XE, Z 14 XE	66	09/98 →		A/C(-), →05/05	MVB938R5	5PK938
					A/C(+), →05/05	MVB1215R5	5PK1215
					→05/05	TB638	162x20
					→05/05, → Eng Nr 02HL5117, 20041690	TBK103	
					→05/05, Eng Nr 02HL5118, 20041691→	TBK240	



kW



...VAUXHALL

...ASTRA Mk IV

1.6	Z 16 SE	62	09/00 →		A/C(-), →05/05	MVB938R5	5PK938
					A/C(+), →05/05	MVB1215R5	5PK1215
1.6 16V	X 16 XEL, Z 16 XE	74	09/98 →		→05/05	TB336	111x17
					→05/05	TBK008	
					Eng. Z16XE, A/C(-), 09/00 →05/05	MVB938R5	5PK938
					Eng. Z16XE, A/C(+), 09/00 →05/05	MVB1215R5	5PK1215
1.6 Dualfuel	Z 16 XE	63	09/02 →		09/00 →05/05	TB638	162x20
					09/00 →05/05	TBK103	
					Eng. Z16XE, 09/00 →05/05, → Eng Nr 20041690,02HL5117	TBK240	
					Eng. Z16XE, 09/00 →05/05, Eng Nr 02HL5118, 20041691 →	TBK240	
1.7 CDTI 16V	Z 17 DTL	59	04/03 →		A/C(-), →05/05	MVB1270R6	6PK1270
					A/C(+), →05/05	MVB1600R6	6PK1600
1.7 DTI 16V	Y 17 DT	55	02/00 →		→05/05	TB740	129x25
					→05/05, → Eng Nr 20041690, 02HL5117	TBK103	
1.7 TD	X 17 DTL	50	09/98 → 08/00		→05/05, Eng Nr 02HL5118, 20041691 →	TBK240	
					A/C(-), 09/00 →05/05	MVB1250R6	6PK1250
1.8 16V	X 18 XE1	85	09/98 → 09/00		A/C(+), 09/00 →05/05	MVB1588R6	6PK1588
					09/00 →05/05	TB656	131x25
	Z 18 XE	92	09/00 →		MVB885R4	4PK885	
					SVB10925	10x925	
1.8 16V Dualfuel	Z 18 XE	87	09/02 →		TB509	176x24	
					TBK081		
	Z 18 XE	92	09/00 →		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
1.8 DI	X 20 DTL, Y 20 DTL	60	09/98 →		→ Eng Nr 20041690,02HL5117	TBK103	
					Eng Nr 20041691,02HL5118 →	TBK240	
	Z 18 XE	92	09/00 →		A/C(-), →05/05	MVB938R5	5PK938
					A/C(+), →05/05	MVB1215R5	5PK1215
1.8 16V Dualfuel	Z 18 XE	87	09/02 →		→05/05	TB638	162x20
					→05/05, → Eng Nr 02HL5117, 20041690	TBK103	
	Z 18 XE	92	09/00 →		→05/05, Eng Nr 02HL5118, 20041691 →	TBK240	
					→05/05, Eng Nr 02HL5118, 20041691 →	TBK240	
2.0 DI	X 20 DTL, Y 20 DTL	60	09/98 →		A/C(-), →05/05	MVB1805R6	6PK1805
					A/C(+), →05/05	MVB1875R6	6PK1875
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	08/99 →		A/C(-), →05/05	MVB1805R6	6PK1805
					A/C(+), →05/05	MVB1875R6	6PK1875



kw



VAUXHALL

...VAUXHALL

ASTRA MK IV Convertible

1.6 16V	Z 16 XE	74	03/01 →	 	A/C(-), →05/05 A/C(-), 04/04→ A/C(+), →05/05 A/C(+), 04/04→ →05/05 04/04→ →05/05, → Eng Nr 20041690, 02HL5117 →05/05, Eng Nr 02HL5118, 20041691→	MVB938R5 MVB1450R5 MVB1215R5 MVB1550R5 TB638 TB741 TBK103 TBK240	5PK938 5PK1450 5PK1215 5PK1550 162x20 146x24
1.8 16V	Z 18 XE	92	03/01 →	 	A/C(-), →09/06 A/C(+), →09/06 →09/06 →07/06, → Eng Nr 20041690, 02HL5117 →09/06, → Eng Nr 20EB2048	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
2.0 Turbo	Z 20 LET	141	03/02 →	 	→07/06 →07/06	MVB1680R5 TB647	5PK1680 168x24
2.2 16V	Z 22 SE	108	03/01 →	 	A/C(-), →07/06 A/C(+), →07/06	MVB875R5 MVB1030R5	5PK875 5PK1030

ASTRA Mk IV Coupe

1.8 16V	X 18 XE1	85	03/00 → 10/00	 	A/C(-) A/C(+) → Eng Nr 02HL5117,20041690 Eng Nr 02HL5118,20041691→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
	Z 18 XE	92	09/00 →	 	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 02HL5117, 20041690 →05/05, Eng Nr 02HL5118, 20041691→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
1.8 16V Dualfuel	Z 18 XE	87	09/02 →	 	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 02HL5117, 20041690 →05/05, Eng Nr 02HL5118, 20041691→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
2.0 16V Turbo	Z 20 LET	140	09/00 →	 	→05/05 →05/05	MVB1680R5 TB647	5PK1680 168x24
2.2 16V	Z 22 SE	108	03/00 →	 	A/C(-), →05/05 A/C(+), →05/05	MVB875R5 MVB1030R5	5PK875 5PK1030

ASTRA Mk IV Estate

1.4 16V	X 14 XE, Z 14 XE	66	02/98 →	 	Eng. Z14XE, A/C(-), →05/05 Eng. Z14XE, A/C(+), →05/05 →05/05 Eng. Z14XE, →05/05, → Eng Nr 20041690, 02HL5117 Eng. Z14XE, →05/05, Eng Nr 20041691, 02HL5118→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
---------	------------------	----	---------	------------------	---	---	-----------------------------



kW



...VAUXHALL

...ASTRA Mk IV Estate

1.6	X 16 SZR	55	02/98 → 09/00	 KIT	A/C(-) A/C(+)	MVB938R5 MVB1215R5 TB336 TBK008	5PK938 5PK1215 111x17
	Z 16 SE	62	09/00 →	 KIT	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05	MVB938R5 MVB1215R5 TB336 TBK008	5PK938 5PK1215 111x17
1.6 16V	X 16 XEL, Z 16 XE	74	02/98 →	 KIT	A/C(-), 02/04→ A/C(+), 02/04→ Eng. Z16XE, A/C(-), →05/05 Eng. Z16XE, A/C(+), →05/05 →05/05 02/04→ Eng. Z16XE, →05/05, → Eng Nr 20041690, 02HL5117 Eng. Z16XE, →05/05, Eng Nr 02HL5118, 20041691→	MVB1450R5 MVB1550R5 MVB938R5 MVB1215R5 TB638 TB741 TBK103 TBK240	5PK1450 5PK1550 5PK938 5PK1215 162x20 146x24
				 KIT	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 20041690, 02HL5117 →05/05, Eng Nr 02HL5118, 20041691→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
1.6 Dualfuel	Z 16 XE	63	09/02 →	 KIT	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 20041690, 02HL5117 →05/05, Eng Nr 02HL5118, 20041691→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
1.7 CDTI 16V	Z 17 DTL	59	04/03 →	 	A/C(-) A/C(+), →05/05 A/C(+), 05/04→	MVB1270R6 MVB1600R6 MVB1625R6 TB740	6PK1270 6PK1600 6PK1625 129x25
1.7 DTI 16V	Y 17 DT	55	02/00 →	 	A/C(-), 09/00→05/05 A/C(+), 09/00→05/05 09/00→05/05	MVB1250R6 MVB1588R6 TB656	6PK1250 6PK1588 131x25
1.7 TD	X 17 DTL	50	02/98 → 08/00	 KIT		MVB885R4 SVB10925 TB509 TBK081	4PK885 10x925 176x24
1.8 16V	X 18 XE1	85	02/98 → 09/00	 KIT	A/C(-) A/C(+) → Eng Nr 20041690,02HL5117 Eng Nr 20041691,02HL5118→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
	Z 18 XE	92	09/00 →	 KIT	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 02HL5117, 20041690 →05/05, Eng Nr 02HL5118, 20041691→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
1.8 16V Dualfuel	Z 18 XE	87	09/02 →	 KIT	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 02HL5117, 20041690 →05/05, Eng Nr 02HL5118, 20041691→	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
2.0 DI	X 20 DTL, Y 20 DTL	60	02/98 →	 	A/C(-), →05/05 A/C(+), →05/05	MVB1805R6 MVB1875R6	6PK1805 6PK1875
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	08/99 →	 	A/C(-), →05/05 A/C(+), →05/05	MVB1805R6 MVB1875R6	6PK1805 6PK1875
				 	A/C(-), →05/05 A/C(+), →05/05	MVB875R5 MVB1030R5	5PK875 5PK1030
2.2 16V	Z 22 SE	108	03/01 →	 	A/C(-), →05/05 A/C(+), →05/05	MVB875R5 MVB1030R5	5PK875 5PK1030



kw



VAUXHALL

...VAUXHALL

ASTRA Mk IV Hatchback

1.4 16V	X 14 XE, Z 14 XE	66	02/98 →	 	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 02HL5117, 20041690 →05/05, Eng Nr 02HL5118, 20041691 →	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
1.6	X 16 SZR	55	02/98 → 09/00	 	A/C(-) A/C(+) 	MVB938R5 MVB1215R5 TB336 TBK008	5PK938 5PK1215 111x17
	Z 16 SE	62	09/00 →	 	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05	MVB938R5 MVB1215R5 TB336 TBK008	5PK938 5PK1215 111x17
1.6 16V	X 16 XEL, Z 16 XE	74	02/98 →	 	Eng. Z16XE, A/C(-), →05/05 Eng. Z16XE, A/C(+), →05/05 →05/05 Eng. Z16XE, →05/05, → Eng Nr 20041690, 02HL5117	MVB938R5 MVB1215R5 TB638 TBK103	5PK938 5PK1215 162x20
					Eng. Z16XE, →05/05, Eng Nr 02HL5118, 20041691 →	TBK240	
1.6 Dualfuel	Z 16 XE	63	09/02 →	 	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 20041690, 02HL5117 →05/05, Eng Nr 02HL5118, 20041691 →	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
1.7 CDTI 16V	Z 17 DTL	59	04/03 →	 	A/C(-), →05/05 A/C(+), →05/05 →05/05	MVB1270R6 MVB1600R6 TB740	6PK1270 6PK1600 129x25
1.7 DTI 16V	Y 17 DT	55	02/00 →	 	A/C(-), 09/00 →05/05 A/C(+), 09/00 →05/05 09/00 →05/05	MVB1250R6 MVB1588R6 TB656	6PK1250 6PK1588 131x25
1.7 TD	X 17 DTL	50	02/98 → 08/00	 		MVB885R4 SVB10925 TB509 TBK081	4PK885 10x925 176x24
1.8 16V	X 18 XE1	85	02/98 → 09/00	 	A/C(-) A/C(+) → Eng Nr 20041690,02HL5117 Eng Nr 20041691,02HL5118 →	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
	Z 18 XE	92	09/00 →	 	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 02HL5117, 20041690 →05/05, Eng Nr 02HL5118, 20041691 →	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20
1.8 16V Dualfuel	Z 18 XE	87	09/02 →	 	A/C(-), →05/05 A/C(+), →05/05 →05/05 →05/05, → Eng Nr 02HL5117, 20041690 →05/05, Eng Nr 02HL5118, 20041691 →	MVB938R5 MVB1215R5 TB638 TBK103 TBK240	5PK938 5PK1215 162x20



kW



...VAUXHALL

...ASTRA Mk IV Hatchback

2.0 16V	X 20 XEV	100	02/98 →		A/C(-), 08/99 → 08/00	MVB938R5	5PK938
					A/C(+), 08/99 → 08/00	MVB1680R5	5PK1680
					08/99 → 08/00	TB647	168x24
2.0 DI	X 20 DTL, Y 20 DTL	60	02/98 →		A/C(-), → 05/05	MVB1805R6	6PK1805
					A/C(+), → 05/05	MVB1875R6	6PK1875
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	08/99 →		A/C(-), → 05/05	MVB1805R6	6PK1805
					A/C(+), → 05/05	MVB1875R6	6PK1875
2.0 SRI Turbo	Z 20 LET	141	07/02 →		→ 05/05	MVB1680R5	5PK1680
					→ 05/05	TB647	168x24
2.2 16V	Z 22 SE	108	03/01 →		A/C(-), → 05/05	MVB875R5	5PK875
					A/C(+), → 05/05	MVB1030R5	5PK1030

ASTRA MK V Estate

1.3 CDTI	Z 13 DTH	66	08/05 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.4	Z 14 XEP	66	08/04 →		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1360R5	5PK1360
1.6	Z 16 XEP	77	08/04 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.7 CDTI	Z 17 DTH	74	08/04 →		A/C(-)	MVB1270R6	6PK1270
					A/C(+)	MVB1625R6	6PK1625
						TB740	129x25
1.8	Z 18 XE	92	08/04 →		A/C(-), → 07/06	MVB938R5	5PK938
					A/C(+), → 07/06	MVB1215R5	5PK1215
					→ 07/06	TB638	162x20
					→ 07/06, → Eng Nr 20EB2048	TBK240	
1.9 CDTI	Z 19 DT	88	09/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB639	190x24
						TBK329	
	Z 19 DTH	110	08/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
						TBK306	
1.9 CDTI 16V	Z 19 DTJ	88	08/04 →		A/C(-), 08/05 →	MVB1050R6	6PK1050
					A/C(+), 08/05 →	MVB1369R6	6PK1369
					08/05 →	TB639	190x24
					08/05 →	TBK329	
2.0 Turbo	Z 20 LEL	125	08/04 →			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LER	147	08/04 →			MVB1680R5	5PK1680
						TB647	168x24

ASTRA MK V Hatchback

1.3 CDTI	Z 13 DTH	66	10/05 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1306R6	6PK1306
1.4	Z 14 XEP	66	03/04 →		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1360R5	5PK1360
1.6	Z 16 XEP	77	03/04 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.7 CDTI	Z 17 DTL	59	03/04 →		A/C(-)	MVB1270R6	6PK1270
					A/C(+)	MVB1625R6	6PK1625
						TB740	129x25
	Z 17 DTH	74	03/04 →		A/C(-)	MVB1270R6	6PK1270
					A/C(+)	MVB1625R6	6PK1625
						TB740	129x25
1.8	Z 18 XE	92	03/04 →		A/C(-), → 07/06	MVB938R5	5PK938
					A/C(+), → 07/06	MVB1215R5	5PK1215
					→ 07/06	TB638	162x20
					→ 07/06, → Eng Nr 20EB2048	TBK240	



kW



VAUXHALL

...VAUXHALL

...ASTRA MK V Hatchback

1.9 CDTi	Z 19 DTH	110	06/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
						TBK306	
	Z 19 DT	88	08/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB639	190x24
						TBK329	
1.9 CDTi 16V	Z 19 DTJ	88	04/04 →		A/C(-), 08/05 →	MVB1050R6	6PK1050
					A/C(+), 08/05 →	MVB1369R6	6PK1369
					08/05 →	TB639	190x24
					08/05 →	TBK329	
2.0 Turbo	Z 20 LEL	125	03/04 →			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LER	147	03/04 →			MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LEH	177	03/05 →		11/05 →	MVB1680R5	5PK1680
					11/05 →	TB647	168x24

ASTRA MK V Sport Hatch

1.6	Z 16 XEP	77	02/05 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
		132	10/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.7 CDTi	Z 17 DTH	74	02/05 →		A/C(-)	MVB1270R6	6PK1270
					A/C(+)	MVB1625R6	6PK1625
						TB740	129x25
1.8	Z 18 XE	92	02/05 →		A/C(-), →07/06	MVB938R5	5PK938
					A/C(+), →07/06	MVB1215R5	5PK1215
					→07/06	TB638	162x20
					→07/06, → Eng Nr 20EB2048	TBK240	
1.9 CDTi	Z 19 DTH	88	02/05 →		A/C(-), 08/05 →	MVB1050R6	6PK1050
					A/C(+), 08/05 →	MVB1369R6	6PK1369
					08/05 →	TB639	190x24
					08/05 →	TBK329	
		110	02/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
						TBK306	
		74	08/05 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1369R6	6PK1369
						TB639	190x24
						TBK329	
2.0 Turbo	Z 20 LEL	125	02/05 →			MVB1680R5	5PK1680
						TB647	168x24

ASTRA TwinTop

1.6	Z 16 XEP	77	09/05 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
		132	10/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
2.0		125	02/06 → 09/06			MVB1680R5	5PK1680
						TB647	168x24



kW



...VAUXHALL

ASTRAVAN Mk III

1.4 i	C 14 NZ	44	01/91 → 10/94	⊗	A/C(-), MS, 09/91 →, → Ch. S2500015	SVB10913	10x913
				⊗	A/C(-), MS, 09/91 →, Ch. S2500016 →	SVB10925	10x925
				⊗	A/C(-), PS, 09/91 → 08/92	MVB985R5	5PK985
				⊗	A/C(-), PS, 09/92 →	MVB1460R6	6PK1460
				⊗	A/C(+), PS, 09/91 →	MVB1805R6	6PK1805
				KIT	09/91 →	TB336	111x17
1.6 i	C 16 NZ	55	01/91 → 08/98	⊗	A/C(-), MS, 09/94 → 08/95	SVB10913	10x913
				⊗	A/C(-), PS, 09/94 → 08/95	MVB1460R6	6PK1460
				⊗	A/C(+), PS, 09/94 → 08/95	MVB1805R6	6PK1805
				KIT	09/94 → 08/95	TB336	111x17
	X 16 SZ	52	02/94 → 10/96	⊗	A/C(-), MS, 09/94 →, → Ch. R5999999, R8999999	SVB10913	10x913
				⊗	A/C(-), MS, 09/94 →, Ch. S5000001, R8000001 →	SVB10925	10x925
				⊗	A/C(-), PS, 09/94 →	MVB1460R6	6PK1460
				⊗	A/C(+), PS, 09/94 →	MVB1805R6	6PK1805
				KIT	09/94 →	TB336	111x17
				KIT	09/94 →	TBK008	
1.7 D	17 DR	44	01/91 → 08/94	⊗	09/93 →	SVB10925	10x925
					09/93 →	TB509	176x24
				KIT	09/93 →	TBK081	
				⊗	09/93 →	SVB10813	10x813
1.7 TD	X 17 DTL	50	01/94 → 08/98	⊗		SVB10925	10x925
						TB509	176x24
				KIT		TBK081	
				⊗		SVB10813	10x813

ASTRAVAN Mk IV

1.6 i	X 16 SZR	55	08/98 → 09/00	⊗	A/C(-)	MVB938R5	5PK938
				⊗	A/C(+)	MVB1215R5	5PK1215
						TB336	111x17
				KIT		TBK008	
	Z 16 SE	62	09/00 →	⊗	A/C(-), → 05/05	MVB938R5	5PK938
				⊗	A/C(+), → 05/05	MVB1215R5	5PK1215
					→ 05/05	TB336	111x17
				KIT	→ 05/05	TBK008	
1.7 CDTI	Z 17 DTL	59	04/04 →	⊗	A/C(-), 03/05 → 07/06	MVB1270R6	6PK1270
				⊗	A/C(+), 03/05 → 07/06	MVB1625R6	6PK1625
					03/05 → 07/06	TB740	129x25
1.7 TD	X 17 DTL	50	08/98 →	⊗	→ 08/00	MVB885R4	4PK885
				⊗	→ 08/00	SVB10925	10x925
					→ 08/00	TB509	176x24
				KIT	→ 08/00	TBK081	
2.0 DI	X 20 DTL	60	08/98 →	⊗	A/C(-), → 05/05	MVB1805R6	6PK1805
				⊗	A/C(+), → 05/05	MVB1875R6	6PK1875
2.0 DTI	Y 20 DTH	74	04/04 →	⊗	A/C(-), → 05/05	MVB1805R6	6PK1805
				⊗	A/C(+), → 05/05	MVB1875R6	6PK1875



kw



VAUXHALL

...VAUXHALL

BRAVA Pickup

2.3 (TFR16)	4 ZD1	69	08/91 → 08/94			SVB10760	10x760
						SVB13875	13x875
						TB265	115x19
						SVB131025	13x1025
	23 P	72	08/94 → 09/96			SVB10760	10x760
						SVB13875	13x875
						TB265	115x19
						SVB131025	13x1025
2.3 4x4 (TFS16)	4 ZD1	69	06/90 → 08/94			SVB10760	10x760
						SVB13875	13x875
						TB265	115x19
						SVB131025	13x1025
	23 P	72	08/94 → 09/96			SVB10760	10x760
						SVB13875	13x875
						TB265	115x19
						SVB131025	13x1025
2.5 D (TFR54)	4 JA1	56	08/91 → 06/94			SVB171055	17x1055
						TB291	119x32
						TBK075	
						SVB131375	13x1375
2.5 D 4x4 (TFS54)	4 JA1T	56	06/90 → 06/94			SVB171055	17x1055
						TB291	119x32
						TBK075	
						SVB131375	13x1375
2.5 DTI	4 JA1	74	08/01 →		→07/03	SVB131500	13x1500
					→07/03	SVB171055	17x1055
					→07/03	SVB131375	13x1375
2.5 DTI 4x4	4 JA1	74	08/01 →		→07/03	SVB131500	13x1500
					→07/03	SVB171055	17x1055
					→07/03	SVB131375	13x1375
2.5 TD (TFR54)	4 JA1T	56	07/94 →		10/96→07/01	SVB131500	13x1500
					→07/01	SVB171055	17x1055
					→07/01	TB291	119x32
					→07/01	TBK075	
					→07/01	SVB131375	13x1375
2.5 TD 4x4 (TFS54)	4 JA1T	56	07/94 →		10/96→07/01	SVB131500	13x1500
					→07/01	SVB171055	17x1055
					→07/01	TB291	119x32
					→07/01	TBK075	
					→07/01	SVB131375	13x1375

CALIBRA

2.0 i	C 20 NE	85	06/90 → 07/97		→08/92	SVB13875	13x875
					A/C(-), 09/92→12/96, Ch. P...→	MVB1725R6	6PK1725
					A/C(+), 09/92→12/96, Ch. P...→	MVB1904R6	6PK1904
					Alt. 70A, →08/92	SVB10925	10x925
					Alt. 90A, →08/90	SVB101000	10x1000
					Alt. 90A, →08/92	SVB10940	10x940
					→12/96, → Eng Nr 14142838	TB155	111x20
					→12/96, Eng Nr 14142839→	TB508	146x20
					→12/96, Eng Nr 14142839→	TBK032	
					A/C(-), →08/92	SVB10800	10x800
					A/C(+), →08/92	SVB10690	10x690



kW



...VAUXHALL

...CALIBRA

2.0 i 16V	X 20 XEV	100	06/90 → 07/97		A/C(-), 08/93→	MVB1725R6	6PK1725
					A/C(+), 08/93→	MVB1904R6	6PK1904
					08/93→	TB783	169x24
					08/93→	TBK261	
	C 20 XE	110	06/90 → 02/94		→08/92	SVB13875	13x875
					A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
					A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
					Alt. 70A, →08/92	SVB10913	10x913
					Alt. 90A, →08/90	SVB101000	10x1000
					Alt. 90A, →08/92	SVB10940	10x940
					→ Eng Nr 14142838	TB221	141x24
					Eng Nr 14142839→	TB509	176x24
					→ Eng Nr 14142838	TBK028	
					Eng Nr 14142839→	TBK111	
					A/C(-), →08/92	SVB10790	10x790
					A/C(+), →08/92	SVB10690	10x690
2.0 i 16V 4x4	X 20 XEV	100	02/94 → 07/97		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
						TBK261	
	C 20 XE	110	06/90 → 02/94		→08/92	SVB13875	13x875
					A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
					A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
					Alt. 70A, →08/92	SVB10913	10x913
					Alt. 90A, →08/90	SVB101000	10x1000
					Alt. 90A, →08/92	SVB10940	10x940
					→ Eng Nr 14142838	TB221	141x24
					Eng Nr 14142839→	TB509	176x24
					→ Eng Nr 14142838	TBK028	
					Eng Nr 14142839→	TBK111	
					A/C(-), →08/92	SVB10790	10x790
					A/C(+), →08/92	SVB10690	10x690
2.0 i 4x4	C 20 NE	85	06/90 → 07/97		→08/92	SVB13875	13x875
					A/C(-), 09/92→12/96, Ch. P...→	MVB1725R6	6PK1725
					A/C(+), 09/92→12/96, Ch. P...→	MVB1904R6	6PK1904
					Alt. 70A, →08/92	SVB10925	10x925
					Alt. 90A, →08/90	SVB101000	10x1000
					Alt. 90A, →08/92	SVB10940	10x940
					→12/96, → Eng Nr 14142838	TB155	111x20
					→12/96, Eng Nr 14142839→	TB508	146x20
					→12/96, Eng Nr 14142839→	TBK032	
					A/C(-), →08/92	SVB10800	10x800
					A/C(+), →08/92	SVB10690	10x690
2.0 i Turbo 4x4	C 20 LET	150	03/92 → 07/97		A/C(-), →02/96	MVB1725R6	6PK1725
					A/C(+), →02/96	MVB1904R6	6PK1904
					→02/96, → Eng Nr 14002934	TB221	141x24
					→02/96, Eng Nr 14002935→	TB509	176x24
					→02/96, → Eng Nr 14002934	TBK028	
2.5 i V6	C 25 XE, X 25 XE	125	04/93 → 07/97		A/C(+), 09/93→, → Ch. S9001729	MVB2265R6	6PK2265
					Eng. C25XE, A/C(-), 09/93→	MVB1904R6	6PK1904
					Eng. C25XE, A/C(+), 09/93→, Ch. S9001730→	MVB2020R6	6PK2020
					09/93→	TB481	225x30
					09/93→	TBK091	



kW



VAUXHALL

...VAUXHALL

CARLTON Mk II

1.8 S	18 S	65	12/82 → 08/86		Cat(-) Cat(+)	SVB10975 SVB10960 TB155 TB179 SVB10825	10x975 10x960 111x20 45x10 10x825
2.0 i	20 E	81	01/83 → 12/84		A/C(-) A/C(+)	SVB10888 SVB10875 SVB101075	10x888 10x875 10x1075
2.0 S	C 20 NEJ	74	10/78 → 08/86		A/C(-) A/C(+)	SVB10888 SVB10875 SVB101075	10x888 10x875 10x1075
2.2 i	22 E	85	11/84 → 08/86		A/C(-) A/C(+)	SVB10888 SVB10875 SVB101075	10x888 10x875 10x1075
2.3 D	23 D	52	05/83 → 08/86		→ Ch. F1000188 Ch. F1000189→	SVB10900 SVB10913 SVB10875 SVB10800	10x900 10x913 10x875 10x800

CARLTON Mk II Estate

1.8 S	18 S	66	11/82 → 08/86		Cat(-) Cat(+)	SVB10975 SVB10960 TB155 TB179 SVB10825	10x975 10x960 111x20 45x10 10x825
2.2 i	22 E	85	11/84 → 08/86		A/C(-) A/C(+)	SVB10888 SVB10875 SVB101075	10x888 10x875 10x1075
2.3 D	23 D	52	05/83 → 08/86		→ Ch. F1000188 Ch. F1000189→	SVB10900 SVB10913 SVB10875 SVB10800	10x900 10x913 10x875 10x800

CARLTON Mk III

1.8	E 18 NVR	65	09/87 → 03/94			SVB101000 TB155 SVB10800	10x1000 111x20 10x800
1.8 i	18 SEH	85	09/86 → 03/94		→09/91 →09/91 →09/91	SVB101000 TB155 SVB10800	10x1000 111x20 10x800
1.8 N	18 NV	60	09/86 → 08/87			SVB101000 TB155 SVB10800	10x1000 111x20 10x800
1.8 S	18 SV	66	09/86 → 03/94			SVB101000 TB155 SVB10800	10x1000 111x20 10x800
2.0	C 20 NEJ	73	09/90 → 03/94		MS PS Alt. 90A Not Alt. 90A → Eng Nr 14608700 Eng Nr 14608701→ Eng Nr 14608701→	SVB10813 SVB10790 SVB101025 SVB101000 TB155 TB508 TBK032 SVB10800	10x813 10x790 10x1025 10x1000 111x20 146x20 10x800
	C 20 NEF	74	09/90 → 03/94		MS PS Alt. 90A Not Alt. 90A → Eng Nr 14608700 Eng Nr 14608701→ Eng Nr 14608701→	SVB10813 SVB10790 SVB101025 SVB101000 TB155 TB508 TBK032 SVB10800	10x813 10x790 10x1025 10x1000 111x20 146x20 10x800



kW



...VAUXHALL

...CARLTON Mk III

2.0 i	20 SE	90	09/86 → 03/94	⚙️	MS	SVB10813	10x813
				⚙️	PS	SVB10790	10x790
				⚙️	Alt. 90A	SVB101025	10x1025
				⚙️	Not Alt. 90A	SVB101000	10x1000
				⚙️	→ Eng Nr 14608700	TB155	111x20
2.2 TD	23 YDT	66	10/86 → 08/88	⚙️	→ Eng Nr 14608701 →	TB508	146x20
				⚙️	Eng Nr 14608701 →	TBK032	
				⚙️	Eng Nr 14608701 →	SVB10800	10x800
				⚙️	→ Ch. K1000098	SVB10888	10x888
				⚙️	Ch. K1000099 →	SVB10913	10x913
2.3 D	23 YD	54	09/86 → 03/94	⚙️	Ch. K1000099 →	SVB10900	10x900
				⚙️	A/C(-)	SVB10813	10x813
				⚙️	A/C(+)	SVB10960	10x960
				⚙️	→ Ch. K1000098	SVB10888	10x888
				⚙️	Ch. K1000099 →	SVB10913	10x913
2.3 TD Interc.	23 DTR	74	08/88 → 03/94	⚙️	A/C(-)	SVB10813	10x813
				⚙️	A/C(+)	SVB10960	10x960
				⚙️	→ Ch. K1000098	SVB10888	10x888
				⚙️	Ch. K1000099 →	SVB10913	10x913
				⚙️	A/C(-)	SVB10900	10x900
2.6 i	C 26 NE	110	09/90 → 03/94	⚙️	A/C(+)	SVB10813	10x813
				⚙️	A/C(+), Alt. 120A,	SVB10960	10x960
				⚙️	Eng Nr 01032427 →	MVB1460R6	6PK1460
				⚙️	A/C(+), Not Alt. 120A,	MVB2225R6	6PK2225
				⚙️	Eng Nr 01032427 →	MVB2265R6	6PK2265
3.0 3000	30 NE	130	03/87 → 09/90	⚙️	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271
				⚙️	Eng Nr 01032427 →		
				⚙️	09/88 →, → Ch. M 1000000	SVB10888	10x888
				⚙️	A/C(-), 09/88 →,	MVB1460R6	6PK1460
				⚙️	Ch. M 1000001 →		
				⚙️	A/C(+),	MVB2225R6	6PK2225
				⚙️	09/88 →, → Eng Nr 01039674,		
				⚙️	Ch. M 1000001 →		
				⚙️	A/C(+), Alt. 120A, 09/88 →,	MVB2265R6	6PK2265
				⚙️	Eng Nr 01039675 →		
3.0 3000 24V	C 30 SE	150	09/89 → 03/94	⚙️	A/C(+),	MVB2271R6	6PK2271
				⚙️	Not Alt. 120A, 09/88 →,		
				⚙️	Eng Nr 01039675 →		
				⚙️	A/C(-), 09/88 →,	SVB10813	10x813
				⚙️	→ Ch. M 1000000		
				⚙️	A/C(+), 09/88 →,	SVB10960	10x960
				⚙️	→ Ch. M 1000000		
				⚙️	A/C(-)	MVB1460R6	6PK1460
				⚙️	A/C(+), → Eng Nr 01024729	MVB2225R6	6PK2225
				⚙️	A/C(+), Alt. 120A,	MVB2265R6	6PK2265
3.6 24V Lotus	C 36 GET	277	08/90 → 09/92	⚙️	Eng Nr 01024730 →	MVB2271R6	6PK2271
				⚙️	A/C(+), Not Alt. 120A,		
				⚙️	Eng Nr 01024730 →		
				⚙️	A/C(+), Not Alt. 120A,	MVB2225R6	6PK2225
				⚙️	Eng Nr 01024730 →		
3000 24V	C 30 SEJ	147	09/89 → 03/94	⚙️	A/C(+), Alt. 120A,	MVB2265R6	6PK2265
				⚙️	Eng Nr 01024730 →		
				⚙️	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271
				⚙️	Eng Nr 01024730 →		
				⚙️	A/C(-)	MVB1460R6	6PK1460



kw



VAUXHALL

...VAUXHALL
...CARLTON Mk III

3000 CAT	C 30 NE	130	03/88 → 03/94	⊗	09/88→, → Ch. M 1000000	SVB10888	10x888
				⊗	A/C(-), 09/88→,	MVB1460R6	6PK1460
					Ch. M 1000001→		
				⊗	A/C(+),	MVB2225R6	6PK2225
					09/88→, → Eng Nr 01039674,		
					Ch. M 1000001→		
				⊗	A/C(+), Alt. 120A, 09/88→,	MVB2265R6	6PK2265
					Eng Nr 01039675→		
				⊗	A/C(+),	MVB2271R6	6PK2271
					Not Alt. 120A, 09/88→,		
					Eng Nr 01039675→		
				⊗	A/C(-), 09/88→,	SVB10813	10x813
					→ Ch. M 1000000		
				⊗	A/C(+), 09/88→,	SVB10960	10x960
					→ Ch. M 1000000		

CARLTON Mk III Estate

1.8	E 18 NVR	65	09/87 → 03/94	⊗		SVB101000	10x1000
				☼		TB155	111x20
				⊗		SVB10800	10x800
1.8 i	18 SEH	85	09/86 → 03/94	⊗	→09/91	SVB101000	10x1000
				☼	→09/91	TB155	111x20
				⊗	→09/91	SVB10800	10x800
1.8 N	18 NV	60	09/86 → 08/87	⊗		SVB101000	10x1000
				☼		TB155	111x20
				⊗		SVB10800	10x800
1.8 S	18 SV	66	09/86 → 03/94	⊗		SVB101000	10x1000
				☼		TB155	111x20
				⊗		SVB10800	10x800
2.0	C 20 NEF	74	09/90 → 03/94	☼	MS	SVB10813	10x813
				☼	PS	SVB10790	10x790
				⊗	Alt. 90A	SVB101025	10x1025
				⊗	Not Alt. 90A	SVB101000	10x1000
				☼	→ Eng Nr 14608700	TB155	111x20
				☼	Eng Nr 14608701→	TB508	146x20
				☼ KIT	Eng Nr 14608701→	TBK032	
				⊗		SVB10800	10x800
2.0 i	20 SE	90	09/86 → 03/94	☼	MS	SVB10813	10x813
				☼	PS	SVB10790	10x790
				⊗	Alt. 90A	SVB101025	10x1025
				⊗	Not Alt. 90A	SVB101000	10x1000
				☼	→ Eng Nr 14608700	TB155	111x20
				☼	Eng Nr 14608701→	TB508	146x20
				☼ KIT	Eng Nr 14608701→	TBK032	
				⊗		SVB10800	10x800
2.2 TD	23 YDT	66	09/86 → 08/88	☼		SVB10888	10x888
				⊗	→ Ch. K1000098	SVB10913	10x913
				⊗	Ch. K1000099→	SVB10900	10x900
				⊗	A/C(-)	SVB10813	10x813
				⊗	A/C(+)	SVB10960	10x960
2.3 D	23 YD	54	09/86 → 03/94	☼		SVB10888	10x888
				⊗	→ Ch. K1000098	SVB10913	10x913
				⊗	Ch. K1000099→	SVB10900	10x900
				⊗	A/C(-)	SVB10813	10x813
				⊗	A/C(+)	SVB10960	10x960
2.3 TD Interc.	23 DTR	74	09/88 → 03/94	☼		SVB10888	10x888
				⊗	→ Ch. K1000098	SVB10913	10x913
				⊗	Ch. K1000099→	SVB10900	10x900
				⊗	A/C(-)	SVB10813	10x813
				⊗	A/C(+)	SVB10960	10x960





kW



...VAUXHALL

...CARLTON Mk III Estate

2.6 i	C 26 NE	110	09/90 → 03/94	⊗	A/C(-)	MVB1460R6	6PK1460
				⊗	A/C(+), → Eng Nr 01032426	MVB2225R6	6PK2225
				⊗	A/C(+), Alt. 120A, Eng Nr 01032427→	MVB2265R6	6PK2265
				⊗	A/C(+), Not Alt. 120A, Eng Nr 01032427→	MVB2271R6	6PK2271
3.0	C 30 NE	130	03/87 → 03/94	⊗	09/88→, → Ch. M 1000000	SVB10888	10x888
				⊗	A/C(-), 09/88→, Ch. M 1000001→	MVB1460R6	6PK1460
				⊗	A/C(+), 09/88→, → Eng Nr 01039674, Ch. M 1000001→	MVB2225R6	6PK2225
				⊗	A/C(+), Alt. 120A, 09/88→, Eng Nr 01039675→	MVB2265R6	6PK2265
				⊗	A/C(+), Not Alt. 120A, 09/88→, Eng Nr 01039675→	MVB2271R6	6PK2271
				⊗	A/C(-), 09/88→, → Ch. M 1000000	SVB10813	10x813
				⊗	A/C(+), 09/88→, → Ch. M 1000000	SVB10960	10x960
				⊗	A/C(-)	MVB1460R6	6PK1460
3.0 24V	C 30 SEJ	147	09/89 → 03/94	⊗	A/C(+), → Eng Nr 01024729	MVB2225R6	6PK2225
				⊗	A/C(+), Alt. 120A, Eng Nr 01024730→	MVB2265R6	6PK2265
				⊗	A/C(+), Not Alt. 120A, Eng Nr 01024730→	MVB2271R6	6PK2271
				⊗	A/C(-)	MVB1460R6	6PK1460

CAVALIER Mk II

1.3 N	13 N	44	09/81 → 08/88	⊗		SVB10875	10x875
				⊗		TB129	104x15
1.3 S	13 S	55	09/81 → 08/88	⊗		SVB10875	10x875
				⊗		TB129	104x15
1.6 D	16 D, 16 DA	40	03/82 → 08/88	⊗		SVB10913	10x913
				⊗	AUTO, → Eng Nr 14503756	TB178	147x24
				⊗	AUTO, Eng Nr 14503757→	TB224	146x24
				⊗	AUTO, → Eng Nr 14503756	TBK046	
				⊗	AUTO, Eng Nr 14503757→	TBK031	
1.6 i	E 16 NZ	55	08/86 → 08/88	⊗		SVB10850	10x850
				⊗		SVB13875	13x875
				⊗	MS	SVB10913	10x913
				⊗	PS, → Ch. M1169325,M5178236	MVB970R5	5PK970
				⊗	PS, Ch. M5178237,M1169326→	MVB985R5	5PK985
				⊗	→ Eng Nr 16-02J22349	TB218	104x17
				⊗	Eng Nr 16-02J22350→	TB336	111x17
				⊗	Eng Nr 16-02J22350→	TBK008	
1.6 i CAT	C 16 LZ, C 16 NZ	55	08/86 → 08/88	⊗		SVB13875	13x875
				⊗	MS	SVB10913	10x913
				⊗	PS, → Ch. M1169325,M5178236	MVB970R5	5PK970
				⊗	PS, Ch. M5178237,M1169326→	MVB985R5	5PK985
				⊗	→ Eng Nr 16-02J22349	TB218	104x17
				⊗	Eng Nr 16-02J22350→	TB336	111x17
				⊗	Eng Nr 16-02J22350→	TBK008	
				⊗	Eng Nr 16-02J22350→	TBK008	
1.6 N	16 N	55	09/81 → 08/88	⊗		SVB13875	13x875
				⊗	08/86→	SVB10913	10x913
				⊗	MS, 08/86→	SVB10913	10x913
				⊗	PS, 08/86→, → Ch. M1169325, M5178236	MVB970R5	5PK970
				⊗	PS, 08/86→, Ch. M5178237, M1169326→	MVB985R5	5PK985
				⊗	08/86→, → Eng Nr 16-02J22349	TB218	104x17
				⊗	08/86→, Eng Nr 16-02J22350→	TB336	111x17
				⊗	08/86→, Eng Nr 16-02J22350→	TBK008	



kW



VAUXHALL

...VAUXHALL

...CAVALIER Mk II

1.6 S	16 SH	66	09/81 → 08/88			SVB10888	10x888
						TB155	111x20
						SVB10850	10x850
1.8 i	18 SE	82	09/81 → 08/88		09/86 →	SVB10925	10x925
					09/86 →	TB155	111x20
	18 E	85	09/81 → 08/88		→08/86	SVB10888	10x888
					→08/86	TB155	111x20
					→08/86	SVB10850	10x850
1.8 i CAT	C 18 NE	74	01/85 → 08/86			SVB10888	10x888
						TB155	111x20
						SVB10850	10x850
2.0 i	20 NE	85	09/86 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
					A/C(-)		
2.0 i CAT	C 20 NE	85	09/86 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
					A/C(-)		
2.0 Sri 130	20 SEH	95	03/87 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
					A/C(-)		
2000i	20 SE	90	09/86 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
					A/C(-)		

CAVALIER Mk II Convertible

1800i	18 SE	82	03/85 → 10/88		→08/86	SVB10888	10x888
					09/86 →	SVB10925	10x925
						TB155	111x20
					→08/86	SVB10850	10x850

CAVALIER Mk II Estate

1.6	16 SH	66	10/83 → 08/88			SVB10888	10x888
						TB155	111x20
						SVB10850	10x850
1.8 i	18 E, 18 SE	82	09/81 → 08/86		Eng. 18E	SVB10888	10x888
						TB155	111x20
						SVB10850	10x850
					Eng. 18E		

CAVALIER Mk II Hatchback

1.3 S	13 S	55	09/81 → 08/88			SVB10875	10x875
						TB129	104x15
1.6 S	16 SH	66	09/81 → 08/88			SVB10888	10x888
						TB155	111x20
						SVB10850	10x850
1.8 i	18 SE	82	09/81 → 08/88		09/86 →	SVB10925	10x925
					09/86 →	TB155	111x20
		18 E	85	09/81 → 08/88		→08/86	SVB10888
					→08/86	TB155	111x20
					→08/86	SVB10850	10x850
2.0 i CAT	C 20 NE	85	09/86 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
					A/C(-)		
2.0 Sri 130	20 SEH	95	03/87 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
					A/C(-)		
1600D	16 D, 16 DA	40	03/82 → 08/88			SVB10913	10x913
						TB178	147x24
						TB224	146x24
						TBK046	
						TBK031	
						SVB10850	10x850
2000i	20 SE	90	09/86 → 08/88			SVB10925	10x925
						TB155	111x20
						SVB10850	10x850
					A/C(-)		



kW



...VAUXHALL

CAVALIER Mk III (87)

1.4 S	14 NV	55	09/88 → 11/95	⊗	→08/92	SVB10875	10x875	
				⊗	→08/92	SVB10913	10x913	
					→08/92, → Eng Nr 14-02J22349	TB218	104x17	
					→08/92, Eng Nr 14-02J22350→	TB336	111x17	
				KIT	→08/92, Eng Nr 14-02J22350→	TBK008		
1.6	16 SV	60	09/88 → 05/93	⊗	→08/92	SVB13875	13x875	
				⊗	A/C(-), PS, 09/92→	MVB1460R6	6PK1460	
				⊗	A/C(+), PS, 09/92→	MVB1805R6	6PK1805	
				⊗	MS	SVB10913	10x913	
				⊗	PS, → Ch. M1169325,M5178236	MVB970R5	5PK970	
				⊗	PS, →08/92, Ch. M5178237, M1169326→	MVB985R5	5PK985	
					→ Eng Nr 16-02J22349	TB218	104x17	
					Eng Nr 16-02J22350→	TB336	111x17	
				KIT	Eng Nr 16-02J22350→	TBK008		
				1.6 i	E 16 NZ	55	09/88 → 11/95	⊗
⊗	A/C(-), PS, 09/92→06/94	MVB1460R6	6PK1460					
⊗	A/C(+), PS, 09/92→06/94	MVB1805R6	6PK1805					
⊗	MS, →06/94	SVB10913	10x913					
⊗	PS, →06/94, → Ch. M1169325, M5178236	MVB970R5	5PK970					
⊗	PS, →08/92, Ch. M5178237, M1169326→	MVB985R5	5PK985					
	→06/94, → Eng Nr 16-02J22349	TB218	104x17					
	→06/94, Eng Nr 16-02J22350→	TB336	111x17					
KIT	→06/94, Eng Nr 16-02J22350→	TBK008						
1.7 D	17 D	42	09/88 → 09/92					⊗
				⊗		SVB10913	10x913	
					→ Eng Nr 14333430	TB224	146x24	
				KIT	→ Eng Nr 14333430	TBK031		
				⊗	AUTO	SVB10825	10x825	
	17 DR	44	07/92 → 11/95		⊗		SVB13875	13x875
					⊗		SVB10913	10x913
						→12/92, → Eng Nr 14333430	TB224	146x24
						01/93→, Eng Nr 14333431→	TB509	176x24
					KIT	→12/92, → Eng Nr 14333430	TBK031	
1.7 TD	17 DT (TC4EE1)	60	09/88 → 11/95	⊗	09/92→	SVB13925	13x925	
					09/92→08/94, → Ch. R...	TB413	136x25.4	
				KIT	09/92→08/94, → Ch. R...	TBK022		
				KIT	09/94→, Ch. S...→	TBK023		
				⊗	09/92→	SVB10950	10x950	
1.8	18 SV, C 18 NZ	66	09/88 → 10/92	⊗		SVB13875	13x875	
				⊗	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725	
				⊗	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904	
				⊗	Alt. 70A	SVB10925	10x925	
				⊗	Alt. 90A, →08/90	SVB101000	10x1000	
				⊗	Alt. 90A, 09/90→	SVB10940	10x940	
					→ Eng Nr 14142838	TB155	111x20	
				⊗	A/C(-)	SVB10800	10x800	
				⊗	A/C(+)	SVB10690	10x690	



kw



VAUXHALL

...VAUXHALL

...CAVALIER Mk III (87)

Model	Engine	Power (kw)	Period	Accessories	Options	Part Numbers	Dimensions					
1.8 i CAT	C 18 NZ	66	03/90 → 11/95		→08/92	SVB13875	13x875					
					A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725					
					A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904					
					Alt. 70A, →08/92	SVB10925	10x925					
					Alt. 90A, →08/90	SVB101000	10x1000					
					Alt. 90A, 09/90→08/92	SVB10940	10x940					
					→12/92, → Eng Nr 14142838	TB155	111x20					
					01/93→, Eng Nr 14142839→	TB508	146x20					
					01/93→, Eng Nr 14142839→	TBK032						
					A/C(-), →08/92	SVB10800	10x800					
A/C(+), →08/92	SVB10690	10x690										
2.0 i	20 NE	85	09/88 → 10/90		Alt. 70A	SVB13875	13x875					
					Alt. 90A	SVB10925	10x925					
					Alt. 90A, 09/90→	SVB101000	10x1000					
					→ Eng Nr 14142838	SVB10940	10x940					
						TB155	111x20					
					A/C(-)	SVB10800	10x800					
					A/C(+)	SVB10690	10x690					
					2.0 i 4x4	20 NE	85	01/91 → 10/92			SVB13875	13x875
										A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
										A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
Alt. 70A	SVB10925	10x925										
Alt. 90A	SVB10940	10x940										
→ Eng Nr 14142838	TB155	111x20										
A/C(-)	SVB10800	10x800										
A/C(+)	SVB10690	10x690										
2.0 i 16V	C 20 XE	110	09/88 → 11/95							09/89→08/92	SVB13875	13x875
										A/C(-), 09/92→06/94, Ch. P...→	MVB1725R6	6PK1725
					A/C(+), 09/92→06/94, Ch. P...→	MVB1904R6	6PK1904					
					Alt. 70A, 09/89→08/92	SVB10913	10x913					
					Alt. 90A, 09/89→08/90	SVB101000	10x1000					
					Alt. 90A, 09/90→08/92	SVB10940	10x940					
					01/93→06/94, Eng Nr 14142839→	TB509	176x24					
					09/89→12/92, → Eng Nr 14142838	TB221	141x24					
					01/93→06/94, Eng Nr 14142839→	TBK111						
					09/89→12/92, → Eng Nr 14142838	TBK028						
A/C(-), 09/89→08/92	SVB10790	10x790										
A/C(+), 09/89→08/92	SVB10690	10x690										
2.0 i 16V 4x4	C 20 XE	110	09/88 → 11/95		09/89→08/92	SVB13875	13x875					
					A/C(-), 09/92→06/94, Ch. P...→	MVB1725R6	6PK1725					
					A/C(+), 09/92→06/94, Ch. P...→	MVB1904R6	6PK1904					
					Alt. 70A, 09/89→08/92	SVB10913	10x913					
					Alt. 90A, 09/89→08/90	SVB101000	10x1000					
					Alt. 90A, 09/90→08/92	SVB10940	10x940					
					01/93→06/94, Eng Nr 14142839→	TB509	176x24					
					09/89→12/92, → Eng Nr 14142838	TB221	141x24					
					01/93→06/94, Eng Nr 14142839→	TBK111						
					09/89→12/92, → Eng Nr 14142838	TBK028						
A/C(-), 09/89→08/92	SVB10790	10x790										
A/C(+), 09/89→08/92	SVB10690	10x690										



kW



...VAUXHALL

...CAVALIER Mk III (87)

2.0 i 4x4	20 SEH	95	09/88 → 09/92	⚙️		SVB13875	13x875
				⚙️	Alt. 70A	SVB10925	10x925
				⚙️	Alt. 90A, →08/90	SVB101000	10x1000
				⚙️	Alt. 90A, 09/90→	SVB10940	10x940
				🔧	→ Eng Nr 14142838	TB155	111x20
				⚙️	A/C(-)	SVB10800	10x800
2.0 i CAT	C 20 NE	85	09/90 → 11/95	⚙️	→08/92	SVB13875	13x875
				⚙️	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
				⚙️	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
				⚙️	Alt. 70A, →08/92	SVB10925	10x925
				⚙️	Alt. 90A, →08/92	SVB10940	10x940
				🔧	→12/92, → Eng Nr 14142838	TB155	111x20
				🔧	01/93→, Eng Nr 14142839→	TB508	146x20
				🔧KIT	01/93→, Eng Nr 14142839→	TBK032	
				⚙️	A/C(-), →08/92	SVB10800	10x800
				⚙️	A/C(+), →08/92	SVB10690	10x690
2.0 i Turbo 4x4	C 20 LET	150	06/92 → 11/94	⚙️	A/C(-), →06/94	MVB1725R6	6PK1725
				⚙️	A/C(+), →06/94	MVB1904R6	6PK1904
				🔧	→12/92, → Eng Nr 14002934	TB221	141x24
				🔧	01/93→06/94,	TB509	176x24
				🔧KIT	Eng Nr 14002935→	TBK028	
2.0 SRI	20 SEH	95	09/88 → 09/92	⚙️	→12/92, → Eng Nr 14002934	SVB13875	13x875
				⚙️	Alt. 70A	SVB10925	10x925
				⚙️	Alt. 90A, →08/90	SVB101000	10x1000
				⚙️	Alt. 90A, 09/90→	SVB10940	10x940
				🔧	→ Eng Nr 14142838	TB155	111x20
				⚙️	A/C(-)	SVB10800	10x800
2.0 SRI 16V	X 20 XEV	100	09/93 → 11/95	⚙️	A/C(+)	SVB10690	10x690
				⚙️	A/C(-)	MVB1725R6	6PK1725
				⚙️	A/C(+)	MVB1904R6	6PK1904
				🔧		TB783	169x24
2.5 V6	C 25 XE	125	02/93 → 11/95	🔧KIT		TBK261	
				⚙️	A/C(-)	MVB1904R6	6PK1904
				⚙️	A/C(+), Alt. 120A	MVB2265R6	6PK2265
				⚙️	A/C(+), Not Alt. 120A	MVB2271R6	6PK2271
				🔧		TB481	225x30
				🔧KIT		TBK091	

CAVALIER Mk III Hatchback

1.4 S	14 NV	55	09/88 → 11/95	⚙️	→08/92	SVB10875	10x875
				⚙️	→08/92	SVB10913	10x913
				🔧	→08/92, → Eng Nr 14-02J22349	TB218	104x17
				🔧	→08/92, Eng Nr 14-02J22350→	TB336	111x17
				🔧KIT	→08/92, Eng Nr 14-02J22350→	TBK008	
1.6	16 SV	60	09/88 → 05/93	⚙️	→08/92	SVB13875	13x875
				⚙️	A/C(-), PS, 09/92→	MVB1460R6	6PK1460
				⚙️	A/C(+), PS, 09/92→	MVB1805R6	6PK1805
				⚙️	MS	SVB10913	10x913
				⚙️	PS, → Ch. M1169325,M5178236	MVB970R5	5PK970
				⚙️	PS, →08/92, Ch. M5178237,	MVB985R5	5PK985
					M1169326→		
				🔧	→ Eng Nr 16-02J22349	TB218	104x17
				🔧	Eng Nr 16-02J22350→	TB336	111x17
				🔧KIT	Eng Nr 16-02J22350→	TBK008	



kW



VAUXHALL

...VAUXHALL

...CAVALIER Mk III Hatchback

Engine	Model	kW	Year Range	Accessories	Options	Part Numbers	Dimensions
1.6 i	E 16 NZ	55	09/88 → 11/95	⚙️	→08/92	SVB13875	13x875
				⚙️	A/C(-), PS, 09/92→06/94	MVB1460R6	6PK1460
				⚙️	A/C(+), PS, 09/92→06/94	MVB1805R6	6PK1805
				⚙️	MS, →06/94	SVB10913	10x913
				⚙️	PS, →06/94, → Ch. M1169325, M5178236	MVB970R5	5PK970
				⚙️	PS, →08/92, Ch. M5178237, M1169326→	MVB985R5	5PK985
				⚙️	→06/94, → Eng Nr 16-02J22349	TB218	104x17
1.7 D	17 D	42	09/88 → 09/92	⚙️	→06/94, Eng Nr 16-02J22350→	TB336	111x17
				⚙️	→06/94, Eng Nr 16-02J22350→	TBK008	
				⚙️	→06/94, Eng Nr 16-02J22350→	TBK008	
				⚙️	→ Eng Nr 14333430	TB224	146x24
				⚙️	→ Eng Nr 14333430	TBK031	
				⚙️	AUTO	SVB10825	10x825
				⚙️	MAN	SVB10813	10x813
1.7 D	17 DR	44	07/92 → 11/95	⚙️		SVB13875	13x875
				⚙️		SVB10913	10x913
				⚙️	→12/92, → Eng Nr 14333430	TB224	146x24
				⚙️	01/93→, Eng Nr 14333431→	TB509	176x24
				⚙️	→12/92, → Eng Nr 14333430	TBK031	
				⚙️	01/93→, Eng Nr 14333431→	TBK081	
				⚙️	AUTO	SVB10825	10x825
1.7 TD	17 DT (TC4EE1)	60	09/88 → 11/95	⚙️	09/92→	SVB13925	13x925
				⚙️	09/92→08/94, → Ch. R...	TB413	136x25.4
				⚙️	09/92→08/94, → Ch. R...	TBK022	
				⚙️	09/94→, Ch. S...→	TBK023	
				⚙️	09/92→	SVB10950	10x950
				⚙️		SVB13875	13x875
				⚙️	Alt. 70A	SVB10925	10x925
1.8	18 SV, C 18 NZ	66	09/88 → 10/90	⚙️	Alt. 90A	SVB101000	10x1000
				⚙️	Alt. 90A, 09/90→	SVB10940	10x940
				⚙️	→ Eng Nr 14142838	TB155	111x20
				⚙️	A/C(-)	SVB10800	10x800
				⚙️	A/C(+)	SVB10690	10x690
				⚙️		SVB13875	13x875
				⚙️	Alt. 70A, →08/92	SVB10925	10x925
1.8 i CAT	C 18 NZ	66	03/90 → 11/95	⚙️	Alt. 90A, →08/90	SVB101000	10x1000
				⚙️	Alt. 90A, 09/90→08/92	SVB10940	10x940
				⚙️	→12/92, → Eng Nr 14142838	TB155	111x20
				⚙️	01/93→, Eng Nr 14142839→	TB508	146x20
				⚙️	01/93→, Eng Nr 14142839→	TBK032	
				⚙️	A/C(-), →08/92	SVB10800	10x800
				⚙️	A/C(+), →08/92	SVB10690	10x690
2.0 i	20 NE	85	09/88 → 10/92	⚙️		SVB13875	13x875
				⚙️	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
				⚙️	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
				⚙️	Alt. 70A	SVB10925	10x925
				⚙️	Alt. 90A, →08/90	SVB101000	10x1000
				⚙️	Alt. 90A, 09/90→	SVB10940	10x940
				⚙️	→ Eng Nr 14142838	TB155	111x20
2.0 i	20 NE	85	09/88 → 10/92	⚙️	A/C(-)	SVB10800	10x800
				⚙️	A/C(+)	SVB10690	10x690
				⚙️		SVB13875	13x875
				⚙️	A/C(-), 09/92→, Ch. P...→	MVB1725R6	6PK1725
				⚙️	A/C(+), 09/92→, Ch. P...→	MVB1904R6	6PK1904
				⚙️	Alt. 70A	SVB10925	10x925
				⚙️	Alt. 90A, →08/90	SVB101000	10x1000



kW



...VAUXHALL

...CAVALIER Mk III Hatchback

Model	Engine	kW	Year Range	Accessories	Part Numbers	Dimensions
2.0 i 16V	C 20 XE	110	09/88 → 11/95	⚙️	09/89→08/92	SVB13875 13x875
				⚙️	A/C(-), 09/92→06/94, Ch. P...→	MVB1725R6 6PK1725
				⚙️	A/C(+), 09/92→06/94, Ch. P...→	MVB1904R6 6PK1904
				⚙️	Alt. 70A, 09/89→08/92	SVB10913 10x913
				⚙️	Alt. 90A, 09/89→08/90	SVB101000 10x1000
				⚙️	Alt. 90A, 09/90→08/92	SVB10940 10x940
				⚙️	01/93→06/94, Eng Nr 14142839→	TB509 176x24
				⚙️	09/89→12/92, → Eng Nr 14142838	TB221 141x24
				⚙️	01/93→06/94, Eng Nr 14142839→	TBK111
				⚙️	09/89→12/92, → Eng Nr 14142838	TBK028
X 20 XEV	100	09/93 → 11/95	⚙️	A/C(-)	SVB10790 10x790	
			⚙️	A/C(+)	SVB10690 10x690	
			⚙️	A/C(-)	MVB1725R6 6PK1725	
			⚙️	A/C(+)	MVB1904R6 6PK1904	
2.0 i 16V 4x4	C 20 XE	110	01/92 → 11/93	⚙️	→08/92	TB783 169x24
				⚙️	A/C(-), 09/92→, Ch. P...→	TBK261
				⚙️	A/C(+), 09/92→, Ch. P...→	SVB13875 13x875
				⚙️	Alt. 70A, →08/92	MVB1725R6 6PK1725
				⚙️	Alt. 90A, →08/92	MVB1904R6 6PK1904
				⚙️	→12/92, → Eng Nr 14142838	SVB10913 10x913
				⚙️	01/93→, Eng Nr 14142839→	SVB10940 10x940
				⚙️	→12/92, → Eng Nr 14142838	TB221 141x24
				⚙️	01/93→, Eng Nr 14142839→	TB509 176x24
				⚙️	→12/92, → Eng Nr 14142838	TBK028
2.0 i 4x4	20 NE	85	01/91 → 10/92	⚙️	01/93→, Eng Nr 14142839→	TBK111
				⚙️	A/C(-), →08/92	SVB10790 10x790
				⚙️	A/C(+), →08/92	SVB10690 10x690
				⚙️	→08/92	SVB13875 13x875
				⚙️	A/C(-), 09/92→, Ch. P...→	MVB1725R6 6PK1725
				⚙️	A/C(+), 09/92→, Ch. P...→	MVB1904R6 6PK1904
2.0 SEH	95	09/88 → 09/92	09/88 → 09/92	⚙️	Alt. 70A	SVB10925 10x925
				⚙️	Alt. 90A, →08/90	SVB101000 10x1000
				⚙️	Alt. 90A, 09/90→	SVB10940 10x940
				⚙️	→ Eng Nr 14142838	TB155 111x20
				⚙️	A/C(-)	SVB10800 10x800
				⚙️	A/C(+)	SVB10690 10x690
				⚙️	Alt. 70A	SVB13875 13x875
				⚙️	Alt. 90A, →08/90	SVB10925 10x925
				⚙️	Alt. 90A, 09/90→	SVB101000 10x1000
				⚙️	→ Eng Nr 14142838	SVB10940 10x940
2.0 i CAT	C 20 NE	85	09/90 → 11/95	⚙️	A/C(-)	TB155 111x20
				⚙️	A/C(+)	SVB10800 10x800
				⚙️	→08/92	SVB10690 10x690
				⚙️	A/C(-), 09/92→, Ch. P...→	SVB13875 13x875
				⚙️	A/C(+), 09/92→, Ch. P...→	MVB1725R6 6PK1725
				⚙️	Alt. 70A, →08/92	MVB1904R6 6PK1904
				⚙️	Alt. 90A, →08/92	SVB10925 10x925
				⚙️	→12/92, → Eng Nr 14142838	SVB10940 10x940
				⚙️	01/93→, Eng Nr 14142839→	TB155 111x20
				⚙️	01/93→, Eng Nr 14142839→	TB508 146x20
2.0 i CAT	C 20 NE	85	09/90 → 11/95	⚙️	01/93→, Eng Nr 14142839→	TBK032
				⚙️	A/C(-), →08/92	SVB10800 10x800
				⚙️	A/C(+), →08/92	SVB10690 10x690
				⚙️	A/C(-), →08/92	SVB10800 10x800



kW



...VAUXHALL

...CAVALIER Mk III Hatchback

2.0 SRI	20 SEH	95	09/88 → 09/92	☼		SVB13875	13x875
				⊗	Alt. 70A	SVB10925	10x925
				⊗	Alt. 90A, →08/90	SVB101000	10x1000
				⊗	Alt. 90A, 09/90→	SVB10940	10x940
				⊗	→ Eng Nr 14142838	TB155	111x20
				⊗	A/C(-)	SVB10800	10x800
				⊗	A/C(+)	SVB10690	10x690
2.5 V6	C 25 XE	125	02/93 → 11/95	⊗	A/C(-)	MVB1904R6	6PK1904
				⊗	A/C(+), Alt. 120A	MVB2265R6	6PK2265
				⊗	A/C(+), Not Alt. 120A	MVB2271R6	6PK2271
				⊗		TB481	225x30
				⊗		TBK091	

CHEVETTE

1300	13 N	39	03/75 → 12/85	⊗	→08/84	SVB10940	10x940
				⊗	→08/84	SVB10950	10x950
	13 S	42	03/75 → 12/85	⊗	→08/84	SVB10940	10x940
				⊗	→08/84	SVB10950	10x950

CHEVETTE Estate

1.2	13 N	39	09/76 → 12/85	⊗	→08/84	SVB10940	10x940
				⊗	→08/84	SVB10950	10x950
1300	13 S	42	09/76 → 12/85	⊗	→08/84	SVB10940	10x940
				⊗	→08/84	SVB10950	10x950

CHEVETTE Hatchback

1300	13 N	39	03/75 → 12/85	⊗	→08/84	SVB10940	10x940
				⊗	→08/84	SVB10950	10x950
	13 S	42	03/75 → 12/85	⊗	→08/84	SVB10940	10x940
				⊗	→08/84	SVB10950	10x950

COMBO

1.3 CDTI 16V	Z 13 DTJ	55	10/05 →	⊗	A/C(-)	MVB1180R6	6PK1180
				⊗	A/C(+)	MVB1318R6	6PK1318
1.4	C 14 NZ	44	07/94 → 10/01	⊗	A/C(-), MS	SVB10913	10x913
				⊗	A/C(-), PS	MVB1460R6	6PK1460
				⊗	A/C(+)	MVB1805R6	6PK1805
				⊗		TB336	111x17
				⊗		TBK008	
	C 14 SE	60	07/94 → 10/01	⊗	A/C(-), MS	SVB10913	10x913
				⊗	A/C(-), PS	MVB1460R6	6PK1460
				⊗	A/C(+)	MVB1805R6	6PK1805
				⊗		TB336	111x17
				⊗		TBK008	
	Z 14 XEP	66	01/04 →	⊗	A/C(-), 10/04→	MVB1230R5	5PK1230
				⊗	A/C(+), 10/04→	MVB1370R5	5PK1370
1.6	Z 16 SE	64	10/01 →	⊗	A/C(-), →10/04	MVB938R5	5PK938
				⊗	A/C(+), →10/04	MVB1215R5	5PK1215
				⊗	→10/04	TB336	111x17
				⊗	→10/04	TBK008	
1.7 D	17 D (4EE1), X 17 D (4EE1)	44	07/94 → 10/01	⊗	A/C(-)	SVB13925	13x925
				⊗	Eng. X17D, A/C(+)	SVB13900	13x900
				⊗	→ Ch. R...	TB413	136x25.4
				⊗		TBK023	
				⊗	→08/94, → Ch. R...	TBK022	
				⊗	Eng. X17D	SVB10950	10x950
1.7 DI 16V	Y 17 DTL	48	09/01 →	⊗	A/C(-)	MVB1250R6	6PK1250
				⊗	A/C(+)	MVB1588R6	6PK1588
				⊗		TB656	131x25
1.7 DTI 16V	Y 17 DT	55	10/01 →	⊗	A/C(-)	MVB1250R6	6PK1250
				⊗	A/C(+)	MVB1588R6	6PK1588
				⊗		TB656	131x25



kW



...VAUXHALL

CORSA

1.0 i 12V	X 10 XE	40	11/96 → 09/00		A/C(-), 06/97→	MVB1230R5	5PK1230
					A/C(+), 06/97→	MVB1360R5	5PK1360
1.2 i	C 12 NZ, X 12 SZ	33	03/93 → 09/00		MS, →08/94, Ch. R ...→	SVB10913	10x913
					MS, 08/94→, Ch. S ...→	SVB10925	10x925
					PS	MVB1460R6	6PK1460
						TB336	111x17
						TBK008	
1.2 i 16V	X 12 XE	48	03/98 → 09/00		A/C(-), 08/98→	MVB1230R5	5PK1230
					A/C(+), 08/98→	MVB1360R5	5PK1360
1.4 i	C 14 NZ, X 14 SZ	44	03/93 → 09/00		A/C(-), MS	SVB10913	10x913
					A/C(-), PS	MVB1460R6	6PK1460
					A/C(+)	MVB1805R6	6PK1805
						TB336	111x17
						TBK008	
1.4 i 16V	X 14 XE	66	09/94 → 09/00		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	
1.4 i S	C 14 SE	60	03/93 → 09/00		A/C(-), MS	SVB10913	10x913
					A/C(-), PS	MVB1460R6	6PK1460
					A/C(+)	MVB1805R6	6PK1805
						TB336	111x17
						TBK008	
1.5 D	15 D (4EC1)	37	03/93 → 09/00			SVB13925	13x925
						TB413	136x25.4
						TBK021	
						SVB10950	10x950
1.5 TD	15 DT (T4EC1), X 15 DT (T4EC1)	49	03/93 → 10/96			SVB13925	13x925
						TB413	136x25.4
						TBK021	
						SVB10950	10x950
1.6 GSI 16V	C 16 XE	80	03/93 → 09/00		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	
1.6 i 16V	X 16 XE	78	09/94 → 09/00		A/C(-), MS	MVB890R6	6PK890
					A/C(-), PS	MVB1530R6	6PK1530
					A/C(+)	MVB1805R6	6PK1805
						TB780	169x20
						TBK260	
1.7 D	17 D (4EE1), X 17 D (4EE1)	44	02/96 → 09/00		A/C(-)	SVB13925	13x925
					Eng. X17D, A/C(+)	SVB13900	13x900
						TB413	136x25.4
						TBK023	
					Eng. X17D	SVB10950	10x950

CORSA Mk II

1.0 12V	Z 10 XE	43	09/00 →		A/C(-), →10/03	MVB1230R5	5PK1230
					A/C(+), →10/03	MVB1360R5	5PK1360
	Z 10 XEP	44	11/03 →		A/C(-), →11/06	MVB1230R5	5PK1230
					A/C(+), →11/06	MVB1360R5	5PK1360
1.2 16V	Z 12 XE	55	09/00 →		A/C(-), →07/04	MVB1230R5	5PK1230
					A/C(+), →07/04,	MVB1360R5	5PK1360
					→ Ch. 44001048		
					A/C(+), →07/04,	MVB1370R5	5PK1370
					Ch. 44001049→		



kw



VAUXHALL

...VAUXHALL

...CORSA Mk II

1.2 16V Dualfuel	Z 12 XE	55	08/01 →	①	A/C(-), →07/04	MVB1230R5	5PK1230
				②	A/C(+), →07/04, → Ch. 44001048	MVB1360R5	5PK1360
				③	A/C(+), →07/04, Ch. 44001049 →	MVB1370R5	5PK1370
1.3 CDTI 16V	Z 13 DT	52	04/04 →	①	A/C(-), →11/06	MVB1180R6	6PK1180
				②	A/C(+), →11/06	MVB1318R6	6PK1318
1.4 16V	Z 14 XE	66	09/00 →	①	A/C(-), →10/03	MVB938R5	5PK938
				②	A/C(+), →10/03	MVB1215R5	5PK1215
				③	→10/03	TB638	162x20
				④	→10/03, → Eng Nr 02NF0884, 20V82069	TBK103	
1.7 CDTI 16V	Z 17 DTH	74	04/04 →	①	A/C(-), →11/06	MVB1270R6	6PK1270
				②	A/C(+), →11/06	MVB1600R6	6PK1600
				③	→11/06	TB656	131x25
1.7 DI 16V	Y 17 DTL	48	09/00 →	①	A/C(-), →10/03	MVB1250R6	6PK1250
				②	A/C(+), →10/03	MVB1588R6	6PK1588
				③	→10/03	TB656	131x25
1.7 DTI 16V	Y 17 DT	55	09/00 →	①	A/C(-), →10/03	MVB1250R6	6PK1250
				②	A/C(+), →10/03	MVB1588R6	6PK1588
				③	→10/03	TB656	131x25
1.8 16V	Z 18 XE	92	09/00 →	①	A/C(-), →08/04	MVB938R5	5PK938
				②	A/C(+), →08/04	MVB1215R5	5PK1215
				③	→08/04	TB638	162x20
				④	→08/04, → Eng Nr 02NF0884, 20V82069	TBK103	
1.8 16V	Z 18 XE	92	09/00 →	⑤	→08/04, Eng Nr 02NF0885, 20V82070 →	TBK240	
				⑥			

CORSA Mk III

1.0	Z 10 XEP	44	07/06 →	①	A/C(-)	MVB1230R5	5PK1230
				②	A/C(+)	MVB1360R5	5PK1360
1.2	Z 12 XEP	59	07/06 →	①	A/C(-)	MVB1230R5	5PK1230
				②	A/C(+), → Ch. 36152608	MVB1360R5	5PK1360
				③	A/C(+), →11/06,	MVB1370R5	5PK1370
				④	Ch. 36152609 →		
1.3 CDTI	Z 13 DTJ	55	07/06 →	①	A/C(-)	MVB1180R6	6PK1180
				②	A/C(+)	MVB1318R6	6PK1318
	Z 13 DTH	66	07/06 →	①	A/C(-)	MVB1180R6	6PK1180
1.4	Z 14 XEP	66	07/06 →	②	A/C(+)	MVB1318R6	6PK1318
				③	A/C(-)	MVB1230R5	5PK1230
				④	A/C(+)	MVB1360R5	5PK1360
1.6 Turbo	Z 16 LER	141	02/07 →	①	A/C(+), →11/06	MVB1370R5	5PK1370
				②	A/C(-)	MVB1450R5	5PK1450
				③	A/C(+)	MVB1550R5	5PK1550
1.7 CDTI	A 17 DTR	92	07/06 →	④		TB741	146x24
				⑤	A/C(-), 11/06 →	MVB1250R6	6PK1250
				⑥	A/C(+), 11/06 →	MVB1613R6	6PK1613
				⑦	11/06 →	TB656	131x25

CORSAVAN

1.4 i	C 14 NZ	44	01/94 → 09/00	①	A/C(-), MS	SVB10913	10x913
				②	A/C(-), PS	MVB1460R6	6PK1460
				③	A/C(+)	MVB1805R6	6PK1805
				④		TB336	111x17
1.7 D	17 D (4EE1), X 17 D (4EE1)	44	01/94 → 09/00	⑤		TBK008	
				⑥	A/C(-), 03/96 →	SVB13925	13x925
				⑦	Eng. X17D, A/C(+), 03/96 →	SVB13900	13x900
				⑧	03/96 →	TB413	136x25.4
				⑨	03/96 →	TBK023	
				⑩	Eng. X17D, 03/96 →	SVB10950	10x950





kW



...VAUXHALL

CORSAVAN MK II

1.2 16V	Z 12 XE	55	09/00 →		A/C(-), 08/01 → 07/04	MVB1230R5	5PK1230
					A/C(+), 08/01 → 07/04	MVB1360R5	5PK1360
1.2 16V Dualfuel	Z 12 XE	55	08/01 →		A/C(-), → 07/04	MVB1230R5	5PK1230
					A/C(+), → 07/04	MVB1360R5	5PK1360
1.3 CDTI 16V	Z 13 DT	52	04/04 →		A/C(-)	MVB1180R6	6PK1180
					A/C(+)	MVB1318R6	6PK1318
1.7 DI 16V	Y 17 DTL	48	09/00 →		A/C(-), 08/01 →	MVB1250R6	6PK1250
					A/C(+), 08/01 →	MVB1588R6	6PK1588
					08/01 →	TB656	131x25
1.7 DTI 16V	Y 17 DT	55	09/00 →		A/C(-), 08/01 →	MVB1250R6	6PK1250
					A/C(+), 08/01 →	MVB1588R6	6PK1588
					08/01 →	TB656	131x25

FRONTERA

2.2 i	X 22 XE	100	03/95 → 10/98		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB2050R6	6PK2050
						TB524	171x24
2.3 TD	23 DTR	74	03/92 → 10/98		→ 03/95	SVB10900	10x900
					→ 03/95	SVB10825	10x825
2.4 i	C 24 NE	92	03/92 → 10/98		Alt. 90A, → 03/95	SVB10875	10x875
					Not Alt. 90A, → 03/95	SVB10888	10x888
					→ 03/95	SVB10825	10x825
2.5 TDS	25TDS (VM41B)	85	09/96 → 10/98			MVB2188R8	8PK2188
2.8 TD	28 TDI (4JB1T)	83	03/95 → 10/98		→ 08/96	SVB131525	13x1525
					→ 08/96	SVB171055	17x1055
					→ 08/96	TB291	119x32
					→ 08/96	TBK075	
					→ 08/96	SVB131450	13x1450

FRONTERA Mk II

2.2 DTI	X 22 DTH, Y 22 DTH	85	10/98 →		A/C(-), → 10/04	MVB1805R6	6PK1805
					A/C(+), → 10/04	MVB1904R6	6PK1904
2.2 i	X 22 SE, Y 22 SE	100	10/98 →		A/C(-), → 10/03	MVB1725R6	6PK1725
					A/C(+), → 10/03	MVB1855R6	6PK1855
					→ 10/03	TB524	171x24
3.2 i	6 VD1, Y 32 NE	151	10/98 →		Eng. 32D1, A/C(-), → 10/04	MVB2040R6	6PK2040
					Eng. 32D1, A/C(+), → 10/04	MVB2280R6	6PK2280
					→ 10/04	TB436	191x32

FRONTERA Sport

2.0 i	C 20 NE, X 20 SE	85	03/92 → 10/98		Eng. C20NE, Alt. 90A, → 08/96	SVB101025	10x1025
					Eng. C20NE, Not Alt. 90A, → 08/96	SVB101000	10x1000
					Eng. X20SE, A/C(-), 09/96 →	MVB1725R6	6PK1725
					Eng. X20SE, A/C(+), 09/96 →	MVB2050R6	6PK2050
						TB508	146x20
					→ 08/96, → Eng Nr 14142838	TB155	111x20
						TBK032	
					→ 08/96	SVB10790	10x790
2.5 TDS	25TDS (VM41B)	85	09/96 → 10/98			MVB2188R8	8PK2188
2.8 TD	28 TDI (4JB1T)	83	03/95 → 08/96			SVB131525	13x1525
						SVB171055	17x1055
						TB291	119x32
						TBK075	
						SVB131450	13x1450

MERIVA

1.3 CDTI	Z 13 DTJ	55	09/03 →		A/C(-), 04/06 →	MVB1180R6	6PK1180
					A/C(+), 04/06 →	MVB1318R6	6PK1318
1.4 16V Twinport	Z 14 XEP	66	07/04 →		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1370R5	5PK1370



kW



VAUXHALL

...VAUXHALL

...MERIVA

1.6 i	Z 16 SE	64	05/03 →	 	A/C(-), →07/04 A/C(+), →07/04 →07/04 →07/04	MVB938R5 MVB1215R5 TB336 TBK008	5PK938 5PK1215 111x17
1.6 i 16V	Z 16 XE	74	05/03 →	 	A/C(-), →07/05 A/C(+), →07/05 →07/05 →07/05, → Eng Nr 20EB2049	MVB938R5 MVB1215R5 TB638 TBK240	5PK938 5PK1215 162x20
1.6 i 16V Twinport	Z 16 XEP	77	01/06 →	 	A/C(-) A/C(+)	MVB1450R5 MVB1550R5 TB741	5PK1450 5PK1550 146x24
1.6 Turbo	Z 16 LET	132	05/06 →	 	A/C(-) A/C(+)	MVB1450R5 MVB1550R5 TB741	5PK1450 5PK1550 146x24
1.7 CDTI 16V	Z 17 DTH	74	04/04 →	 	A/C(-) A/C(+)	MVB1270R6 MVB1600R6 TB656	6PK1270 6PK1600 131x25
1.8 i 16V	Z 18 XE	92	05/03 →	 	A/C(-) A/C(+) → Eng Nr 230EK4285	MVB938R5 MVB1215R5 TB638 TBK240	5PK938 5PK1215 162x20

MIDI

1.8		63	09/84 → 05/88	 	→12/85 01/86 →	SVB10760 SVB13950 SVB13900 SVB13875 TB209 SVB131025	10x760 13x950 13x900 13x875 111x19 13x1025
2.0 TD		50	09/84 → 05/88	 	MS PS	SVB131375 TB522 SVB131025 SVB131000 SVB10665	13x1375 137x30 13x1025 13x1000 10x665

MIDI II

2.0		62	06/88 →	 	→08/92 →02/96 →02/96 →08/92	SVB10760 SVB13900 TB209 SVB131025	10x760 13x900 111x19 13x1025
2.0 TD	4FC1T	51	06/88 → 02/96	 	MS, →08/94 PS, →08/94 →08/94 →08/94	SVB131025 SVB131000 TB522 SVB10665	13x1025 13x1000 137x30 10x665
2.2 D	4FD1	45	07/90 →	 	MS, →08/94 PS, →08/94 →08/94 →08/94	SVB131025 SVB131000 TB522 SVB10665	13x1025 13x1000 137x30 10x665
2.4 TD	4FG1T	56	09/94 →	 	MS, →07/96 PS, →07/96 →07/96 →07/96	SVB131025 SVB131000 TB522 SVB10665	13x1025 13x1000 137x30 10x665
		69	10/94 → 08/97	 	MS, →07/96 PS, →07/96 →07/96 →07/96	SVB131025 SVB131000 TB522 SVB10665	13x1025 13x1000 137x30 10x665

MONTEREY

3.1 TD	4 JG2TC	84	09/91 → 07/98	 	05/94 → 05/94 → 05/94 → A/C(-), 05/94 → A/C(+), 05/94 →	SVB171055 TB291 TBK075 SVB131450 SVB131525	17x1055 119x32 13x1450 13x1525
--------	---------	----	---------------	--------------	---	---	---





kW



...VAUXHALL

...MONTEREY

3.2	6VD1	130	06/92 → 07/98		05/94 →	MVB800R4	4PK800
					05/94 →	MVB960R4	4PK960
					05/94 →	TB393	223x32
					05/94 →	SVB101025	10x1025

MOVANO Chassis/Cab (ED, UD, HD)

2.2 DTI	G9T 720	66	09/00 →		A/C(-), →09/03	MVB1150R6	6PK1150
					A/C(+), →09/03	MVB1795R6	6PK1795
					→09/03	TB710	89x25
2.5 CDTI	G9U 754	74	04/04 →		A/C(-), eng. PTO shaft (-)	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-)	MVB1150R7	7PK1150
					A/C(+)	MVB1788R7	7PK1788
						TB710	89x25
		88	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
		107	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
2.5 D	S8U 770	59	10/98 → 09/00			MVB1200R5	5PK1200
					→ Eng Nr 3053818	MVB860R6	6PK860
					Eng Nr 3053819 →	MVB870R6	6PK870
						TB368	152x30
						TBK037	
2.5 DTI	G9U 720, G9U 724, G9U 754	84	10/01 →		A/C(-), →09/03	MVB1150R6	6PK1150
					A/C(+), →09/03	MVB1795R6	6PK1795
					→09/03	TB710	89x25
2.8 DTI	S9W 702	84	10/98 → 10/01			MVB1200R5	5PK1200
					→ Eng Nr 3053818	MVB838R6	6PK838
					Eng Nr 3053819 →	MVB850R6	6PK850
						TB558	154x30
						TBK102	
3.0 DTi	ZD3 202	100	10/03 →		→09/06	MVB1920R7	7PK1920

MOVANO Combi (JD)

1.9 DTI	F9Q 774	60	10/01 →		A/C(-), 10/03 →09/06	MVB1120R5	5PK1120
					A/C(+), 10/03 →09/06	MVB1795R6	6PK1795
					10/03 →09/06	TB653	132x26
					10/03 →09/06	TBK275	
2.2 DTI	G9T 720	66	09/00 →		A/C(-), →09/03	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), 10/03 →09/06	MVB1150R7	7PK1150
					A/C(+), →09/03	MVB1795R6	6PK1795
					A/C(+), eng. PTO shaft (+), 10/03 →09/06	MVB1788R7	7PK1788
					→09/06	TB710	89x25
2.5 CDTI	G9U 754	74	04/04 →		A/C(-), eng. PTO shaft (-)	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-)	MVB1150R7	7PK1150
					A/C(+)	MVB1788R7	7PK1788
						TB710	89x25
		88	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
		107	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
2.5 D	S8U 770	59	10/98 → 09/00			MVB1200R5	5PK1200
					→ Eng Nr 3053818	MVB860R6	6PK860
					Eng Nr 3053819 →	MVB870R6	6PK870
						TB368	152x30
						TBK037	



kw



VAUXHALL

...VAUXHALL

...MOVANO Combi (JD)

2.5 DTI	G9U 720, G9U 750, G9U 754	84	10/01 →		A/C(-), →09/03	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), 10/03→	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-), 10/03→	MVB1150R7	7PK1150
					A/C(+), →09/03	MVB1795R6	6PK1795
2.8 DTI	S9W 702	84	10/98 → 10/01		A/C(+), 10/03→	MVB1788R7	7PK1788
						TB710	89x25
					→ Eng Nr 3053818	MVB1200R5	5PK1200
					Eng Nr 3053819→	MVB838R6	6PK838
3.0 DTI	ZD3 200	100	10/03 →			MVB850R6	6PK850
						TB558	154x30
						TBK102	
						MVB1920R7	7PK1920

MOVANO Van (FD)

1.9 DTI	F9Q 774	60	10/01 →		A/C(-), 10/03→09/06	MVB1120R5	5PK1120
					A/C(+), 10/03→09/06	MVB1795R6	6PK1795
					10/03→09/06	TB653	132x26
					10/03→09/06	TBK275	
2.2 DTI	G9T 720	66	09/00 →		A/C(-), →09/03	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), 10/03→09/06	MVB1150R7	7PK1150
					A/C(+), →09/03	MVB1795R6	6PK1795
					A/C(+), eng. PTO shaft (+), 10/03→09/06	MVB1788R7	7PK1788
2.5 CDTI	G9U 754	74	04/04 →			TB710	89x25
					A/C(-), eng. PTO shaft (-)	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-)	MVB1150R7	7PK1150
					A/C(+)	MVB1788R7	7PK1788
2.5 D	S8U 770	59	10/98 → 09/00			TB710	89x25
					A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
					A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
2.5 DTI	G9U 720, G9U 724, G9U 750, G9U 754	84	10/01 →		→ Eng Nr 3053818	MVB1200R5	5PK1200
					Eng Nr 3053819→	MVB860R6	6PK860
						MVB870R6	6PK870
						TB368	152x30
2.5 DTI	G9U 720, G9U 724, G9U 750, G9U 754	84	10/01 →			TBK037	
					A/C(-), →09/03	MVB1150R6	6PK1150
					A/C(-), eng. PTO shaft (-), 10/03→	MVB1103R7	7PK1103
					A/C(-), eng. PTO shaft (-), 10/03→	MVB1150R7	7PK1150
2.8 TDI	S9W 702	84	10/98 → 10/01		A/C(+), →09/03	MVB1795R6	6PK1795
					A/C(+), 10/03→	MVB1788R7	7PK1788
						TB710	89x25
					→ Eng Nr 3053818	MVB1200R5	5PK1200
3.0 DTI	ZD3 202	100	10/03 →		Eng Nr 3053819→	MVB838R6	6PK838
						MVB850R6	6PK850
						TB558	154x30
						TBK102	
3.0 DTI	ZD3 202	100	10/03 →			MVB1920R7	7PK1920

NOVA

1.0	10 S	33	09/82 → 10/87			SVB10925	10x925
1.2 N	12 NC, E 12 GV	33	01/85 → 10/87			SVB10925	10x925
1.2 S	12 ST	40	09/82 → 10/87			SVB10925	10x925
						SVB10875	10x875
					08/87→	SVB10913	10x913
					08/87→	TB190	101x17



kW



...VAUXHALL

...NOVA

1.3 i	13 NB	44	09/85 → 10/87			SVB10875	10x875
						SVB10913	10x913
						TB129	104x15
1.3 S	13 SB	51	09/82 → 10/87			SVB10875	10x875
						SVB10913	10x913
						TB129	104x15
1.4 S	14 NV	55	01/90 → 02/93			SVB10875	10x875
						SVB10913	10x913
					→ Eng Nr 19307805	TB218	104x17
					Eng Nr 19307806→	TB336	111x17
					Eng Nr 19307806→	TBK008	
1.5 TD	15 DT (T4EC1)	49	01/90 → 02/93			SVB13875	13x875
						TB413	136x25.4
						TBK021	

NOVA Hatchback

1.0	10 S	33	05/83 → 03/93		→08/92	SVB10925	10x925
1.2 i	12 NC, E 12 GV	33	01/85 → 10/89			SVB10925	10x925
1.2 i CAT	C 12 NZ	33	09/89 → 03/93		09/91→	SVB10875	10x875
					09/91→	SVB10913	10x913
					09/91→	TB336	111x17
					09/91→	TBK008	
1.2 N	12 NV	38	01/90 → 03/93		→01/92	SVB10925	10x925
1.2 S	12 ST	40	05/83 → 02/90			SVB10925	10x925
		43	01/88 → 02/90			SVB10875	10x875
						SVB10913	10x913
						TB190	101x17
1.3 i	13 NB	44	09/85 → 10/89			SVB10875	10x875
						SVB10913	10x913
						TB129	104x15
1.3 i CAT	C 13 N	44	09/89 → 03/93		→08/90	SVB10875	10x875
					→08/90	SVB10913	10x913
					→08/90	TB129	104x15
1.3 S	13 SB	51	05/83 → 10/89			SVB10875	10x875
						SVB10913	10x913
						TB129	104x15
1.4 i	C 14 NZ	44	01/90 → 03/93		10/90→	SVB10875	10x875
					10/90→	SVB10913	10x913
					10/90→, → Eng Nr 19311737	TB218	104x17
					10/90→, Eng Nr 19311738→	TB336	111x17
					10/90→, Eng Nr 19311738→	TBK008	
1.4 i S	C 14 SE	60	09/91 → 03/93			SVB10875	10x875
						SVB10913	10x913
					→ Eng Nr 02J22349	TB218	104x17
					Eng Nr 02J22350→	TB336	111x17
					Eng Nr 02J22350→	TBK008	
1.4 S	14 NV	55	01/90 → 03/93			SVB10875	10x875
						SVB10913	10x913
					→ Eng Nr 19307805	TB218	104x17
					Eng Nr 19307806→	TB336	111x17
					Eng Nr 19307806→	TBK008	
1.5 D	15 D (4EC1)	37	09/87 → 03/93		08/89→	SVB13875	13x875
					08/89→	TB413	136x25.4
					08/89→	TBK021	
1.5 TD	15 DT (T4EC1)	49	01/90 → 03/93			SVB13875	13x875
						TB413	136x25.4
						TBK021	



kw



VAUXHALL

...VAUXHALL

...NOVA Hatchback

1.6 GSI	E 16 SE	74	05/88 → 03/92	⊗	10/90 →	SVB10875	10x875
				⊗	10/90 →	SVB10913	10x913
					10/90 →, → Eng Nr 02J22349	TB218	104x17
					10/90 →, Eng Nr 02J22350 →	TB336	111x17
					10/90 →, Eng Nr 02J22350 →	TBK008	
					10/90 →, Eng Nr 02J22350 →	TBK008	
C 16 SEI	72	09/89 → 03/93	⊗	10/90 →	SVB10875	10x875	
			⊗	10/90 →	SVB10913	10x913	
				10/90 →, → Eng Nr 02J22349	TB218	104x17	
				10/90 →, Eng Nr 02J22350 →	TB336	111x17	
				10/90 →, Eng Nr 02J22350 →	TBK008		
				10/90 →, Eng Nr 02J22350 →	TBK008		
1.6 GSI CAT	C 16 SE	74	02/92 → 03/93	⊗		SVB10875	10x875
				⊗		SVB10913	10x913
					→ Eng Nr 02J22349	TB218	104x17
					Eng Nr 02J22350 →	TB336	111x17
					Eng Nr 02J22350 →	TBK008	
					Eng Nr 02J22350 →	TBK008	

NOVAVAN

1.2	12 NV	38	01/90 → 10/94	⊗	11/90 → 01/92	SVB10925	10x925
1.5 D	15 D (4EC1)	37	01/91 → 10/94	⊗	→ 03/93	SVB13875	13x875
					→ 03/93	TB413	136x25.4
					→ 03/93	TBK021	

OMEGA

2.0	X 20 SE	85	03/94 → 09/99	⊗	A/C(-), → 07/95	MVB1725R6	6PK1725
				⊗	A/C(+), → 07/95	MVB1904R6	6PK1904
					→ 07/95	TB508	146x20
					→ 07/95	TBK032	
20 SE	85	03/94 → 12/00	⊗	A/C(-), → 07/95	MVB1725R6	6PK1725	
			⊗	A/C(+), → 07/95	MVB1904R6	6PK1904	
				→ 07/95	TB508	146x20	
				→ 07/95	TBK032		
2.0 16V	X 20 XEV	100	03/94 → 09/99	⊗	A/C(-), → 05/99	MVB1725R6	6PK1725
				⊗	A/C(+), → 05/99	MVB1904R6	6PK1904
					→ 05/99	TB783	169x24
					→ 05/99	TBK261	
2.0 DTI 16V	X 20 DTH	74	10/98 → 09/00	⊗	A/C(-), → 05/99	MVB1805R6	6PK1805
				⊗	A/C(+), → 05/99	MVB1904R6	6PK1904
2.2 16V	Y 22 XE, Z 22 XE	106	09/99 →	⊗	A/C(-), → 08/03	MVB1725R6	6PK1725
				⊗	A/C(+), → 08/03	MVB1904R6	6PK1904
					→ 08/03	TB524	171x24
					→ 08/03	TB524	
2.2 DTI 16V	Y 22 DTH	88	09/00 →	⊗	A/C(-), → 08/03	MVB1805R6	6PK1805
				⊗	A/C(+), → 08/03	MVB1904R6	6PK1904
2.5 TD	25 DT, X 25 DT	96	04/94 → 02/01	⊗	→ 07/00, → Ch. V1999999	MVB775R4	4PK775
				⊗	→ 07/00, Ch. W1000001 →	MVB800R4	4PK800
				⊗	→ 07/00	MVB1815R5	5PK1815
					→ 07/00	MVB1815R5	
2.5 V6	X 25 XE	125	03/94 → 09/00	⊗	A/C(-)	MVB1904R6	6PK1904
				⊗	A/C(+), → Ch. S1059678	MVB2265R6	6PK2265
				⊗	A/C(+), Ch. S1059679 →	MVB2020R6	6PK2020
					→ Eng Nr 08300418	TB481	225x30
					→ Eng Nr 08300418	TBK091	
					→ Eng Nr 08300418	TBK091	
2.6 V6	Y 26 SE	132	09/00 →	⊗	A/C(-), → 08/03	MVB1904R6	6PK1904
				⊗	A/C(+), → 08/03	MVB2020R6	6PK2020
					→ 08/03	TB481	225x30
3.0 V6	X 30 XE	155	04/94 →	⊗	A/C(-), → 07/00	MVB1904R6	6PK1904
				⊗	A/C(+), → 07/00,	MVB2265R6	6PK2265
					→ Ch. S1059678		
				⊗	A/C(+), → 07/00,	MVB2020R6	6PK2020
					Ch. S1059679 →		
					→ 07/00	TB481	225x30
3.2 V6	Y 32 SE	160	02/01 →	⊗	→ 07/00, → Eng Nr 08300418	TBK091	
				⊗	A/C(-), → 08/03	MVB1904R6	6PK1904
				⊗	A/C(+), → 08/03	MVB2020R6	6PK2020
					→ 08/03	TB481	225x30



kW



...VAUXHALL

OMEGA Estate

2.0	X 20 SE	85	03/94 → 09/99	 	A/C(-), →07/95 A/C(+), →07/95 →07/95 →07/95	MVB1725R6 MVB1904R6 TB508 TBK032	6PK1725 6PK1904 146x20
2.0 16V	X 20 XEV	100	03/94 → 09/99	 	A/C(-), →05/99 A/C(+), →05/99 →05/99 →05/99	MVB1725R6 MVB1904R6 TB783 TBK261	6PK1725 6PK1904 169x24
2.0 DTI 16V	X 20 DTH	74	10/98 → 09/00	 	A/C(-), →05/99 A/C(+), →05/99	MVB1805R6 MVB1904R6	6PK1805 6PK1904
2.2 16V	Y 22 XE, Z 22 XE	106	09/99 →	 	A/C(-), →08/03 A/C(+), →08/03 →08/03	MVB1725R6 MVB1904R6 TB524	6PK1725 6PK1904 171x24
2.2 DTI 16V	Y 22 DTH	88	09/00 →	 	A/C(-), →08/03 A/C(+), →08/03	MVB1805R6 MVB1904R6	6PK1805 6PK1904
2.5 TD	25 DT, X 25 DT	96	04/94 → 02/01	 	→07/00, → Ch. V1999999 →07/00, Ch. W1000001→ →07/00	MVB775R4 MVB800R4 MVB1815R5	4PK775 4PK800 5PK1815
2.5 V6	X 25 XE	125	03/94 → 09/00	 	A/C(-) A/C(+), → Ch. S1059678 A/C(+), Ch. S1059679→ → Eng Nr 08300418	MVB1904R6 MVB2265R6 MVB2020R6 TB481 TBK091	6PK1904 6PK2265 6PK2020 225x30
2.6 V6	Y 26 SE	132	09/00 →	 	A/C(-), →08/03 A/C(+), →08/03 →08/03	MVB1904R6 MVB2020R6 TB481	6PK1904 6PK2020 225x30
3.0 V6	X 30 XE	155	04/94 →	 	A/C(-), →07/00 A/C(+), →07/00, → Ch. S1059678 A/C(+), →07/00, Ch. S1059679→ →07/00 →07/00, → Eng Nr 08300418	MVB1904R6 MVB2265R6 MVB2020R6 TB481 TBK091	6PK1904 6PK2265 6PK2020 225x30
3.2 V6	Y 32 SE	160	02/01 →	 	A/C(-), →08/03 A/C(+), →08/03 →08/03	MVB1904R6 MVB2020R6 TB481	6PK1904 6PK2020 225x30

ROYALE

2.8	28 H	103	02/78 → 04/81	 	10/78→ MAN, 10/78→04/79 A/C(-), 10/78→ A/C(+), 10/78→	SVB10888 SVB10900 SVB10875 SVB101075	10x888 10x900 10x875 10x1075
2.9 E	30 E	132	02/78 → 12/86	 	PS, 09/80→08/83 A/C(-), 09/80→08/83	SVB101075 SVB10875	10x1075 10x875
3.0	30 E	132	10/79 → 10/82	 	PS, 09/80→ 09/80→ A/C(-), 09/80→	SVB101075 SVB10888 SVB10875	10x1075 10x888 10x875

ROYALE Coupe

2.8	28 H	103	10/79 → 10/82	 	A/C(-) A/C(+) A/C(+) A/C(+) A/C(-), 09/80→08/83	SVB10888 SVB10875 SVB101075 SVB10875	10x888 10x875 10x1075 10x875
2.9	30 E	132	02/78 → 08/86	 	PS, 09/80→08/83 A/C(-), 09/80→08/83	SVB101075 SVB10875	10x1075 10x875
3.0	30 E	132	10/79 → 10/82	 	PS, 09/80→ 09/80→ A/C(-), 09/80→	SVB101075 SVB10888 SVB10875	10x1075 10x888 10x875



kW



VAUXHALL

...VAUXHALL

SENATOR Mk II

2.5 i	25 E	103	09/87 → 10/90	☀	→ Ch. M 1000000	SVB10888	10x888
				⌚	A/C(-), Ch. M 1000001→	MVB1460R6	6PK1460
				⌚	A/C(+), → Eng Nr 1039674,	MVB2225R6	6PK2225
					Ch. M 1000001→		
				⌚	A/C(+), Alt. 120A,	MVB2265R6	6PK2265
					Eng Nr 1039675→		
				⌚	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271
					Eng Nr 1039675→		
				⊕	A/C(-), Cat(-),	SVB10813	10x813
					→ Ch. M 1000000		
	⊕	A/C(-), Cat(+),	SVB10790	10x790			
		→ Ch. M 1000000					
	⊕	A/C(+), Cat(-),	SVB10960	10x960			
		→ Ch. M 1000000					
	⊕	A/C(+), Cat(+),	SVB10940	10x940			
		→ Ch. M 1000000					
2.6 i	C 26 NE	110	09/90 → 09/93	⌚	A/C(-)	MVB1460R6	6PK1460
				⌚	A/C(+), → Eng Nr 1032426	MVB2225R6	6PK2225
				⌚	A/C(+), Alt. 120A,	MVB2265R6	6PK2265
					Eng Nr 1032427→		
				⌚	A/C(+), Not Alt. 120A,	MVB2271R6	6PK2271
	Eng Nr 1032427→						
3.0	30 NE	130	01/88 → 09/90	☀	09/88→, → Ch. M 1000000	SVB10888	10x888
				⌚	A/C(-), 09/88→,	MVB1460R6	6PK1460
					Ch. M 1000001→		
				⌚	A/C(+),	MVB2225R6	6PK2225
					09/88→, → Eng Nr 01039674,		
					Ch. M 1000001→		
				⌚	A/C(+), Alt. 120A, 09/88→,	MVB2265R6	6PK2265
					Eng Nr 01039675→		
				⌚	A/C(+),	MVB2271R6	6PK2271
					Not Alt. 120A, 09/88→,		
	Eng Nr 01039675→						
	⊕	A/C(-), 09/88→,	SVB10813	10x813			
		→ Ch. M 1000000					
	⊕	A/C(+), 09/88→,	SVB10960	10x960			
		→ Ch. M 1000000					
3.0 24V	C 30 SE	150	09/89 → 09/93	⌚	A/C(-)	MVB1460R6	6PK1460
				⌚	A/C(+), → Eng Nr 1024729	MVB2225R6	6PK2225
				⌚	A/C(+), Eng Nr 1024730→	MVB2271R6	6PK2271
3.0 i CAT	C 30 NE	130	01/88 → 09/93	☀	09/88→08/92, → Ch. M 1000000	SVB10888	10x888
				⌚	A/C(-), 09/88→08/92,	MVB1460R6	6PK1460
					Ch. M 1000001→		
				⌚	A/C(+),	MVB2225R6	6PK2225
					09/88→08/92,		
					→ Eng Nr 01039674,		
					Ch. M 1000001→		
				⌚	A/C(+),	MVB2265R6	6PK2265
					Alt. 120A, 09/88→08/92,		
					Eng Nr 01039675→		
⌚	A/C(+),	MVB2271R6	6PK2271				
	Not Alt. 120A, 09/88→08/92,						
	Eng Nr 01039675→						
	⊕	A/C(-), 09/88→08/92,	SVB10813	10x813			
		→ Ch. M 1000000					
	⊕	A/C(+), 09/88→08/92,	SVB10960	10x960			
		→ Ch. M 1000000					



kW



...VAUXHALL

SIGNUM

1.8		103	08/05 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
		90	06/03 → 07/05		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1240R5	5PK1240
						TB638	162x20
						TBK240	
					→ Eng Nr 20EK4285		
1.9 CDTI	Z 19 DT	88	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
1.9 CDTI 16V	Z 19 DTH	110	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
2.0 DTI	Y 20 DTH	74	05/03 →		A/C(-), →04/04	MVB1805R6	6PK1805
					A/C(+), →04/04, Ch. 31154546→	MVB1875R6	6PK1875
2.0 i Turbo	Z 20 NET	129	05/03 →		A/C(-), 09/03→	MVB875R5	5PK875
					A/C(+), 09/03→	MVB1030R5	5PK1030
2.2 DTI	Y 22 DTR	92	05/03 →		A/C(-), →04/04	MVB1805R6	6PK1805
					A/C(+), →04/04, Ch. 31154546→	MVB1875R6	6PK1875
2.2 i	Z 22 YH	114	05/03 →		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.8 V6 Turbo	Z 28 NEL	169	08/05 →			MVB2120R6	6PK2120
3.0 CDTi	Y 30 DT	130	05/03 →			MVB1920R6	6PK1920
						TB750	116x25
3.0 V6 CDTI	Z 30 DT	135	09/05 →		A/C(+)	MVB1920R6	6PK1920
						TB750	116x25
3.2 V6	Z 32 SE	155	05/03 →		A/C(-), →07/05	MVB1865R6	6PK1865
					A/C(+), →07/05	MVB1995R6	6PK1995
					→07/05	TB481	225x30

SINTRA

2.2 DTI	X 22 DTH	85	07/97 → 04/99		A/C(-), 01/99→	MVB1805R6	6PK1805
					A/C(+), 01/99→	MVB1904R6	6PK1904
2.2 i 16 V	X 22 XE	104	11/96 → 04/99		A/C(-), 03/97→	MVB1725R6	6PK1725
					A/C(+), 03/97→	MVB1904R6	6PK1904
					03/97→	TB524	171x24
3.0 i 24V	X 30 XE	148	11/96 → 04/99		03/97→	MVB2020R6	6PK2020
					03/97→	TB481	225x30

TIGRA

1.4 16V	X 14 XE	66	07/94 →		A/C(-), MS, →12/00	MVB890R6	6PK890
					A/C(-), PS, →12/00	MVB1530R6	6PK1530
					A/C(+), →12/00	MVB1805R6	6PK1805
					→12/00	TB780	169x20
					→12/00	TBK260	
1.6 16V	X 16 XE	78	07/94 →		A/C(-), MS, 06/97→12/00	MVB890R6	6PK890
					A/C(-), PS, 06/97→12/00	MVB1530R6	6PK1530
					A/C(+), 06/97→12/00	MVB1805R6	6PK1805
					06/97→12/00	TB780	169x20
					06/97→12/00	TBK260	

TIGRA TwinTop

1.3 CDTI	Z 13 DT	51	06/04 →		A/C(-), 11/04→	MVB1180R6	6PK1180
					A/C(+), 11/04→	MVB1318R6	6PK1318
1.4	Z 14 XEP	66	06/04 →		A/C(-)	MVB1230R5	5PK1230
					A/C(+)	MVB1370R5	5PK1370



kw



VAUXHALL

...VAUXHALL

...TIGRA TwinTop

1.8	Z 18 XE	92	06/04 →		A/C(-)	MVB938R5	5PK938
					A/C(+)	MVB1215R5	5PK1215
						TB638	162x20
					→ Ch. 4E999999	TBK240	

VECTRA

1.6 i	X 16 SZR	55	10/95 → 12/00		A/C(-), →08/00	MVB1460R6	6PK1460
					A/C(+), →08/00	MVB1805R6	6PK1805
					→08/00	TB336	111x17
					→08/00	TBK008	
1.6 i 16V	X 16 XEL, Y 16 XE, Z 16 XE	74	10/95 →		A/C(-), →03/02	MVB1530R6	6PK1530
					A/C(+), →03/02	MVB1805R6	6PK1805
					→03/02	TB780	169x20
					→03/02	TBK260	
1.7 TD	X 17 DT (TC4EE1)	60	10/95 → 11/96			SVB131250	13x1250
						SVB13925	13x925
						TB413	136x25.4
						TBK023	
						SVB10950	10x950
1.8 i 16V	X 18 XE, X 18 XE1	85	10/95 → 09/00		A/C(-), 02/99 →	MVB1530R6	6PK1530
					A/C(+), 02/99 →	MVB1805R6	6PK1805
					Eng. X18XE, A/C(-)	MVB1725R6	6PK1725
					Eng. X18XE, A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
					02/99 →	TB780	169x20
						TBK261	
					02/99 →	TBK260	
	Z 18 XE	92	09/00 →		A/C(-), →03/02	MVB1530R6	6PK1530
					A/C(+), →03/02	MVB1805R6	6PK1805
					→03/02	TB780	169x20
					→03/02	TBK260	
2.0 DI 16V	X 20 DTL	60	11/96 →		A/C(-), →03/02	MVB1805R6	6PK1805
					A/C(+), →03/02	MVB1904R6	6PK1904
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	06/97 →		A/C(-), →03/02	MVB1805R6	6PK1805
					A/C(+), →03/02	MVB1904R6	6PK1904
2.0 i 16V	X 20 XEV	100	10/95 → 09/00		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
						TBK261	
2.2 DTI 16V	Y 22 DTR	92	09/00 →		A/C(-), →03/02	MVB1805R6	6PK1805
					A/C(+), →03/02	MVB1904R6	6PK1904
2.2 i 16V	Z 22 SE	108	09/00 →		A/C(-), →03/02	MVB875R5	5PK875
					A/C(+), →03/02	MVB1030R5	5PK1030
2.5 i V6	X 25 XE	125	10/95 → 09/00		A/C(-)	MVB1904R6	6PK1904
					A/C(+)	MVB2020R6	6PK2020
						TB481	225x30
					→ Ch. W7154258	TBK091	
2.6 i V6	Y 26 SE	125	09/00 →		A/C(-), →03/02	MVB1904R6	6PK1904
					A/C(+), →03/02	MVB2020R6	6PK2020
					→03/02	TB481	225x30

VECTRA Estate

1.6 i	X 16 SZR	55	11/96 →		A/C(-), →08/00	MVB1460R6	6PK1460
					A/C(+), →08/00	MVB1805R6	6PK1805
					→08/00	TB336	111x17
					→08/00	TBK008	
1.6 i 16V	X 16 XEL, Y 16 XE, Z 16 XE	74	11/96 →		A/C(-), →03/02	MVB1530R6	6PK1530
					A/C(+), →03/02	MVB1805R6	6PK1805
					→03/02	TB780	169x20
					→03/02	TBK260	



kW



...VAUXHALL

...VECTRA Estate

1.8 i 16V	X 18 XE, X 18 XE1	85	11/96 → 09/00		A/C(-), 02/99→	MVB1530R6	6PK1530
					A/C(+), 02/99→	MVB1805R6	6PK1805
					Eng. X18XE, A/C(-)	MVB1725R6	6PK1725
					Eng. X18XE, A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
					02/99→	TB780	169x20
						TBK261	
					02/99→	TBK260	
	Z 18 XE	92	09/00 →		A/C(-), →03/02	MVB1530R6	6PK1530
					A/C(-), 04/02→08/05	MVB938R5	5PK938
					A/C(+), →03/02	MVB1805R6	6PK1805
					A/C(+), 04/02→08/05	MVB1240R5	5PK1240
					→03/02	TB780	169x20
					04/02→08/05	TB638	162x20
					→03/02	TBK260	
					04/02→08/05, → Eng Nr 20EK2285	TBK240	
2.0 DI 16V	X 20 DTL	60	11/96 →		A/C(-), →03/02	MVB1805R6	6PK1805
					A/C(+), →03/02	MVB1904R6	6PK1904
2.0 DTI 16V	X 20 DTH, Y 20 DTH	74	06/97 →		→03/04	MVB1805R6	6PK1805
					A/C(+), →03/02	MVB1904R6	6PK1904
					A/C(+), 04/02→03/04	MVB1875R6	6PK1875
2.0 i 16V	X 20 XEV	100	11/96 → 09/00		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
						TBK261	
2.2 DTI 16V	Y 22 DTR	92	09/00 →		A/C(-), →03/04	MVB1805R6	6PK1805
					A/C(+), →03/02	MVB1904R6	6PK1904
					A/C(+), 04/02→03/04	MVB1875R6	6PK1875
2.2 i 16V	Z 22 SE	108	09/00 →		A/C(-), →03/02	MVB875R5	5PK875
					A/C(+), →03/02	MVB1030R5	5PK1030
2.5 i V6	X 25 XE	125	11/96 → 09/00		A/C(-)	MVB1904R6	6PK1904
					A/C(+)	MVB2020R6	6PK2020
						TB481	225x30
					→ Ch. W7154258	TBK091	
2.6 i V6	Y 26 SE	125	09/00 →		A/C(-), →03/02	MVB1904R6	6PK1904
					A/C(+), →03/02	MVB2020R6	6PK2020
					→03/02	TB481	225x30

VECTRA Hatchback

1.6 i	X 16 SZR	55	10/95 → 12/00		A/C(-), →08/00	MVB1460R6	6PK1460
					A/C(+), →08/00	MVB1805R6	6PK1805
					→08/00	TB336	111x17
					→08/00	TBK008	
1.6 i 16V	X 16 XEL, Y 16 XE, Z 16 XE	74	10/95 →		A/C(-), →03/02	MVB1530R6	6PK1530
					A/C(+), →03/02	MVB1805R6	6PK1805
					→03/02	TB780	169x20
					→03/02	TBK260	
1.7 TD	X 17 DT (TC4EE1)	60	10/95 → 11/96			SVB131250	13x1250
						SVB13925	13x925
						TB413	136x25.4
						TBK023	
						SVB10950	10x950



kw



VAUXHALL

...VAUXHALL

...VECTRA Hatchback

1.8 i 16V	X 18 XE, X 18 XE1	85	10/95 → 09/00		A/C(-), 02/99→	MVB1530R6	6PK1530
					A/C(+), 02/99→	MVB1805R6	6PK1805
					Eng. X18XE, A/C(-)	MVB1725R6	6PK1725
					Eng. X18XE, A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
						TB780	169x20
					02/99→	TBK261	
					02/99→	TBK260	
					A/C(-), →03/02	MVB1530R6	6PK1530
					A/C(+), →03/02	MVB1805R6	6PK1805
2.0 Di 16V	X 20 DTL	60	11/96 →		A/C(-), →03/02	MVB1805R6	6PK1805
					A/C(+), →03/02	MVB1904R6	6PK1904
					→03/02	TB780	169x20
2.0 DTi 16V	X 20 DTH, Y 20 DTH	74	06/97 →		→03/04	MVB1805R6	6PK1805
					A/C(+), →03/02	MVB1904R6	6PK1904
					A/C(+), 04/02→03/04	MVB1875R6	6PK1875
2.0 i 16V	X 20 XEV	100	10/95 → 09/00		A/C(-)	MVB1725R6	6PK1725
					A/C(+)	MVB1904R6	6PK1904
						TB783	169x24
						TBK261	
2.2 DTi 16V	Y 22 DTR	92	09/00 →		A/C(-), →03/04	MVB1805R6	6PK1805
					A/C(+), →03/02	MVB1904R6	6PK1904
					A/C(+), 04/02→03/04	MVB1875R6	6PK1875
					→03/04	MVB875R5	5PK875
2.2 i 16V	Z 22 SE	108	09/00 →		A/C(-), →03/04	MVB875R5	5PK875
					A/C(+), →03/04	MVB1030R5	5PK1030
2.5 i V6	X 25 XE	125	10/95 → 09/00		A/C(-)	MVB1904R6	6PK1904
					A/C(+)	MVB2020R6	6PK2020
						TB481	225x30
					→ Ch. W7154258	TBK091	
2.6 i V6	Y 26 SE	125	09/00 →		A/C(-), →03/02	MVB1904R6	6PK1904
					A/C(+), →03/02	MVB2020R6	6PK2020
					→03/02	TB481	225x30

VECTRA Mk II

1.8	Z 18 XER	103	01/06 →		A/C(-)	MVB1450R5	5PK1450
					A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.8 16V	Z 18 XE	90	04/02 →		A/C(-), →08/05	MVB938R5	5PK938
					A/C(+), →08/05	MVB1240R5	5PK1240
					→08/05	TB638	162x20
					→08/05, → Eng Nr 20EK2285	TBK240	
1.8 16V Dualfuel	Z 18 XE	90	04/02 →		A/C(-), →08/05	MVB938R5	5PK938
					A/C(+), →08/05	MVB1240R5	5PK1240
					→08/05	TB638	162x20
					→08/05, → Eng Nr 20EK2285	TBK240	
1.9 CDTI	Z 19 DT	88	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
					A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
1.9 CDTI 16V	Z 19 DTH	110	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB790	199x24
2.0 16V Turbo	Z 20 NET	129	03/03 →			TBK306	
					A/C(-)	MVB875R5	5PK875
2.0 DTi 16V	Y 20 DTH	74	04/02 →		A/C(+)	MVB1030R5	5PK1030
					→03/04	MVB1805R6	6PK1805
					A/C(+), →03/04	MVB1875R6	6PK1875



kW



...VAUXHALL

...VECTRA Mk II

2.2 16V	Z 22 SE	108	04/02 →		A/C(-), →03/04 A/C(+), →03/04	MVB875R5 MVB1030R5	5PK875 5PK1030
2.2 direct	Z 22 YH	114	10/03 →		A/C(-) A/C(+)	MVB875R5 MVB1030R5	5PK875 5PK1030
2.2 DTI 16V	Y 22 DTR	92	04/02 →		A/C(-), →03/04 A/C(+), →03/04	MVB1805R6 MVB1875R6	6PK1805 6PK1875
2.8 V6 Turbo	Z 28 NEL	169	08/05 →			MVB2120R6	6PK2120
		184	08/06 →			MVB2120R6	6PK2120
	Z 28 NET	188	08/05 →			MVB2120R6	6PK2120
3.0 CDTi	Z 30 DT	135	08/05 →			MVB1920R6 TB750	6PK1920 116x25
3.0 V6 CDTi	Y 30 DT	130	06/03 →		→07/05 →07/05	MVB1920R6 TB750	6PK1920 116x25
3.2 V6	Z 32 SE	155	06/03 →		A/C(-), →07/05	MVB1865R6	6PK1865
					A/C(+), →07/05	MVB1995R6	6PK1995
					→07/05	TB481	225x30

VECTRA Mk II Estate

1.8	Z 18 XER	103	01/06 →		A/C(-) A/C(+)	MVB1450R5 MVB1550R5	5PK1450 5PK1550
						TB741	146x24
1.8 16V	Z 18 XE	90	10/03 →		A/C(-), →08/05	MVB938R5	5PK938
					A/C(+), →08/05	MVB1240R5	5PK1240
					→08/05	TB638	162x20
					→08/05, → Eng Nr 20EK2285	TBK240	
1.9 CDTi	Z 19 DT	88	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
1.9 CDTi 16V	Z 19 DTH	110	04/04 →		A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
2.0 16V Turbo	Z 20 NET	129	10/03 →		A/C(-)	MVB875R5	5PK875
					A/C(+)	MVB1030R5	5PK1030
2.2 direct	Z 22 YH	114	10/03 →		A/C(-) A/C(+)	MVB875R5 MVB1030R5	5PK875 5PK1030
2.2 DTI 16V	Y 22 DTR	92	10/03 →		A/C(-), →03/04	MVB1805R6	6PK1805
					A/C(+), →03/04	MVB1875R6	6PK1875
2.8 V6 Turbo	Z 28 NEL	169	08/05 →			MVB2120R6	6PK2120
		188	08/06 →			MVB2120R6	6PK2120
	Z 28 NET	188	08/06 →			MVB2120R6	6PK2120
3.0 CDTi	Z 30 DT	135	08/05 →			MVB1920R6 TB750	6PK1920 116x25
3.0 V6 CDTi	Y 30 DT	130	10/03 →		→07/05 →07/05	MVB1920R6 TB750	6PK1920 116x25
3.2 V6	Z 32 SE	155	10/03 →		A/C(-), →07/05	MVB1865R6	6PK1865
					A/C(+), →07/05	MVB1995R6	6PK1995
					→07/05	TB481	225x30

VECTRA Mk II GTS

1.8	Z 18 XER	103	01/06 →		A/C(-) A/C(+)	MVB1450R5 MVB1550R5	5PK1450 5PK1550
						TB741	146x24
1.8 16V	Z 18 XE	90	08/02 →		A/C(-), →08/05	MVB938R5	5PK938
					A/C(+), →08/05	MVB1240R5	5PK1240
					→08/05	TB638	162x20
					→08/05, → Eng Nr 20EK2285	TBK240	
1.8 16V Dualfuel	Z 18 XE	90	08/02 →		A/C(-), →08/05	MVB938R5	5PK938
					A/C(+), →08/05	MVB1240R5	5PK1240
					→08/05	TB638	162x20
					→08/05, → Eng Nr 20EK2285	TBK240	



kw



VAUXHALL

...VAUXHALL

...VECTRA Mk II GTS

1.9 CDTi	Z 19 DT	88	04/04 →	①	A/C(-)	MVB1050R6	6PK1050
					A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
	Z 19 DTL	74	10/05 →	①	A/C(-)	MVB1050R6	6PK1050
				①	A/C(+)	MVB1413R6	6PK1413
						TB639	190x24
						TBK329	
1.9 CDTi 16V	Z 19 DTH	110	04/04 →	①	A/C(-)	MVB1050R6	6PK1050
				①	A/C(+)	MVB1413R6	6PK1413
						TB790	199x24
						TBK306	
2.0 16V Turbo	Z 20 NET	129	03/03 →	①	A/C(-)	MVB875R5	5PK875
				①	A/C(+)	MVB1030R5	5PK1030
2.2 16V	Z 22 SE	108	08/02 →	①	A/C(-), →03/04	MVB875R5	5PK875
				①	A/C(+), →03/04	MVB1030R5	5PK1030
2.2 direct	Z 22 YH	114	10/03 →	①	A/C(-)	MVB875R5	5PK875
				①	A/C(+)	MVB1030R5	5PK1030
2.2 DTi 16V	Y 22 DTR	92	08/02 →	①	A/C(-), →03/04	MVB1805R6	6PK1805
				①	A/C(+), →03/04	MVB1875R6	6PK1875
2.8 V6 Turbo	Z 28 NEL	169	08/05 →	①		MVB2120R6	6PK2120
		184	08/06 →	①		MVB2120R6	6PK2120
	Z 28 NET	188	08/05 →	①		MVB2120R6	6PK2120
3.0 CDTi	Z 30 DT	135	08/05 →	①		MVB1920R6	6PK1920
						TB750	116x25
3.0 V6 CDTi	Y 30 DT	130	06/03 →	①	→07/05	MVB1920R6	6PK1920
					→07/05	TB750	116x25
3.2 V6	Z 32 SE	155	08/02 →	①	A/C(-), →07/05	MVB1865R6	6PK1865
				①	A/C(+), →07/05	MVB1995R6	6PK1995
					→07/05	TB481	225x30

VIVARO Box

1.9 DI		59	08/01 →	①	A/C(-), →07/06	MVB1120R5	5PK1120
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
1.9 DTi	F9Q 760	74	08/01 →	①	A/C(-), →07/06	MVB1120R5	5PK1120
				①	A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
2.0 16V	F4R 720	88	08/01 →	①	A/C(-)	MVB1120R5	5PK1120
				①	A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.0 CDTi		84	08/06 →	①	A/C(-), eng. PTO shaft (+)	MVB2000R7	7PK2000
				①	A/C(+), eng. PTO shaft (+)	MVB1969R7	7PK1969
		66	01/06 →	①	A/C(-), eng. PTO shaft (+), 08/06 →	MVB2000R7	7PK2000
				①	A/C(+), eng. PTO shaft (+), 08/06 →	MVB1969R7	7PK1969
2.5 CDTi		107	08/06 →	①	A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25
2.5 DTi	G9U 730	99	04/04 →	①	A/C(-), eng. PTO shaft (-), →07/06	MVB1150R6	6PK1150
				①	A/C(+), eng. PTO shaft (+), →07/06	MVB1795R6	6PK1795
				①	A/C(+), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					→07/06	TB710	89x25



kW



...VAUXHALL

VIVARO Combi

1.9 DI		59	08/01 →		A/C(-), →07/06	MVB1120R5	5PK1120
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
1.9 DTI	F9Q 760	74	08/01 →		A/C(-), →07/06	MVB1120R5	5PK1120
					A/C(+), →07/06	MVB1795R6	6PK1795
					→07/06	TB653	132x26
					→07/06	TBK275	
2.0 16V	F4R 720	88	08/01 →		A/C(-)	MVB1120R5	5PK1120
					A/C(+)	MVB1795R6	6PK1795
						TB652	126x27
2.0 CDTI		66	01/06 →		A/C(-), eng. PTO shaft (+), 08/06→	MVB2000R7	7PK2000
					A/C(+), eng. PTO shaft (+), 08/06→	MVB1969R7	7PK1969
		84	08/06 →		A/C(-), eng. PTO shaft (+)	MVB1969R7	7PK1969
					A/C(-), eng. PTO shaft (+)	MVB2000R7	7PK2000
2.5 DTI	G9U 730	99	04/04 →		A/C(-), eng. PTO shaft (-), →07/06	MVB1150R6	6PK1150
					A/C(+), eng. PTO shaft (+), →07/06	MVB1795R6	6PK1795
					A/C(+), eng. PTO shaft (+), →07/06	MVB1833R6	6PK1833
					→07/06	TB710	89x25

VIVARO Flatbed / Chassis

2.0 CDTI		66	01/06 →		A/C(-), eng. PTO shaft (+), 08/06→	MVB1969R7	7PK1969
					A/C(-), eng. PTO shaft (+), 08/06→	MVB2000R7	7PK2000
		84	08/06 →		A/C(-), eng. PTO shaft (+)	MVB1969R7	7PK1969
					A/C(-), eng. PTO shaft (+)	MVB2000R7	7PK2000
2.5 CDTI		107	08/06 →		A/C(+), eng. PTO shaft (+)	MVB1788R7	7PK1788
						TB710	89x25

VX220

2.0 i Turbo	Z 20 LET	147	04/03 →		→09/06	MVB1680R5	5PK1680
					→09/06	TB647	168x24
2.2 i	Z 22 SE	108	09/00 →		A/C(-), →09/05	MVB875R5	5PK875
					A/C(+), →09/05	MVB1030R5	5PK1030

ZAFIRA

1.6 16V	X 16 XEL	74	04/99 →		A/C(-), →06/05	MVB938R5	5PK938
					A/C(+), Alt. 100A, →06/05, → Ch. 12999999, 1H999999	MVB1255R5	5PK1255
					A/C(+), Alt. 120A, →06/05, Ch. 22999999, 2H999999→	MVB1215R5	5PK1215
					→06/05	TB638	162x20
					→06/05, → Eng Nr 20041690, 02HL5117	TBK103	
					→06/05, Eng Nr 20041691, 02HL5118→	TBK240	



kW



VAUXHALL

...VAUXHALL

...ZAFIRA

1.8 16V	X 18 XE1	85	04/99 → 09/00	⊗	A/C(-)	MVB938R5	5PK938
				⊗	A/C(+)	MVB1255R5	5PK1255
						TB638	162x20
					→ Eng Nr 20041690,02HL5117	TBK103	
					Eng Nr 20041691,02HL5118→	TBK240	
Z 18 XE		92	09/00 →	⊗	A/C(-), →06/05	MVB938R5	5PK938
				⊗	A/C(+),	MVB1255R5	5PK1255
					→06/05, → Eng Nr 12999999,		
					2H000001	MVB1215R5	5PK1215
				⊗	A/C(+),		
					→06/05, Eng Nr 22000001,		
					2H000001→		
					→06/05	TB638	162x20
					→06/05, → Eng Nr 20041690,	TBK103	
					02HL5117		
					→06/05, Eng Nr 20041691,	TBK240	
					02HL5118→		
2.0 DI 16V	X 20 DTL	60	10/99 →	⊗	A/C(-), →06/05	MVB1805R6	6PK1805
				⊗	A/C(+), →06/05	MVB1865R6	6PK1865
2.0 DTI 16V	Y 20 DTH	74	04/99 →	⊗	A/C(-), →06/05	MVB1805R6	6PK1805
				⊗	A/C(+), →06/05	MVB1865R6	6PK1865
2.0 GSI Turbo	Z 20 LET	141	09/01 →	⊗	→06/05	MVB1680R5	5PK1680
					→06/05	TB647	168x24
2.2 16V	Z 22 SE	108	09/00 →	⊗	A/C(-), →06/05	MVB875R5	5PK875
				⊗	A/C(+), →06/05	MVB1030R5	5PK1030

ZAFIRA Mk II

1.6	Z 16 XEP	77	07/05 →	⊗	A/C(-)	MVB1450R5	5PK1450
				⊗	A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
		83	12/07 →	⊗	A/C(-)	MVB1450R5	5PK1450
				⊗	A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.8	Z 18 XEP, Z 18 XER	103	07/05 →	⊗	Eng. Z18XER, A/C(-)	MVB1450R5	5PK1450
				⊗	Eng. Z18XER, A/C(+)	MVB1550R5	5PK1550
						TB741	146x24
1.9 CDTI	Z 19 DT	88	07/05 →	⊗	A/C(-)	MVB1050R6	6PK1050
				⊗	A/C(+)	MVB1369R6	6PK1369
						TB639	190x24
						TBK329	
	Z 19 DTH	110	07/05 →	⊗	A/C(-)	MVB1050R6	6PK1050
				⊗	A/C(+)	MVB1369R6	6PK1369
						TB790	199x24
						TBK306	
2.0	Z 20 LER	147	07/05 →	⊗		MVB1680R5	5PK1680
						TB647	168x24
	Z 20 LEH	177	01/06 →	⊗		MVB1680R5	5PK1680
						TB647	168x24
2.2	Z 22 YH	110	07/05 →	⊗	A/C(-)	MVB875R5	5PK875
				⊗	A/C(+)	MVB1030R5	5PK1030



kW



VOLVO

240 (P242, P244)

2.0	B 19 A	66	08/76 → 07/79	⊗	MS	SVB13925	13x925			
				⊗	MS	SVB13975	13x975			
				⊗	PS	SVB131075	13x1075			
				⊗	PS	SVB131350	13x1350			
				⊗		SVB10925	10x925			
				⊗	→08/78	SVB10888	10x888			
				⊗	→08/78	SVB12885	12x885			
				⊗		TB118	123x19			
				⊗	→ Ch. 99679	SVB10940	10x940			
				⊗	A/C(+)	SVB10850	10x850			
				B 19 A, B 19 K	71	09/78 → 08/83	⊗	MS	SVB13925	13x925
							⊗	MS	SVB13975	13x975
							⊗	PS	SVB131075	13x1075
							⊗	PS	SVB131350	13x1350
⊗		SVB10925	10x925							
⊗		TB118	123x19							
⊗	A/C(-)	SVB10940	10x940							
⊗	A/C(+)	SVB10850	10x850							
B 20 A	60	08/74 → 07/76	⊗				MS	SVB13925	13x925	
			⊗				MS	SVB13975	13x975	
			⊗	PS	SVB131075	13x1075				
			⊗	PS	SVB131350	13x1350				
			⊗		SVB10925	10x925				
			⊗		TB118	123x19				
			⊗	A/C(-)	SVB10940	10x940				
			⊗	A/C(+)	SVB10850	10x850				
			B 200 K	76	08/84 → 07/85	⊗	MS	SVB13925	13x925	
						⊗	MS	SVB13975	13x975	
⊗	PS	SVB131075				13x1075				
⊗	PS	SVB131350				13x1350				
⊗		SVB10925				10x925				
⊗		TB118				123x19				
⊗	A/C(-)	SVB10940				10x940				
⊗	A/C(+)	SVB10850				10x850				
B 19 ET	100	10/82 → 08/84				⊗	MS	SVB13925	13x925	
						⊗	MS	SVB13975	13x975	
			⊗	PS	SVB131075	13x1075				
			⊗	PS	SVB131350	13x1350				
			⊗		SVB10925	10x925				
			⊗		TB118	123x19				
			⊗	A/C(-)	SVB10940	10x940				
			⊗	A/C(+)	SVB10850	10x850				
			89	09/84 → 12/93	⊗	MS	SVB13925	13x925		
					⊗	MS	SVB13975	13x975		
					⊗	PS	SVB131075	13x1075		
					⊗	PS	SVB131350	13x1350		
					⊗		SVB10925	10x925		
					⊗	→12/92	TB118	123x19		
⊗	01/93→	TB404			123x19					
⊗	A/C(-), LHD, 01/91→	SVB10990			10x990					
⊗	A/C(-), RHA	SVB10940			10x940					
⊗	A/C(+), →12/92	SVB10850			10x850					
⊗	A/C(+), 01/93→	SVB10840	10x840							



kw



VOLVO

...VOLVO
...240 (P242, P244)

2.1	B 21 A	71	08/74 → 07/75	☼	MS	SVB13925	13x925				
				⊖		SVB10925	10x925				
				☼		TB118	123x19				
		74	08/75 → 07/80	☼	A/C(-), → Ch. 174909	SVB10875	10x875				
					A/C(-), Ch. 174910→	SVB10940	10x940				
					MS	SVB13925	13x925				
				☼	MS	SVB13975	13x975				
				☼	PS	SVB131075	13x1075				
				☼	PS	SVB131350	13x1350				
				⊖		SVB10925	10x925				
				☼		TB118	123x19				
				79	08/80 → 07/84	☼	A/C(-), → Ch. 174909	SVB10875	10x875		
							A/C(-), Ch. 174910→	SVB10940	10x940		
							A/C(+)	SVB10850	10x850		
						☼	MS, →09/82	SVB13925	13x925		
☼	MS, →09/82	SVB13975	13x975								
☼	PS, →09/82	SVB131075	13x1075								
2.1 Turbo	B 21 ET	90	08/74 → 07/80	☼	MS	SVB13925	13x925				
				☼	MS	SVB13975	13x975				
				☼	PS	SVB131075	13x1075				
		114	08/80 → 07/84	☼	PS	SVB131350	13x1350				
					⊖		SVB10925	10x925			
					☼		TB118	123x19			
				2.3	B 230 A	81	08/84 → 07/86	☼	A/C(-), → Ch. 174909	SVB10875	10x875
								☼	A/C(-), Ch. 174910→	SVB10940	10x940
								☼	A/C(+)	SVB10850	10x850
						82	08/80 → 07/84	☼	MS	SVB13925	13x925
									MS	SVB13975	13x975
									PS	SVB131075	13x1075
				☼	PS, 10/82→			SVB131350	13x1350		
				⊖				SVB10925	10x925		
				☼				TB118	123x19		
B 23 A	82	08/80 → 07/84	A/C(-), 10/82→	SVB10940	10x940						
			A/C(+), 10/82→	SVB10850	10x850						





kW



...VOLVO

...240 (P242, P244)

...2.3	B 230 F	83	08/86 → 07/87	⊗	MS	SVB13925	13x925			
				⊗	MS	SVB13975	13x975			
				⊗	PS	SVB131075	13x1075			
				⊗	PS	SVB131350	13x1350			
				⊗		SVB10925	10x925			
				⊗		TB118	123x19			
				⊗	A/C(-)	SVB10940	10x940			
				⊗	A/C(+)	SVB10850	10x850			
				B 230 E	96	08/83 → 07/85	⊗	MS	SVB13925	13x925
							⊗	MS	SVB13975	13x975
							⊗	PS	SVB131075	13x1075
							⊗	PS	SVB131350	13x1350
							⊗		SVB10925	10x925
							⊗		TB118	123x19
⊗	A/C(-)	SVB10940	10x940							
⊗	A/C(+)	SVB10850	10x850							
B 23 E	100	08/80 → 07/83	⊗				MS, 10/82→	SVB13925	13x925	
			⊗				MS, 10/82→	SVB13975	13x975	
			⊗				PS, 10/82→	SVB131075	13x1075	
			⊗				PS, 10/82→	SVB131350	13x1350	
			⊗					SVB10925	10x925	
			⊗					TB118	123x19	
			⊗	A/C(-), 10/82→	SVB10940	10x940				
			⊗	A/C(+), 10/82→	SVB10850	10x850				
			103	08/78 → 07/80	⊗		SVB10925	10x925		
					⊗		TB118	123x19		
					98	08/84 → 12/89	⊗	MS	SVB13925	13x925
							⊗	MS	SVB13975	13x975
							⊗	PS	SVB131075	13x1075
							⊗	PS	SVB131350	13x1350
⊗		SVB10925					10x925			
⊗		TB118					123x19			
⊗	A/C(-)	SVB10940					10x940			
⊗	A/C(+)	SVB10850					10x850			
B 230 K	85	08/86 → 12/88					⊗	MS	SVB13925	13x925
							⊗	MS	SVB13975	13x975
							⊗	PS	SVB131075	13x1075
							⊗	PS	SVB131350	13x1350
			⊗				SVB10925	10x925		
			⊗				TB118	123x19		
			⊗	A/C(-)	SVB10940	10x940				
			⊗	A/C(+)	SVB10850	10x850				
			2.3 i CAT	B 230 F	85	08/86 → 07/93	⊗	MS	SVB13925	13x925
							⊗	MS	SVB13975	13x975
							⊗	PS	SVB131075	13x1075
							⊗	PS	SVB131350	13x1350
							⊗		SVB10925	10x925
							⊗		TB118	123x19
⊗		TB404					123x19			
⊗	A/C(-), LHD, 01/91→	SVB10990					10x990			
⊗	A/C(-), RHD	SVB10940					10x940			
⊗	A/C(+), →12/92	SVB10850					10x850			
⊗	A/C(+), 01/93→	SVB10840					10x840			



kw



VOLVO

...VOLVO

...240 (P242, P244)

2.4 Diesel	D 24	60	08/78 → 07/85	☼	10/82→	SVB13925	13x925
				⊖	A/C(-), MS	SVB10975	10x975
				⊕	A/C(+), PS	SVB10800	10x800
				☼		TB131	119x25.4
				☼		TBK044	
				☼		TB136	75x20
				⊖	A/C(-), 10/82→	SVB10888	10x888
		58	08/87 → 08/93	⊕	A/C(+)	SVB101237	10x1237
				☼		SVB13925	13x925
				⊖	A/C(-), MS	SVB10975	10x975
				⊕	A/C(+), PS	SVB10800	10x800
				☼		TB131	119x25.4
				☼		TBK044	
				☼		TB136	75x20
2.7 GLT6	B 27 E	104	08/79 → 07/80	☼	→ Ch. 2659	SVB101400	10x1400
				☼	Ch. 2660→	SVB131400	13x1400
				⊖	→ Ch. 2429	SVB101125	10x1125
				⊖	Ch. 2430→	SVB101100	10x1100
				⊕	→ Ch. 2429	SVB10975	10x975
				⊕	Ch. 2430→	SVB10960	10x960
				⊕			

240 Kombi (P245)

2.0	B 20 A	60	08/74 → 07/75	☼	MS	SVB13925	13x925	
				☼	MS	SVB13975	13x975	
				☼	PS	SVB131075	13x1075	
				☼	PS	SVB131350	13x1350	
				⊖		SVB10925	10x925	
				☼		TB118	123x19	
				⊖	A/C(-)	SVB10940	10x940	
		B 19 A, B 19 K	71	08/80 → 12/84	⊕	A/C(+)	SVB10850	10x850
					☼	MS	SVB13925	13x925
					☼	MS	SVB13975	13x975
					☼	PS	SVB131075	13x1075
					☼	PS	SVB131350	13x1350
					⊖		SVB10925	10x925
					☼		TB118	123x19
B 19 A	66	08/76 → 01/82	⊕	A/C(-)	SVB10940	10x940		
			⊕	A/C(+)	SVB10850	10x850		
			☼	MS	SVB13925	13x925		
			☼	MS	SVB13975	13x975		
			☼	PS	SVB131075	13x1075		
			☼	PS	SVB131350	13x1350		
			⊖		SVB10925	10x925		
B 200 K	76	08/84 → 07/85	☼		TB118	123x19		
			☼		SVB10940	10x940		
			☼	A/C(-)	SVB10940	10x940		
			☼	A/C(+)	SVB10850	10x850		
			☼	MS	SVB13925	13x925		
			☼	MS	SVB13975	13x975		
			☼	PS	SVB131075	13x1075		
B 19 A	66	08/76 → 01/82	☼	PS	SVB131350	13x1350		
			☼	PS	SVB131350	13x1350		
			⊖		SVB10925	10x925		
			☼		TB118	123x19		
			⊖	A/C(-)	SVB10940	10x940		
			⊖	A/C(+)	SVB10850	10x850		
			☼	MS	SVB13925	13x925		



kW



...VOLVO

...240 Kombi (P245)

...2.0	B 200 E	86	08/83 → 07/93	⊗	MS	SVB13925	13x925		
				⊗	MS	SVB13975	13x975		
				⊗	PS	SVB131075	13x1075		
				⊗	PS	SVB131350	13x1350		
				⊗		SVB10925	10x925		
				⊗	→12/92	TB118	123x19		
				⊗	01/93→	TB404	123x19		
				⊗	A/C(-), LHD, 01/91→	SVB10990	10x990		
				⊗	A/C(-), RHD	SVB10940	10x940		
				⊗	A/C(+), →12/92	SVB10850	10x850		
B 19 ET	100	10/82 → 08/84	⊗	MS	SVB13925	13x925			
			⊗	MS	SVB13975	13x975			
			⊗	PS	SVB131075	13x1075			
			⊗	PS	SVB131350	13x1350			
			⊗		SVB10925	10x925			
			⊗		TB118	123x19			
			⊗	A/C(-)	SVB10940	10x940			
			⊗	A/C(+)	SVB10850	10x850			
			2.0 D	50	09/78 → 10/80	⊗		SVB10800	10x800
						⊗		TB131	119x25.4
⊗		TBK044							
⊗		TB136				75x20			
⊗		SVB101237				10x1237			
⊗		SVB10975				10x975			
2.1	B 21 A	74				08/75 → 07/80	⊗	MS	SVB13925
			⊗	MS	SVB13975		13x975		
			⊗	PS, → Ch. 115349	SVB131550		13x1550		
			⊗	PS, Ch. 115350→	SVB131075		13x1075		
			⊗		SVB10925		10x925		
			⊗		TB118		123x19		
			⊗	A/C(-), → Ch. 115349	SVB10875		10x875		
			⊗	A/C(-), Ch. 115350→	SVB10940		10x940		
			⊗	A/C(+)	SVB10850		10x850		
			B 21 F	80	08/80 → 07/84		⊗	MS, →09/82	SVB13925
⊗	MS, →09/82	SVB13975				13x975			
⊗	PS, →09/82, → Ch. 115349	SVB131550				13x1550			
⊗	PS, →09/82, Ch. 115350→	SVB131075				13x1075			
⊗	→09/82	SVB10925				10x925			
⊗	→09/82	TB118				123x19			
⊗	A/C(-), →09/82, → Ch. 115349	SVB10875				10x875			
⊗	A/C(-), →09/82, Ch. 115350→	SVB10940				10x940			
⊗	A/C(+), →09/82	SVB10850				10x850			
B 21 E	90	08/74 → 07/79				⊗	MS	SVB13925	13x925
			⊗	MS	SVB13975	13x975			
			⊗	PS, → Ch. 115349	SVB131550	13x1550			
			⊗	PS, Ch. 115350→	SVB131075	13x1075			
			⊗		SVB10925	10x925			
			⊗		TB118	123x19			
			⊗	A/C(-), → Ch. 115349	SVB10875	10x875			
			⊗	A/C(-), Ch. 115350→	SVB10940	10x940			
			⊗	A/C(+)	SVB10850	10x850			



kw



VOLVO

...VOLVO

...240 Kombi (P245)

...2.1	B 21 A	71	08/74 → 07/75	☼	MS	SVB13925	13x925				
				☼	MS	SVB13975	13x975				
				☼	PS, → Ch. 115349	SVB131550	13x1550				
				☼	PS, Ch. 115350→	SVB131075	13x1075				
				⚙		SVB10925	10x925				
				🌀		TB118	123x19				
				☼	A/C(-), → Ch. 115349	SVB10875	10x875				
				☼	A/C(-), Ch. 115350→	SVB10940	10x940				
				☼	A/C(+)	SVB10850	10x850				
				79	08/80 → 07/84	☼	MS, →09/82	SVB13925	13x925		
						☼	MS, →09/82	SVB13975	13x975		
						☼	PS, →09/82, → Ch. 115349	SVB131550	13x1550		
						☼	PS, →09/82, Ch. 115350→	SVB131075	13x1075		
						⚙	→09/82	SVB10925	10x925		
						🌀	→09/82	TB118	123x19		
☼	A/C(-), →09/82, → Ch. 115349	SVB10875	10x875								
☼	A/C(-), →09/82, Ch. 115350→	SVB10940	10x940								
☼	A/C(+), →09/82	SVB10850	10x850								
2.1 Turbo	B 21 ET	114	08/80 → 07/85			☼	MS, →08/84	SVB13925	13x925		
				☼	MS, →08/84	SVB13975	13x975				
				☼	PS, →08/84	SVB131075	13x1075				
				☼	PS, →09/82, → Ch. 115349	SVB131550	13x1550				
				☼	PS, 10/82→08/84	SVB131350	13x1350				
				⚙	→08/84	SVB10925	10x925				
				🌀	→08/84	TB118	123x19				
				☼	A/C(-), →08/84	SVB10940	10x940				
				☼	A/C(-), →09/82, → Ch. 115349	SVB10875	10x875				
				☼	A/C(+), →08/84	SVB10850	10x850				
				2.3	B 230 A	81	08/84 → 07/86	☼	MS	SVB13925	13x925
								☼	MS	SVB13975	13x975
								☼	PS	SVB131075	13x1075
								☼	PS	SVB131350	13x1350
								⚙		SVB10925	10x925
🌀		TB118	123x19								
☼	A/C(-)	SVB10940	10x940								
☼	A/C(+)	SVB10850	10x850								
B 23 A	82	08/80 → 07/84	☼					MS, 10/82→	SVB13925	13x925	
			☼					MS, 10/82→	SVB13975	13x975	
			☼		PS, 10/82→	SVB131075	13x1075				
			☼		PS, 10/82→	SVB131350	13x1350				
			⚙			SVB10925	10x925				
B 230 F	83	08/86 → 07/87	☼			TB118	123x19				
			☼		A/C(-), 10/82→	SVB10940	10x940				
			☼	A/C(+), 10/82→	SVB10850	10x850					
			☼	MS	SVB13925	13x925					
			☼	MS	SVB13975	13x975					
B 230 E	96	08/84 → 07/85	☼	PS	SVB131075	13x1075					
			☼	PS	SVB131350	13x1350					
			⚙		SVB10925	10x925					
			🌀		TB118	123x19					
			☼	A/C(-)	SVB10940	10x940					
			☼	A/C(+)	SVB10850	10x850					
			☼	MS	SVB13925	13x925					
			☼	MS	SVB13975	13x975					
			☼	PS	SVB131075	13x1075					
			☼	PS	SVB131350	13x1350					



kW



...VOLVO

...240 Kombi (P245)

Model	Engine	kW	Period	Accessories	Options	Part Numbers	Dimensions	
...2.3	B 23 E	98	08/84 → 12/88	⊗	MS	SVB13925	13x925	
				⊗	MS	SVB13975	13x975	
				⊗	PS	SVB131075	13x1075	
				⊗	PS	SVB131350	13x1350	
				⊗		SVB10925	10x925	
				⊗		TB118	123x19	
	100	01/83 → 12/84	⊗	A/C(-)	SVB10940	10x940		
			⊗	A/C(+)	SVB10850	10x850		
			⊗	MS	SVB13925	13x925		
			⊗	MS	SVB13975	13x975		
			⊗	PS	SVB131075	13x1075		
			⊗	PS	SVB131350	13x1350		
			⊗		SVB10925	10x925		
			⊗		TB118	123x19		
B 230 K	85	08/86 → 12/88	⊗	A/C(-)	SVB10940	10x940		
			⊗	A/C(+)	SVB10850	10x850		
			⊗	MS	SVB13925	13x925		
			⊗	MS	SVB13975	13x975		
			⊗	PS	SVB131075	13x1075		
			⊗	PS	SVB131350	13x1350		
2.3 CAT	B 230 F	100	08/91 → 07/92	⊗		SVB10925	10x925	
				⊗		TB118	123x19	
				⊗	A/C(-)	SVB10940	10x940	
				⊗	A/C(+)	SVB10850	10x850	
				⊗	MS	SVB13925	13x925	
				⊗	MS	SVB13975	13x975	
	2.3 i CAT	B 230 F	85	08/86 → 07/93	⊗	PS	SVB131075	13x1075
					⊗	PS	SVB131350	13x1350
					⊗		SVB10925	10x925
					⊗		TB118	123x19
					⊗	→12/92	TB404	123x19
					⊗	01/93→	SVB10990	10x990
					⊗	A/C(-), LHD, 01/91→	SVB10940	10x940
					⊗	A/C(-), RHA	SVB10850	10x850
2.4 Diesel	D 24	58	08/88 → 08/93	⊗	A/C(+)	SVB10840	10x840	
				⊗		SVB13925	13x925	
				⊗		SVB10975	10x975	
				⊗	A/C(-), MS	SVB101237	10x1237	
				⊗	A/C(+), PS	SVB10800	10x800	
				⊗	A/C(+), PS	TB131	119x25.4	
	60	04/79 → 08/93	⊗		TBK044			
			⊗		TB136	75x20		
			⊗	A/C(-)	SVB10888	10x888		
			⊗	10/82→	SVB13925	13x925		
			⊗	A/C(-), MS	SVB10975	10x975		
			⊗	A/C(+), PS	SVB10800	10x800		
			⊗		TB131	119x25.4		
			⊗		TBK044			
2.4 Diesel	D 24	58	08/88 → 08/93	⊗		TB136	75x20	
				⊗		SVB10888	10x888	
				⊗	A/C(-), 10/82→	SVB10888	10x888	
				⊗	A/C(-)	SVB101237	10x1237	
				⊗	A/C(+)			
				⊗	A/C(+)			



kW



VOLVO

...VOLVO

...240 Kombi (P245)

2.7 GLT6	B 27 E	104	08/79 → 07/80	☼	→ Ch. 10919	SVB101400	10x1400
				☼	Ch. 10920→	SVB131400	13x1400
				⊖	→ Ch. 8114	SVB101125	10x1125
				⊖	Ch. 8115→	SVB101100	10x1100
				⊖	→ Ch. 8114	SVB10975	10x975
				⊖	Ch. 8115→	SVB10960	10x960
2.8		95	10/81 → 09/82	☼		SVB131400	13x1400
				⊖		SVB10960	10x960
		114	10/80 → 09/82	☼		SVB131400	13x1400
				⊖		SVB101100	10x1100
				⊖		SVB101125	10x1125
				⊖		SVB10960	10x960

340-360 (343, 345)

1.4	B 14.3 E	47	08/79 → 07/83	⊖	09/82→, → Ch. 609999	SVB101215	10x1215
				⊖	09/82→, Ch. 610000→	SVB101237	10x1237
	B 14.4 S	51	08/75 → 07/83	⊖	→08/80, → Ch. 609999	SVB101215	10x1215
				⊖	→08/80, Ch. 610000→	SVB101237	10x1237
		52	08/83 → 07/86	⊖	→ Ch. 609999	SVB101215	10x1215
				⊖	Ch. 610000→	SVB101237	10x1237
	B 14.3 E	46	08/82 → 08/85	⊖	→ Ch. 609999	SVB101215	10x1215
				⊖	Ch. 610000→	SVB101237	10x1237
	B 14.4 S	50	08/86 → 12/88	⊖	→ Ch. 609999	SVB101215	10x1215
				⊖	Ch. 610000→	SVB101237	10x1237
		51	08/87 → 07/88	⊖	→ Ch. 609999	SVB101215	10x1215
				⊖	Ch. 610000→	SVB101237	10x1237
1.6 Diesel	D 16	40	08/84 → 07/91	⊖	→ Eng Nr 14931	MVB885R4	4PK885
				⊖	Eng Nr 14932→	MVB887R5	5PK887
				☼	→ Eng Nr 32767	TB189	153x25.4
				☼	Eng Nr 32768→	TB258	153x25.4
				☼	→ Eng Nr 32767	TBK047	
				☼	Eng Nr 32768→	TBK038	
				⊖		SVB10750	10x750
1.7	B 17.2 K	59	08/85 → 07/91	⊖		MVB850R5	5PK850
				☼	→ Eng Nr 51891	TB195	124x19
				☼	Eng Nr 51892→	TB256	125x19
				☼	→ Eng Nr 51891	TBK051	
				☼	Eng Nr 51892→	TBK017	
2.0	B 19 A, B 200 K	70	08/80 → 07/83	☼	Eng. B19A, →08/82	SVB131000	13x1000
				⊖	Eng. B19A, →08/82	SVB10925	10x925
				☼	→08/82	TB118	123x19
				⊖	Eng. B19A, A/C(-), →08/82	SVB10940	10x940
				⊖	Eng. B19A, A/C(+), →08/82	SVB10865	10x865
	B 19 A	65	08/80 → 07/84	☼	09/82→	SVB131000	13x1000
				⊖	09/82→	SVB10925	10x925
				☼	09/82→	TB118	123x19
				⊖	A/C(-), 09/82→	SVB10940	10x940
				⊖	A/C(+), 09/82→	SVB10865	10x865
	B 200 F	80	08/88 → 07/89	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				⊖	A/C(-)	SVB10940	10x940
				⊖	A/C(+)	SVB10865	10x865
	B 200 E, B 200 F	82	08/86 → 07/88	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				⊖	A/C(-)	SVB10940	10x940
				⊖	A/C(+)	SVB10865	10x865



kW



...VOLVO

...340-360 (343, 345)

...2.0	B 19 E	83	08/82 → 07/84	⊗		SVB131000	13x1000
				⊗		SVB10925	10x925
				⊗		TB118	123x19
				⊗	A/C(-)	SVB10940	10x940
				⊗	A/C(+)	SVB10865	10x865
		85	08/82 → 07/84	⊗		SVB131000	13x1000
				⊗		SVB10925	10x925
				⊗		TB118	123x19
				⊗	A/C(-)	SVB10940	10x940
				⊗	A/C(+)	SVB10865	10x865
	B 19 A	68	08/83 → 07/84	⊗		SVB131000	13x1000
				⊗		SVB10925	10x925
				⊗		TB118	123x19
				⊗	A/C(-)	SVB10940	10x940
				⊗	A/C(+)	SVB10865	10x865
	B 200 K	77	08/84 → 07/87	⊗		SVB131000	13x1000
				⊗		SVB10925	10x925
				⊗		TB118	123x19
				⊗	A/C(-)	SVB10940	10x940
				⊗	A/C(+)	SVB10865	10x865
	B 200 E	87	08/84 → 07/86	⊗		SVB131000	13x1000
				⊗		SVB10925	10x925
				⊗		TB118	123x19
				⊗	A/C(-)	SVB10940	10x940
				⊗	A/C(+)	SVB10865	10x865
	B 200 F	81	08/87 → 07/88	⊗		SVB131000	13x1000
				⊗		SVB10925	10x925
				⊗		TB118	123x19
				⊗	A/C(-)	SVB10940	10x940
				⊗	A/C(+)	SVB10865	10x865

340-360 Saloon (344)

1.4	B 14.4 S	50	08/86 → 12/88	⊗	→ Ch. 609999	SVB101215	10x1215		
				⊗	Ch. 610000→	SVB101237	10x1237		
				51	08/87 → 07/88	⊗	→ Ch. 609999	SVB101215	10x1215
						⊗	Ch. 610000→	SVB101237	10x1237
				53	08/83 → 07/86	⊗	→ Ch. 609999	SVB101215	10x1215
				⊗	Ch. 610000→	SVB101237	10x1237		
1.6 Diesel	D 16	40	08/84 → 07/91	⊗	→ Eng Nr 14931	MVB885R4	4PK885		
				⊗	Eng Nr 14932→	MVB887R5	5PK887		
					→ Eng Nr 32767	TB189	153x25.4		
					Eng Nr 32768→	TB258	153x25.4		
					→ Eng Nr 32767	TBK047			
					Eng Nr 32768→	TBK038			
			⊗		SVB10750	10x750			
1.7	B 17 2 K	59	08/85 → 07/91	⊗		MVB850R5	5PK850		
					→ Eng Nr 51891	TB195	124x19		
					Eng Nr 51892→	TB256	125x19		
					→ Eng Nr 51891	TBK051			
					Eng Nr 51892→	TBK017			



kW



...VOLVO

...340-360 Saloon (344)

VOLVO

2.0	B 19 A	66	08/82 → 07/84	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				☼	A/C(-)	SVB10940	10x940
				☼	A/C(+)	SVB10865	10x865
	B 200 K	75	08/84 → 07/90	☼	→08/89	SVB131000	13x1000
				⊖	→08/89	SVB10925	10x925
				☼	→08/89	TB118	123x19
				☼	A/C(-), →08/89	SVB10940	10x940
				☼	A/C(+), →08/89	SVB10865	10x865
	B 200 E	85	08/84 → 07/86	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				☼	A/C(-)	SVB10940	10x940
				☼	A/C(+)	SVB10865	10x865
	B 19 A	68	08/83 → 07/84	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				☼	A/C(-)	SVB10940	10x940
				☼	A/C(+)	SVB10865	10x865
	B 200 K	77	08/84 → 07/87	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				☼	A/C(-)	SVB10940	10x940
				☼	A/C(+)	SVB10865	10x865
	B 200 E	87	08/84 → 07/86	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				☼	A/C(-)	SVB10940	10x940
				☼	A/C(+)	SVB10865	10x865
	B 200 EA	82	08/86 → 07/88	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				☼	A/C(-)	SVB10940	10x940
				☼	A/C(+)	SVB10865	10x865
	B 200 F	80	08/88 → 07/89	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				☼	A/C(-)	SVB10940	10x940
				☼	A/C(+)	SVB10865	10x865
	B 200 EA	81	08/87 → 07/88	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				☼	A/C(-)	SVB10940	10x940
				☼	A/C(+)	SVB10865	10x865
	B 19 E	83	08/83 → 07/84	☼		SVB131000	13x1000
				⊖		SVB10925	10x925
				☼		TB118	123x19
				☼	A/C(-)	SVB10940	10x940
				☼	A/C(+)	SVB10865	10x865

440 K (445)

1.6	B 16 F	61	09/88 → 12/96	☼	PS, 09/91→	MVB1550R6	6PK1550
				⊖	A/C(-), PS, 09/91→	MVB1155R6	6PK1155
				⊖	A/C(+), MS, 09/91→	MVB838R6	6PK838
				⊖	A/C(+), PS, 09/91→,	MVB600R3	3PK600
					→ Ch. 656031		
				⊖	A/C(+), PS, 09/91→,	MVB580R4	4PK580
					Ch. 656032→		
				☼	09/91→	TB256	125x19
				☼	09/91→	TBK017	



kW



...VOLVO

...440 K (445)

1.7	B 18 F	70	08/88 → 07/89	☼	PS, → Ch. 60000	MVB1550R6	6PK1550			
				☼	PS, Ch. 60001→	MVB1550R6	6PK1550			
				⊗	A/C(-), PS	MVB1155R6	6PK1155			
				⊗	A/C(+), MS	MVB838R6	6PK838			
				⊗	A/C(+), PS, → Ch. 656031	MVB600R3	3PK600			
				⊗	A/C(+), PS, Ch. 656032→	MVB580R4	4PK580			
						TB256	125x19			
						TBK017				
				B 18 EP	78	09/88 → 12/96	☼	PS, →04/96, → Ch. 60000	MVB1550R6	6PK1550
							☼	PS, →04/96, Ch. 60001→	MVB1550R6	6PK1550
⊗	A/C(-), MS, →04/96	MVB838R6	6PK838							
⊗	A/C(-), PS, →04/96	MVB1155R6	6PK1155							
⊗	A/C(+), PS, →04/96,	MVB600R3	3PK600							
	→ Ch. 656031									
⊗	A/C(+), PS, →04/96,	MVB580R4	4PK580							
	Ch. 656032→									
	→04/96	TB256	125x19							
	→04/96	TBK017								
B 18 KP	64	09/88 → 12/96	☼	PS, →04/96, → Ch. 60000	MVB1550R6	6PK1550				
			☼	PS, →04/96, Ch. 60001→	MVB1550R6	6PK1550				
			⊗	A/C(-), MS, →04/96	MVB838R6	6PK838				
			⊗	A/C(-), PS, →04/96	MVB1155R6	6PK1155				
			⊗	A/C(+), PS, →04/96,	MVB600R3	3PK600				
				→ Ch. 656031						
			⊗	A/C(+), PS, →04/96,	MVB580R4	4PK580				
				Ch. 656032→						
				→04/96	TB256	125x19				
				→04/96	TBK017					
B 18 FP	75	08/89 → 12/96	☼	PS, →04/96, → Ch. 60000	MVB1550R6	6PK1550				
			☼	PS, →04/96, Ch. 60001→	MVB1550R6	6PK1550				
			⊗	A/C(-), MS, →04/96	MVB838R6	6PK838				
			⊗	A/C(-), PS, →04/96	MVB1155R6	6PK1155				
			⊗	A/C(+), PS, →04/96,	MVB600R3	3PK600				
				→ Ch. 656031						
			⊗	A/C(+), PS, →04/96,	MVB580R4	4PK580				
				Ch. 656032→						
				→04/96	TB256	125x19				
				→04/96	TBK017					
1.7 Turbo	B 18 FT	88	08/88 → 07/96	☼	PS, → Ch. 60000	MVB1550R6	6PK1550			
				☼	PS, Ch. 60001→	MVB1550R6	6PK1550			
				⊗	A/C(-), PS	MVB1155R6	6PK1155			
				⊗	A/C(+), MS	MVB838R6	6PK838			
				⊗	A/C(+), PS, → Ch. 656031	MVB600R3	3PK600			
				⊗	A/C(+), PS, Ch. 656032→	MVB580R4	4PK580			
						TB256	125x19			
						TBK017				
				90	01/91 → 12/96	☼	PS, →04/96, → Ch. 60000	MVB1550R6	6PK1550	
						☼	PS, →04/96, Ch. 60001→	MVB1550R6	6PK1550	
⊗	A/C(-), MS, →04/96	MVB838R6	6PK838							
⊗	A/C(-), PS, →04/96	MVB1155R6	6PK1155							
⊗	A/C(+), PS, →04/96,	MVB600R3	3PK600							
	→ Ch. 656031									
⊗	A/C(+), PS, →04/96,	MVB580R4	4PK580							
	Ch. 656032→									
	→04/96	TB256	125x19							
	→04/96	TBK017								



kw



VOLVO

...VOLVO

...440 K (445)

1.8	B 18 U	66	08/91 → 07/96	☼	PS, → Ch. 60000	MVB1550R6	6PK1550
				☼	PS, Ch. 60001→	MVB1550R6	6PK1550
				⊖	A/C(-), MS	MVB838R6	6PK838
				⊖	A/C(-), PS	MVB1155R6	6PK1155
				⊖	A/C(+), PS, → Ch. 656031	MVB600R3	3PK600
				⊖	A/C(+), PS, Ch. 656032→	MVB580R4	4PK580
						TB256	125x19
						TBK017	
		66	09/95 → 12/96	☼	PS, → Ch. 60000	MVB1550R6	6PK1550
				☼	PS, Ch. 60001→	MVB1550R6	6PK1550
				⊖	A/C(-), PS	MVB1155R6	6PK1155
				⊖	A/C(+), MS	MVB838R6	6PK838
				⊖	A/C(+), PS, → Ch. 656031	MVB600R3	3PK600
				⊖	A/C(+), PS, Ch. 656032→	MVB580R4	4PK580
						TB256	125x19
						TBK017	
1.9 Turbo-Diesel	D 19 T	66	07/94 → 12/96	⊖	A/C(-)	MVB1155R6	6PK1155
				⊖	A/C(+)	MVB1173R6	6PK1173
						TB258	153x25.4
						TBK038	
2.0	B 20 F	81	08/92 → 07/95	☼	PS	MVB1550R6	6PK1550
				⊖	A/C(-), MS	MVB838R6	6PK838
				⊖	A/C(-), PS	MVB1155R6	6PK1155
				⊖	A/C(+), PS	MVB600R3	3PK600
						TB431	127x19
		80	08/93 → 07/96	☼	PS	MVB1550R6	6PK1550
				⊖	A/C(-), MS	MVB838R6	6PK838
				⊖	A/C(-), PS	MVB1155R6	6PK1155
				⊖	A/C(+), PS	MVB600R3	3PK600
						TB431	127x19

460 L (464)

1.6	B 16 F	61	07/92 → 07/96	☼	PS, 09/93→	MVB1550R6	6PK1550
				⊖	A/C(-), MS, 09/93→	MVB838R6	6PK838
				⊖	A/C(-), PS, 09/93→	MVB1155R6	6PK1155
				⊖	A/C(+), PS, 09/93→, → Ch. 656031	MVB600R3	3PK600
				⊖	A/C(+), PS, 09/93→, Ch. 656032→	MVB580R4	4PK580
					09/93→	TB256	125x19
					09/93→	TBK017	
1.7	B 18 EP	75	08/89 → 07/92	☼	PS, → Ch. 60000	MVB1550R6	6PK1550
				☼	PS, Ch. 60001→	MVB1550R6	6PK1550
				⊖	A/C(-), MS	MVB838R6	6PK838
				⊖	A/C(-), PS	MVB1155R6	6PK1155
				⊖	A/C(+), PS, → Ch. 656031	MVB600R3	3PK600
				⊖	A/C(+), PS, Ch. 656032→	MVB580R4	4PK580
						TB256	125x19
						TBK017	
		66	09/90 → 07/96	☼	PS, → Ch. 60000	MVB1550R6	6PK1550
				☼	PS, Ch. 60001→	MVB1550R6	6PK1550
				⊖	A/C(-), MS	MVB838R6	6PK838
				⊖	A/C(-), PS	MVB1155R6	6PK1155
				⊖	A/C(+), PS, → Ch. 656031	MVB600R3	3PK600
				⊖	A/C(+), PS, Ch. 656032→	MVB580R4	4PK580
						TB256	125x19
						TBK017	



kW



...VOLVO

...460 L (464)

Engine	Model	kW	Period	Accessories	Options	Part Number	Part Number					
...1.7	B 18 KP	64	09/88 → 07/96		PS, 09/89→, → Ch. 60000	MVB1550R6	6PK1550					
					PS, 09/89→, Ch. 60001→	MVB1550R6	6PK1550					
					A/C(-), PS, 09/89→	MVB1155R6	6PK1155					
					A/C(+), MS, 09/89→	MVB838R6	6PK838					
					A/C(+), PS, 09/89→, → Ch. 656031	MVB600R3	3PK600					
					A/C(+), PS, 09/89→, Ch. 656032→	MVB580R4	4PK580					
					09/89→	TB256	125x19					
					09/89→	TBK017						
					80	08/89 → 07/92		PS, → Ch. 60000	MVB1550R6	6PK1550		
					PS, Ch. 60001→	MVB1550R6	6PK1550					
A/C(-), PS	MVB1155R6	6PK1155										
A/C(+), MS	MVB838R6	6PK838										
A/C(+), PS, → Ch. 656031	MVB600R3	3PK600										
A/C(+), PS, Ch. 656032→	MVB580R4	4PK580										
		TB256	125x19									
		TBK017										
1.7 Turbo	B 18 FT	88	08/89 → 07/96		PS, → Ch. 60000	MVB1550R6	6PK1550					
					PS, Ch. 60001→	MVB1550R6	6PK1550					
					A/C(-), PS	MVB1155R6	6PK1155					
					A/C(+), MS	MVB838R6	6PK838					
					A/C(+), PS, → Ch. 656031	MVB600R3	3PK600					
					A/C(+), PS, Ch. 656032→	MVB580R4	4PK580					
						TB256	125x19					
						TBK017						
					90	01/91 → 07/96		PS, → Ch. 60000	MVB1550R6	6PK1550		
					PS, Ch. 60001→	MVB1550R6	6PK1550					
A/C(-), PS	MVB1155R6	6PK1155										
A/C(+), MS	MVB838R6	6PK838										
A/C(+), PS, → Ch. 656031	MVB600R3	3PK600										
A/C(+), PS, Ch. 656032→	MVB580R4	4PK580										
	TB256	125x19										
	TBK017											
1.8	B 18 U	66	08/91 → 07/96		PS, → Ch. 60000	MVB1550R6	6PK1550					
					PS, Ch. 60001→	MVB1550R6	6PK1550					
					A/C(-), PS	MVB1155R6	6PK1155					
					A/C(+), MS	MVB838R6	6PK838					
					A/C(+), PS, → Ch. 656031	MVB600R3	3PK600					
					A/C(+), PS, Ch. 656032→	MVB580R4	4PK580					
						TB256	125x19					
						TBK017						
					1.9 Turbo-Diesel	D 19 T	66	07/94 → 07/96		A/C(-)	MVB1155R6	6PK1155
										A/C(+)	MVB1173R6	6PK1173
	TB258	153x25.4										
	TBK038											
2.0	B 20 F	81	08/92 → 07/95		PS	MVB1550R6	6PK1550					
					A/C(-), PS	MVB1155R6	6PK1155					
					A/C(+), MS	MVB838R6	6PK838					
					A/C(+), PS	MVB600R3	3PK600					
						TB431	127x19					
		80	08/93 → 07/96		PS	MVB1550R6	6PK1550					
					A/C(-), MS	MVB838R6	6PK838					
					A/C(-), PS	MVB1155R6	6PK1155					
					A/C(+), PS	MVB600R3	3PK600					
						TB431	127x19					

VOLVO



kw



...VOLVO

480 E

VOLVO

1.7	B 18 F	70	08/87 → 07/89		PS, → Ch. 60000	MVB1550R6	6PK1550	
					PS, Ch. 60001→	MVB1550R6	6PK1550	
					A/C(-), MS	MVB838R6	6PK838	
					A/C(-), PS	MVB1155R6	6PK1155	
					A/C(+), PS	MVB600R3	3PK600	
					→ Eng Nr B18F1725,B18FT1455	TB195	124x19	
					Eng Nr B18F1726,B18FT1456→	TB256	125x19	
					→ Eng Nr B18F1725,B18FT1455	TBK051		
					Eng Nr B18F1726,B18FT1456→	TBK017		
					B 18 E	80	08/86 → 07/88	
	PS, Ch. 60001→	MVB1550R6	6PK1550					
	A/C(-), MS	MVB838R6	6PK838					
	A/C(-), PS	MVB1155R6	6PK1155					
	A/C(+), PS	MVB600R3	3PK600					
		TB256	125x19					
	→ Eng Nr B18E16529	TB195	124x19					
		TBK017						
	→ Eng Nr B18E16529	TBK051						
	B 18 EP	75	08/89 → 07/96					
					PS, →12/95, Ch. 60001→	MVB1550R6	6PK1550	
					A/C(-), MS, →12/95	MVB838R6	6PK838	
					A/C(-), PS, →12/95	MVB1155R6	6PK1155	
					A/C(+), PS, →12/95	MVB600R3	3PK600	
					→12/95, → Eng Nr B18F1725, B18FT1455	TB195	124x19	
					→12/95, Eng Nr B18F1726, B18FT1456→	TB256	125x19	
					→12/95, → Eng Nr B18F1725, B18FT1455	TBK051		
					→12/95, Eng Nr B18F1726, B18FT1456→	TBK017		
					B 18 E	78	04/86 → 07/89	
	PS, Ch. 60001→	MVB1550R6	6PK1550					
	A/C(-), MS	MVB838R6	6PK838					
	A/C(-), PS	MVB1155R6	6PK1155					
	A/C(+), PS	MVB600R3	3PK600					
		TB256	125x19					
	→ Eng Nr B18E16529	TB195	124x19					
		TBK017						
	→ Eng Nr B18E16529	TBK051						
1.7 Turbo	B 18 FT	88	08/87 → 07/96					
					PS, →12/95, Ch. 60001→	MVB1550R6	6PK1550	
					A/C(-), MS, →12/95	MVB838R6	6PK838	
					A/C(-), PS, →12/95	MVB1155R6	6PK1155	
					A/C(+), PS, →12/95	MVB600R3	3PK600	
					→12/95, → Eng Nr B18F1725, B18FT1455	TB195	124x19	
					→12/95, Eng Nr B18F1726, B18FT1456→	TB256	125x19	
					→12/95, → Eng Nr B18F1725, B18FT1455	TBK051		
					→12/95, Eng Nr B18F1726, B18FT1456→	TBK017		
		90		01/91 → 07/96		PS, →12/95, → Ch. 60000	MVB1550R6	6PK1550
						PS, →12/95, Ch. 60001→	MVB1550R6	6PK1550
						A/C(-), MS, →12/95	MVB838R6	6PK838
						A/C(-), PS, →12/95	MVB1155R6	6PK1155
						A/C(+), PS, →12/95	MVB600R3	3PK600
	→12/95, → Eng Nr B18F1725, B18FT1455				TB195	124x19		
	→12/95, Eng Nr B18F1726, B18FT1456→	TB256	125x19					
	→12/95, → Eng Nr B18F1725, B18FT1455	TBK051						
	→12/95, Eng Nr B18F1726, B18FT1456→	TBK017						



kW



...VOLVO

...480 E

2.0	B 20 F	81	08/92 → 09/95	 	PS A/C(-), PS A/C(+), PS	MVB1550R6 MVB1155R6 MVB600R3 TB431	6PK1550 6PK1155 3PK600 127x19
-----	---------------	----	---------------	--------------	--------------------------------	---	--

740 (744)

2.0	B 200 G	89	08/85 → 07/92		09/87 →	SVB13975	13x975
					09/87 → 12/87	SVB10913	10x913
					A/C(-), 01/88 →	SVB10925	10x925
					09/87 →	TB118	123x19
		01/88 →	SVB121015	12x1015			
		A/C(-), 09/87 → 12/87	SVB10940	10x940			
		A/C(+), 09/87 → 12/87	SVB10875	10x875			
	B 200 E	86	01/87 → 08/88		09/87 →	SVB13975	13x975
					09/87 → 12/87	SVB10913	10x913
					A/C(-), 01/88 →	SVB10925	10x925
				09/87 →	TB118	123x19	
				01/88 →	SVB121015	12x1015	
				A/C(-), 09/87 → 12/87	SVB10940	10x940	
B 200 K	76	09/88 → 08/90			SVB13975	13x975	
				A/C(-)	SVB10925	10x925	
				A/C(+)	SVB121015	12x1015	
					TB118	123x19	
B 200 ET	118	01/86 → 08/90			SVB13975	13x975	
					TB118	123x19	
	120	01/85 → 12/85			SVB121015	12x1015	
					SVB13975	13x975	
B 19 ET	110	12/83 → 07/84			SVB13975	13x975	
					TB118	123x19	
					SVB10925	10x925	
				A/C(-)	SVB10940	10x940	
	147	09/90 → 08/92			SVB10865	10x865	
					SVB101275	10x1275	
					TB297	110x14	
				Auto Tensioner	TB430	167x23	
	Manu Tensioner	TB520	164x23				
		SVB121015	12x1015				
2.3	B 230 F	83	09/85 → 12/89		09/87 →	SVB13975	13x975
					09/87 → 12/87	SVB10913	10x913
					A/C(-), 01/88 →	SVB10925	10x925
					09/87 →	TB118	123x19
		01/88 →	SVB121015	12x1015			
	B 23 A, B 230 F	84	08/84 → 07/90		09/87 →	SVB13975	13x975
					09/87 → 12/87	SVB10913	10x913
					A/C(-), 01/88 →	SVB10925	10x925
					09/87 →	TB118	123x19
		01/88 →	SVB121015	12x1015			
B 230 E	96	08/84 → 07/88		01/85 →	SVB13975	13x975	
				MS, →12/84	SVB13925	13x925	
				PS, →12/84	SVB131075	13x1075	
					SVB10913	10x913	
					TB118	123x19	
				A/C(-), →12/87	SVB10940	10x940	
	A/C(-), 01/88 →	SVB10950	10x950				
	A/C(+)	SVB10875	10x875				



kW



VOLVO

...VOLVO

...740 (744)

...2.3	B 234 F	114	08/88 → 07/91	⊗		SVB131200	13x1200
				⊗		SVB13975	13x975
				⊖		SVB101275	10x1275
				⊖		SVB121015	12x1015
				⊖		TB297	110x14
				⊖		TB118	123x19
				⊖	Auto Tensioner	TB430	167x23
				⊖	Manu Tensioner	TB520	164x23
				⊖	→ Ch. 408724	SVB131060	13x1060
				B 230 F	85	08/87 → 07/92	⊗
	⊖	→12/87	SVB10913				10x913
	⊖	A/C(-), 01/88→	SVB10925				10x925
	⊖		TB118				123x19
	⊖	01/88→	SVB121015				12x1015
	B 230 FB	100	08/88 → 07/90	⊗		SVB13975	13x975
				⊖	A/C(-)	SVB10925	10x925
				⊖		TB118	123x19
				⊖		SVB121015	12x1015
	B 230 K	86	08/86 → 07/88	⊗		SVB13975	13x975
				⊖		SVB10913	10x913
⊖					TB118	123x19	
⊖				A/C(-), →12/87	SVB10940	10x940	
⊖				A/C(-), 01/88→	SVB10950	10x950	
⊖				A/C(+)	SVB10875	10x875	
B 23 E	95	08/83 → 07/84	⊗		SVB13925	13x925	
			⊖		TB118	123x19	
			⊖		SVB10913	10x913	
			⊖		SVB10925	10x925	
			⊖	A/C(-)	SVB10940	10x940	
			B 234 F	117	08/87 → 07/89	⊗	
⊖		SVB101275				10x1275	
⊖		TB297				110x14	
⊖	Auto Tensioner	TB430				167x23	
⊖	Manu Tensioner	TB520				164x23	
111	08/88 → 08/92	⊗					SVB131200
		⊖			SVB101275	10x1275	
		⊖			TB297	110x14	
		⊖		Auto Tensioner	TB430	167x23	
		⊖		Manu Tensioner	TB520	164x23	
		⊖		→ Ch. 408724	SVB131060	13x1060	
2.3 Turbo	B 230 FT	115		08/86 → 07/89	⊗	09/87→	SVB13975
			⊖		09/87→	TB118	123x19
			⊖		09/87→	SVB121015	12x1015
		121	08/89 → 07/90	⊗		SVB13975	13x975
				⊖		TB118	123x19
				⊖		SVB121015	12x1015
	140			08/89 → 07/90	⊗		SVB13975
		⊖			TB118	123x19	
	B 230 ET	134	08/85 → 12/88	⊗	09/87→	SVB13975	13x975
				⊖	09/87→	TB118	123x19
⊖				09/87→	SVB121015	12x1015	
2.4 Diesel				D 24	60	08/84 → 07/92	⊗
	⊖	01/87→08/91	SVB101150				10x1150
	⊖	MS, →12/86	SVB10750				10x750
	⊖	MS, →12/86	SVB10975				10x975
	⊖	PS, →12/86	SVB101237				10x1237
	⊖	→08/91	TB131				119x25.4
	⊖	→08/91	TBK044				
	⊖	→08/91	TB136				75x20
	⊖	01/87→08/91	SVB101010				10x1010



kW



...VOLVO

...740 (744)

2.4 TD		83	08/84 → 07/90	 		SVB13925 13x925 SVB101150 10x1150 SVB10750 10x750 SVB10975 10x975 SVB101237 10x1237 TB131 119x25.4 TBK044 TB136 75x20 SVB101010 10x1010
--------	--	----	---------------	--------------------------------------	--	--

740 Kombi (745)

2.0	B 200 F	82	08/89 → 07/91			SVB13975 13x975
					A/C(-)	SVB10925 10x925
						TB118 123x19
						SVB121015 12x1015
	B 200 G	89	08/85 → 07/92		09/87 →	SVB13975 13x975
					09/87 → 12/87	SVB10913 10x913
					A/C(-), 01/88 →	SVB10925 10x925
					09/87 →	TB118 123x19
					01/88 →	SVB121015 12x1015
					A/C(-), 09/87 → 12/87	SVB10940 10x940
B 200 E	86	01/87 → 08/88		09/87 →	SVB13975 13x975	
				09/87 → 12/87	SVB10913 10x913	
				A/C(-), 01/88 →	SVB10925 10x925	
				09/87 →	TB118 123x19	
				01/88 →	SVB121015 12x1015	
				A/C(-), 09/87 → 12/87	SVB10940 10x940	
2.0 16V	B 200 K	76	09/88 → 08/90			SVB13975 13x975
					A/C(-)	SVB10925 10x925
					A/C(+)	SVB121015 12x1015
						TB118 123x19
		147	09/90 → 08/92			SVB101275 10x1275
						TB297 110x14
					Auto Tensioner	TB430 167x23
					Manu Tensioner	TB520 164x23
						SVB121015 12x1015
					Ch. 250081 →	SVB121040 12x1040
2.3	B 204 E	100	09/87 → 08/90			SVB131200 13x1200
						SVB101275 10x1275
					Auto Tensioner	TB297 110x14
					Manu Tensioner	TB430 167x23
	B 230 F	83	08/85 → 12/89		09/87 →	TB520 164x23
					Ch. 250081 →	SVB121040 12x1040
					09/87 →	SVB13975 13x975
					09/87 → 12/87	SVB10913 10x913
					A/C(-), 01/88 →	SVB10925 10x925
					09/87 →	TB118 123x19
B 230 K	84	09/85 → 07/90		01/88 →	SVB121015 12x1015	
				09/87 →	SVB13975 13x975	
				09/87 → 12/87	SVB10913 10x913	
				A/C(-), 01/88 →	SVB10925 10x925	
				09/87 →	TB118 123x19	
				01/88 →	SVB121015 12x1015	
B 230 E	96	08/85 → 07/88			SVB13975 13x975	
					SVB10913 10x913	
					TB118 123x19	
				A/C(-), → 12/87	SVB10940 10x940	
				A/C(-), 01/88 →	SVB10950 10x950	
				A/C(+)	SVB10875 10x875	

VOLVO



kW



VOLVO

...VOLVO

...740 Kombi (745)

...2.3	B 230 F	85	08/87 → 07/92	☼	→08/91	SVB13975	13x975				
				⊖	→12/87	SVB10913	10x913				
				⊖	A/C(-), 01/88→08/91	SVB10925	10x925				
					☼	→08/91	TB118	123x19			
					⊖	01/88→08/91	SVB121015	12x1015			
	B 234 F	114	08/88 → 07/90	☼		SVB131200	13x1200				
				☼		SVB13975	13x975				
				⊖		SVB101275	10x1275				
				⊖		SVB121015	12x1015				
				⊖		TB297	110x14				
				☼		TB118	123x19				
				☼		TB430	167x23				
				☼	Auto Tensioner	TB520	164x23				
				☼	Manu Tensioner	SVB121040	12x1040				
				☼	Ch. 250081→	SVB13975	13x975				
					SVB10925	10x925					
					TB118	123x19					
B 230 FB	100	08/89 → 07/90	☼		SVB131200	13x1200					
			⊖		SVB101275	10x1275					
			⊖	A/C(-)	SVB121015	12x1015					
B 234 F	117	08/87 → 07/89	☼		SVB131200	13x1200					
			⊖		SVB101275	10x1275					
			⊖		TB297	110x14					
			☼		TB430	167x23					
			☼	Auto Tensioner	TB520	164x23					
			☼	Manu Tensioner	SVB121040	12x1040					
	111	07/89 → 08/92	☼		SVB131200	13x1200					
			⊖		SVB101275	10x1275					
			⊖		TB297	110x14					
			☼		TB430	167x23					
			☼	Auto Tensioner	TB520	164x23					
			☼	Manu Tensioner	SVB121040	12x1040					
2.3 Turbo	B 230 FT	115	08/86 → 07/89	☼	09/87→	SVB13975	13x975				
				☼		TB118	123x19				
				⊖	09/87→	SVB121015	12x1015				
	B 230 FT, B 230 GT	121	08/89 → 07/90	☼		SVB13975	13x975				
				⊖		TB118	123x19				
				⊖		SVB121015	12x1015				
	B 230 ET	134	08/85 → 07/88	☼	09/87→	SVB13975	13x975				
				⊖	09/87→	SVB121015	12x1015				
				⊖	09/87→	TB118	123x19				
	B 230 FT	140	08/89 → 07/90	☼		SVB13975	13x975				
				☼		TB118	123x19				
				⊖		SVB121015	12x1015				
	2.4 Diesel	D 24	60	08/85 → 07/88	☼		SVB13925	13x925			
					⊖	01/87→	SVB101150	10x1150			
					⊖	MS, →12/86	SVB10750	10x750			
⊖					MS, →12/86	SVB10975	10x975				
☼						TB131	119x25.4				
☼						TBK044					
☼						TB136	75x20				
☼					→12/86	SVB101237	10x1237				
☼					01/87→	SVB101010	10x1010				
2.4 TD Interc.					D 24 TIC	90	08/86 → 07/88	☼		SVB13925	13x925
								⊖	01/87→	SVB101150	10x1150
								⊖	MS, →12/86	SVB10750	10x750
								⊖	MS, →12/86	SVB10975	10x975
								⊖	PS, →12/86	SVB101237	10x1237
								☼		TB131	119x25.4
	☼		TBK044								
	☼		TB136	75x20							
	☼	01/87→	SVB101010	10x1010							



kW



...VOLVO

...740 Kombi (745)

2.4 Turbo-Diesel	D 24 T	80	09/85 → 07/92	⊗	→08/91	SVB13925	13x925
				⊗	01/87→08/91	SVB101150	10x1150
				⊗	MS, →12/86	SVB10750	10x750
				⊗	MS, →12/86	SVB10975	10x975
				⊗	→08/91	TB131	119x25.4
				⊗	→08/91	TBK044	
				⊗	→08/91	TB136	75x20
				⊗	→12/86	SVB101237	10x1237
				⊗	01/87→08/91	SVB101010	10x1010

760 (704, 764)

2.3	B 230 FT	119	01/88 → 07/92	⊗	→08/90	SVB13975	13x975
				⊗	→08/90	SVB121015	12x1015
				⊗	→08/90	TB118	123x19
		84	08/84 → 08/87	⊗	→12/84	SVB13925	13x925
				⊗	01/85→	SVB13975	13x975
				⊗	→12/84	SVB10913	10x913
				⊗		TB118	123x19
				⊗	01/85→	SVB121015	12x1015
				⊗	A/C(-), →12/84	SVB10940	10x940
				⊗	A/C(+), →12/84	SVB131075	13x1075
2.3 Turbo (704)	B 230 ET	134	08/84 → 10/88	⊗	→12/84	SVB13925	13x925
				⊗	01/85→	SVB13975	13x975
				⊗	→12/84	SVB10913	10x913
				⊗		TB118	123x19
				⊗	01/85→	SVB121015	12x1015
				⊗	A/C(-), →12/84	SVB10940	10x940
				⊗	A/C(+), →12/84	SVB131075	13x1075
	B 23 ET	127	08/82 → 07/84	⊗		SVB13925	13x925
				⊗		SVB10913	10x913
				⊗		TB118	123x19
				⊗	A/C(-)	SVB10940	10x940
				⊗	A/C(+)	SVB131075	13x1075
2.4 D	D 24	60	01/82 → 07/92	⊗	→08/90	SVB13925	13x925
				⊗	01/87→08/90	SVB101150	10x1150
				⊗	MS, →12/86	SVB10750	10x750
				⊗	MS, →12/86	SVB10975	10x975
				⊗	PS, →12/86	SVB101237	10x1237
				⊗	→08/90	TB131	119x25.4
				⊗	→08/90	TBK044	
				⊗	→08/90	TB136	75x20
				⊗	01/87→08/90	SVB101010	10x1010
2.4 TD Interc. (704)	D 24 TIC	85	08/87 → 07/92	⊗	→08/90	SVB13925	13x925
				⊗	→08/90	SVB101150	10x1150
				⊗	→08/90	TB131	119x25.4
				⊗	→08/90	TBK044	
				⊗	→08/90	TB136	75x20
				⊗	→08/90	SVB101010	10x1010
2.4 Turbo Diesel (704)	D 24 T	80	04/87 → 07/92	⊗	→08/90	SVB13925	13x925
				⊗	→08/90	SVB101150	10x1150
				⊗	→08/90	TB131	119x25.4
				⊗	→08/90	TBK044	
				⊗	→08/90	TB136	75x20
				⊗	→08/90	SVB101010	10x1010
		82	08/82 → 07/87	⊗		SVB13925	13x925
				⊗	01/87→	SVB101150	10x1150
				⊗	MS, →12/86	SVB10750	10x750
				⊗	MS, →12/86	SVB10975	10x975
				⊗		TB131	119x25.4
				⊗		TBK044	
				⊗		TB136	75x20
				⊗	→12/86	SVB101237	10x1237
				⊗	01/87→	SVB101010	10x1010



kW



VOLVO

...VOLVO

...760 (704, 764)

2.8	B 28 A	95	01/82 → 12/87	☼		SVB131400	13x1400		
				☼		SVB131425	13x1425		
				⊖	→ Ch. 135626	SVB101100	10x1100		
				⊖	Ch. 135627→	SVB101075	10x1075		
				☼		SVB10990	10x990		
				125	09/87 → 08/90	☼		SVB131425	13x1425
						☼	→12/87	SVB131400	13x1400
						⊖		SVB101100	10x1100
						⊖	→12/87, Ch. 135627→	SVB101075	10x1075
						☼		SVB10990	10x990
2.8 (704)	B 280 F	105	05/86 → 08/91	☼	→08/90	SVB131425	13x1425		
				☼	→12/87	SVB131400	13x1400		
				⊖	→08/90	SVB101100	10x1100		
				⊖	→12/87, Ch. 135627→	SVB101075	10x1075		
				☼	→08/90	SVB10990	10x990		
2.8 (704, 764)	B 28 E, B 280 E	115	08/81 → 07/88	☼	04/82→	SVB131425	13x1425		
				☼	04/82→12/87	SVB131400	13x1400		
				⊖	04/82→	SVB101100	10x1100		
				⊖	04/82→12/87, Ch. 135627→	SVB101075	10x1075		
				☼	04/82→	SVB10990	10x990		
2.8 (764)	B 280 F	108	08/86 → 07/90	☼		SVB131425	13x1425		
				☼	→12/87	SVB131400	13x1400		
				⊖		SVB101100	10x1100		
				⊖	→12/87, Ch. 135627→	SVB101075	10x1075		
				☼		SVB10990	10x990		

760 Kombi (704, 765)

2.3		84	08/84 → 08/87	☼	→12/84	SVB13925	13x925				
				☼	01/85→	SVB13975	13x975				
				⊖	→12/84	SVB10913	10x913				
						TB118	123x19				
				☼	01/85→	SVB121015	12x1015				
				☼	A/C(-), →12/84	SVB10940	10x940				
				☼	A/C(+), →12/84	SVB131075	13x1075				
2.3 Turbo	B 230 ET	134	08/84 → 08/90	☼	→12/84	SVB13925	13x925				
				☼	01/85→	SVB13975	13x975				
				⊖	→12/84	SVB10913	10x913				
						TB118	123x19				
				☼	01/85→	SVB121015	12x1015				
				☼	A/C(-), →12/84	SVB10940	10x940				
				☼	A/C(+), →12/84	SVB131075	13x1075				
2.4 D	D 24	60	01/82 → 07/92	☼	08/84→08/90	SVB13925	13x925				
				⊖	01/87→08/90	SVB101150	10x1150				
				⊖	MS, 08/84→12/86	SVB10750	10x750				
				⊖	MS, 08/84→12/86	SVB10975	10x975				
					08/84→08/90	TB131	119x25.4				
					08/84→08/90	TBK044					
					08/84→08/90	TB136	75x20				
				☼	01/87→08/90	SVB101010	10x1010				
				☼	08/84→12/86	SVB101237	10x1237				
				2.4 TD Interc. (765)	D 24 TIC	85	08/87 → 07/92	☼	→08/90	SVB13925	13x925
								⊖	→08/90	SVB101150	10x1150
	→08/90	TB131	119x25.4								
	→08/90	TBK044									
	→08/90	TB136	75x20								
☼	→08/90	SVB101010	10x1010								



kW



...VOLVO

...760 Kombi (704, 765)

2.8 (765)	B 280 F	105	05/86 → 08/91	⊗	→08/90	SVB131425	13x1425
				⊗	→12/87	SVB131400	13x1400
				⊗	→08/90	SVB101100	10x1100
				⊗	→12/87, Ch. 135627→	SVB101075	10x1075
				⊗	→08/90	SVB10990	10x990
				⊗			
	B 28 E, B 280 E	115	08/86 → 08/90	⊗		SVB131425	13x1425
				⊗	→12/87	SVB131400	13x1400
				⊗		SVB101100	10x1100
				⊗	→12/87, Ch. 135627→	SVB101075	10x1075
				⊗		SVB10990	10x990
				⊗			
B 28 A	95	05/86 → 12/87	⊗		SVB131400	13x1400	
			⊗		SVB131425	13x1425	
			⊗	→ Ch. 135626	SVB101100	10x1100	
			⊗	Ch. 135627→	SVB101075	10x1075	
			⊗		SVB10990	10x990	
			⊗				

780

2.9	B 280 E	115	08/86 → 07/87	⊗		SVB131425	13x1425
				⊗		SVB101100	10x1100
				⊗		SVB10990	10x990
	B 280 F	108	08/87 → 07/90	⊗		SVB131425	13x1425
				⊗		SVB101100	10x1100
				⊗		SVB10990	10x990

850 (LS)

2.0	B 5204 F	105	06/91 → 12/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250	
				⊗	A/C(-), MAN	MVB1270R6	6PK1270	
				⊗	A/C(+)	MVB1625R6	6PK1625	
				⊗	→ Eng Nr 131154	TB372	143x21	
				⊗	Eng Nr 131155→	TB434	148x23	
				⊗				
	B 5202 S	93	08/94 → 12/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250	
				⊗	A/C(-), MAN	MVB1270R6	6PK1270	
				⊗	A/C(+), → Eng Nr 565356	MVB1625R6	6PK1625	
				⊗	A/C(+), Eng Nr 565357→	MVB1740R6	6PK1740	
				⊗	→ Eng Nr 131154	TB438	139x21	
				⊗	Eng Nr 131155→	TB439	144x23	
	2.0 Turbo	B 5204 FT, B 5204 T	155	08/93 → 12/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250
					⊗	A/C(-), MAN	MVB1270R6	6PK1270
					⊗	A/C(+)	MVB1625R6	6PK1625
					⊗	→ Eng Nr 131154	TB372	143x21
					⊗	Eng Nr 131155→	TB434	148x23
					⊗			
2.3 T5	B 5234 FT	166	08/93 → 07/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250	
				⊗	A/C(-), MAN	MVB1270R6	6PK1270	
				⊗	A/C(+)	MVB1625R6	6PK1625	
				⊗	→ Eng Nr 131154	TB372	143x21	
				⊗	Eng Nr 131155→	TB434	148x23	
				⊗				
2.3 T5-R	B 5234 T4	184	08/95 → 12/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250	
				⊗	A/C(-), MAN	MVB1270R6	6PK1270	
				⊗	A/C(+)	MVB1625R6	6PK1625	
				⊗	→ Eng Nr 131154	TB372	143x21	
				⊗	Eng Nr 131155→	TB434	148x23	
				⊗				



kw



VOLVO

...VOLVO

...850 (LS)

2.5	B 5252	103	06/91 → 07/94	⊗	A/C(-), AUTO, 09/92→	MVB1250R6	6PK1250			
				⊗	A/C(-), MAN, 09/92→	MVB1270R6	6PK1270			
				⊗	A/C(+), 09/92→,	MVB1625R6	6PK1625			
					→ Eng Nr 565356					
				⊗	A/C(+), 09/92→,	MVB1740R6	6PK1740			
					Eng Nr 565357→					
					09/92→, → Eng Nr 131154	TB438	139x21			
					09/92→, Eng Nr 131155→	TB439	144x23			
				B 5254 S	125	08/91 → 12/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250
							⊗	A/C(-), MAN	MVB1270R6	6PK1270
⊗	A/C(+), → Eng Nr 565356	MVB1625R6	6PK1625							
⊗	A/C(+), Eng Nr 565357→	MVB1740R6	6PK1740							
	→ Eng Nr 131154	TB372	143x21							
	Eng Nr 131155→	TB434	148x23							
B 5252 S	106	08/94 → 12/96	⊗				A/C(-), AUTO	MVB1250R6	6PK1250	
			⊗				A/C(-), MAN	MVB1270R6	6PK1270	
			⊗				A/C(+), → Eng Nr 565356	MVB1625R6	6PK1625	
			⊗				A/C(+), Eng Nr 565357→	MVB1740R6	6PK1740	
				→ Eng Nr 131154	TB438	139x21				
				Eng Nr 131155→	TB439	144x23				
			2.5 TDI	D 5252 T	103	08/95 → 12/96	⊗	A/C(-), 12/95→	MVB1420R6	6PK1420
							⊗	A/C(-), 12/95→	MVB1428R6	6PK1428
							⊗	A/C(+), 12/95→	MVB1675R6	6PK1675
							⊗	A/C(+), 12/95→	MVB1685R6	6PK1685
	12/95→	TB785					122x26.5			
	12/95→	TB557					81x21			

850 Estate (LW)

2.0	B 5202 S	93	08/94 → 12/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250			
				⊗	A/C(-), MAN	MVB1270R6	6PK1270			
				⊗	A/C(+)	MVB1625R6	6PK1625			
					→ Eng Nr 131154	TB438	139x21			
					Eng Nr 131155→	TB439	144x23			
				B 5204 F	105	02/93 → 12/96	⊗	A/C(-), AUTO, 09/93→	MVB1250R6	6PK1250
							⊗	A/C(-), MAN, 09/93→	MVB1270R6	6PK1270
							⊗	A/C(+), 09/93→,	MVB1625R6	6PK1625
								→ Eng Nr 565356		
							⊗	A/C(+), 09/93→,	MVB1740R6	6PK1740
	Eng Nr 565357→									
	09/93→, → Eng Nr 131154	TB372	143x21							
	09/93→, Eng Nr 131155→	TB434	148x23							
2.0 Turbo	B 5204 FT, B 5204 T	155	02/93 → 12/96				⊗	A/C(-), AUTO, 09/93→	MVB1250R6	6PK1250
							⊗	A/C(-), MAN, 09/93→	MVB1270R6	6PK1270
				⊗	A/C(+), 09/93→,	MVB1625R6	6PK1625			
					→ Eng Nr 565356					
				⊗	A/C(+), 09/93→,	MVB1740R6	6PK1740			
					Eng Nr 565357→					
	09/93→, → Eng Nr 131154	TB372	143x21							
	09/93→, Eng Nr 131155→	TB434	148x23							
2.3 T5	B 5234 FT	166	02/93 → 12/96	⊗	A/C(-), AUTO, 09/93→	MVB1250R6	6PK1250			
				⊗	A/C(-), MAN, 09/93→	MVB1270R6	6PK1270			
				⊗	A/C(+), 09/93→,	MVB1625R6	6PK1625			
					→ Eng Nr 565356					
				⊗	A/C(+), 09/93→,	MVB1740R6	6PK1740			
					Eng Nr 565357→					
					09/93→, → Eng Nr 131154	TB372	143x21			
					09/93→, Eng Nr 131155→	TB434	148x23			
2.3 T5-R	B 5234 T4	184	08/95 → 12/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250			
				⊗	A/C(-), MAN	MVB1270R6	6PK1270			
				⊗	A/C(+), → Eng Nr 565356	MVB1625R6	6PK1625			
				⊗	A/C(+), Eng Nr 565357→	MVB1740R6	6PK1740			
					→ Eng Nr 131154	TB372	143x21			
					Eng Nr 131155→	TB434	148x23			



kW



VOLVO

...VOLVO

...850 Estate (LW)

2.5	B 5254 S	125	09/92 → 12/96	⊗	A/C(-), AUTO, 09/93→	MVB1250R6	6PK1250				
				⊗	A/C(-), MAN, 09/93→	MVB1270R6	6PK1270				
				⊗	A/C(+), 09/93→,	MVB1625R6	6PK1625				
					→ Eng Nr 565356						
				⊗	A/C(+), 09/93→,	MVB1740R6	6PK1740				
					Eng Nr 565357→						
					09/93→, → Eng Nr 131154	TB372	143x21				
					09/93→, Eng Nr 131155→	TB434	148x23				
				B 5252	103	08/92 → 07/94	⊗	A/C(-), AUTO, 09/93→	MVB1250R6	6PK1250	
							⊗	A/C(-), MAN, 09/93→	MVB1270R6	6PK1270	
⊗	A/C(+), 09/93→,	MVB1625R6	6PK1625								
	→ Eng Nr 565356										
⊗	A/C(+), 09/93→,	MVB1740R6	6PK1740								
	Eng Nr 565357→										
	09/93→, → Eng Nr 131154	TB438	139x21								
	09/93→, Eng Nr 131155→	TB439	144x23								
B 5252 S	106	08/94 → 12/96	⊗				A/C(-), AUTO	MVB1250R6	6PK1250		
			⊗				A/C(-), MAN	MVB1270R6	6PK1270		
			⊗	A/C(+), → Eng Nr 565356	MVB1625R6	6PK1625					
			⊗	A/C(+), Eng Nr 565357→	MVB1740R6	6PK1740					
				→ Eng Nr 131154	TB438	139x21					
				Eng Nr 131155→	TB439	144x23					
			2.5 AWD	B 5254 T	142	04/96 → 12/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250	
							⊗	A/C(-), MAN	MVB1270R6	6PK1270	
							⊗	A/C(+), → Eng Nr 565356	MVB1625R6	6PK1625	
							⊗	A/C(+), Eng Nr 565357→	MVB1740R6	6PK1740	
	→ Eng Nr 131154	TB372					143x21				
	Eng Nr 131155→	TB434					148x23				
2.5 TDI	D 5252 T	103					08/95 → 12/96	⊗	A/C(-), 12/95→	MVB1420R6	6PK1420
								⊗	A/C(-), 12/95→	MVB1428R6	6PK1428
								⊗	A/C(+), 12/95→	MVB1675R6	6PK1675
								⊗	A/C(+), 12/95→	MVB1685R6	6PK1685
				12/95→	TB785	122x26.5					
				12/95→	TB557	81x21					

940 (944)

2.0	B 200 F	82	01/92 → 07/94	⊗	→12/92	SVB13975	13x975				
				⊗	01/93→	SVB13950	13x950				
				⊗	A/C(-), → Ch. 117441	SVB10925	10x925				
				⊗	A/C(-), Ch. 117442→	SVB12885	12x885				
					→12/92	TB118	123x19				
					01/93→	TB404	123x19				
				⊗		SVB121015	12x1015				
				2.0 Turbo	B 200 FT	114	04/96 → 10/98	⊗	AUTO, →05/97	SVB13950	13x950
								⊗	MAN, →05/97	SVB13975	13x975
									→05/97	TB404	123x19
⊗	→05/97	SVB121015	12x1015								



kW



VOLVO

...VOLVO

...940 (944)

2.3	B 230 FB, B 230 G	96	08/90 → 12/94	⊗		SVB13950	13x950				
				⊗	→12/92	SVB13975	13x975				
				⊗		SVB10913	10x913				
				⊗		SVB10925	10x925				
				⊗	A/C(-), Ch. 117442→	SVB12885	12x885				
				⊗	→12/92	TB118	123x19				
				⊗	01/93→	TB404	123x19				
				⊗		SVB121015	12x1015				
				⊗	A/C(-)	SVB10950	10x950				
				⊗	A/C(+)	SVB10875	10x875				
				B 230 FD	85	08/92 → 07/94	⊗	→12/92	SVB13975	13x975	
							⊗	01/93→	SVB13950	13x950	
							⊗	A/C(-), → Ch. 117441	SVB10925	10x925	
							⊗	A/C(-), Ch. 117442→	SVB12885	12x885	
							⊗	→12/92	TB118	123x19	
⊗	01/93→	TB404	123x19								
⊗		SVB121015	12x1015								
B 234 F, B 234 G	114	08/90 → 07/91	⊗					SVB131200	13x1200		
			⊗		SVB101275	10x1275					
			⊗		TB297	110x14					
			⊗		TB430	167x23					
			⊗		SVB121040	12x1040					
2.3 Turbo	B 230 FT	121	08/90 → 07/94	⊗	AUTO, 01/93→	SVB13950	13x950				
				⊗	MAN	SVB13975	13x975				
				⊗	A/C(-), → Ch. 117441	SVB10925	10x925				
				⊗	A/C(-), Ch. 117442→	SVB12885	12x885				
				⊗	→12/92	TB118	123x19				
				⊗	01/93→	TB404	123x19				
				⊗		SVB121015	12x1015				
				B 230 FT+	140	08/91 → 07/93	⊗	AUTO, 01/93→	SVB13950	13x950	
							⊗	MAN	SVB13975	13x975	
							⊗	→12/92	TB118	123x19	
⊗	01/93→	TB404	123x19								
⊗		SVB121015	12x1015								
2.4 D	D 24	60	08/90 → 12/94	⊗	→12/92	SVB13925	13x925				
				⊗	01/93→	SVB13900	13x900				
				⊗		SVB101150	10x1150				
				⊗	→12/92	TB131	119x25.4				
				⊗	01/93→	TB440	120x25.4				
				⊗	→12/92	TBK044					
				⊗		TB136	75x20				
				⊗		SVB101010	10x1010				
				2.4 TD Intercooler	D 24 TIC	90	08/90 → 12/94	⊗	→12/92	SVB13925	13x925
								⊗	01/93→	SVB13900	13x900
⊗		SVB101150	10x1150								
⊗	→12/92	TB131	119x25.4								
⊗	01/93→	TB440	120x25.4								
⊗	→12/92	TBK044									
⊗		TB136	75x20								
⊗		SVB101010	10x1010								
2.4 Turbo Diesel	D 24 T	80	08/90 → 12/94	⊗	→12/92	SVB13925	13x925				
				⊗	01/93→	SVB13900	13x900				
				⊗		SVB101150	10x1150				
				⊗	→12/92	TB131	119x25.4				
				⊗	01/93→	TB440	120x25.4				
				⊗	→12/92	TBK044					
				⊗		TB136	75x20				
⊗		SVB101010	10x1010								



kW



...VOLVO

940 II (944)

2.0 Turbo	B 200 FT	114	04/96 → 10/98	⚙️	AUTO, →05/97	SVB13950	13x950
				⚙️	MAN, →05/97	SVB13975	13x975
				🔧	→05/97	TB404	123x19
				⊕	→05/97	SVB121015	12x1015
2.3	B 230 FB	96	08/94 → 10/98	⚙️	→05/97	SVB13950	13x950
				⚙️	A/C(-), →05/97, → Ch. 117441	SVB10925	10x925
				⚙️	A/C(-), →05/97, Ch. 117442→	SVB12885	12x885
				🔧	→05/97	TB404	123x19
	B 230 FD	85	08/94 → 07/95	⚙️	→05/97	SVB121015	12x1015
				⚙️	A/C(-), → Ch. 117441	SVB13950	13x950
				⚙️	A/C(-), Ch. 117442→	SVB10925	10x925
				🔧		SVB12885	12x885
2.3 ti	B 230 FK	99	01/95 → 10/98	⚙️		TB404	123x19
				⚙️	→05/97	SVB13950	13x950
				⚙️	A/C(-), →05/97, → Ch. 117441	SVB10925	10x925
				⚙️	A/C(-), →05/97, Ch. 117442→	SVB12885	12x885
	B 230 FT	121	08/94 → 10/98	⚙️	→05/97	SVB121015	12x1015
				⚙️	→05/97	SVB13950	13x950
				⚙️	MAN, →12/95	SVB13975	13x975
				⚙️	A/C(-), →05/97, → Ch. 117441	SVB10925	10x925
2.4 TD Interc.	D 24 TIC	90	08/94 → 10/98	⚙️	A/C(-), →05/97, Ch. 117442→	SVB12885	12x885
				⚙️	→05/97	TB404	123x19
				⚙️	→05/97	SVB121015	12x1015
				⚙️	→05/97	SVB13900	13x900
	B 230 FB	96	08/94 → 10/98	⚙️	→05/97	SVB101150	10x1150
				⚙️	→05/97	TB440	120x25.4
				⚙️	→05/97	TB136	75x20
				⚙️	→05/97	SVB101010	10x1010

940 II Estate (945)

2.0 Turbo	B 200 FT	114	04/96 → 10/98	⚙️	AUTO, →05/97	SVB13950	13x950
				⚙️	MAN, →05/97	SVB13975	13x975
				🔧	→05/97	TB404	123x19
				⊕	→05/97	SVB121015	12x1015
2.3	B 230 FB	96	08/94 → 10/98	⚙️	→05/97	SVB13950	13x950
				⚙️	A/C(-), →05/97, → Ch. 117441	SVB10925	10x925
				⚙️	A/C(-), →05/97, Ch. 117442→	SVB12885	12x885
				🔧	→05/97	TB404	123x19
	B 230 FD	85	08/94 → 07/95	⚙️	→05/97	SVB121015	12x1015
				⚙️	A/C(-), → Ch. 117441	SVB13950	13x950
				⚙️	A/C(-), Ch. 117442→	SVB10925	10x925
				🔧		SVB12885	12x885
2.3 ti	B 230 FK	99	01/95 → 10/98	⚙️		TB404	123x19
				⚙️	→05/97	SVB13950	13x950
				⚙️	A/C(-), →05/97, → Ch. 117441	SVB10925	10x925
				⚙️	A/C(-), →05/97, Ch. 117442→	SVB12885	12x885
B 230 FT	121	08/94 → 10/98	⚙️	→05/97	SVB121015	12x1015	
			⚙️	→05/97	SVB13950	13x950	
			⚙️	MAN, →12/95	SVB13975	13x975	
			⚙️	A/C(-), →05/97, → Ch. 117441	SVB10925	10x925	



kW



VOLVO

...VOLVO

...940 II Estate (945)

2.3 Turbo	B 230 FT	121	08/94 → 10/98	☼	→05/97	SVB13950	13x950		
				☼	MAN, →12/95	SVB13975	13x975		
				⊖	A/C(-), →05/97, → Ch. 117441	SVB10925	10x925		
				⊖	A/C(-), →05/97, Ch. 117442→	SVB12885	12x885		
					→05/97	TB404	123x19		
				⊕	→05/97	SVB121015	12x1015		
				126	08/95 → 10/98	☼	→05/97	SVB13950	13x950
						⊖	A/C(-), →05/97, → Ch. 117441	SVB10925	10x925
						⊖	A/C(-), →05/97, Ch. 117442→	SVB12885	12x885
							→05/97	TB404	123x19
⊕	→05/97	SVB121015	12x1015						
☼	→05/97	SVB13900	13x900						
2.4 TD Interc.	D 24 TIC	90	08/94 → 10/98	⊖	→05/97	SVB101150	10x1150		
					→05/97	TB440	120x25.4		
					→05/97	TB136	75x20		
				⊕	→05/97	SVB101010	10x1010		
				☼	→05/97	SVB13900	13x900		

940 Kombi (945)

2.0	B 200 F	82	01/92 → 07/94	☼	→12/92	SVB13975	13x975				
				☼	01/93→	SVB13950	13x950				
				⊖	A/C(-), → Ch. 117441	SVB10925	10x925				
				⊖	A/C(-), Ch. 117442→	SVB12885	12x885				
					→12/92	TB118	123x19				
					01/93→	TB404	123x19				
				⊕		SVB121015	12x1015				
				2.0 Turbo	B 200 FT	114	01/91 → 07/95	☼	AUTO, 01/93→	SVB13950	13x950
								☼	MAN	SVB13975	13x975
									→12/92	TB118	123x19
	01/93→	TB404	123x19								
⊕		SVB121015	12x1015								
2.3	B 230 FB	96	08/90 → 12/94					☼	→12/92	SVB13975	13x975
								☼	01/93→	SVB13950	13x950
								⊖		SVB10913	10x913
								⊖	A/C(-), → Ch. 117441	SVB10925	10x925
									→12/92	TB118	123x19
					01/93→	TB404	123x19				
				⊕		SVB121015	12x1015				
				⊕	A/C(-)	SVB10950	10x950				
				⊕	A/C(+)	SVB10875	10x875				
				B 230 FD	85	08/92 → 07/94	☼	→12/92	SVB13975	13x975	
☼	01/93→09/93	SVB13950	13x950								
⊖	A/C(-), →09/93, → Ch. 117441	SVB10925	10x925								
⊖	A/C(-), →09/93, Ch. 117442→	SVB12885	12x885								
	→12/92	TB118	123x19								
	01/93→09/93	TB404	123x19								
⊕	→09/93	SVB121015	12x1015								
B 234 F	114	08/90 → 07/91	☼					SVB131200	13x1200		
			⊖					SVB101275	10x1275		
								TB297	110x14		
					TB430	167x23					
			⊕		SVB121040	12x1040					
2.3 Turbo	B 230 FT	121	08/90 → 07/94	☼	AUTO, 01/93→	SVB13950	13x950				
				☼	MAN	SVB13975	13x975				
				⊖	A/C(-), → Ch. 117441	SVB10925	10x925				
				⊖	A/C(-), Ch. 117442→	SVB12885	12x885				
					→12/92	TB118	123x19				
					01/93→	TB404	123x19				
				⊕		SVB121015	12x1015				
				B 230 FT+	140	08/91 → 07/93	☼	AUTO, 01/93→	SVB13950	13x950	
							☼	MAN	SVB13975	13x975	
								→12/92	TB118	123x19	
	01/93→	TB404	123x19								
⊕		SVB121015	12x1015								





kW



...VOLVO

...940 Kombi (945)

2.4 D	D 24	60	08/90 → 07/95	⊗	→12/92	SVB13925	13x925
				⊗	01/93→	SVB13900	13x900
				⊗		SVB101150	10x1150
				⊗	→12/92	TB131	119x25.4
				⊗	01/93→	TB440	120x25.4
				⊗KIT	→12/92	TBK044	
				⊗		TB136	75x20
2.4 TD Intercooler	D 24 TIC	90	08/90 → 08/94	⊗	→12/92	SVB13925	13x925
				⊗	01/93→	SVB13900	13x900
				⊗		SVB101150	10x1150
				⊗	→12/92	TB131	119x25.4
				⊗	01/93→	TB440	120x25.4
				⊗KIT	→12/92	TBK044	
				⊗		TB136	75x20
2.4 Turbo Diesel	D 24 T	80	08/90 → 07/94	⊗	→12/92	SVB13925	13x925
				⊗	01/93→	SVB13900	13x900
				⊗		SVB101150	10x1150
				⊗	→12/92	TB131	119x25.4
				⊗	01/93→	TB440	120x25.4
				⊗KIT	→12/92	TBK044	
				⊗		TB136	75x20
		SVB101010	10x1010				

960 (964)

2.0	B 204 FT	140	08/90 → 09/93	⊗	→12/92	SVB131200	13x1200
				⊗	01/93→	SVB131175	13x1175
				⊗		SVB101275	10x1275
				⊗		TB297	110x14
				⊗		TB430	167x23
				⊗		SVB121040	12x1040
				B 204 E	103	09/90 → 08/93	⊗
⊗	01/93→	SVB131175	13x1175				
⊗		SVB101275	10x1275				
⊗		TB297	110x14				
⊗		TB430	167x23				
⊗		SVB121040	12x1040				
2.4 TD Interc.	D 24 TIC	85	09/91 → 07/94				⊗
				⊗	01/93→08/93	SVB13900	13x900
				⊗	→08/93	SVB101150	10x1150
				⊗	→12/92	TB131	119x25.4
				⊗	01/93→08/93	TB440	120x25.4
				⊗KIT	→12/92	TBK044	
				⊗	→08/93	TB136	75x20
	→08/93	SVB101010	10x1010				
2.9	B 6304 F	150	08/90 → 07/94	⊗	A/C(-), AUTO, 09/93→	MVB1250R6	6PK1250
				⊗	A/C(-), MAN	MVB1270R6	6PK1270
				⊗	A/C(+)	MVB1625R6	6PK1625
				⊗	A/C(+), 09/93→	MVB1642R6	6PK1642
				⊗	A/C(+), 09/93→	MVB1755R6	6PK1755
				⊗		TB434	148x23
				⊗	→08/93, → Eng Nr 131034	TB372	143x21
	09/93→	TB488	152x28				

960 II (964)

2.5	B 6254 S	125	07/94 → 12/96	⊗	A/C(-), AUTO	MVB1250R6	6PK1250
				⊗	A/C(-), MAN	MVB1270R6	6PK1270
				⊗	A/C(+)	MVB1625R6	6PK1625
				⊗	A/C(+)	MVB1642R6	6PK1642
				⊗		TB434	148x23
				⊗		TB488	152x28



kw



VOLVO

...VOLVO

...960 II (964)

2.9	B 6304 S	150	07/94 → 12/96		A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1625R6	6PK1625
					A/C(+)	MVB1642R6	6PK1642
					A/C(+)	MVB1755R6	6PK1755
						TB434	148x23
						TB488	152x28

960 II Estate (965)

2.5	B 6254 S	125	08/94 → 12/96		A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1625R6	6PK1625
					A/C(+), 01/95→	MVB1642R6	6PK1642
						TB434	148x23
					01/95→	TB488	152x28
2.9	B 6304 S	150	08/95 → 12/96		A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1625R6	6PK1625
					A/C(+)	MVB1642R6	6PK1642
					A/C(+)	MVB1755R6	6PK1755
						TB434	148x23
						TB488	152x28

960 Kombi (965)

2.0	B 204 FT	140	08/90 → 09/93		→12/92	SVB131200	13x1200
					01/93→	SVB131175	13x1175
						SVB101275	10x1275
						TB297	110x14
						TB430	167x23
						SVB121040	12x1040
	B 204 E	103	09/90 → 08/93		→12/92	SVB131200	13x1200
					01/93→	SVB131175	13x1175
						SVB101275	10x1275
						TB297	110x14
						TB430	167x23
						SVB121040	12x1040
2.4 TD Interc.	D 24 TIC	85	09/91 → 07/94		→12/92	SVB13925	13x925
					01/93→08/93	SVB13900	13x900
					→08/93	SVB101150	10x1150
					→12/92	TB131	119x25.4
					01/93→08/93	TB440	120x25.4
					→12/92	TBK044	
					→08/93	TB136	75x20
					→08/93	SVB101010	10x1010
2.9	B 6304 F, B 6304 S	150	08/90 → 07/94		A/C(+), 09/93→	MVB1755R6	6PK1755
					Eng. B6304FS, A/C(-), AUTO, 09/93→	MVB1250R6	6PK1250
					Eng. B6304FS, A/C(-), MAN	MVB1270R6	6PK1270
					Eng. B6304FS, A/C(+)	MVB1625R6	6PK1625
					Eng. B6304FS, A/C(+), 09/93→	MVB1642R6	6PK1642
						TB434	148x23
					→08/93, → Eng Nr 131034	TB372	143x21
					09/93→	TB488	152x28

C30

1.6	B 4164 S3	74	10/06 →			TB472	117x22
1.6 D	D 4164 T	80	10/06 →		A/C(+)	MVB975R6	6PK975
1.8	B 4184 S11	92	10/06 →			MVB1306R6	6PK1306
1.8 FlexFuel	B 4184 S8	92	01/07 →			MVB1306R6	6PK1306
2.0	B 4204 S3	107	10/06 →			MVB1306R6	6PK1306
2.0 D	D 4204 T	100	10/06 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	



kW



...VOLVO

...C30

2.4 D5	D 5244 T9	120	10/06 →	 		MVB850R5 MVB887R5 TB748	5PK850 5PK887 132x28
2.4 i	B 5244 S4	125	10/06 →	 		MVB850R5 MVB887R5 TB643	5PK850 5PK887 142x23
D5	D 5244 T13, D 5244 T8	132	10/06 →	 		MVB850R5 MVB887R5 TB748	5PK850 5PK887 132x28
T5	B 5254 T3	162	10/06 →	 		MVB850R5 MVB887R5 TB643	5PK850 5PK887 142x23
		169	03/07 →	 		MVB850R5 MVB887R5 TB643	5PK850 5PK887 142x23

C70 Convertible

2.0	B 5204 T2	132	03/98 → 10/05	 A/C(-), AUTO, →09/99	MVB1250R6	6PK1250			
				 A/C(-), MAN, →09/99	MVB1270R6	6PK1270			
				 A/C(+), →09/99	MVB1740R6	6PK1740			
				 Hyd Tensioner, →09/99, → Eng Nr 1266127	TB434	148x23			
				 Mec Tensioner, →09/99, Eng Nr 1266128→	TB643	142x23			
2.0 D	D 4204 T	100	01/08 →	 	MVB1215R6 TB742	6PK1215 116x25			
					TBK338				
2.0 T	B 5204 T3	166	03/98 → 10/05	 A/C(-), →08/02	MVB1825R6D	6DPK1825			
				 A/C(-), AUTO, →08/02	MVB1250R6	6PK1250			
				 A/C(-), MAN, →08/02	MVB1270R6	6PK1270			
				 A/C(+), →08/02	MVB1740R6	6PK1740			
				 A/C(+), →08/02	MVB1838R6D	6DPK1838			
				 A/C(+), →08/02	MVB1850R6D	6DPK1850			
				 Hyd Tensioner, →08/02, → Eng Nr 1266127	TB434	148x23			
				 Mec Tensioner, →08/02, Eng Nr 1266128→	TB643	142x23			
				B 5204 T4	120	03/00 → 10/05	 A/C(-)	MVB1825R6D	6DPK1825
							 A/C(+)	MVB1838R6D	6DPK1838
 A/C(+)	MVB1850R6D	6DPK1850							
	TB643	142x23							
2.3 T5	B 5234 T9	180	07/02 → 10/05	 A/C(-)	MVB1838R6D	6DPK1838			
				 A/C(+)	MVB1850R6D	6DPK1850			
				 Mec Tensioner	TB643	142x23			
2.3 T-5	B 5234 T3	176	03/98 → 10/05	 A/C(-), →08/02	MVB1825R6D	6DPK1825			
				 A/C(-), AUTO, →08/02	MVB1250R6	6PK1250			
				 A/C(-), MAN, →08/02	MVB1270R6	6PK1270			
				 A/C(+), →08/02	MVB1740R6	6PK1740			
				 A/C(+), →08/02	MVB1838R6D	6DPK1838			
				 A/C(+), →08/02	MVB1850R6D	6DPK1850			
				 Hyd Tensioner, →08/02, → Eng Nr 1266127	TB434	148x23			
				 Mec Tensioner, →08/02, Eng Nr 1266128→	TB643	142x23			
2.4	B 5244 S5	103	03/06 →	 	MVB850R5 MVB887R5 TB643	5PK850 5PK887 142x23			
2.4 i	B 5244 S4	125	03/06 →	 	MVB850R5 MVB887R5 TB643	5PK850 5PK887 142x23			
2.4 T	B 5244 T7	147	07/02 → 10/05	 A/C(-)	MVB1838R6D	6DPK1838			
				 A/C(+)	MVB1850R6D	6DPK1850			
	TB643	142x23							



kw



VOLVO

...VOLVO

...C70 Convertible

2.5	B 5254 S	125	06/98 → 10/05	 	A/C(-), →09/01 A/C(-), AUTO, →09/01 A/C(-), MAN, →09/01 A/C(+), →09/01 A/C(+), →09/01 A/C(+), →09/01 Hyd Tensioner, →09/01, → Eng Nr 1266127 Mec Tensioner, →09/01, Eng Nr 1266128→	MVB1825R6D MVB1250R6 MVB1270R6 MVB1740R6 MVB1838R6D MVB1850R6D TB434 TB643	6DPK1825 6PK1250 6PK1270 6PK1740 6DPK1838 6DPK1850 148x23 142x23
2.5 T	B 5244 T, B 5254 T	142	03/98 → 10/05	 	A/C(-), 10/98→ A/C(+), 10/98→ A/C(+), 10/98→ 10/98→	MVB1825R6D MVB1838R6D MVB1850R6D TB643	6DPK1825 6DPK1838 6DPK1850 142x23
D5	D 5244 T8	132	03/06 →	 		MVB850R5 MVB887R5 TB748	5PK850 5PK887 132x28
T5	B 5254 T3	162	03/06 →	 		MVB850R5 MVB887R5 TB643	5PK850 5PK887 142x23
	B 5254 T7	169	03/07 →	 		MVB850R5 MVB887R5 TB643	5PK850 5PK887 142x23

C70 Coupe

2.0	B 5204 T2	132	03/97 → 09/02	 	A/C(-), AUTO, 09/97→09/99 A/C(-), MAN, 09/97→09/99 A/C(+), 09/97→09/99 Hyd Tensioner, 09/97→09/99, → Eng Nr 1266127 Mec Tensioner, 09/97→09/99, Eng Nr 1266128→	MVB1250R6 MVB1270R6 MVB1740R6 TB434 TB643	6PK1250 6PK1270 6PK1740 148x23 142x23
2.0 T	B 5204 T3	166	03/97 → 09/02	 	A/C(-) A/C(-), AUTO A/C(-), MAN A/C(+) A/C(+) A/C(+) Hyd Tensioner, → Eng Nr 1266127 Mec Tensioner, Eng Nr 1266128→	MVB1825R6D MVB1250R6 MVB1270R6 MVB1740R6 MVB1838R6D MVB1850R6D TB434 TB643	6DPK1825 6PK1250 6PK1270 6PK1740 6DPK1838 6DPK1850 148x23 142x23
	B 5204 T4	120	03/00 → 09/02	 	A/C(-) A/C(+) A/C(+) 	MVB1825R6D MVB1838R6D MVB1850R6D TB643	6DPK1825 6DPK1838 6DPK1850 142x23
2.3 T-5	B 5234 T3	176	03/97 → 09/02	 	A/C(-) A/C(-), AUTO A/C(-), MAN A/C(+) A/C(+) A/C(+) Hyd Tensioner, → Eng Nr 1266127 Mec Tensioner, Eng Nr 1266128→	MVB1825R6D MVB1250R6 MVB1270R6 MVB1740R6 MVB1838R6D MVB1850R6D TB434 TB643	6DPK1825 6PK1250 6PK1270 6PK1740 6DPK1838 6DPK1850 148x23 142x23



kW



VOLVO

...VOLVO

...C70 Coupe

2.5		121	03/99 → 09/02	 	A/C(-), →08/00 A/C(+), →08/00 A/C(+), →08/00 →08/00	MVB1825R6D MVB1838R6D MVB1850R6D TB643	6DPK1825 6DPK1838 6DPK1850 142x23
	B 5244 S, B 5254 S	125	11/99 → 09/02	 	A/C(-) A/C(+) A/C(+) →08/00	MVB1825R6D MVB1838R6D MVB1850R6D TB643	6DPK1825 6DPK1838 6DPK1850 142x23
2.5 T	B 5244 T, B 5254 T	142	03/97 → 09/02	 	A/C(-), 10/98→ A/C(+), 10/98→ A/C(+), 10/98→ 10/98→	MVB1825R6D MVB1838R6D MVB1850R6D TB643	6DPK1825 6DPK1838 6DPK1850 142x23

S40 I (VS)

1.6	B 4164 S	77	09/95 → 08/99	 	A/C(-), 03/96→, → Eng Nr 1440994 A/C(-), 03/96→, Eng Nr 1440995→ A/C(+), 03/96→, → Eng Nr 1440994 A/C(+), 03/96→, Eng Nr 1440995→ Hyd Tensioner, 03/96→, → Eng Nr 1266195 Mec Tensioner, 03/96→, Eng Nr 1266196→	MVB1613R6 MVB1625R6 MVB1755R6 MVB1760R6 TB434 TB643	6PK1613 6PK1625 6PK1755 6PK1760 148x23 142x23
	B 4164 S2	80	03/99 → 12/03	 	10/99→ Mec Tensioner, 10/99→	MVB1838R6D TB643	6DPK1838 142x23
1.8	B 4184 S, B 4184 S3	85	07/95 → 08/99	 	Eng. B4184S, A/C(-), 11/95→, → Eng Nr 1440994 Eng. B4184S, A/C(-), 11/95→, Eng Nr 1440995→ Eng. B4184S, A/C(+), 11/95→, → Eng Nr 1440994 Eng. B4184S, A/C(+), 11/95→, Eng Nr 1440995→ Hyd Tensioner, 11/95→, → Eng Nr 1266195 Mec Tensioner, 11/95→, Eng Nr 1266196→	MVB1613R6 MVB1625R6 MVB1755R6 MVB1760R6 TB434 TB643	6PK1613 6PK1625 6PK1755 6PK1760 148x23 142x23
	B 4184 S2, B 4184 S9	90	03/99 → 12/03	 		MVB1838R6D TB643	6DPK1838 142x23
		85	06/01 → 08/03	 		MVB1838R6D TB643	6DPK1838 142x23
1.8 i	B 4184 SM	92	03/98 → 12/03	 	10/98→08/02 10/98→08/02 A/C(-), 10/98→08/02 A/C(+), 10/98→08/02	MVB775R4 TB684 MVB1090R5 MVB1345R5	4PK775 154x29 5PK1090 5PK1345
	B 4184 SJ	90	06/01 → 12/03	 	→08/02 →08/02 A/C(-), →08/02 A/C(+), →08/02	MVB775R4 TB684 MVB1090R5 MVB1345R5	4PK775 154x29 5PK1090 5PK1345



kW



VOLVO

...VOLVO

...S40 I (VS)

1.9 DI	D 4192 T2	70	03/99 → 07/00	⊗	A/C(-), 10/99 →	MVB1137R6	6PK1137
				⊗	A/C(+), 10/99 →	MVB1642R6	6PK1642
					10/99 →	TB546	153x26
				KIT	10/99 →, check kit comp.	TBK099	
				KIT	10/99 →, check kit comp.	TBK114	
D 4192 T4	75	07/00 → 12/03	⊗	A/C(-)	MVB1120R5	5PK1120	
			⊗	A/C(+)	MVB1795R6	6PK1795	
			KIT		TB653	132x26	
D 4192 T3	85	07/00 → 12/03	⊗	A/C(-)	MVB1120R5	5PK1120	
			⊗	A/C(+)	MVB1795R6	6PK1795	
			KIT		TB653	132x26	
1.9 T4	B 4194 T, B 4194 T2	147	05/97 → 07/00	⊗	10/99 →	MVB1838R6D	6DPK1838
				⊗	Eng. B4194T, A/C(-), →09/99, → Eng Nr 1440994	MVB1613R6	6PK1613
				⊗	Eng. B4194T, A/C(-), →09/99, Eng Nr 1440995 →	MVB1625R6	6PK1625
				⊗	Eng. B4194T, A/C(+), →09/99, → Eng Nr 1440994	MVB1755R6	6PK1755
				⊗	Eng. B4194T, A/C(+), →09/99, Eng Nr 1440995 →	MVB1760R6	6PK1760
					Hyd Tensioner, →09/99, → Eng Nr 1219753	TB434	148x23
					Mec Tensioner	TB643	142x23
1.9 TD	D 4192 T	66	07/95 → 08/99	⊗	A/C(-), 01/96 →	MVB1137R6	6PK1137
				⊗	A/C(+), 01/96 →	MVB1642R6	6PK1642
					01/96 →, → Eng Nr 3534	TB258	153x25.4
					01/96 →, Eng Nr 3535 →	TB545	153x25.4
2.0	B 4204 S, B 4204 S2	100	07/95 → 12/03	⊗	10/99 →	MVB1838R6D	6DPK1838
					10/99 →	TB643	142x23
	B 4204 S	103	07/95 → 08/99	⊗	A/C(-), 11/95 →, → Eng Nr 1440994	MVB1613R6	6PK1613
				⊗	A/C(-), 11/95 →, Eng Nr 1440995 →	MVB1625R6	6PK1625
				⊗	A/C(+), 11/95 →, → Eng Nr 1440994	MVB1755R6	6PK1755
				⊗	A/C(+), 11/95 →, Eng Nr 1440995 →	MVB1760R6	6PK1760
					Hyd Tensioner, 11/95 →, → Eng Nr 1266195	TB434	148x23
					Mec Tensioner, 11/95 →, Eng Nr 1266196 →	TB643	142x23
2.0 T	B 4204 T	118	10/97 → 07/00	⊗	10/99 →	MVB1838R6D	6DPK1838
				⊗	A/C(-), →12/99, → Eng Nr 1440994	MVB1613R6	6PK1613
				⊗	A/C(-), →12/99, Eng Nr 1440995 →	MVB1625R6	6PK1625
				⊗	A/C(+), →12/99, → Eng Nr 1440994	MVB1755R6	6PK1755
				⊗	A/C(+), →12/99, Eng Nr 1440995 →	MVB1760R6	6PK1760
					Hyd Tensioner, →12/99, → Eng Nr 1266195	TB643	142x23
					Hyd Tensioner, →12/99, → Eng Nr 1266195	TB434	148x23
2.0 T4	B 4204 T5	147	07/00 → 12/03	⊗		MVB1838R6D	6DPK1838
						TB643	142x23
						TB643	142x23



kW



...VOLVO

S40 II (MS)

1.6	B 4164 S3	74	01/05 →			TB472	117x22
1.6 D		81	01/05 →		A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
						TBK302	
					→ Ch. 269263		
1.8	B 4184 S11	92	04/04 →			MVB1306R6	6PK1306
1.8 FlexFuel	B 4184 S8	92	01/06 →		04/07 →	MVB1306R6	6PK1306
2.0	B 4204 S3	107	10/06 →			MVB1306R6	6PK1306
2.0 D	D 4204 T	100	01/04 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.4	B 5244 S5	103	01/04 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23
	B 5244 S	125	01/04 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23
2.4 D5	D 5244 T8	132	03/06 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB748	132x28
T5	B 5254 T3	162	01/04 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23
	B 5254 T7	169	03/07 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23
T5 AWD	B 5254 T3	162	04/04 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23
	B 5254 T7	169	03/07 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23

S60

2.0 T	B 5204 T5	132	09/01 →			MVB1838R6D	6DPK1838
						TB643	142x23
2.4	B 5244 S2	103	11/00 →			MVB1838R6D	6DPK1838
						TB643	142x23
	B 5244 S	125	11/00 →			MVB1838R6D	6DPK1838
						TB643	142x23
2.4 Bifuel	B 5244 SG2	103	06/02 →		→08/06	MVB1838R6D	6DPK1838
					→08/06	TB643	142x23
2.4 D	D 5244 T2	96	12/01 →		→ Ch. 545224	MVB1838R6D	6DPK1838
					Ch. 545225 →	MVB1825R6D	6DPK1825
						TB748	132x28
		93	09/05 →		→ Ch. 545224	MVB1838R6D	6DPK1838
					Ch. 545225 →	MVB1825R6D	6DPK1825
						TB748	132x28
2.4 D5	D 5244 T	120	07/01 →		→ Ch. 545224	MVB1838R6D	6DPK1838
					Ch. 545225 →	MVB1825R6D	6DPK1825
						TB748	132x28
	D 5244 T4	136	09/05 →		→ Ch. 545224	MVB1838R6D	6DPK1838
					Ch. 545225 →	MVB1825R6D	6DPK1825
						TB748	132x28
2.4 T	B 5244 T3	147	11/00 →			MVB1838R6D	6DPK1838
						TB643	142x23
2.4 T AWD	B 5244 T3	147	11/01 →			MVB1838R6D	6DPK1838
						TB643	142x23
2.4 T5	B 5244 T5	191	04/04 →			MVB1838R6D	6DPK1838
						TB643	142x23



kw



VOLVO

...VOLVO

...S60

2.5 T	B 5254 T2	154	02/04 →	 		MVB1825R6D MVB1838R6D TB643	6DPK1825 6DPK1838 142x23
2.5 T AWD	B 5254 T2	154	04/04 →	 		MVB1825R6D MVB1838R6D TB643	6DPK1825 6DPK1838 142x23
R 2,5 T AWD	B 5254 T4	221	03/03 →	 		MVB1825R6D MVB1838R6D TB643	6DPK1825 6DPK1838 142x23
T5	B 5234 T3	184	11/00 →	 	→08/05 →08/05	MVB1838R6D TB643	6DPK1838 142x23

S70 (P80_)

2.0	B 5202 S	93	01/97 → 11/00		A/C(-)	MVB1825R6D	6DPK1825
					A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1838R6D	6DPK1838
					A/C(+)	MVB1850R6D	6DPK1850
					Hyd Tensioner, → Eng Nr 1266127	TB439	144x23
					Mec Tensioner, Eng Nr 1266128→	TB737	138x23
					A/C(-)	MVB1825R6D	6DPK1825
					A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1838R6D	6DPK1838
					A/C(+)	MVB1850R6D	6DPK1850
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23
	Mec Tensioner, Eng Nr 1266128→	TB643	142x23				
2.0 Turbo	B 5204 T3	166	01/97 → 11/00		A/C(-)	MVB1825R6D	6DPK1825
					A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1838R6D	6DPK1838
					A/C(+)	MVB1850R6D	6DPK1850
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23
					Mec Tensioner, Eng Nr 1266128→	TB643	142x23
					A/C(-)	MVB1825R6D	6DPK1825
					A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1838R6D	6DPK1838
					A/C(+)	MVB1850R6D	6DPK1850
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23
	Mec Tensioner, Eng Nr 1266128→	TB643	142x23				
2.3		195	04/99 → 09/00		A/C(-)	MVB1825R6D	6DPK1825
					A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1838R6D	6DPK1838
					A/C(+)	MVB1850R6D	6DPK1850
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23
					Mec Tensioner, Eng Nr 1266128→	TB643	142x23



kW



...VOLVO

...S70 (P80_)

2.3 T-5	B 5234 T3	176	01/97 → 11/00		A/C(-)	MVB1825R6D	6DPK1825
					A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1838R6D	6DPK1838
					A/C(+)	MVB1850R6D	6DPK1850
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23
					Mec Tensioner, Eng Nr 1266128→	TB643	142x23
2.3 T5 Sport AWD	B 5234 T3	177	11/96 → 09/98		A/C(-)	MVB1825R6D	6DPK1825
					A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1838R6D	6DPK1838
					A/C(+)	MVB1850R6D	6DPK1850
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23
					Mec Tensioner, Eng Nr 1266128→	TB643	142x23
2.3 Turbo	B 5234 FT+	184	01/97 → 11/00		A/C(-)	MVB1825R6D	6DPK1825
					A/C(-), AUTO	MVB1250R6	6PK1250
					A/C(-), MAN	MVB1270R6	6PK1270
					A/C(+)	MVB1740R6	6PK1740
					A/C(+)	MVB1838R6D	6DPK1838
					A/C(+)	MVB1850R6D	6DPK1850
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23
					Mec Tensioner, Eng Nr 1266128→	TB643	142x23
2.4	B 5254 S	125	01/97 → 11/00		A/C(-), 10/98→	MVB1825R6D	6DPK1825
					A/C(-), AUTO, →10/98	MVB1250R6	6PK1250
					A/C(-), MAN, →10/98	MVB1270R6	6PK1270
					A/C(+), →10/98	MVB1740R6	6PK1740
					A/C(+), 10/98→	MVB1838R6D	6DPK1838
					A/C(+), 10/98→	MVB1850R6D	6DPK1850
		Hyd Tensioner, →10/98, → Eng Nr 1266127	TB643	142x23			
		Hyd Tensioner, →10/98, → Eng Nr 1266127	TB434	148x23			
	B 5244 S2, B 5244 SG	103	08/99 → 11/00		A/C(-)	MVB1825R6D	6DPK1825
					A/C(+)	MVB1838R6D	6DPK1838
				A/C(+)	MVB1850R6D	6DPK1850	
		TB643	142x23				



kW



VOLVO

...VOLVO

...S70 (P80_)

2.4 AWD		103	04/99 → 09/00	①	A/C(-)	MVB1825R6D	6DPK1825				
				②	A/C(+)	MVB1838R6D	6DPK1838				
				③	A/C(+)	MVB1850R6D	6DPK1850				
				④		TB643	142x23				
				106	11/96 → 05/99	⑤	A/C(-)	MVB1825R6D	6DPK1825		
						⑥	A/C(-), AUTO	MVB1250R6	6PK1250		
						⑦	A/C(-), MAN	MVB1270R6	6PK1270		
						⑧	A/C(+)	MVB1740R6	6PK1740		
						⑨	A/C(+)	MVB1838R6D	6DPK1838		
						⑩	Hyd Tensioner, → Eng Nr 1266127	TB439	144x23		
						⑪	Mec Tensioner, Eng Nr 1266128→	TB737	138x23		
						⑫					
121	10/98 → 05/99	⑬	A/C(-)	MVB1825R6D	6DPK1825						
		⑭	A/C(-)	MVB1838R6D	6DPK1838						
		⑮	A/C(+)	MVB1850R6D	6DPK1850						
125	04/99 → 09/00	⑯		TB643	142x23						
		⑰	A/C(-)	MVB1825R6D	6DPK1825						
		⑱	A/C(+)	MVB1838R6D	6DPK1838						
2.4 Turbo	B 5244 T, B 5254 T	142	01/97 → 11/00	⑲	A/C(-)	MVB1825R6D	6DPK1825				
				⑳	A/C(+)	MVB1838R6D	6DPK1838				
				㉑	A/C(+), 10/98→	MVB1850R6D	6DPK1850				
				㉒	Eng. B5254T, A/C(-), AUTO, →04/99	MVB1250R6	6PK1250				
				㉓	Eng. B5254T, A/C(-), MAN, →04/99	MVB1270R6	6PK1270				
				㉔	Eng. B5254T, A/C(+), →04/99	MVB1740R6	6PK1740				
				㉕		TB643	142x23				
				㉖	Hyd Tensioner, →04/99, → Eng Nr 1266127	TB434	148x23				
				2.5	B 5252 S	106	01/97 → 11/00	㉗	A/C(-)	MVB1825R6D	6DPK1825
								㉘	A/C(-), AUTO, →05/99	MVB1250R6	6PK1250
								㉙	A/C(-), MAN, →05/99	MVB1270R6	6PK1270
								㉚	A/C(+)	MVB1838R6D	6DPK1838
㉛	A/C(+), →05/99	MVB1740R6	6PK1740								
㉜	A/C(+), 07/97→	MVB1850R6D	6DPK1850								
㉝	Eng Nr 1266128→	TB737	138x23								
㉞	Hyd Tensioner, → Eng Nr 1266127	TB439	144x23								
121	06/98 → 11/00	㉟	A/C(-), 10/98→					MVB1825R6D	6DPK1825		
		㊱	A/C(-), 10/98→					MVB1838R6D	6DPK1838		
		㊲	A/C(+), 10/98→					MVB1850R6D	6DPK1850		
2.5 Bifuel	GB 5252 S	106	10/98 → 11/00					㊳		TB643	142x23
				㊴	A/C(-)	MVB1825R6D	6DPK1825				
				㊵	A/C(+)	MVB1838R6D	6DPK1838				
				㊶	A/C(+)	MVB1850R6D	6DPK1850				
				㊷	Eng Nr 1266128→	TB737	138x23				
				㊸	Hyd Tensioner, → Eng Nr 1266127	TB439	144x23				
				103	07/99 → 11/00	㊹	A/C(-)	MVB1825R6D	6DPK1825		
						㊺	A/C(+)	MVB1838R6D	6DPK1838		
						㊻	A/C(+)	MVB1850R6D	6DPK1850		
				2.5 TDI	D 5252 T	103	01/97 → 11/00	㊼	Mec Tensioner	TB643	142x23
								㊽	A/C(-)	MVB1428R6	6PK1428
								㊾	A/C(+)	MVB1685R6	6PK1685
㊿		TB785	122x26.5								
Ⓚ		TB557	81x21								



kW



...VOLVO

...S70 (P80_)

2.5 TDi AWD		103	10/99 → 09/00		A/C(-)	MVB1428R6	6PK1428
					A/C(+)	MVB1685R6	6PK1685
						TB785	122x26.5
						TB557	81x21

S80 (TS, XY)

2.0	B 5204 T4	120	06/98 → 07/06		11/98→09/02, → Ch. 44276	MVB1825R6D	6DPK1825
					11/98→09/02, Ch. 44277→	MVB1838R6D	6DPK1838
					11/98→09/02	TB643	142x23
2.0 T	B 5204 T3	166	06/98 → 07/06		11/98→10/01, → Ch. 44276	MVB1825R6D	6DPK1825
					11/98→10/01, Ch. 44277→	MVB1838R6D	6DPK1838
					11/98→10/01	TB643	142x23
	B 5204 T5	132	12/99 → 07/06		→08/05, → Ch. 44276	MVB1825R6D	6DPK1825
					→08/05, Ch. 44277→	MVB1838R6D	6DPK1838
					→08/05	TB643	142x23
2.4	B 5244 S2	103	01/99 → 07/06		→ Ch. 44276	MVB1825R6D	6DPK1825
					Ch. 44277→	MVB1838R6D	6DPK1838
						TB643	142x23
	B 5244 S	125	01/99 → 07/06		→ Ch. 44276	MVB1825R6D	6DPK1825
					Ch. 44277→	MVB1838R6D	6DPK1838
						TB643	142x23
2.4 Bifuel	B 5244 SG2	103	09/01 → 07/06		→ Ch. 44276	MVB1825R6D	6DPK1825
					Ch. 44277→	MVB1838R6D	6DPK1838
						TB643	142x23
2.4 D	D 5244 T2	96	10/01 → 07/06			MVB1120R5	5PK1120
						MVB1825R6D	6DPK1825
						TB748	132x28
2.4 D5	D 5244 T	120	08/01 → 07/06			MVB1120R5	5PK1120
						MVB1825R6D	6DPK1825
						TB748	132x28
2.4 T	B 5244 T3	147	06/00 → 07/06		→09/03, → Ch. 44276	MVB1825R6D	6DPK1825
					→09/03, Ch. 44277→	MVB1838R6D	6DPK1838
					→09/03	TB643	142x23
2.4 T5 AWD	B 5244 T3	147	04/00 → 09/03		→ Ch. 44276	MVB1825R6D	6DPK1825
					Ch. 44277→	MVB1838R6D	6DPK1838
						TB643	142x23
2.5 T	B 5254 T2	154	03/03 → 07/06		→ Ch. 44276	MVB1825R6D	6DPK1825
					Ch. 44277→	MVB1838R6D	6DPK1838
						TB643	142x23
2.5 T AWD	B 5254 T2	154	07/03 → 07/06		→ Ch. 44276	MVB1825R6D	6DPK1825
					Ch. 44277→	MVB1838R6D	6DPK1838
						TB643	142x23
2.5 TDi	D 5252 T	103	01/99 → 07/06		A/C(-), →10/01	MVB1428R6	6PK1428
					A/C(+), →10/01, → Ch. 116809	MVB1685R6	6PK1685
					A/C(+), →10/01, Ch. 116810→	MVB1795R6	6PK1795
					→10/01	TB785	122x26.5
					→10/01	TB557	81x21
2.8 T6	B 6284 T	200	05/98 → 07/06		→10/03, → Ch. 44276	MVB1825R6D	6DPK1825
					→10/03, Ch. 44277→	MVB1838R6D	6DPK1838
					→10/03	TB488	152x28
					→10/03	TB705	146x28
2.9	B 6304 S3	150	05/98 → 07/06		→06/04, → Ch. 44276	MVB1825R6D	6DPK1825
					→06/04, Ch. 44277→	MVB1838R6D	6DPK1838
					→06/04	TB488	152x28
					→06/04	TB705	146x28
	B 6294 S	147	03/99 → 07/06		→06/04, → Ch. 44276	MVB1825R6D	6DPK1825
					→06/04, Ch. 44277→	MVB1838R6D	6DPK1838
					→06/04	TB488	152x28
					→06/04	TB705	146x28
3.0	B 6294 S2	144	06/01 → 07/06		→06/04, → Ch. 44276	MVB1825R6D	6DPK1825
					→06/04, Ch. 44277→	MVB1838R6D	6DPK1838
					→06/04	TB488	152x28
					→06/04	TB705	146x28



kw



VOLVO

...VOLVO

...S80 (TS, XY)

3.0 T6	B 6294 T	200	06/01 → 07/06		10/01 →, → Ch. 44276	MVB1825R6D	6DPK1825
					10/01 →, Ch. 44277 →	MVB1838R6D	6DPK1838
					10/01 →	TB705	146x28

S80 II

2.4 D	D 5244 T	120	03/06 →			MVB1120R5	5PK1120
						MVB1825R6D	6DPK1825
						TB748	132x28
2.4 D5	D 5244 T4	136	03/06 →			MVB1120R5	5PK1120
						MVB1825R6D	6DPK1825
						TB748	132x28
2.4 D5 AWD	D 5244 T4	136	01/07 →			MVB1120R5	5PK1120
						MVB1825R6D	6DPK1825
						TB748	132x28
2.5 T	B 5254 T6	147	03/06 →		08/06 →	TB643	142x23
3.0 T6 AWD	B 6304 T2	210	01/07 →		05/07 →	MVB1200R6	6PK1200
3.2	B 6324 S	175	03/06 →		08/06 →	MVB1200R6	6PK1200
3.2 AWD	B 6324 S	175	01/07 →			MVB1200R6	6PK1200

S90

2.5		125	11/96 → 10/98		A/C(-), AUTO	MVB1250R6	6PK1250		
					A/C(-), MAN	MVB1270R6	6PK1270		
					A/C(+)	MVB1642R6	6PK1642		
					A/C(+)	MVB1755R6	6PK1755		
						TB488	152x28		
				132	11/96 → 10/97		A/C(-), AUTO	MVB1250R6	6PK1250
							A/C(-), MAN	MVB1270R6	6PK1270
							A/C(+)	MVB1642R6	6PK1642
	A/C(+)	MVB1755R6	6PK1755						
		TB488	152x28						
2.9	B 6304 S2	132	01/97 → 05/98		A/C(-), AUTO	MVB1250R6	6PK1250		
					A/C(-), MAN	MVB1270R6	6PK1270		
					A/C(+)	MVB1642R6	6PK1642		
					A/C(+)	MVB1755R6	6PK1755		
			TB488	152x28					
	B 6304 G	150	01/97 → 05/98		A/C(-), AUTO	MVB1250R6	6PK1250		
					A/C(-), MAN	MVB1270R6	6PK1270		
					A/C(+)	MVB1642R6	6PK1642		
				A/C(+)	MVB1755R6	6PK1755			
		TB488	152x28						

V40 Estate (VW)

1.6	B 4164 S	77	12/95 → 08/99		A/C(-), → Eng Nr 1440994	MVB1613R6	6PK1613	
					A/C(-), Eng Nr 1440995 →	MVB1625R6	6PK1625	
					A/C(+), → Eng Nr 1440994	MVB1755R6	6PK1755	
					A/C(+), Eng Nr 1440995 →	MVB1760R6	6PK1760	
	B 4164 S2	80	03/99 → 06/04			Hyd Tensioner, → Eng Nr 1266195	TB434	148x23
						Mec Tensioner, Eng Nr 1266196 →	TB643	142x23
						10/99 →	MVB1838R6D	6DPK1838
						Mec Tensioner, 10/99 →	TB643	142x23



kW



...VOLVO

...V40 Estate (VW)

1.8	B 4184 S, B 4184 S3	85	07/95 → 08/99	⊗	Eng. B4184S, A/C(-), 03/96→, → Eng Nr 1440994	MVB1613R6	6PK1613
				⊗	Eng. B4184S, A/C(-), 03/96→, Eng Nr 1440995→	MVB1625R6	6PK1625
				⊗	Eng. B4184S, A/C(+), 03/96→, → Eng Nr 1440994	MVB1755R6	6PK1755
				⊗	Eng. B4184S, A/C(+), 03/96→, Eng Nr 1440995→	MVB1760R6	6PK1760
					Hyd Tensioner, 03/96→, → Eng Nr 1266195	TB434	148x23
					Mec Tensioner, 03/96→, Eng Nr 1266196→	TB643	142x23
	B 4184 S2, B 4184 S9	90	03/99 → 06/04	⊗		MVB1838R6D	6DPK1838
					Mec Tensioner	TB643	142x23
1.8 i	B 4184 SM	92	03/98 → 06/04	⊗	10/98→08/02	MVB775R4	4PK775
					10/98→08/02	TB684	154x29
				⊗	A/C(-), 10/98→08/02	MVB1090R5	5PK1090
				⊗	A/C(+), 10/98→08/02	MVB1345R5	5PK1345
	B 4184 SJ	90	06/01 → 06/04	⊗	→08/02	MVB775R4	4PK775
					→08/02	TB684	154x29
				⊗	A/C(-), →08/02	MVB1090R5	5PK1090
				⊗	A/C(+), →08/02	MVB1345R5	5PK1345
1.9 DI	D 4192 T2	70	03/99 → 07/00	⊗	A/C(-)	MVB1137R6	6PK1137
				⊗	A/C(+)	MVB1642R6	6PK1642
						TB546	153x26
					check kit comp.	TBK099	
					check kit comp.	TBK114	
	D 4192 T4	75	07/00 → 06/04	⊗	A/C(-)	MVB1120R5	5PK1120
				⊗	A/C(+)	MVB1795R6	6PK1795
						TB653	132x26
						TBK275	
	D 4192 T3	85	07/00 → 06/04	⊗	A/C(-)	MVB1120R5	5PK1120
				⊗	A/C(+)	MVB1795R6	6PK1795
						TB653	132x26
						TBK275	
1.9 T4	B 4194 T	147	05/97 → 07/00	⊗	10/99→	MVB1838R6D	6DPK1838
				⊗	A/C(-), →09/99, → Eng Nr 1440994	MVB1613R6	6PK1613
				⊗	A/C(-), →09/99, Eng Nr 1440995→	MVB1625R6	6PK1625
				⊗	A/C(+), →09/99, → Eng Nr 1440994	MVB1755R6	6PK1755
				⊗	A/C(+), →09/99, Eng Nr 1440995→	MVB1760R6	6PK1760
					Hyd Tensioner, →09/99, → Eng Nr 1219753	TB434	148x23
					Mec Tensioner	TB643	142x23
1.9 TD	D 4192 T	66	07/95 → 08/99	⊗	A/C(-), 03/96→	MVB1137R6	6PK1137
				⊗	A/C(+), 03/96→	MVB1642R6	6PK1642
					03/96→, → Eng Nr 3534	TB258	153x25.4
					03/96→, Eng Nr 3535→	TB545	153x25.4



kW



VOLVO

...VOLVO

...V40 Estate (VW)

2.0	B 4204 S	100	07/95 → 06/04		12/99 →	MVB1838R6D	6DPK1838
					Mec Tensioner, 12/99 →	TB643	142x23
		103	07/95 → 08/99		A/C(-), 03/96 →,	MVB1613R6	6PK1613
					→ Eng Nr 1440994		
					A/C(-), 03/96 →,	MVB1625R6	6PK1625
					Eng Nr 1440995 →		
					A/C(+), 03/96 →,	MVB1755R6	6PK1755
2.0 T	B 4204 T				→ Eng Nr 1440994		
					A/C(+), 03/96 →,	MVB1760R6	6PK1760
					Eng Nr 1440995 →		
					Hyd Tensioner, 03/96 →,	TB434	148x23
					→ Eng Nr 1266195		
					Mec Tensioner, 03/96 →,	TB643	142x23
					Eng Nr 1266196 →		
					10/99 →	MVB1838R6D	6DPK1838
					A/C(-), →09/99,	MVB1613R6	6PK1613
					→ Eng Nr 1440994		
2.0 T	B 4204 T				A/C(-), →09/99,	MVB1625R6	6PK1625
					Eng Nr 1440995 →		
					A/C(+), →09/99,	MVB1755R6	6PK1755
					→ Eng Nr 1440994		
					A/C(+), →09/99,	MVB1760R6	6PK1760
					Eng Nr 1440995 →		
					Hyd Tensioner, →09/99,	TB643	142x23
					→ Eng Nr 1219753	TB434	148x23
2.0 T4	B 4204 T2	121	07/00 → 06/01			MVB1838R6D	6DPK1838
						TB643	142x23
2.0 T4	B 4204 T3	120	06/01 → 06/04			MVB1838R6D	6DPK1838
						TB643	142x23
2.0 T4	B 4204 T5	147	07/00 → 06/04			MVB1838R6D	6DPK1838
						TB643	142x23

V50 (MW)

1.6	B 4164 S3	74	01/05 →			TB472	117x22
1.6 D		81	01/05 →		A/C(+)	MVB975R6	6PK975
						TB724	137x25.4
					→ Ch. 284265	TBK302	
1.8	B 4184 S11	92	04/04 →			MVB1306R6	6PK1306
1.8 FlexFuel	B 4184 S8	92	01/05 →		04/07 →	MVB1306R6	6PK1306
2.0	B 4204 S3	107	10/06 →			MVB1306R6	6PK1306
2.0 D	D 4204 T	100	04/04 →			MVB1215R6	6PK1215
						TB742	116x25
						TBK338	
2.4	B 5244 S5	103	04/04 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23
2.4	B 5244 S	125	04/04 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23
2.4 D5	D 5244 T8	132	03/06 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB748	132x28
T5	B 5254 T3	162	04/04 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23
T5	B 5254 T7	169	03/07 →			MVB850R5	5PK850
						MVB887R5	5PK887
						TB643	142x23



kW



...VOLVO

...V50 (MW)

T5 AWD	B 5254 T3	162	04/04 →	 		MVB850R5 MVB887R5 TB643	5PK850 5PK887 142x23
	B 5254 T7	169	03/07 →	 		MVB850R5 MVB887R5 TB643	5PK850 5PK887 142x23

V70 I Estate (P80_)

2.0	B 5202 S	93	01/97 → 03/00		A/C(-)	MVB1825R6D	6DPK1825		
					A/C(-), AUTO	MVB1250R6	6PK1250		
					A/C(-), MAN	MVB1270R6	6PK1270		
					A/C(+)	MVB1740R6	6PK1740		
					A/C(+)	MVB1838R6D	6DPK1838		
					A/C(+)	MVB1850R6D	6DPK1850		
					Hyd Tensioner, → Eng Nr 1266127	TB439	144x23		
					Mec Tensioner, Eng Nr 1266128→	TB737	138x23		
	B 5204 T2	132	01/97 → 03/00		A/C(-), AUTO, →11/98	MVB1250R6	6PK1250		
					A/C(-), MAN, →11/98	MVB1270R6	6PK1270		
					A/C(+), →11/98	MVB1740R6	6PK1740		
					Hyd Tensioner, →11/98, → Eng Nr 1266127	TB434	148x23		
				Mec Tensioner, →11/98, Eng Nr 1266128→	TB643	142x23			
B 5204 T4	120	01/97 → 03/00		A/C(-), 12/98→	MVB1825R6D	6DPK1825			
				A/C(+), 12/98→	MVB1838R6D	6DPK1838			
				A/C(+), 12/98→	MVB1850R6D	6DPK1850			
				Mec Tensioner, 12/98→	TB643	142x23			
2.0 Turbo	B 5204 T3	166	01/97 → 03/00		A/C(-)	MVB1825R6D	6DPK1825		
					A/C(-), AUTO	MVB1250R6	6PK1250		
					A/C(-), MAN	MVB1270R6	6PK1270		
					A/C(+)	MVB1740R6	6PK1740		
					A/C(+)	MVB1838R6D	6DPK1838		
					A/C(+)	MVB1850R6D	6DPK1850		
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23		
					Mec Tensioner, Eng Nr 1266128→	TB643	142x23		
	2.0 Turbo AWD	B 5204 T3	166	01/97 → 03/00		A/C(-)	MVB1825R6D	6DPK1825	
						A/C(-), AUTO	MVB1250R6	6PK1250	
						A/C(-), MAN	MVB1270R6	6PK1270	
						A/C(+)	MVB1740R6	6PK1740	
					A/C(+)	MVB1838R6D	6DPK1838		
					A/C(+)	MVB1850R6D	6DPK1850		
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23		
					Mec Tensioner, Eng Nr 1266128→	TB643	142x23		
2.3 T AWD		B 5234 FT+	184	04/97 → 03/00		A/C(-)	MVB1838R6D	6DPK1838	
						A/C(-), AUTO	MVB1825R6D	6DPK1825	
						A/C(-), MAN	MVB1250R6	6PK1250	
						A/C(+)	MVB1270R6	6PK1270	
					A/C(+)	MVB1740R6	6PK1740		
					A/C(+)	MVB1850R6D	6DPK1850		
					Hyd Tensioner, → Eng Nr 1266127	TB434	148x23		
					Mec Tensioner, Eng Nr 1266128→	TB643	142x23		



kW



VOLVO

...VOLVO

...V70 I Estate (P80_)

2.3 T-5	B 5234 T3	176	01/97 → 03/00	⊗		MVB1838R6D	6DPK1838
				⊗	A/C(-)	MVB1825R6D	6DPK1825
				⊗	A/C(-), AUTO	MVB1250R6	6PK1250
				⊗	A/C(-), MAN	MVB1270R6	6PK1270
				⊗	A/C(+)	MVB1740R6	6PK1740
				⊗	A/C(+)	MVB1850R6D	6DPK1850
2.3 T-5 AWD	B 5234 T3	176	01/97 → 03/00	⊗		MVB1838R6D	6DPK1838
				⊗	A/C(-)	MVB1825R6D	6DPK1825
				⊗	A/C(-), AUTO	MVB1250R6	6PK1250
				⊗	A/C(-), MAN	MVB1270R6	6PK1270
				⊗	A/C(+)	MVB1740R6	6PK1740
				⊗	A/C(+)	MVB1850R6D	6DPK1850
2.3 Turbo	B 5234 FT+	184	01/97 → 03/00	⊗		MVB1838R6D	6DPK1838
				⊗	A/C(-)	MVB1825R6D	6DPK1825
				⊗	A/C(-), AUTO	MVB1250R6	6PK1250
				⊗	A/C(-), MAN	MVB1270R6	6PK1270
				⊗	A/C(+)	MVB1740R6	6PK1740
				⊗	A/C(+)	MVB1850R6D	6DPK1850
2.4	B 5254 S	125	01/97 → 05/00	⊗	A/C(-), AUTO, →05/99	MVB1250R6	6PK1250
				⊗	A/C(-), MAN, →05/99	MVB1270R6	6PK1270
				⊗	A/C(+), →05/99	MVB1740R6	6PK1740
	B 5244 S2, B 5244 SG2	103	08/99 → 05/00	⊗	Hyd Tensioner, →05/99	TB434	148x23
				⊗	Mec Tensioner, →05/99	TB643	142x23
				⊗	Eng Nr 1266128→		
2.4 Bifuel	B 5244 SG	103	08/99 → 03/00	⊗	A/C(-)	MVB1825R6D	6DPK1825
				⊗	A/C(+)	MVB1838R6D	6DPK1838
				⊗	A/C(+)	MVB1850R6D	6DPK1850
2.4 Turbo	B 5244 T, B 5254 T	142	01/97 → 03/00	⊗		TB643	142x23
				⊗	A/C(-)	MVB1838R6D	6DPK1838
				⊗	A/C(+)	MVB1250R6	6PK1250
				⊗	A/C(+), 04/99→	MVB1740R6	6PK1740
				⊗	Eng. B5254T, A/C(-), AUTO, →04/99	MVB1850R6D	6DPK1850
				⊗	Eng. B5254T, A/C(+), MAN, →04/99	MVB1270R6	6PK1270
2.4 Turbo	B 5244 T, B 5254 T	142	01/97 → 03/00	⊗	Eng. B5254T, A/C(+), →04/99	MVB1740R6	6PK1740
				⊗	Hyd Tensioner, →04/99,	TB643	142x23
				⊗	→ Eng Nr 1266127	TB434	148x23



kW



...VOLVO

...V70 I Estate (P80_)

2.5	B 5252 S	106	01/97 → 03/00	⊗	A/C(-)	MVB1825R6D	6DPK1825
				⊗	A/C(+)	MVB1838R6D	6DPK1838
				⊗	A/C(+), →06/99	MVB1740R6	6PK1740
				⊗	A/C(+), 07/97→	MVB1850R6D	6DPK1850
				⊗	AUTO	MVB1250R6	6PK1250
				⊗	MAN	MVB1270R6	6PK1270
				⊗	Eng Nr 1266128→ Hyd Tensioner, → Eng Nr 1266127	TB737 TB439	138x23 144x23
121	06/98 → 03/00	106	01/97 → 03/00	⊗	04/99→	MVB1838R6D	6DPK1838
				⊗	A/C(-), 04/99→	MVB1825R6D	6DPK1825
				⊗	A/C(+), 04/99→	MVB1850R6D	6DPK1850
2.5 AWD		195	03/99 → 03/00	⊗	04/99→	TB643	142x23
				⊗	A/C(-)	MVB1825R6D	6DPK1825
				⊗	A/C(+)	MVB1838R6D	6DPK1838
2.5 Bifuel	GB 5252 S	106	10/98 → 08/99	⊗	A/C(+)	MVB1850R6D	6DPK1850
				⊗		TB643	142x23
				⊗	A/C(-)	MVB1825R6D	6DPK1825
2.5 TDi	D 5252 T	103	01/97 → 05/00	⊗	A/C(-), AUTO	MVB1250R6	6PK1250
				⊗	A/C(-), MAN	MVB1270R6	6PK1270
				⊗	A/C(+)	MVB1740R6	6PK1740
				⊗	A/C(+)	MVB1838R6D	6DPK1838
				⊗	Hyd Tensioner, → Eng Nr 1266127	TB439	144x23
				⊗	Mec Tensioner, Eng Nr 1266128→	TB737	138x23
				⊗			
2.5 TDi AWD		103	11/96 → 02/00	⊗	A/C(-)	MVB1428R6	6PK1428
				⊗	A/C(-)	MVB1550R6	6PK1550
				⊗	A/C(+)	MVB1685R6	6PK1685
				⊗	A/C(+)	MVB1795R6	6PK1795
				⊗		TB785 TB557	122x26.5 81x21
2.5 Turbo AWD	B 5244 T, B 5254 T	142	01/97 → 05/00	⊗	A/C(-)	MVB1428R6	6PK1428
				⊗	A/C(-)	MVB1550R6	6PK1550
				⊗	A/C(+)	MVB1685R6	6PK1685
				⊗	A/C(+)	MVB1795R6	6PK1795
				⊗		TB785 TB557	122x26.5 81x21
				⊗	A/C(-)	MVB1825R6D	6DPK1825
				⊗	A/C(+)	MVB1838R6D	6DPK1838
2.0 T	B 5204 T5	132	07/01 →	⊗	A/C(+), 04/99→	MVB1850R6D	6DPK1850
				⊗	Eng. B5254T, A/C(-), AUTO, →04/99	MVB1250R6	6PK1250
				⊗	Eng. B5254T, A/C(-), MAN, →04/99	MVB1270R6	6PK1270
				⊗	Eng. B5254T, A/C(+), →04/99	MVB1740R6	6PK1740
				⊗		TB643	142x23
				⊗	Hyd Tensioner, →04/99, → Eng Nr 1266127	TB434	148x23
				⊗			

V70 II Estate (P80_)

2.0 T	B 5204 T5	132	07/01 →	⊗	→08/05	MVB1838R6D	6DPK1838
				⊗	Mec Tensioner, →08/05	TB643	142x23
2.3		195	10/00 → 09/04	⊗		MVB1838R6D	6DPK1838
				⊗	A/C(-)	MVB1825R6D	6DPK1825
				⊗	A/C(-), AUTO	MVB1250R6	6PK1250
				⊗	A/C(-), MAN	MVB1270R6	6PK1270
				⊗	A/C(+)	MVB1740R6	6PK1740
				⊗	A/C(+)	MVB1850R6D	6DPK1850
				⊗	Hyd Tensioner, → Eng Nr 1266127	TB434	148x23
2.3		195	10/00 → 09/04	⊗	Mec Tensioner, Eng Nr 1266128→	TB643	142x23
				⊗			



kW



VOLVO

...VOLVO

...V70 II Estate (P80_)

2.3 T5	B 5234 T3, B 5234 T4	184	03/00 →	⊗	→09/04	MVB1838R6D	6DPK1838
				⊗	A/C(-), →09/04	MVB1825R6D	6DPK1825
				⊗	A/C(-), AUTO, →09/04	MVB1250R6	6PK1250
				⊗	A/C(-), MAN, →09/04	MVB1270R6	6PK1270
				⊗	A/C(+), →09/04	MVB1740R6	6PK1740
				⊗	A/C(+), →09/04	MVB1850R6D	6DPK1850
					Hyd Tensioner, →09/04, → Eng Nr 1266127	TB434	148x23
					Mec Tensioner, →09/04, Eng Nr 1266128→	TB643	142x23
2.4	B 5244 S2	103	03/00 →	⊗	A/C(-), →07/07	MVB1825R6D	6DPK1825
				⊗	A/C(+), →07/07	MVB1838R6D	6DPK1838
				⊗	A/C(+), →07/07	MVB1850R6D	6DPK1850
					→07/07	TB643	142x23
	B 5244 S	125	03/00 →	⊗	A/C(-), →07/07	MVB1825R6D	6DPK1825
				⊗	A/C(+), →07/07	MVB1838R6D	6DPK1838
				⊗	A/C(+), →07/07	MVB1850R6D	6DPK1850
					→07/07	TB643	142x23
2.4 Bifuel	B 5244 SG	103	09/01 →	⊗	→07/07	MVB1838R6D	6DPK1838
					→07/07	TB643	142x23
2.4 D	D 5244 T2	96	12/01 →	⊗	→08/05	MVB1838R6D	6DPK1838
					→08/05	TB748	132x28
		93	05/05 →	⊗		MVB1838R6D	6DPK1838
						TB748	132x28
2.4 D5	D 5244 T	120	08/01 →	⊗	→07/07	MVB1838R6D	6DPK1838
				⊗	08/07→	MVB1120R5	5PK1120
						TB748	132x28
	D 5244 T4	136	12/05 →	⊗	→07/07	MVB1838R6D	6DPK1838
				⊗	08/07→	MVB1120R5	5PK1120
						TB748	132x28
2.4 D5 AWD	D 5244 T2	120	03/03 →	⊗	→07/07	MVB1838R6D	6DPK1838
					→07/07	TB748	132x28
	D 5244 T4	136	12/05 →	⊗	→07/07	MVB1838R6D	6DPK1838
⊗				08/07→	MVB1120R5	5PK1120	
						TB748	132x28
2.4 T	B 5244 T3	147	03/00 →	⊗	→09/04	MVB1838R6D	6DPK1838
					Mec Tensioner, →09/04, Eng Nr 1266128→	TB643	142x23
2.4 T AWD	B 5244 T3	147	09/01 →	⊗	→09/04	MVB1838R6D	6DPK1838
					Mec Tensioner, →09/04, Eng Nr 1266128→	TB643	142x23
2.4 T5	B 5244 T5	191	04/04 →	⊗	→07/07	MVB1838R6D	6DPK1838
					→07/07	TB643	142x23
2.5 R Sport	B 5254 T4	221	12/02 →	⊗	→07/07, → Ch. 348999	MVB1838R6D	6DPK1838
				⊗	→07/07, Ch. 349000→	MVB1825R6D	6DPK1825
					→07/07	TB643	142x23
2.5 T	B 5254 T2	154	04/04 →	⊗	→07/07	MVB1838R6D	6DPK1838
					→07/07	TB643	142x23
2.5 T AWD	B 5254 T2	154	09/02 →	⊗	→07/07	MVB1838R6D	6DPK1838
					→07/07	TB643	142x23
2.5 TDI	D 5252 T	103	03/00 →	⊗	A/C(-), →03/02	MVB1428R6	6PK1428
				⊗	A/C(-), →03/02	MVB1550R6	6PK1550
				⊗	A/C(+), →03/02	MVB1685R6	6PK1685
				⊗	A/C(+), →03/02	MVB1795R6	6PK1795
					→03/02	TB785	122x26.5
					→03/02	TB557	81x21
R 2,5 T AWD	B 5254 T4	221	03/03 →	⊗	→07/07, → Ch. 348999	MVB1838R6D	6DPK1838
				⊗	→07/07, Ch. 349000→	MVB1825R6D	6DPK1825
					→07/07	TB643	142x23



kW



...VOLVO

V70 III Estate

2.0	B 4204 S3	107	10/07 →		02/08 →	MVB2215R6	6PK2215
2.0 D	D 4204 T	100	10/07 →		02/08 →	TB742	116x25
					02/08 →	TBK338	
2.4 D		120	03/06 →		08/07 →	MVB1120R5	5PK1120
					08/07 →	TB748	132x28
2.4 D5	D 5244 T4	136	08/07 →			MVB1120R5	5PK1120
						TB748	132x28
2.4 D5 AWD		136	10/07 →			MVB1120R5	5PK1120
						TB748	132x28
2.5 T	B 5254 T6	147	08/07 →			TB643	142x23
2.5 T FlexFuel		147	05/08 →			TB643	142x23
3.0 T6 AWD	B 6304 T2	210	08/07 →			MVB1200R6	6PK1200
3.2		175	08/07 →			MVB1200R6	6PK1200
3.2 AWD		175	08/07 →			MVB1200R6	6PK1200

V90 Estate

2.5		125	11/96 → 10/98		A/C(-), AUTO	MVB1250R6	6PK1250		
					A/C(-), MAN	MVB1270R6	6PK1270		
					A/C(+)	MVB1642R6	6PK1642		
					A/C(+)	MVB1755R6	6PK1755		
						TB488	152x28		
				132	11/96 → 10/97		A/C(-), AUTO	MVB1250R6	6PK1250
							A/C(-), MAN	MVB1270R6	6PK1270
							A/C(+)	MVB1642R6	6PK1642
	A/C(+)	MVB1755R6	6PK1755						
		TB488	152x28						
2.9	B 6304 S2	132	01/97 → 12/98		A/C(-), AUTO	MVB1250R6	6PK1250		
					A/C(-), MAN	MVB1270R6	6PK1270		
					A/C(+)	MVB1642R6	6PK1642		
					A/C(+)	MVB1755R6	6PK1755		
						TB488	152x28		
	B 6304 G	150	01/97 → 12/98		A/C(-), AUTO	MVB1250R6	6PK1250		
					A/C(-), MAN	MVB1270R6	6PK1270		
					A/C(+)	MVB1642R6	6PK1642		
					A/C(+)	MVB1755R6	6PK1755		
						TB488	152x28		

XC 90

2.5 T	B 5254 T2	154	10/02 →			MVB1825R6D	6DPK1825
						TB643	142x23
3.2	B 6324 S	175	05/06 →			MVB1200R6	6PK1200
D5	D 5244 T	120	10/02 →		→08/06, → Ch. 288075	MVB1838R6D	6DPK1838
					→08/06, Ch. 288076 →	MVB1825R6D	6DPK1825
	D 5244 T4	136	05/06 →		→08/06	TB748	132x28
					→ Ch. 288075	MVB1838R6D	6DPK1838
					Ch. 288076 →	MVB1825R6D	6DPK1825
						TB748	132x28
T6	B 6294 T	200	10/02 →		→08/05	MVB1825R6D	6DPK1825
					→08/05	TB705	146x28

XC70 CROSS COUNTRY

2.4 D5 AWD	D 5244 T4	136	12/05 →		→07/07	MVB1838R6D	6DPK1838
					08/07 →	MVB1120R5	5PK1120
						TB748	132x28
2.4 D5 XC AWD	D 5244 T	120	09/02 →		→08/05	MVB1838R6D	6DPK1838
					08/07 →	MVB1120R5	5PK1120
						TB748	132x28
2.4 T XC AWD	B 5244 T3	147	03/00 → 09/02		A/C(-)	MVB1838R6D	6DPK1838
					A/C(+), 10/00 →	MVB1850R6D	6DPK1850
					Mec Tensioner	TB643	142x23
2.5 T XC AWD	B 5254 T2	154	09/02 →		→07/07	MVB1838R6D	6DPK1838
					→07/07	TB643	142x23
3.2	B 6324 S	175	02/07 →		08/07 →	MVB1200R6	6PK1200



kw



VOLVO

...VOLVO

XC70 II

2.4 D AWD	D 5244 T5	120	08/07 →			MVB1120R5	5PK1120
						TB748	132x28

VW

BORA (1J2)

1.4 16V	AHW, AKQ, APE, AXP, BCA	55	03/00 → 05/05		Eng. BCA, A/C(-)	MVB1080R6	6PK1080
					Eng. BCA, A/C(+)	MVB1550R6	6PK1550
						TB634	58x17
						TB658	130x20
					Eng. AKQ, → Eng Nr 242000	TBK263	
					Eng. BCA	TBK246	
1.6	AEH, AKL, APF	74	10/98 → 05/05		A/C(-), →06/02	MVB1125R6	6PK1125
					A/C(+), →06/02	MVB1200R6D	6DPK1200
					→06/02	TB552	138x23
					→06/02	TBK100	
	AVU, BFQ, BJH	75	08/00 → 05/05		Eng. BFQ, A/C(-)	MVB1125R6	6PK1125
					Eng. BFQ, A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
1.6 16V	ATN, AUS, AZD, BCB	77	05/00 → 05/05		Eng. BCB, A/C(-), →04/02	MVB1080R6	6PK1080
					Eng. BCB, A/C(+), →04/02	MVB1550R6	6PK1550
					→04/02	TB634	58x17
					→04/02	TB658	130x20
					→04/02	TBK246	
1.6 FSI	BAD	81	01/02 → 05/05		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1538R6	6PK1538
						TB634	58x17
						TB658	130x20
						TBK246	
1.8	AGN, BAF	92	10/98 → 05/05		A/C(+), 02/99→10/00	MVB1200R6D	6DPK1200
					02/99→10/00	TB554	150x23
					Eng. AGN, 02/99→10/00,	TBK101	
					→ Ch. 1J-Y-850000		
					Eng. AGN, 02/99→10/00,	TBK115	
					Ch. 1J-Y-850001→		
1.8 4motion	AGN	92	02/99 → 05/05		A/C(+), →10/00	MVB1200R6D	6DPK1200
					→10/00	TB554	150x23
					→10/00, → Ch. 1J-Y-850000	TBK101	
					→10/00, Ch. 1J-Y-850001→	TBK115	
1.8 T	AGU, ARX, AUM, BAE	110	05/00 → 05/05		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
					→ Ch. 1J-Y-850000	TBK101	
					Ch. 1J-Y-850001→	TBK115	
	AUQ	132	03/02 → 05/05		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
					→ Ch. 1J-Y-850000	TBK101	
					Ch. 1J-Y-850001→	TBK115	
1.9 SDI	AGP, AQM	50	10/98 → 05/05		Eng. AGP, A/C(-)	MVB906R6	6PK906
					Eng. AGP, A/C(+)	MVB1660R6	6PK1660
					Eng. AGP, → Eng Nr 400000	TB533	141x25
					Eng. AGP, Eng Nr 400001→	TB659	141x26
					→ Eng Nr 400000	TBK116	
					Eng. AGP, Eng Nr 400001→	TBK272	
					Eng. AQM,	TBK107	
					Eng Nr 030001→045000		



kW



...VW

...BORA (1J2)

1.9 TDI	AGR, ALH	66	10/98 → 06/01		Eng. ALH, A/C(-) Eng. ALH, A/C(+) Eng. ALH, → Eng Nr 500000 Eng. ALH, Eng Nr 500001→ Eng. ALH, Eng Nr 500001→ Eng. ALH, MAN, → Eng Nr 500000	MVB906R6 MVB1660R6 TB533 TB659 TBK272 TBK107	6PK906 6PK1660 141x25 141x26
	AHF, ASV	81	10/98 → 06/01		Eng. ASV, A/C(-) Eng. ASV, A/C(+) Eng. ASV, → Eng Nr 150000 Eng. ASV, Eng Nr 150001→ Eng. ASV, → Eng Nr 150000 Eng. ASV, Eng Nr 150001→	MVB906R6 MVB1660R6 TB533 TB659 TBK107 TBK272	6PK906 6PK1660 141x25 141x26
	AJM, AUJ	85	12/98 → 06/01		A/C(-) A/C(-) A/C(+) → Ch. 1J-2-592782/2D352773 → Ch. 1J-2-592782/2D352773, VD(+) 05/00→, Ch. 1J-2-592783/2D352774→	MVB1125R6 MVB1432R5 MVB1200R6D TB680 TBK225 TBK269 TBK270	6PK1125 5PK1432 6DPK1200 120x30
	ATD, AXR	74	09/00 → 05/05		A/C(-) A/C(-) Eng. AXR, A/C(+) Eng Nr 010001→ Eng. AXR, → Eng Nr 010000 Eng. AXR, → Eng Nr 010000, VD(+)	MVB1125R6 MVB1432R5 MVB1200R6D TB680 TBK270 TBK225 TBK269	6PK1125 5PK1432 6DPK1200 120x30
	ARL	110	05/00 → 05/05		A/C(-), 10/00→ A/C(+), 10/00→ 10/00→ 10/00→, → Ch. 1J-2-592782/2D352773 10/00→, → Ch. 1J-2-592782/2D352773, VD(+) 10/00→, Ch. 1J-2-592783/2D352774→	MVB1125R6 MVB1200R6D TB680 TBK225 TBK269 TBK270	6PK1125 6DPK1200 120x30
	ASZ	96	11/00 → 05/05		A/C(-) A/C(+) → Ch. 1J-2-592782/2D352773 → Ch. 1J-2-592782/2D352773, VD(+) Ch. 1J-2-592783/2D352774→	MVB1125R6 MVB1200R6D TB680 TBK225 TBK269 TBK270	6PK1125 6DPK1200 120x30

VW



kw



...VW

...BORA (1J2)

VW	1.9 TDI 4motion	AGR	66	02/99 → 06/01		A/C(-)	MVB906R6	6PK906
						A/C(+)	MVB1660R6	6PK1660
						→ Eng Nr 565000	TB533	141x25
						Eng Nr 565001 →	TB659	141x26
						→ Eng Nr 565000	TBK107	
						Eng Nr 565001 →	TBK272	
		AJM, AUY	85	02/99 → 06/01		A/C(-)	MVB1125R6	6PK1125
						A/C(-)	MVB1432R5	5PK1432
						A/C(+)	MVB1200R6D	6DPK1200
							TB680	120x30
						→ Ch. 1J-2-592782/2D352773	TBK225	
						→ Ch. 1J-2-592782/2D352773,	TBK269	
						VD(+)		
						05/00 →,	TBK270	
						Ch. 1J-2-592783/2D352774 →		
	ATD	74	09/00 → 05/05		A/C(-)	MVB1125R6	6PK1125	
					A/C(-)	MVB1432R5	5PK1432	
					A/C(+)	MVB1200R6D	6DPK1200	
						TB680	120x30	
					→ Ch. 1J-2-592782/2D352773	TBK225		
					→ Ch. 1J-2-592782/2D352773,	TBK269		
					VD(+)			
					Ch. 1J-2-592783/2D352774 →	TBK270		
	ARL	110	05/00 → 05/05		A/C(-), 10/00 →	MVB1125R6	6PK1125	
					A/C(+), 10/00 →	MVB1200R6D	6DPK1200	
					10/00 →	TB680	120x30	
					10/00 →,	TBK225		
					→ Ch. 1J-2-592782/2D352773			
					10/00 →,	TBK269		
					→ Ch. 1J-2-592782/2D352773,			
					VD(+)			
					10/00 →,	TBK270		
					Ch. 1J-2-592783/2D352774 →			
	ASZ	96	11/00 → 05/05		A/C(-)	MVB1125R6	6PK1125	
					A/C(+)	MVB1200R6D	6DPK1200	
						TB680	120x30	
					→ Ch. 1J-2-592782/2D352773	TBK225		
					→ Ch. 1J-2-592782/2D352773,	TBK269		
					VD(+)			
					Ch. 1J-2-592783/2D352774 →	TBK270		
2.0	APK, AQY, AZG, AZH, AZJ	85	10/98 → 05/05		A/C(-)	MVB1125R6	6PK1125	
					A/C(+)	MVB1200R6D	6DPK1200	
						TB552	138x23	
						TBK100		
2.0 4motion	AZH, AZJ	85	04/00 → 05/05		A/C(-)	MVB1125R6	6PK1125	
					A/C(+)	MVB1200R6D	6DPK1200	
						TB552	138x23	
						TBK100		
2.3 V5	AQN	125	10/00 → 05/05		A/C(-)	MVB1260R6	6PK1260	
2.3 V5 4motion	AQN	125	10/00 → 05/05		A/C(-)	MVB1260R6	6PK1260	
2.8 V6 4motion	AQP, AUE, BDE	150	03/99 → 05/05		A/C(-), →05/03	MVB1260R6	6PK1260	
BORA Estate (1J6)								
1.4 16V	AHW, AXP, BCA	55	09/01 → 05/05		A/C(-)	MVB1080R6	6PK1080	
					A/C(+)	MVB1550R6	6PK1550	
						TB634	58x17	
						TB658	130x20	
						TBK246		
					Eng. AHW, → Eng Nr 160000	TBK263		



kW



...VW

...BORA Estate (1J6)

1.6	AEH, AKL, APF	74	05/99 → 05/05	⊗	A/C(-), →06/02	MVB1125R6	6PK1125
				⊗	A/C(+), →06/02	MVB1200R6D	6DPK1200
					→06/02	TB552	138x23
				KIT	→06/02	TBK100	
1.6	AVU, BFQ	75	08/00 → 05/05	⊗	Eng. BFQ, A/C(-)	MVB1125R6	6PK1125
				⊗	Eng. BFQ, A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
				KIT		TBK100	
1.6 16V	ATN, AUS, AZD, BCB	77	02/00 → 05/05	⊗	Eng. BCB, A/C(-), →04/02	MVB1080R6	6PK1080
				⊗	Eng. BCB, A/C(+), →04/02	MVB1550R6	6PK1550
					→04/02	TB634	58x17
				KIT	→04/02	TB658	130x20
1.6 FSI	BAD	81	01/02 → 05/05	⊗	A/C(-)	MVB1080R6	6PK1080
				⊗	A/C(+)	MVB1538R6	6PK1538
						TB634	58x17
				KIT		TB658	130x20
1.8 4motion	AGN	92	05/99 → 05/05	⊗	A/C(+), →09/00	MVB1200R6D	6DPK1200
					→09/00	TB554	150x23
				KIT	→09/00, → Ch. 1J-Y-850000	TBK101	
				KIT	→09/00, Ch. 1J-Y-850001→	TBK115	
1.8 T	AGU, ARX, AUM	110	05/00 → 05/05	⊗	A/C(-), 09/00→	MVB1125R6	6PK1125
				⊗	A/C(+), 09/00→	MVB1200R6D	6DPK1200
					09/00→	TB554	150x23
				KIT	09/00→, → Ch. 1J-Y-850000	TBK101	
1.8 T	AUQ	132	05/02 → 05/05	⊗	A/C(-)	MVB1125R6	6PK1125
				⊗	A/C(+)	MVB1200R6D	6DPK1200
					→ Ch. 1J-Y-850000	TB554	150x23
				KIT	Ch. 1J-Y-850001→	TBK101	
1.9 SDi		50	06/01 → 05/05	⊗	A/C(-)	MVB906R6	6PK906
				⊗	A/C(+)	MVB1660R6	6PK1660
					→ Eng Nr 045000	TB533	141x25
					Eng Nr 045001→	TB659	141x26
1.9 SDi		50	06/01 → 05/05		→ Eng Nr 030000	TBK116	
				KIT	Eng Nr 030001→045000	TBK107	
					Eng Nr M045001→	TBK272	
				KIT			
1.9 TDI	AJM, AUY	85	05/99 → 06/01	⊗	A/C(-)	MVB1125R6	6PK1125
				⊗	A/C(-)	MVB1432R5	5PK1432
				⊗	A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
1.9 TDI	AJM, AUY	85	05/99 → 06/01		→ Ch. 1J-2-592782/2D352773	TBK225	
				KIT	→ Ch. 1J-2-592782/2D352773,	TBK269	
					VD(+)		
				KIT	05/00→,	TBK270	
1.9 TDI	AHF, ASV	81	05/99 → 06/01	⊗	Eng. ASV, A/C(-)	MVB906R6	6PK906
				⊗	Eng. ASV, A/C(+)	MVB1660R6	6PK1660
					Eng. ASV, → Eng Nr 150000	TB533	141x25
					Eng. ASV, Eng Nr 150001→	TB659	141x26
1.9 TDI	AHF, ASV	81	05/99 → 06/01		Eng. ASV, → Eng Nr 150000	TBK107	
				KIT	Eng. ASV, Eng Nr 150001→	TBK272	
				KIT			
1.9 TDI	ATD, AXR	74	09/00 → 05/05	⊗	A/C(-)	MVB1125R6	6PK1125
				⊗	Eng. AXR, A/C(-)	MVB1432R5	5PK1432
				⊗	Eng. AXR, A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
1.9 TDI	ATD, AXR	74	09/00 → 05/05		Eng Nr 010001→	TBK270	
				KIT	Eng. AXR, → Eng Nr 010000	TBK225	
					Eng. AXR, → Eng Nr 010000,	TBK269	
				KIT	VD(+)		



kW



...VW

...BORA Estate (1J6)

...1.9 TDI	ASZ	96	11/00 → 05/05		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
					→ Ch. 1J-2-592782/2D352773	TBK225	
					→ Ch. 1J-2-592782/2D352773,	TBK269	
					VD(+)		
					Ch. 1J-2-592783/2D352774 →	TBK270	
	ARL	110	05/01 → 05/05		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
					→ Ch. 1J-2-592782/2D352773	TBK225	
					→ Ch. 1J-2-592782/2D352773,	TBK269	
					VD(+)		
					Ch. 1J-2-592783/2D352774 →	TBK270	
1.9 TDI 4motion	AJM, AUJ	85	05/99 → 06/01		A/C(-)	MVB1125R6	6PK1125
					A/C(-)	MVB1432R5	5PK1432
					A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
					→ Ch. 1J-2-592782/2D352773	TBK225	
					→ Ch. 1J-2-592782/2D352773,	TBK269	
					VD(+)		
					05/00 →,	TBK270	
					Ch. 1J-2-592783/2D352774 →		
	ATD	74	09/00 → 05/05		A/C(-)	MVB1125R6	6PK1125
					A/C(-)	MVB1432R5	5PK1432
					A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
					→ Ch. 1J-2-592782/2D352773	TBK225	
					→ Ch. 1J-2-592782/2D352773,	TBK269	
					VD(+)		
					Ch. 1J-2-592783/2D352774 →	TBK270	
	ASZ	96	11/00 → 05/05		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
					→ Ch. 1J-2-592782/2D352773	TBK225	
					→ Ch. 1J-2-592782/2D352773,	TBK269	
					VD(+)		
					Ch. 1J-2-592783/2D352774 →	TBK270	
	ARL	110	05/01 → 05/05		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
					→ Ch. 1J-2-592782/2D352773	TBK225	
					→ Ch. 1J-2-592782/2D352773,	TBK269	
					VD(+)		
					Ch. 1J-2-592783/2D352774 →	TBK270	
2.0	APK, AQY, AZG, AZH, AZJ	85	05/99 → 05/05		Eng. AZH, A/C(-)	MVB1125R6	6PK1125
					Eng. AZH, A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
2.0 4motion	AZH, AZJ	85	04/00 → 05/05		Eng. AZH, A/C(-)	MVB1125R6	6PK1125
					Eng. AZH, A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
2.3 V5	AQN	125	10/00 → 05/05		A/C(-)	MVB1260R6	6PK1260
2.3 V5 4motion	AQN	125	10/00 → 05/05		A/C(-)	MVB1260R6	6PK1260
2.8 V6 4motion	AQP, AUE, BDE	150	05/99 → 05/05		A/C(-), →05/03	MVB1260R6	6PK1260
2.8 VR6		150	03/00 → 05/00		A/C(-)	MVB1260R6	6PK1260



kW



...VW

CADDY I (14)

1.5	JB	51	08/82 → 07/83		→ Ch. 14-E-020000	SVB10940	10x940
					Ch. 14-F-000001→	SVB10950	10x950
						TB108	121x18
						TBK016	
						SVB10735	10x735
1.6	EW	55	01/83 → 07/92		→ Ch. 14-E-020000	SVB10940	10x940
					Ch. 14-F-000001→	SVB10950	10x950
						TB108	121x18
						TBK016	
						SVB10735	10x735
	EM	55	10/82 → 10/83		→ Ch. 14-E-020000	SVB10940	10x940
					Ch. 14-F-000001→	SVB10950	10x950
						TB108	121x18
						TBK016	
						SVB10735	10x735
1.6 D	JK, ME	40	08/82 → 07/92			SVB10875	10x875
						TB225	135x25.4
						TBK018	
1.8	JH	70	08/85 → 07/92		→ Ch. 14-E-020000	SVB10940	10x940
					Ch. 14-F-000001→	SVB10950	10x950
						TB108	121x18
						TBK016	
						SVB10735	10x735

CADDY II Box (9K9A)

1.4	AUA	55	08/00 → 01/04		A/C(-)	MVB1065R6	6PK1065
					A/C(+)	MVB1180R6	6PK1180
						TB634	58x17
						TB658	130x20
						TBK246	
1.7 SDI	AHB	42	07/96 → 09/00		A/C(-)	MVB1045R6	6PK1045
					A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
						TBK305	
					A/C(-)	SVB12735	12x735
					A/C(+)	SVB11790	11x790
1.9 D	1Y	47	11/95 → 01/04		A/C(-)	MVB925R6	6PK925
					A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
						TBK025	
					A/C(-)	SVB12735	12x735
					A/C(+)	SVB11790	11x790
1.9 SDI	AEY, AYQ	47	11/95 → 01/04		A/C(+), →08/00	MVB1150R6	6PK1150
					Eng. AEY, A/C(-), →08/00	MVB1045R6	6PK1045
					Eng. AYQ, A/C(-), 09/00→	MVB906R6	6PK906
					Eng. AYQ, A/C(+), 09/00→	MVB1660R6	6PK1660
					→08/00	TB384	137x25.4
					Eng. AYQ, 09/00→,	TB533	141x25
					→ Eng Nr 005517		
					Eng. AYQ, 09/00→,	TB659	141x26
					Eng Nr 005518→		
					→08/00	TBK305	
					Eng. AYQ, 09/00→,	TBK107	
					→ Eng Nr 005517		
					Eng. AYQ, 09/00→,	TBK272	
					Eng Nr 005518→		
					Eng. AEY, A/C(-), →08/00	SVB12735	12x735
					Eng. AEY, A/C(+), →08/00	SVB11790	11x790



kW



...VW

...CADDY II Box (9K9A)

1.9 TDI	1Z, AHU, ALH	66	09/96 → 01/04	⊗	A/C(+), →05/97	MVB1150R6	6PK1150				
				⊗	Eng. 1Z, A/C(-), →05/97	MVB1045R6	6PK1045				
				⊗	Eng. ALH, A/C(-), 09/00→	MVB906R6	6PK906				
				⊗	Eng. ALH, A/C(+), 09/00→	MVB1660R6	6PK1660				
				⊗	→05/97	TB384	137x25.4				
				⊗	Eng. ALH, 09/00→,	TB533	141x25				
				⊗	→ Eng Nr 500000						
				⊗	Eng. ALH, 09/00→,	TB659	141x26				
				⊗	Eng Nr 500001→						
				⊗	→05/97	TBK025					
60 1.4	AEX, APQ, AUD	44	11/95 → 01/04	⊗	A/C(-), MS	MVB750R6	6PK750				
				⊗	Eng. AUD, A/C(-), PS	MVB1065R6	6PK1065				
				⊗	Eng. AUD, A/C(+)	MVB1180R6	6PK1180				
				⊗		TB466	135x19				
				⊗		TBK087					
				⊗		TBK320					
				⊗	Eng. AUD, 09/00→						
				75 1.6	AEE	55	11/95 → 09/00	⊗	A/C(-), MS, 06/97→	MVB750R6	6PK750
								⊗	A/C(-), PS, 06/97→	MVB1065R6	6PK1065
								⊗	A/C(+), MS, 06/97→	MVB1080R6	6PK1080
⊗	A/C(+), PS, 06/97→	MVB1125R6	6PK1125								
⊗	06/97→	TB467	137x19								
⊗	06/97→	TBK088									
1F	55	11/95 → 05/97	⊗					A/C(-)	MVB890R6	6PK890	
			⊗					A/C(+)	MVB1155R6	6PK1155	
			⊗						TB108	121x18	
			⊗						TBK016		
			⊗	A/C(-)	SVB12685	12x685					
			⊗	A/C(+)	SVB12760	12x760					

CADDY II Estate (9K9B)

1.4	AEX, AKV, APQ, AUD	44	11/95 → 01/04	⊗	A/C(-), MS	MVB750R6	6PK750				
				⊗	Eng. AUD, A/C(-), PS	MVB1065R6	6PK1065				
				⊗	Eng. AUD, A/C(+)	MVB1180R6	6PK1180				
				⊗		TB466	135x19				
				⊗		TBK087					
				⊗		TBK320					
				⊗	Eng. AUD, 09/00→						
				1.4 16V	AUA	55	08/00 → 01/04	⊗	A/C(-)	MVB1065R6	6PK1065
								⊗	A/C(+)	MVB1180R6	6PK1180
								⊗		TB634	58x17
⊗		TB658	130x20								
⊗		TBK246									
1.6	1F	55	11/95 → 05/97					⊗	A/C(-)	MVB890R6	6PK890
								⊗	A/C(+)	MVB1155R6	6PK1155
								⊗		TB108	121x18
								⊗		TBK016	
								⊗	A/C(-)	SVB12685	12x685
				⊗	A/C(+)	SVB12760	12x760				
				AEE	55	06/97 → 09/00	⊗	A/C(-), MS	MVB750R6	6PK750	
							⊗	A/C(-), PS	MVB1065R6	6PK1065	
							⊗	A/C(+), MS	MVB1080R6	6PK1080	
							⊗	A/C(+), PS	MVB1125R6	6PK1125	
⊗		TB467	137x19								
⊗		TBK088									
1.7 SDI	AHB	42	07/96 → 09/00				⊗	A/C(-)	MVB1045R6	6PK1045	
							⊗	A/C(+)	MVB1150R6	6PK1150	
							⊗		TB384	137x25.4	
							⊗		TBK305		
				⊗	A/C(-)	SVB12735	12x735				
				⊗	A/C(+)	SVB11790	11x790				



kW



...VW

...CADDY II Estate (9K9B)

1.9 D	1Y	47	11/95 → 01/04		A/C(-)	MVB925R6	6PK925			
					A/C(+)	MVB1150R6	6PK1150			
						TB384	137x25.4			
						TBK025				
					A/C(-)	SVB12735	12x735			
					A/C(+)	SVB11790	11x790			
1.9 SDI	AEY, AYQ	47	11/95 → 01/04		A/C(+), →08/00	MVB1150R6	6PK1150			
					Eng. AEY, A/C(-), →08/00	MVB1045R6	6PK1045			
					Eng. AYQ, A/C(-), 09/00→	MVB906R6	6PK906			
					Eng. AYQ, A/C(+), 09/00→	MVB1660R6	6PK1660			
					→08/00	TB384	137x25.4			
					Eng. AYQ, 09/00→,	TB533	141x25			
								→ Eng Nr 005517		
					Eng. AYQ, 09/00→,	TB659	141x26			
								Eng Nr 005518→		
					→08/00	TBK305				
					Eng. AYQ, 09/00→,	TBK107				
								→ Eng Nr 005517		
					Eng. AYQ, 09/00→,	TBK272				
								Eng Nr 005518→		
					Eng. AEY, A/C(-), →08/00	SVB12735	12x735			
					Eng. AEY, A/C(+), →08/00	SVB11790	11x790			
1.9 TDI	AHU, ALE, ALH	66	10/96 → 01/04		A/C(-), →08/00	MVB1045R6	6PK1045			
					A/C(+), →08/00	MVB1150R6	6PK1150			
					Eng. ALH, A/C(-), 09/00→	MVB906R6	6PK906			
					Eng. ALH, A/C(+), 09/00→	MVB1660R6	6PK1660			
					→08/00	TB384	137x25.4			
					Eng. ALH, 09/00→,	TB533	141x25			
								→ Eng Nr 500000		
					Eng. ALH, 09/00→,	TB659	141x26			
								Eng Nr 500001→		
					→05/97	TBK025				
					→08/00	TBK026				
					Eng. ALH, 09/00→,	TBK107				
								→ Eng Nr 500000		
					Eng. ALH, 09/00→,	TBK272				
				Eng Nr 500001→						
					A/C(-), →08/00	SVB12735	12x735			
					A/C(+), →08/00	SVB11790	11x790			

CADDY II Pickup (9U7)

1.6	AEE	55	06/96 → 12/00		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), MS	MVB1080R6	6PK1080
					A/C(+), PS	MVB1125R6	6PK1125
						TB467	137x19
						TBK088	
1.9 D	AEF	47	06/96 → 12/00			MVB1225R5	5PK1225
						TB657	137x23
						TBK093	

CADDY III Box (2KA, 2KH)

1.4	BCA	55	03/04 →		A/C(-), →05/06	MVB736R6	6PK736
					A/C(+), →05/06	MVB1100R6	6PK1100
					→05/06	TB634	58x17
					→05/06	TB658	130x20
					→05/06	TBK246	
1.4 16V	BUD	59	05/06 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1100R6	6PK1100
						TB634	58x17
						TB658	130x20
						TBK246	



kw



...VW

...CADDY III Box (2KA, 2KH)

1.6	BGU, BSE, BSF	75	04/04 →	①	A/C(-), MS	MVB900R6	6PK900
				②	A/C(-), PS, 11/07→	MVB1125R6	6PK1125
				③	A/C(+), MS	MVB1045R6	6PK1045
				④	A/C(+), PS, 11/07→	MVB1200R6D	6DPK1200
				⑤		TB552	138x23
						TBK100	
1.9 TDI	BJB, BLS	77	04/04 →	①	A/C(-), 06/05→	MVB1137R6	6PK1137
				②	Eng. BJB, A/C(-), → Ch. 2K-6-048669	MVB946R6	6PK946
				③	Eng. BLS, A/C(+)	MVB1050R6	6PK1050
				④		TB680	120x30
				⑤		TBK270	
						TBK270	
	BSU	55	09/05 →	①	A/C(-)	MVB1137R6	6PK1137
				②	A/C(+)	MVB1050R6	6PK1050
				③		TB680	120x30
				④		TBK270	
				⑤		TBK270	
						TBK270	
2.0 EcoFuel	BSX	80	04/06 →	①	A/C(-)	MVB900R6	6PK900
				②	A/C(+)	MVB1045R6	6PK1045
				③		TB552	138x23
				④		TBK100	
				⑤		TBK100	
						TBK100	
2.0 SDI	BDJ, BST	51	03/04 →	①	A/C(-)	MVB946R6	6PK946
				②	A/C(+)	MVB1050R6	6PK1050
				③		TB680	120x30
				④		TBK270	
				⑤		TBK270	
						TBK270	
2.0 TDI	BMM	103	09/07 →	①	A/C(-), → Ch. 2K-6-048669	MVB946R6	6PK946
				②	A/C(-), Ch. 2K-6-048670→	MVB1137R6	6PK1137
				③	A/C(+)	MVB1050R6	6PK1050
				④	A/C(+)	MVB1215R6D	6DPK1215
				⑤		TB680	120x30
						TBK270	

CADDY III Estate (2KB, 2KJ)

1.4	BCA	55	03/04 →	①	A/C(-), →05/06	MVB736R6	6PK736
				②	A/C(+), →05/06	MVB1100R6	6PK1100
				③	→05/06	TB634	58x17
				④	→05/06	TB658	130x20
				⑤	→05/06	TBK246	
						TBK246	
1.4 16V	BUD	59	05/06 →	①	A/C(-)	MVB736R6	6PK736
				②	A/C(+)	MVB1100R6	6PK1100
				③		TB634	58x17
				④		TB658	130x20
				⑤		TBK246	
						TBK246	
1.6	BGU, BSE, BSF	75	04/04 →	①	A/C(-)	MVB900R6	6PK900
				②	A/C(+)	MVB1045R6	6PK1045
				③		TB552	138x23
				④		TBK100	
				⑤		TBK100	
						TBK100	
1.9 TDI	BJB, BLS	77	04/04 →	①	A/C(-), 06/05→	MVB1137R6	6PK1137
				②	Eng. BJB, A/C(-), → Ch. 2K-6-048669	MVB946R6	6PK946
				③	Eng. BLS, A/C(+)	MVB1050R6	6PK1050
				④		TB680	120x30
				⑤		TBK270	
						TBK270	
	BSU	55	09/05 →	①	A/C(-)	MVB1137R6	6PK1137
				②	A/C(+)	MVB1050R6	6PK1050
				③		TB680	120x30
				④		TBK270	
				⑤		TBK270	
						TBK270	
2.0 EcoFuel	BSX	80	04/06 →	①	A/C(-)	MVB900R6	6PK900
				②	A/C(+)	MVB1045R6	6PK1045
				③		TB552	138x23
				④		TBK100	
				⑤		TBK100	
						TBK100	



kW



...VW

...CADDY III Estate (2KB, 2KJ)

2.0 SDI	BDJ, BST	51	03/04 →	 KIT	A/C(-) A/C(+)	MVB946R6 MVB1050R6 TB680 TBK270	6PK946 6PK1050 120x30
2.0 TDI	BMM	103	09/07 →	 KIT	A/C(-), → Ch. 2K-6-048669 A/C(-), Ch. 2K-6-048670 → A/C(+) A/C(+)	MVB946R6 MVB1137R6 MVB1050R6 MVB1215R6D TB680 TBK270	6PK946 6PK1137 6PK1050 6DPK1215 120x30

CORRADO (53I)

1.8 16V	KR	100	04/89 → 07/92	 KIT 	A/C(-) → Eng Nr 131261 → Ch. 50M005059 Ch. 50M005060 →	SVB13950 SVB10950 TB505 TBK066 SVB10735 SVB10625	13x950 10x950 147x25.4 10x735 10x625
1.8 G60	PG	118	09/88 → 09/93	 KIT 	A/C(-) A/C(+) A/C(-) A/C(+)	MVB1650R6 MVB1755R6 TB108 TBK016 SVB10665 SVB10740	6PK1650 6PK1755 121x18 10x665 10x740
2.0 i	2E, ADY	85	04/93 → 12/95	 KIT 	A/C(-), Auto Tensioner, →05/95 A/C(-), Manu Tensioner, →05/95 A/C(+), →05/95 →05/95 →05/95 A/C(-), →05/95 A/C(+), →05/95	MVB975R6 MVB890R6 MVB1155R6 TB506 TBK076 SVB12685 SVB12760	6PK975 6PK890 6PK1155 124x18 12x685 12x760
2.0 i 16V	9A	100	08/91 → 12/95	 KIT 	→05/95 A/C(-), →05/95 →05/95 →05/95, → Eng Nr 131261 →05/95	SVB13950 SVB10950 TB505 TBK066 SVB10625	13x950 10x950 147x25.4 10x625
2.9 VR6	ABV	140	08/91 → 12/95	 	A/C(-), →05/95 A/C(+), →05/95	MVB1285R7 MVB1360R7D	7PK1285 7DPK1360

CRAFTER 30-35 Bus (2E)

2.5 TDI	BJJ	65	04/06 →	 	A/C(-) A/C(+)	MVB1995R6 MVB2585R6 TB797	6PK1995 6PK2585 141x26
	BJK	80	04/06 →	 	A/C(-) A/C(+)	MVB1995R6 MVB2585R6 TB797	6PK1995 6PK2585 141x26
	BJL	100	04/06 →	 	A/C(-) A/C(+)	MVB1995R6 MVB2585R6 TB797	6PK1995 6PK2585 141x26
	BJM	120	04/06 →	 	A/C(-) A/C(+)	MVB1995R6 MVB2585R6 TB797	6PK1995 6PK2585 141x26



kw



...VW

CRAFTER 30-50 Box (2E)

2.5 TDI	BJJ	65	04/06 →	⊗	A/C(-)	MVB1995R6	6PK1995
				⊗	A/C(+)	MVB2585R6	6PK2585
						TB797	141x26
	BJK	80	04/06 →	⊗	A/C(-)	MVB1995R6	6PK1995
				⊗	A/C(+)	MVB2585R6	6PK2585
						TB797	141x26
	BJL	100	04/06 →	⊗	A/C(-)	MVB1995R6	6PK1995
				⊗	A/C(+)	MVB2585R6	6PK2585
						TB797	141x26
	BJM	120	04/06 →	⊗	A/C(-)	MVB1995R6	6PK1995
				⊗	A/C(+)	MVB2585R6	6PK2585
						TB797	141x26

CRAFTER 30-50 Flatbed / Chassis (2E)

2.5 TDI	BJJ	65	04/06 →	⊗	A/C(-)	MVB1995R6	6PK1995
				⊗	A/C(+)	MVB2585R6	6PK2585
						TB797	141x26
	BJK	80	04/06 →	⊗	A/C(-)	MVB1995R6	6PK1995
				⊗	A/C(+)	MVB2585R6	6PK2585
						TB797	141x26
	BJL	100	04/06 →	⊗	A/C(-)	MVB1995R6	6PK1995
				⊗	A/C(+)	MVB2585R6	6PK2585
						TB797	141x26
	BJM	120	04/06 →	⊗	A/C(-)	MVB1995R6	6PK1995
				⊗	A/C(+)	MVB2585R6	6PK2585
						TB797	141x26

EOS

1.6 FSI	BLF	85	06/06 →	⊗	A/C(-)	MVB1088R6	6PK1088
				⊗	A/C(+)	MVB1740R6	6PK1740
2.0 FSI	BVY, BVZ	110	03/06 →	⊗	A/C(-)	MVB900R6	6PK900
				⊗	A/C(+)	MVB1045R6	6PK1045
						TB753	148x23
2.0 TDI	BMM	103	06/06 →	⊗		MVB1050R6	6PK1050
						TB680	120x30
					KIT	TBK270	
2.0 TFSI	BWA	147	03/06 →	⊗		MVB1050R6	6PK1050
						TB753	148x23
3.2 V6	BUB	184	06/06 →	⊗		MVB1625R6	6PK1625

FOX (5Z1)

1.2	BMD	40	04/05 →	⊗	A/C(-)	MVB1450R6	6PK1450
				⊗	A/C(+)	MVB1875R6	6PK1875
1.4	BKR	55	04/05 →	⊗	A/C(+)	MVB1080R6	6PK1080
						TB466	135x19
					KIT	TBK320	
1.4 TDI	BNM	51	04/05 →	⊗	A/C(-)	MVB860R6	6PK860
				⊗	A/C(+)	MVB1000R6	6PK1000
						TB680	120x30
					KIT	TBK270	

GOLF I (17)

1.1	FA, GG	37	04/74 → 07/83	⊗	→ Ch. 17A0279403	SVB10700	10x700
				⊗	Ch. 17A0279404 →	SVB10690	10x690
						TB107	108x19
FJ	38	01/81 → 07/83	01/81 → 07/83	⊗	→ Ch. 17A0279403	SVB10700	10x700
				⊗	Ch. 17A0279404 →	SVB10690	10x690
						TB107	108x19
HC	44	01/81 → 07/83	01/81 → 07/83	⊗	→ Ch. 17A0279403	SVB10700	10x700
				⊗	Ch. 17A0279404 →	SVB10690	10x690
						TB107	108x19



kW



...VW

...GOLF I (17)

1.3	GF	44	08/79 → 07/83		→ Ch. 17A0279403	SVB10700	10x700				
					Ch. 17A0279404→	SVB10690	10x690				
						TB107	108x19				
1.3	GS	43	08/82 → 12/83		→07/83, → Ch. 17A0279403	SVB10700	10x700				
					→07/83, Ch. 17A0279404→	SVB10690	10x690				
					→07/83	TB107	108x19				
1.5	JB	51	08/77 → 07/83		→07/81	SVB10825	10x825				
					→07/81, → Ch. 1773262000	SVB131125	13x1125				
					→07/81,	SVB101125	10x1125				
					Ch. 1773262001→1773800000						
					→07/81, Ch. 1773800001→	SVB131050	13x1050				
					08/81→	SVB131025	13x1025				
					→07/81	SVB101150	10x1150				
					A/C(-), →08/81	SVB10950	10x950				
					A/C(+)	SVB10850	10x850				
						TB108	121x18				
						TBK016					
				1.5	FH	51	04/74 → 12/75			SVB10825	10x825
									→ Ch. 1773262000	SVB131125	13x1125
	Ch. 1773262001→1773800000	SVB101125	10x1125								
	Ch. 1773800001→	SVB131050	13x1050								
		SVB101150	10x1150								
	A/C(+), → Ch. 1773800000	SVB10950	10x950								
	A/C(+), Ch. 1773800001→	SVB10850	10x850								
		TB108	121x18								
		TBK016									
1.5 D	CK	37	08/76 → 07/80							SVB13950	13x950
										SVB10875	10x875
										TB225	135x25.4
1.6	EM, FN, FP	55	08/75 → 02/84						→07/83	SVB10825	10x825
					→07/83, → Ch. 1773262000	SVB131125	13x1125				
					→07/83,	SVB101125	10x1125				
					Ch. 1773262001→1773800000						
					→07/83, Ch. 1773800001→	SVB131050	13x1050				
					02/76 →07/83	SVB131025	13x1025				
					→07/83	SVB101150	10x1150				
					A/C(-), →07/83	SVB10950	10x950				
					A/C(+), →07/83	SVB10850	10x850				
					→07/83	TB108	121x18				
					→07/83	TBK016					
				1.6	FT	51	08/75 → 07/77			SVB10825	10x825
									→ Ch. 1773262000	SVB131125	13x1125
	Ch. 1773262001→1773800000	SVB101125	10x1125								
	Ch. 1773800001→	SVB131050	13x1050								
		SVB101150	10x1150								
	A/C(+), → Ch. 1773800000	SVB10950	10x950								
	A/C(+), Ch. 1773800001→	SVB10850	10x850								
		TB108	121x18								
		TBK016									
1.6	EW, HN	55	01/83 → 02/84						→07/83	SVB10825	10x825
									→07/83	SVB131025	13x1025
									→07/83, → Ch. 1773262000	SVB131125	13x1125
									→07/83,	SVB101125	10x1125
					Ch. 1773262001→1773800000						
					→07/83, Ch. 1773800001→	SVB131050	13x1050				
					→07/83	SVB101150	10x1150				
					A/C(-), →07/83	SVB10950	10x950				
					A/C(+), →07/83	SVB10850	10x850				
					→07/83	TB108	121x18				
					→07/83	TBK016					



kW



...VW

...GOLF I (17)

1.6 D	CR, JK	40	08/80 → 07/83	 		SVB13950 SVB10875 TB225 TBK018	13x950 10x875 135x25.4
1.6 GTI	EG	81	08/76 → 07/82	 	→ Ch. 1773262000 Ch. 1773262001→1773800000 Ch. 1773800001→	SVB10825 SVB131025 SVB131125 SVB101125 SVB131050 SVB101150 SVB10940 SVB10850 TB108 TBK016	10x825 13x1025 13x1125 10x1125 13x1050 10x1150 10x940 10x850 121x18
1.6 TD	CY	51	03/82 → 07/83	 		SVB13950 SVB10875 TB225 TBK018	13x950 10x875 135x25.4
1.8 GTI	DX, JJ	82	08/82 → 12/83	 	→07/83 A/C(-), →07/83 A/C(+), →07/83 →07/83 →07/83	SVB131025 SVB10940 SVB10850 TB108 TBK016	13x1025 10x940 10x850 121x18

GOLF I Cabriolet (155)

1.3		40	08/83 → 07/86	 		SVB10700 TB107	10x700 108x19
1.5	JB	51	01/79 → 11/83	 	→07/83 A/C(-), →08/81 A/C(+), →07/83 →07/83 →07/83	SVB131025 SVB10950 SVB10850 TB108 TBK016	13x1025 10x950 10x850 121x18
1.6	RE	53	04/86 → 02/90	 	→ Ch. 15-E-007195 Ch. 15-E-007196→ A/C(-), MS A/C(-), PS A/C(+), → Ch. 15-M-009000 A/C(+), Ch. 15-M-009001→	SVB131025 SVB13950 SVB10950 SVB10865 TB108 TBK016 SVB10735 SVB10625	13x1025 13x950 10x950 10x865 121x18
	EW	55	08/83 → 04/92	 	→07/90, → Ch. 15-E-007195 →07/90, Ch. 15-E-007196→ A/C(-), MS, →07/90 A/C(-), PS, →07/90 →07/90 →07/90 A/C(+), →07/90, → Ch. 15-M-009000 A/C(+), →07/90, Ch. 15-M-009001→	SVB131025 SVB13950 SVB10950 SVB10865 TB108 TBK016 SVB10735 SVB10625	13x1025 13x950 10x950 10x865 121x18
	EG	81	08/79 → 07/82	 	A/C(-), 09/81→ A/C(+)	SVB131025 SVB10940 SVB10850 TB108 TBK016	13x1025 10x940 10x850 121x18



kW



...VW

...GOLF I Cabriolet (155)

1.8	EX	66	08/83 → 09/92	⚙️	→ Ch. 15E007195	SVB131025	13x1025				
				⚙️	Ch. 15E007196→	SVB13950	13x950				
				⚙️	A/C(-), MS	SVB10950	10x950				
				⚙️	A/C(-), PS	SVB10865	10x865				
				🌀		TB108	121x18				
				🌀KIT		TBK016					
				⚙️	A/C(+), → Ch. 15-M-009000	SVB10735	10x735				
				⚙️	A/C(+), Ch. 15-M-009001→	SVB10625	10x625				
				<hr/>							
				JH		70	08/83 → 04/93	⚙️	→12/92, → Ch. 15-E-007195	SVB131025	13x1025
⚙️	→12/92, Ch. 15-E-007196→	SVB13950	13x950								
⚙️	A/C(-), MS, →12/92	SVB10950	10x950								
⚙️	A/C(-), PS, →12/92	SVB10865	10x865								
⚙️	A/C(+), →12/92	SVB10625	10x625								
🌀	→12/92	TB108	121x18								
🌀KIT	→12/92	TBK016									
⚙️	A/C(+), →12/92,	SVB10735	10x735								
	→ Ch. 15-M-009000										
<hr/>											
DX, EV, PB		82	08/82 → 12/89	⚙️	→ Ch. 15-E-007195	SVB131025	13x1025				
				⚙️	Ch. 15-E-007196→	SVB13950	13x950				
				⚙️	A/C(-), MS	SVB10950	10x950				
				⚙️	A/C(-), PS	SVB10865	10x865				
				🌀		TB108	121x18				
				🌀KIT		TBK016					
				⚙️	A/C(+), → Ch. 15-M-009000	SVB10735	10x735				
				⚙️	A/C(+), Ch. 15-M-009001→	SVB10625	10x625				
				<hr/>							
				2H		72	08/89 → 03/93	⚙️	→ Ch. 15-E-007195	SVB131025	13x1025
⚙️	Ch. 15-E-007196→	SVB13950	13x950								
⚙️	A/C(-), MS	SVB10950	10x950								
⚙️	A/C(-), PS	SVB10865	10x865								
🌀		TB108	121x18								
🌀KIT		TBK016									
⚙️	A/C(+), → Ch. 15-M-009000	SVB10735	10x735								
⚙️	A/C(+), Ch. 15-M-009001→	SVB10625	10x625								

GOLF II (19E, 1G1)

1.0	GN	33	11/83 → 08/85	⚙️		SVB10690	10x690
				🌀		TB107	108x19
1.0	HZ	37	08/85 → 10/91	⚙️		SVB10690	10x690
				🌀		TB107	108x19
				🌀		TB283	128x19
1.3	HK, MH	40	08/83 → 06/87	⚙️		SVB10690	10x690
				🌀		TB107	108x19
1.3	NU	37	08/85 → 12/87	⚙️		SVB10690	10x690
				🌀		TB107	108x19
1.3	GT	44	08/83 → 10/86	⚙️		SVB10690	10x690
				🌀		TB107	108x19
1.3 CAT	2G, MH, NZ	40	06/86 → 12/92	⚙️	Eng. 2G, →07/92,	SVB10690	10x690
					→ Ch. 1G-M-368060		
				⚙️	Eng. 2G, →07/92,	SVB12710	12x710
					Ch. 1G-M-368061→		
				🌀	→10/90, → Eng Nr 2G 262739	TB107	108x19
	10/90→07/92,	TB283	128x19				
			Eng Nr 2G 262740→				



kw



...VW

...GOLF II (19E, 1G1)

VW

1.6	PN	51	10/86 → 12/92	☼	→07/91	SVB13950	13x950
				⊖	A/C(-), MS, →07/91	SVB10950	10x950
				⊖	A/C(-), PS, →07/91	SVB10865	10x865
				⊖	A/C(+), →07/91	SVB10625	10x625
				☼	→07/91	TB108	121x18
				☼	→07/91	TBK016	
				☼	→07/91	SVB10735	10x735
				☼		SVB13950	13x950
				⊖	A/C(-), MS	SVB10950	10x950
				⊖	A/C(-), PS	SVB10865	10x865
RF	53	02/86 → 10/91	☼		SVB13950	13x950	
			⊖	A/C(-), MS	SVB10950	10x950	
			⊖	A/C(-), PS	SVB10865	10x865	
			⊖	A/C(+)	SVB10625	10x625	
			☼		TB108	121x18	
			☼		TBK016		
			☼		SVB10735	10x735	
			☼		SVB13950	13x950	
			⊖	Eng. ABN	SVB10625	10x625	
			⊖	07/85→	SVB10950	10x950	
ABN, EZ, HM	55	08/83 → 07/92	☼	→07/91	SVB13950	13x950	
			☼	Eng. ABN	SVB10625	10x625	
			⊖	07/85→	SVB10950	10x950	
			⊖	A/C(-), MS, →07/85	SVB10940	10x940	
			☼		TB108	121x18	
			☼		TBK016		
			☼	→07/91	SVB10735	10x735	
			☼	Eng. ABN	SVB10865	10x865	
			☼		SVB13950	13x950	
			⊖	A/C(-)	SVB12950	12x950	
1.6 D	JP, ME	40	08/83 → 10/91	☼		SVB13950	13x950
				⊖	A/C(-)	SVB12950	12x950
				⊖	A/C(+), → Ch. F-350000	SVB10690	10x690
				⊖	A/C(+), Ch. F-350001→	SVB10700	10x700
				☼		TB225	135x25.4
				☼		TBK018	
				☼		SVB10740	10x740
				☼		SVB13950	13x950
				⊖	A/C(-)	SVB12950	12x950
				⊖	A/C(+), → Ch. F-350000	SVB10690	10x690
37	08/83 → 10/91	☼		SVB13950	13x950		
		⊖	A/C(-)	SVB12950	12x950		
		⊖	A/C(+), → Ch. F-350000	SVB10690	10x690		
		⊖	A/C(+), Ch. F-350001→	SVB10700	10x700		
		☼		TB225	135x25.4		
		☼		TBK018			
		☼		SVB10740	10x740		
		☼		SVB13950	13x950		
		⊖	→07/85	SVB10875	10x875		
		⊖	A/C(-)	SVB12950	12x950		
1.6 TD	JR, MF	51	08/83 → 10/91	☼		SVB13950	13x950
				⊖	→07/85	SVB10875	10x875
				⊖	A/C(-)	SVB12950	12x950
				⊖	A/C(+), → Ch. F-350000	SVB10690	10x690
				⊖	A/C(+), Ch. F-350001→	SVB10700	10x700
				☼		TB225	135x25.4
				☼		TBK018	
				☼		SVB10740	10x740
				☼		SVB13950	13x950
				⊖	A/C(-)	SVB12950	12x950
RA, SB	59	04/89 → 10/91	☼		SVB13950	13x950	
			⊖	A/C(-)	SVB12950	12x950	
			⊖	A/C(+), → Ch. F-350000	SVB10690	10x690	
			⊖	A/C(+), Ch. F-350001→	SVB10700	10x700	
			☼		TB225	135x25.4	
			☼		TBK018		
			☼		SVB10740	10x740	
			☼		SVB13950	13x950	
			⊖	A/C(-)	SVB12950	12x950	
			⊖	A/C(+), → Ch. F-350000	SVB10690	10x690	
1V	44	08/89 → 10/91	☼		SVB13950	13x950	
			⊖	A/C(-)	SVB12950	12x950	
			⊖	A/C(+), → Ch. F-350000	SVB10690	10x690	
			⊖	A/C(+), Ch. F-350001→	SVB10700	10x700	
			☼		TB225	135x25.4	
			☼		TBK018		
			☼		SVB10740	10x740	
			☼		SVB13950	13x950	
			⊖	A/C(-)	SVB12950	12x950	
			⊖	A/C(+), → Ch. F-350000	SVB10690	10x690	



kW



...VW

...GOLF II (19E, 1G1)

1.8	RH	62	08/86 → 01/90	⊗	08/87 →	SVB13950	13x950
				⊗	A/C(-), MS, 08/87 →	SVB10950	10x950
				⊗	PS, 08/87 →	SVB12865	12x865
					08/87 →	TB108	121x18
				KIT	08/87 →	TBK016	
				⊗	08/87 →	SVB10735	10x735
				GU, GX, HV	66	08/84 → 10/91	⊗
⊗	A/C(-), MS, →07/85	SVB10940	10x940				
⊗	A/C(-), MS, 07/85 →	SVB10950	10x950				
⊗	A/C(-), PS	SVB10865	10x865				
⊗	A/C(+)	SVB10625	10x625				
		TB108	121x18				
KIT		TBK016					
1.8 Syncro	GU, GX	66	02/86 → 07/91	⊗		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10625	10x625
						TB108	121x18
				KIT		TBK016	
				⊗		SVB10735	10x735
1.8 GTI	DX, EV, GZ, PB	82	08/83 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-), MS, →07/85	SVB10940	10x940
				⊗	A/C(-), MS, 07/85 →	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10625	10x625
						TB108	121x18
				KIT		TBK016	
1.8 GTI	RD	79	08/85 → 10/87	⊗		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10625	10x625
						TB108	121x18
				KIT		TBK016	
				⊗		SVB10735	10x735
1.8 GTI	HT	77	01/85 → 07/85			TB108	121x18
				KIT		TBK016	
1.8 GTI 16V	PL	95	02/86 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-), MS, →08/87	SVB10940	10x940
				⊗	A/C(-), MS, 08/87 →	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10635	10x635
						TB505	147x25.4
				KIT		TBK066	
1.8 GTI	KR	102	02/86 → 06/90	⊗		SVB13950	13x950
				⊗	A/C(-), MS, →08/87	SVB10940	10x940
				⊗	A/C(-), MS, 08/87 →	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10635	10x635
						TB505	147x25.4
				KIT		TBK066	
⊗		SVB10735	10x735				

VW



kW



...VW

...GOLF II (19E, 1G1)

1.8 GTI CAT	PF	79	01/87 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10625	10x625
				⊗	PS, 08/87 →	SVB12865	12x865
						TB108	121x18
						TBK016	
				⊗		SVB10735	10x735
1.8 GTI G60	PG	118	04/90 → 07/91	⊗	A/C(-)	MVB1650R6	6PK1650
				⊗	A/C(+)	MVB1755R6	6PK1755
						TB108	121x18
						TBK016	
				⊗	A/C(-)	SVB10665	10x665
				⊗	A/C(+)	SVB10740	10x740
1.8 GTI G60 Syncro	1H, PG	118	08/88 → 07/91	⊗	A/C(-)	MVB1650R6	6PK1650
				⊗	A/C(+)	MVB1755R6	6PK1755
						TB108	121x18
						TBK016	
				⊗	A/C(-)	SVB10665	10x665
				⊗	A/C(+)	SVB10740	10x740
1.8 i CAT	GX, RP	66	08/87 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10625	10x625
						TB108	121x18
						TBK016	
				⊗		SVB10735	10x735
1.8 i Syncro CAT	RP	66	08/87 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10625	10x625
						TB108	121x18
						TBK016	
				⊗		SVB10735	10x735

GOLF III (1H1)

1.4	ABD, AEX	40	11/91 → 08/97	⊗	Eng. ABD, A/C(-), MS, →07/95	MVB736R6	6PK736
				⊗	Eng. ABD, A/C(-), PS, →07/95, → Ch. 1H-S-120000	MVB1100R6	6PK1100
				⊗	Eng. ABD, A/C(-), PS, Ch. 1H-S-120001→	MVB1065R6	6PK1065
				⊗	Eng. ABD, A/C(+), PS, →07/95	MVB1155R6	6PK1155
				⊗	Eng. AEX, MS	MVB750R6	6PK750
				⊗	Eng. AEX, PS	MVB1065R6	6PK1065
					Eng. ABD, →07/95	TB283	128x19
					Eng. AEX	TB466	135x19
					Eng. AEX	TBK087	
				⊗	Eng. ABD, A/C(+), →07/95	SVB12760	12x760
		44	10/91 → 08/97	⊗	Eng. ABD, A/C(-), MS, →07/95	MVB736R6	6PK736
				⊗	Eng. ABD, A/C(-), PS, →07/95, → Ch. 1H-S-120000	MVB1100R6	6PK1100
				⊗	Eng. ABD, A/C(-), PS, Ch. 1H-S-120001→	MVB1065R6	6PK1065
				⊗	Eng. ABD, A/C(+), PS, →07/95	MVB1155R6	6PK1155
				⊗	Eng. AEX, MS	MVB750R6	6PK750
				⊗	Eng. AEX, PS	MVB1065R6	6PK1065
					Eng. ABD, →07/95	TB283	128x19
					Eng. AEX	TB466	135x19
					Eng. AEX	TBK087	
				⊗	Eng. ABD, A/C(+), →07/95	SVB12760	12x760



kW



...VW

...GOLF III (1H1)

Power (kW)	Engine Code	Power (kW)	Period	Timing Belt	Notes	Part Number	Part Number				
1.6	ABU, AEA, AEE	55	09/92 → 08/97		A/C(+), PS, 10/94→	MVB1155R6	6PK1155				
					Eng. AEA, A/C(-), MS, →07/95	MVB736R6	6PK736				
					Eng. AEA, A/C(-), PS, →07/95	MVB1100R6	6PK1100				
					Eng. AEE, A/C(-), MS, 08/95→	MVB750R6	6PK750				
					Eng. AEE, A/C(-), PS, 08/95→	MVB1065R6	6PK1065				
					→07/94	TB442	133x19				
					10/94→	TB467	137x19				
					10/94→	TBK088					
					A/C(+), 10/94→07/95	SVB12760	12x760				
					AEK, AFT, AKS	74	07/95 → 08/97		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
									A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
									A/C(-), Manu Tensioner	MVB890R6	6PK890
									A/C(+)	MVB1155R6	6PK1155
										TB463	121x18
	TBK086										
1.8	AAM	55	11/91 → 08/97		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975				
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035				
					A/C(-), Manu Tensioner	MVB890R6	6PK890				
					A/C(+)	MVB1155R6	6PK1155				
					→07/94, → Ch. R...	TB108	121x18				
					07/94→, Ch. S...→	TB463	121x18				
					→07/94, → Ch. R...	TBK016					
					07/94→, Ch. S...→	TBK086					
					A/C(-)	SVB12685	12x685				
					A/C(+)	SVB12760	12x760				
					ABS, ACC, ADZ	66	11/91 → 08/97		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
									A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
									A/C(-), Manu Tensioner	MVB890R6	6PK890
									A/C(+)	MVB1155R6	6PK1155
→07/94, → Ch. R...	TB108	121x18									
07/94→, Ch. S...→	TB463	121x18									
→07/94, → Ch. R...	TBK016										
07/94→, Ch. S...→	TBK086										
A/C(-)	SVB12685	12x685									
A/C(+)	SVB12760	12x760									
1.8 Syncro (1HX1)	ABS, ADZ	66	01/93 → 08/97						A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
									A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
									A/C(-), Manu Tensioner	MVB890R6	6PK890
									A/C(+)	MVB1155R6	6PK1155
					→07/94, → Ch. R...	TB108	121x18				
					07/94→, Ch. S...→	TB463	121x18				
					→07/94, → Ch. R...	TBK016					
					07/94→, Ch. S...→	TBK086					
					A/C(-)	SVB12685	12x685				
					A/C(+)	SVB12760	12x760				



kw



...VW

...GOLF III (1H1)

Engine	Code	Power (kw)	Period	Accessories	Notes	Part Numbers	Dimensions
1.9 D	1Y	48	11/91 → 08/97	⊗	A/C(-), Auto Tensioner	MVB925R6	6PK925
				⊗	A/C(-), Manu Tensioner	MVB1045R6	6PK1045
				⊗	A/C(+), Manu Tensioner	MVB1150R6	6PK1150
						TB384	137x25.4
					→07/94, → Eng Nr 1Y378364	TBK024	
					07/94 →, Eng Nr 1Y378365 →	TBK025	
1.9 SDI	AEY	47	07/95 → 08/97	⊗	A/C(-)	MVB1045R6	6PK1045
				⊗	A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
						TBK026	
				⊗	A/C(-)	SVB12735	12x735
				⊗	A/C(+)	SVB11790	11x790
1.9 TD,GTD	AAZ	55	11/91 → 08/97	⊗	A/C(-), Auto Tensioner	MVB925R6	6PK925
				⊗	A/C(-), Manu Tensioner	MVB1045R6	6PK1045
				⊗	A/C(+), Manu Tensioner	MVB1150R6	6PK1150
						TB384	137x25.4
					→07/94, → Eng Nr 552765	TBK024	
					07/94 →, Eng Nr 552766 →	TBK025	
1.9 TDI	1Z, AHU, ALE	66	09/93 → 08/97	⊗	Eng. 1Z, A/C(-)	MVB1045R6	6PK1045
				⊗	Eng. 1Z, A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
	AFN	81	04/96 → 08/97	⊗	→07/94, → Eng Nr 1Z289575	TBK119	
					Eng Nr 1Z289576 →	TBK026	
				⊗	Eng. 1Z, A/C(-)	SVB12735	12x735
1.9 TDI Syncro (1HX1)	1Z, AHU, ALE	66	08/95 → 08/97	⊗	Eng. 1Z, A/C(+)	SVB11790	11x790
				⊗	Eng. 1Z, A/C(-)	MVB1045R6	6PK1045
				⊗	Eng. 1Z, A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
					Eng Nr 1Z289576 →	TBK026	
				⊗	Eng. 1Z, A/C(-)	SVB12735	12x735
2.0	2E, ADY, AGG, AKR	85	11/91 → 08/97	⊗	Eng. 1Z, A/C(+)	SVB11790	11x790
				⊗	A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95 →	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner	MVB890R6	6PK890
				⊗	A/C(+)	MVB1155R6	6PK1155
						TB506	124x18
2.0 Syncro (1HX1)	AGG	85	08/95 → 08/97			TBK076	
				⊗	A/C(-)	SVB12685	12x685
				⊗	A/C(+)	SVB12760	12x760
				⊗	A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95 →	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner	MVB890R6	6PK890
				⊗	A/C(+)	MVB1155R6	6PK1155
						TB506	124x18
						TBK076	
				⊗	A/C(-)	SVB12685	12x685
				⊗	A/C(+)	SVB12760	12x760



kW



...VW

...GOLF III (1H1)

2.0 GTI 16V	ABF	110	08/92 → 08/97		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner	MVB890R6	6PK890
					A/C(+)	MVB1155R6	6PK1155
						TB441	151x25.4
					A/C(-)	SVB12685	12x685
					A/C(+)	SVB12760	12x760
2.8 VR6	AAA	128	01/92 → 08/97		A/C(-)	MVB1285R7	7PK1285
					A/C(+)	MVB1360R7D	7DPK1360
2.9 VR6 Syncro (1HX1)	ABV	140	10/94 → 08/97		A/C(-)	MVB1285R7	7PK1285
					A/C(+)	MVB1360R7D	7DPK1360

GOLF III Cabriolet (1E7)

1.6	AEK, AFT, AKS	74	10/94 → 05/98		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner	MVB890R6	6PK890
					A/C(+)	MVB1155R6	6PK1155
						TB463	121x18
						TBK086	
					A/C(-)	SVB12685	12x685
					A/C(+)	SVB12760	12x760
1.8	AAM	55	07/93 → 05/98		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner	MVB890R6	6PK890
					A/C(+)	MVB1155R6	6PK1155
					→07/94, → Ch. R...	TB108	121x18
					07/94→, Ch. S...→	TB463	121x18
					→07/94, → Ch. R...	TBK016	
					07/94→, Ch. S...→	TBK086	
					A/C(-)	SVB12685	12x685
					A/C(+)	SVB12760	12x760
	ABS, ADZ	66	07/93 → 05/98		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner	MVB890R6	6PK890
					A/C(+)	MVB1155R6	6PK1155
					→07/94, → Ch. R...	TB108	121x18
					07/94→, Ch. S...→	TB463	121x18
					→07/94, → Ch. R...	TBK016	
					07/94→, Ch. S...→	TBK086	
					A/C(-)	SVB12685	12x685
					A/C(+)	SVB12760	12x760
1.9 TDI	1Z, AHU	66	08/95 → 05/98		A/C(-), Auto Tensioner	MVB1045R6	6PK1045
					A/C(-), Manu Tensioner	MVB925R6	6PK925
					A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
						TBK026	
					A/C(-)	SVB12735	12x735
					A/C(+)	SVB11790	11x790
	AFN	81	07/96 → 05/98		A/C(-), Auto Tensioner	MVB1045R6	6PK1045
					A/C(-), Manu Tensioner	MVB925R6	6PK925
					A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
						TBK026	
					A/C(-)	SVB12735	12x735
					A/C(+)	SVB11790	11x790



kw



...VW

...GOLF III Cabriolet (1E7)

2.0	2E, ADY, AGG, AKR	85	07/93 → 05/98		A/C(-), Auto Tensioner, 08/94→12/95	MVB975R6	6PK975
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner, 08/94→	MVB890R6	6PK890
					A/C(+), 08/94→	MVB1155R6	6PK1155
					08/94→	TB506	124x18
					08/94→	TBK076	
					A/C(-), 08/94→	SVB12685	12x685
					A/C(+), 08/94→	SVB12760	12x760

GOLF III Variant (1H5)

1.4	ABD	40	07/93 → 04/99		A/C(-), MS, →07/98	MVB736R6	6PK736
					A/C(-), PS, →07/98, → Ch. 1H-S-120000	MVB1100R6	6PK1100
					A/C(-), PS, →07/98, Ch. 1H-S-120001→	MVB1065R6	6PK1065
					A/C(+), PS, →07/98	MVB1155R6	6PK1155
					→07/98	TB283	128x19
					A/C(+), →07/98	SVB12760	12x760
	ABD, AEX, APQ	44	07/93 → 04/99		A/C(-), MS, →07/98	MVB736R6	6PK736
					Eng. ABD, A/C(-), PS, →07/98, → Ch. 1H-S-120000	MVB1100R6	6PK1100
					Eng. ABD, A/C(+), PS, →07/98	MVB1155R6	6PK1155
					MS, 08/95→	MVB750R6	6PK750
					PS	MVB1065R6	6PK1065
					→07/98	TB283	128x19
					08/95→	TB466	135x19
					08/95→	TBK087	
					A/C(+), →07/98	SVB12760	12x760
1.6	AEK, AFT, AKS	74	07/94 → 04/99		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner	MVB890R6	6PK890
					A/C(+)	MVB1155R6	6PK1155
						TB463	121x18
						TBK086	
					A/C(-)	SVB12685	12x685
					A/C(+)	SVB12760	12x760
	ABU, AEA, AEE	55	07/93 → 12/97		A/C(-), MS, 08/95→04/96	MVB750R6	6PK750
					Eng. AEE, A/C(-), PS, 08/95→04/96	MVB1065R6	6PK1065
					Eng. AEE, A/C(+), PS, 08/95→04/96	MVB1155R6	6PK1155
					08/95→04/96	TB467	137x19
					08/95→04/96	TBK088	



kW



...VW

...GOLF III Variant (1H5)

Engine	Model	kW	Year Range	Icon	Description	Part Number	Dimensions				
1.8	AAM, ANN	55	07/93 → 04/99		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975				
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035				
					A/C(-), Manu Tensioner	MVB890R6	6PK890				
					A/C(+)	MVB1155R6	6PK1155				
					→07/94, → Ch. R...	TB108	121x18				
					07/94→, Ch. S...→	TB463	121x18				
					→07/94, → Ch. R...	TBK016					
					07/94→, Ch. S...→	TBK086					
					A/C(-)	SVB12685	12x685				
					A/C(+)	SVB12760	12x760				
ABS, ADZ, ANP		66	07/93 → 04/99		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975				
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035				
					A/C(-), Manu Tensioner	MVB890R6	6PK890				
					A/C(+)	MVB1155R6	6PK1155				
					→07/94, → Ch. R...	TB108	121x18				
					07/94→, Ch. S...→	TB463	121x18				
					→07/94, → Ch. R...	TBK016					
					07/94→, Ch. S...→	TBK086					
					A/C(-)	SVB12685	12x685				
					A/C(+)	SVB12760	12x760				
1.8 Syncro	ADZ	66	10/94 → 04/99		A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975				
					A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035				
					A/C(-), Manu Tensioner	MVB890R6	6PK890				
					A/C(+)	MVB1155R6	6PK1155				
					Ch. S...→	TB463	121x18				
					Ch. S...→	TBK086					
					A/C(-)	SVB12685	12x685				
					A/C(+)	SVB12760	12x760				
				1.9 D	1Y	48	07/93 → 04/99		A/C(-), Auto Tensioner	MVB925R6	6PK925
									A/C(-), Manu Tensioner	MVB1045R6	6PK1045
	A/C(+), Manu Tensioner	MVB1150R6	6PK1150								
		TB384	137x25.4								
	→07/94, → Eng Nr 1Y378364	TBK024									
	07/94→, Eng Nr 1Y378365→	TBK025									
	A/C(-)	SVB12735	12x735								
1.9 SDI	AEY	47	07/95 → 04/99		A/C(-)	MVB1045R6	6PK1045				
					A/C(+)	MVB1150R6	6PK1150				
						TB384	137x25.4				
						TBK026					
					A/C(-)	SVB12735	12x735				
1.9 TD	AAZ	55	07/93 → 04/99		A/C(-), Auto Tensioner	MVB925R6	6PK925				
					A/C(-), Manu Tensioner	MVB1045R6	6PK1045				
					A/C(+), Manu Tensioner	MVB1150R6	6PK1150				
		TB384	137x25.4								
	→07/94, → Eng Nr 552765	TBK024									
	07/94→, Eng Nr 552766→	TBK025									
	A/C(-)	SVB12735	12x735								
	A/C(+)	SVB11790	11x790								

VW



kW



...VW
...GOLF III Variant (1H5)

1.9 TDI	1Z, AHU, ALE	66	03/94 → 04/99	⊗	A/C(-)	MVB1045R6	6PK1045
				⊗	A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
					→07/94, → Eng Nr 1Z289575	TBK119	
					07/94→	TBK026	
				⊗	A/C(-)	SVB12735	12x735
				⊗	A/C(+)	SVB11790	11x790
	AFN	81	04/96 → 04/99	⊗	A/C(-)	MVB1045R6	6PK1045
				⊗	A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
						TBK026	
				⊗	A/C(-)	SVB12735	12x735
				⊗	A/C(+)	SVB11790	11x790
1.9 TDI Syncro	1Z, AHU	66	07/95 → 04/99	⊗	Eng. 1Z, A/C(-)	MVB1045R6	6PK1045
				⊗	Eng. 1Z, A/C(+)	MVB1150R6	6PK1150
						TB384	137x25.4
					Eng Nr 1Z289576→	TBK026	
				⊗	Eng. 1Z, A/C(-)	SVB12735	12x735
				⊗	Eng. 1Z, A/C(+)	SVB11790	11x790
2.0	2E, ADY, AGG, AKR	85	07/93 → 04/99	⊗	A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner	MVB890R6	6PK890
				⊗	A/C(+)	MVB1155R6	6PK1155
						TB506	124x18
						TBK076	
				⊗	A/C(-)	SVB12685	12x685
				⊗	A/C(+)	SVB12760	12x760
2.0 Syncro	AGG	85	08/95 → 04/99	⊗	A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner	MVB890R6	6PK890
				⊗	A/C(+)	MVB1155R6	6PK1155
						TB506	124x18
						TBK076	
				⊗	A/C(-)	SVB12685	12x685
				⊗	A/C(+)	SVB12760	12x760
2.9 VR6	ABV	140	10/94 → 04/99	⊗	A/C(-), 05/96→	MVB1285R7	7PK1285
				⊗	A/C(+), 05/96→	MVB1360R7D	7DPK1360
2.9 VR6 Syncro	ABV	140	10/94 → 04/99	⊗	A/C(-), 05/96→	MVB1285R7	7PK1285
				⊗	A/C(+), 05/96→	MVB1360R7D	7DPK1360

GOLF IV (1J1)

1.4 16V	AHW, AKQ, APE, AXP, BCA	55	08/97 → 06/05	⊗	Eng. BCA, A/C(-), →09/03	MVB1080R6	6PK1080
				⊗	Eng. BCA, A/C(+), →09/03	MVB1550R6	6PK1550
					→09/03	TB634	58x17
					→09/03	TB658	130x20
					→09/03,	TBK263	
					→ Eng Nr AKQ242000/AHW160000	TBK246	
					Eng. BCA, →09/03	TBK246	
1.6	AEH, AKL, APF	74	08/97 → 02/00	⊗	A/C(-)	MVB1125R6	6PK1125
				⊗	A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
	AVU, BFQ, BJH	75	08/00 → 06/05	⊗	Eng. BFQ, A/C(-), →10/03	MVB1125R6	6PK1125
				⊗	Eng. BFQ, A/C(+), →10/03	MVB1200R6D	6DPK1200
					→10/03	TB552	138x23
					→10/03	TBK100	



kW



...VW

...GOLF IV (1J1)

1.6 16V	ATN, AUS, AZD, BCB	77	02/00 → 06/05	⊗	A/C(-), →09/03	MVB1080R6	6PK1080
				⊗	A/C(+), →09/03	MVB1550R6	6PK1550
					→09/03	TB634	58x17
					→09/03	TB658	130x20
1.6 FSI	BAD	81	01/02 → 06/05	⊗	A/C(-), →09/03	MVB1080R6	6PK1080
				⊗	A/C(+), →09/03	MVB1538R6	6PK1538
					→09/03	TB634	58x17
					→09/03	TB658	130x20
1.8	AGN, BAF	92	08/97 → 06/05	⊗	A/C(-), →09/03	MVB1125R6	6PK1125
				⊗	A/C(+), →09/03	MVB1200R6D	6DPK1200
					→09/03, → Ch. 1J-Y-850000	TB554	150x23
					→09/03, Ch. 1J-Y-850001→	TBK101	
1.8 4motion	AGN	92	05/98 → 06/05	⊗	A/C(-), →09/03	MVB1125R6	6PK1125
				⊗	A/C(+), →09/03	MVB1200R6D	6DPK1200
					→09/03, → Ch. 1J-Y-850000	TB554	150x23
					→09/03, Ch. 1J-Y-850001→	TBK101	
1.8 T	AGU, ARZ, AUM	110	08/97 → 06/05	⊗	A/C(-), →09/03	MVB1125R6	6PK1125
				⊗	A/C(+), →09/03	MVB1200R6D	6DPK1200
					→09/03, → Ch. 1J-Y-850000	TB554	150x23
					→09/03, Ch. 1J-Y-850001→	TBK101	
1.8 T GTI	AUQ	132	08/01 → 06/05	⊗	A/C(-), →09/03	MVB1125R6	6PK1125
				⊗	A/C(+), →09/03	MVB1200R6D	6DPK1200
					→09/03, → Ch. 1J-Y-850000	TB554	150x23
					→09/03, Ch. 1J-Y-850001→	TBK101	
1.9 SDI	AGP, AQM	50	08/97 → 06/05	⊗	Eng. AQM, A/C(-), →09/03	MVB906R6	6PK906
				⊗	Eng. AQM, A/C(+), →09/03	MVB1660R6	6PK1660
					Eng. AQM, →09/03, → Eng Nr 045000	TB533	141x25
					Eng. AQM, →09/03, Eng Nr 045001→	TB659	141x26
					11/98→09/03, Eng Nr 030001→045000	TBK107	
					Eng. AQM, →09/03, → Eng Nr 030000	TBK116	
					Eng. AQM, →09/03, Eng Nr 045001→	TBK272	
1.9 TDI	AGR, ALH	66	10/97 → 05/04	⊗	A/C(-), →09/03	MVB906R6	6PK906
				⊗	A/C(-), →09/99	MVB1045R6	6PK1045
				⊗	A/C(+), →09/03	MVB1660R6	6PK1660
				⊗	A/C(+), →09/99	MVB1150R6	6PK1150
					→09/03, → Eng Nr 500000	TB533	141x25
					→09/03, Eng Nr 500001→	TB659	141x26
					→09/99	TB384	137x25.4
					→09/03, Eng Nr 500001→	TBK272	
	→09/99	TBK026					
	MAN, →09/03, → Eng Nr 500000	TBK107					
	⊗	A/C(-), →09/99	SVB12735	12x735			
	⊗	A/C(+), →09/99	SVB11790	11x790			

VW



kw



...VW

...GOLF IV (1J1)

Engine	Power (kw)	Year Range	Accessories	Eng. Description	Part Numbers	Dimensions
...1.9 TDI	AHF, ASV	81	08/97 → 05/04	Eng. ASV, A/C(-), →09/03	MVB906R6	6PK906
				Eng. ASV, A/C(+), →09/03	MVB1660R6	6PK1660
				Eng. ASV, →09/03, → Eng Nr 150000	TB533	141x25
				Eng. ASV, →09/03, Eng Nr 150001→	TB659	141x26
				Eng. ASV, →09/03, → Eng Nr 150000	TBK107	
...	KTT	KTT	Eng. ASV, →09/03, → Eng Nr 150000	TBK272		
			Eng. ASV, →09/03, Eng Nr 150001→			
AJM, AUY	85	12/98 → 06/01	Eng. AJM, A/C(-), 05/99→	MVB1432R5	5PK1432	
			Eng. AJM, A/C(+), 05/99→	MVB1200R6D	6DPK1200	
			Eng. AJM, 05/99→, Eng Nr 185671→	TB680	120x30	
			Eng. AJM, 05/99→, Eng Nr 185671→, VD(+)	TBK225		
...	KTT	KTT		TBK269		
ATD, AXR	74	09/00 → 06/05	Eng. AXR, A/C(-), 06/01→09/03	MVB1125R6	6PK1125	
			Eng. AXR, A/C(+), 06/01→09/03	MVB1200R6D	6DPK1200	
			06/01→09/03	TB680	120x30	
			06/01→09/03, Eng Nr 010001→	TBK270		
ARL	110	05/00 → 06/05	A/C(-), 09/00→09/03	MVB1125R6	6PK1125	
			A/C(+), 09/00→09/03	MVB1200R6D	6DPK1200	
			09/00→09/03	TB680	120x30	
			02/02→09/03	TBK270		
			09/00→02/02	TBK225		
...	KTT	KTT	09/00→02/02, VD(+)	TBK269		
ASZ	96	11/00 → 06/05	A/C(-), →09/03	MVB1125R6	6PK1125	
			A/C(+), →09/03	MVB1200R6D	6DPK1200	
			→09/03	TB680	120x30	
			→02/02	TBK225		
...	KTT	KTT	→02/02, VD(+)	TBK269		
...	KTT	KTT	02/02→09/03	TBK270		
1.9 TDI 4motion	AGR, ALH	66	07/98 → 04/02	A/C(-)	MVB906R6	6PK906
				A/C(+)	MVB1660R6	6PK1660
				→ Eng Nr 500000	TB533	141x25
				Eng Nr 500001→	TB659	141x26
				Eng Nr 500001→ MAN, → Eng Nr 500000	TBK272	
...	KTT	KTT		TBK107		
AJM, AUY	85	09/99 → 06/01	A/C(-)	MVB1432R5	5PK1432	
			A/C(+)	MVB1200R6D	6DPK1200	
				TB680	120x30	
				TBK225		
...	KTT	KTT	VD(+)	TBK269		
ATD	74	09/00 → 06/05	A/C(-), →09/03	MVB1432R5	5PK1432	
			A/C(+), →09/03	MVB1200R6D	6DPK1200	
			→09/03	TB680	120x30	
			→02/02	TBK225		
			→02/02, VD(+)	TBK269		
...	KTT	KTT	02/02→09/03	TBK270		
ARL	110	02/00 → 06/05	A/C(-), 09/00→09/03	MVB1125R6	6PK1125	
			A/C(+), 09/00→09/03	MVB1200R6D	6DPK1200	
			09/00→09/03	TB680	120x30	
			02/02→09/03	TBK270		
			09/00→02/02	TBK225		
...	KTT	KTT	09/00→02/02, VD(+)	TBK269		
ASZ	96	11/00 → 06/05	A/C(-), →09/03	MVB1125R6	6PK1125	
			A/C(+), →09/03	MVB1200R6D	6DPK1200	
			→09/03	TB680	120x30	
			→02/02	TBK225		
			→02/02, VD(+)	TBK269		
...	KTT	KTT	02/02→09/03	TBK270		





kW



...VW

...GOLF IV (1J1)

2.0	APK, AQY, AZG, AZJ	85	07/98 → 06/05		A/C(-), 11/98 → 09/03	MVB1125R6	6PK1125
					A/C(+), 11/98 → 09/03	MVB1200R6D	6DPK1200
					11/98 → 09/03	TB552	138x23
					11/98 → 09/03	TBK100	
2.0 4motion	AZH, AZJ	85	10/00 → 06/05		A/C(-), → 09/03	MVB1125R6	6PK1125
					A/C(+), → 09/03	MVB1200R6D	6DPK1200
					→ 09/03	TB552	138x23
					→ 09/03	TBK100	
2.3 V5	AQN	125	10/00 → 06/05		A/C(-), → 09/03	MVB1260R6	6PK1260
2.3 V5 4motion	AQN	125	10/00 → 06/05		A/C(-), → 09/03	MVB1260R6	6PK1260
2.8 V6 4motion	AQP, AUE, BDE	150	03/99 → 06/05		Eng. BDE, A/C(-), → 09/03	MVB1260R6	6PK1260
3.2 R32 4motion	BFH, BML	177	09/02 → 06/05		Eng. BFH, A/C(-), → 09/03	MVB1260R6	6PK1260

GOLF IV Cabriolet (1E7)

1.6	AFT, AKS	74	06/98 → 06/02		A/C(-), Auto Tensioner, → 09/00	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner, → 09/00	MVB890R6	6PK890
					A/C(+), → 09/00	MVB1155R6	6PK1155
					→ 09/00	TB463	121x18
					→ 09/00	TBK086	
					A/C(-), → 09/00	SVB12685	12x685
					A/C(+), → 09/00	SVB12760	12x760
1.8	AAM, ANN	55	06/98 → 06/02		A/C(-), Auto Tensioner, → 09/00	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner, → 09/00	MVB890R6	6PK890
					A/C(+), → 09/00	MVB1155R6	6PK1155
					→ 09/00, Ch. S... →	TB463	121x18
					→ 09/00, Ch. S... →	TBK086	
					A/C(-), → 09/00	SVB12685	12x685
					A/C(+), → 09/00	SVB12760	12x760
	ADZ, ANP	66	06/98 → 06/02		A/C(-), Auto Tensioner, → 09/00	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner, → 09/00	MVB890R6	6PK890
					A/C(+), → 09/00	MVB1155R6	6PK1155
					→ 09/00, Ch. S... →	TB463	121x18
					→ 09/00, Ch. S... →	TBK086	
					A/C(-), → 09/00	SVB12685	12x685
					A/C(+), → 09/00	SVB12760	12x760
1.9 TDI	AHU, ALE	66	06/98 → 06/02		A/C(-), Auto Tensioner, → 12/01	MVB1045R6	6PK1045
					A/C(-), Manu Tensioner, → 12/01	MVB925R6	6PK925
					A/C(+), → 12/01	MVB1150R6	6PK1150
					→ 12/01	TB384	137x25.4
					→ 12/01	TBK026	
					A/C(-), → 12/01	SVB12735	12x735
					A/C(+), → 12/01	SVB11790	11x790
	AFN, AVG	81	06/98 → 06/02		A/C(-), Auto Tensioner, → 12/01	MVB1045R6	6PK1045
					A/C(-), Manu Tensioner, → 12/01	MVB925R6	6PK925
					A/C(+), → 12/01	MVB1150R6	6PK1150
					→ 12/01	TB384	137x25.4
					→ 12/01	TBK026	
					A/C(-), → 12/01	SVB12735	12x735
					A/C(+), → 12/01	SVB11790	11x790



kW



...VW

...GOLF IV Cabriolet (1E7)

2.0	AGG, AKR, ATU, AWF, AWG	85	06/98 → 06/02		A/C(-), Auto Tensioner, →07/01	MVB1035R6	6PK1035
					A/C(-), Manu Tensioner, →07/01	MVB890R6	6PK890
					A/C(+), →07/01	MVB1155R6	6PK1155
					04/99 →07/01	TB506	124x18
					→09/00	TBK076	
					A/C(-), →07/01	SVB12685	12x685
					A/C(+), →07/01	SVB12760	12x760

GOLF IV Variant (1J5)

1.4 16V	AHW, AKQ, APE, AXP, BCA	55	05/99 →		Eng. BCA, A/C(-)	MVB1080R6	6PK1080
					Eng. BCA, A/C(+)	MVB1550R6	6PK1550
						TB634	58x17
						TB658	130x20
						TBK246	
					→08/00, → Eng Nr 160000	TBK263	
1.6	AEH, AKL, APF	74	05/99 → 02/00		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
	AVU	75	08/00 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
1.6 16V	ATN, AUS, AZD, BCB	77	02/00 →		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1550R6	6PK1550
						TB634	58x17
						TB658	130x20
						TBK246	
1.6 FSI	BAD	81	01/02 →		A/C(-)	MVB1080R6	6PK1080
					A/C(+)	MVB1538R6	6PK1538
						TB634	58x17
						TB658	130x20
						TBK246	
1.8 4motion	AGN	92	05/99 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
					→ Ch. 1J-Y-850000	TBK101	
					Ch. 1J-Y-850001→	TBK115	
1.8 T	AGU, AUM	110	05/00 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
					→ Ch. 1J-Y-850000	TBK101	
					Ch. 1J-Y-850001→	TBK115	
1.9 SDI	AGP, AQM	50	05/99 →		Eng. AQM, A/C(-)	MVB906R6	6PK906
					Eng. AQM, A/C(+)	MVB1660R6	6PK1660
					Eng. AQM, → Eng Nr 045000	TB533	141x25
					Eng. AQM, Eng Nr 045001→	TB659	141x26
					→ Eng Nr 030000	TBK116	
					Eng. AQM,	TBK107	
					Eng Nr 030001→045000		
					Eng. AQM, Eng Nr 045001→	TBK272	



kW



...VW

...GOLF IV Variant (1J5)

1.9 TDI	AGR, ALH	66	05/99 → 05/06		A/C(-)	MVB906R6	6PK906	
					A/C(+)	MVB1660R6	6PK1660	
					→ Eng Nr 500000	TB533	141x25	
					Eng Nr 500001→	TB659	141x26	
					Eng Nr 500001→	TBK272		
	AHF, ASV	81	05/99 → 06/01		MAN, → Eng Nr 500000	TBK107		
					Eng. ASV, A/C(-)	MVB906R6	6PK906	
					Eng. ASV, A/C(+)	MVB1660R6	6PK1660	
					Eng. ASV, → Eng Nr 150000	TB533	141x25	
					Eng. ASV, Eng Nr 150001→	TB659	141x26	
AJM, AUY	85	08/99 → 06/01		Eng. ASV, → Eng Nr 150000	TBK107			
				Eng. ASV, Eng Nr 150001→	TBK272			
				Eng. AJM, A/C(-)	MVB1432R5	5PK1432		
				Eng. AJM, A/C(+)	MVB1200R6D	6DPK1200		
					TB680	120x30		
ATD, AXR	74	09/00 →		Eng. AJM, Eng Nr 185670→	TBK225			
				Eng. AJM, Eng Nr 185670→, VD(+)	TBK269			
				A/C(-), 05/01→	MVB1125R6	6PK1125		
				Eng. ATD, A/C(-)	MVB1432R5	5PK1432		
				Eng. AXR, A/C(+)	MVB1200R6D	6DPK1200		
ASZ	96	11/00 →			TB680	120x30		
				05/01→	TBK270			
				Eng. ATD, →02/02	TBK225			
				Eng. ATD, →02/02, VD(+)	TBK269			
1.9 TDI 4motion	AGR, ALH	66	05/99 → 04/02		A/C(-)	MVB906R6	6PK906	
					A/C(+)	MVB1660R6	6PK1660	
					→ Eng Nr 500000	TB533	141x25	
					Eng Nr 500001→	TB659	141x26	
					Eng Nr 500001→	TBK272		
	AJM	85	05/99 → 06/01		MAN, → Eng Nr 500000	TBK107		
					A/C(-)	MVB1432R5	5PK1432	
					A/C(+)	MVB1200R6D	6DPK1200	
						TB680	120x30	
						TBK225		
ATD	74	09/00 →		VD(+)	TBK269			
				A/C(-)	MVB1432R5	5PK1432		
				A/C(+)	MVB1200R6D	6DPK1200		
				→02/02	TB680	120x30		
				→02/02, VD(+)	TBK225			
ASZ	96	11/00 →		02/02→	TBK269			
				02/02→	TBK270			
				06/01→02/02	TBK225			
				06/01→02/02, VD(+)	TBK269			
2.0	APK, AQY, AZJ	85	05/99 →		A/C(-)	MVB1125R6	6PK1125	
					A/C(+)	MVB1200R6D	6DPK1200	
						TB552	138x23	
						TBK100		
2.0 4motion	AZH, AZJ	85	10/00 →		A/C(-)	MVB1125R6	6PK1125	
					A/C(+)	MVB1200R6D	6DPK1200	
						TB552	138x23	
						TBK100		



kW



...VW

...GOLF IV Variant (1J5)

2.0 Bi-Fuel	BEH	85	02/02 →		A/C(-), →05/03	MVB1125R6	6PK1125
					A/C(+), →05/03	MVB1200R6D	6DPK1200
					→05/03	TB552	138x23
					→05/03	TBK100	
2.3 V5	AQN	125	10/00 →		A/C(-)	MVB1260R6	6PK1260
2.3 V5 4motion	AQN	125	10/00 →		A/C(-)	MVB1260R6	6PK1260
2.8 V6 4motion	AQP, AUE, BDE	150	05/99 →		Eng. BDE, A/C(-)	MVB1260R6	6PK1260

GOLF V (1K1)

1.4 16V	BCA	55	10/03 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1100R6	6PK1100
						TB634	58x17
						TB658	130x20
						TBK246	
	BUD	59	05/06 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1100R6	6PK1100
						TB634	58x17
					→ Ch. 1K-6-250000	TB658	130x20
						TBK246	
1.4 FSI	BKG, BLN	66	10/03 →		Eng. BLN, A/C(-)	MVB1088R6	6PK1088
					Eng. BLN, A/C(+)	MVB1740R6	6PK1740
1.4 TSI	BLG	125	11/05 →		A/C(-)	MVB1600R6	6PK1600
					A/C(+)	MVB1700R6	6PK1700
					A/C(-)	MVB1600R6	6PK1600
					A/C(+)	MVB1700R6	6PK1700
	BMY	103	05/06 →		A/C(-)	MVB1600R6	6PK1600
					A/C(+)	MVB1700R6	6PK1700
	CAXA	90	05/07 →		A/C(-)	MVB1088R6	6PK1088
					A/C(+)	MVB1740R6	6PK1740
1.6	BGU, BSE, BSF	75	01/04 →		A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
						TBK100	
1.6 FSI	BAG, BLF, BLP	85	10/03 →		Eng. BLF, A/C(-)	MVB1088R6	6PK1088
					Eng. BLF, A/C(+)	MVB1740R6	6PK1740
1.9 TDI	BKC, BLS, BXE	77	10/03 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
	BRU, BXF, BXJ	66	05/04 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
1.9 TDI 4motion	BKC, BLS, BXE	77	08/04 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0 FSI	AXW, BLR, BLX, BLY, BVX, BVY, BVZ	110	01/04 →		A/C(-), →07/04	MVB890R6	6PK890
					A/C(-), 05/04→	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
					→07/04	TB745	145x23
					05/04→	TB753	148x23
2.0 FSI 4motion	BLX, BVX	110	08/04 →		A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
						TB753	148x23
2.0 GTD	BMN	125	11/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
					A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
2.0 GTI	AXX, BPY, BWA	147	10/04 →		A/C(-), →11/05	MVB955R6	6PK955
					A/C(-), 11/05→	MVB900R6	6PK900
					A/C(+)	MVB1050R6	6PK1050
						TB753	148x23
	BYD	169	09/06 →		A/C(-)	MVB955R6	6PK955
					A/C(+)	MVB1050R6	6PK1050
						TB753	148x23



kW



...VW

...GOLF V (1K1)

2.0 SDI	BDK	55	01/04 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0 TDI	AZV	100	10/03 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
						TBK262	
					→05/06, → Ch. 1K-6-250000		
	BMM	103	12/04 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0 TDI 4motion	BMM	103	08/04 →		A/C(-), 12/04→	MVB946R6	6PK946
					A/C(+), 12/04→	MVB1050R6	6PK1050
					12/04→	TB680	120x30
					12/04→	TBK270	
2.0 TDI 16V	BKD	103	10/03 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
						TBK262	
					→05/06, → Ch. 1K-6-250000		
2.0 TDI 16V 4motion	BKD	103	08/04 →		A/C(-), 12/04→	MVB946R6	6PK946
					A/C(+), 12/04→	MVB1050R6	6PK1050
					12/04→	TB680	120x30
					12/04→	TBK270	
3.2 R32 4motion	BUB, CBR	184	11/05 →		Eng. BUB, A/C(-)	MVB1238R6	6PK1238
					Eng. BUB, A/C(+)	MVB1625R6	6PK1625

GOLF V PLUS (5M1)

1.4 16V	BCA	55	01/05 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1100R6	6PK1100
						TB634	58x17
						TB658	130x20
						TBK246	
					→ Ch. 1K-6-650000		
					→ Ch. 1K-6-650000		
	BUD, CGGA	59	01/05 →		Eng. BUD, A/C(-), 05/06→	MVB736R6	6PK736
					Eng. BUD, A/C(+), 05/06→	MVB1100R6	6PK1100
					05/06→	TB634	58x17
					05/06→, → Ch. 1K-6-650000	TB658	130x20
					05/06→, → Ch. 1K-6-650000	TBK246	
1.4 FSI	BLN	66	07/05 → 05/06		A/C(-)	MVB1088R6	6PK1088
					A/C(+)	MVB1740R6	6PK1740
1.4 TSI	BMY	103	05/06 →		A/C(-)	MVB1600R6	6PK1600
					A/C(+)	MVB1700R6	6PK1700
	BLG	125	05/06 →		A/C(-)	MVB1600R6	6PK1600
					A/C(+)	MVB1700R6	6PK1700
	CAXA	90	06/07 →		A/C(-)	MVB1088R6	6PK1088
					A/C(+)	MVB1740R6	6PK1740
1.6	BSE, BSF, CCSA	75	05/05 →		Eng. CCSA, A/C(-)	MVB900R6	6PK900
					Eng. CCSA, A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
						TBK100	
1.6 FSI	BLF	85	01/05 →		A/C(-)	MVB1088R6	6PK1088
					A/C(+)	MVB1740R6	6PK1740
1.9 TDI	BKC, BLS, BXE	77	01/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
	BRU, BXF, BXJ	66	05/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0 FSI	BLR, BLY, BVY, BVZ	110	05/05 →		A/C(-), →05/08	MVB900R6	6PK900
					A/C(+), →05/08	MVB1045R6	6PK1045
					→05/08	TB753	148x23



kw



...VW
...GOLF V PLUS (5M1)

2.0 TDI	AZV	100	05/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
	BMM	103	12/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
					→05/06, → Ch. 1K-6-650000	TBK262	
2.0 TDI 16V	BKD	103	01/05 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
					→05/06, → Ch. 1K-6-650000	TBK262	

GOLF V Variant

1.4	BUD	59	06/07 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1100R6	6PK1100
						TB634	58x17
						TB658	130x20
					→ Ch. 1K-6-250000	TBK246	
1.4 TSI	BMY	103	06/07 →		A/C(-)	MVB1600R6	6PK1600
					A/C(+)	MVB1700R6	6PK1700
	CAXA	90	06/07 →		A/C(-)	MVB1088R6	6PK1088
					A/C(+)	MVB1740R6	6PK1740
BLG	125	06/07 →		A/C(-)	MVB1600R6	6PK1600	
				A/C(+)	MVB1700R6	6PK1700	
1.6	BSE, BSF	75	06/07 →		A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
						TBK100	
1.9 TDI	BKC, BLS, BXE	77	06/07 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
1.9 TDI 4motion	BLS	77	01/08 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB680	120x30
						TBK270	
2.0	BWA	147	06/07 →		A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1050R6	6PK1050
						TB753	148x23
						TBK270	
2.0 TDI	BMM	103	06/07 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
	AZV	100	06/07 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
2.0 TDI 16V	BKD	103	06/07 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30

ILTIS (183)

1.6 TD	1C	51	08/87 → 12/88			SVB10960	10x960
						TB225	135x25.4
						TBK018	
1.7	WL, YX	55	03/79 → 12/88			SVB10950	10x950
						TB108	121x18
						TBK016	



kW



...VW

JETTA I (16)

1.1	FA, GG	37	08/78 → 02/84		08/79 → 09/81	SVB10690	10x690
					09/81 → 07/83	SVB10700	10x700
					08/79 → 07/83	TB107	108x19
1.3	GF	44	08/79 → 02/84		→ 07/83, → Ch. 16A0279403	SVB10700	10x700
					→ 07/83, Ch. 16A0279404 →	SVB10690	10x690
					→ 07/83	TB107	108x19
	GS	43	08/82 → 02/84		→ 07/83, → Ch. 16A0279403	SVB10700	10x700
					→ 07/83, Ch. 16A0279404 →	SVB10690	10x690
					→ 07/83	TB107	108x19
1.5	JB	51	08/78 → 02/84		08/79 → 07/83	SVB131025	13x1025
					A/C(-), 08/79 → 08/81	SVB10950	10x950
					A/C(-), 08/81 → 07/83	SVB10940	10x940
					A/C(+), 08/79 → 07/83	SVB10850	10x850
					08/79 → 07/83	TB108	121x18
					08/79 → 07/83	TBK016	
1.5 D	CK	37	08/78 → 07/80		08/79 →	SVB13950	13x950
					08/79 →	SVB10875	10x875
					08/79 →	TB225	135x25.4
					08/79 →	TBK018	
1.6	FR	63	08/78 → 02/84		08/79 → 07/83	SVB131025	13x1025
					A/C(-), 08/79 → 08/81	SVB10950	10x950
					A/C(-), 08/81 → 07/83	SVB10940	10x940
					A/C(+), 08/79 → 07/83	SVB10850	10x850
					08/79 → 07/83	TB108	121x18
					08/79 → 07/83	TBK016	
		55	08/82 → 07/83			SVB131025	13x1025
					A/C(+)	SVB10850	10x850
						TB108	121x18
						TBK016	
1.6 D	CR, JK	40	08/80 → 02/84		→ 07/83	SVB13950	13x950
					A/C(-), → 07/83	SVB10875	10x875
					→ 07/83	TB225	135x25.4
					→ 07/83	TBK018	
1.6 GLI	EG	81	08/78 → 07/82		→ 07/83	SVB10740	10x740
					08/79 →	SVB13950	13x950
					08/79 → 07/80	SVB10950	10x950
					08/80 →	SVB10940	10x940
1.6 TD	CY	51	03/82 → 02/84		08/79 →	TB108	121x18
					08/79 →	TBK016	
					08/79 →	SVB10735	10x735
					08/79 →	SVB13950	13x950
1.6 TD	CY	51	03/82 → 02/84		→ 07/83	SVB10875	10x875
					A/C(-), → 07/83	SVB10875	10x875
					→ 07/83	TB225	135x25.4
					→ 07/83	TBK018	
1.8	DX, JJ	82	08/82 → 02/84		→ 07/83	SVB10740	10x740
					→ 07/83	SVB13950	13x950
					→ 07/83	SVB10940	10x940
					→ 07/83	TB108	121x18
					→ 07/83	TBK016	
					→ 07/83	SVB10735	10x735

JETTA II (19E, 1G2)

1.3	HK, MH	40	01/84 → 06/87		→ Ch. LB-300000,LW-990000	SVB10690	10x690
					Ch. MB-000001,MW-00001 →	SVB12710	12x710
					→ Eng Nr NZ-200000	TB107	108x19
	GT	44	01/84 → 10/86		→ Ch. LB-300000,LW-990000	SVB10690	10x690
					Ch. MB-000001,MW-00001 →	SVB12710	12x710
						TB107	108x19



kW



...VW

...JETTA II (19E, 1G2)

VW

1.3 CAT	2G, MH, NZ	40	06/87 → 12/91	⊗	Eng. 2G, →07/91, → Ch. 1G-M-368060	SVB10690	10x690
				⊗	Eng. 2G, →07/91, Ch. 1G-M-368061→	SVB12710	12x710
				⊗ ⊗	→12/90, → Eng Nr 2G 262739 10/90→07/91, Eng Nr NZ-200001→	TB107 TB283	108x19 128x19
1.6	PN	51	10/86 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10625	10x625
				⊗ ⊗		TB108	121x18
				⊗ ⊗ ⊗		TBK016 SVB10735	 10x735
	RF	53	03/86 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB10865	10x865
				⊗	A/C(+)	SVB10625	10x625
				⊗ ⊗		TB108	121x18
				⊗ ⊗ ⊗		TBK016 SVB10735	 10x735
ABN, EZ, HM	55	01/84 → 07/92	⊗	→07/91	SVB13950	13x950	
			⊗	Eng. ABN	SVB10625	10x625	
			⊗	07/85→	SVB10950	10x950	
			⊗	A/C(-), MS, →07/85	SVB10940	10x940	
			⊗ ⊗		TB108	121x18	
			⊗ ⊗ ⊗		TBK016 SVB10735 SVB10865	 10x735 10x865	
1.6 D	JP, ME	40	01/84 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-)	SVB12950	12x950
				⊗	A/C(+), → Ch. F-350000	SVB10690	10x690
				⊗	A/C(+), Ch. F-350001→	SVB10700	10x700
				⊗ ⊗		TB225	135x25.4
				⊗ ⊗ ⊗		TBK018 SVB10740	 10x740
1.6 TD	JR, MF	51	01/84 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-)	SVB12950	12x950
				⊗	A/C(+), → Ch. F-350000	SVB10690	10x690
				⊗	A/C(+), Ch. F-350001→	SVB10700	10x700
				⊗ ⊗		TB225	135x25.4
				⊗ ⊗ ⊗		TBK018 SVB10740	 10x740
	RA, SB	59	04/89 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-)	SVB12950	12x950
				⊗	A/C(+), → Ch. F-350000	SVB10690	10x690
				⊗	A/C(+), Ch. F-350001→	SVB10700	10x700
				⊗ ⊗		TB225	135x25.4
				⊗ ⊗ ⊗		TBK018 SVB10740	 10x740
	1V	44	01/90 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-)	SVB12950	12x950
				⊗	A/C(+), → Ch. F-350000	SVB10690	10x690
				⊗	A/C(+), Ch. F-350001→	SVB10700	10x700
				⊗ ⊗		TB225	135x25.4
				⊗ ⊗ ⊗		TBK018 SVB10740	 10x740



kW



...VW

...JETTA II (19E, 1G2)

1.8	RH	62	08/86 → 01/90	⊗	04/87 →	SVB13950	13x950			
				⊗	A/C(-), MS, 04/87 →	SVB10950	10x950			
				⊗	PS, 04/87 →	SVB12865	12x865			
					04/87 →	TB108	121x18			
				KIT	04/87 →	TBK016				
				⊗	04/87 →	SVB10735	10x735			
				EV, GZ, PB	82	01/84 → 10/91	⊗		SVB13950	13x950
				⊗	A/C(-), MS, →07/85	SVB10940	10x940			
				⊗	A/C(-), MS, 07/85 →	SVB10950	10x950			
				⊗	A/C(-), PS	SVB10865	10x865			
⊗	A/C(+)	SVB10625	10x625							
		TB108	121x18							
KIT		TBK016								
⊗		SVB10735	10x735							
RD	79	08/85 → 10/87	⊗		SVB13950	13x950				
⊗	A/C(-), MS	SVB10950	10x950							
⊗	A/C(-), PS	SVB10865	10x865							
⊗	A/C(+)	SVB10625	10x625							
		TB108	121x18							
KIT		TBK016								
⊗		SVB10735	10x735							
GU, GX, HV	66	08/84 → 10/91	⊗		SVB13950	13x950				
⊗	A/C(-), MS, →07/85	SVB10940	10x940							
⊗	A/C(-), MS, 07/85 →	SVB10950	10x950							
⊗	A/C(-), PS	SVB10865	10x865							
⊗	A/C(+)	SVB10625	10x625							
		TB108	121x18							
KIT		TBK016								
⊗		SVB10735	10x735							
1.8 CAT	GX, RP	66	08/87 → 10/91	⊗		SVB13950	13x950			
⊗	A/C(-), MS	SVB10950	10x950							
⊗	A/C(-), PS	SVB10865	10x865							
⊗	A/C(+)	SVB10625	10x625							
		TB108	121x18							
KIT		TBK016								
⊗		SVB10735	10x735							
PF	79	01/87 → 10/91	⊗		SVB13950	13x950				
⊗	A/C(-), MS	SVB10950	10x950							
⊗	A/C(-), PS	SVB10865	10x865							
⊗	A/C(+)	SVB10625	10x625							
⊗	PS	SVB12865	12x865							
		TB108	121x18							
KIT		TBK016								
⊗		SVB10735	10x735							
1.8 Syncro	1P	72	08/88 → 07/91	⊗		SVB13950	13x950			
⊗	A/C(-), MS	SVB10950	10x950							
⊗	A/C(-), PS	SVB10865	10x865							
⊗	A/C(+)	SVB10625	10x625							
		TB108	121x18							
KIT		TBK016								
⊗		SVB10735	10x735							
RP	66	08/87 → 12/88	⊗		SVB13950	13x950				
⊗	A/C(-), MS	SVB10950	10x950							
⊗	A/C(-), PS	SVB10865	10x865							
⊗	A/C(+)	SVB10625	10x625							
		TB108	121x18							
KIT		TBK016								
⊗		SVB10735	10x735							

VW



kW



...VW

...JETTA II (19E, 1G2)

1.8 16V	PL	95	08/86 → 10/91	☼		SVB13950	13x950			
				⊖	A/C(-), MS, →08/87	SVB10940	10x940			
				⊖	A/C(-), MS, 08/87→	SVB10950	10x950			
				⊖	A/C(-), PS	SVB10865	10x865			
				⊖	A/C(+)	SVB10635	10x635			
				⌘		TB505	147x25.4			
				⌘		TBK066				
				⊕		SVB10735	10x735			
				KR	102	06/87 → 12/89	☼		SVB13950	13x950
							⊖	A/C(-), MS	SVB10950	10x950
							⊖	A/C(-), MS, →08/87	SVB10940	10x940
							⊖	A/C(-), PS	SVB10865	10x865
							⊖	A/C(+)	SVB10635	10x635
							⌘		TB505	147x25.4
⌘		TBK066								
⊕		SVB10735	10x735							

JETTA III (1K2)

1.4 TSI	BMY	103	07/06 →	⊖	A/C(+)	MVB1700R6	6PK1700
				⊖	A/C(+)	MVB1700R6	6PK1700
				⊖	A/C(-)	MVB1088R6	6PK1088
				⊖	A/C(+)	MVB1740R6	6PK1740
1.6	BSE, BSF, CCSA	75	10/05 →	⊖		MVB1045R6	6PK1045
				⌘		TB552	138x23
				⌘		TBK100	
1.6 FSI	BLF	85	09/05 →	⊖		MVB1740R6	6PK1740
1.9 TDI	BKC, BLS, BXE	77	09/05 →	⊖		MVB1050R6	6PK1050
				⌘		TB680	120x30
				⌘		TBK270	
2.0 FSI	BLR, BLY, BVY, BVZ	110	08/05 →	⊖		MVB1045R6	6PK1045
2.0 TDI	AZV	100	09/05 →	⊖		TB753	148x23
				⌘		MVB1050R6	6PK1050
2.0 TDI	BMM	103	10/05 →	⊖		TB743	141x30
				⌘		TBK262	
				⊖		MVB1050R6	6PK1050
				⌘		TB680	120x30
2.0 TDI 16V	BKN	125	10/06 →	⌘		TBK270	
				⊖		MVB1050R6	6PK1050
2.0 TFSI	BPY, BWA, CCTA	147	10/05 →	⊖		TB743	141x30
				⊖		MVB1050R6	6PK1050
				⊖	Eng. BWA	MVB1045R6	6PK1045
2.5 FSI	BGP, BTK	110	01/06 →	⊖		TB753	148x23
				⊖	A/C(-)	MVB925R5	5PK925
				⊖	A/C(+)	MVB1060R5	5PK1060

KAEFER

1.1 (Brezel)		18	04/49 → 12/53	⊖	Eng Nr 1.695282→	SVB10900	10x900
1.2 (42005)		22	01/54 → 07/65	⊖	Eng Nr 1.695282→	SVB10900	10x900
1200 1.2 (11)	D	25	01/60 → 12/85	⊖		SVB10900	10x900
1300 1.3	E	27	08/65 → 07/70	⊖		SVB10900	10x900
1300 1.3 (11)	F	29	01/65 → 07/70	⊖		SVB10900	10x900
	AB	32	01/70 → 01/73	⊖		SVB10900	10x900
1302 1.2 (11)	D	25	08/69 → 08/72	⊖	08/70→	SVB10900	10x900
				⊖	08/70→	SVB12915	12x915
1302 1.3	AC	29	08/70 → 07/75	⊖		SVB10900	10x900
				⊖	→07/74	SVB12915	12x915
1302 1.3 (11)	AB	32	08/70 → 08/72	⊖		SVB10900	10x900
				⊖		SVB12915	12x915
1302 1.6	AE, AH, AK	35	07/71 → 07/74	⊖		SVB10900	10x900



kW



...VW

...KAEFER

1302 1.6 (11)	AD	37	01/70 → 08/72	⊗	08/70 →	SVB10900	10x900
				⊗	08/70 →	SVB12915	12x915
1303 1.2 (13)	D	25	07/72 → 02/76	⊗		SVB12915	12x915
1303 1.3 (13)	AB, AR	32	08/72 → 07/75	⊗		SVB10900	10x900
				⊗		SVB12915	12x915
1303 1.6 (13)	AD	35	08/72 → 12/79	⊗		SVB12915	12x915
1303 LS,S 1.6 (13)	AD, AJ, AS	37	08/72 → 12/79	⊗		SVB10900	10x900
				⊗		SVB12915	12x915
1500 1.5 (11)	H	32	08/66 → 11/73	⊗	→07/70	SVB10900	10x900
1500 1.6	AD	37	07/70 → 01/73	⊗		SVB10900	10x900
1600 (Mexico)	AF	34	05/73 → 09/92	⊗		SVB10900	10x900
1600 i (Mexico)	ACD	34	10/92 → 07/03	⊗		SVB12915	12x915

KAEFER Convertible (15)

1302 1.3	AC	29	08/70 → 07/74	⊗		SVB12915	12x915
1302 1.6	AF	34	08/70 → 07/74	⊗		SVB12915	12x915
1302,1303 1.6	AD	37	07/70 → 06/79	⊗	→07/74	SVB12915	12x915
1303 1.2	D	25	04/75 → 12/79	⊗		SVB10900	10x900
				⊗		SVB12915	12x915
1303 1.3	AB	32	07/70 → 03/81	⊗	→07/79	SVB12915	12x915
				⊗	→12/75	SVB10900	10x900
1303 1.6	AE, AH, AK	35	08/70 → 07/74	⊗		SVB12915	12x915
1500 1.5	H	32	01/66 → 12/70	⊗	08/66 → 07/70	SVB10900	10x900
1500 1.6	B	35	07/69 → 07/70	⊗		SVB10900	10x900
Karmann 1.3	F	29	07/64 → 07/70	⊗		SVB10900	10x900

KARMANN GHIA Coupe (14, 34)

1300	AB	32	07/70 → 07/74	⊗		SVB10900	10x900
1500	H	32	01/66 → 12/69	⊗		SVB10900	10x900
		40	08/61 → 05/70	⊗		SVB10900	10x900
1600	AD	37	01/70 → 12/73	⊗		SVB10900	10x900
		35	07/71 → 07/74	⊗		SVB10900	10x900

LT 28-35 I Box (281-363)

2.0	CH	55	04/75 → 09/83	⊗	A/C(-), →11/82	SVB101010	10x1010
				⊗	A/C(+), →11/82	SVB10900	10x900
					→11/82	TB108	121x18
				KIT	→11/82	TBK016	
				⊕	→11/82	SVB10800	10x800
2.4	DL	66	12/82 → 07/92	⊗	→ Ch. 28-G-016821	SVB13875	13x875
				⊗	Ch. 28-G-016822 →	SVB10813	10x813
					→ Ch. 28E025000	TB603	112x19
					Ch. 28F000001 →	TB101	119x19
				⊕		SVB13800	13x800
				⊗	12/82 →	SVB13875	13x875
				⊗	→ Ch. 28-G-016821	SVB10813	10x813
2.4 D	CP, DW	55	01/79 → 07/92	⊗	12/82 →, Ch. 28-G-016822 →	SVB10800	10x800
						TB131	119x25.4
				KIT		TBK044	
						TB136	75x20
				⊕	12/82 →	SVB13800	13x800
				⊗	→11/82	SVB101025	10x1025
				⊗	→07/94	SVB13875	13x875
				⊗	→07/94, → Ch. 28-G-016821	SVB10813	10x813
				⊗	→07/94, Ch. 28-G-016822 →	SVB10800	10x800
					→07/94	TB131	119x25.4
KIT	→07/94	TBK044					
	→07/94	TB136	75x20				
⊕	→07/94	SVB13800	13x800				



kw



...VW

...LT 28-35 I Box (281-363)

2.4 i	1E	69	03/94 → 06/96	☼ ⊖ ⊖ ☼ ☼ ⊖	→ Ch. 28-G-016821 Ch. 28-G-016822→ → Ch. 28E025000 Ch. 28F000001→	SVB13875 SVB10813 SVB10800 TB603 TB101 SVB13800	13x875 10x813 10x800 112x19 119x19 13x800
2.4 TD	1G	68	08/88 → 08/92	☼ ⊖ ⊖ ☼ ☼ ⊖	→ Ch. 28-G-016821 Ch. 28-G-016822→	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x875 10x813 10x800 119x25.4 75x20 13x800
	ACL	70	06/92 → 05/96	☼ ⊖ ☼ ⊖		SVB13875 SVB10800 TB440 TB136 SVB13800	13x875 10x800 120x25.4 75x20 13x800
	DV	75	02/86 → 08/92	☼ ⊖ ⊖ ☼ ☼ ⊖	→ Ch. 28-G-016821 Ch. 28-G-016822→	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x875 10x813 10x800 119x25.4 75x20 13x800
2.7 D	CG	48	11/75 → 01/80	⊖		SVB101140	10x1140

LT 28-35 I Bus (281-363)

2.0	CH	55	04/75 → 09/83	⊖ ⊖ ☼ ☼ ⊖	A/C(-), →11/82 A/C(+), →11/82 →11/82 →11/82 →11/82	SVB101010 SVB10900 TB108 TBK016 SVB10800	10x1010 10x900 121x18 10x800
2.4	DL	66	12/82 → 07/92	☼ ⊖ ⊖ ☼ ☼ ⊖	→ Ch. 28-G-016821 Ch. 28-G-016822→ → Ch. 28E025000 Ch. 28F000001→	SVB13875 SVB10813 SVB10800 TB603 TB101 SVB13800	13x875 10x813 10x800 112x19 119x19 13x800
2.4 D	CP, DW	55	01/79 → 07/92	☼ ⊖ ⊖ ☼ ☼ ⊖	12/82→ → Ch. 28-G-016821 12/82→, Ch. 28-G-016822→	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x875 10x813 10x800 119x25.4 75x20 13x800
	1S, ACT	51	08/89 → 06/96	☼ ⊖ ⊖ ☼ ☼ ⊖	→07/92 →07/92, → Ch. 28-G-016821 →07/92, Ch. 28-G-016822→ →07/92 →07/92 →07/92	SVB101025 SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	10x1025 13x875 10x813 10x800 119x25.4 75x20 13x800



kW



...VW

...LT 28-35 I Bus (281-363)

...2.4 D		51	08/91 → 07/92	 	→ Ch. 28-G-016821 Ch. 28-G-016822 →	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136	13x875 10x813 10x800 119x25.4 75x20
		55	08/91 → 07/92	 	→ Ch. 28-G-016821 Ch. 28-G-016822 →	SVB13800 SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x800 13x875 10x813 10x800 119x25.4 75x20 13x800
2.4 i	1E	69	08/89 → 06/96	 	→ Ch. 28-G-016821 Ch. 28-G-016822 → → Ch. 28E025000 Ch. 28F000001 →	SVB13875 SVB10813 SVB10800 TB603 TB101 SVB13800	13x875 10x813 10x800 112x19 119x19 13x800
2.4 TD	1G	68	08/89 → 08/92	 	→ Ch. 28-G-016821 Ch. 28-G-016822 →	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x875 10x813 10x800 119x25.4 75x20 13x800
	DV	75	12/82 → 07/89	 	→ Ch. 28-G-016821 Ch. 28-G-016822 →	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x875 10x813 10x800 119x25.4 75x20 13x800
	ACL	70	09/92 → 06/96	 		SVB13875 SVB10800 TB440 TB136 SVB13800	13x875 10x800 120x25.4 75x20 13x800
		68	08/91 → 07/92	 	→ Ch. 28-G-016821 Ch. 28-G-016822 →	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x875 10x813 10x800 119x25.4 75x20 13x800
		75	12/82 → 07/89	 	→ Ch. 28-G-016821 Ch. 28-G-016822 →	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x875 10x813 10x800 119x25.4 75x20 13x800

VW



kw



...VW

LT 28-35 I Flatbed / Chassis (281-363)

VW	2.0	CH	55	04/75 → 09/83		A/C(-), →11/82	SVB101010	10x1010
						A/C(+), →11/82	SVB10900	10x900
						→11/82	TB108	121x18
						→11/82	TBK016	
						→11/82	SVB10800	10x800
	2.4	DL	66	12/82 → 07/92			SVB13875	13x875
						→ Ch. 28-G-016821	SVB10813	10x813
						Ch. 28-G-016822→	SVB10800	10x800
						→ Ch. 28E025000	TB603	112x19
						Ch. 28F000001→	TB101	119x19
2.4 Syncro		70	08/92 → 07/94			SVB13800	13x800	
					→ Ch. 28-G-016821	SVB13875	13x875	
					Ch. 28-G-016822→	SVB10813	10x813	
					→ Ch. 28E025000	SVB10800	10x800	
					Ch. 28F000001→	TB603	112x19	
						TB101	119x19	
						SVB13800	13x800	
		66	08/91 → 07/92			SVB13875	13x875	
					→ Ch. 28-G-016821	SVB10813	10x813	
					Ch. 28-G-016822→	SVB10800	10x800	
					→ Ch. 28E025000	TB603	112x19	
					Ch. 28F000001→	TB101	119x19	
						SVB13800	13x800	
2.4 D	1S, ACT	51	08/90 → 06/96		→07/94	SVB13875	13x875	
					→07/94, → Ch. 28-G-016821	SVB10813	10x813	
					→07/94, Ch. 28-G-016822→	SVB10800	10x800	
					→07/94	TB131	119x25.4	
					→07/94	TBK044		
					→07/94	TB136	75x20	
					→07/94	SVB13800	13x800	
	CP, DW	55	12/78 → 02/91		12/82→	SVB13875	13x875	
					→ Ch. 28-G-016821	SVB10813	10x813	
					12/82→, Ch. 28-G-016822→	SVB10800	10x800	
						TB131	119x25.4	
						TBK044		
						TB136	75x20	
					12/82→	SVB13800	13x800	
					→11/82	SVB101025	10x1025	
2.4 D Syncro		55	08/91 → 07/92			SVB13875	13x875	
					→ Ch. 28-G-016821	SVB10813	10x813	
					Ch. 28-G-016822→	SVB10800	10x800	
						TB131	119x25.4	
						TBK044		
						TB136	75x20	
						SVB13800	13x800	
		51	08/91 → 07/92			SVB13875	13x875	
					→ Ch. 28-G-016821	SVB10813	10x813	
					Ch. 28-G-016822→	SVB10800	10x800	
						TB131	119x25.4	
						TBK044		
						TB136	75x20	
						SVB13800	13x800	
2.4 i	1E	69	03/94 → 06/96			SVB13875	13x875	
					→ Ch. 28-G-016821	SVB10813	10x813	
					Ch. 28-G-016822→	SVB10800	10x800	
					→ Ch. 28E025000	TB603	112x19	
					Ch. 28F000001→	TB101	119x19	
						SVB13800	13x800	



kW



...VW

...LT 28-35 I Flatbed / Chassis (281-363)

2.4 TD	1G	68	08/90 → 08/92		→ Ch. 28-G-016821 Ch. 28-G-016822→	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x875 10x813 10x800 119x25.4 75x20 13x800
	ACL	70	08/92 → 06/96			SVB13875 SVB10800 TB440 TB136 SVB13800	13x875 10x800 120x25.4 75x20 13x800
	DV	75	12/82 → 09/93		→ Ch. 28-G-016821 Ch. 28-G-016822→	SVB13875 SVB10813 SVB10800 TB131 TBK044 TB136 SVB13800	13x875 10x813 10x800 119x25.4 75x20 13x800
2.7 D	CG	48	11/75 → 01/80			SVB101140	10x1140

LT 28-35 II Bus (2DM)

2.3	AGL	105	05/96 →		A/C(-), →11/01 A/C(-), →11/01 A/C(+), →11/01 A/C(+), →11/01	MVB2100R6 MVB2120R6 MVB2205R6 MVB2215R6	6PK2100 6PK2120 6PK2205 6PK2215
2.5 SDI	AGX	55	07/96 →		A/C(-), →04/01, → Ch. 2D-Y-009086 A/C(-), →04/01, Ch. 2D-Y-009087→ A/C(+), →04/01 →04/01 →04/01 →04/01 →04/01	MVB1755R6 MVB1715R6 MVB2145R6 MVB2100R6 MVB2120R6 TB785 TB557	6PK1755 6PK1715 6PK2145 6PK2100 6PK2120 122x26.5 81x21
2.5 TDI	AHD	75	05/96 → 08/99		A/C(-), → Ch. 2D-Y-009086 A/C(-), Ch. 2D-Y-009087→ A/C(+)	MVB1755R6 MVB1715R6 MVB2145R6 MVB2100R6 MVB2120R6 TB785 TB557	6PK1755 6PK1715 6PK2145 6PK2100 6PK2120 122x26.5 81x21
	BBE	61	05/01 →		A/C(+), →06/06 A/C(-), →06/06, → Ch. 2D-Y-009086 A/C(-), →06/06, Ch. 2D-Y-009087→ A/C(-), →06/06 →06/06 →06/06	MVB2145R6 MVB1755R6 MVB1715R6 MVB2080R6 TB785 TB557	6PK2145 6PK1755 6PK1715 6PK2080 122x26.5 81x21
	BBF	70	05/01 →		A/C(+), →06/06 A/C(-), →06/06, → Ch. 2D-Y-009086 A/C(-), →06/06, Ch. 2D-Y-009087→ A/C(-), →06/06 →06/06 →06/06	MVB2145R6 MVB1755R6 MVB1715R6 MVB2080R6 TB785 TB557	6PK2145 6PK1755 6PK1715 6PK2080 122x26.5 81x21



kW



...VW

...LT 28-35 II Bus (2DM)

2.5 TDI Front Wheel Drive	APA	66	05/99 →	①	A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755
				②	A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715
				③	A/C(+), →06/06	MVB2145R6	6PK2145
				④	→06/06	MVB2100R6	6PK2100
				⑤	→06/06	MVB2120R6	6PK2120
				⑥	→06/06	TB785	122x26.5
				⑦	→06/06	TB557	81x21
				⑧			
				⑨			
				⑩			
ANJ, AVR	80	05/99 →	①	A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755	
			②	A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715	
			③	A/C(+), →06/06	MVB2145R6	6PK2145	
			④	→06/06	MVB2100R6	6PK2100	
			⑤	→06/06	MVB2120R6	6PK2120	
			⑥	→06/06	TB785	122x26.5	
			⑦	→06/06	TB557	81x21	
			⑧				
			⑨				
			⑩				
2.8 TDi	BCQ	116	05/01 → 06/06	①	A/C(-)	MVB1685R6	6PK1685
				②	A/C(+)	MVB2153R6	6PK2153
		96	01/99 → 01/02	③	A/C(-)	MVB1642R6	6PK1642
				④	A/C(+)	MVB2125R6	6PK2125
				⑤		MVB1995R6	6PK1995
				⑥		SVB10900	10x900

LT 28-46 II Box (2DX0AE)

2.3	AGL	105	05/96 →	①	A/C(-), →11/01	MVB2100R6	6PK2100
				②	A/C(-), →11/01	MVB2120R6	6PK2120
				③	A/C(+), →11/01	MVB2205R6	6PK2205
				④	A/C(+), →11/01	MVB2215R6	6PK2215
				⑤			
2.5 SDI	AGX	55	09/96 →	①	A/C(-), →04/01, → Ch. 2D-Y-009086	MVB1755R6	6PK1755
				②	A/C(-), →04/01, Ch. 2D-Y-009087→	MVB1715R6	6PK1715
				③	A/C(+), →04/01	MVB2145R6	6PK2145
				④	→04/01	MVB2100R6	6PK2100
				⑤	→04/01	MVB2120R6	6PK2120
				⑥	→04/01	TB785	122x26.5
				⑦	→04/01	TB557	81x21
				⑧			
				⑨			
				⑩			
2.5 TDI	AHD	75	05/96 → 08/99	①	A/C(-), → Ch. 2D-Y-009086	MVB1755R6	6PK1755
				②	A/C(-), Ch. 2D-Y-009087→	MVB1715R6	6PK1715
				③	A/C(+)	MVB2145R6	6PK2145
				④		MVB2100R6	6PK2100
				⑤		MVB2120R6	6PK2120
				⑥		TB785	122x26.5
				⑦		TB557	81x21
	APA	66	05/99 →	①	A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755
				②	A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715
				③	A/C(+), →06/06	MVB2145R6	6PK2145
				④	→06/06	MVB2100R6	6PK2100
				⑤	→06/06	MVB2120R6	6PK2120
				⑥	→06/06	TB785	122x26.5
				⑦	→06/06	TB557	81x21
				⑧			
BBE	61	05/01 →	①	A/C(+), →06/06	MVB2145R6	6PK2145	
			②	A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755	
			③	A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715	
			④	A/C(-), →06/06	MVB2080R6	6PK2080	
			⑤	→06/06	TB785	122x26.5	
			⑥	→06/06	TB557	81x21	





kW



...VW

...LT 28-46 II Box (2DX0AE)

...2.5 TDI	BBF	70	05/01 →	⊗	A/C(+), →06/06	MVB2145R6	6PK2145
				⊗ ①	A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755
				⊗ ①	A/C(-), →06/06, Ch. 2D-Y-009087 →	MVB1715R6	6PK1715
				⊗ ②	A/C(-), →06/06	MVB2080R6	6PK2080
				⊗ ② ⊗ ③ ⊗ ④	→06/06 →06/06	TB785 TB557	122x26.5 81x21
2.5 TDI Front Wheel Drive	ANJ, AVR	80	05/99 →	⊗	A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755
				⊗	A/C(-), →06/06, Ch. 2D-Y-009087 →	MVB1715R6	6PK1715
				⊗	A/C(+), →06/06	MVB2145R6	6PK2145
				⊗ ②	→06/06	MVB2100R6	6PK2100
				⊗ ② ⊗ ③ ⊗ ④	→06/06 →06/06 →06/06	MVB2120R6 TB785 TB557	6PK2120 122x26.5 81x21
2.8 TDI	AGK	92	06/97 → 12/98	⊗	A/C(-)	MVB1642R6	6PK1642
				⊗	A/C(+)	MVB2125R6	6PK2125
				⊗ ②		MVB1995R6	6PK1995
				⊗		SVB10900	10x900
	ATA	96	01/99 →	⊗	A/C(-), →01/02	MVB1642R6	6PK1642
				⊗	A/C(+), →01/02	MVB2125R6	6PK2125
				⊗ ②	→01/02	MVB1995R6	6PK1995
	AUH, BCQ	116	04/02 →	⊗	A/C(-), →06/06	MVB1685R6	6PK1685
				⊗	A/C(+), →06/06	MVB2153R6	6PK2153
		116	06/03 → 06/06	⊗ ⊗	A/C(-) A/C(+)	MVB1685R6 MVB2153R6	6PK1685 6PK2153

LT 28-46 II Flatbed / Chassis (2DX0FE)

2.3	AGL	105	06/96 →	⊗	A/C(-), →11/01	MVB2100R6	6PK2100
				⊗	A/C(-), →11/01	MVB2120R6	6PK2120
				⊗	A/C(+), →11/01	MVB2205R6	6PK2205
				⊗	A/C(+), →11/01	MVB2215R6	6PK2215
2.5 SDI	AGX	55	09/96 →	⊗	A/C(-), →04/01, → Ch. 2D-Y-009086	MVB1755R6	6PK1755
				⊗	A/C(-), →04/01, Ch. 2D-Y-009087 →	MVB1715R6	6PK1715
				⊗	A/C(+), →04/01	MVB2145R6	6PK2145
				⊗ ②	→04/01	MVB2100R6	6PK2100
				⊗ ② ⊗ ③ ⊗ ④	→04/01 →04/01 →04/01	MVB2120R6 TB785 TB557	6PK2120 122x26.5 81x21
2.5 TDI	AHD	75	06/96 → 08/99	⊗	A/C(-), → Ch. 2D-Y-009086	MVB1755R6	6PK1755
				⊗	A/C(-), Ch. 2D-Y-009087 →	MVB1715R6	6PK1715
				⊗	A/C(+)	MVB2145R6	6PK2145
				⊗ ②		MVB2100R6	6PK2100
				⊗ ② ⊗ ③ ⊗ ④		MVB2120R6 TB785 TB557	6PK2120 122x26.5 81x21
	APA	66	05/99 →	⊗	A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755
				⊗	A/C(-), →06/06, Ch. 2D-Y-009087 →	MVB1715R6	6PK1715
				⊗	A/C(+), →06/06	MVB2145R6	6PK2145
				⊗ ②	→06/06	MVB2100R6	6PK2100
				⊗ ② ⊗ ③ ⊗ ④	→06/06 →06/06 →06/06	MVB2120R6 TB785 TB557	6PK2120 122x26.5 81x21



kW



...VW

...LT 28-46 II Flatbed / Chassis (2DX0FE)

Engine	Model	Power (kW)	Year Range	Options	Configuration	Accessories	Dimensions
2.5 TDI	ANJ, AVR	80	05/99 →	 	A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755
					A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715
					A/C(+), →06/06	MVB2145R6	6PK2145
					→06/06	MVB2100R6	6PK2100
					→06/06	MVB2120R6	6PK2120
					→06/06	TB785	122x26.5
					→06/06	TB557	81x21
					A/C(+), →06/06	MVB2145R6	6PK2145
					A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755
					A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715
BBE	61	05/01 →	 	A/C(+), →06/06	MVB2145R6	6PK2145	
				A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755	
				A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715	
				A/C(-), →06/06	MVB2080R6	6PK2080	
				→06/06	TB785	122x26.5	
				→06/06	TB557	81x21	
				A/C(+), →06/06	MVB2145R6	6PK2145	
				A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755	
				A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715	
				A/C(-), →06/06	MVB2080R6	6PK2080	
BBF	70	05/01 →	 	A/C(+), →06/06	MVB2145R6	6PK2145	
				A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755	
				A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715	
				A/C(-), →06/06	MVB2080R6	6PK2080	
				→06/06	TB785	122x26.5	
				→06/06	TB557	81x21	
				A/C(+), →06/06	MVB2145R6	6PK2145	
				A/C(-), →06/06, → Ch. 2D-Y-009086	MVB1755R6	6PK1755	
				A/C(-), →06/06, Ch. 2D-Y-009087→	MVB1715R6	6PK1715	
				A/C(-), →06/06	MVB2080R6	6PK2080	
2.8 TDI	AGK	92	06/97 → 12/98	 	A/C(-)	MVB1642R6	6PK1642
					A/C(+)	MVB2125R6	6PK2125
						MVB1995R6	6PK1995
						SVB10900	10x900
					A/C(-), →01/02	MVB1642R6	6PK1642
					A/C(+), →01/02	MVB2125R6	6PK2125
					→01/02	MVB1995R6	6PK1995
					→01/02	SVB10900	10x900
					A/C(-), →06/06	MVB1685R6	6PK1685
					A/C(+), →06/06	MVB2153R6	6PK2153

LT 40-55 I Box (291-512)

2.0	CH	55	04/75 → 09/83	 	A/C(-), →11/82	SVB101010	10x1010
					A/C(+), →11/82	SVB10900	10x900
					→11/82	TB108	121x18
					→11/82	TBK016	
					→11/82	SVB10800	10x800
2.4	DL	66	12/82 → 07/92	 	→ Ch. 28-G-016821	SVB13875	13x875
					Ch. 28-G-016822→	SVB10813	10x813
					→ Ch. 28E025000	SVB10800	10x800
					Ch. 28F000001→	TB603	112x19
						TB101	119x19
2.4 4WD	DL	66	12/82 → 07/92	 	→ Ch. 28-G-016821	SVB13875	13x875
					Ch. 28-G-016822→	SVB10813	10x813
					→ Ch. 28E025000	SVB10800	10x800
					Ch. 28F000001→	TB603	112x19
						TB101	119x19



kW



...VW

...LT 40-55 I Box (291-512)

2.4 D	CP, DW	55	01/79 → 07/92	⊗	12/82 →	SVB13875	13x875
				⊗	12/82 →, → Ch. 28-G-016821	SVB10813	10x813
				⊗	12/82 →, Ch. 28-G-016822 →	SVB10800	10x800
					12/82 →	TB131	119x25.4
				KIT	12/82 →	TBK044	
					12/82 →	TB136	75x20
1S, ACT	51	07/90 → 05/96	⊗		SVB13875	13x875	
			⊗		SVB10800	10x800	
			⊗	→ Ch. 28-G-016821	SVB10813	10x813	
					TB131	119x25.4	
				08/92 →	TB440	120x25.4	
			KIT		TBK044		
2.4 D 4WD	DW	55	01/79 → 03/86		→11/82	SVB10813	10x813
					→11/82	TB131	119x25.4
				KIT	→11/82	TBK044	
					→11/82	TB136	75x20
					→11/82	SVB101025	10x1025
				2.4 i	1E	69	01/93 → 06/96
⊗	→ Ch. 28-G-016821	SVB10813	10x813				
⊗	Ch. 28-G-016822 →	SVB10800	10x800				
	→ Ch. 28E025000	TB603	112x19				
	Ch. 28F000001 →	TB101	119x19				
		SVB13800	13x800				
2.4 TD	1G	68	08/88 → 08/92	⊗		SVB13875	13x875
				⊗	→ Ch. 28-G-016821	SVB10813	10x813
				⊗	Ch. 28-G-016822 →	SVB10800	10x800
						TB131	119x25.4
				KIT		TBK044	
						TB136	75x20
	DV	75	02/86 → 08/92	⊗		SVB13875	13x875
				⊗	→ Ch. 28-G-016821	SVB10813	10x813
				⊗	Ch. 28-G-016822 →	SVB10800	10x800
						TB131	119x25.4
				KIT		TBK044	
						TB136	75x20
ACL	70	06/92 → 05/96	⊗		SVB13875	13x875	
			⊗		SVB10800	10x800	
					TB440	120x25.4	
					TB136	75x20	
					SVB13800	13x800	
			2.4 TD 4WD	DV	75	08/78 → 03/86	⊗
⊗	12/82 →, → Ch. 28-G-016821	SVB10813					10x813
⊗	12/82 →, Ch. 28-G-016822 →	SVB10800					10x800
	12/82 →	TB131					119x25.4
KIT	12/82 →	TBK044					
	12/82 →	TB136					75x20
			12/82 →	SVB13800	13x800		

VW



kw



...VW

LT 40-55 I Flatbed / Chassis (293-909)

VW	2.0	CH	55	04/75 → 09/83		A/C(-), →11/82	SVB101010	10x1010
						A/C(+), →11/82	SVB10900	10x900
						→11/82	TB108	121x18
						→11/82	TBK016	
						→11/82	SVB10800	10x800
	2.4		66	08/85 → 07/89			SVB13875	13x875
						→ Ch. 28-G-016821	SVB10813	10x813
						Ch. 28-G-016822→	SVB10800	10x800
						→ Ch. 28E025000	TB603	112x19
						Ch. 28F000001→	TB101	119x19
		70	08/88 → 07/89			SVB13800	13x800	
					→ Ch. 28-G-016821	SVB13875	13x875	
					Ch. 28-G-016822→	SVB10813	10x813	
					→ Ch. 28E025000	SVB10800	10x800	
					→ Ch. 28E025000	TB603	112x19	
					Ch. 28F000001→	TB101	119x19	
						SVB13800	13x800	
2.4 Syncro		66	12/82 → 07/89			SVB13875	13x875	
					→ Ch. 28-G-016821	SVB10813	10x813	
					Ch. 28-G-016822→	SVB10800	10x800	
					→ Ch. 28E025000	TB603	112x19	
					Ch. 28F000001→	TB101	119x19	
						SVB13800	13x800	
2.4 D	1S, ACT	51	08/90 → 06/96			SVB13875	13x875	
						SVB10800	10x800	
					→ Ch. 28-G-016821	SVB10813	10x813	
						TB131	119x25.4	
					08/92→	TB440	120x25.4	
						TBK044		
						TB136	75x20	
						SVB13800	13x800	
	CP, DW	55	12/78 → 02/91		12/82→	SVB13875	13x875	
					→ Ch. 28-G-016821	SVB10813	10x813	
					12/82→, Ch. 28-G-016822→	SVB10800	10x800	
						TB131	119x25.4	
						TBK044		
						TB136	75x20	
					12/82→	SVB13800	13x800	
					→11/82	SVB101025	10x1025	
2.4 i	1E	69	03/94 → 06/96			SVB13875	13x875	
					→ Ch. 28-G-016821	SVB10813	10x813	
					Ch. 28-G-016822→	SVB10800	10x800	
					→ Ch. 28E025000	TB603	112x19	
					Ch. 28F000001→	TB101	119x19	
						SVB13800	13x800	
2.4 TD	ACL	70	08/92 → 06/96			SVB13875	13x875	
						SVB10800	10x800	
					→ Ch. 28-G-016821	SVB10813	10x813	
						TB131	119x25.4	
						TB440	120x25.4	
						TBK044		
						TB136	75x20	
						SVB13800	13x800	
	DV	75	12/82 → 09/93			SVB13875	13x875	
					→ Ch. 28-G-016821	SVB10813	10x813	
					Ch. 28-G-016822→	SVB10800	10x800	
						TB131	119x25.4	
						TBK044		
						TB136	75x20	
						SVB13800	13x800	



kW



...VW

LUPU (6X1, 6E1)

1.0	AER, AHT, ALD, ALL, ANV, AUC	37	09/98 → 07/05	⊗	A/C(-), MS	MVB750R6	6PK750
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(+), PS	MVB1125R6	6PK1125
				⊗	Eng. AHT, A/C(-), MS	MVB1225R5	5PK1225
				⊗	Eng. AHT, A/C(-), PS	MVB1520R6	6PK1520
				⊗	Eng. AHT, A/C(+), MS	MVB1488R6	6PK1488
				⊗	Eng. AHT, A/C(+), PS	MVB1875R6	6PK1875
						TB466	135x19
				KIT	→ Ch. 6X-Y-060000	TBK087	
				KIT	Ch. 6X-Y-060001→	TBK320	
1.2 TDI 3L	ANY, AYZ	45	07/99 → 07/05	⊗	Eng. AYZ, A/C(-)	MVB860R6	6PK860
				⊗	Eng. AYZ, A/C(+)	MVB1000R6	6PK1000
						TB726	117x30
1.4	AUD	44	10/00 → 07/05	⊗	A/C(-), MS	MVB750R6	6PK750
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(+), PS	MVB1125R6	6PK1125
						TB466	135x19
				KIT	→ Ch. 6X-Y-060000	TBK087	
				KIT	Ch. 6X-Y-060001→	TBK320	
1.4 16V	AHW, AKQ, APE, AUA, BBY	55	09/98 → 07/05	⊗	Eng. BBY, A/C(-)	MVB1065R6	6PK1065
				⊗	Eng. BBY, A/C(+)	MVB1125R6	6PK1125
						TB634	58x17
						TB658	130x20
	KIT	Eng. AHW, → Eng Nr 160000	TBK263				
	KIT	Eng. BBY	TBK246				
	AFK, ANM, AQQ, AUB	74	08/99 → 07/05	⊗	A/C(-)	MVB1065R6	6PK1065
				⊗	A/C(+)	MVB1125R6	6PK1125
					TB634	58x17	
					TB658	130x20	
KIT		TBK246					
1.4 FSI	ARR	77	02/01 → 07/05	⊗	A/C(-), →09/03	MVB750R6	6PK750
				⊗	A/C(+), →09/03	MVB1088R6	6PK1088
					→09/03	TB634	58x17
					→09/03	TB658	130x20
				KIT	→09/03	TBK246	
1.4 TDI	AMF	55	01/99 → 07/05	⊗	A/C(-), 05/99→	MVB1125R6	6PK1125
				⊗	A/C(+), 05/99→	MVB1188R6D	6DPK1188
					05/99→	TB680	120x30
				KIT	05/99→, Ch. 6X-2-015001→	TBK270	
				KIT	05/99→, Eng Nr 011495→,	TBK225	
					→ Ch. 6X-2-015000		
				KIT	05/99→,	TBK269	
	Eng Nr 011495→,						
	→ Ch. 6X-2-015000, VD(+)						
1.6 GTI	AVY	92	09/00 → 07/05	⊗	A/C(-)	MVB1065R6	6PK1065
				⊗	A/C(+)	MVB1155R6	6PK1155
						TB634	58x17
						TB658	130x20
				KIT		TBK246	
1.7 SDI	AKU	44	09/98 → 07/05	⊗		MVB1225R5	5PK1225
						TB657	137x23
				KIT		TBK112	



kW



...VW

MULTIVAN V (7HM, 7HF)

1.9 TDI	AXB	77	04/03 →	 	A/C(-), → Ch. 7H-6H079890 A/C(-), Ch. 7H-6X022357 → A/C(+), → Ch. 7H-6H079890 A/C(+), Ch. 7H-6X022357 →	MVB1125R6 MVB1137R6 MVB1200R6D MVB1215R6D TB680 TBK270	6PK1125 6PK1137 6DPK1200 6DPK1215 120x30
	BRS	75	06/06 →	 	A/C(-), → Ch. 7H-6X022356 A/C(-), Ch. 7H-6X022357 → A/C(+), → Ch. 7H-6H079890 A/C(+), Ch. 7H-6X022357 →	MVB1125R6 MVB1137R6 MVB1200R6D MVB1215R6D TB680 TBK270	6PK1125 6PK1137 6DPK1200 6DPK1215 120x30
2.0	AXA	85	11/03 →	 	A/C(-), 08/03 → A/C(+), 08/03 → 08/03 → 08/03 →	MVB1125R6 MVB1200R6D TB552 TBK100	6PK1125 6DPK1200 138x23
				 	A/C(-) A/C(-) A/C(-)	MVB1260R6 MVB1260R6 MVB1260R6	6PK1260 6PK1260 6PK1260
3.2 V6	BDL	170	02/04 → 06/04		A/C(-)	MVB1260R6	6PK1260
	BKK, CFLA	173	02/04 →		A/C(-)	MVB1260R6	6PK1260
3.2 V6 4motion	BKK, CFLA	173	07/04 →		A/C(-)	MVB1260R6	6PK1260

NEW BEETLE (9C1, 1C1)

1.4	BCA	55	11/01 →	 	A/C(-), → Ch. 9C-2-610157 A/C(-), Ch. 9C-2-610158 → A/C(+) → Ch. 9C-6-599000 → Ch. 9C-6-599000	MVB1080R6 MVB1155R6 MVB1550R6 TB634 TB658 TBK246	6PK1080 6PK1155 6PK1550 58x17 130x20
				 	A/C(-) A/C(+) → Ch. 9C-6-599000 → Ch. 9C-6-599000	MVB1125R6 MVB1200R6D TB552 TBK100	6PK1125 6DPK1200 138x23
1.6	AWH	74	10/99 → 09/00	 	A/C(-) A/C(+) → Ch. 9C-6-599000 → Ch. 9C-6-599000	MVB1125R6 MVB1200R6D TB552 TBK100	6PK1125 6DPK1200 138x23
	AYD	75	09/00 →	 	A/C(-) A/C(+) → Ch. 9C-6-599000 → Ch. 9C-6-599000	MVB1125R6 MVB1200R6D TB552 TBK100	6PK1125 6DPK1200 138x23
1.8 T	APH, AVC, AWU, AWW	110	10/99 →	 	A/C(-) A/C(+) → Ch. 9C-6-599000 → Ch. 9C-6-599000	MVB1125R6 MVB1200R6D TB554 TBK115 TBK101	6PK1125 6DPK1200 150x23
	AWP	132	11/01 → 06/05	 	A/C(-) A/C(+) → Ch. 9C-6-599000 → Ch. 9C-6-599000	MVB1125R6 MVB1200R6D TB554 TBK115	6PK1125 6DPK1200 150x23
1.9 TDI	ALH	66	01/98 → 02/01	 	A/C(-) A/C(+) → Eng Nr 500000 Eng Nr 500001 → Eng Nr 500001 → Eng Nr 500001 → MAN, → Eng Nr 500000	MVB906R6 MVB1660R6 TB533 TB659 TBK272 TBK107	6PK906 6PK1660 141x25 141x26
	ATD, BEW	74	02/01 →	 	A/C(-), 07/01 → A/C(-), 07/01 → 06/05 A/C(+), 07/01 → 07/01 → 07/01 → Eng. ATD, 07/01 → 06/05, → Ch. 9C-2-613920 Eng. ATD, 07/01 → 06/05, → Ch. 9C-2-613920, VD(+)	MVB1125R6 MVB1432R5 MVB1200R6D TB680 TBK270 TBK225 TBK269	6PK1125 5PK1432 6DPK1200 120x30



kW



...VW

...NEW BEETLE (9C1, 1C1)

...1.9 TDI	BSW	77	07/05 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
						TBK270	
2.0	AEG, APK, AQY, AVH, AZG, BEV	85	01/98 →		Eng. AZG, A/C(-)	MVB1125R6	6PK1125
					Eng. AZG, A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
2.3 V5	AQN	125	10/00 →		A/C(-), →10/02	MVB1260R6	6PK1260
2.5	BPR, BPS	110	07/05 →		A/C(+)	MVB938R5	5PK938

NEW BEETLE Convertible (1Y7)

1.4	BCA	55	01/03 →		A/C(-), → Ch. 9C-2-610157	MVB1080R6	6PK1080
					A/C(-), Ch. 9C-2-610158→	MVB1155R6	6PK1155
					A/C(+)	MVB1550R6	6PK1550
						TB634	58x17
					→ Ch. 1Y-6-399000	TB658	130x20
					→ Ch. 1Y-6-399000	TBK246	
1.6	BFS	75	01/03 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
1.8 T	AWU	110	01/04 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB554	150x23
						TBK115	
1.9 TDI	AXR	74	03/03 →		A/C(-), 07/03→	MVB1125R6	6PK1125
					A/C(+), 07/03→	MVB1200R6D	6DPK1200
					07/03→	TB680	120x30
					07/03→	TBK270	
	BSW	77	07/05 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB680	120x30
						TBK270	
2.0	AZJ, BDC, BEV, BGD	85	01/03 →		A/C(-)	MVB1200R6D	6DPK1200
						MVB1125R6	6PK1125
						TB552	138x23
						TBK100	
2.5	BPR, BPS	110	07/05 →		A/C(+)	MVB938R5	5PK938

PASSAT (3A2, 35I)

1.6	1F, EZ	53	02/88 → 09/91			SVB13950	13x950
					A/C(-), MS	SVB10950	10x950
					A/C(-), PS	SVB12865	12x865
						TB108	121x18
						TBK016	
					A/C(-)	SVB10735	10x735
					A/C(+)	SVB10625	10x625
	EZ	55	02/88 → 12/88			SVB13950	13x950
					A/C(-), MS	SVB10950	10x950
					A/C(-), PS	SVB12865	12x865
						TB108	121x18
						TBK016	
					A/C(-)	SVB10735	10x735
					A/C(+)	SVB10625	10x625



kW



...VW
...PASSAT (3A2, 35I)

Engine	Code	Power (kW)	Period	Accessories	Notes	Part Numbers	Dimensions
1.6	AEK, AFT	74	10/94 → 08/96	⊗	A/C(-), Auto Tensioner, 08/95→12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner, 08/95→	MVB890R6	6PK890
				⊗	A/C(+), 08/95→	MVB1155R6	6PK1155
					08/95→	TB108	121x18
					08/95→	TBK016	
				⊗	A/C(-), 08/95→	SVB12685	12x685
				⊗	A/C(+), 08/95→	SVB12760	12x760
1.6 TD	RA, SB	59	08/88 → 09/93	⊗		SVB13950	13x950
				⊗	A/C(-)	SVB12950	12x950
				⊗	A/C(+)	SVB10700	10x700
						TB225	135x25.4
						TBK018	
				→ Ch. 31M200000		SVB10740	10x740
				⊗	Ch. 31M200001→	SVB12650	12x650
				⊗		SVB13950	13x950
1.8	PF	79	04/88 → 07/93	⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB12865	12x865
						TB108	121x18
						TBK016	
	PB	82	04/88 → 07/92	⊗	A/C(-)	SVB10735	10x735
				⊗	A/C(+)	SVB10625	10x625
				⊗		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
AAM	55	08/90 → 08/96	⊗	A/C(-), PS	SVB12865	12x865	
			⊗	A/C(+), PS	SVB10625	10x625	
					TB108	121x18	
					TBK016		
			⊗	A/C(-)	SVB10735	10x735	
			⊗	→09/93	SVB13950	13x950	
			⊗	A/C(-), Auto Tensioner, 10/93→12/95	MVB975R6	6PK975	
			⊗	A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035	
			⊗	A/C(-), Manu Tensioner, 10/93→	MVB890R6	6PK890	
			⊗	A/C(-), MS, →09/93	SVB10950	10x950	
			⊗	A/C(-), PS, →09/93	SVB12865	12x865	
			⊗	A/C(+), 10/93→	MVB1155R6	6PK1155	
ABS, ADZ, RP	66	02/88 → 08/96	⊗	A/C(+), PS, →09/93	SVB10625	10x625	
					TB108	121x18	
					TBK016		
			⊗	A/C(-), →09/93	SVB10735	10x735	
			⊗	A/C(-), 10/93→	SVB12685	12x685	
			⊗	A/C(+), 10/93→	SVB12760	12x760	
			⊗	→09/93	SVB13950	13x950	
			⊗	A/C(-), Auto Tensioner, 10/93→12/95	MVB975R6	6PK975	
			⊗	A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035	
			⊗	A/C(-), Manu Tensioner, 10/93→	MVB890R6	6PK890	
			⊗	A/C(-), MS, →09/93	SVB10950	10x950	
			⊗	A/C(-), PS, →09/93	SVB12865	12x865	
⊗	A/C(+), 10/93→	MVB1155R6	6PK1155				
⊗	A/C(+), PS, →09/93	SVB10625	10x625				
		TB108	121x18				
		TBK016					
⊗	A/C(-), →09/93	SVB10735	10x735				
⊗	A/C(-), 10/93→	SVB12685	12x685				
⊗	A/C(+), 10/93→	SVB12760	12x760				



kW



...VW

...PASSAT (3A2, 35I)

Engine	Code	kW	Year Range	Accessories	Notes	Part Numbers	Dimensions
1.8 16V	KR	100	04/88 → 12/89	⚙️		SVB13950	13x950
				⚙️	A/C(-)	SVB10950	10x950
				⚙️	A/C(+)	SVB10625	10x625
				🔧		TB505	147x25.4
				🔧KIT		TBK066	
1.8 G60 Syncro	PG	118	08/88 → 08/96	⚙️	A/C(-), 09/89 → 07/93	MVB1650R6	6PK1650
				⚙️	A/C(+), 09/89 → 07/93	MVB1755R6	6PK1755
				🔧	09/89 → 07/93	TB108	121x18
				🔧KIT	09/89 → 07/93	TBK016	
				⚙️	A/C(-), 09/89 → 07/93	SVB10665	10x665
1.9 D	1Y	50	05/89 → 10/93	⚙️	A/C(+), 09/89 → 07/93	SVB10740	10x740
				⚙️	→ 11/91	SVB13950	13x950
				⚙️	A/C(-), → 11/91	SVB12950	12x950
				⚙️	A/C(-), Auto Tensioner, 11/91 →	MVB925R6	6PK925
				⚙️	A/C(-), Manu Tensioner, 11/91 →	MVB1045R6	6PK1045
1.9 TD	AAZ	55	03/91 → 08/96	⚙️	A/C(+), → 11/91	SVB10700	10x700
				⚙️	A/C(+), 11/91 →	MVB1150R6	6PK1150
				🔧		TB384	137x25.4
				🔧KIT		TBK024	
				⚙️	→ 01/91	SVB10740	10x740
				⚙️	01/91 → 11/91	SVB12650	12x650
				⚙️	A/C(-), 11/91 →	SVB12735	12x735
				⚙️	A/C(+), 11/91 →	SVB11790	11x790
				⚙️	A/C(-), Auto Tensioner	MVB925R6	6PK925
				⚙️	A/C(-), Manu Tensioner	MVB1045R6	6PK1045
1.9 TDI	1Z	66	10/93 → 08/96	⚙️	A/C(+)	MVB1150R6	6PK1150
				⚙️		TB384	137x25.4
				🔧		TBK024	
				🔧KIT	→ 07/94, → Eng Nr 552765	TBK025	
				🔧KIT	07/94 →, Eng Nr 552766 →	TBK025	
				⚙️	A/C(-)	SVB12735	12x735
				⚙️	A/C(+)	SVB11790	11x790
				⚙️	A/C(-)	MVB1045R6	6PK1045
				⚙️	A/C(+)	MVB1150R6	6PK1150
				⚙️		TB384	137x25.4
1.9 TDI	1Z	66	10/93 → 08/96	⚙️	→ 07/94, → Eng Nr 1Z289575	TBK119	
				⚙️	07/94 →, Eng Nr 1Z289576 →	TBK026	
				⚙️	A/C(-)	SVB12735	12x735
				⚙️	A/C(+)	SVB11790	11x790
				⚙️	A/C(-)	MVB1045R6	6PK1045
1.9 TDI	AFN	81	03/96 → 08/96	⚙️	A/C(+)	MVB1150R6	6PK1150
				⚙️		TB384	137x25.4
				🔧		TBK026	
				🔧KIT		TBK026	
				⚙️	A/C(-)	SVB12735	12x735
⚙️	A/C(+)	SVB11790	11x790				

VW



kw



...VW

...PASSAT (3A2, 35I)

2.0	2E, ADY, AGG	85	02/90 → 08/96	⚙️	→09/93, → Ch. 31-N-400000	SVB13950	13x950					
				⚙️	A/C(-),	MVB975R6	6PK975					
					Auto Tensioner, →09/93,							
					Ch. 31-N-400001→							
				⚙️	Eng. 2E,	MVB890R6	6PK890					
					A/C(-),							
					Manu Tensioner, →09/93,							
					Ch. 31-N-400001→							
				⚙️	Eng. 2E, A/C(-), MS, →09/93,	SVB10950	10x950					
					→ Ch. 31-N-400000							
				⚙️	Eng. 2E, A/C(-), PS, →09/93,	SVB12865	12x865					
					→ Ch. 31-N-400000							
				⚙️	Eng. 2E, A/C(+), →09/93,	MVB1155R6	6PK1155					
	Ch. 31-N-400001→											
	→09/93	TB506	124x18									
	→09/93	TBK076										
	⊕	Eng. 2E, A/C(-), →09/93,	SVB10735	10x735								
	→ Ch. 31-N-400000											
	⊕	Eng. 2E, A/C(-), →09/93,	SVB12685	12x685								
	Ch. 31-N-400001→											
	⊕	Eng. 2E, A/C(+), →09/93,	SVB10625	10x625								
	→ Ch. 31-N-400000											
	⊕	Eng. 2E, A/C(+), →09/93,	SVB12760	12x760								
	Ch. 31-N-400001→											
AEP		79	03/95 → 08/96	⚙️	A/C(-), Auto Tensioner,	MVB975R6	6PK975					
					→12/95							
				⚙️	A/C(-), Auto Tensioner,	MVB1035R6	6PK1035					
					12/95→							
				⚙️	A/C(-), Manu Tensioner	MVB890R6	6PK890					
				⚙️	A/C(+)	MVB1155R6	6PK1155					
					⚙️	TB506	124x18					
					⚙️	TBK076						
					⊕	A/C(-)	SVB12685	12x685				
					⊕	A/C(+)	SVB12760	12x760				
2.0 Syncro	2E, ADY, AGG	85	10/90 → 08/96	⚙️	→09/93, → Ch. 31-N-400000	SVB13950	13x950					
				⚙️	A/C(-), Auto Tensioner,	MVB975R6	6PK975					
					→12/95							
				⚙️	A/C(-), Auto Tensioner,	MVB1035R6	6PK1035					
					12/95→							
				⚙️	A/C(-), Manu Tensioner	MVB890R6	6PK890					
				⚙️	A/C(+)	MVB1155R6	6PK1155					
				⚙️	Eng. 2E, A/C(-), MS, →09/93,	SVB10950	10x950					
					→ Ch. 31-N-400000							
				⚙️	Eng. 2E, A/C(-), PS, →09/93,	SVB12865	12x865					
					→ Ch. 31-N-400000							
					⚙️	TB506	124x18					
					⚙️	TBK076						
	⊕	A/C(-)	SVB12685	12x685								
	⊕	A/C(+)	SVB12760	12x760								
	⊕	Eng. 2E, A/C(-), →09/93,	SVB10735	10x735								
	→ Ch. 31-N-400000											
	⊕	Eng. 2E, A/C(+), →09/93,	SVB10625	10x625								
	→ Ch. 31-N-400000											
2.0 16V	9A	100	08/88 → 09/93	⚙️		SVB13950	13x950					
				⚙️	A/C(-)	SVB10950	10x950					
					⚙️	TB505	147x25.4					
					⚙️	TBK066						
					⊕	SVB10625	10x625					
				ABF		110	01/94 → 08/96	⚙️	A/C(-), →12/95	MVB975R6	6PK975	
								⚙️	A/C(+)	MVB1155R6	6PK1155	
									⚙️	TB441	151x25.4	
									⊕	A/C(-)	SVB12685	12x685
									⊕	A/C(+)	SVB12760	12x760



kW



...VW

...PASSAT (3A2, 35I)

2.8 VR6	AAA	128	06/91 → 08/96		A/C(-)	MVB1285R7	7PK1285
					A/C(+)	MVB1360R7D	7DPK1360

PASSAT (3B2)

1.6	ADP, AHL, ANA, ARM	74	10/96 → 11/00			MVB855R4	4PK855
						MVB1300R5	5PK1300
					→10/97	TB463	121x18
					11/97→	TB552	138x23
					→10/97	TBK309	
					11/97→	TBK100	
						SVB12528	12x528
1.8	ADR, APT, ARG	92	10/96 → 11/00			MVB855R4	4PK855
					Eng. APT	MVB1300R5	5PK1300
					Hydr	TB555	153x25
					Eng. APT	TBK330	
					Eng. APT, VD(+)	TBK331	
						SVB12528	12x528
	AFY	85	01/97 → 11/00			MVB855R4	4PK855
						MVB1300R5	5PK1300
					Hydr	TB555	153x25
					Thermo	TB464	152x25.4
						TBK330	
					VD(+)	TBK331	
						SVB12528	12x528
1.8 Syncro/4motion	ADR, APT, ARG	92	10/96 → 11/00			MVB855R4	4PK855
						MVB1300R5	5PK1300
					Hydr	TB555	153x25
						TBK330	
					VD(+)	TBK331	
						SVB12528	12x528
1.8 T	AEB, ANB, APU	110	10/96 → 11/00			MVB855R4	4PK855
						MVB1300R5	5PK1300
					08/99→	TB554	150x23
					Hydr	TB555	153x25
					Thermo	TB464	152x25.4
					06/00→	TBK115	
					08/99→	TBK341	
					Eng. AEB	TBK330	
					Eng. AEB, VD(+)	TBK331	
						SVB12528	12x528
1.9 TDI	AHH, AHU	66	10/96 → 11/00			MVB855R4	4PK855
					Eng. AHH	MVB1590R5	5PK1590
						TB384	137x25.4
						TBK026	
					03/97→04/99, Ch. 3B-V-000001→	TBK335	
	AFN, AVG	81	10/96 → 11/00			MVB855R4	4PK855
						MVB1590R5	5PK1590
						TB384	137x25.4
						TBK026	
	AJM, ATJ	85	08/98 → 11/00		Eng. ATJ	MVB855R4	4PK855
					Eng. ATJ	MVB1432R5	5PK1432
						TB680	120x30
					Eng. ATJ	TBK225	
					Eng. ATJ, VD(+)	TBK269	
	AVB	74	02/00 → 11/00			MVB855R4	4PK855
						MVB1432R5	5PK1432
						TB680	120x30
						TBK225	
					, VD(+)	TBK269	

VW



kW



...VW

...PASSAT (3B2)

1.9 TDI 4motion	AJM, ATJ	85	08/99 → 11/00	☼	Eng. ATJ	MVB855R4	4PK855
				⊗	Eng. ATJ	MVB1432R5	5PK1432
				☞☞☞		TB680	120x30
				☞☞☞KIT	Eng. ATJ	TBK225	
1.9 TDI Syncro/4motion	AFN, AVG	81	10/96 → 11/00	☼		MVB855R4	4PK855
				⊗		MVB1590R5	5PK1590
				☞☞☞		TB384	137x25.4
				☞☞☞KIT	Eng. ATJ, VD(+)	TBK269	
2.0	ASU, AUZ	88	04/00 → 11/00	☼		MVB855R4	4PK855
				⊗		MVB1300R5	5PK1300
2.0 4motion		88	04/00 → 11/00	☼		MVB855R4	4PK855
				⊗		MVB1300R5	5PK1300
2.3 VR5	AGZ	110	10/96 → 11/00	⊗	A/C(-)	MVB1660R6	6PK1660
				⊗	A/C(+)	MVB2373R6	6PK2373
2.3 VR5 Syncro/4motion	AGZ	110	10/97 → 11/00	⊗	A/C(-)	MVB1660R6	6PK1660
				⊗	A/C(+)	MVB2373R6	6PK2373
2.5 TDI	AFB, AKN	110	07/98 → 11/00	☼		MVB1238R4	4PK1238
				⊗		MVB2403R6	6PK2403
				☞☞☞		TB642	207x32
				☞☞☞KIT		TBK358	
				☞☞☞		TB641	87x25
2.5 TDI Syncro/4motion	AFB, AKN	110	12/98 → 11/00	☼		MVB1238R4	4PK1238
				⊗		MVB2403R6	6PK2403
				☞☞☞		TB642	207x32
				☞☞☞KIT		TBK358	
				☞☞☞		TB641	87x25
2.8 Syncro	AGE	132	05/97 → 09/99	⊗	A/C(-)	MVB1760R6	6PK1760
				⊗	A/C(+)	MVB1875R6	6PK1875
				☞☞☞		TB556	253x30
				☞☞☞KIT		TBK357	
				☞☞☞KIT	VD(+)	TBK353	
2.8 V6	ACK, APR, AQD	142	08/96 → 11/00	⊗	A/C(-)	MVB1760R6	6PK1760
				⊗	A/C(+)	MVB1875R6	6PK1875
				☞☞☞		TB556	253x30
				☞☞☞KIT		TBK357	
				☞☞☞KIT	VD(+)	TBK353	
2.8 V6	AGE	132	05/97 → 09/99	⊗	A/C(-)	MVB1760R6	6PK1760
				⊗	A/C(+)	MVB1875R6	6PK1875
				☞☞☞		TB556	253x30
				☞☞☞KIT		TBK357	
				☞☞☞KIT	VD(+)	TBK353	
2.8 V6	ATX, BBG	140	09/99 → 11/00	⊗	A/C(-)	MVB1760R6	6PK1760
				⊗	A/C(+)	MVB1875R6	6PK1875
				☞☞☞		TB556	253x30
				☞☞☞KIT		TBK357	
				☞☞☞KIT	VD(+)	TBK353	
2.8 V6 Syncro/4motion	ACK, ALG, APR, AQD	142	10/96 → 11/00	⊗	A/C(-)	MVB1760R6	6PK1760
				⊗	A/C(+)	MVB1875R6	6PK1875
				☞☞☞		TB556	253x30
				☞☞☞KIT		TBK357	
				☞☞☞KIT	VD(+)	TBK353	

PASSAT (3B3)

1.6	ALZ	75	11/00 → 05/05	☼		MVB855R4	4PK855
				⊗		MVB1300R5	5PK1300
				☞☞☞		TB552	138x23
				☞☞☞KIT		TBK100	
1.8	APT	92	03/03 → 03/05	⊗		MVB1300R5	5PK1300
				☞☞☞	Hydr	TB555	153x25
				☞☞☞KIT		TBK330	
				☞☞☞KIT	VD(+)	TBK331	



kW



...VW

...PASSAT (3B3)

1.8 4motion		125	03/01 → 05/05	 KIT		MVB1300R5 TB554 TBK341	5PK1300 150x23
1.8 T 20V	AWL, AWT	110	11/00 → 05/05	 KIT		MVB1300R5 TB554 TBK341	5PK1300 150x23
1.9 TDI	AVB	74	11/00 → 05/05	 KIT	→07/02 →07/02, VD(+)	MVB855R4 MVB1432R5 TB680 TBK225 TBK269 TBK270	4PK855 5PK1432 120x30
	AVF, AWX	96	11/00 → 05/05	 KIT	→07/02 →07/02, VD(+) 08/02→	MVB855R4 MVB1432R5 TB680 TBK225 TBK269 TBK270	4PK855 5PK1432 120x30
1.9 TDI 4motion	AVF	96	11/00 → 05/05	 KIT	→07/02 →07/02, VD(+) 08/02→	MVB855R4 MVB1432R5 TB680 TBK225 TBK269 TBK270	4PK855 5PK1432 120x30
2.0	AZM, BFF	85	11/00 → 05/05	 KIT	Eng. AZM Eng. AZM	MVB855R4 MVB1300R5 TB552 TBK100	4PK855 5PK1300 138x23
	ALT	96	11/01 → 05/05	 KIT		MVB855R4 MVB1300R5 TB554 TBK341	4PK855 5PK1300 150x23
2.0 4motion	AZM	85	11/00 → 05/05	 KIT		MVB855R4 MVB1300R5 TB552 TBK100	4PK855 5PK1300 138x23
2.0 TDI	BGW	100	12/03 → 05/05	 KIT		MVB855R4 MVB1432R5 TB680 TBK270	4PK855 5PK1432 120x30
2.3 V5	AZX	125	11/00 → 05/05	 KIT	A/C(-) A/C(+)	MVB1660R6 MVB2373R6	6PK1660 6PK2373
2.3 V5 4motion	AZX	125	11/00 → 05/05	 KIT	A/C(-) A/C(+)	MVB1660R6 MVB2373R6	6PK1660 6PK2373
2.5 TDI	AFB, AKN	110	11/00 → 05/05	 KIT	→05/03 →05/03 →05/03 →05/03	MVB1238R4 MVB2403R6 TB642 TBK358 TB641	4PK1238 6PK2403 207x32 87x25
	BDG	120	05/03 → 05/05	 KIT	VD(+)	MVB1238R4 MVB2403R6 TB738 TBK348 TBK354 TB641	4PK1238 6PK2403 207x30 87x25

VW



kW



...VW

...PASSAT (3B3)

2.5 TDI 4motion	AFB, AKN	110	11/00 → 05/05	☼ ⊖ ☞ ☞ KIT ☞ ☞	→05/03 →05/03 →05/03 →05/03 →05/03	MVB1238R4 MVB2403R6 TB642 TBK358 TB641	4PK1238 6PK2403 207x32 87x25
	BAU, BDH	132	01/03 → 05/05	☼ ⊖ ☞ ☞ KIT ☞ ☞ KIT ☞ ☞ KIT ☞	VD(+)	MVB1238R4 MVB2403R6 TB738 TBK348 TBK354 TB641	4PK1238 6PK2403 207x30 87x25
2.8 4motion	AMX, ATQ	142	11/00 → 05/05	⊖ ⊖ ☞ ☞ KIT ☞ ☞ KIT ☞	A/C(-) A/C(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30
					VD(+)		

PASSAT (3C2)

1.4 TSI	CAXA	90	05/07 →	⊖ ⊖	A/C(-) A/C(+)	MVB1088R6 MVB1740R6	6PK1088 6PK1740
1.6	BSE, BSF	75	05/05 →	⊖ ☞ ☞ KIT	A/C(+)	MVB1045R6 TB552 TBK100	6PK1045 138x23
1.6 FSI	BLF	85	03/05 →	⊖	A/C(+)	MVB1740R6	6PK1740
1.8 TSI	BZB	118	05/07 →	⊖		MVB1115R6	6PK1115
1.9 TDI	BKC, BLS, BXE	77	03/05 →	⊖ ☞ ☞ KIT		MVB1050R6 TB680 TBK270	6PK1050 120x30
2.0 FSI	BLR, BLY, BVY, BVZ	110	03/05 →	⊖ ☞		MVB1045R6 TB753	6PK1045 148x23
2.0 FSI 4motion	BLX, BLY, BVX	110	09/05 →	⊖ ☞		MVB1045R6 TB753	6PK1045 148x23
2.0 TDI	BMR	125	08/05 →	⊖ ☞ ☞ KIT	→ Ch. 3C-6-300000	MVB1050R6 TB743 TBK262	6PK1050 141x30
	BMP	103	03/05 →	⊖ ☞ ☞ KIT		MVB1050R6 TB680 TBK270	6PK1050 120x30
2.0 TDI	BMA, CBAA	100	03/05 →	⊖ ☞ ☞ KIT	→ Ch. 3C-6-300000	MVB1050R6 TB743 TBK262	6PK1050 141x30
	BMP	103	03/05 →	⊖ ☞ ☞ KIT		MVB1050R6 TB680 TBK270	6PK1050 120x30
2.0 TDI 16V	BKP	103	03/05 →	⊖ ☞ ☞ KIT	→ Ch. 3C-6-300000	MVB1050R6 TB743 TBK262	6PK1050 141x30
2.0 TDI 16V 4motion	BKP	103	03/05 →	⊖ ☞ ☞ KIT	→ Ch. 3C-6-300000	MVB1050R6 TB743 TBK262	6PK1050 141x30
2.0 TFSI	AXX, BPY, BWA, CAWB, CBFA, CCTA	147	07/05 →	⊖ ☞	→07/07 →07/07	MVB1050R6 TB753	6PK1050 148x23
3.2 FSI	AXZ	184	11/05 →	⊖		MVB1625R6	6PK1625
3.2 FSI 4motion	AXZ	184	11/05 →	⊖		MVB1625R6	6PK1625
3.6 R36 4motion	BWS	220	04/07 →	⊖	→07/07	MVB1613R6	6PK1613



kW



...VW

PASSAT (32B)

1.3	FY	40	08/80 → 07/83		→07/81	SVB10690	10x690
					08/81 →	SVB10700	10x700
						TB107	108x19
	FZ	44	08/80 → 07/86		→07/81	SVB10690	10x690
					08/81 → 07/83	SVB10700	10x700
					08/83 → 07/85	SVB10940	10x940
					08/85 →	SVB10950	10x950
					→07/84	TB107	108x19
					08/83 →	TB108	121x18
					08/83 →	TBK016	
EP, EU	44	08/80 → 07/86		08/83 → 07/85	SVB10940	10x940	
				08/85 →	SVB10950	10x950	
				08/83 →	TB108	121x18	
1.6	PP	51	08/87 → 03/88		→ Ch. 32F299999	SVB13825	13x825
					Ch. 32F300001 →	SVB13800	13x800
						SVB10950	10x950
						TB108	121x18
						TBK016	
	RL	53	02/86 → 03/88		→ Ch. 32G275000	SVB10760	10x760
					Ch. 32G275001 →	SVB10850	10x850
					→ Ch. 32F299999	SVB13825	13x825
					Ch. 32F300001 →	SVB13800	13x800
						SVB10950	10x950
WV, YN	55	08/80 → 03/88			TB108	121x18	
					TBK016		
				→ Ch. 32G275000	SVB10760	10x760	
				Ch. 32G275001 →	SVB10850	10x850	
				→ Ch. 32F299999	SVB13825	13x825	
YP	63	01/81 → 02/83		Ch. 32F300001 →	SVB13800	13x800	
					SVB10940	10x940	
				→07/85	SVB10940	10x940	
				08/85 →	SVB10950	10x950	
					TB108	121x18	
DT	55	08/80 → 03/88			TBK016		
				→ Ch. 32G275000	SVB10760	10x760	
				Ch. 32G275001 →	SVB10850	10x850	
				→ Ch. 32F299999	SVB13825	13x825	
				Ch. 32F300001 →	SVB13800	13x800	
1.6 D	CR, JK	40	08/80 → 03/88		→07/85	SVB10940	10x940
					08/85 →	SVB10950	10x950
						TB108	121x18
						TBK016	
					→ Ch. 32G275000	SVB10760	10x760
					Ch. 32G275001 →	SVB10850	10x850
					→ Ch. 32F299999	SVB13825	13x825
					Ch. 32F300001 →	SVB13800	13x800
					A/C(-)	SVB10740	10x740
					A/C(+)	SVB10760	10x760
		TB225	135x25.4				
		TBK018					
		SVB10800	10x800				
		SVB10610	10x610				

VW



kW



...VW

...PASSAT (32B)

1.6 TD	CY	51	04/82 → 03/88	☼	→ Ch. 32F299999	SVB13825	13x825				
				☼	Ch. 32F300001→	SVB13800	13x800				
				⊖	A/C(-)	SVB10740	10x740				
				⊕	A/C(+)	SVB10760	10x760				
				⊕	A/C(+)	SVB10775	10x775				
				⊖		TB225	135x25.4				
				⊖		TBK018					
				⊖		SVB10800	10x800				
				⊖		SVB10610	10x610				
				RA		59	05/86 → 03/88	☼	→ Ch. 32F299999	SVB13825	13x825
								☼	Ch. 32F300001→	SVB13800	13x800
								⊖	A/C(-)	SVB10740	10x740
								⊕	A/C(+)	SVB10760	10x760
				⊕	A/C(+)	SVB10775	10x775				
				⊖		TB225	135x25.4				
				⊖		TBK018					
				⊖		SVB10800	10x800				
				⊖		SVB10610	10x610				
1.8	RM	64	05/86 → 03/88	☼	→ Ch. 32F299999	SVB13825	13x825				
				☼	Ch. 32F300001→	SVB13800	13x800				
				⊖		SVB10950	10x950				
				⊖		TB108	121x18				
				⊖		TBK016					
				⊖	→ Ch. 32G275000	SVB10760	10x760				
				⊖	Ch. 32G275001→	SVB10850	10x850				
				DS, JN		66	01/83 → 03/88	☼	→ Ch. 32F299999	SVB13825	13x825
								☼	Ch. 32F300001→	SVB13800	13x800
								⊖	→07/85	SVB10940	10x940
								⊖	08/85→	SVB10950	10x950
								⊖		TB108	121x18
								⊖		TBK016	
				⊖	→ Ch. 32G275000	SVB10760	10x760				
				⊖	Ch. 32G275001→	SVB10850	10x850				
	DZ	82	12/83 → 03/88	☼	→ Ch. 32F299999	SVB13825	13x825				
				☼	Ch. 32F300001→	SVB13800	13x800				
				⊖	→07/85	SVB10940	10x940				
				⊖	08/85→	SVB10950	10x950				
				⊖		TB108	121x18				
				⊖		TBK016					
				⊖	→ Ch. 32G275000	SVB10760	10x760				
				⊖	Ch. 32G275001→	SVB10850	10x850				
1.9	WN	85	01/81 → 07/83	☼		SVB131000	13x1000				
				⊖	A/C(-), → Ch. 32F300000	SVB10800	10x800				
				⊖	A/C(-), Ch. 32F300001→	SVB10825	10x825				
				⊖	A/C(+)	SVB10850	10x850				
				⊖		TB602	113x19				
				2.0		HP, JS	85	08/83 → 03/88	☼	SVB131000	13x1000
				⊖	A/C(-), → Ch. 32F300000	SVB10800	10x800				
				⊖	A/C(-), Ch. 32F300001→	SVB10825	10x825				
				⊖	A/C(+)	SVB10850	10x850				
				⊖	→07/84	TB602	113x19				
				⊖	08/84→	TB207	120x18				
				⊖	08/84→	TBK048					



kW



...VW

...PASSAT (32B)

2.2	KX	85	08/85 → 03/88	⊗		SVB131000	13x1000	
				⊗	A/C(-), → Ch. 32F300000	SVB10800	10x800	
				⊗	A/C(-), Ch. 32F300001→	SVB10825	10x825	
				⊗	A/C(+)	SVB10850	10x850	
						TB207	120x18	
			TBK048					
		KV	100	01/85 → 03/88	⊗		SVB131000	13x1000
	⊗				A/C(-), → Ch. 32F300000	SVB10800	10x800	
	⊗				A/C(-), Ch. 32F300001→	SVB10825	10x825	
	⊗				A/C(+)	SVB10850	10x850	
					TB207	120x18		
				TBK048				

PASSAT Saloon (32B)

1.6	DT	55	01/85 → 03/88	⊗	→ Ch. 32F299999	SVB13825	13x825	
				⊗	Ch. 32F300001→	SVB13800	13x800	
				⊗	→07/85	SVB10940	10x940	
				⊗	08/85→	SVB10950	10x950	
						TB108	121x18	
			TBK016					
		RF, RL	53	01/85 → 03/88	⊗	→ Ch. 32G275000	SVB10760	10x760
	⊗				Ch. 32G275001→	SVB10850	10x850	
	⊗				→ Ch. 32F299999	SVB13825	13x825	
	⊗				Ch. 32F300001→	SVB13800	13x800	
⊗	→07/85				SVB10940	10x940		
				SVB10950	10x950			
				TB108	121x18			
				TBK016				
				⊗	→ Ch. 32G275000	SVB10760	10x760	
				⊗	Ch. 32G275001→	SVB10850	10x850	
	PP	51	08/87 → 03/88	⊗	→ Ch. 32F299999	SVB13825	13x825	
⊗				Ch. 32F300001→	SVB13800	13x800		
⊗					SVB10950	10x950		
					TB108	121x18		
					TBK016			
				⊗	→ Ch. 32G275000	SVB10760	10x760	
				⊗	Ch. 32G275001→	SVB10850	10x850	
1.6 TD	CY	51	01/85 → 03/88	⊗	→ Ch. 32F299999	SVB13825	13x825	
				⊗	Ch. 32F300001→	SVB13800	13x800	
				⊗	A/C(-)	SVB10740	10x740	
				⊗	A/C(+)	SVB10760	10x760	
				⊗	A/C(+)	SVB10775	10x775	
					TB225	135x25.4		
					TBK018			
					⊗		SVB10800	10x800
					⊗		SVB10610	10x610
	1.8	DS, JN	66	01/85 → 03/88	⊗	→ Ch. 32F299999	SVB13825	13x825
⊗					Ch. 32F300001→	SVB13800	13x800	
⊗					→07/85	SVB10940	10x940	
⊗					08/85→	SVB10950	10x950	
						TB108	121x18	
					TBK016			
					⊗	→ Ch. 32G275000	SVB10760	10x760
					⊗	Ch. 32G275001→	SVB10850	10x850
		RM	64	05/86 → 03/88	⊗	→ Ch. 32F299999	SVB13825	13x825
⊗					Ch. 32F300001→	SVB13800	13x800	
⊗					SVB10950	10x950		
					TB108	121x18		
					TBK016			
				⊗	→ Ch. 32G275000	SVB10760	10x760	
				⊗	Ch. 32G275001→	SVB10850	10x850	



kW



...VW

...PASSAT Saloon (32B)

2.2	KX	85	01/85 → 03/88	☼		SVB131000	13x1000
				⊗	A/C(-), → Ch. 32F300000	SVB10800	10x800
				⊗	A/C(-), Ch. 32F300001→	SVB10825	10x825
				⊗	A/C(+)	SVB10850	10x850
				☼		TB207	120x18
				☼	KIT	TBK048	

PASSAT Variant (3A5, 35I)

1.6	1F, EZ	53	04/88 → 09/91	☼		SVB13950	13x950
				⊗	Eng. 1F, A/C(-), MS	SVB10950	10x950
				⊗	Eng. 1F, A/C(-), PS	SVB12865	12x865
				☼		TB108	121x18
				☼	KIT	TBK016	
				⊗	Eng. 1F	SVB10735	10x735
				⊗	Eng. 1F, A/C(-)	SVB10625	10x625
	EZ	55	04/88 → 12/88	☼		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB12865	12x865
				☼		TB108	121x18
				☼	KIT	TBK016	
				⊗	A/C(-)	SVB10735	10x735
				⊗	A/C(+)	SVB10625	10x625
	AEK, AFT	74	07/94 → 12/95	⊗	A/C(-), Auto Tensioner	MVB975R6	6PK975
				⊗	A/C(-), Manu Tensioner	MVB890R6	6PK890
				⊗	A/C(+)	MVB1155R6	6PK1155
				☼		TB108	121x18
				☼	KIT	TBK016	
				⊗	A/C(-)	SVB12685	12x685
				⊗	A/C(+)	SVB12760	12x760
1.6 TD	RA, SB	59	08/88 → 09/93	☼		SVB13950	13x950
				⊗	Eng. SB, A/C(-)	SVB12950	12x950
				⊗	Eng. SB, A/C(+)	SVB10700	10x700
				☼		TB225	135x25.4
				☼	KIT	TBK018	
				⊗	Eng. SB	SVB10740	10x740
				⊗	Eng. SB, → Ch. 31M200000	SVB12650	12x650
				⊗	Eng. SB, Ch. 31M200001→		
1.8	PB	82	04/88 → 07/92	☼		SVB13950	13x950
				⊗	A/C(-), MS	SVB10950	10x950
				⊗	A/C(-), PS	SVB12865	12x865
				☼		TB108	121x18
				☼	KIT	TBK016	
				⊗	A/C(-)	SVB10735	10x735
				⊗	A/C(+)	SVB10625	10x625
	AAM	55	08/90 → 05/97	☼	→09/93	SVB13950	13x950
				⊗	A/C(-), Auto Tensioner, 10/93→12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95→10/96	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner, 10/93→10/96	MVB890R6	6PK890
				⊗	A/C(-), MS, →09/93	SVB10950	10x950
				⊗	A/C(-), PS, →09/93	SVB12865	12x865
				⊗	A/C(+), 10/93→10/96	MVB1155R6	6PK1155
				⊗	A/C(+), PS, →09/93	SVB10625	10x625
				☼	→10/96	TB108	121x18
				☼	→10/96	TBK016	
				⊗	A/C(-), →09/93	SVB10735	10x735
				⊗	A/C(-), 10/93→10/96	SVB12685	12x685
				⊗	A/C(+), 10/93→10/96	SVB12760	12x760



kW



...VW

...PASSAT Variant (3A5, 35I)

Engine	Options	kW	Year Range	Timing	Accessories	Part Numbers	Dimensions
...1.8	ABS, ADZ, RP	66	02/88 → 05/97	⊗	→09/93	SVB13950	13x950
				⊗	A/C(-), Auto Tensioner, 10/93→12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95→10/96	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner, 10/93→10/96	MVB890R6	6PK890
				⊗	A/C(-), MS, →09/93	SVB10950	10x950
				⊗	A/C(-), PS, →09/93	SVB12865	12x865
				⊗	A/C(+), 10/93→10/96	MVB1155R6	6PK1155
				⊗	A/C(+), PS, →09/93	SVB10625	10x625
				⊗	→10/96	TB108	121x18
				⊗	→10/96	TBK016	
1.8 16V	KR	100	04/88 → 12/89	⊗		SVB13950	13x950
				⊗	A/C(-)	SVB10950	10x950
				⊗	A/C(+)	SVB10625	10x625
				⊗		TB505	147x25.4
				⊗		TBK066	
1.8 G60 Syncro	PG	118	08/88 → 05/97	⊗	A/C(-), 09/89→07/93	MVB1650R6	6PK1650
				⊗	A/C(+), 09/89→07/93	MVB1755R6	6PK1755
				⊗	09/89→07/93	TB108	121x18
				⊗	09/89→07/93	TBK016	
				⊗	A/C(-), 09/89→07/93	SVB10665	10x665
1.9 D	1Y	50	05/89 → 10/93	⊗	A/C(+), 09/89→07/93	SVB10740	10x740
				⊗		SVB13950	13x950
				⊗	→11/91	SVB12950	12x950
				⊗	A/C(-), Auto Tensioner, 11/91→	MVB925R6	6PK925
				⊗	A/C(-), Manu Tensioner, 11/91→	MVB1045R6	6PK1045
1.9 TD	AAZ	55	03/91 → 05/97	⊗	A/C(+), →11/91	SVB10700	10x700
				⊗	A/C(+), 11/91→	MVB1150R6	6PK1150
				⊗		TB384	137x25.4
				⊗		TBK024	
				⊗	→01/91	SVB10740	10x740
				⊗	01/91→11/91	SVB12650	12x650
				⊗	A/C(-), 11/91→	SVB12735	12x735
				⊗	A/C(+), 11/91→	SVB11790	11x790
				⊗	A/C(-), Auto Tensioner, →09/93	MVB925R6	6PK925
				⊗	A/C(-), Manu Tensioner, →09/93	MVB1045R6	6PK1045
1.9 TD	AAZ	55	03/91 → 05/97	⊗	A/C(+), →09/93	MVB1150R6	6PK1150
				⊗	→09/93	TB384	137x25.4
				⊗	→09/93	TBK024	
				⊗	A/C(-), →09/93	SVB12735	12x735
				⊗	A/C(+), →09/93	SVB11790	11x790

VW



kW



...VW
...PASSAT Variant (3A5, 35I)

Engine	Code	Power (kW)	Period	Notes	Eng. Description	Part Number	Dimensions			
1.9 TDI	1Z, AHU	66	10/93 → 05/97	⊗	Eng. 1Z, A/C(-), Auto Tensioner	MVB925R6	6PK925			
				⊗	Eng. 1Z, A/C(-), Manu Tensioner	MVB1045R6	6PK1045			
				⊗	Eng. 1Z, A/C(+)	MVB1150R6	6PK1150			
						TB384	137x25.4			
					→07/94, → Eng Nr 1Z289575	TBK119				
					07/94→, Eng Nr 1Z289576→	TBK026				
				⊗	Eng. 1Z, A/C(-)	SVB12735	12x735			
				⊗	Eng. 1Z, A/C(+)	SVB11790	11x790			
				AFN	81	03/96 → 05/97	⊗	A/C(-), →10/96	MVB1045R6	6PK1045
							⊗	A/C(+), →10/96	MVB1150R6	6PK1150
	→10/96	TB384	137x25.4							
	→10/96	TBK026								
⊗	A/C(-), →10/96	SVB12735	12x735							
⊗	A/C(+), →10/96	SVB11790	11x790							
66	04/88 → 07/91		⊗	A/C(-)	MVB1045R6	6PK1045				
			⊗	A/C(+)	MVB1150R6	6PK1150				
					TB384	137x25.4				
				→ Eng Nr 1Z289575	TBK119					
			⊗	A/C(-)	SVB12735	12x735				
			⊗	A/C(+)	SVB11790	11x790				
			2.0	2E, ADY, AGG	85	02/90 → 05/97	⊗	→09/93, → Ch. 31-N-400000	SVB13950	13x950
							⊗	A/C(-), Auto Tensioner, →09/93, Ch. 31-N-400001→	MVB975R6	6PK975
							⊗	Eng. 2E, A/C(-), Manu Tensioner, →09/93, Ch. 31-N-400001→	MVB890R6	6PK890
							⊗	Eng. 2E, A/C(-), MS, →09/93, → Ch. 31-N-400000	SVB10950	10x950
⊗	Eng. 2E, A/C(-), PS, →09/93, → Ch. 31-N-400000	SVB12865					12x865			
⊗	Eng. 2E, A/C(+), →09/93, Ch. 31-N-400001→	MVB1155R6					6PK1155			
	→09/93	TB506					124x18			
	→09/93	TBK076								
⊗	Eng. 2E, A/C(-), →09/93, → Ch. 31-N-400000	SVB10735					10x735			
⊗	Eng. 2E, A/C(-), →09/93, Ch. 31-N-400001→	SVB12685					12x685			
⊗	Eng. 2E, A/C(+), →09/93, → Ch. 31-N-400000	SVB10625	10x625							
⊗	Eng. 2E, A/C(+), →09/93, Ch. 31-N-400001→	SVB12760	12x760							
AEP	79	03/95 → 08/96	⊗	A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975				
			⊗	A/C(-), Auto Tensioner, 12/95→	MVB1035R6	6PK1035				
			⊗	A/C(-), Manu Tensioner	MVB890R6	6PK890				
			⊗	A/C(+)	MVB1155R6	6PK1155				
					TB506	124x18				
					TBK076					
⊗	A/C(-)	SVB12685	12x685							
⊗	A/C(+)	SVB12760	12x760							



kW



...VW

...PASSAT Variant (3A5, 35I)

2.0 Syncro	2E, ADY, AGG	85	10/90 → 05/97	⊗	→09/93, → Ch. 31-N-400000	SVB13950	13x950
				⊗	A/C(-), Auto Tensioner, →09/93, Ch. 31-N-400001→	MVB975R6	6PK975
				⊗	Eng. 2E, A/C(-), Manu Tensioner, →09/93, Ch. 31-N-400001→	MVB890R6	6PK890
				⊗	Eng. 2E, A/C(-), MS, →09/93, → Ch. 31-N-400000	SVB10950	10x950
				⊗	Eng. 2E, A/C(-), PS, →09/93, → Ch. 31-N-400000	SVB12865	12x865
				⊗	Eng. 2E, A/C(+), →09/93, Ch. 31-N-400001→	MVB1155R6	6PK1155
					→09/93	TB506	124x18
					→09/93	TBK076	
				⊗	A/C(-), →09/93, Ch. 31-N-400001→	SVB12685	12x685
				⊗	Eng. 2E, A/C(-), →09/93, → Ch. 31-N-400000	SVB10735	10x735
⊗	Eng. 2E, A/C(+), →09/93, → Ch. 31-N-400000	SVB10625	10x625				
⊗	Eng. 2E, A/C(+), →09/93, Ch. 31-N-400001→	SVB12760	12x760				
2.0 16V	9A	100	08/88 → 09/93	⊗		SVB13950	13x950
				⊗	A/C(-)	SVB10950	10x950
						TB505	147x25.4
						TBK066	
				⊗		SVB10625	10x625
ABF	110	01/94 → 05/97	⊗	A/C(-), →12/95	MVB975R6	6PK975	
			⊗	A/C(+), 12/95→10/96	MVB1155R6	6PK1155	
				→10/96	TB441	151x25.4	
			⊗	A/C(-), →10/96	SVB12685	12x685	
			⊗	A/C(+), →10/96	SVB12760	12x760	
2.8 VR6	AAA	128	06/91 → 05/97	⊗	A/C(-)	MVB1285R7	7PK1285
				⊗	A/C(+)	MVB1360R7D	7DPK1360
2.9 VR6 Syncro	ABV	135	01/94 → 05/97	⊗	A/C(-)	MVB1285R7	7PK1285
				⊗	A/C(+)	MVB1360R7D	7DPK1360

PASSAT Variant (3B5)

1.6	ADP, AHL, ANA, ARM	74	06/97 → 11/00	⊗		MVB855R4	4PK855
				⊗		MVB1300R5	5PK1300
						TB552	138x23
					→10/97	TB463	121x18
						TBK100	
					→10/97	TBK309	
1.8	ADR, APT, ARG	92	06/97 → 11/00	⊗	Eng. ADR	MVB855R4	4PK855
				⊗	Eng. ADR	MVB1300R5	5PK1300
					Hydr	TB555	153x25
					Eng. ADR	TBK330	
					Eng. ADR, VD(+)	TBK331	
				⊗		SVB12528	12x528
AFY	85	06/97 → 11/00	⊗		MVB855R4	4PK855	
			⊗		MVB1300R5	5PK1300	
				Hydr	TB555	153x25	
				Thermo	TB464	152x25.4	
					TBK330		
				VD(+)	TBK331		
⊗		SVB12528	12x528				



kW



...VW

...PASSAT Variant (3B5)

1.8 Syncro/4motion	ADR, APT, ARG	92	06/97 → 11/00	⊗	Eng. ADR	MVB855R4	4PK855
				⊖	Eng. ADR	MVB1300R5	5PK1300
				⊗	Hydr	TB555	153x25
				⊗	Eng. ADR	TBK330	
				⊗	Eng. ADR, VD(+)	TBK331	
1.8 T	AEB, ANB, APU	110	06/97 → 11/00	⊗		MVB855R4	4PK855
				⊖		MVB1300R5	5PK1300
				⊗	08/99→	TB554	150x23
				⊗	Hydr	TB555	153x25
				⊗	Thermo	TB464	152x25.4
				⊗	06/00→	TBK115	
				⊗	08/99→	TBK341	
				⊗	Eng. AEB	TBK330	
				⊗	Eng. AEB, VD(+)	TBK331	
				⊗		SVB12528	12x528
1.9 TDI	AHH, AHU	66	06/97 → 11/00	⊗	Eng. AHH	MVB855R4	4PK855
				⊖	Eng. AHH	MVB1590R5	5PK1590
				⊗		TB384	137x25.4
				⊗	→04/99	TB384	137x25.4
				⊗		TBK026	
	AFN, AVG	81	06/97 → 11/00	⊗		MVB855R4	4PK855
				⊖		MVB1590R5	5PK1590
				⊗		TB384	137x25.4
	AJM, ATJ	85	08/98 → 11/00	⊗	Eng. ATJ	MVB855R4	4PK855
				⊖	Eng. ATJ	MVB1432R5	5PK1432
	AVB	74	02/00 → 11/00	⊗		TB680	120x30
				⊖		TBK225	
				⊗		TBK269	
				⊗	Eng. ATJ, VD(+)	TBK269	
				⊗	VD(+)	TBK269	
1.9 TDI 4motion	ATJ	85	08/99 → 11/00	⊗		MVB855R4	4PK855
				⊖		MVB1432R5	5PK1432
				⊗		TB680	120x30
				⊗		TBK225	
1.9 TDI Syncro/4motion	AFN, AVG	81	06/97 → 11/00	⊗		TBK269	
				⊖		MVB855R4	4PK855
				⊗		MVB1590R5	5PK1590
2.0	ASU, AUZ	88	04/00 → 11/00	⊗		TB384	137x25.4
				⊖		TBK026	
				⊗		MVB855R4	4PK855
2.0 4motion	ASU, AUZ	88	04/00 → 11/00	⊗		MVB855R4	4PK855
				⊖		MVB1300R5	5PK1300
2.3 VR5	AGZ	110	06/97 → 11/00	⊗	A/C(-)	MVB1660R6	6PK1660
				⊖	A/C(+)	MVB2373R6	6PK2373
2.3 VR5 Syncro/4motion	AGZ	110	10/97 → 11/00	⊗	A/C(-)	MVB1660R6	6PK1660
				⊖	A/C(+)	MVB2373R6	6PK2373
2.5 TDI	AFB, AKN	110	07/98 → 11/00	⊗		MVB1238R4	4PK1238
				⊖		MVB2403R6	6PK2403
				⊗		TB642	207x32
				⊗		TBK358	
				⊗		TB641	87x25



kW



...VW

...PASSAT Variant (3B5)

2.5 TDI Syncro/4motion	AFB, AKN	110	12/98 → 11/00	 		MVB1238R4 MVB2403R6 TB642 TBK358 TB641	4PK1238 6PK2403 207x32 87x25
2.8 V6	ACK, APR, AQD	142	06/97 → 11/00	 	A/C(-) A/C(+) VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30
	AGE	132	09/97 → 09/99	 	A/C(-) A/C(+) VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30
	ATX	140	09/99 → 11/00	 	A/C(-), 09/00→ A/C(+), 09/00→ 09/00→ 09/00→ 09/00→, VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30
2.8 V6 Syncro/4motion	ACK, ALG, APR, AQD	142	06/97 → 11/00	 	A/C(-) A/C(+) VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30

PASSAT Variant (3B6)

1.6	ALZ	75	11/00 → 05/05	 		MVB855R4 MVB1300R5 TB552 TBK100	4PK855 5PK1300 138x23
1.8 T 20V	AWT	110	11/00 → 05/05	 		MVB855R4 MVB1300R5 TB554 TBK341	4PK855 5PK1300 150x23
1.9 TDI	AVB	74	11/00 → 05/05	 	→07/02 →07/02, VD(+) 08/02→	MVB855R4 MVB1432R5 TB680 TBK225 TBK269 TBK270	4PK855 5PK1432 120x30
	AVF, AWX	96	11/00 → 05/05	 	→07/02 →07/02, VD(+) 08/02→	MVB855R4 MVB1432R5 TB680 TBK225 TBK269 TBK270	4PK855 5PK1432 120x30
1.9 TDI 4motion	AVF	96	11/00 → 05/05	 	→07/02 →07/02, VD(+) 08/02→	MVB855R4 MVB1432R5 TB680 TBK225 TBK269 TBK270	4PK855 5PK1432 120x30
2.0	AZM	85	11/00 → 05/05	 		MVB855R4 MVB1300R5 TB552 TBK100	4PK855 5PK1300 138x23
	ALT	96	11/01 → 05/05	 		MVB855R4 MVB1300R5 TB554 TBK341	4PK855 5PK1300 150x23



kw



...VW

...PASSAT Variant (3B6)

2.0 4motion	AZM	85	11/00 → 05/05	 		MVB855R4 MVB1300R5 TB552 TBK100	4PK855 5PK1300 138x23
2.0 TDI	BGW	100	12/03 → 05/05	 		MVB855R4 MVB1432R5 TB680 TBK270	4PK855 5PK1432 120x30
2.3 VR5	AZX	125	11/00 → 05/05	 	A/C(-) A/C(+)	MVB1660R6 MVB2373R6	6PK1660 6PK2373
2.3 VR5 4motion	AZX	125	11/00 → 05/05	 	A/C(-) A/C(+)	MVB1660R6 MVB2373R6	6PK1660 6PK2373
2.5 TDI	AFB, AKN	110	11/00 → 05/05	 	→-05/03 →-05/03 →-05/03 →-05/03	MVB1238R4 MVB2403R6 TB642 TBK358 TB641	4PK1238 6PK2403 207x32 87x25
	BDG	120	05/03 → 05/05	 	VD(+)	MVB1238R4 MVB2403R6 TB738 TBK348 TBK354 TB641	4PK1238 6PK2403 207x30 87x25
2.5 TDI 4motion	AFB, AKN	110	11/00 → 05/05	 	→-05/03 →-05/03 →-05/03 →-05/03	MVB1238R4 MVB2403R6 TB642 TBK358 TB641	4PK1238 6PK2403 207x32 87x25
	BAU, BDH	132	01/03 → 05/05	 	VD(+)	MVB1238R4 MVB2403R6 TB738 TBK348 TBK354 TB641	4PK1238 6PK2403 207x30 87x25
2.8 4motion	AMX, ATQ	142	11/00 → 05/05	 	A/C(-) A/C(+) VD(+)	MVB1760R6 MVB1875R6 TB556 TBK357 TBK353	6PK1760 6PK1875 253x30

PASSAT Variant (3C5)

1.4 TSI	CAXA	90	05/07 →	 	A/C(-) A/C(+)	MVB1088R6 MVB1740R6	6PK1088 6PK1740
1.6	BSE, BSF	75	08/05 →	 	A/C(+)	MVB1045R6 TB552 TBK100	6PK1045 138x23
1.6 FSI	BLF	85	08/05 →			MVB1740R6	6PK1740
1.8 TSI	BZB	118	05/07 →			MVB1115R6	6PK1115
1.9 TDI	BKC, BLS, BXE	77	08/05 →	 		MVB1050R6 TB680 TBK270	6PK1050 120x30
2.0 FSI	BLR, BLY, BVY, BVZ	110	08/05 →	 		MVB1045R6 TB753	6PK1045 148x23
2.0 FSI 4motion	BLX, BLY, BVX	110	09/05 →	 		MVB1045R6 TB753	6PK1045 148x23



kW



...VW

...PASSAT Variant (3C5)

2.0 TDI	BVD, BVE	90	08/05 →	 KIT	→ Ch. 3C-6-300000	MVB1050R6 TB743 TBK262	6PK1050 141x30
	BMA, CBAA	100	08/05 →	 KIT	→ Ch. 3C-6-300000	MVB1050R6 TB743 TBK262	6PK1050 141x30
	BMR	125	08/05 →	 KIT	→ Ch. 3C-6-300000	MVB1050R6 TB743 TBK262	6PK1050 141x30
	BMP	103	08/05 →	 KIT		MVB1050R6 TB680 TBK270	6PK1050 120x30
2.0 TDI 4motion	BMP	103	08/05 →	 KIT		MVB1050R6 TB680 TBK270	6PK1050 120x30
2.0 TDI 16V	BKP	103	08/05 →	 KIT	→ Ch. 3C-6-300000	MVB1050R6 TB743 TBK262	6PK1050 141x30
2.0 TDI 16V 4motion	BKP	103	08/05 →	 KIT	→ Ch. 3C-6-300000	MVB1050R6 TB743 TBK262	6PK1050 141x30
2.0 TFSI	AXX, BPY, BWA, CAWB, CBFA, CCTA	147	08/05 →	 		MVB1050R6 TB753	6PK1050 148x23
3.2 FSI	AXZ	184	11/05 →			MVB1625R6	6PK1625
3.2 FSI 4motion	AXZ	184	11/05 →			MVB1625R6	6PK1625
3.6 R36 4motion	BWS	220	04/07 →		→07/07	MVB1613R6	6PK1613

PASSAT Variant (32B)

1.3	FY	40	08/80 → 07/83		→07/81	SVB13900	13x900
						SVB10700	10x700
					→07/81, Ch. 32A0100001→	SVB10690	10x690
						TB107	108x19
					→07/81	SVB10875	10x875
44	FZ	08/80 → 07/86		→07/81	SVB13900	13x900	
				→07/81, Ch. 32A0100001→	SVB10690	10x690	
				→07/83	SVB10700	10x700	
				08/83→07/85	SVB10940	10x940	
				08/85→	SVB10950	10x950	
				→07/84	TB107	108x19	
				08/83→	TB108	121x18	
			 KIT	08/83→	TBK016		
				→07/81	SVB10875	10x875	
				08/83→07/85	SVB10940	10x940	
44	EP, EU	08/80 → 07/86		08/85→	SVB10950	10x950	
				08/83→	TB108	121x18	
			 KIT	08/83→	TBK016		
1.6	PP	51	08/87 → 03/88		→ Ch. 32F299999	SVB13825	13x825
					Ch. 32F300001→	SVB13800	13x800
						SVB10950	10x950
						TB108	121x18
				 KIT		TBK016	
	53	RL	02/86 → 03/88		→ Ch. 32G275000	SVB10760	10x760
					Ch. 32G275001→	SVB10850	10x850
					→ Ch. 32F299999	SVB13825	13x825
					Ch. 32F300001→	SVB13800	13x800
						SVB10950	10x950
		TB108	121x18				
 KIT		TBK016					
	→ Ch. 32G275000	SVB10760	10x760				
	Ch. 32G275001→	SVB10850	10x850				



kW



...VW

...PASSAT Variant (32B)

Engine	Model	Power (kW)	Period	Accessories	Part Numbers	Dimensions			
...1.6	WV, YN	55	08/80 → 03/88	☼	→ Ch. 32F299999	SVB13825 13x825			
				☼	→07/81	SVB13900 13x900			
				☼	Ch. 32F300001→	SVB13800 13x800			
				⊗		SVB10950 10x950			
				⊗	→07/85	SVB10940 10x940			
				⌘		TB108 121x18			
				⌘KIT		TBK016			
				⊕	→ Ch. 32G275000	SVB10760 10x760			
				⊕	→07/81	SVB10875 10x875			
				⊕	Ch. 32G275001→	SVB10850 10x850			
YP	63	01/81 → 02/83	☼	→ Ch. 32F299999	SVB13825 13x825				
			☼	→07/81	SVB13900 13x900				
			☼	Ch. 32F300001→	SVB13800 13x800				
			⊗		SVB10940 10x940				
			⊗	→07/81	SVB10950 10x950				
			⌘		TB108 121x18				
			⌘KIT		TBK016				
			⊕	→ Ch. 32G275000	SVB10760 10x760				
			⊕	→07/81	SVB10875 10x875				
			⊕	Ch. 32G275001→	SVB10850 10x850				
DT	55	08/80 → 03/88	☼	→ Ch. 32F299999	SVB13825 13x825				
			☼	Ch. 32F300001→	SVB13800 13x800				
			⊗	→07/85	SVB10940 10x940				
			⊗	08/85→	SVB10950 10x950				
			⌘		TB108 121x18				
			⌘KIT		TBK016				
			⊕	→ Ch. 32G275000	SVB10760 10x760				
			⊕	Ch. 32G275001→	SVB10850 10x850				
			1.6 D	CR, JK	40	08/80 → 03/88	☼	→ Ch. 32F299999	SVB13825 13x825
							☼	Eng. JK, Ch. 32F300001→	SVB13800 13x800
⊗	Eng. JK, A/C(-)	SVB10740 10x740							
⊗	Eng. JK, A/C(+)	SVB10760 10x760							
⌘		TB225 135x25.4							
⌘KIT	Eng. JK	TBK018							
⊕	Eng. JK	SVB10800 10x800							
⊕	Eng. JK	SVB10610 10x610							
1.6 TD	CY	51	04/82 → 03/88	☼	→ Ch. 32F299999	SVB13825 13x825			
				☼	Ch. 32F300001→	SVB13800 13x800			
				⊗	A/C(-)	SVB10740 10x740			
				⊗	A/C(+)	SVB10760 10x760			
				⊗	A/C(+)	SVB10775 10x775			
				⌘		TB225 135x25.4			
				⌘KIT		TBK018			
				⊕		SVB10800 10x800			
⊕		SVB10610 10x610							



kW



...VW

...PASSAT Variant (32B)

1.8	RM	64	05/86 → 03/88	⊗	→ Ch. 32F299999	SVB13825	13x825
				⊗	Ch. 32F300001→	SVB13800	13x800
				⊗		SVB10950	10x950
						TB108	121x18
				KIT		TBK016	
				⊗	→ Ch. 32G275000	SVB10760	10x760
				⊗	Ch. 32G275001→	SVB10850	10x850
	DS, JN	66	01/83 → 03/88	⊗	08/83→, → Ch. 32F299999	SVB13825	13x825
				⊗	08/83→, Ch. 32F300001→	SVB13800	13x800
				⊗	08/83→07/85	SVB10940	10x940
				⊗	08/85→	SVB10950	10x950
					08/83→	TB108	121x18
				KIT	08/83→	TBK016	
				⊗	08/83→, → Ch. 32G275000	SVB10760	10x760
				⊗	08/83→, Ch. 32G275001→	SVB10850	10x850
	DZ	82	12/83 → 03/88	⊗	→ Ch. 32F299999	SVB13825	13x825
				⊗	Ch. 32F300001→	SVB13800	13x800
				⊗	→07/85	SVB10940	10x940
				⊗	08/85→	SVB10950	10x950
						TB108	121x18
				KIT		TBK016	
				⊗	→ Ch. 32G275000	SVB10760	10x760
				⊗	Ch. 32G275001→	SVB10850	10x850
1.8 Syncro	DS, JN	66	01/86 → 03/88	⊗	→ Ch. 32F299999	SVB13825	13x825
				⊗	Ch. 32F300001→	SVB13800	13x800
				⊗		SVB10950	10x950
						TB108	121x18
				KIT		TBK016	
				⊗	→ Ch. 32G275000	SVB10760	10x760
				⊗	Ch. 32G275001→	SVB10850	10x850
1.9	WN	85	01/81 → 07/83	⊗		SVB131000	13x1000
				⊗	A/C(-), → Ch. 32F300000	SVB10800	10x800
				⊗	A/C(-), Ch. 32F300001→	SVB10825	10x825
				⊗	A/C(+)	SVB10850	10x850
						TB602	113x19
2.0	HP, JS	85	08/83 → 03/88	⊗		SVB131000	13x1000
				⊗	A/C(-), → Ch. 32F300000	SVB10800	10x800
				⊗	A/C(-), Ch. 32F300001→	SVB10825	10x825
				⊗	A/C(+)	SVB10850	10x850
					→07/84	TB602	113x19
					08/84→	TB207	120x18
				KIT	08/84→	TBK048	
2.0 Syncro	JS	85	05/84 → 03/88	⊗		SVB131000	13x1000
				⊗	A/C(-), → Ch. 32F300000	SVB10800	10x800
				⊗	A/C(-), Ch. 32F300001→	SVB10825	10x825
				⊗	A/C(+)	SVB10850	10x850
						TB207	120x18
					→07/84	TB602	113x19
				KIT		TBK048	
2.2	KX	85	08/85 → 03/88	⊗		SVB131000	13x1000
				⊗	A/C(-), → Ch. 32F300000	SVB10800	10x800
				⊗	A/C(-), Ch. 32F300001→	SVB10825	10x825
				⊗	A/C(+)	SVB10850	10x850
						TB207	120x18
				KIT		TBK048	
	KV	100	01/85 → 03/88	⊗		SVB131000	13x1000
				⊗	A/C(-), → Ch. 32F300000	SVB10800	10x800
				⊗	A/C(-), Ch. 32F300001→	SVB10825	10x825
				⊗	A/C(+)	SVB10850	10x850
						TB207	120x18
				KIT		TBK048	

VW



kW



...VW

...PASSAT Variant (32B)

2.2 Syncro	JT	88	08/85 → 03/88	 KIT	A/C(-), → Ch. 32F300000 A/C(-), Ch. 32F300001→ A/C(+) MS PS	SVB131000 SVB10800 SVB10825 SVB10850 TB207 TBK048	13x1000 10x800 10x825 10x850 120x18
------------	----	----	---------------	------------------------------------	---	--	---

PHAETON (3D2)

3.0 V6 TDI 4motion	BMK	165	09/04 →	 KIT	MS PS	MVB2475R6 TB760 TB556	6PK2475 83x24 253x30
--------------------	-----	-----	---------	------------------------	----------	--	----------------------------

POLO (6N1)

1.7 SDI	AHG	42	04/97 → 10/99	 KIT	MS PS	MVB1225R5 TB657 TBK112	5PK1225 137x23
45 1.0	AEV	33	10/94 → 09/96	 KIT	MS PS	MVB750R6 MVB1065R6 TB465	6PK750 6PK1065 132x19
50 1.0	AER, ALL	37	09/96 → 10/99	 KIT	A/C(-), MS A/C(-), PS A/C(+), PS	MVB750R6 MVB1065R6 MVB1125R6 TB466 TBK087	6PK750 6PK1065 6PK1125 135x19
55 1.3	ADX	40	10/94 → 07/95	 KIT	A/C(-), MS A/C(-), PS A/C(+), PS	MVB750R6 MVB1065R6 MVB1125R6 TB466 TBK087	6PK750 6PK1065 6PK1125 135x19
55 1.4	AEX	40	08/95 → 10/99	 KIT	A/C(-), MS A/C(-), PS A/C(+), PS	MVB750R6 MVB1065R6 MVB1125R6 TB466 TBK087	6PK750 6PK1065 6PK1125 135x19
60 1.4	AEX, AKV, APQ	44	07/95 → 10/99	 KIT	A/C(-), MS A/C(-), PS A/C(+), PS	MVB750R6 MVB1065R6 MVB1125R6 TB466 TBK087	6PK750 6PK1065 6PK1125 135x19
60 1.7 SDI	AKU	44	08/97 → 10/99	 KIT	A/C(-), MS A/C(-), PS A/C(+), PS	MVB1225R5 TB657 TBK112	5PK1225 137x23
64 1.9 D	AEF	47	10/94 → 10/99	 KIT	A/C(-), MS A/C(-), PS A/C(+), PS	MVB1225R5 TB657 TBK093	5PK1225 137x23
64 1.9 SDI	AGD	47	07/96 → 10/99	 KIT	A/C(-), MS A/C(-), PS A/C(+), PS	MVB1225R5 TB657 TBK112	5PK1225 137x23
75 1.6	AEA, AEE, AHS	55	10/94 → 10/99	 KIT	A/C(-), MS A/C(-), PS A/C(+), PS	MVB750R6 MVB1065R6 MVB1125R6 TB467 TBK088	6PK750 6PK1065 6PK1125 137x19
100 1.4 16V	AFH	74	04/96 → 10/99	 KIT	A/C(-), MS A/C(-), PS A/C(+), PS	MVB750R6 MVB1065R6 MVB1125R6 TB553	6PK750 6PK1065 6PK1125 149x25



kW



...VW

...POLO (6N1)

120 1.6 16V GTI	AJV	88	09/98 → 10/99		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1125R6	6PK1125
						TB634	58x17
						TB658	130x20
				KIT	→ Eng Nr 005000	TBK263	
				KIT	Eng Nr AVJ 005001→	TBK246	

POLO (6N2)

1.0	ALD, AUC	37	10/99 → 09/01		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1125R6	6PK1125
						TB466	135x19
				KIT	→ Ch. 6N-Y-600000	TBK087	
				KIT	Ch. 6N-Y-600001→	TBK320	

1.4	AKK, AUD	44	10/99 → 09/01		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1125R6	6PK1125
						TB466	135x19
				KIT	→ Ch. 6N-Y-600000	TBK087	
				KIT	Ch. 6N-Y-600001→	TBK320	

	AKP	40	10/99 → 09/01		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1125R6	6PK1125
						TB466	135x19
				KIT	→ Ch. 6N-Y-600000	TBK087	
				KIT	Ch. 6N-Y-600001→	TBK320	

1.4 16V	AHW, APE, AUA	55	10/99 → 09/01		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1125R6	6PK1125
						TB634	58x17
						TB658	130x20
				KIT		TBK246	

	AFK, AQQ, AUB	74	10/99 → 09/01		A/C(-), MS	MVB750R6	6PK750
					A/C(-), PS	MVB1065R6	6PK1065
					A/C(+), PS	MVB1125R6	6PK1125
						TB634	58x17
						TB658	130x20
				KIT		TBK246	

1.4 TDI	AMF	55	10/99 → 09/01		A/C(-), 09/00→, → Ch. 6N-2-010000	MVB1125R6	6PK1125
					A/C(-), 09/00→, Ch. 9N-2-000001→	MVB860R6	6PK860
					A/C(+), 09/00→, → Ch. 6N-2-010000	MVB1188R6D	6DPK1188
					A/C(+), 09/00→, Ch. 9N-2-000001→	MVB1000R6	6PK1000
					09/00→	TB680	120x30
				KIT	09/00→, Ch. 9N-2-050001→	TBK270	
				KIT	09/00→, Eng Nr 011495→, → Ch. 9N-2-050000	TBK225	
				KIT	09/00→, Eng Nr 011495→, → Ch. 9N-2-050000, VD(+)	TBK269	

1.6 16V GTI	ARC, AVY	92	10/99 → 09/01		A/C(-), MS, 06/00→	MVB750R6	6PK750
					A/C(-), PS, 06/00→	MVB1065R6	6PK1065
					A/C(+), PS, 06/00→	MVB1125R6	6PK1125
					06/00→	TB634	58x17
					06/00→	TB658	130x20
				KIT	06/00→	TBK246	

1.7 SDI	AKU	44	10/99 → 09/01		→04/00	MVB1225R5	5PK1225
					→04/00	TB657	137x23
				KIT	→04/00	TBK112	



kw



...VW

...POLO (6N2)

1.9 D	AEF	47	10/99 → 09/01	①		MVB1225R5	5PK1225
				②	A/C(-), 04/01→	MVB780R6	6PK780
				③	A/C(+), 04/01→	MVB1100R6	6PK1100
				④		TB657	137x23
				⑤	04/01→	TB659	141x26
				⑥		TBK093	
				⑦		TBK112	
1.9 SDI	AGD, ASX	47	10/99 → 09/01	①	05/00→	MVB1225R5	5PK1225
				②	05/00→	TB657	137x23
				③	05/00→	TBK112	

POLO (9N_)

1.2	AZQ, BME	47	10/01 →	①	Eng. AZQ, A/C(-), →05/05, → Ch. 9N-3-070000	MVB1460R6	6PK1460
				②	Eng. BME, A/C(-), →07/07	MVB1450R6	6PK1450
				③	Eng. BME, A/C(+), →05/05, → Ch. 9N-3Y234442	MVB1875R6	6PK1875
	AWY, BMD	40	01/02 →	④	Eng. BME, A/C(+), →07/07	MVB1875R6	6PK1875
				⑤	A/C(-)	MVB1450R6	6PK1450
				⑥	A/C(+), 05/04→, Ch. 9N-4Y074378→	MVB1875R6	6PK1875
				⑦	Eng. AWY, A/C(-), →05/05, → Ch. 9N-3-070000	MVB1460R6	6PK1460
	BBM	44	05/07 →	⑧	Eng. BMD, A/C(+), →05/05, → Ch. 9N-4Y074377	MVB1875R6	6PK1875
				⑨	A/C(-)	MVB1450R6	6PK1450
	BZG	51	05/07 →	⑩	A/C(+)	MVB1875R6	6PK1875
⑪				A/C(-)	MVB1450R6	6PK1450	
1.4 16V	AUA, BBY, BKY	55	10/01 →	⑫	A/C(+)	MVB1875R6	6PK1875
				⑬	A/C(-)	MVB736R6	6PK736
				⑭	A/C(-), MS, →11/01	MVB750R6	6PK750
				⑮	A/C(-), PS, →11/01	MVB1065R6	6PK1065
				⑯	A/C(+)	MVB1080R6	6PK1080
				⑰	A/C(+), PS, →11/01	MVB1125R6	6PK1125
	AUB, BBZ	74	10/01 →	⑱		TB634	58x17
				⑲		TB658	130x20
				⑳		TBK246	
				㉑	A/C(-)	MVB736R6	6PK736
				㉒	A/C(-), MS, →11/01	MVB750R6	6PK750
				㉓	A/C(-), PS, →11/01	MVB1065R6	6PK1065
BUD	59	05/06 →	㉔	A/C(+)	MVB1080R6	6PK1080	
			㉕	A/C(-)	MVB736R6	6PK736	
			㉖	A/C(+)	MVB1080R6	6PK1080	
			㉗		TB634	58x17	
			㉘	→ Ch. 9N-6-300000	TB658	130x20	
			㉙	→ Ch. 9N-6-300000	TBK246		
1.4 FSI	AXU	63	05/02 →	㉚	A/C(-)	MVB1088R6	6PK1088
				㉛	A/C(+)	MVB1740R6	6PK1740



kW



...VW

...POLO (9N_)

1.4 TDI	AMF, BAY	55	10/01 →		Eng. AMF, A/C(-), → Ch. 6N-2-010000	MVB1125R6	6PK1125
					Eng. AMF, A/C(-), Ch. 9N-2-000001→	MVB860R6	6PK860
					Eng. AMF, A/C(+), → Ch. 6N-2-010000	MVB1188R6D	6DPK1188
					Eng. AMF, A/C(+), Ch. 9N-2-000001→	MVB1000R6	6PK1000
				 	Ch. 9N-2-050001→ Eng. AMF, Eng Nr 011495→, → Ch. 9N-2-050000 Eng. AMF, Eng Nr 011495→, → Ch. 9N-2-050000, VD(+)	TB680 TBK270 TBK225	120x30
BMS, BNV	59	04/05 →		A/C(-)	MVB825R6	6PK825	
				A/C(+)	MVB1000R6	6PK1000	
			 		TB680 TBK270	120x30	
BNM, BWB	51	04/05 →		A/C(-)	MVB825R6	6PK825	
				A/C(+)	MVB1000R6	6PK1000	
			 		TB680 TBK270	120x30	
1.6 16V	BTS	77	05/06 →		A/C(-)	MVB1088R6	6PK1088
					A/C(+)	MVB1740R6	6PK1740
1.8 GTI	BJX	110	09/05 →			MVB1035R6	6PK1035
						TB554	150x23
1.8 GTi Cup Edition	BBU	132	05/06 →			MVB1035R6	6PK1035
						TB554	150x23
1.9 SDI	ASY	47	10/01 →		A/C(-)	MVB780R6	6PK780
					A/C(+)	MVB1100R6	6PK1100
						TB659	141x26
1.9 TDI	ATD, AXR, BMT	74	10/01 →		A/C(-)	MVB780R6	6PK780
					A/C(-), 06/05→	MVB825R6	6PK825
					Eng. BMT, A/C(+)	MVB1180R6	6PK1180
				 		TB680 TBK270	120x30
						TB680 TBK270	120x30
ASZ, BLT	96	11/03 →		A/C(-)	MVB780R6	6PK780	
				A/C(+)	MVB1180R6	6PK1180	
			 		TB680 TBK270	120x30	

POLO (86C, 80)

0.9	HA	29	10/81 → 12/81		→ Ch. 86A0087520	SVB10700	10x700
					Ch. 86A0087521→	SVB10690	10x690
						TB107	108x19
1.0	GL	29	10/81 → 10/86		→ Ch. 86D	SVB10700	10x700
					Ch. 86E→	SVB10675	10x675
						TB107	108x19
HZ	33	08/85 → 01/92		→09/90, → Ch. 86D	SVB10700	10x700	
				→09/90, Ch. 86E→	SVB10675	10x675	
				10/90→	SVB12710	12x710	
				→09/90	TB107	108x19	
			 	10/90→	TB283	128x19	
1.0 CAT	AAK, AAU, ACM	33	08/89 → 09/94		→09/90, → Ch. 86D	SVB10700	10x700
					→09/90, Ch. 86E→	SVB10675	10x675
					10/90→	SVB12710	12x710
					→09/90	TB107	108x19
				 	10/90→	TB283	128x19
1.1	HB	37	10/81 → 09/89		→07/83, → Ch. 86D	SVB10700	10x700
					→07/83, Ch. 86E→	SVB10675	10x675
					→07/83	TB107	108x19



kW



...VW

...POLO (86C, 80)

VW	1.3	HH	44	10/81 → 07/83		→ Ch. 86D	SVB10700	10x700
						Ch. 86E→	SVB10675	10x675
							TB107	108x19
		HK, MH	40	08/83 → 07/88		→ Ch. 86D	SVB10700	10x700
						Ch. 86E→	SVB10675	10x675
							TB107	108x19
		GK	55	09/82 → 09/89		→ Ch. 86D	SVB10700	10x700
						Ch. 86E→	SVB10675	10x675
							TB107	108x19
		HW	37	08/83 → 07/85		→ Ch. 86D	SVB10700	10x700
						Ch. 86E→	SVB10675	10x675
							TB107	108x19
1.3 CAT	2G, AAV, MH, NZ	40	07/87 → 09/94		→09/90, → Ch. 86D	SVB10700	10x700	
					→09/90, Ch. 86E→	SVB10675	10x675	
					10/90→	SVB12710	12x710	
					→01/90	TB107	108x19	
					01/90→	TB283	128x19	
	3F	55	10/89 → 03/91		→09/90, → Ch. 86D	SVB10700	10x700	
					→09/90, Ch. 86E→	SVB10675	10x675	
					→01/90	TB107	108x19	
					→09/90	TB283	128x19	
1.3 D	MN	33	08/86 → 07/90			SVB10675	10x675	
						TB255	107x20	
						TB254	71x17.8	
1.4 D	1W	35	10/90 → 09/94			SVB12710	12x710	
						TB255	107x20	
						TB254	71x17.8	

POLO Box (6NF)

1.0	AAU	33	10/94 → 12/99		MS, →07/96	MVB750R6	6PK750
					PS, →07/96	MVB1065R6	6PK1065
					→07/96	TB465	132x19
1.4	AEX, APQ	44	05/98 → 12/99		A/C(-), MS	MVB750R6	6PK750
					Eng. AEX, A/C(-), PS	MVB1065R6	6PK1065
					Eng. AEX, A/C(+), PS	MVB1125R6	6PK1125
						TB466	135x19
						TBK087	
1.7 SDI	AKU	44	08/97 → 12/99			MVB1225R5	5PK1225
						TB657	137x23
						TBK112	
1.9 D	AEF	47	10/94 → 12/99			MVB1225R5	5PK1225
					A/C(-), 11/99→	MVB906R6	6PK906
					A/C(-), Auto Tensioner,	MVB925R6	6PK925
					10/97→		
					A/C(-), Manu Tensioner,	MVB1045R6	6PK1045
					10/97→		
					A/C(+), 10/97→	MVB1150R6	6PK1150
					A/C(+), 11/99→	MVB1660R6	6PK1660
						TB657	137x23
					10/97→	TB384	137x25.4
					11/99→, → Eng Nr 595000	TB533	141x25
					11/99→, Eng Nr 595001→	TB659	141x26
					→08/96	TBK093	
					07/96→	TBK112	
					10/97→	TBK026	
					11/99→, → Eng Nr 229903	TBK116	
					11/99→, Eng Nr 229904→595000	TBK107	
					11/99→, Eng Nr 595001→	TBK272	
					A/C(-), 10/97→	SVB12735	12x735
					A/C(+), 10/97→	SVB11790	11x790
1.9 SDI	AGD	47	07/96 → 12/99			MVB1225R5	5PK1225
						TB657	137x23
						TBK112	



kW



...VW

POLO Box (86CF)

1.0	AAU	33	08/92 → 07/94			SVB12710	12x710
						TB283	128x19
1.3	AAV	40	08/92 → 07/94			SVB12710	12x710
						TB283	128x19
1.4 D	1W	35	08/92 → 07/94			SVB12710	12x710
						TB255	107x20
						TB254	71x17.8

POLO CLASSIC (6KV2)

57 1.7 SDI	AKW	42	07/97 → 09/01		A/C(-), Auto Tensioner,	MVB925R6	6PK925	
					12/97→08/99			
					A/C(-), Manu Tensioner,	MVB1045R6	6PK1045	
					12/97→08/99			
					A/C(+), 12/97→08/99	MVB1150R6	6PK1150	
60 1.4	AEX, AKK, AKV, ANW, ANX, APQ, AUD	44	12/95 → 09/01		12/97→08/99	TB384	137x25.4	
					12/97→08/99	TBK305		
					A/C(-), 12/97→08/99	SVB12735	12x735	
					A/C(+), 12/97→08/99	SVB11790	11x790	
					A/C(-), MS	MVB750R6	6PK750	
					Eng. AUD, A/C(-), PS	MVB1065R6	6PK1065	
					Eng. AUD, A/C(+), PS	MVB1125R6	6PK1125	
64 1.9 SDI	1Y, AEY	47	12/95 → 08/99		→ Eng Nr 127806	TB466	135x19	
					Eng. AUD, 09/99→	TBK087		
						TBK320		
					A/C(-), Auto Tensioner	MVB925R6	6PK925	
					Eng. AEY, A/C(-), Manu Tensioner	MVB1045R6	6PK1045	
68 1.9 SDI	AGP, AQM	50	08/99 → 09/01		Eng. AEY, A/C(+)	MVB1150R6	6PK1150	
						TB384	137x25.4	
						TBK305		
					Eng. AEY, A/C(-)	SVB12735	12x735	
					Eng. AEY, A/C(+)	SVB11790	11x790	
75 1.4 16V	APE, AUA	55	10/99 → 09/01		Eng. AGP, A/C(-)	MVB906R6	6PK906	
					Eng. AGP, A/C(+)	MVB1660R6	6PK1660	
					Eng. AGP, → Eng Nr 595000	TB533	141x25	
					Eng. AGP, Eng Nr 595001→	TB659	141x26	
					→ Eng Nr 229903	TBK116		
					Eng. AGP,	TBK107		
					Eng Nr 229904→595000			
75 1.6	AEE, ALM	55	11/95 → 09/01		Eng. AGP, Eng Nr 595001→	TBK272		
					A/C(-), MS	MVB750R6	6PK750	
					A/C(-), PS	MVB1065R6	6PK1065	
					A/C(+), PS	MVB1125R6	6PK1125	
						TB634	58x17	
75 1.6	AEE, ALM	55	11/95 → 09/01			TB658	130x20	
						TBK246		
					A/C(+), PS, 05/96→	MVB1180R6	6PK1180	
					Eng. AEE, A/C(-), MS, 05/96→07/98	MVB750R6	6PK750	
					Eng. AEE, A/C(-), PS, 05/96→	MVB1065R6	6PK1065	
	1F	ALM	55	11/95 → 09/97		Eng. AEE, A/C(+), PS, 05/96→07/98	MVB1125R6	6PK1125
						05/96→	TB467	137x19
						05/96→	TBK088	
						A/C(-)	MVB890R6	6PK890
						A/C(+)	MVB1155R6	6PK1155
		TB108	121x18					
		TBK016						
	A/C(-)	SVB12685	12x685					
	A/C(+)	SVB12760	12x760					



kw



...VW

...POLO CLASSIC (6KV2)

90 1.9 TDI	AGR, AHU, ALE, ALH	66	09/96 → 09/01	⊗	A/C(-), Auto Tensioner, 01/97→08/99	MVB925R6	6PK925				
				⊗	A/C(-), Manu Tensioner, 01/97→08/99	MVB1045R6	6PK1045				
				⊗	A/C(+), 01/97→08/99	MVB1150R6	6PK1150				
				⊗	Eng. AGR, A/C(-), 09/99→	MVB906R6	6PK906				
				⊗	Eng. AGR, A/C(+), 09/99→	MVB1660R6	6PK1660				
					01/97→08/99	TB384	137x25.4				
					Eng. AGR, 09/99→, → Eng Nr 565000	TB533	141x25				
					Eng. AGR, 09/99→, Eng Nr 565001→	TB659	141x26				
					01/97→08/99	TBK026					
					Eng. AGR, 09/99→, → Eng Nr 565000	TBK107					
					Eng. AGR, 09/99→, Eng Nr 565001→	TBK272					
				100 1.6	AEH, AFT, AKL, APF, AUR	74	12/95 → 09/01	⊗	A/C(-), 01/97→08/99	SVB12735	12x735
⊗	A/C(+), 01/97→08/99	SVB11790	11x790								
⊗	A/C(-), 09/99→	MVB1125R6	6PK1125								
⊗	A/C(+), 09/99→	MVB1200R6D	6DPK1200								
⊗	Eng. AFT, A/C(-), →08/99	MVB890R6	6PK890								
⊗	Eng. AFT, A/C(+), →08/99	MVB1155R6	6PK1155								
	→08/99	TB463	121x18								
	09/99→	TB552	138x23								
	→08/99	TBK086									
	09/99→	TBK100									
110 1.9 TDI	AFN, ASV	81	06/98 → 09/01					⊗	Eng. ASV, A/C(-), 09/99→	MVB906R6	6PK906
								⊗	Eng. ASV, A/C(+), 09/99→	MVB1660R6	6PK1660
					Eng. ASV, 09/99→, → Eng Nr 150000	TB533	141x25				
					Eng. ASV, 09/99→, Eng Nr 150001→	TB659	141x26				
					Eng. ASV, 09/99→, → Eng Nr 150000	TBK107					
					Eng. ASV, 09/99→, Eng Nr 150001→	TBK272					

POLO CLASSIC (86C, 80)

1.0	GL	29	01/85 → 10/86	⊗	→ Ch. 86D	SVB10700	10x700
				⊗	Ch. 86E→	SVB10675	10x675
						TB107	108x19
	AAK, AAU, HZ	33	01/85 → 09/94	⊗	→09/90, → Ch. 86D	SVB10700	10x700
				⊗	→09/90, Ch. 86E→	SVB10675	10x675
				⊗	10/90→	SVB12710	12x710
1.3	HK, MH	40	01/85 → 07/87		→09/90	TB107	108x19
					10/90→	TB283	128x19
1.3	MH, NZ	40	07/87 → 09/94	⊗	→ Ch. 86D	SVB10700	10x700
				⊗	Ch. 86E→	SVB10675	10x675
1.3 CAT	MH, NZ	40	07/87 → 09/94			TB107	108x19
				⊗	→09/90, → Ch. 86D	SVB10700	10x700
				⊗	→09/90, Ch. 86E→	SVB10675	10x675
				⊗	10/90→	SVB12710	12x710
					→01/90	TB107	108x19
					01/90→	TB283	128x19
1.3 D	MN	33	08/86 → 12/88	⊗		SVB10675	10x675
						TB255	107x20
						TB254	71x17.8
1.4 D	1W	35	10/90 → 09/94	⊗		SVB12710	12x710
						TB255	107x20
						TB254	71x17.8



kW



...VW

POLO Coupe (86C, 80)

1.0	GL	29	05/82 → 10/86		→ Ch. 86D	SVB10700	10x700
					Ch. 86E→	SVB10675	10x675
						TB107	108x19
1.0	HZ	33	08/85 → 01/92		→09/90, → Ch. 86D	SVB10700	10x700
					→09/90, Ch. 86E→	SVB10675	10x675
					10/90→	SVB12710	12x710
					→09/90	TB107	108x19
					10/90→	TB283	128x19
1.0 CAT	AAK, AAU, ACM	33	08/89 → 09/94		→09/90, → Ch. 86D	SVB10700	10x700
					→09/90, Ch. 86E→	SVB10675	10x675
					10/90→	SVB12710	12x710
					→09/90	TB107	108x19
					10/90→	TB283	128x19
1.1	HB	37	10/81 → 07/83		→ Ch. 86D	SVB10700	10x700
					Ch. 86E→	SVB10675	10x675
						TB107	108x19
1.3	HH	44	10/81 → 07/83		→ Ch. 86D	SVB10700	10x700
					Ch. 86E→	SVB10675	10x675
						TB107	108x19
	HK, MH	40	08/83 → 06/87		→ Ch. 86D	SVB10700	10x700
					Ch. 86E→	SVB10675	10x675
1.3	GK	55	09/82 → 09/89		→ Ch. 86D	SVB10700	10x700
					Ch. 86E→	SVB10675	10x675
	3F	57	03/91 → 09/94			TB107	108x19
						TB283	128x19
1.3 CAT	2G, AAV, MH, NZ	40	07/87 → 08/94		→09/90, → Ch. 86D	SVB10700	10x700
					→09/90, Ch. 86E→	SVB10675	10x675
					10/90→	SVB12710	12x710
	3F	55	10/89 → 09/94		→01/90	TB107	108x19
					01/90→	TB283	128x19
1.3 D	MN	33	08/86 → 08/90		→09/90, → Ch. 86D	SVB10700	10x700
					→09/90, Ch. 86E→	SVB10675	10x675
					10/90→	SVB12710	12x710
					→01/90	TB107	108x19
					01/90→	TB283	128x19
1.3 G40	PY	85	01/87 → 08/90		→ Ch. 86D	SVB10700	10x700
					Ch. 86E→	SVB10675	10x675
					→01/90	TB107	108x19
					01/90→	TB283	128x19
1.4 D	1W	35	08/90 → 09/94			TB283	128x19
						TB255	107x20
						TB254	71x17.8

POLO Saloon

1.4	BBY, BKY	55	07/03 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1080R6	6PK1080
						TB634	58x17
						TB658	130x20
						TBK246	
1.4	BBZ	74	11/03 →		A/C(-)	MVB736R6	6PK736
					A/C(+)	MVB1080R6	6PK1080
						TB634	58x17
						TB658	130x20
						TBK246	



kw



...VW

...POLO Saloon

1.4 TDI	BAY	55	07/03 →	⊗	A/C(-), → Ch. 6N-2-010000	MVB1125R6	6PK1125
				⊗	A/C(-), Ch. 9N-2-000001→	MVB860R6	6PK860
				⊗	A/C(+), → Ch. 6N-2-010000	MVB1188R6D	6DPK1188
				⊗	A/C(+), Ch. 9N-2-000001→	MVB1000R6	6PK1000
					→ Ch. 9N-2-050000	TB680	120x30
					→ Ch. 9N-2-050000	TBK225	
					→ Ch. 9N-2-050000, VD(+)	TBK269	
					Ch. 9N-2-050001→	TBK270	
1.9 SDI	ASY	47	11/03 →	⊗	A/C(-)	MVB780R6	6PK780
				⊗	A/C(+)	MVB1100R6	6PK1100
						TB659	141x26

POLO Variant (6KV5)

1.4	AEX, AKK, AKV, ANW, ANX, APQ, AUD	44	05/97 → 09/01	⊗	A/C(-), MS	MVB750R6	6PK750
				⊗	Eng. AKK, A/C(-), PS	MVB1065R6	6PK1065
				⊗	Eng. AKK, A/C(+), PS	MVB1125R6	6PK1125
					→ Eng Nr 127806	TB466	135x19
					Eng. AKK, 09/99→, Eng Nr 127807→	TBK087	TBK320
	AKP	40	12/98 → 09/01	⊗	A/C(-), MS	MVB750R6	6PK750
				⊗	A/C(-), PS	MVB1065R6	6PK1065
				⊗	A/C(+), PS	MVB1125R6	6PK1125
						TB634	58x17
						TB658	130x20
						TBK246	
1.4 16V	APE, AUA	55	10/99 → 09/01	⊗	A/C(-), MS	MVB750R6	6PK750
				⊗	Eng. AUA, A/C(-), PS	MVB1065R6	6PK1065
				⊗	Eng. AUA, A/C(+), PS	MVB1125R6	6PK1125
						TB634	58x17
						TB658	130x20
						TBK246	
1.6	AEE, ALM	55	05/97 → 09/01	⊗	A/C(-), →09/97	MVB890R6	6PK890
				⊗	A/C(+)	MVB1180R6	6PK1180
				⊗	A/C(+), →09/97	MVB1155R6	6PK1155
				⊗	Eng. AEE, A/C(-), MS	MVB750R6	6PK750
				⊗	Eng. AEE, A/C(-), PS	MVB1065R6	6PK1065
				⊗	Eng. AEE, A/C(+), PS	MVB1125R6	6PK1125
						TB467	137x19
					→09/97	TB108	121x18
						TBK088	
					→09/97	TBK016	
				⊗	A/C(-), →09/97	SVB12685	12x685
				⊗	A/C(+), →09/97	SVB12760	12x760
					AEH, AFT, AKL, APF, AUR	74	05/97 → 09/01
				⊗	A/C(+), 09/99→	MVB1200R6D	6DPK1200
				⊗	Eng. AFT, A/C(-), →08/99	MVB890R6	6PK890
				⊗	Eng. AFT, A/C(+), →08/99	MVB1155R6	6PK1155
					→08/99	TB463	121x18
					09/99→	TB552	138x23
					→08/99	TBK086	
					09/99→	TBK100	
				⊗	Eng. AFT, A/C(-), →08/99	SVB12685	12x685
				⊗	Eng. AFT, A/C(+), →08/99	SVB12760	12x760
1.7 SDI	AKW	42	08/97 → 09/01	⊗	A/C(-), Auto Tensioner, 12/97→08/99	MVB925R6	6PK925
				⊗	A/C(-), Manu Tensioner, 12/97→08/99	MVB1045R6	6PK1045
				⊗	A/C(+), 12/97→08/99	MVB1150R6	6PK1150
					12/97→08/99	TB384	137x25.4
					12/97→08/99	TBK305	
				⊗	A/C(-), 12/97→08/99	SVB12735	12x735
				⊗	A/C(+), 12/97→08/99	SVB11790	11x790



kW



...VW

...POLO Variant (6KV5)

1.8	ADZ	66	05/97 → 09/01		A/C(-)	MVB890R6	6PK890		
					A/C(+)	MVB1155R6	6PK1155		
						TB463	121x18		
						TBK086			
					A/C(-)	SVB12685	12x685		
1.9 SDI	AEY	47	06/97 → 09/01		A/C(-), Auto Tensioner, →08/99	MVB925R6	6PK925		
					A/C(-), Manu Tensioner, →08/99	MVB1045R6	6PK1045		
					A/C(+), →08/99	MVB1150R6	6PK1150		
					→08/99	TB384	137x25.4		
					→08/99	TBK026			
1.9 TDI	AGR, AHU, ALE, ALH	66	05/97 → 09/01		A/C(-), →08/99	SVB12735	12x735		
					A/C(+), →08/99	SVB11790	11x790		
					50	08/99 → 09/01	Eng. AGP, A/C(-)	MVB906R6	6PK906
							Eng. AGP, A/C(+)	MVB1660R6	6PK1660
							Eng. AGP, → Eng Nr 595000	TB533	141x25
							Eng. AGP, Eng Nr 595001 →	TB659	141x26
							→ Eng Nr 229903	TBK116	
							Eng. AGP,	TBK107	
							Eng Nr 229904 → 595000		
							Eng. AGP, Eng Nr 595001 →	TBK272	
1.9 TDI	AFN, ASV	81	06/98 → 09/01		A/C(-), Auto Tensioner, →08/99	MVB925R6	6PK925		
					A/C(-), Manu Tensioner, →08/99	MVB1045R6	6PK1045		
					A/C(+), →08/99	MVB1150R6	6PK1150		
					Eng. AGR, A/C(-), 09/99 →	MVB906R6	6PK906		
					Eng. AGR, A/C(+), 09/99 →	MVB1660R6	6PK1660		
					→08/99	TB384	137x25.4		
					Eng. AGR, 09/99 →,	TB533	141x25		
					→ Eng Nr 565000				
					Eng. AGR, 09/99 →,	TB659	141x26		
					Eng Nr 565001 →				
					→08/99	TBK026			
					Eng. AGR, 09/99 →,	TBK107			
					→ Eng Nr 565000				
					Eng. AGR, 09/99 →,	TBK272			
					Eng Nr 565001 →				
	A/C(-), →08/99	SVB12735	12x735						
	A/C(+), →08/99	SVB11790	11x790						
	A/C(-), Auto Tensioner, →08/99	MVB925R6	6PK925						
	A/C(-), Manu Tensioner, →08/99	MVB1045R6	6PK1045						
	A/C(+), →08/99	MVB1150R6	6PK1150						
	Eng. ASV, A/C(-), 09/99 →	MVB906R6	6PK906						
	Eng. ASV, A/C(+), 09/99 →	MVB1660R6	6PK1660						
	→08/99	TB384	137x25.4						
	Eng. ASV, 09/99 →,	TB533	141x25						
	→ Eng Nr 150000								
	Eng. ASV, 09/99 →,	TB659	141x26						
	Eng Nr 150001 →								
	→08/99	TBK026							
	Eng. ASV, 09/99 →,	TBK107							
	→ Eng Nr 150000								
	Eng. ASV, 09/99 →,	TBK272							
	Eng Nr 150001 →								
	A/C(-), →08/99	SVB12735	12x735						
	A/C(+), →08/99	SVB11790	11x790						



kw



...VW

SANTANA (32B)

1.3	FZ	44	08/81 → 07/83	⊗	→ Ch. 32F299999	SVB10700	10x700
				⊗		SVB10950	10x950
				⊗		TB107	108x19
1.6	WV	55	08/81 → 12/84	⊗	→ Ch. 32F300001 →	SVB10950	10x950
				⊗		TB108	121x18
				⊗		TBK016	
1.6	YP	63	08/81 → 12/82	⊗	A/C(-)	SVB10950	10x950
				⊗		TB108	121x18
				⊗		TBK016	
1.6 D	CR, JK	40	08/81 → 12/84	⊗	A/C(+)	SVB10950	10x950
				⊗		TB108	121x18
				⊗		TBK016	
1.6 TD	CY	51	12/81 → 12/84	⊗	→ Ch. 32F299999	SVB13825	13x825
				⊗		SVB13800	13x800
				⊗		SVB10740	10x740
				⊗		SVB10760	10x760
				⊗		TB225	135x25.4
				⊗		TBK018	
1.6 TD	CY	51	12/81 → 12/84	⊗	Ch. 32F300001 →	SVB10610	10x610
				⊗		SVB13825	13x825
				⊗		SVB13800	13x800
				⊗		SVB10740	10x740
				⊗		SVB10775	10x775
				⊗		TB225	135x25.4
1.8	DS	66	01/83 → 12/84	⊗	A/C(-)	SVB10950	10x950
				⊗		TB108	121x18
				⊗		TBK016	
1.9	WN	85	08/81 → 07/83	⊗	A/C(+)	SVB131000	13x1000
				⊗		SVB10800	10x800
				⊗		TB602	113x19
2.0	HP, JS	85	08/83 → 12/84	⊗	→07/84	SVB131000	13x1000
				⊗		SVB10800	10x800
				⊗		TB602	113x19
				⊗		TB207	120x18
				⊗		TBK048	

SCIROCCO (53B)

1.3	GF	44	08/80 → 12/83	⊗	→08/81	SVB10690	10x690
				⊗		SVB10700	10x700
				⊗		TB107	108x19
1.5	JB	51	08/80 → 12/83	⊗	→07/81	SVB101150	10x1150
				⊗		SVB10825	10x825
				⊗		SVB131025	13x1025
				⊗		SVB13950	13x950
				⊗		SVB131125	13x1125
				⊗		SVB101125	10x1125
				⊗		SVB131050	13x1050
				⊗		SVB10940	10x940
				⊗		SVB10950	10x950
				⊗		SVB10850	10x850
				⊗		SVB10865	10x865
				⊗		TB108	121x18
⊗	TBK016						
⊗	SVB10735	10x735					



kW



...VW

...SCIROCCO (53B)

Power (kW)	Engine	Power (kW)	Year Range	Accessories	Part Numbers	Dimensions
1.6	EW	55	01/83 → 12/89	→ Ch. 53-E-013385	SVB131025	13x1025
				Ch. 53-E-013386→	SVB13950	13x950
				A/C(-), MS, → Ch. 53-E-060000	SVB10940	10x940
				A/C(-), MS, Ch. 53-F-000001→	SVB10950	10x950
				A/C(+)	SVB10850	10x850
				PS	SVB10865	10x865
					TB108	121x18
				KIT	TBK016	
					SVB10735	10x735
				FR	63	08/80 → 04/84
→07/81, → Ch. 5372037000	SVB131125	13x1125				
→07/81,	SVB101125	10x1125				
Ch. 5372037001→5372500000						
→07/81,	SVB131050	13x1050				
Ch. 5382000001→5392043812						
Ch. 53-E-013386→	SVB13950	13x950				
Ch. 5392043813→	SVB131025	13x1025				
A/C(-), MS, → Ch. 53-E-060000	SVB10940	10x940				
A/C(+), → Ch. 5372500000	SVB10950	10x950				
EG	81	08/80 → 07/82	→07/81	SVB101150	10x1150	
			→07/81, → Ch. 5372037000	SVB131125	13x1125	
			→07/81,	SVB101125	10x1125	
			Ch. 5372037001→5372500000			
			→07/81,	SVB131050	13x1050	
			Ch. 5382000001→5392043812			
			Ch. 53-E-013386→	SVB13950	13x950	
			Ch. 5392043813→	SVB131025	13x1025	
			A/C(-)	SVB10950	10x950	
			A/C(-), MS, → Ch. 53-E-060000	SVB10940	10x940	
RE	53	04/86 → 07/90	→ Ch. 53-E-013385	SVB131025	13x1025	
			Ch. 53-E-013386→	SVB13950	13x950	
			A/C(-), MS, → Ch. 53-E-060000	SVB10940	10x940	
			A/C(-), MS, Ch. 53-F-000001→	SVB10950	10x950	
			A/C(+)	SVB10850	10x850	
			PS	SVB10865	10x865	
				TB108	121x18	
			KIT	TBK016		
				SVB10735	10x735	
			EWA	51	08/83 → 07/84	→ Ch. 53-E-013385
Ch. 53-E-013386→	SVB13950	13x950				
A/C(-), MS, → Ch. 53-E-060000	SVB10940	10x940				
A/C(-), MS, Ch. 53-F-000001→	SVB10950	10x950				
A/C(+)	SVB10850	10x850				
PS	SVB10865	10x865				
	TB108	121x18				
KIT	TBK016					
	SVB10735	10x735				

VW



kW



...VW

...SCIROCCO (53B)

1.8	EX	66	08/83 → 07/92	☼	→ Ch. 53-E-013385	SVB131025	13x1025			
				☼	Ch. 53-E-013386→	SVB13950	13x950			
				⊖	A/C(-), MS, → Ch. 53-E-060000	SVB10940	10x940			
				⊖	A/C(-), MS, Ch. 53-F-000001→	SVB10950	10x950			
				⊖	A/C(+), →12/83	SVB10850	10x850			
				⊖	A/C(+), 01/84→	SVB10625	10x625			
				⊖	PS	SVB10865	10x865			
						TB108	121x18			
						TBK016				
						SVB10735	10x735			
				JH	70	11/85 → 07/92	☼	→ Ch. 53-E-013385	SVB131025	13x1025
							☼	Ch. 53-E-013386→	SVB13950	13x950
							⊖	A/C(-), MS, → Ch. 53-E-060000	SVB10940	10x940
⊖	A/C(-), MS, Ch. 53-F-000001→	SVB10950	10x950							
⊖	A/C(+)	SVB10625	10x625							
⊖	PS	SVB10865	10x865							
		TB108	121x18							
		TBK016								
		SVB10735	10x735							
DX, EV, JJ, PB	82	08/82 → 12/89	☼				→ Ch. 53-E-013385	SVB131025	13x1025	
			☼				Ch. 53-E-013386→	SVB13950	13x950	
			⊖				A/C(-), MS, → Ch. 53-E-060000	SVB10940	10x940	
			⊖				A/C(-), MS, Ch. 53-F-000001→	SVB10950	10x950	
			⊖	A/C(+), →12/83	SVB10850	10x850				
			⊖	A/C(+), 01/84→	SVB10625	10x625				
			⊖	PS	SVB10865	10x865				
					TB108	121x18				
					TBK016					
					SVB10735	10x735				
			1.8 16V	KR	102	10/85 → 07/89	☼		SVB13950	13x950
							⊖	A/C(-), MS	SVB10950	10x950
							⊖	A/C(+)	SVB10625	10x625
⊖	PS	SVB10865					10x865			
		TB505					147x25.4			
		TBK066								
		SVB10735					10x735			
PL	95	03/86 → 07/92					☼		SVB13950	13x950
							⊖	A/C(-), MS	SVB10950	10x950
							⊖	A/C(+)	SVB10625	10x625
							⊖	PS	SVB10865	10x865
									TB505	147x25.4
									TBK066	
					SVB10735	10x735				

SHARAN (7M8, 7M9, 7M6)

1.8 T 20V	AJH, AWC	110	09/97 →	⊖		MVB1200R6D	6DPK1200
				⊖	A/C(-), →02/00	MVB1125R6	6PK1125
						TB554	150x23
					→02/00	TBK101	
					03/00→	TBK115	



kW



...VW

...SHARAN (7M8, 7M9, 7M6)

Engine	Model	kW	Year	Accessories	Notes	Part Number	Part Number
1.9 TDI	1Z, AHU, ANU	66	09/95 →	⊗	A/C(-), →05/00, → Ch. 7M-Y-020000	MVB1045R6	6PK1045
				⊗	A/C(-), →05/00, Ch. 7M-Y-020001→	MVB1050R6	6PK1050
				⊗	A/C(-), Not Alt. 120A, →02/00	MVB925R6	6PK925
				⊗	A/C(+), →05/00	MVB1150R6	6PK1150
				⊗	Eng. ANU, A/C(-), 04/99→	MVB1125R6	6PK1125
				⊗	Eng. ANU, A/C(+), 04/99→	MVB1200R6D	6DPK1200
				⊗	→05/00	TB384	137x25.4
				⊗	04/99→	TB680	120x30
				⊗	→05/00	TBK305	
				⊗	08/02→	TBK270	
				⊗	Eng. ANU, 04/99→07/02, Eng Nr 005001→	TBK225	
				⊗	Eng. ANU, 04/99→07/02, Eng Nr 005001→, VD(+)	TBK269	
				AFN, AVG	81	09/96 → 04/00	⊗
⊗	A/C(+), →05/00	SVB11790	11x790				
⊗	A/C(-), → Ch. 7M-Y-020000	MVB1045R6	6PK1045				
⊗	A/C(-), Ch. 7M-Y-020001→	MVB1050R6	6PK1050				
⊗	A/C(-), Not Alt. 120A	MVB925R6	6PK925				
⊗	A/C(+)	MVB1150R6	6PK1150				
AUY, BVK	85	04/00 →	⊗		TB384	137x25.4	
			⊗		TBK305		
			⊗	A/C(-)	SVB12735	12x735	
			⊗	A/C(+)	SVB11790	11x790	
			⊗	Eng. AUY, Ch. 7M-6-015001→	MVB1200R6D	6DPK1200	
			⊗		MVB1215R6D	6DPK1215	
ASZ	96	11/02 →	⊗		TB680	120x30	
			⊗		TBK270		
			⊗	08/02→	TBK225		
			⊗	Eng. AUY, →07/02 Eng. AUY, →07/02, VD(+)	TBK269		
BTB	110	06/05 →	⊗		MVB1200R6D	6DPK1200	
			⊗		TB680	120x30	
			⊗		TBK270		
1.9 TDI 4motion	AUY, BVK	85	04/00 →	⊗	Eng. AUY, → Ch. 7M-6-015000	MVB1200R6D	6DPK1200
				⊗	Eng. AUY, Ch. 7M-6-015001→	MVB1215R6D	6DPK1215
				⊗		TB680	120x30
				⊗	08/02→	TBK270	
2.0	ADY, ATM	85	09/95 →	⊗	Eng. AUY, →07/02	TBK225	
				⊗	Eng. AUY, →07/02, VD(+)	TBK269	
				⊗	03/00→	MVB1200R6D	6DPK1200
				⊗	A/C(-), →12/95	MVB975R6	6PK975
				⊗	Eng. ADY, A/C(-), →05/00	MVB1035R6	6PK1035
				⊗	Eng. ADY, A/C(+), →05/00	MVB1155R6	6PK1155
2.0 TDI	BRT	103	11/05 →	⊗	→05/00	TB506	124x18
				⊗	03/00→	TB552	138x23
				⊗	→05/00	TBK076	
				⊗	03/00→	TBK100	
				⊗	A/C(+), →05/00	SVB12760	12x760
				⊗	Eng. ADY, A/C(-), →05/00	SVB12675	12x675
				⊗	Eng. ADY, A/C(-), →05/00	SVB12685	12x685
				⊗		MVB1215R6D	6DPK1215
2.8 VR6	AAA, AMY	128	09/95 → 04/00	⊗	Eng. AAA, A/C(-)	MVB1285R7	7PK1285
				⊗	Eng. AAA, A/C(+)	MVB1360R7D	7DPK1360

VW



kW



...VW

...SHARAN (7M8, 7M9, 7M6)

2.8 VR6 Syncro	AAA, AMY	128	11/96 → 04/00		A/C(-)	MVB1285R7	7PK1285
					A/C(+)	MVB1360R7D	7DPK1360

TARO

1.8	2Y	61	04/89 → 09/94			SVB13875	13x875
						MVB835R4	4PK835
						SVB131050	13x1050
2.2	4Y	69	06/89 → 07/94			SVB13875	13x875
						MVB835R4	4PK835
						SVB131050	13x1050
2.4 D	2L	59	09/91 → 07/94			SVB131050	13x1050
						TB314	129x31
						TBK068	
					LHD	SVB13875	13x875
					RHD	SVB13825	13x825
		58	07/94 → 03/97			SVB131050	13x1050
						TB314	129x31
						TBK068	
					LHD	SVB13875	13x875
					RHD	SVB13825	13x825
		61	06/89 → 03/97			SVB131050	13x1050
						TB314	129x31
						TBK068	
					LHD	SVB13875	13x875
					RHD	SVB13825	13x825
2.4 D 4x4	2L	58	07/94 → 03/97			SVB131050	13x1050
						TB314	129x31
						TBK068	
					LHD	SVB13875	13x875
					RHD	SVB13825	13x825
		61	04/89 → 03/97			SVB131050	13x1050
						TB314	129x31
						TBK068	
					LHD	SVB13875	13x875
					RHD	SVB13825	13x825
2.4 i 4x4	22R	84	06/89 → 03/97			SVB10875	10x875
						SVB131125	13x1125

TIGUAN

1.4 TSI	BWK	110	09/07 →		A/C(+)	MVB1700R6	6PK1700
2.0 TDI		103	09/07 →			MVB1073R5	5PK1073
2.0 TFSI	CAWB	147	09/07 →			MVB1115R6	6PK1115

TOUAREG (7LA, 7L6, 7L7)

3.0 V6 TDI	BKS	165	11/04 →			MVB2490R6	6PK2490
						TB760	83x24
	CASA	176	11/07 →			MVB2490R6	6PK2490
4.2 V8	AXQ, BHX	228	12/02 → 11/06		→11/06	MVB2365R7	7PK2365
					→11/06	TB556	253x30
4.2 V8 FSI	BAR	257	12/06 →			MVB1110R5	5PK1110

TOURAN (1T1, 1T2)

1.4 Fsi		125	12/06 →		A/C(-)	MVB1600R6	6PK1600
					A/C(+)	MVB1700R6	6PK1700
1.4 TSI	BMY	103	02/06 →		A/C(-)	MVB1600R6	6PK1600
					A/C(+)	MVB1700R6	6PK1700
1.6	BGU, BSE, BSF	75	07/03 →		A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
						TBK100	
1.6 FSI	BAG, BLF, BLP	85	02/03 →		Eng. BLF, A/C(-), →02/07	MVB1088R6	6PK1088
					Eng. BLF, A/C(+), →02/07	MVB1740R6	6PK1740



kW



...VW

...TOURAN (1T1, 1T2)

1.9 TDI	AVQ	74	02/03 →		A/C(-), →02/06	MVB946R6	6PK946
					A/C(+), →02/06	MVB1045R6	6PK1045
					→02/06	TB680	120x30
					→02/06	TBK270	
BKC, BXE	77	08/03 →		11/05 →	MVB1050R6	6PK1050	
				A/C(-)	MVB946R6	6PK946	
				A/C(+), →02/06	MVB1045R6	6PK1045	
					TB680	120x30	
					TBK270		
BRU, BXJ	66	11/04 →		11/05 →	MVB1050R6	6PK1050	
				A/C(-)	MVB946R6	6PK946	
				A/C(+), →02/06	MVB1045R6	6PK1045	
					TB680	120x30	
					TBK270		
2.0 EcoFuel	BSX	80	02/06 →		A/C(-)	MVB900R6	6PK900
					A/C(+)	MVB1045R6	6PK1045
						TB552	138x23
					TBK100		
2.0 FSI	AXW, BLR, BLX, BLY	110	10/03 →		A/C(-), →11/06	MVB900R6	6PK900
					A/C(+), →11/06	MVB1045R6	6PK1045
					→05/04	TB745	145x23
				06/04 →11/06	TB753	148x23	
2.0 TDI	AZV	100	02/03 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
				→05/06, → Ch. 1T-6-185466	TBK262		
BMN	125	12/05 →		A/C(-)	MVB946R6	6PK946	
				A/C(+)	MVB1050R6	6PK1050	
					TB743	141x30	
BMM	103	12/05 →		A/C(-)	MVB946R6	6PK946	
				A/C(+)	MVB1050R6	6PK1050	
					TB680	120x30	
					TBK270		
2.0 TDI 16V	BKD	103	08/03 →		A/C(-)	MVB946R6	6PK946
					A/C(+)	MVB1050R6	6PK1050
						TB743	141x30
				→05/06, → Ch. 1T-6-185466	TBK262		

TRANSPORTER III Box

1.6	CT	37	05/79 → 12/82			SVB101175	10x1175
						SVB10700	10x700
1.6 D	CS	37	01/81 → 07/87			SVB131250	13x1250
					A/C(-), Alt. 65A, → Ch. 24K033108	SVB10600	10x600
					A/C(-), Alt. 65A, Ch. 24K033109 →	SVB10875	10x875
					A/C(-), Alt. 90A, → Ch. 24K033108	SVB10625	10x625
					A/C(-), Alt. 90A, Ch. 24K033109 →	SVB10913	10x913
						SVB131225	13x1225
						TB225	135x25.4
						TBK018	
					A/C(-), MS	SVB10760	10x760
					A/C(-), PS	SVB10650	10x650
	A/C(+), MS	SVB10900	10x900				
	A/C(+), PS	SVB10635	10x635				
	A/C(+), PS	SVB10840	10x840				



kW



...VW
...TRANSPORTER III Box

Engine	Code	kW	Period	Accessories	Options	Part Number	Dimensions	
1.6 TD	JX	51	10/84 → 07/92			SVB131250	13x1250	
						A/C(-), Alt. 65A, → Ch. 24K033108	SVB10600	10x600
						A/C(-), Alt. 65A, Ch. 24K033109→	SVB10875	10x875
						A/C(-), Alt. 90A, → Ch. 24K033108	SVB10625	10x625
						A/C(-), Alt. 90A, Ch. 24K033109→	SVB10913	10x913
							SVB131225	13x1225
							TB225	135x25.4
							TBK018	
							SVB10760	10x760
						A/C(-), MS	SVB10650	10x650
						A/C(-), PS	SVB10900	10x900
					1.6 TD Syncro	JX	51	03/86 → 07/92
	A/C(-), Alt. 65A, → Ch. 24K033108	SVB10600	10x600					
	A/C(-), Alt. 65A, Ch. 24K033109→	SVB10875	10x875					
	A/C(-), Alt. 90A, → Ch. 24K033108	SVB10625	10x625					
	A/C(-), Alt. 90A, Ch. 24K033109→	SVB10913	10x913					
		SVB131225	13x1225					
		TB225	135x25.4					
		TBK018						
		SVB10760	10x760					
	A/C(-), MS	SVB10650	10x650					
	A/C(-), PS	SVB10900	10x900					
1.7 D	KY	42	07/89 → 07/92					
						A/C(-), Alt. 65A, → Ch. 24K033108	SVB10600	10x600
						A/C(-), Alt. 65A, Ch. 24K033109→	SVB10875	10x875
						A/C(-), Alt. 90A, → Ch. 24K033108	SVB10625	10x625
						A/C(-), Alt. 90A, Ch. 24K033109→	SVB10913	10x913
							SVB131225	13x1225
							TB225	135x25.4
							TBK018	
							SVB10760	10x760
						A/C(-), MS	SVB10650	10x650
						A/C(-), PS	SVB10900	10x900



kW



...VW

...TRANSPORTER III Box

Model	Code	kW	Year Range	Icons	Notes	Part Number	Dimensions
...1.7 D		42	08/85 → 07/87	⚙️	A/C(-), Alt. 65A, → Ch. 24K033108	SVB131250	13x1250
				⚙️	A/C(-), Alt. 65A, Ch. 24K033109→	SVB10600	10x600
				⚙️	A/C(-), Alt. 90A, → Ch. 24K033108	SVB10875	10x875
				⚙️	A/C(-), Alt. 90A, Ch. 24K033109→	SVB10625	10x625
				⚙️		SVB10913	10x913
				⚙️ ②		SVB131225	13x1225
				🔌		TB225	135x25.4
				🔌 KIT		TBK018	
				⚙️		SVB10760	10x760
				⚙️	A/C(-), MS	SVB10650	10x650
				⚙️	A/C(-), PS	SVB10900	10x900
				⚙️	A/C(+), MS	SVB10635	10x635
⚙️	A/C(+), PS	SVB10840	10x840				
1.9	DF	44	10/82 → 07/92	⚙️	→02/92	SVB131150	13x1150
				⚙️	Alt. 45,65A, →02/92, Ch. 24-H-000001→	SVB101100	10x1100
	DG	57	10/82 → 07/92	⚙️	→02/92	SVB101075	10x1075
				⚙️	Alt. 45,65A, →02/92, Ch. 24-H-000001→	SVB131150	13x1150
GW	66	08/83 → 02/89	⚙️	→02/92	SVB101075	10x1075	
			⚙️	Alt. 45,65A, Ch. 24-H-000001→	SVB131150	13x1150	
DH	61	10/84 → 02/89	⚙️		SVB101100	10x1100	
			⚙️	Alt. 45,65A, Ch. 24-H-000001→	SVB101075	10x1075	
1.9 Syncro	DG	57	11/84 → 07/92	⚙️	→02/92	SVB131150	13x1150
				⚙️	Alt. 45,65A, →02/92, Ch. 24-H-000001→	SVB101100	10x1100
2.0	CU	51	05/79 → 04/86	⚙️	→02/92	SVB101075	10x1075
				⚙️	→12/82	SVB10960	10x960
2.1	MV	70	08/85 → 07/92	⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB131150	13x1150
				⚙️	Alt. 90A	SVB101075	10x1075
	DJ	82	03/86 → 07/92	⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB101100	10x1100
				⚙️		SVB131150	13x1150
2.1 Syncro	MV	70	08/85 → 07/92	⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB101075	10x1075
				⚙️		SVB131150	13x1150
	DJ	82	03/86 → 07/92	⚙️	Alt. 45,65A, Ch. 24-H-000001→	SVB101100	10x1100
				⚙️		SVB131150	13x1150
2.1 i	SS	68	07/89 → 07/92	⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB101075	10x1075
				⚙️		SVB101100	10x1100

VW



kW



...VW

TRANSPORTER III Bus

Engine	Model	Power (kW)	Year Range	Options	Accessories	Dimensions	
1.6	CT	37	05/79 → 12/82	①	SVB101175	10x1175	
				①②	SVB10700	10x700	
1.6 D	CS	37	01/81 → 07/87	⚙	SVB131250	13x1250	
				①	SVB10600	10x600	
				①	A/C(-), Alt. 65A, → Ch. 24K033108	SVB10875	10x875
				①	A/C(-), Alt. 65A, Ch. 24K033109 →	SVB10625	10x625
				①	A/C(-), Alt. 90A, → Ch. 24K033108	SVB10913	10x913
				①	A/C(-), Alt. 90A, Ch. 24K033109 →	SVB131225	13x1225
				①②	TB225	135x25.4	
				⚙	TBK018		
				Ⓜ	SVB10760	10x760	
				Ⓜ	A/C(-), MS	SVB10650	10x650
				Ⓜ	A/C(-), PS	SVB10900	10x900
Ⓜ	A/C(+), MS	SVB10635	10x635				
Ⓜ	A/C(+), PS	SVB10840	10x840				
1.6 TD	JX	51	08/84 → 07/92	⚙	→08/90	SVB131250	13x1250
				①	A/C(-), Alt. 65A, →08/90, → Ch. 24K033108	SVB10600	10x600
				①	A/C(-), Alt. 65A, →08/90, Ch. 24K033109 →	SVB10875	10x875
				①	A/C(-), Alt. 90A, →08/90, → Ch. 24K033108	SVB10625	10x625
				①	A/C(-), Alt. 90A, →08/90, Ch. 24K033109 →	SVB10913	10x913
				①②	→08/90	SVB131225	13x1225
				⚙	→08/90	TB225	135x25.4
				⚙	→08/90	TBK018	
				Ⓜ	→08/90	SVB10760	10x760
				Ⓜ	A/C(-), MS, →08/90	SVB10650	10x650
				Ⓜ	A/C(-), PS, →08/90	SVB10900	10x900
Ⓜ	A/C(+), MS, →08/90	SVB10635	10x635				
Ⓜ	A/C(+), PS, →08/90	SVB10840	10x840				
1.6 TD Syncro	JX	51	03/86 → 07/92	⚙	→08/90	SVB131250	13x1250
				①	A/C(-), Alt. 65A, →08/90, → Ch. 24K033108	SVB10600	10x600
				①	A/C(-), Alt. 65A, →08/90, Ch. 24K033109 →	SVB10875	10x875
				①	A/C(-), Alt. 90A, →08/90, → Ch. 24K033108	SVB10625	10x625
				①	A/C(-), Alt. 90A, →08/90, Ch. 24K033109 →	SVB10913	10x913
				①②	→08/90	SVB131225	13x1225
				⚙	→08/90	TB225	135x25.4
				⚙	→08/90	TBK018	
				Ⓜ	→08/90	SVB10760	10x760
				Ⓜ	A/C(-), MS, →08/90	SVB10650	10x650
				Ⓜ	A/C(-), PS, →08/90	SVB10900	10x900
Ⓜ	A/C(+), MS, →08/90	SVB10635	10x635				
Ⓜ	A/C(+), PS, →08/90	SVB10840	10x840				



kW



...VW

...TRANSPORTER III Bus

Engine	Model	kW	Year Range	Accessories	Notes	Part Number	Dimensions
1.7 D	KY	42	10/86 → 07/92	⚙️	→08/90	SVB131250	13x1250
				⚙️	A/C(-), Alt. 65A, →08/90, → Ch. 24K033108	SVB10600	10x600
				⚙️	A/C(-), Alt. 65A, →08/90, Ch. 24K033109→	SVB10875	10x875
				⚙️	A/C(-), Alt. 90A, →08/90, → Ch. 24K033108	SVB10625	10x625
				⚙️	A/C(-), Alt. 90A, →08/90, Ch. 24K033109→	SVB10913	10x913
				⚙️ ②	→08/90	SVB131225	13x1225
				⚙️ ②	→08/90	TB225	135x25.4
				⚙️ ② KIT	→08/90	TBK018	
				⚙️	→08/90	SVB10760	10x760
				⚙️	A/C(-), MS, →08/90	SVB10650	10x650
				⚙️	A/C(-), PS, →08/90	SVB10900	10x900
				⚙️	A/C(+), MS, →08/90	SVB10635	10x635
				⚙️	A/C(+), PS, →08/90	SVB10840	10x840
1.9	DF	44	08/82 → 07/92	⚙️	→12/91	SVB131150	13x1150
				⚙️ ②	→12/91	SVB101100	10x1100
				⚙️	→12/91	SVB101075	10x1075
	DG	57	08/82 → 07/92	⚙️	→12/91	SVB131150	13x1150
				⚙️	Alt. 45,65A, →12/91, → Ch. 24-G-093123	SVB101075	10x1075
	DH	61	01/83 → 07/85	⚙️ ②	→12/91	SVB101100	10x1100
				⚙️ ②		SVB131150	13x1150
				⚙️		SVB101100	10x1100
	GW	66	08/83 → 07/85	⚙️		SVB131150	13x1150
				⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB101075	10x1075
⚙️ ②					SVB101100	10x1100	
⚙️					SVB131150	13x1150	
1.9 Syncro	DG	57	02/85 → 07/92	⚙️	→12/91	SVB131150	13x1150
				⚙️	Alt. 45,65A, →12/91, → Ch. 24-G-093123	SVB101075	10x1075
2.0	CU, CV	51	05/79 → 12/82	⚙️ ②	→12/91	SVB101100	10x1100
				⚙️		SVB10960	10x960
2.1	MV	70	08/85 → 07/92	⚙️	Alt. 90A	SVB131150	13x1150
				⚙️		SVB101100	10x1100
2.1	DJ	82	08/85 → 07/92	⚙️		SVB101075	10x1075
				⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB131150	13x1150
				⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB101075	10x1075
				⚙️	Alt. 45,65A, Ch. 24-H-000001→	SVB101100	10x1100
2.1	SR	64	10/86 → 07/92	⚙️	Alt. 45,65A, Ch. 24-H-000001→	SVB131150	13x1150
				⚙️		SVB101100	10x1100
				⚙️		SVB101075	10x1075
2.1 CAT	MV	70	06/89 → 07/92	⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB131150	13x1150
				⚙️	Alt. 45,65A, Ch. 24-H-000001→	SVB101075	10x1075
2.1 Syncro	MV	70	08/85 → 07/92	⚙️	Alt. 45,65A, Ch. 24-H-000001→	SVB101100	10x1100
				⚙️		SVB131150	13x1150
2.1	DJ	82	01/86 → 07/92	⚙️	Alt. 90A	SVB101100	10x1100
				⚙️		SVB101075	10x1075
				⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB131150	13x1150
				⚙️		SVB101075	10x1075
2.1	SR	64	10/86 → 07/92	⚙️ ②		SVB101100	10x1100
				⚙️		SVB131150	13x1150
				⚙️	Alt. 45,65A, → Ch. 24-G-093123	SVB101075	10x1075
2.1	SR	64	10/86 → 07/92	⚙️	Alt. 90A	SVB101100	10x1100
				⚙️		SVB131150	13x1150

VW



kw



...VW

...TRANSPORTER III Bus

2.1 i	SS	68	07/89 → 07/92	⚙️ ①	Alt. 45,65A, → Ch. 24-G-093123	SVB131150 SVB101075	13x1150 10x1075
				①-②		SVB101100	10x1100

TRANSPORTER III Flatbed / Chassis

1.6 D	CS	37	01/81 → 07/87	⚙️ ①	A/C(-), Alt. 65A, → Ch. 24K033108	SVB131250 SVB10600	13x1250 10x600
				①	A/C(-), Alt. 65A, Ch. 24K033109→	SVB10875	10x875
				①	A/C(-), Alt. 90A, → Ch. 24K033108	SVB10625	10x625
				①	A/C(-), Alt. 90A, Ch. 24K033109→	SVB10913	10x913
				①-② ⚙️ ⚙️KIT		SVB131225 TB225 TBK018	13x1225 135x25.4
				⚙️		SVB10760	10x760
				⚙️	A/C(-), MS	SVB10650	10x650
				⚙️	A/C(-), PS	SVB10900	10x900
				⚙️	A/C(+), MS	SVB10635	10x635
				⚙️	A/C(+), PS	SVB10840	10x840
1.6 TD	JX	51	10/84 → 07/92	⚙️ ①	A/C(-), Alt. 65A, → Ch. 24K033108	SVB131250 SVB10600	13x1250 10x600
				①	A/C(-), Alt. 65A, Ch. 24K033109→	SVB10875	10x875
				①	A/C(-), Alt. 90A, → Ch. 24K033108	SVB10625	10x625
				①	A/C(-), Alt. 90A, Ch. 24K033109→	SVB10913	10x913
				①-② ⚙️ ⚙️KIT		SVB131225 TB225 TBK018	13x1225 135x25.4
				⚙️		SVB10760	10x760
				⚙️	A/C(-), MS	SVB10650	10x650
				⚙️	A/C(-), PS	SVB10900	10x900
				⚙️	A/C(+), MS	SVB10635	10x635
				⚙️	A/C(+), PS	SVB10840	10x840
1.6 TD Syncro	JX	51	03/86 → 07/92	⚙️ ①	A/C(-), Alt. 65A, → Ch. 24K033108	SVB131250 SVB10600	13x1250 10x600
				①	A/C(-), Alt. 65A, Ch. 24K033109→	SVB10875	10x875
				①	A/C(-), Alt. 90A, → Ch. 24K033108	SVB10625	10x625
				①	A/C(-), Alt. 90A, Ch. 24K033109→	SVB10913	10x913
				①-② ⚙️ ⚙️KIT		SVB131225 TB225 TBK018	13x1225 135x25.4
				⚙️		SVB10760	10x760
				⚙️	A/C(-), MS	SVB10650	10x650
				⚙️	A/C(-), PS	SVB10900	10x900
				⚙️	A/C(+), MS	SVB10635	10x635
				⚙️	A/C(+), PS	SVB10840	10x840



kW



...VW

...TRANSPORTER III Flatbed / Chassis

1.7 D	KY	42	07/89 → 07/92	⊗	A/C(-), Alt. 65A, → Ch. 24K033108	SVB131250	13x1250							
				⊗		SVB10600	10x600							
				⊗		SVB10875	10x875							
				⊗		SVB10625	10x625							
				⊗		SVB10913	10x913							
				⊗②		SVB131225	13x1225							
						TB225	135x25.4							
						TBK018								
				⊗		SVB10760	10x760							
				⊗		SVB10650	10x650							
				1.9		DF	44	09/82 → 07/92	⊗	→02/92 Alt. 45,65A, →02/92, Ch. 24-H-000001→	SVB131150	13x1150		
⊗	SVB101100	10x1100												
⊗	SVB101075	10x1075												
DG	57	08/82 → 07/92	⊗		→02/92				SVB131150		13x1150			
			⊗		Alt. 45,65A, →02/92, → Ch. 24-G-093123				SVB101075		10x1075			
DH	61	10/84 → 02/89	⊗②		→02/92				SVB101100		10x1100			
			⊗		Alt. 45,65A, Ch. 24-H-000001→				SVB131150		13x1150			
			⊗						SVB101100		10x1100			
1.9 Syncro	DG	57	12/84 → 07/92		⊗				→02/92 Alt. 45,65A, →02/92, Ch. 24-H-000001→		SVB131150	13x1150		
					⊗						SVB101100	10x1100		
					⊗						SVB101075	10x1075		
				⊗	→02/92	SVB101075	10x1075							
				CU	51	05/79 → 04/86	⊗	→12/82		SVB10960	10x960			
							MV	70		08/85 → 07/92	⊗	Alt. 45,65A, → Ch. 24-G-093123	SVB131150	13x1150
											⊗	SVB101075	10x1075	
				DJ	82	03/86 → 07/92	⊗②			SVB101100	10x1100			
							⊗	Alt. 45,65A, Ch. 24-H-000001→		SVB131150	13x1150			
							⊗			SVB101100	10x1100			
				2.1	MV	70	08/85 → 07/92	⊗		Alt. 45,65A, → Ch. 24-G-093123	SVB131150	13x1150		
⊗	SVB101075	10x1075												
DJ	82	03/86 → 07/92	⊗					Alt. 45,65A, → Ch. 24-G-093123	SVB101100		10x1100			
			⊗					Alt. 90A	SVB131150		13x1150			
SS	68	07/89 → 07/92	⊗					Alt. 45,65A, → Ch. 24-G-093123	SVB101075		10x1075			
			⊗					Alt. 90A	SVB131150		13x1150			
			⊗						SVB101075		10x1075			
2.1 i	SS	68	07/89 → 07/92					⊗	Alt. 45,65A, → Ch. 24-G-093123		SVB131150	13x1150		
								⊗			SVB101075	10x1075		
								⊗②			SVB101100	10x1100		

VW



kW



...VW

TRANSPORTER IV Box (70XA)

Engine	Model	Power (kW)	Period	Accessories	Notes	Part Numbers	Dimensions
1.9 D	1X	45	07/90 → 04/03	①	→07/95, → Ch. 70N200000	SVB10975	10x975
				②	Alt. 120A, →07/95, Ch. 70P000001→	MVB1045R6	6PK1045
				③	Not Alt. 120A, →07/95, Ch. 70P000001→	MVB925R6	6PK925
				④	→07/95	TB384	137x25.4
				⑤	→07/94, → Eng Nr 1X120077	TBK024	
1.9 TD	ABL	50	10/92 → 04/03	⑥	07/94→07/95, Eng Nr 1X120078→	TBK025	
				⑦	→07/95	SVB12650	12x650
				⑧	→ Ch. 70N200000	SVB10975	10x975
				⑨	Alt. 120A, Ch. 70P000001→	MVB1045R6	6PK1045
				⑩	Not Alt. 120A, Ch. 70P000001→	MVB925R6	6PK925
2.0	AAC	62	07/90 → 04/03	⑪	→07/94, → Eng Nr 029319	TB384	137x25.4
				⑫	07/94→, Eng Nr 029320→	TBK024	
				⑬		TBK025	
				⑭		SVB12650	12x650
				⑮	A/C(-), →04/96	SVB10960	10x960
2.4 D	AAB	57	07/90 → 04/98	⑯	A/C(-), Alt. 120A, eng. PTO shaft (-), 05/96→	MVB1065R6	6PK1065
				⑰	A/C(-), eng. PTO shaft (+), 05/96→	MVB1875R6	6PK1875
				⑱	A/C(-), Not Alt. 120A, eng. PTO shaft (-), 05/96→	MVB925R6	6PK925
				⑲	→04/96	MVB1550R6	6PK1550
				⑳		TB506	124x18
				㉑		TBK076	
				㉒	→04/96	MVB1460R6	6PK1460
				㉓	A/C(-)	SVB10650	10x650
				㉔	A/C(+)	MVB1588R6	6PK1588
				2.4 D	AJA	55	08/97 → 04/03
㉖	A/C(-), eng. PTO shaft (-), Ch. 70-N-000001→	MVB1352R6	6PK1352				
㉗	A/C(+), eng. PTO shaft (-), Ch. 70-N-000001→	MVB2240R6	6PK2240				
㉘	eng. PTO shaft (-), →07/92	SVB101075	10x1075				
㉙	eng. PTO shaft (-), 08/92→, → Ch. 70-M-150000	SVB131125	13x1125				
㉚	eng. PTO shaft (+), →07/92	SVB101150	10x1150				
㉛	eng. PTO shaft (+), 08/92→	SVB131175	13x1175				
㉜	eng. PTO shaft (+), Ch. 70-N-000001→	MVB1715R6	6PK1715				
㉝	→ Ch. 70-M-150000	SVB131275	13x1275				
㉞	Rigid PTO (+), Ch. 70-N-000001→	MVB2080R6	6PK2080				
㉟		TB785	122x26.5				
㊱	→ Ch. 70-M-150000	SVB131050	13x1050				
㊲	eng. PTO shaft (-), Ch. 70-X-140001→	MVB2100R6	6PK2100				
㊳		TB293	77x21				
㊴	→ Ch. 70-M-150000	SVB10865	10x865				
2.4 D	AJA	55	08/97 → 04/03	㊵	A/C(-), eng. PTO shaft (-), →04/02	MVB1352R6	6PK1352
				㊶	A/C(+), eng. PTO shaft (-), →04/02	MVB2240R6	6PK2240
				㊷	eng. PTO shaft (+), →04/02	MVB1715R6	6PK1715
				㊸	Rigid PTO (+), →04/02	MVB2080R6	6PK2080
				㊹	→04/02	TB785	122x26.5
				㊺	eng. PTO shaft (-), →04/02, → Ch. 70-X-140000	MVB2125R6	6PK2125
				㊻	eng. PTO shaft (-), →04/02, Ch. 70-X-140001→	MVB2100R6	6PK2100
				㊼	→04/02	TB293	77x21



kW



...VW

...TRANSPORTER IV Box (70XA)

2.4 D Syncro	AAB	57	10/92 → 09/98	⚙	→ Ch. 70-M-150000	SVB131325	13x1325
				⚙	A/C(-), eng. PTO shaft (-),	MVB1352R6	6PK1352
					Ch. 70-N-000001→		
				⚙	A/C(+), eng. PTO shaft (-),	MVB2240R6	6PK2240
					Ch. 70-N-000001→		
				⚙	eng. PTO shaft (-),	SVB131125	13x1125
					→ Ch. 70-M-150000		
				⚙	eng. PTO shaft (+)	SVB131175	13x1175
				⚙	eng. PTO shaft (+),	MVB1715R6	6PK1715
					Ch. 70-N-000001→		
				⚙	→ Ch. 70-M-150000	SVB131275	13x1275
				⚙	Rigid PTO (+),	MVB2080R6	6PK2080
					Ch. 70-N-000001→		
		TB785	122x26.5				
	⚙						
	⚙						
		→ Ch. 70-M-150000	SVB131050	13x1050			
		eng. PTO shaft (-),	MVB2100R6	6PK2100			
		Ch. 70-X-140001→					
		⚙					
			TB293	77x21			
			SVB10865	10x865			
2.5	AAF, ACU, AEN, AEU	81	11/90 → 04/03	⚙	→ Ch. 70-M-150000	SVB131325	13x1325
					Eng. AAF, →09/91,		
					→ Ch. 70-M-150000		
				⚙	A/C(-), 01/95→01/96	MVB1335R6	6PK1335
				⚙	A/C(-), 01/96→	MVB1352R6	6PK1352
				⚙	A/C(+), AUTO, 01/95→	MVB2225R6	6PK2225
				⚙	A/C(+), MAN, 01/95→	MVB2240R6	6PK2240
				⚙	Eng. AAF,	SVB101075	10x1075
					eng. PTO shaft (-), →09/91,		
					→ Ch. 70-M-150000		
				⚙	Eng. AAF,	SVB101140	10x1140
					eng. PTO shaft (+), →09/91,		
					→ Ch. 70-M-150000		
				⚙	Eng. AEN, A/C(-), 10/91→07/95	MVB1715R6	6PK1715
				⚙	01/95→	MVB2080R6	6PK2080
				⚙	Eng. AAF, →09/91,	SVB131275	13x1275
					→ Ch. 70-M-150000		
				⚙	Eng. AEN, 10/91→07/95	MVB1995R6	6PK1995
						TB785	122x26.5
						TB375	124x26.5
	→04/98						
	10/91→	MVB2125R6	6PK2125				
	10/91→07/95	MVB2063R6	6PK2063				
	Eng. AAF, →09/91,	SVB131050	13x1050				
	→ Ch. 70-M-150000						
	Eng. AAF, →09/91,	SVB10865	10x865				
	→ Ch. 70-M-150000						
AET, APL, AVT		85	08/96 → 04/03	⚙	A/C(-)	MVB1352R6	6PK1352
				⚙	A/C(+), AUTO	MVB2225R6	6PK2225
				⚙	A/C(+), MAN	MVB2240R6	6PK2240
				⚙		MVB2080R6	6PK2080
				⚙		TB785	122x26.5
				⚙		MVB2125R6	6PK2125



kw



...VW

...TRANSPORTER IV Box (70XA)

Engine	Model	Power (kw)	Period	Accessories	Options	Part Number	Part Number					
2.5 Syncro	AAF, ACU, AEN, AEU	81	10/92 → 04/03		A/C(-), 01/95→01/96	MVB1335R6	6PK1335					
					A/C(-), 01/96→	MVB1352R6	6PK1352					
					A/C(+), AUTO, 01/95→	MVB2225R6	6PK2225					
					A/C(+), MAN, 01/95→	MVB2240R6	6PK2240					
					Eng. ACU, A/C(-), →07/95	MVB1715R6	6PK1715					
					01/95→	MVB2080R6	6PK2080					
					Eng. ACU, →07/95	MVB1995R6	6PK1995					
						TB785	122x26.5					
						TB375	124x26.5					
					→04/98, → Eng Nr 019149	MVB2125R6	6PK2125					
						MVB2063R6	6PK2063					
						MVB1352R6	6PK1352					
						MVB2225R6	6PK2225					
						MVB2240R6	6PK2240					
						MVB2080R6	6PK2080					
	TB785	122x26.5										
	MVB2125R6	6PK2125										
2.5 TDI	ACV, AUF, AYC	75	09/95 → 04/03		A/C(-), 09/00→	MVB1690R6	6PK1690					
					A/C(-), MAN, Ch. X...→	MVB1768R6	6PK1768					
					A/C(+)	MVB2215R6	6PK2215					
					A/C(+),	MVB2240R6	6PK2240					
					→ Ch. 70-XX133656/XH132969							
					Eng. AXG, A/C(+), 09/00→	MVB2170R6	6PK2170					
					Eng. AYC, A/C(-), 05/98→	MVB1755R6	6PK1755					
						MVB2080R6	6PK2080					
						MVB2063R6	6PK2063					
						TB785	122x26.5					
						TB557	81x21					
					AJT, AYY	65	12/98 → 04/03		A/C(-)	MVB1755R6	6PK1755	
									A/C(-), 09/00→	MVB1690R6	6PK1690	
									A/C(-), MAN, Ch. X...→	MVB1768R6	6PK1768	
									A/C(+)	MVB2215R6	6PK2215	
A/C(+),	MVB2240R6	6PK2240										
→ Ch. 70-XX133656/XH132969												
A/C(+), 09/00→	MVB2170R6	6PK2170										
	MVB2080R6	6PK2080										
	MVB2063R6	6PK2063										
	TB785	122x26.5										
	TB557	81x21										
AXG	111	09/00 → 04/03		A/C(-)					MVB1690R6	6PK1690		
				A/C(-)					MVB1755R6	6PK1755		
				A/C(-), MAN, Ch. X...→					MVB1768R6	6PK1768		
				A/C(+)					MVB2170R6	6PK2170		
				A/C(+)	MVB2215R6	6PK2215						
				A/C(+),	MVB2240R6	6PK2240						
				→ Ch. 70-XX133656/XH132969								
					MVB2063R6	6PK2063						
					MVB2080R6	6PK2080						
					TB785	122x26.5						
					TB557	81x21						
				2.5 TDI Syncro	ACV, AXL	75	09/95 → 04/03		A/C(-), AUTO, 05/98→,	MVB1755R6	6PK1755	
									Ch. X...→			
									A/C(-), MAN, Ch. X...→	MVB1768R6	6PK1768	
									A/C(+),	MVB2240R6	6PK2240	
→ Ch. 70-XX133656/XH132969												
A/C(+),	MVB2215R6	6PK2215										
Ch. 70-XX13365/XH132970→												
Eng. AXL, A/C(-), 04/01→	MVB1690R6	6PK1690										
Eng. AXL, A/C(+), 04/01→	MVB2170R6	6PK2170										
	MVB2080R6	6PK2080										
	TB785	122x26.5										
	TB557	81x21										
2.8 VR6		150	06/00 → 04/03							A/C(-)	MVB1285R7	7PK1285
										A/C(+)	MVB1360R7D	7DPK1360



kW



...VW

TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW)

Model	Code	kW	Period	Notes	Part Numbers	Dimensions	
1.8	PD	49	12/90 → 07/92	⊗	SVB10960	10x960	
					TB108	121x18	
				KIT	TBK016		
					SVB10650	10x650	
1.9 D	1X	44	09/90 → 04/03	⊗	→07/95, → Ch. 70N200000	SVB10975	10x975
				⊗	Alt. 120A, →07/95, Ch. 70P000001→	MVB1045R6	6PK1045
				⊗	Not Alt. 120A, →07/95, Ch. 70P000001→	MVB925R6	6PK925
					→07/95	TB384	137x25.4
				KIT	→07/94, → Eng Nr 1X120077	TBK024	
				KIT	07/94→07/95, Eng Nr 1X120078→	TBK025	
				⊗	→07/95	SVB12650	12x650
1.9 TD	ABL	50	10/92 → 04/03	⊗	→ Ch. 70N200000	MVB1045R6	6PK1045
				⊗	Alt. 120A, Ch. 70P000001→	MVB925R6	6PK925
				⊗	Not Alt. 120A, Ch. 70P000001→	TB384	137x25.4
					→07/94, → Eng Nr 029319	TBK024	
				KIT	07/94→, Eng Nr 029320→	TBK025	
				⊗		SVB12650	12x650
2.0	AAC	62	09/90 → 04/03	⊗	A/C(-), →04/96	SVB10960	10x960
				⊗	A/C(-), Alt. 120A, eng. PTO shaft (-), 05/96→	MVB1065R6	6PK1065
				⊗	A/C(-), eng. PTO shaft (+), 05/96→	MVB1875R6	6PK1875
				⊗	A/C(-), Not Alt. 120A, eng. PTO shaft (-), 05/96→	MVB925R6	6PK925
				⊗ ²	→04/96	MVB1550R6	6PK1550
						TB506	124x18
				KIT		TBK076	
				⊗	→04/96	MVB1460R6	6PK1460
				⊗	A/C(-)	SVB10650	10x650
				⊗	A/C(+)	MVB1588R6	6PK1588

VW



kW



...VW

...TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW)

Model	Code	Power (kW)	Period	Accessories	Description	Part Number	Dimensions
2.4 D	AAB	57	09/90 → 04/98	⊗	→ Ch. 70-M-150000	SVB131325	13x1325
				①	A/C(-), eng. PTO shaft (-), Ch. 70-N-000001→	MVB1352R6	6PK1352
				①	A/C(+), eng. PTO shaft (-), Ch. 70-N-000001→	MVB2240R6	6PK2240
				①	eng. PTO shaft (-), →07/92	SVB101075	10x1075
				①	eng. PTO shaft (-), 08/92→, → Ch. 70-M-150000	SVB131125	13x1125
				①	eng. PTO shaft (+), →07/92	SVB101150	10x1150
				①	eng. PTO shaft (+), 08/92→	SVB131175	13x1175
				①	eng. PTO shaft (+), Ch. 70-N-000001→	MVB1715R6	6PK1715
				①②	→ Ch. 70-M-150000	SVB131275	13x1275
				①②	Rigid PTO (+), Ch. 70-N-000001→	MVB2080R6	6PK2080
				Ⓜ		TB785	122x26.5
				⊗	→ Ch. 70-M-150000	SVB131050	13x1050
				⊗	eng. PTO shaft (-), Ch. 70-X-140001→	MVB2100R6	6PK2100
				Ⓜ		TB293	77x21
				2.4 D Syncro	AAB	55	08/97 → 04/03
①	A/C(-), eng. PTO shaft (-), →04/02	MVB1352R6	6PK1352				
①	A/C(+), eng. PTO shaft (-), →04/02	MVB2240R6	6PK2240				
①	eng. PTO shaft (+), →04/02	MVB1715R6	6PK1715				
①②	Rigid PTO (+), →04/02	MVB2080R6	6PK2080				
Ⓜ	→04/02	TB785	122x26.5				
⊗	eng. PTO shaft (-), →04/02, → Ch. 70-X-140000	MVB2125R6	6PK2125				
⊗	eng. PTO shaft (-), →04/02, Ch. 70-X-140001→	MVB2100R6	6PK2100				
Ⓜ		TB293	77x21				
⊗	→04/02	TB293	77x21				
⊗	→ Ch. 70-M-150000	SVB131325	13x1325				
①	A/C(-), eng. PTO shaft (-), Ch. 70-N-000001→	MVB1352R6	6PK1352				
①	A/C(+), eng. PTO shaft (-), Ch. 70-N-000001→	MVB2240R6	6PK2240				
①	eng. PTO shaft (-), → Ch. 70-M-150000	SVB131125	13x1125				
①	eng. PTO shaft (+)	SVB131175	13x1175				
①	eng. PTO shaft (+), Ch. 70-N-000001→	MVB1715R6	6PK1715				
①②	→ Ch. 70-M-150000	SVB131275	13x1275				
①②	Rigid PTO (+), Ch. 70-N-000001→	MVB2080R6	6PK2080				
Ⓜ		TB785	122x26.5				
⊗	→ Ch. 70-M-150000	SVB131050	13x1050				
⊗	eng. PTO shaft (-), Ch. 70-X-140001→	MVB2100R6	6PK2100				
Ⓜ		TB293	77x21				
⊗	→ Ch. 70-M-150000	SVB10865	10x865				



kW



...VW

...TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW)

2.5	AAF, ACU, AEN, AEU	81	11/90 → 04/03	⚙	Eng. AAF, →09/91, → Ch. 70-M-150000	SVB131325	13x1325				
				⚙	A/C(-), 01/95→01/96	MVB1335R6	6PK1335				
				⚙	A/C(-), 01/96→	MVB1352R6	6PK1352				
				⚙	A/C(+), AUTO, 01/95→	MVB2225R6	6PK2225				
				⚙	A/C(+), MAN, 01/95→	MVB2240R6	6PK2240				
				⚙	Eng. AAF, eng. PTO shaft (-), →09/91, → Ch. 70-M-150000	SVB101075	10x1075				
				⚙	Eng. AAF, eng. PTO shaft (+), →09/91, → Ch. 70-M-150000	SVB101140	10x1140				
				⚙	Eng. AEN, A/C(-), 10/91→07/95	MVB1715R6	6PK1715				
				⚙ ②	01/95→	MVB2080R6	6PK2080				
				⚙ ②	Eng. AAF, →09/91, → Ch. 70-M-150000	SVB131275	13x1275				
				⚙ ②	Eng. AEN, 10/91→07/95	MVB1995R6	6PK1995				
				⚙ ②		TB785	122x26.5				
				⚙ ②	→04/98, → Eng Nr 019149	TB375	124x26.5				
				⚙ ②	10/91→	MVB2125R6	6PK2125				
				2.5	AAF, ACU, AEN, AEU	81	11/92 → 04/03	⚙	A/C(-)	MVB1352R6	6PK1352
⚙	A/C(+), AUTO	MVB2225R6	6PK2225								
⚙	A/C(+), MAN	MVB2240R6	6PK2240								
⚙ ②		MVB2080R6	6PK2080								
⚙ ②		TB785	122x26.5								
⚙ ②		MVB2125R6	6PK2125								
2.5 Syncro	AAF, ACU, AEN, AEU	81	11/92 → 04/03					⚙	A/C(-), 01/95→01/96	MVB1335R6	6PK1335
								⚙	A/C(-), 01/96→	MVB1352R6	6PK1352
								⚙	A/C(+), AUTO, 01/95→	MVB2225R6	6PK2225
								⚙	A/C(+), MAN, 01/95→	MVB2240R6	6PK2240
								⚙	Eng. ACU, A/C(-), →01/95	MVB1715R6	6PK1715
								⚙ ②	01/95→	MVB2080R6	6PK2080
								⚙ ②	Eng. ACU, →01/95	MVB1995R6	6PK1995
								⚙ ②		TB785	122x26.5
								⚙ ②	→04/98, → Eng Nr 019149	TB375	124x26.5
				⚙ ②		MVB2125R6	6PK2125				
				⚙ ②	→01/95	MVB2063R6	6PK2063				
				2.5	AAF, APL, AVT	85	07/96 → 04/03	⚙	A/C(-)	MVB1352R6	6PK1352
								⚙	A/C(+), AUTO	MVB2225R6	6PK2225
								⚙	A/C(+), MAN	MVB2240R6	6PK2240
								⚙ ②		MVB2080R6	6PK2080
⚙ ②		TB785	122x26.5								
⚙ ②		MVB2125R6	6PK2125								



kW



...VW

...TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW)

Engine	Model	Power (kW)	Period	Options	Accessories	Part Number	Part Description
2.5 TDI	ACV, AUF, AYC	75	09/95 → 04/03	①	A/C(-), 09/00→	MVB1690R6	6PK1690
					A/C(-), MAN, Ch. X...→	MVB1768R6	6PK1768
					A/C(+)	MVB2215R6	6PK2215
					A/C(+),	MVB2240R6	6PK2240
					→ Ch. 70-XX133656/XH132969		
					A/C(+), 09/00→	MVB2170R6	6PK2170
					Eng. AYC, A/C(-), 05/98→	MVB1755R6	6PK1755
						MVB2080R6	6PK2080
						MVB2063R6	6PK2063
						TB785	122x26.5
						TB557	81x21
					AJT, AYY	65	05/98 → 04/03
A/C(-), 09/00→	MVB1690R6	6PK1690					
A/C(-), MAN, Ch. X...→	MVB1768R6	6PK1768					
A/C(+)	MVB2215R6	6PK2215					
A/C(+),	MVB2240R6	6PK2240					
→ Ch. 70-XX133656/XH132969							
A/C(+), 09/00→	MVB2170R6	6PK2170					
	MVB2080R6	6PK2080					
	MVB2063R6	6PK2063					
	TB785	122x26.5					
	TB557	81x21					
AHY, AXG	111	05/98 → 04/03	①	A/C(-)			
				A/C(-), 09/00→	MVB1690R6	6PK1690	
				A/C(-), MAN, Ch. X...→	MVB1768R6	6PK1768	
				A/C(+)	MVB2215R6	6PK2215	
				A/C(+),	MVB2240R6	6PK2240	
				→ Ch. 70-XX133656/XH132969			
				Eng. AXG, A/C(+), 09/00→	MVB2170R6	6PK2170	
					MVB2080R6	6PK2080	
					MVB2063R6	6PK2063	
					TB785	122x26.5	
					TB557	81x21	
				2.5 TDI Syncro	ACV, AXL	75	01/96 → 04/03
Ch. X...→							
A/C(-), MAN, Ch. X...→	MVB1768R6	6PK1768					
A/C(+),	MVB2240R6	6PK2240					
→ Ch. 70-XX133656/XH132969							
A/C(+),	MVB2215R6	6PK2215					
Ch. 70-XX13365/XH132970→							
Eng. AXL, A/C(-), 04/01→	MVB1690R6	6PK1690					
Eng. AXL, A/C(+), 04/01→	MVB2170R6	6PK2170					
	MVB2080R6	6PK2080					
	TB785	122x26.5					
	TB557	81x21					
2.8 V6	AMV	150	04/00 → 04/03	①	A/C(-)	MVB1285R7	7PK1285
					A/C(+)	MVB1360R7D	7DPK1360

TRANSPORTER IV Flatbed / Chassis (70XD)

1.8		49	12/90 → 07/92	①		SVB10960	10x960
						TB108	121x18
						TBK016	
						SVB10650	10x650
1.9 D	1X	45	07/90 → 04/03	①	→07/95, → Ch. 70N200000	SVB10975	10x975
					Alt. 120A, →07/95,	MVB1045R6	6PK1045
					Ch. 70P000001→		
					Not Alt. 120A, →07/95,	MVB925R6	6PK925
					Ch. 70P000001→		
					→07/95	TB384	137x25.4
					→07/94, → Eng Nr 1X120077	TBK024	
07/94→07/95,	TBK025						
	Eng Nr 1X120078→						
	→07/95	SVB12650	12x650				



kW



...VW

...TRANSPORTER IV Flatbed / Chassis (70XD)

Engine	Code	Power (kW)	Period	Accessories	Notes	Part Numbers	Dimensions
1.9 TD	ABL	50	10/92 → 04/03	⊗	→ Ch. 70N200000	SVB10975	10x975
				⊗	Alt. 120A, Ch. 70P000001→	MVB1045R6	6PK1045
				⊗	Not Alt. 120A, Ch. 70P000001→	MVB925R6	6PK925
						TB384	137x25.4
				KIT	→07/94, → Eng Nr 029319	TBK024	
2.0	AAC	62	07/90 → 04/03	⊗	A/C(-), →04/96	SVB10960	10x960
				⊗	A/C(-), Alt. 120A, eng. PTO shaft (-), 05/96→	MVB1065R6	6PK1065
				⊗	A/C(-), Not Alt. 120A, eng. PTO shaft (-), 05/96→	MVB925R6	6PK925
					→04/96	MVB1550R6	6PK1550
					05/96→	MVB1875R6	6PK1875
						TB506	124x18
				KIT		TBK076	
				⊗	→04/96	MVB1460R6	6PK1460
				⊗	A/C(-)	SVB10650	10x650
				⊗	A/C(+)	MVB1588R6	6PK1588
2.4 D	AAB	57	09/90 → 04/98		→ Ch. 70-M-150000	SVB131325	13x1325
				⊗	A/C(-), eng. PTO shaft (-), Ch. 70-N-000001→	MVB1352R6	6PK1352
				⊗	A/C(+), eng. PTO shaft (-), Ch. 70-N-000001→	MVB2240R6	6PK2240
				⊗	eng. PTO shaft (-), →07/92	SVB101075	10x1075
				⊗	eng. PTO shaft (-), 08/92→, → Ch. 70-M-150000	SVB131125	13x1125
				⊗	eng. PTO shaft (+), →07/92	SVB101150	10x1150
				⊗	eng. PTO shaft (+), 08/92→	SVB131175	13x1175
				⊗	eng. PTO shaft (+), Ch. 70-N-000001→	MVB1715R6	6PK1715
					→ Ch. 70-M-150000	SVB131275	13x1275
					Rigid PTO (+), Ch. 70-N-000001→	MVB2080R6	6PK2080
						TB785	122x26.5
					→ Ch. 70-M-150000	SVB131050	13x1050
					eng. PTO shaft (-), Ch. 70-X-140001→	MVB2100R6	6PK2100
						TB293	77x21
				⊗	→ Ch. 70-M-150000	SVB10865	10x865
AJA		55	08/97 → 04/03	⊗	A/C(-), eng. PTO shaft (-), →04/02	MVB1352R6	6PK1352
				⊗	A/C(+), eng. PTO shaft (-), →04/02	MVB2240R6	6PK2240
				⊗	eng. PTO shaft (+), →04/02	MVB1715R6	6PK1715
					Rigid PTO (+), →04/02	MVB2080R6	6PK2080
					→04/02	TB785	122x26.5
					eng. PTO shaft (-), →04/02, → Ch. 70-X-140000	MVB2125R6	6PK2125
					eng. PTO shaft (-), →04/02, Ch. 70-X-140001→	MVB2100R6	6PK2100
					→04/02	TB293	77x21



kw



...VW

...TRANSPORTER IV Flatbed / Chassis (70XD)

2.4 D Syncro	AAB	57	10/92 → 09/98	⚙	→ Ch. 70-M-150000	SVB131325	13x1325
				⌚	A/C(-), eng. PTO shaft (-), Ch. 70-N-000001→	MVB1352R6	6PK1352
				⌚	A/C(+), eng. PTO shaft (-), Ch. 70-N-000001→	MVB2240R6	6PK2240
				⌚	eng. PTO shaft (-), → Ch. 70-M-150000	SVB131125	13x1125
				⌚	eng. PTO shaft (+)	SVB131175	13x1175
				⌚	eng. PTO shaft (+), Ch. 70-N-000001→	MVB1715R6	6PK1715
				⌚ ②	→ Ch. 70-M-150000	SVB131275	13x1275
				⌚ ②	Rigid PTO (+), Ch. 70-N-000001→	MVB2080R6	6PK2080
						TB785	122x26.5
					→ Ch. 70-M-150000	SVB131050	13x1050
					eng. PTO shaft (-), Ch. 70-X-140001→	MVB2100R6	6PK2100
						TB293	77x21
				2.5	AAF, ACU, AEN, AEU	81	11/90 → 04/03
⌚	Eng. AAF, →09/91, → Ch. 70-M-150000	SVB131325	13x1325				
⌚	A/C(-), 01/95→01/96	MVB1335R6	6PK1335				
⌚	A/C(-), 01/96→	MVB1352R6	6PK1352				
⌚	A/C(+), AUTO, 01/95→	MVB2225R6	6PK2225				
⌚	A/C(+), MAN, 01/95→	MVB2240R6	6PK2240				
⌚	Eng. AAF, eng. PTO shaft (-), →09/91, → Ch. 70-M-150000	SVB101075	10x1075				
⌚	Eng. AAF, eng. PTO shaft (+), →09/91, → Ch. 70-M-150000	SVB101140	10x1140				
⌚	Eng. AEN, A/C(-), 10/91→07/95	MVB1715R6	6PK1715				
⌚ ②	01/95→	MVB2080R6	6PK2080				
⌚ ②	Eng. AAF, →09/91, → Ch. 70-M-150000	SVB131275	13x1275				
⌚ ②	Eng. AEN, 10/91→07/95	MVB1995R6	6PK1995				
		TB785	122x26.5				
	→04/98	TB375	124x26.5				
	10/91→	MVB2125R6	6PK2125				
	10/91→07/95	MVB2063R6	6PK2063				
	Eng. AAF, →09/91, → Ch. 70-M-150000	SVB131050	13x1050				
	Eng. AAF, →09/91, → Ch. 70-M-150000	SVB10865	10x865				
AET, APL, AVT		85	08/96 → 04/03	⌚	A/C(-)	MVB1352R6	6PK1352
				⌚	A/C(+), AUTO	MVB2225R6	6PK2225
				⌚	A/C(+), MAN	MVB2240R6	6PK2240
				⌚ ②		MVB2080R6	6PK2080
						TB785	122x26.5
						MVB2125R6	6PK2125





kW



...VW

...TRANSPORTER IV Flatbed / Chassis (70XD)

Engine	Model	kW	Period	Icons	Options	Part Numbers	Dimensions
2.5 Syncro	AAF, ACU, AEN, AEU	81	10/92 → 04/03		A/C(-), 01/95 → 01/96	MVB1335R6	6PK1335
					A/C(-), 01/96 →	MVB1352R6	6PK1352
					A/C(+), AUTO, 01/95 →	MVB2225R6	6PK2225
					A/C(+), MAN, 01/95 →	MVB2240R6	6PK2240
					Eng. ACU, A/C(-), → 07/95	MVB1715R6	6PK1715
					01/95 →	MVB2080R6	6PK2080
					Eng. ACU, → 07/95	MVB1995R6	6PK1995
						TB785	122x26.5
						TB375	124x26.5
					→ 04/98, → Eng Nr 019149	MVB2125R6	6PK2125
						MVB2063R6	6PK2063
						MVB2125R6	6PK2125
						MVB2063R6	6PK2063
						MVB2125R6	6PK2125
2.5 TDI	ACV, AUF, AYC	75	09/95 → 04/03		A/C(-), 09/00 →	MVB1690R6	6PK1690
					A/C(-), MAN, Ch. X... →	MVB1768R6	6PK1768
					A/C(+)	MVB2215R6	6PK2215
					A/C(+),	MVB2240R6	6PK2240
					→ Ch. 70-XX133656/XH132969		
					A/C(+), 09/00 →	MVB2170R6	6PK2170
					Eng. AYC, A/C(-), 05/98 →	MVB1755R6	6PK1755
						MVB2080R6	6PK2080
						MVB2063R6	6PK2063
						TB785	122x26.5
						TB557	81x21
						MVB1755R6	6PK1755
						MVB1690R6	6PK1690
						MVB1768R6	6PK1768
	MVB2215R6	6PK2215					
	MVB2240R6	6PK2240					
	MVB2170R6	6PK2170					
	MVB2080R6	6PK2080					
	MVB2063R6	6PK2063					
	TB785	122x26.5					
	TB557	81x21					
2.5 TDI Syncro	ACV, AXL	75	05/98 → 04/03		A/C(-), AUTO, Ch. X... →	MVB1755R6	6PK1755
					A/C(-), MAN, Ch. X... →	MVB1768R6	6PK1768
					A/C(+),	MVB2240R6	6PK2240
					→ Ch. 70-XX133656/XH132969		
					A/C(+),	MVB2215R6	6PK2215
					Ch. 70-XX13365/XH132970 →		
					Eng. AXL, A/C(-), 04/01 →	MVB1690R6	6PK1690
					Eng. AXL, A/C(+), 04/01 →	MVB2170R6	6PK2170
						MVB2080R6	6PK2080
						TB785	122x26.5
						TB557	81x21
						MVB1755R6	6PK1755
						MVB1768R6	6PK1768
						MVB2240R6	6PK2240
	MVB2215R6	6PK2215					
	MVB1690R6	6PK1690					
	MVB2170R6	6PK2170					
	MVB2080R6	6PK2080					
	TB785	122x26.5					
	TB557	81x21					

VW



kw



...VW

TRANSPORTER V Box (7HA, 7HH)

1.9 TDI	AXC	63	04/03 →	⊗	A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125			
				⊗	A/C(-), Ch. 7H-6X022357 →	MVB1137R6	6PK1137			
				⊗	A/C(+), → Ch. 7H-6X022356	MVB1200R6D	6DPK1200			
				⊗	A/C(+), Ch. 7H-6X022357 →	MVB1215R6D	6DPK1215			
						TB680	120x30			
					KIT	TBK270				
				AXB	77	04/03 →	⊗	A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125
							⊗	A/C(-), Ch. 7H-6X022357 →	MVB1137R6	6PK1137
							⊗	A/C(+), → Ch. 7H-6X022356	MVB1200R6D	6DPK1200
							⊗	A/C(+), Ch. 7H-6X022357 →	MVB1215R6D	6DPK1215
		TB680	120x30							
	KIT	TBK270								
BRS	75	06/06 →	⊗				A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125	
			⊗				A/C(-), Ch. 7H-6X022357 →	MVB1137R6	6PK1137	
			⊗				A/C(+), → Ch. 7H-6H079890	MVB1200R6D	6DPK1200	
			⊗				A/C(+), Ch. 7H-6X022357 →	MVB1215R6D	6DPK1215	
					TB680	120x30				
				KIT	TBK270					
			BRR	62	01/06 →	⊗	A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125	
						⊗	A/C(-), Ch. 7H-6X022357 →	MVB1137R6	6PK1137	
						⊗	A/C(+), → Ch. 7H-6H079890	MVB1200R6D	6DPK1200	
						⊗	A/C(+), Ch. 7H-6H079891 →	MVB1215R6D	6DPK1215	
		TB680				120x30				
	KIT	TBK270								
2.0	AXA	85				11/03 →	⊗	A/C(-)	MVB1125R6	6PK1125
							⊗	A/C(+)	MVB1200R6D	6DPK1200
									TB552	138x23
								KIT	TBK100	
3.2 4motion	BKK, CFLA	173	11/03 →	⊗	Eng. BKK, A/C(-)	MVB1260R6	6PK1260			
3.2 V6	BDL	170	04/03 →	⊗	A/C(-)	MVB1260R6	6PK1260			
	BKK, CFLA	173	02/04 →	⊗	Eng. BKK, A/C(-)	MVB1260R6	6PK1260			

TRANSPORTER V Bus (7HB, 7HJ)

1.9 TDI	AXC	63	04/03 →	⊗	A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125			
				⊗	A/C(-), Ch. 7H-6X022357 →	MVB1137R6	6PK1137			
				⊗	A/C(+), → Ch. 7H-6H079890	MVB1200R6D	6DPK1200			
				⊗	A/C(+), Ch. 7H-6X022357 →	MVB1215R6D	6DPK1215			
						TB680	120x30			
					KIT	TBK270				
				AXB	77	04/03 →	⊗	A/C(-), → Ch. 7H-6X022356	MVB1125R6	6PK1125
							⊗	A/C(-), Ch. 7H-6X022357 →	MVB1137R6	6PK1137
							⊗	A/C(+), → Ch. 7H-6H079890	MVB1200R6D	6DPK1200
							⊗	A/C(+), Ch. 7H-6X022357 →	MVB1215R6D	6DPK1215
		TB680	120x30							
	KIT	TBK270								
BRS	75	06/06 →	⊗				A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125	
			⊗				A/C(-), Ch. 7H-6H079891 →	MVB1137R6	6PK1137	
			⊗				A/C(+), → Ch. 7H-6X022356	MVB1200R6D	6DPK1200	
			⊗				A/C(+), Ch. 7H-6H079891 →	MVB1215R6D	6DPK1215	
					TB680	120x30				
				KIT	TBK270					
			BRR	62	01/06 →	⊗	A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125	
						⊗	A/C(-), Ch. 7H-6X022357 →	MVB1137R6	6PK1137	
						⊗	A/C(+), → Ch. 7H-6H079890	MVB1200R6D	6DPK1200	
						⊗	A/C(+), Ch. 7H-6H079891 →	MVB1215R6D	6DPK1215	
		TB680				120x30				
	KIT	TBK270								
2.0	AXA	85				11/03 →	⊗	A/C(-)	MVB1125R6	6PK1125
							⊗	A/C(+)	MVB1200R6D	6DPK1200
									TB552	138x23
								KIT	TBK100	



kW



...VW

...TRANSPORTER V Bus (7HB, 7HJ)

3.2 4motion	BKK, CFLA	173	11/03 →		Eng. BKK, A/C(-)	MVB1260R6	6PK1260
3.2 V6	BDL	170	02/04 → 06/04		A/C(-)	MVB1260R6	6PK1260
	BKK, CFLA	173	02/04 →		Eng. BKK, A/C(-)	MVB1260R6	6PK1260

TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)

1.9 TDI	AXC	63	04/03 →		A/C(-), → Ch. 7H-6X022356	MVB1125R6	6PK1125
					A/C(-), Ch. 7H-6X022357 →	MVB1137R6	6PK1137
					A/C(+), → Ch. 7H-6H079890	MVB1200R6D	6DPK1200
					A/C(+), Ch. 7H-6X022357 →	MVB1215R6D	6DPK1215
						TB680	120x30
						TBK270	
	AXB	77	04/03 →		A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125
					A/C(-), Ch. 7H-6H079891 →	MVB1137R6	6PK1137
					A/C(+), → Ch. 7H-6X022356	MVB1200R6D	6DPK1200
					A/C(+), Ch. 7H-6X022357 →	MVB1215R6D	6DPK1215
						TB680	120x30
						TBK270	
BRS	75	06/06 →		A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125	
				A/C(-), Ch. 7H-6H079891 →	MVB1137R6	6PK1137	
				A/C(+), → Ch. 7H-6X022356	MVB1200R6D	6DPK1200	
				A/C(+), Ch. 7H-6H079891 →	MVB1215R6D	6DPK1215	
					TB680	120x30	
					TBK270		
BRR	62	01/06 →		A/C(-), → Ch. 7H-6H079890	MVB1125R6	6PK1125	
				A/C(-), Ch. 7H-6X022357 →	MVB1137R6	6PK1137	
				A/C(+), → Ch. 7H-6H079890	MVB1200R6D	6DPK1200	
				A/C(+), Ch. 7H-6H079891 →	MVB1215R6D	6DPK1215	
					TB680	120x30	
					TBK270		
2.0	AXA	85	11/03 →		A/C(-)	MVB1125R6	6PK1125
					A/C(+)	MVB1200R6D	6DPK1200
						TB552	138x23
						TBK100	
3.2 V6	BDL	170	02/04 →		A/C(-)	MVB1260R6	6PK1260
	BKK	173	08/03 →		A/C(-)	MVB1260R6	6PK1260

VENTO (1H2)

1.4	ABD, AEX	40	11/91 → 09/98		A/C(-), MS	MVB736R6	6PK736		
					Eng. ABD, A/C(-), PS	MVB1100R6	6PK1100		
					Eng. ABD, A/C(+)	MVB1155R6	6PK1155		
						TB283	128x19		
					A/C(+)	SVB12760	12x760		
				44	11/91 → 09/98		A/C(-), MS	MVB736R6	6PK736
							Eng. ABD, A/C(-), PS	MVB1100R6	6PK1100
							Eng. ABD, A/C(+)	MVB1155R6	6PK1155
							Eng. AEX, MS, 08/95 → 04/96	MVB750R6	6PK750
							Eng. AEX, PS, 08/95 → 04/96	MVB1065R6	6PK1065
								TB283	128x19
							08/95 → 04/96	TB466	135x19
							08/95 → 04/96	TBK087	
								SVB12760	12x760



kw



...VW

...VENTO (1H2)

Power (kw)	Engine Code	Power (kw)	Period	Accessories	Notes	Part Number	Part Number
1.6	ABU, AEA, AEE	55	09/92 → 09/98	⊗	A/C(-), MS, →07/95	MVB736R6	6PK736
				⊗	Eng. AEA, A/C(-), PS, →07/95	MVB1100R6	6PK1100
				⊗	Eng. AEA, A/C(+), →07/95	MVB1155R6	6PK1155
				⊗	Eng. AEE, MS, 08/95→12/97	MVB750R6	6PK750
				⊗	Eng. AEE, PS, 08/95→12/97	MVB1065R6	6PK1065
				⊗	→07/95	TB442	133x19
				⊗	07/94→12/97	TB467	137x19
				⊗	07/94→12/97	TBK088	
				⊗	A/C(+), →07/95	SVB12760	12x760
				⊗	A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95→12/97	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner, →12/97	MVB890R6	6PK890
				⊗	A/C(+), →12/97	MVB1155R6	6PK1155
				⊗	→12/97	TB463	121x18
1.8	AAM	55	11/91 → 09/98	⊗	A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95→07/97	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner, →07/97	MVB890R6	6PK890
				⊗	A/C(+), →07/97	MVB1155R6	6PK1155
				⊗	→07/94, → Ch. R...	TB108	121x18
				⊗	07/94→07/97, Ch. S...→	TB463	121x18
				⊗	→07/94, → Ch. R...	TBK016	
				⊗	07/94→07/97, Ch. S...→	TBK086	
				⊗	A/C(-), →07/97	SVB12685	12x685
				⊗	A/C(+), →07/97	SVB12760	12x760
				⊗	A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95→07/97	MVB1035R6	6PK1035
				⊗	A/C(-), Manu Tensioner, →07/97	MVB890R6	6PK890
				⊗	A/C(+), →07/97	MVB1155R6	6PK1155
⊗	→07/94, → Ch. R...	TB108	121x18				
⊗	07/94→07/97, Ch. S...→	TB463	121x18				
⊗	→07/94, → Ch. R...	TBK016					
⊗	07/94→07/97, Ch. S...→	TBK086					
⊗	A/C(-), →07/97	SVB12685	12x685				
⊗	A/C(+), →07/97	SVB12760	12x760				
1.9 D	1Y	48	11/91 → 09/98	⊗	A/C(-), →07/97	MVB1045R6	6PK1045
				⊗	A/C(-), Auto Tensioner, →07/97	MVB925R6	6PK925
				⊗	A/C(+), →07/97	MVB1150R6	6PK1150
				⊗	→07/97	TB384	137x25.4
				⊗	→07/94, → Eng Nr 1Y378364	TBK024	
				⊗	07/94→07/97,	TBK025	
				⊗	Eng Nr 1Y378365→		
				⊗	08/95→07/97	TBK026	
				⊗	A/C(-), →07/97	SVB12735	12x735
				⊗	A/C(+), →07/97	SVB11790	11x790



kW



...VW

...VENTO (1H2)

1.9 SDI	AEY	47	04/97 → 09/98	⊗	A/C(-), →07/97	MVB1045R6	6PK1045
				⊗	A/C(+), →07/97	MVB1150R6	6PK1150
					→07/97	TB384	137x25.4
				KIT	→07/97	TBK026	
1.9 TD	AAZ	55	11/91 → 09/98	⊗	A/C(-), Auto Tensioner, →07/97	MVB925R6	6PK925
				⊗	A/C(-), Manu Tensioner, →07/97	MVB1045R6	6PK1045
				⊗	A/C(+), →07/97	MVB1150R6	6PK1150
					→07/97	TB384	137x25.4
				KIT	→07/94, → Eng Nr 552765	TBK024	
				KIT	07/94→07/97, Eng Nr 552766→	TBK025	
				⊗	A/C(-), →07/97	SVB12735	12x735
				⊗	A/C(+), →07/97	SVB11790	11x790
1.9 TDI	1Z, AHU, ALE	66	09/93 → 09/98	⊗	A/C(-), →12/97	MVB1045R6	6PK1045
				⊗	A/C(+), →04/96	MVB1155R6	6PK1155
				⊗	A/C(+), 08/95→12/97	MVB1150R6	6PK1150
					→12/97	TB384	137x25.4
				KIT	→07/94, → Eng Nr 1Z289575	TBK119	
				KIT	07/94→12/97	TBK026	
				⊗	A/C(-), →12/97	SVB12735	12x735
				⊗	A/C(+), →12/97	SVB11790	11x790
	AFN	81	04/96 → 09/98	⊗	A/C(-), →12/97	MVB1045R6	6PK1045
				⊗	A/C(+), →12/97	MVB1150R6	6PK1150
					→12/97	TB384	137x25.4
				KIT	→12/97	TBK026	
				⊗	A/C(-), →12/97	SVB12735	12x735
				⊗	A/C(+), →12/97	SVB11790	11x790
				⊗	A/C(-), Auto Tensioner, →12/95	MVB975R6	6PK975
				⊗	A/C(-), Auto Tensioner, 12/95→12/97	MVB1035R6	6PK1035
	2E, ADY, AGG, AKR	85	11/91 → 09/98	⊗	A/C(-), Manu Tensioner, →12/97	MVB890R6	6PK890
				⊗	A/C(+), →12/97	MVB1155R6	6PK1155
					→12/97	TB506	124x18
				KIT	→12/97	TBK076	
				⊗	A/C(-), →12/97	SVB12685	12x685
				⊗	A/C(+), →12/97	SVB12760	12x760
				⊗	A/C(-), →07/97	MVB1285R7	7PK1285
				⊗	A/C(+), →07/97	MVB1360R7D	7DPK1360

WARTBURG

353

1.0	353,18	33	06/66 → 04/69	⊗		SVB101150	10x1150
				⊗	incl. oil pump	SVB101250	10x1250
				⊗		SVB101150	10x1150
				⊗	incl. oil pump	SVB101250	10x1250
1.0 (353 W 000)	353,18	37	02/75 → 08/88	⊗	→03/88	SVB101075	10x1075
				⊗	→03/88	SVB101150	10x1150
				⊗	→03/88, incl. oil pump	SVB101250	10x1250

353 Tourist

1.0	353,18	33	10/67 → 04/69	⊗		SVB101150	10x1150
				⊗	incl. oil pump	SVB101250	10x1250
		37	02/75 → 01/89	⊗	→03/88	SVB101075	10x1075
				⊗	→03/88	SVB101150	10x1150
				⊗	→03/88, incl. oil pump	SVB101250	10x1250
				⊗		SVB101150	10x1150
		37	04/69 → 02/75	⊗	incl. oil pump	SVB101250	10x1250



kW



ZASTAVA

ZASTAVA

101 (1100)

1.1	128 A.064	41	05/75 → 12/93			SVB10825	10x825
						TB114	116x19
						SVB10825	10x825
	128 A.000	40	06/73 → 01/90			SVB10825	10x825
						TB114	116x19
		37	12/75 → 01/80			SVB10825	10x825
						TB114	116x19
1.1 Super	128 AC 5000	47	07/79 → 09/81			SVB10825	10x825
						TB114	116x19
1.3	128 AR 000	48	10/81 → 12/93			SVB10950	10x950
						TB114	116x19

YUGO

0.9		33	04/80 → 06/92		→12/88	SVB10840	10x840
1.1 60 EFI (145 A)	100 GL. 0.64, 11 E 1.064	44	08/91 → 06/95			SVB10825	10x825
						TB114	116x19
1.3 65 EFI (145 A)	13 E 1.064	48	08/91 → 06/95			SVB10825	10x825
						SVB10950	10x950
					→09/93	TB114	116x19








YUGO FLORIDA

1.1		44	08/89 →		→05/95	SVB10825	10x825
					→05/95	TB114	116x19
1.4	160 A1.000	52	10/88 → 06/95		10/89 →	SVB10850	10x850
					10/89 →, → Ch. 2125555	MVB915R3	3PK915
					10/89 →, Ch. 2125555 →	MVB915R4	4PK915
					01/89 → 12/94, Eng. EFI	TB580	136x15
					10/89 →	TB305	138x15
					10/89 →	TBK027	
1.4 CAT		52	10/88 →		10/89 → 10/95	SVB10850	10x850
					Inj, 10/89 → 10/95,	MVB915R3	3PK915
					→ Ch. 2125555		
					Inj, 10/89 → 10/95,	MVB915R4	4PK915
					Ch. 2125555 →		
					01/89 → 12/94, Eng. EFI	TB580	136x15
1.6		62	08/89 → 06/95		10/89 → 10/95	TB305	138x15
					10/89 → 10/95	TBK027	
					→ Ch. 2125555	MVB915R3	3PK915
					Ch. 2125555 →	MVB915R4	4PK915
						TB305	138x15

ZAZ







TAVRIJA







1.1	MEMZ-245	37	01/89 →		06/00 →	SVB10725	10x725
					06/00 →	TB161	94x19
1.3	MEMZ-310	44	01/89 →		04/00 →	SVB10710	10x710
					04/00 →	TB161	94x19

 	 	 
MVB500R3 SUZUKI GRAND VITARA, GRAND VITARA (FT, GT), VITARA (ET, TA), VITARA Cabrio (ET, TA)	LANCER V (CB/D_A), LANCER V Station Wagon (CB_W, CD_W), SPACE RUNNER (N1_W, N2_W), SPACE WAGON (N3_W, N4_W) 605 (6B) PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S)	PUNTO (176), PUNTO (188), PUNTO Convertible (176C), PUNTO Van (176L), PUNTO Van (188AX), SEICENTO (187), SEICENTO Van (187), SIENA (178_), STILO (192), STILO Multi Wagon (192), STRADA (178E) ATOS (MX), ATOS PRIME (MX), GETZ (TB) PICANTO (BA) Y (840A), Y10 (156), YPSILON
MVB513R3 DAIHATSU CUORE VI (L7_), MOVE (L6, L9), SIRION (M1), YRV (M2)	PEUGEOT PROTON	HYUNDAI KIA LANCIA
MVB538R3 DAIHATSU CHARADE IV (G200, G202), CHARADE IV Saloon (G203), GRAN MOVE (G3)	MVB648R3 FIAT FIORINO Box (146 Uno), FIORINO Pick up (146) FORD ESCORT '86 Express (AVF), ESCORT '91 Express (AVL), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), FIESTA Box (FVD), FIESTA III (GF), ORION II (AFF), ORION III (GAL)	MVB675R3 AUTOBIANCHI Y10 FIAT UNO (146A/E) FORD ESCORT '91 Express (AVL), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Estate (GAL), FIESTA Box (F3L, F5L), FIESTA Box (FVD), FIESTA III (GF), ORION III (GAL) HYUNDAI COUPE (GK), TRAJET (FO), TUCSON (JM) KIA CARENS II (FJ), CERATO, CERATO Saloon, SPORTAGE (E_) LANCIA Y10 (156)
MVB545R4 FIAT CINQUECENTO (170), SEICENTO (187), SEICENTO Van (187), UNO (146A/E)	MVB648R4 ALFA ROMEO 155 (167), GTV (916C_), SPIDER (916S_) FORD ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA Box (FVD), FIESTA III (GF) MAZDA 626 II (GC), 626 II Hatchback (GC), 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD) MITSUBISHI SPACE WAGON (N3_W, N4_W) NISSAN MICRA (K11)	MVB675R5 FORD FIESTA Box (J5_, J3_), FIESTA Box (JV_), FIESTA IV (JA_, JB_) MAZDA 121 III (JASM, JBSM)
MVB563R3 DAIHATSU CHARADE II (G11, G30), CHARADE III (G100, G101, G102), CHARADE III Saloon (G102)	MVB648R4 ALFA ROMEO 155 (167), GTV (916C_), SPIDER (916S_) FORD ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA Box (FVD), FIESTA III (GF) MAZDA 626 II (GC), 626 II Hatchback (GC), 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD) MITSUBISHI SPACE WAGON (N3_W, N4_W) NISSAN MICRA (K11)	MVB675R6 NISSAN MICRA (K11)
MVB563R4 RENAULT SAFRANE I (B54_)	MVB650R5 RENAULT ESPACE III (JEO_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_)	MVB683R3 AUTOBIANCHI Y10 CHEVROLET MATIZ FIAT ELBA (146_), FIORINO Box (146 Uno), FIORINO Pick up (146) FORD COUGAR (EC_), MAVERICK, MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), MONDEO III (B5Y), MONDEO III Estate (BWY), MONDEO III Saloon (B4Y) LANCIA Y10 (156) MAZDA MPV II (LW), TRIBUTE (EP)
MVB575R5 FORD ESCORT V Estate (GAL), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP)	MVB660R3 HYUNDAI ELANTRA (XD), ELANTRA Saloon (XD), MATRIX (FC) SUBARU JUSTY I (KAD)	MVB688R5 CITROËN AX (ZA-_), XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) MAZDA 626 III Station Wagon (GV), 626 IV (GE), 626 IV Hatchback (GE) SUBARU IMPREZA Coupe (GFC), IMPREZA Estate (GD, GG), IMPREZA Estate (GF), IMPREZA Saloon (GC), IMPREZA Saloon (GD, GG), LEGACY I (BC), LEGACY I Estate (BJF)
MVB580R4 VOLVO 440 K (445), 460 L (464)	MVB660R3 HYUNDAI ELANTRA (XD), ELANTRA Saloon (XD), MATRIX (FC) SUBARU JUSTY I (KAD)	MVB698R6 CITROËN JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (230), ZX (N2), ZX Break (N2) FIAT BRAVO (182), COUPE (FA/175), DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230), MAREA (185), MAREA Weekend (185) LADA 110, 111, 112, SAMARA (2108, 2109), SAMARA FORMA (21099) PEUGEOT 306 Convertible (7D, N3, N5), 405 II (4B), 405 II Break (4E), BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (ZCT_)
MVB588R4 MITSUBISHI COLT IV (CA_A), LANCER V (CB/D_A) PROTON PERSONA 300 (C9_M), PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S), SATRIA (C9_M), WIRA, WIRA Hatchback	MVB660R3 HYUNDAI ELANTRA (XD), ELANTRA Saloon (XD), MATRIX (FC) SUBARU JUSTY I (KAD)	MVB698R6 CITROËN JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (230), ZX (N2), ZX Break (N2) FIAT BRAVO (182), COUPE (FA/175), DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230), MAREA (185), MAREA Weekend (185) LADA 110, 111, 112, SAMARA (2108, 2109), SAMARA FORMA (21099) PEUGEOT 306 Convertible (7D, N3, N5), 405 II (4B), 405 II Break (4E), BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (ZCT_)
MVB600R3 VOLVO 440 K (445), 460 L (464), 480 E	MVB673R4 AUTOBIANCHI Y10 FIAT BRAVA (182), BRAVO (182), CINQUECENTO (170), DOBLO (119), DOBLO Cargo (223), IDEA, MAREA (185), MAREA Weekend (185), PALIO (178BX), PALIO Weekend (178DX), PANDA (141A_), PANDA Van (141_)	
MVB613R4 HYUNDAI ACCENT (LC), ACCENT (X-3), ACCENT Saloon (LC), ACCENT Saloon (X-3), GETZ (TB), LANTRA II (J-2), LANTRA II Wagon (J2)	MVB673R4 AUTOBIANCHI Y10 FIAT BRAVA (182), BRAVO (182), CINQUECENTO (170), DOBLO (119), DOBLO Cargo (223), IDEA, MAREA (185), MAREA Weekend (185), PALIO (178BX), PALIO Weekend (178DX), PANDA (141A_), PANDA Van (141_)	
MVB630R3 NISSAN MICRA (K10) TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), CARINA II (T15_), CARINA II (T17_), CARINA II Saloon (T15_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CELICA (T20_), CELICA (ST16_), CELICA Coupe (T18_), CELICA Hatchback (T16), COROLLA (E9_), COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E9_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA FX Compact (E8B), COROLLA Liftback (E9_), COROLLA Liftback (E10_), COROLLA Liftback (E11_), COROLLA Station Wagon (E9_), COROLLA Wagon (E11_), COROLLA Wagon (E10_)	MVB673R4 AUTOBIANCHI Y10 FIAT BRAVA (182), BRAVO (182), CINQUECENTO (170), DOBLO (119), DOBLO Cargo (223), IDEA, MAREA (185), MAREA Weekend (185), PALIO (178BX), PALIO Weekend (178DX), PANDA (141A_), PANDA Van (141_)	
MVB638R5 ROVER 800 (XS), 800 Hatchback (XS)		
MVB640R4 HYUNDAI S COUPE (SLC) MITSUBISHI GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A)		

NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits



					
MVB700R4			MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), RAPID Box (F40_, G40_)		CRX I (AF, AS), INTEGRA (DA_)
CITROËN	BX (XB-), BX Break (XB-), C15 (VD-), VISA, ZX (N2)			MG	MG ZT, MG ZT-T
FIAT	BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185), PALIO (178BX), PALIO Weekend (178DX), PUNTO (176), PUNTO (188), PUNTO Convertible (176C), PUNTO Van (188AX), SIENA (178_), STRADA (178E)	MVB715R4	CHEVROLET MATIZ DACIA LOGAN, LOGAN MCV DAEWOO MATIZ (KLYA) DAIHATSU CHARADE (L2_), CUORE VI (L7_), CUORE VII (L251), MOVE (L6, L9), SIRION (M1), TREVIS, YRV (M2) NISSAN SUNNY III Traveller (Y10) PEUGEOT 205 Box, 205 I (741A/C), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E)	NISSAN	KUBISTAR (X76)
FSO	POLONEZ II, POLONEZ III			RENAULT	CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), THALIA (LB0/1/2_), TWINGO (C06_), TWINGO Box (S06_)
LADA	SAMARA (2108, 2109), SAMARA FORMA (21099)			ROVER	75 (RJ), 75 Tourer (RJ), 200 (XH)
LANCIA	Y (840A)			SUBARU	VIVIO
MITSUBISHI	ECLIPSE II (D3_), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A)			MVB735R4	
PEUGEOT	205 Box, 205 I (741A/C), 205 I Convertible (741B, 20D), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), 405 II (4B), 405 II Break (4E) HORIZON	RENAULT LOGAN (L5_) TATA (TELCO) INDICA (40_V2), INDIGO (4_V2), INDIGO MARINA (4_V2) TOYOTA PREVIA (TCR1_, 2_)		CHEVROLET MATIZ DAEWOO MATIZ (KLYA) FORD MONDEO III (B5V), MONDEO III Estate (BWV), MONDEO III Saloon (B4Y), TRANSIT Box (FA_), TRANSIT Bus (FD_, FB_, FS_, FZ_, FC_), TRANSIT Flatbed / Chassis (FM_, FN_)	
TALBOT		MVB715R6		JAGUAR	X-TYPE (CF1), X-TYPE Estate
		PORSCHE 944, 944 Convertible, 968, 968 Convertible		RENAULT	CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), SAFRANE I (B54_), TWINGO (C06_), TWINGO Box (S06_)
MVB700R5		MVB720R3		ROVER	200 (XH)
CITROËN	BX (XB-), BX Break (XB-)	FIAT	PALIO Weekend (178DX), PUNTO (176), PUNTO Van (176L), STRADA (178E)	MVB735R5	
HONDA	CONCERTO (HW)			CITROËN	XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4)
PEUGEOT	106 I (1A, 1C), 405 I (15B), 405 I Break (15E), 605 (6B)	MVB725R4		LAND ROVER	FREELANDER (LN), FREELANDER Soft Top
ROVER	200 Hatchback (XW), 400 (XW), 400 Tourer (XW)	NISSAN	BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11), MICRA (K11), PRAIRIE PRO (M11)	MG	MG TF, MG ZR, MG ZS, MG ZS Hatchback, MG ZT, MG ZT-T, MGF (RD)
MVB705R3		ROVER	CITYROVER	PEUGEOT	605 (6B)
RENAULT	CLIO I (B/C57_, 5/357_), CLIO I Box (S57_)	SUBARU	JUSTY I (KAD)	PORSCHE	924, 944
MVB706R4		MVB725R5		ROVER	25 (RF), 45 (RT), 45 Saloon (RT), 75 (RJ), 75 Tourer (RJ), 100 (METRO) (XP), 100 Convertible (XP), 200 (RF), 400 (RT), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW), COUPE, STREETWISE
DAIHATSU	EXTOL Bus (S22_, S23_), FERROZA Hard Top (F300), FERROZA Soft Top (F300)	CITROËN	BX (XB-)		
FIAT	PUNTO (176), PUNTO Convertible (176C), PUNTO Van (176L)	PEUGEOT	309 II (3C, 3A), 405 I (15B)	MVB736R6	
LANCIA	Y (840A)			AUDI	A2 (8Z0)
NISSAN	BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13)	MVB730R6		SEAT	ALTEA (5P1), ALTEA XL (5P5), CORDOBA (6K2/C2), CORDOBA (6L2), CORDOBA Hatchback (6K2), IBIZA II (6K1), IBIZA IV (6L1), IBIZA V (6J5), IBIZA V SPORTCOUPE (6I1)
SUBARU	LIBERO Bus (E10, E12)	CITROËN	BERLINGO (MF), BERLINGO Box (M_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), C4 (LC_), C4 Coupe (LA_), JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), ZX (N2), ZX Break (N2)	SKODA	FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1Z3), OCTAVIA Combi (1Z5), PRAKTIK, ROOMSTER (5I)
MVB710R5		FIAT	DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), SCUDO Box (220L), SCUDO Combinato (220P)	VW	CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), GOLF III (1H1), GOLF III Variant (1H5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, POLO (9N_), POLO Saloon, VENTO (1H2)
CITROËN	BERLINGO (MF), BERLINGO Box (M_), BX (XB-), BX Break (XB-), SAXO (S0, S1), XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4)	NISSAN	BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11), PRAIRIE PRO (M11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13)	MVB747R4	
FORD	ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA Box (FVD), FIESTA III (GF)	PEUGEOT	206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 207 SW (WK_), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 405 I (15B), 405 II (4B), 405 II Break (4E), 1007 (KM_), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F)	FIAT	BRAVA (182), BRAVO (182)
PEUGEOT	106 II (1), 405 I (15B), 405 I Break (15E), 605 (6B), PARTNER Box (5), PARTNER Combispace (5F)			FSO	POLONEZ III
MVB715R3		MVB735R3		HYUNDAI	ATOS (MX), ATOS PRIME (MX), GETZ (TB)
HONDA	CRX I (AF, AS), CRX II (ED, EE), INTEGRA (DA_)	HONDA	CIVIC II, CIVIC II Hatchback (AL, AJ, AG, AH),	KIA	PICANTO (BA)
RENAULT	19 I (B/C53_), 19 I Box (S53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_), CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_)			ROVER	100 (METRO) (XP), 100 Convertible (XP), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), CABRIOLET (XW)
				MVB750R6	
				AUDI	A2 (8Z0)
				CITROËN	C15 (VD-)
				LADA	110, 111, 112, KALINA Hatchback (1119), KALINA Saloon (1118)
				PEUGEOT	PARTNER Combispace (5F)





  <p>SEAT AROSA (6H), CORDOBA (6K2/C2), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), INCA (6K9)</p> <p>SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3), FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5)</p> <p>VW CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY II Pickup (9U7), GOLF III (1H1), GOLF III Variant (1H5), LUPO (6X1, 6E1), POLO (6N1), POLO (6N2), POLO (9N_), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), VENTO (1H2)</p>	  <p>CARINA II Station Wagon (T17_), CELICA (T20_), CELICA (ST16), CELICA Convertible (T16_), CELICA Convertible (T18), CELICA Convertible (T20), CELICA Convertible (T18_), CELICA Coupe (T16F), CELICA Hatchback (T16), PICNIC (XM10), RAV 4 I (SXA1_), RAV 4 I Cabrio (SXA1_)</p>	  <p>ROVER 100 (METRO) (XP)</p> <p>TOYOTA HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_)</p> <p>VAUXHALL OMEGA, OMEGA Estate</p> <p>VOLVO S40 I (VS), V40 Estate (VW)</p>
<p>MVB753R3</p> <p>LAND ROVER FREELANDER (LN), FREELANDER Soft Top</p> <p>MG MG ZR, MG ZS, MG ZS Hatchback</p> <p>RENAULT CLIO II (BB0/1/2_, CB0/1/2_), THALIA (LB0/1/2_)</p> <p>ROVER 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 200 (XH), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW), COUPE, STREETWISE</p> <p>SUZUKI ALTO IV (FF)</p> <p>TOYOTA CAMRY (V1_), CAMRY (V20), CAMRY Station Wagon (V10)</p>	<p>MVB763R4</p> <p>ALFA ROMEO 164 (164)</p> <p>FIAT CROMA (154)</p> <p>HONDA INTEGRA (DC2)</p> <p>LANCIA THEMA (834), THEMA SW (834)</p> <p>MITSUBISHI COLT IV (CA_A), LANCER V (CB/D_A), SPACE RUNNER (N1_W, N2_W), SPACE WAGON (N3_W, N4_W)</p> <p>NISSAN MICRA (K11)</p> <p>ROVER MONTEGO, MONTEGO Estate (XE)</p> <p>SUZUKI SWIFT II Hatchback (EA, MA)</p>	<p>MVB775R5</p> <p>CITROËN AX (ZA-), SAXO (S0, S1)</p> <p>NISSAN MICRA (K11)</p> <p>PEUGEOT 106 I (1A, 1C), 106 II (1)</p> <p>RENAULT LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_)</p> <p>ROVER 100 (METRO) (XP)</p> <p>TOYOTA COROLLA (E8_), COROLLA FX Compact (E8B), COROLLA Liftback (E8_)</p>
<p>MVB755R4</p> <p>CITROËN BX (XB-), BX Break (XB-), JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (230), JUMPER Flatbed / Chassis (244)</p> <p>FIAT DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230), DUCATO Flatbed / Chassis (244), PALIO (178BX), SIENA (178_)</p> <p>PEUGEOT BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), BOXER Flatbed / Chassis (ZCT_)</p> <p>ROVER 200 (XH)</p>	<p>MVB768R5</p> <p>CITROËN XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4)</p> <p>PEUGEOT 605 (6B)</p> <p>SMART CABRIO, CITY-COUPÉ (MC01), FORTWO cabrio, FORTWO Coupe</p>	<p>MVB780R6</p> <p>SEAT CORDOBA (6L2), IBIZA IV (6L1)</p> <p>SKODA FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), ROOMSTER (5j)</p> <p>TOYOTA YARIS, YARIS (CP10)</p> <p>VW POLO (6N2), POLO (9N_), POLO Saloon</p>
<p>MVB760R3</p> <p>FORD USA PROBE I</p> <p>FSO POLONEZ III</p> <p>HONDA CIVIC II Shuttle (EE), CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED), CONCERTO (HW), CONCERTO Saloon (HWW), CRX II (ED, EE)</p> <p>KIA CLARUS (K9A), CLARUS Estate (GC)</p> <p>LEXUS ES (F1, F2)</p> <p>MAZDA 626 II (GC), 626 II Hatchback (GC), 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV)</p> <p>ROVER 200 (XH), 200 Coupe (XW), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Tourer (XW), CABRIOLET (XW)</p> <p>TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CAMRY (V1_), CAMRY (V2_), CAMRY Liftback (V1), CAMRY Saloon (V1), CAMRY Station Wagon (V2_), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), CARINA II (T15_), CARINA II (T17_), CARINA II Saloon (T15_), CARINA II Saloon (T17_)</p>	<p>MVB775R3</p> <p>RENAULT 19 I (B/C53_), 19 I Box (S53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_), CLIO I (B/C57_, 5/357_), CLIO I Box (S57_)</p> <p>MVB775R4</p> <p>BMW 3 (E36), 3 Touring (E36), 5 (E34), 5 (E39), 5 Touring (E34), 5 Touring (E39), 7 (E38)</p> <p>DAIHATSU APPLAUSE I (A101, A111), APPLAUSE II, CHARADE III (G100, G101, G102), CHARADE III Saloon (G102), CHARADE IV (G200, G202), CHARADE IV Saloon (G203), FERROZA Hard Top (F300), FERROZA Soft Top (F300), GRAN MOVE (G3), TERIOS (J1)</p> <p>FIAT CINQUECENTO (170), SEICENTO (187), SEICENTO Van (187), UNO (146A/E)</p> <p>HONDA CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED), CIVIC IV (EG, EH), CIVIC IV Coupe (EJ), CIVIC IV Hatchback (EG), CIVIC V (EJ9, EK3/4), CIVIC V Coupe (EJ6, EJ8), CIVIC V Hatchback (EJ9, EK1/3/4), CRX II (ED, EE), CRX III (EH, EG)</p> <p>HYUNDAI ATOS (MX), ATOS PRIME (MX), GETZ (TB), i10</p> <p>KIA PICANTO (BA)</p> <p>MAZDA RX 8 (SE17)</p> <p>MITSUBISHI CARISMA (DA_), CARISMA Saloon (DA_), COLT IV (CA_A), COLT V (CJ_A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), LANCER IV (C6_A, C7_A), LANCER V (CB/D_A), LANCER V Station Wagon (CB_W, CD_W), PAJERO PININ (H6_W, H7_W), SPACE RUNNER (N1_W, N2_W), SPACE STAR (DGO)</p> <p>NISSAN MAXIMA (J30), MAXIMA QX (A32), MAXIMA QX (A33), MAXIMA Station Wagon, MURANO (Z50)</p> <p>OPEL OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_)</p> <p>PROTON PERSONA 300 (C9_M), PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S), SATRIA (C9_M), WIRA</p> <p>RENAULT ESPACE IV (JK0/1_), VEL SATIS (BJO_)</p>	<p>MVB785R3</p> <p>DAIHATSU CHARADE III (G100, G101, G102), CHARADE IV (G200, G202)</p> <p>HONDA CONCERTO (HW), CONCERTO Saloon (HWW)</p> <p>NISSAN MICRA (K10)</p> <p>ROVER 200 Coupe (XW), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Tourer (XW), CABRIOLET (XW)</p> <p>MVB788R5</p> <p>BMW 3 (E36), 3 Convertible (E36), 3 Coupe (E36), Z3, Z3 Coupe</p> <p>CHRYSLER VOYAGER I (ES)</p> <p>FORD SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)</p> <p>ROVER MAESTRO, MONTEGO, MONTEGO Estate (XE)</p> <p>TOYOTA CELICA (TA60, RA40, RA6_), CELICA Coupe (RA6), COROLLA (E8_), COROLLA (E9_), COROLLA Compact (E9_), COROLLA FX Compact (E8B), COROLLA Liftback (E8_), COROLLA Liftback (E9_), COROLLA Station Wagon (E9_)</p>
		<p>MVB790R4</p> <p>DAIHATSU APPLAUSE I (A101, A111), CHARADE IV (G200, G202), CHARADE IV Saloon (G203), GRAN MOVE (G3)</p> <p>FIAT CROMA (154)</p> <p>HONDA ACCORD VII (CG), CIVIC IV Fastback (MA, MB), CIVIC V Aerodeck (MC), CIVIC V Fastback (MB)</p> <p>LANCIA THEMA (834), THEMA SW (834)</p> <p>ROVER 400 (RT), 400 Hatchback (RT)</p> <p>SMART CABRIO, CITY-COUPÉ (MC01), CROSSBLADE, FORTWO cabrio, FORTWO Coupe, ROADSTER, ROADSTER Coupe</p> <p>SUBARU JUSTY II (JMA, MS)</p> <p>SUZUKI GRAND VITARA (FT, GT), SWIFT Convertible (SF413), SWIFT II (AH, AJ), SWIFT II Hatchback (EA, MA), VITARA (ET, TA), VITARA Cabrio (ET, TA), WAGON R+ (MM)</p> <p>TOYOTA MR 2 (W1_)</p>
		<p>MVB795R6</p> <p>CITROËN C1 (PM_, PN_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230)</p>



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits

  <p>FIAT BRAVO, STILO (192) FORD C-MAX, FIESTA V (JH_, JD_), FOCUS C-MAX, FOCUS II (DA_), FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), FUSION (JU_) MAZDA 3 (BK14), 3 Saloon (BK12) MINI MINI, MINI CLUBMAN PEUGEOT 107, 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 207 CC (WD_), 207 SW (WK_), 307 (3A/C), 307 Break (3E), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 1007 (KM_), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_), PARTNER Tepee TOYOTA AYGO</p>	  <p>MVB810R4 CITROËN ZX (N2) FIAT SEDICI HONDA CIVIC IV (EG, EH), CIVIC IV Coupe (EJ), CIVIC IV Fastback (MA, MB), CIVIC IV Hatchback (EG), CONCERTO (HW), CONCERTO Saloon (HWW), CRX III (EH, EG), INTEGRA (DC2) HYUNDAI ACCENT (LC), ACCENT (MC), ACCENT (X-3), ACCENT Saloon (LC), ACCENT Saloon (MC), ACCENT Saloon (X-3), COUPE (GK), ELANTRA (XD), ELANTRA Saloon (XD), MATRIX (FC) KIA CERATO, CERATO Saloon, RIO II, RIO II Saloon LANCIA Y10 (156) MAZDA 626 II (GC), 626 II Hatchback (GC) NISSAN 100 NX (B13), ALMERA I (N15), ALMERA I Hatchback (N15), BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11), MICRA (K10), PRIMERA (P10), PRIMERA (P11), PRIMERA Hatchback (P10), PRIMERA Hatchback (P11), PRIMERA Traveller (W10), SERENA (C23M), SUNNY Box (Y10), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10), VANETTE CARGO Box (HC 23), VANETTE CARGO Bus (HC 23)</p>	  <p>MVB825R3 FORD ESCORT V Estate (GAL, AVL), P 100 II, SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) NISSAN SILVIA (S12)</p>
<p>MVB800R3 TOYOTA LITEACE Box (_R2_V), LITEACE Bus (_R2_LG), MODELL F Bus (_R2_, 31)</p>	<p>MVB813R3 FORD ESCORT V Estate (GAL, AVL), P 100 II, SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) HONDA ACCORD III (CA4, CA5), PRELUDE III (BA) RENAULT CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), RAPID Box (F40_, G40_) SUBARU JUSTY II (JMA, MS) SUZUKI SWIFT Convertible (SF413), SWIFT II (AH, AJ), SWIFT II Hatchback (EA, MA)</p>	<p>MVB825R4 AUSTIN MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE) DAIHATSU CHARADE IV (G200, G202), CHARADE IV Saloon (G203), GRAN MOVE (G3) FORD FIESTA Box (F3L, F5L), FIESTA III (GF) HONDA ACCORD VII (CG), CIVIC IV Coupe (EJ), CIVIC V (EJ9, EK3/4), CIVIC V Aerodeck (MC), CIVIC V Coupe (EJ6, EJ8), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK1/3/4), CIVIC VII Hatchback (EU_, EP_), CR-V I (RD), CRX III (EH, EG) HYUNDAI ACCENT (X-3), GETZ (TB) LANCIA Y10 (156) NISSAN ALMERA I (N15), ALMERA I Hatchback (N15), NAVARA (D40), PATHFINDER (R51), PRIMERA (P11), PRIMERA Hatchback (P11), SUNNY III Traveller (Y10) ROVER 400 (RT), 400 Hatchback (RT) SUZUKI SWIFT II Hatchback (EA, MA), VITARA (ET, TA), VITARA Cabrio (ET, TA) TOYOTA COROLLA (_E9_), COROLLA (_E10_), COROLLA (_E11_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA Compact (_E11_), COROLLA FX Compact (E8B), COROLLA Liftback (_E9_), COROLLA Liftback (_E10_), COROLLA Liftback (_E11_), COROLLA Wagon (_E11_), COROLLA Wagon (_E10_), MR 2 (_W2_), PASEO Convertible (EL54), PASEO Coupe (EL54), STARLET (EP91)</p>
<p>MVB800R4 CITROËN C25 Bus (280_, 290_) DAIHATSU CHARADE IV (G200, G202) HONDA CIVIC IV (EG, EH), CIVIC IV Coupe (EJ), CIVIC IV Fastback (MA, MB), CIVIC IV Hatchback (EG), CIVIC V (EJ9, EK3/4), CIVIC V Coupe (EJ6, EJ8), CIVIC V Hatchback (EJ9, EK1/3/4), CIVIC VI Hatchback (EU_, EP_), CRX III (EH, EG), HR-V (GH), LOGO (GA3) ISUZU TROOPER (UB), TROOPER Open Off-Road Vehicle (UB) KIA PRIDE (DA), PRIDE Estate LEXUS ES (F1, F2) MAZDA FESTIVA MITSUBISHI COLT VI NISSAN 100 NX (B13), ALMERA I (N15), ALMERA I Hatchback (N15), PRIMERA (P10), PRIMERA (P11), PRIMERA Hatchback (P10), PRIMERA Hatchback (P11), PRIMERA Traveller (W10), SUNNY Box (Y10), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10) OPEL MONTEREY A (UBS_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_) PEUGEOT J5 Box (290L), J5 Bus (290P), J5 Flatbed / Chassis (290L) ROVER 400 (RT), 400 Hatchback (RT), 800 (XS), 800 Hatchback (XS) SMART FORFOUR, FORTWO Cabrio, FORTWO Coupe SUBARU JUSTY III (G3X) SUZUKI GRAND VITARA (FT, GT), IGNIS II, SWIFT III (SG), SX4, VITARA (ET, TA), VITARA Cabrio (ET, TA) TALBOT EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1800 Box TOYOTA CAMRY (_V1_), CAMRY Station Wagon (_V10), MODELL F Bus (_R2_, 31) VAUXHALL MONTEREY, OMEGA, OMEGA Estate</p>	<p>PEUGEOT 205 I Convertible (741B, 20D), 205 II (20A/C), 309 I (10C, 10A), 309 II (3C, 3A) ROVER 200 Coupe (XW), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW), MAESTRO SUBARU JUSTY II (JMA, MS) SUZUKI ALTO III (EF), BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), CARRY Box (FD), GRAND VITARA (FT, GT), IGNIS (FH), JIMNY (FJ), SWIFT I (AA), SWIFT II (AH, AJ), SWIFT II Hatchback (EA, MA), SWIFT III (SG), SX4, VITARA (ET, TA), VITARA Cabrio (ET, TA), WAGON R+ (MM), X-90 (EU) TOYOTA COROLLA (_E8_), COROLLA (_E9_), COROLLA Compact (_E9_), COROLLA FX Compact (E8B), COROLLA Liftback (_E8_), COROLLA Liftback (_E9_), COROLLA Station Wagon (_E9_), STARLET (_P7_), STARLET (_P8_)</p>	<p>MVB825R5 ALFA ROMEO 164 (164) DAIHATSU ROCKY Hard Top (F7, F8), ROCKY Soft Top (F7, F8) MAZDA RX 8 (SE17) RENAULT SAFRANE I (B54_) TOYOTA CELICA (ST16_), CELICA (TA60, RA40, RA6_), CELICA Coupe (RA6), CELICA Hatchback (T16), COROLLA Coupe (AE86), COROLLA FX Compact (E8B), DYNA Flatbed / Chassis, LITEACE Box (_R2_V), LITEACE Bus (_R2_LG), MODELL F Bus (_R2_, 31), MR 2 (_W1_)</p>
<p>MVB800R5 ALFA ROMEO 155 (167), 164 (164) CITROËN BERLINGO (MF), ZX (N2), ZX Break (N2) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5) TOYOTA COROLLA Coupe (AE86)</p>	<p>MVB813R5 BMW 3 (E46), 3 Touring (E46), 5 (E39), 5 Touring (E39), 7 (E38), X5 (E53) LAND ROVER RANGE ROVER III (LM)</p>	<p>MVB825R6 FIAT PUNTO (188), PUNTO Van (188AX), STILO (192), STILO Multi Wagon (192) NISSAN ALMERA II (N16), ALMERA II Hatchback (N16), ALMERA TINO (V10), PRIMERA (P11), PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P11), PRIMERA Hatchback (P12), PRIMERA Traveller (WP11) RENAULT SPORT SPIDER (EFO_) SEAT CORDOBA (6L2), IBIZA IV (6L1), IBIZA V (6J5), IBIZA V SPORTCOUPE (6J1) SKODA FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), PRAKTIK, ROOMSTER (5J)</p>




 		 		 	
TOYOTA	PREVIA (TCR1_, 2_)		COROLLA Liftback (E9_), COROLLA Station Wagon (E9_), HIACE II Box (H5_), HIACE II Wagon (H5_), HIACE III Box (H10_), HIACE III Wagon (H10_), HILUX Pickup (N_), MODELL F Bus (R2_, 31), STARLET (P7_), SUPRA (MA70)	KIA	ACCENT Saloon (X-3), COUPE (GK), COUPE (RD), ELANTRA (XD), ELANTRA Saloon (XD), GETZ (TB), LANTRA II (J-2), LANTRA II Wagon (J2) CARNIVAL III (UVP_), CERATO, CERATO Saloon, RIO (DC_), RIO Estate (DC), RIO II, RIO II Saloon
VW	POLO (9N_)		TARO	MAZDA	121 II (DB), 323 C V (BA), 323 P V (BA), 323 S V (BA), DEMIO (DW)
MVB830R5				NISSAN	ALMERA II (N16), ALMERA II Hatchback (N16), ALMERA TINO (V10), PRIMERA (P11), PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P11), PRIMERA Hatchback (P12), PRIMERA Traveller (WP11)
BMW	3 Convertible (E46), 3 Coupe (E46), Z3, Z3 Coupe, Z4 (E85)	MVB836R5	BMW 3 (E46), 3 Touring (E46), 5 (E39), 5 Touring (E39) FIAT REGATA (138), REGATA Weekend, SEDICI JAGUAR XJ (X300), XJ (XJ 40, 81), XJS Coupe, XJSC Convertible SUZUKI GRAND VITARA, SWIFT III (SG), SX4	SUBARU	JUSTY II (JMA, MS), SVX (CX)
CITROËN	XSARA (N1), XSARA Break (N2), XSARA Coupe (N0)			SUZUKI	SWIFT Convertible (SF413), SWIFT II (AH, AJ), SWIFT II Hatchback (EA, MA)
OPEL	OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_)			TOYOTA	CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), CARINA II (T17_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CELICA Coupe (T18_), COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA Liftback (E10_), COROLLA Liftback (E11_), COROLLA Wagon (E11_)
ROVER	MINI MK I, MINI MK I Convertible (XN)			MVB850R5	
TOYOTA	COROLLA Compact (E9_), COROLLA Coupe (AE86), COROLLA Liftback (E9_), DYNA Flatbed / Chassis			CITROËN	XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4)
MVB835R4		MVB838R3	NISSAN 200 SX (S13) RENAULT MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_) TOYOTA LITEACE Box (R2_V), LITEACE Bus (R2_LG)	FIAT	REGATA (138), REGATA Weekend, RITMO II (138A)
BMW	3 (E36), 3 Compact (E36), 3 Touring (E36)			HONDA	JAZZ (GD)
CHEVROLET	AVEO Hatchback			LANCIA	DELTA I (831AB0), PRISMA (831AB0)
CITROËN	ZX (N2)			MITSUBISHI	COLT IV (CA_A), LANCER V (CB/D_A)
DAIHATSU	APPLAUSE I (A101, A111), APPLAUSE II, ROCKY Hard Top (F7, F8), ROCKY Soft Top (F7, F8)			PEUGEOT	605 (6B)
FIAT	BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185), PALIO (178BX), PALIO Weekend (178DX), PUNTO (176), PUNTO (188), PUNTO Convertible (176C), PUNTO Van (188AX), SIENA (178_), STRADA (178E)	MVB838R6	OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9) RENAULT MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD) VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD) VOLVO 440 K (445), 460 L (464), 480 E	RENAULT	9 (L42_), 11 (B/C37_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), CLIO I (B/C57_, 5/357_), SAFRANE I (B54_), SUPER 5 (B/C60_), TRAFIC Box (T1, T3, T4), TRAFIC Bus (T5, T6, T7), TRAFIC Flatbed / Chassis (P6)
HONDA	CIVIC IV (EG, EH), CIVIC IV Hatchback (EG), CRX III (EH, EG)			TOYOTA	COROLLA Compact (E9_), COROLLA Liftback (E9_)
HYUNDAI	ACCENT (X-3), GETZ (TB), TERRACAN (HP)	MVB845R4	BMW 5 (E60), 5 Touring (E61), 7 (E65, E66) DAIHATSU CHARADE IV (G200, G202) HONDA ACCORD VII (CG), CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED), CIVIC IV Coupe (EJ), CIVIC V (EJ9, EK3/4), CIVIC V Aerodeck (MC), CIVIC V Coupe (EJ6, EJ8), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK1/3/4), CIVIC VI Hatchback (EU_, EP_), CR-V I (RD), CRX II (ED, EE), HR-V (GH) HYUNDAI ACCENT (X-3), COUPE (GK), ELANTRA (XD), ELANTRA Saloon (XD), GETZ (TB), MATRIX (FC) NISSAN 100 NX (B13), 200 SX (S13), ALMERA I Hatchback (N15), PRIMERA (P10), PRIMERA (P11), PRIMERA Hatchback (P10), PRIMERA Hatchback (P11), PRIMERA Traveller (W10), PRIMERA Traveller (WP11), SILVIA (S12), SUNNY III Hatchback (N14), SUNNY III Liftback (N14)	TOYOTA	340-360 (343, 345), 340-360 Saloon (344), C30, C70 Convertible, S40 II (MS), V50 (MW)
JAGUAR	XJ, XJS Coupe, XJSC Convertible			MVB850R6	
LANCIA	Y (840A)			CITROËN	C1 (PM_, PN_)
LAND ROVER	RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN), RANGE ROVER II (LP)			OPEL	MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9)
NISSAN	100 NX (B13), ALMERA I (N15), ALMERA I Hatchback (N15), ALMERA TINO (V10), MICRA (K12), MICRA C+C (K12), NOTE (E11), PRIMERA (P10), PRIMERA (P11), PRIMERA Hatchback (P10), PRIMERA Hatchback (P11), PRIMERA Traveller (W10), PRIMERA Traveller (WP11), SERENA (C23M), SUNNY Box (Y10), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10), VANETTE CARGO Box (HC 23), VANETTE CARGO Bus (HC 23)			PEUGEOT	107
PEUGEOT	205 I (741A/C), 205 I Convertible (741B, 20D), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), 405 II (4B), 405 II Break (4E)			RENAULT	MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD), TRAFIC Box (TXX), TRAFIC Bus (TXW)
SUZUKI	ALTO III (EF), BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), IGNIS (FH), IGNIS II, JIMNY (FJ), LIANA (ER), LIANA Estate (ER), SWIFT II Hatchback (EA, MA), SWIFT III (SG), VITARA (ET, TA), VITARA Cabrio (ET, TA), WAGON R+ (MM)	MVB850R3	LANCIA THEMA (834) NISSAN ALMERA II (N16) SMART CABRIO, CITY-COUPE (MC01), CROSSBLADE, FORTWO cabrio, FORTWO Coupe, ROADSTER, ROADSTER Coupe TOYOTA YARIS (CP10), YARIS VERSO (NC/LP2_)	TOYOTA	AYGO
TOYOTA	AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CARINA II (T17_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), COROLLA (E9_), COROLLA Compact (E9_),	MVB850R4	CHRYSLER NEON (PL), NEON II, PT CRUISER (PT_) HYUNDAI ACCENT (LC), ACCENT (MC), ACCENT (X-3), ACCENT Saloon (LC), ACCENT Saloon (MC),	VAUXHALL	MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD)
				MVB855R4	
				AUDI	80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), CABRIOLET (8G7, B4), COUPE (89, 8B)



NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits





  <p>BMW 3 (E36), 3 Coupe (E36), 5 Touring (E34) CITROËN BERLINGO (MF), BERLINGO Box (M_), JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2) FIAT PALIO (178BX), PALIO Weekend (178DX), PUNTO (176), PUNTO Convertible (176C), PUNTO Van (176L), SIENA (178_) HYUNDAI ACCENT (LC), ACCENT (X-3), ACCENT Saloon (LC), ACCENT Saloon (X-3), COUPE (GK), ELANTRA (XD), ELANTRA Saloon (XD), LANTRA II Wagon (J2), MATRIX (FC), TRAJET (FO) KIA CARENS II (FJ), CERATO, CERATO Saloon, SPORTAGE (JE_) LANCIA Y (840A) LAND ROVER RANGE ROVER II (LP) MAZDA MX-5 I (NA) PEUGEOT 205 I Convertible (741B, 20D), 205 II (20A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 309 II (3C, 3A), PARTNER Box (5), PARTNER Combispacer (5F) SKODA SUPERB (3U4) SUBARU FORESTER (SG), IMPREZA Estate (GF), IMPREZA Saloon (GC) SUZUKI WAGON R+ (EM) VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)</p>	  <p>306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), EXPERT Box (222), EXPERT Flatbed / Chassis, EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispacer (5F) PORSCHE 928 RENAULT MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD) SEAT CORDOBA (6L2), IBIZA IV (6L1) SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3) VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD) VW FOX (5Z1), LUPO (6X1, 6E1), POLO (6N2), POLO (9N_), POLO Saloon</p>	  <p>LANCER III (C1_A, C6_A), LANCER III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A), LANCER IV Saloon (C6_A) 200 SX (S13), ALMERA II (N16), SILVIA (S12) BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_) NISSAN PERSONA 300 (C9_M), PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S), SATHIA (C9_M), WIRA, WIRA Hatchback 25 (B29_) PEUGEOT 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), CABRIOLET (XW) PROTON 4 RUNNER (N130), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), LAND CRUISER 90 (J9_), STARLET (P8_)</p>
<p>MVB860R4 BMW 3 (E46), 3 Compact (E46), 3 Convertible (E46), 3 Coupe (E46), 3 Touring (E46), 5 (E39), 5 (E60), 5 Touring (E39), 5 Touring (E61), 7 (E65, E66), X3 (E83), X5 (E53), Z4 (E85) FORD FIESTA Box (F3L, F5L), FIESTA III (GF) MAZDA MX-5 II (NB) PORSCHE 928 TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CELICA (T20_), COROLLA (E9_), COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E9_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA Liftback (E9_), COROLLA Liftback (E10_), COROLLA Liftback (E11_), COROLLA Liftback (E11_), COROLLA Station Wagon (E9_), COROLLA Wagon (E10_), HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_), STARLET (P8_)</p>	<p>MVB865R5 ALFA ROMEO 145 (930), 146 (930) BMW 3 (E46), 3 Compact (E46), 3 Convertible (E46), 3 Coupe (E46), 3 Touring (E46), 5 (E39), 5 Touring (E39), 7 (E38), X5 (E53), Z3, Z3 Coupe CITROËN BERLINGO (MF), BERLINGO Box (M_) FORD USA PROBE II (ECP) MAZDA 323 F V (BA), 626 IV Hatchback (GE), MX-3 (EC), MX-6 (GE6), XEDOS 6 (CA), XEDOS 9 (TA) MITSUBISHI CARISMA Saloon (DA_), COLT V (C1_A), LANCER VI (CK/P_A), MIRAGE Coupe, MIRAGE Hatchback, SPACE STAR (DGO) PROTON IMPIAN TOYOTA COROLLA (E9_), COROLLA Compact (E9_), COROLLA FX Compact (E8B), COROLLA Liftback (E9_), COROLLA Station Wagon (E9_), HIACE III Box (H10_), HIACE III Wagon (H10_), HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_), HILUX Pickup (N_)</p>	<p>MVB870R6 CITROËN JUMPER Box (244), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (244) FIAT DUCATO Box (244), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (244) MINI MINI, MINI Convertible OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9) PEUGEOT 307 (3A/C), 307 Break (3E), 307 SW (3H), BOXER Box (244), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244) PORSCHE 928 RENAULT 19 I (B/C53_), 19 I Box (S53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD) TOYOTA YARIS VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD)</p>
<p>MVB860R6 AUDI A2 (8Z0) CITROËN BERLINGO (MF), BERLINGO Box (M_), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO) DAIHATSU SIRION (M3_) FIAT SCUDO Box (220L) FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), KA (RB_) HONDA CIVIC VI, CIVIC VI Hatchback (EU_, EP_), STREAM (RN) MAZDA 121 III (JASM, JBSM) OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9) PEUGEOT 206 Hatchback (2A/C), 306 (7B, N3, N5),</p>	<p>MVB869R5 DAEWOO ESPERO (KLEI), LANOS (KLAT), LANOS Saloon (KLAT), NEXIA (KLETN), NEXIA Saloon (KLETN) FORD MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP) LAND ROVER FREELANDER (LN) MG MG ZT, MG ZT-T MITSUBISHI LANCER VI (CK/P_A) RENAULT 9 (L42_), 11 (B/C37_) ROVER 75 (RJ), 75 Tourer (RJ) SUBARU FORESTER (SG), IMPREZA Saloon (GD, GG), LEGACY IV Estate (B13_), OUTBACK TOYOTA COROLLA (E10_), COROLLA Compact (E10_)</p>	<p>MVB872R3 NISSAN 200 SX (S14), MICRA (K10)</p> <p>MVB875R4 CHRYSLER PT CRUISER (PT_), PT CRUISER Convertible HONDA CIVIC V (EJ9, EK3/4), CIVIC V Coupe (EJ6, EJ8), CIVIC V Hatchback (EJ9, EK1/3/4) HYUNDAI ACCENT (X-3), ACCENT Saloon (X-3), COUPE (GK), COUPE (RD), ELANTRA (XD), ELANTRA Saloon (XD), LANTRA II (J-2), LANTRA II Wagon (J2), MATRIX (FC), TUCSON (JM) JEEP CHEROKEE (XJ) KIA SEPHIA (FA), SEPHIA Saloon (FA), SHUMA Saloon (FB) LEXUS ES (F1, F2), RX (MCU_), RX (XU1) MAZDA 121 II (DB), 323 C V (BA), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), DEMIO (DW) MITSUBISHI COLT III (C5_A), COLT IV (CA_A), LANCER III (C1_A, C6_A), LANCER III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A), LANCER IV Saloon (C6_A), LANCER V (CB/D_A), MIRAGE Hatchback NISSAN 200 SX (S14), PRAIRIE PRO (M11), SERENA (C23M) RENAULT 21 (B48_), 21 Box (S48_), 21 Estate (K48_),</p>

					
TATA (TELCO)	21 Saloon (L48_), 25 (B29_), ESPACE I (J11_), ESPACE II (J/S63_)	MVB885R4	ALFA ROMEO 155 (167)	FIAT	CROMA (154), ELBA (146_), FIORINO Box (146 Uno), FIORINO Pick up (146), UNO (146A/E)
TOYOTA	INDICA (40_V2), INDIGO (4_V2), INDIGO MARINA (4_V2)	BMW	3 (E46), 3 Coupe (E46), 3 Touring (E46), 7 (E65, E66), X3 (E83), X5 (E53)	FORD	FIESTA Box (J5_, J3_), FIESTA Box (IV_), FIESTA IV (JA_, JB_), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP)
TOYOTA	CAMRY (V20), CAMRY (V30), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), MR 2 (W2_), STARLET (EP91)	KIA	CARENS I (FC), CARENS II (FJ), CLARUS (K9A), CLARUS Estate (GC), RIO (DC_), RIO Estate (DC), SEPHIA (FA), SEPHIA Saloon (FA), SHUMA (FB), SHUMA II (FB), SHUMA II Saloon (FB), SHUMA Saloon (FB)	LADA	KALINA Estate (1117), KALINA Hatchback (1119), KALINA Saloon (1118)
MVB875R5	ALFA ROMEO SPIDER (916S_)	MAZDA	323 C IV (BG), 323 C V (BA), 323 F IV (BG), 323 F V (BA), 323 F VI (BI), 323 P V (BA), 323 S IV (BG), 323 S V (BA), 323 S VI (BI), DEMIO (DW), MX-3 (EC), MX-5 I (NA), MX-5 II (NB), XEDOS 6 (CA)	LANCIA	THEMA (834), THEMA SW (834)
CITROËN	BERLINGO (MF), BERLINGO Box (M_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2)	OPEL	ASTRA G Box (F70), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_)	LAND ROVER	FREELANDER (LN)
HONDA	PRELUDE III (BA)	RENAULT	9 (L42_), 11 (B/C37_), 11 Box (S37_), SUPER 5 (B/C40_), SUPER 5 Box (S40_)	MAZDA	121 III (JASM, JBSM)
MITSUBISHI	COLT IV (CA_A), LANCER V (CB/D_A)	SUBARU	IMPREZA Coupe (GFC), IMPREZA Estate (GD, GG), IMPREZA Estate (GF), IMPREZA Saloon (GC), IMPREZA Saloon (GD, GG), LEGACY I (BC), LEGACY I Estate (BJF), LEGACY II (BD, BG), LEGACY II Estate (BD, BG), LEGACY III (BE, BH), LEGACY III Estate (BE, BH), OUTBACK (BE, BH)	PORSCHE	928
OPEL	ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), SIGNUM, SPEEDSTER, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA, ZAFIRA (F75_)	VAUXHALL	ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRAMAN Mk IV	RENAULT	9 (L42_), 11 (B/C37_), 11 Box (S37_), RAPID Box (F40_, G40_), SUPER 5 (B/C40_), SUPER 5 Box (S40_)
PEUGEOT	306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), PARTNER Box (5), PARTNER Combispace (5F)	VOLVO	340-360 (343, 345), 340-360 Saloon (344)	ROVER	MONTEGO, MONTEGO Estate (XE)
RENAULT	CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_)	HONDA	LOGO (GA3)	TOYOTA	4 RUNNER (N130), AVENSIS (T25), AVENSIS Estate (T25), AVENSIS Saloon (T25), AVENSIS VERSO (AC_), COROLLA (E9_), COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E9_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA Estate (E12_), COROLLA Estate (E12T_), COROLLA FX Compact (E8B), COROLLA Liftback (E9_), COROLLA Liftback (E10_), COROLLA Liftback (E11_), COROLLA Saloon (E12T_, E12T_), COROLLA Verso (E12L), COROLLA Verso (ZER_, ZZE_), COROLLA Wagon (E11_), COROLLA Wagon (E10_), PREVIA (ACR3_), RAV 4 II (XA2)
SUBARU	FORESTER (SF), FORESTER (SG), IMPREZA Coupe (GFC), IMPREZA Estate (GD, GG), IMPREZA Estate (GF), IMPREZA Saloon (GC), IMPREZA Saloon (GD, GG), LEGACY I (BC), LEGACY I Estate (BJF), LEGACY II (BD, BG), LEGACY II Estate (BD, BG), LEGACY III (BE, BH), LEGACY III Estate (BE, BH), OUTBACK (BE, BH), SVX (CX)	LEXUS	IS (GXE10), IS SportCross	VOLVO	340-360 (343, 345), 340-360 Saloon (344), C30, C70 Convertible, S40 II (MS), V50 (MW)
TOYOTA	COROLLA (E9_), COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E9_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA Liftback (E9_), COROLLA Liftback (E10_), COROLLA Liftback (E11_), COROLLA Station Wagon (E9_), COROLLA Wagon (E10_)	RENAULT	SAFRANE I (B54_)	MVB890R6	AUDI 80 (8C, B4), 80 Avant (8C, B4), A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4)
VAUXHALL	ASTRA MK IV Convertible, ASTRA MK IV Coupe, ASTRA MK IV Estate, ASTRA MK IV Hatchback, SIGNUM, VECTRA, VECTRA Estate, VECTRA Hatchback, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, VX220, ZAFIRA, ZAFIRA Mk II	MVB887R3	HONDA LOGO (GA3)	CHRYSLER	NEON II
MVB880R7	RENAULT CLIO III (BR0/1, CR0/1), MODUS (F/JPO_)	MVB887R4	AUDI 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4), COUPE (89, 8B)	CITROËN	JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_)
MVB884R6	CHEVROLET AVEO Saloon, LOVA	AUSTIN	MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE)	DACIA	SOLENZA
CHRYSLER	PT CRUISER (PT_)	BMW	3 (E36), 3 Compact (E36), 3 Convertible (E36), 3 Coupe (E36), 3 Touring (E36), 5 (E34), 5 Touring (E34), Z3	FIAT	DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), SCUDO Box (220L), SCUDO Combinato (220P)
NISSAN	BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11), MAXIMA QX (A32), MICRA (K11), PRAIRIE PRO (M11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13)	CHRYSLER	NEON (PL), SEBRING Coupe	MINI	MINI MAXIMA QX (A32), MAXIMA QX (A33), MAXIMA Station Wagon
RENAULT	9 (L42_), 11 (B/C37_), 11 Box (S37_)	DODGE	NEON	NISSAN	ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA G Estate (F35_), CORSA B (73_, 78_, 79_, F35_), TIGRA (95_)
		FIAT	TIPO (160)	OPEL	ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA G Estate (F35_), CORSA B (73_, 78_, 79_, F35_), TIGRA (95_)
		HYUNDAI	ELANTRA (XD), ELANTRA Saloon (XD), i30, i30 CW Estate, TRAJET (FO), TUCSON (JM)	PEUGEOT	BOXER Box (230L), BOXER Bus (230P), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223)
		KIA	CARENS II (FJ), CEE'D Estate, CEE'D Hatchback, CERATO, CERATO Saloon, PRO CEE'D, SEPHIA (FA), SEPHIA Saloon (FA), SHUMA (FB), SHUMA Saloon (FB), SPORTAGE (JE_)	RENAULT	CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO,
		MAZDA	323 C IV (BG), 323 C V (BA), 323 F IV (BG), 323 F V (BA), 323 F VI (BI), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), 323 P V (BA), 323 S IV (BG), 323 S V (BA), 323 S VI (BI), MX-3 (EC), XEDOS 6 (CA)		
		MG	MAESTRO, MONTEGO		
		MITSUBISHI	GALANT VI (EA_), GALANT VI Estate (EA_)		
		ROVER	MONTEGO, MONTEGO Estate (XE)		
		SUZUKI	GRAND VITARA		
		MVB887R5	AUSTIN MONTEGO Estate (XE)		
		BMW	3 (E36), 3 Convertible (E36), 3 Coupe (E36), 5 (E34), 5 (E39), 5 Touring (E34), 7 (E38)		






NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits

  <p>SEAT KANGOO (KC0/1_), KANGOO Express (FC0/1_), RAPID Box (F40_, G40_), THALIA (LB0/1/2_) ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L) VAUXHALL ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CORSA, TIGRA VW CADDY II Box (9K9A), CADDY II Estate (9K9B), CORRADO (53I), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV Cabriolet (1E7), GOLF V (1K1), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO CLASSIC (6KV2), POLO Variant (6KV5), VENTO (1H2)</p>	  <p>FIAT 3 Coupe (E36), 3 Touring (E36), 5 (E34), 5 (E39), 5 Touring (E34), 5 Touring (E39), 7 (E38), Z3, Z3 Coupe CROMA (154), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) HYUNDAI XG KIA OPIRUS LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836) MITSUBISHI COLT VI RENAULT CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), TWINGO (C06_), TWINGO Box (S06_) TOYOTA COROLLA (_E10_), COROLLA Compact (_E10_), COROLLA Coupe (AE86), COROLLA Wagon (_E10_)</p>	  <p>MVB915R5 ALFA ROMEO 145 (930), 146 (930), 155 (167) BMW 7 (E65, E66) FIAT TEMPRA (159), TEMPRA S.W. (159), TIPO (160) LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836) MITSUBISHI COLT VI SMART FORFOUR TOYOTA CELICA (ST16_), CELICA Hatchback (T16), COROLLA (_E9_), COROLLA (_E10_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA FX Compact (E8B), COROLLA Liftback (_E9_), COROLLA Liftback (_E10_), COROLLA Station Wagon (_E9_), COROLLA Wagon (_E10_)</p>
<p>MVB900R4 CHRYSLER SEBRING (JR), SEBRING Convertible (JR), STRATUS (JA), STRATUS Convertible (JX), VOYAGER II (GS), VOYAGER III (RG) DODGE STRATUS HONDA CR-V I (RD) HYUNDAI ACCENT (LC), ACCENT (X-3), ACCENT Saloon (LC), ACCENT Saloon (X-3), GETZ (TB), LANTRA II (J-2), LANTRA II Wagon (J2), S COUPE (SLC) KIA SEPHIA (FA), SEPHIA Saloon (FA), SHUMA Saloon (FB) LEXUS IS (GXE10), IS SportCross NISSAN PRAIRIE PRO (M11) PEUGEOT EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223) SUBARU FORESTER (SF), FORESTER (SG), IMPREZA Coupe (GFC), IMPREZA Estate (GF), IMPREZA Saloon (GC), IMPREZA Saloon (GD, GG) SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), JIMNY (FJ)</p>	<p>MVB906R6 AUDI A3 (8L1) MINI MINI, MINI CLUBMAN PEUGEOT 207 (WA_, WC_), 207 CC (WD_), 207 SW (WK_), 308 (4A_, 4C_), 308 SW SEAT CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), INCA (6K9), LEON (1M1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5) VW BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5)</p>	<p>MVB915R6 CITROËN JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230) FIAT DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230) FORD ESCORT '86 Express (AVF), ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GFJ), ORION II (AFF), ORION III (GAL) HONDA ACCORD VII (CG), PRELUDE IV (BB) PEUGEOT BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_) TOYOTA AURIS, YARIS</p>
<p>MVB900R5 ARO SPARTANA MITSUBISHI LANCER Estate (CS_W), LANCER Saloon (CS_A) RENAULT TWINGO (C06_), TWINGO Box (S06_)</p>	<p>MVB915R3 FIAT BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185), PALIO (178BX), PALIO Weekend (178DX), PUNTO (176), PUNTO Convertible (176C), PUNTO Van (176L), SIENA (178_), STRADA (178E), TIPO (160) LANCIA Y (840A) NISSAN MICRA (K10) ZASTAVA YUGO FLORIDA</p>	<p>MVB920R4 FORD USA PROBE II (ECP) HONDA CIVIC V Aerodeck (MC), CIVIC V Fastback (MB), INTEGRA (DC2) KIA SHUMA (FB), SHUMA II (FB), SPORTAGE (K00) MAZDA 323 FV (BA), 323 FV (BI), 323 S VI (BJ), 626 IV (GE), 626 IV Hatchback (GE), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), MX-3 (EC), MX-6 (GE6), PREMACY (CP), XEDOS 6 (CA), XEDOS 9 (TA) MITSUBISHI 3000 GT (Z16A), ECLIPSE I (D2_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), SIGMA (F16A) NISSAN 300 ZX (Z32), BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11), KUBISTAR (X76), SUNNY III Hatchback (N14) ROVER 200 (XH) SUZUKI SWIFT II Hatchback (EA, MA), VITARA (ET, TA), VITARA Cabrio (ET, TA) TOYOTA COROLLA (_E10_), COROLLA Compact (_E10_), STARLET (EP91), SUPRA (MA70), YARIS (_CP10), YARIS VERSO (NC/LP2_)</p>
<p>MVB900R6 AUDI A3 (8P1), A3 Sportback (8PA) RENAULT CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), RAPID Box (F40_, G40_) SEAT ALTEA (5P1), ALTEA XL (5P5), LEON (1P1), TOLEDO III (5P2) SKODA OCTAVIA (1Z3), OCTAVIA Combi (1Z5) VW CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), EOS, GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, TOURAN (1T1, 1T2)</p>	<p>MVB915R4 CHEVROLET MATIZ DAEWOO MATIZ (KLYA) FIAT ELBA (146_), FIORINO Box (146 Uno), FIORINO Pick up (146), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) HONDA ACCORD III (CA4, CA5), ACCORD III Aerodeck (CA5), LEGEND I (HS, KA), LEGEND I Coupe (KA3) HYUNDAI LANTRA I (J-1) LANCIA DEDRA (835) NISSAN 100 NX (B13), ALMERA I (N15), ALMERA I Hatchback (N15), KUBISTAR (X76), PRIMERA (P10), PRIMERA Hatchback (P10), PRIMERA Traveller (W10), SERENA (C23M), SUNNY Box (Y10), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10), VANETTE CARGO Box (HC 23), VANETTE CARGO Bus (HC 23) ROVER 800 (XS), 800 Coupe, 800 Hatchback (XS) SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG)</p>	<p>MVB906R5 ALFA ROMEO 145 (930), 146 (930), 155 (167) BMW 3 (E36), 3 Compact (E36), 3 Convertible (E36),</p>
<p>MVB905R4 CHRYSLER VOYAGER II (GS), VOYAGER III (RG) CITROËN JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_) FIAT PALIO Weekend (178DX), SCUDDO Box (220L), SCUDDO Combinato (220P), STRADA (178E), UNO (146A/E) FORD USA PROBE I MAZDA XEDOS 9 (TA) NISSAN KUBISTAR (X76) RENAULT CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), THALIA (LB0/1/2_), TWINGO (C06_), TWINGO Box (S06_)</p>	<p>TOYOTA 4 RUNNER (_N130) ZASTAVA YUGO FLORIDA</p>	

						
MVB920R7 TOYOTA	CELICA SUPRA (MA61), CROWN Saloon (S1)	FIAT	BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), MAREA (185), MAREA Weekend (185), MULTIPLA (186), PALIO (178BX), PALIO Weekend (178DX), PUNTO (176), PUNTO Convertible (176C), PUNTO Van (176L), SIENA (178), STILO (192), STILO Multi Wagon (192), TEMPRA (159), TEMPRA S.W. (159), TIPO (160)	NISSAN	LANCER III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A), SIGMA Station Wagon (F07W), SPACE GEAR (PA/B/D_V/W), SPACE WAGON (D0_V/W), SPACE WAGON (N3_W, N4_W)	
MVB925R4 FIAT KIA MAZDA MITSUBISHI RENAULT SAAB SUZUKI TOYOTA	TEMPRA (159), TEMPRA S.W. (159), TIPO (160) CARENS I (FC), CARENS II (FJ), PRIDE (DA), PRIDE Estate, RETONA (CE), SHUMA II (FB), SHUMA II Saloon (FB) E 2000, 2200 Box (SR2), MPV II (LW) L 200 (K_T), SPACE WAGON (N3_W, N4_W) CLIO II (BB0/1/2_, CB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), THALIA (LB0/1/2_), TWINGO (C06_), TWINGO Box (S06_) 9-7X GRAND VITARA (FT, GT), VITARA (ET, TA), VITARA Cabrio (ET, TA) HILUX Pickup (N_), STARLET (P8_)	HONDA LANCIA MITSUBISHI	ACCORD III (CA4, CA5), ACCORD III Aerodeck (CA5), LEGEND II (KA7), LEGEND II Coupe (KA8), LEGEND III (KA9) DEDRA (835), DEDRA SW (835), DELTA II (836), LYBRA (839AX), LYBRA SW (839BX) GALANT VI (EA_), GALANT VI Estate (EA_), SPACE RUNNER (N50), SPACE WAGON (N5_W)	SUZUKI TOYOTA	BLUEBIRD (T72, T12), BLUEBIRD Hatchback (T72, T12), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13) LIANA (ER), LIANA Estate (ER), VITARA (ET, TA), VITARA Cabrio (ET, TA), X-90 (EL) HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_), HILUX Pickup (N_), PASEO Convertible (EL54), PASEO Coupe (EL54)	
MVB925R5 CITROËN FIAT LANCIA MITSUBISHI RENAULT VW	C25 Bus (280_, 290_), C25 Flatbed / Chassis (280_, 290_) DUCATO Box (230L), DUCATO Box (280), DUCATO Box (290), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), DUCATO Flatbed / Chassis (280), DUCATO Flatbed / Chassis (290), DUCATO Panorama (280), DUCATO Panorama (290), TALENTO Box (290), TALENTO Bus (290), TALENTO Flatbed / Chassis (290), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) DEDRA (835), DELTA II (836) GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A, E8_A), SPACE RUNNER (N1_W, N2_W) SAFRANE I (B54_) JETTA III (1K2)	NISSAN OPEL TOYOTA VAUXHALL VW	ASTRA G Box (F70), ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F08), MERIVA, SIGNUM, TIGRA TwinTop, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA, ZAFIRA (F75_) YARIS (CP10), YARIS VERSO (NC/LP2_) ASTRA Mk III Convertible, ASTRA Mk IV, ASTRA Mk IV Convertible, ASTRA Mk IV Coupe, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRA Mk V Estate, ASTRA Mk V Hatchback, ASTRA Mk V Sport Hatch, ASTRAMAN Mk IV, COMBO, CORSA Mk II, MERIVA, SIGNUM, TIGRA TwinTop, VECTRA Estate, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7)	FIAT HONDA PEUGEOT SEAT SKODA VW	LANCIA III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A), JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (230), JUMPER Flatbed / Chassis (244) DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230), DUCATO Flatbed / Chassis (244) PRELUDE V (BB) BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), BOXER Flatbed / Chassis (ZCT_) ALTEA (5P1), ALTEA XL (5P5), LEON (1P1), TOLEDO III (5P2) OCTAVIA (1Z3), OCTAVIA Combi (1Z5) CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, TOURAN (1T1, 1T2)	
MVB925R6 CITROËN FIAT FORD MAZDA PEUGEOT SEAT SKODA VW	JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_) BRAVA (182), BRAVO (182), SCUDDO Box (220L), SCUDDO Combinato (220P) GALAXY (WGR) RX 7 III (FD) EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223) ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA (6L2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), INCA (6K9), TOLEDO I (1L) FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3) CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD), VENTO (1H2)	FIAT HONDA TOYOTA MVB940R3 CITROËN FIAT PEUGEOT MVB940R4 FIAT HYUNDAI KIA MITSUBISHI	PUNTO (176), PUNTO Van (176L) ACCORD IV Coupe (CC1), ACCORD V Aerodeck (CE), ACCORD V Coupe (CD7, CD9), ACCORD VII Coupe (CG), SHUTTLE (RA) CAMRY (LV1_), CAMRY (LV2_), CAMRY Station Wagon (LV2_), CAMRY Station Wagon (LV10) JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), XM (Y4), XM Break (Y4) PUNTO (176) 605 (6B), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_) ELBA (146_), FIORINO Box (146 Uno), FIORINO Pick up (146), PALIO Weekend (178DX), TEMPRA (159), TEMPRA S.W. (159) H-1 Box, H-1 Bus (KMF), LANTRA I (J-1), SONATA III (EF), SONATA IV (EU4), TERRACAN (HP) CLARUS (K9A), CLARUS Estate (GC), MAGENTIS (GD), SORENTO (JC) COLT II (C1_A), ECLIPSE II (D3_), GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), GALANT VI (EA_), GALANT VI Estate (EA_), L 400 Box (PA0V),	SEAT SKODA VW HYUNDAI MAZDA MITSUBISHI NISSAN PEUGEOT SKODA SUBARU SUZUKI	MVB950R4 CHEVROLET CITROËN DAEWOO FIAT HONDA HYUNDAI MAZDA MITSUBISHI NISSAN PEUGEOT SKODA SUBARU SUZUKI	AVEO Saloon, KALOS JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), XM (Y4), XM Break (Y4) KALOS (KLAS) PUNTO (176), PUNTO Van (176L) ACCORD II (AC, AD), ACCORD II Hatchback (AC, AD), ACCORD III Aerodeck (CA5), LEGEND II (KA7), LEGEND II Coupe (KA8), LEGEND III (KA9) H-1 Bus (KMF), HIGHWAY VAN, S COUPE (SLC), SANTA FE (SM), SONATA III (EF), SONATA IV (EU4), TRAJET (FO) FESTIVA, MX-5 II (NB) GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), GALANT VI (EA_), GALANT VI Estate (EA_) 350 Z (Z33), 350 Z Roadster, PATHFINDER (R50) 605 (6B), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_) FAVORIT (781), FAVORIT Forman (785), FAVORIT Pickup (787), FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA II (6U1) 1800 XT COUPE (XT), JUSTY II (JMA, MS), LEONE II, LEONE II Estate GRAND VITARA (FT, GT), JIMNY (FJ), SWIFT Convertible (SF413), SWIFT II (AH, AJ), SWIFT II Hatchback (EA, MA), VITARA (ET, TA), VITARA Cabrio (ET, TA), X-90 (EL)
MVB935R7 MINI	MINI					
MVB938R5 ALFA ROMEO DODGE	145 (930), 146 (930), 155 (167), SPIDER (115) STRATUS					














					
FORD MITSUBISHI	ESCORT VI (GAL), ESCORT VII (GAL, AAL, ABL) GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), L 200 (K_T), L 300 Box (PO_W, P1_W), L 300 Bus (PO_W, P1_W, P2_W), L 300 Flatbed / Chassis (P1_T), L 400 Box (PAOV), SPACE GEAR (PA/B/D_V/W), SPACE WAGON (N3_W, N4_W)	FIAT LAND ROVER MAZDA PORSCHE TOYOTA	LANOS Saloon (KLAT), NEXIA (KLETN), NEXIA Saloon (KLETN) TIPO (160) RANGE ROVER III (LM) XEDOS 9 (TA) 924, 944 CAMRY (V1_), CAMRY (V2_), CAMRY Liftback (V1), CAMRY Saloon (V1), CAMRY Station Wagon (V2_), CAMRY Station Wagon (V10), CARINA II (T15_), CARINA II (T17_), CARINA II Saloon (T15_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), PICNIC (XM10), RAV 4 I (SXA1), RAV 4 I Cabrio (SXA1_)	SUNNY II Hatchback (N13), SUNNY II Traveller (B12) SUZUKI LIANA (ER), LIANA Estate (ER)	
PEUGEOT SUBARU	205 Box, 205 I (741A/C), 205 II (20A/C) 1800 XT COUPE (XT), LEONE II, LEONE II Estate				
MVB985R5					
ALFA ROMEO FIAT	145 (930), 146 (930), 155 (167), 164 (164) CROMA (154), PUNTO (176), TEMPRA (159), TEMPRA S.W. (159), TIPO (160)	MVB1000R6			
LANCIA OPEL	DEDRA (835), DEDRA SW (835), DELTA II (836) ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), COMBO (71_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)	AUDI CITROËN	A2 (820) C4 (LC_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C8 (EA_, EB_), JUMPER Box (244), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (244), JUMPY, JUMPY (U6U), JUMPY Box		
VAUXHALL	ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CAVALIER Mk II, CAVALIER Mk III (87), CAVALIER Mk III Hatchback	FIAT	DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230), DUCATO Flatbed / Chassis (244)	FORD USA MAZDA	PROBE I, PROBE II (ECP) 323 FV (BA), 626 II (GC), 626 II Hatchback (GC), 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV), 626 IV Hatchback (GE), MX-3 (EC), MX-6 (GE6), XEDOS 6 (CA), XEDOS 9 (TA)
MVB986R6		FORD	ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ORION III (GAL)	OPEL	KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_)
FIAT	BRAVA (182), BRAVO (182), PALIO Weekend (178DX), PUNTO (176), PUNTO Van (176L), STRADA (178E)	HONDA	CIVIC VI, CIVIC VI Hatchback (EU_, EP_), CIVIC VII Hatchback (FD_)	PEUGEOT	405 I (15B)
HONDA	CIVIC VI Coupe (EM), FR-V, STREAM (RN)	MERCEDES-BENZ	T1 Box (601), T1 Box (602), T1 Bus (601), T1 Bus (602), T1 Flatbed / Chassis (601), T1 Flatbed / Chassis (602)	TOYOTA	CAMRY (V2_), CAMRY Station Wagon (V2_), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), CELICA (ST16_), CELICA Convertible (T16_), CELICA Convertible (T18_), CELICA Coupe (T18_), CELICA Coupe (T16F), CELICA Hatchback (T16)
MVB995R4		PEUGEOT	307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U), 807 (E), BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), BOXER Flatbed / Chassis (ZCT_), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Tepee (VF3V_)	VAUXHALL	ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback
HYUNDAI	LANTRA I (J-), SANTAMO, SONATA II (Y-3)	PORSCHE	924, 944, 944 Convertible, 968, 968 Convertible	MVB1015R6	
JAGUAR	XJ (X300), XJ (X) 40, 81, XJS Coupe, XJSC Convertible	SEAT	CORDOBA (6L2), IBIZA IV (6L1)	CHRYSLER	VOYAGER II (GS)
KIA	JOICE	SKODA	FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), PRAKTIK, ROOMSTER (5)	CITROËN	JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230)
MAZDA	323 C V (BA), 323 F V (BA), 323 III (BF), 323 III Hatchback (BF), 323 P V (BA), 323 S V (BA) COLT III (C5_A), ECLIPSE I (D2_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), PAJERO II (V2_W, V4_W), SANTAMO	VW	FOX (5Z1), LUPO (6X1, 6E1), POLO (6N2), POLO (9N_), POLO Saloon	FORD	ESCORT '95 Box (AVL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL)
MITSUBISHI	SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12)	MVB1015R4		MERCEDES-BENZ	190 (W201), T1 Box (601), T1 Box (602), T1 Bus (601), T1 Bus (602), T1 Flatbed / Chassis (601), T1 Flatbed / Chassis (602)
NISSAN	SUNNY II Traveller (B11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12)	DAIHATSU	TERIOS (J1)	PEUGEOT	206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_)
RENAULT	CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_)	FORD	SCORPIO II (GFR, GGR), SCORPIO II Estate (GMR, GGR)	RENAULT	CLIO I (B/C57_, 5/357_), ESPACE III (JEO_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SAFRANE II (B54_)
SUZUKI	GRAND VITARA	HONDA	CIVIC VI Coupe (EM)	MVB1020R4	
MVB1000R3		KIA	SEPHIA (FA), SEPHIA Saloon (FA), SHUMA Saloon (FB)	CITROËN	AX (ZA_)
FIAT	PUNTO (176), PUNTO Convertible (176C)	MAZDA	323 C IV (BG), 323 F IV (BG), 323 F V (BA), 323 F VI (BJ), 323 P V (BA), 323 S IV (BG), 323 S V (BA), 323 S VI (BJ), MX-3 (EC), XEDOS 6 (CA)	HONDA	ACCORD VII (CG), CRX III (EH, EG), PRELUDE IV (BB), PRELUDE V (BB)
MVB1000R4		MITSUBISHI	PAJERO II (V2_W, V4_W)	JAGUAR	XJ (X300)
MAZDA	323 C IV (BG), 323 CV (BA), 323 F IV (BG), 323 F V (BA), 323 F VI (BJ), 323 P V (BA), 323 S IV (BG), 323 S V (BA), 323 S VI (BJ), MX-3 (EC), XEDOS 6 (CA)	NISSAN	SUNNY II Traveller (B12)	PEUGEOT	205 II (20A/C)
NISSAN	SUNNY II Traveller (B12)	SUZUKI	BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG)	SUZUKI	GRAND VITARA (FT, GT), VITARA (ET, TA)
MVB1000R5					
ALFA ROMEO	GTV (916C_), SPIDER (916S_)				
BMW	5 (E39), 5 Touring (E39), 7 (E38), 8 (E31)				
DAEWOO	ESPERO (KLEJ), LANOS (KLAT),				



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits




					
MVB1025R3 FORD	ESCORT V Estate (GAL, AVL), P 100 II, SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)	TOYOTA	COROLLA Coupe (AE86)		GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV (1J1), GOLF IV Cabriolet (1E7), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), PASSAT (3A2, 35I), PASSAT (3C2), PASSAT Variant (3A5, 35I), PASSAT Variant (3C5), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), TOURAN (1T1, 1T2), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD), VENTO (1H2)
MVB1025R4 HONDA NISSAN PEUGEOT	FR-V, STREAM (RN) 300 ZX (Z31) 605 (6B)	CITROËN	BERLINGO (MF), BERLINGO Box (M_), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0) BRAVA (182), BRAVO (182), MAREA (185), MAREA Weekend (185), MULTIPLA (186)		
MVB1025R6 ALFA ROMEO FIAT NISSAN PEUGEOT RENAULT	147 (937), 156 (932), 156 Sportwagon (932), GT BARCHETTA (183) ALMERA TINO (V10), PRIMERA (P11), PRIMERA Hatchback (P11), PRIMERA Traveller (WP11) 206 Hatchback (2A/C) SAFRANE I (B54_)	LANCIA	KAPPA (838A), KAPPA SW (838B), LYBRA (839AX), LYBRA SW (839BX)		
MVB1030R5 BMW CITROËN FIAT FORD	X5 (E53) AX (Z2-), SAXO (S0, S1) CROMA (154), CROMA (194) ESCORT '95 Box (AVL), ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL)	LEXUS MINI NISSAN	RX (MCU_), RX (XU1) MINI, MINI Convertible 100 NX (B13), ALMERA I Hatchback (N15), PRIMERA (P10), PRIMERA Hatchback (P10), PRIMERA Traveller (W10), SUNNY III Hatchback (N14), SUNNY III Liftback (N14)		
FORD USA MAZDA	PROBE II (ECP) 323 F VI (B1), 323 S VI (B1), 626 IV (GE), 626 IV Hatchback (GE), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), MX-6 (GE6), PREMACY (CP)	SEAT	ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA (6L2), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1)		
OPEL	ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), GT Convertible, SIGNUM, SPEEDSTER, VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_), VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA, ZAFIRA (F75_)	SKODA	FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3)		
PEUGEOT SAAB TOYOTA	106 I (1A, 1C), 106 II (1) 9-3 (YS3F), 9-3 Convertible (YS3F), 9-3 Estate AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_), CARINA E (_T19_), CARINA E Saloon (_T19_), CARINA E Sportswagon (_T19_), CELICA (_T20_), CELICA Convertible (_T20_)	TOYOTA VW	CAMRY (_V20), CAMRY (_V30) GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO (9N_), SHARAN (7M8, 7M9, 7M6), VENTO (1H2)		
VAUXHALL	ASTRA MK IV Convertible, ASTRA Mk IV Coupe, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, SIGNUM, VECTRA, VECTRA Estate, VECTRA Hatchback, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, VX220, ZAFIRA, ZAFIRA Mk II	MVB1035R7 BMW NISSAN RENAULT	MICRA (E38), MICRA C+C (E31) CLIO III (BR0/1, CR0/1), MODUS (F/JP0_), TWINGO (CNO_)		
MVB1035R3 RENAULT	CLIO I (B/C57_, 5/357_), CLIO II (B80/1/2_, CB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_)	MVB1040R4 CHRYSLER MAZDA NISSAN	LE BARON, LE BARON Convertible, VOYAGER I (ES) 323 III Station Wagon (BW) 300 ZX (Z32), MAXIMA (J30)		
MVB1035R5 ALFA ROMEO FIAT LANCIA	155 (167) COUPE (FA/175), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) DEDRA (835), DEDRA SW (835), DELTA II (836)	MVB1045R6 ALFA ROMEO AUDI CHRYSLER FIAT FORD HONDA LANCIA MAZDA PEUGEOT	145 (930), 146 (930), 147 (937), 155 (167), 156 (932), 156 Sportwagon (932), GTV (916C_), SPIDER (916S_) A3 (8P1), A3 Sportback (8PA) VOYAGER II (GS) BARCHETTA (183), BRAVA (182), BRAVO (182), COUPE (FA/175), MAREA (185), MAREA Weekend (185), SCUDO Box (220L), STRADA (178E) GALAXY (WGR) ACCORD VII (CG), PRELUDE IV (BB), PRELUDE V (BB) Y (840A) RX 7 III (FD) 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), EXPERT Box (222), EXPERT Flatbed / Chassis, EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combi (5F) ALHAMBRA (7V8, 7V9), ALTEA (5P1), ALTEA XL (5P5), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), LEON (1P1), TOLEDO III (5P2) OCTAVIA (1Z3), OCTAVIA Combi (1Z5) CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2K1), EOS, GOLF III (1H1),		
		MVB1050R4 FIAT HONDA HYUNDAI IVECO KIA LANCIA MITSUBISHI RENAULT TOYOTA	TEMPRA (159), TEMPRA S.W. (159), TIPO (160) ACCORD IV (CB3, CB7), ACCORD IV Aerodeck (CB8, CC), PRELUDE V (BB) H-1 Box, H-1 Bus (KMF), PORTER Box, PORTER Pickup, STAREX (H1) Daily II CARENS I (FC), CARENS II (FI), K2500 (SD), PREGIO Box (TB), SHUMA (FB), SHUMA II (FB), SHUMA II Saloon (FB), SHUMA Saloon (FB), SORENTO (JC) DEDRA (835) L 200 (K_), L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W), L 300 Flatbed / Chassis (P1_T), L 400 Box (PAOV), SPACE GEAR (PA/B/D_V/W) SAFRANE I (B54_) 4 RUNNER (_N130), LAND CRUISER 90 (_J9_)		
		MVB1050R5 ALFA ROMEO CITROËN FIAT FORD HONDA LANCIA MAZDA PEUGEOT TOYOTA	155 (167) SAXO (S0, S1) COUPE (FA/175), DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) PRELUDE III (BA) DEDRA (835), DEDRA SW (835), DELTA II (836) 626 II (GC), 626 II Hatchback (GC), 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD) 106 II (1) COROLLA (_E9_), COROLLA (_E10_), COROLLA (_E11_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA Compact (_E11_), COROLLA FX Compact (E8B), COROLLA Liftback (_E9_), COROLLA Liftback (_E11_), COROLLA Wagon (_E11_)		
		MVB1050R6 AUDI CITROËN FIAT FORD IVECO LEXUS MINI OPEL PEUGEOT	A3 (8P1), A3 Sportback (8PA), TT (8J3), TT Roadster (8J9) C2 (JM_), C3 (FC_), C3 Pluriel (HB_), C4 (LC_), C4 Coupe (LA) DOBLO (119), DOBLO Cargo (223) GALAXY (WGR) Daily II ES (F1, F2) MINI, MINI Convertible ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA 207 (WA_, WC_), 207 SW (WK_), 307 (3A/C),		







  <p>SEAT 307 Break (3E), 307 CC (3B), 307 SW (3H), 1007 (KM_) ALHAMBRA (7V8, 7V9), ALTEA (5P1), ALTEA XL (5P5), LEON (1P1), TOLEDO III (5P2) SKODA OCTAVIA (1Z3), OCTAVIA Combi (1Z5) SUZUKI SX4 TOYOTA CAMRY (_V1_), CAMRY (_V2_), CAMRY Station Wagon (_V2_), CAMRY Station Wagon (_V10) VAUXHALL ASTRA MK V Estate, ASTRA MKV Hatchback, ASTRA MK V Sport Hatch, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II VW CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2K), EOS, GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), PASSAT (3C2), PASSAT Variant (3C5), SHARAN (7M8, 7M9, 7M6), TOURAN (1T1, 1T2)</p>	  <p>SKODA CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), INCA (6K9) FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5) VW CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY II Pickup (9U7), GOLF III (1H1), GOLF III Variant (1H5), LUPO (6X1, 6E1), POLO (6N1), POLO (6N2), POLO (9N_), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD), VENTO (1H2)</p>	  <p>LANCIA DELTA II (836), LYBRA (839AX), LYBRA SW (839BX), ZETA (220) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 405 II (4B), 405 II Break (4E), 406 (8B), 406 Break (8E/F), 605 (6B), 806 (221), EXPERT (224), EXPERT Box (222), PARTNER Combi (5F) SEAT CORDOBA (6L2), CORDOBA Hatchback (6K2), IBIZA IV (6L1), IBIZA V (6I5), IBIZA V SPORTCOUPE (6I1), LEON (1M1), LEON (1P1), TOLEDO II (1M2) SKODA FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Saloon (6Y3), FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5), OCTAVIA (1U2), OCTAVIA Combi (1U5), PRAKTIK, ROOMSTER (5I) VW BORA (1J2), BORA Estate (1I6), CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY II Pickup (9U7), FOX (5Z1), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), POLO (9N_), POLO Saloon</p>
<p>MBV1060R5 FIAT CROMA (154) FORD USA PROBE I MAZDA 626 II (GC), 626 II Hatchback (GC), 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV) MITSUBISHI CARISMA Saloon (DA_), COLT V (C_A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), LANCER Estate (CS_W), LANCER Saloon (CS_A), SPACE STAR (DGO) TOYOTA COROLLA (_E9_), COROLLA Compact (_E9_), COROLLA FX Compact (E8B), COROLLA Liftback (_E9_) VW JETTA III (1K2)</p>	<p>MBV1070R4 HONDA ACCORD IV (CB3, CB7), ACCORD IV Aerodeck (CB8, CC), ACCORD V (CC7), ACCORD VI (CE, CF) JAGUAR XJ (X300), XJ (XJ 40, 81), XJS Coupe, XJS Convertible LEXUS IS (GXE10), IS SportCross RENAULT CLIO I (B/C57_, 5/357_), CLIO I Box (S57_) ROVER 600 (RH) TOYOTA 4 RUNNER (_N130), LAND CRUISER 90 (_J9_)</p>	<p>MBV1083R7 ALFA ROMEO 145 (930), 146 (930), 155 (167), 156 (932), GTV (916C_), SPIDER (916S_) FIAT DUCATO Box, DUCATO Box (244), DUCATO Bus, DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis, DUCATO Flatbed / Chassis (244) LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836)</p>
<p>MBV1065R4 HONDA ACCORD V Aerodeck (CE), ACCORD V Coupe (CD7, CD9), ACCORD VII (CG), ACCORD VII Coupe (CG), ACCORD VII Hatchback (CH), SHUTTLE (RA) MITSUBISHI PAJERO II (V2_W, V4_W) NISSAN MICRA (K12) RENAULT SAFRANE I (B54_)</p>	<p>MBV1073R5 ALFA ROMEO 159, 159 Sportwagon, BRERA, SPIDER HONDA PRELUDE IV (BB) KIA CLARUS (K9A), CLARUS Estate (GC) MITSUBISHI COLT V (C_A), GALANT VI (EA_), GALANT VI Estate (EA_), LANCER VI (CK/P_A), MIRAGE Coupe, MIRAGE Hatchback CITYROVER ROVER CITYROVER TOYOTA COROLLA (_E9_), COROLLA (_E10_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA FX Compact (E8B), COROLLA Liftback (_E9_), COROLLA Liftback (_E10_), COROLLA Station Wagon (_E9_), COROLLA Wagon (_E10_) VW TIGUAN</p>	<p>MBV1088R6 AUDI A2 (8Z0), A3 (8P1), A3 Sportback (8PA) BMW 5 (E60), 5 Touring (E61), 6 (E63), 6 Convertible (E64) FIAT STRADA (178E) HONDA SHUTTLE (RA) SEAT CORDOBA (6L2), IBIZA IV (6L1) SKODA FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1Z3), OCTAVIA Combi (1Z5), ROOMSTER (5I) VW EOS, GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), LUPO (6X1, 6E1), PASSAT (3C2), PASSAT Variant (3C5), POLO (9N_), TOURAN (1T1, 1T2)</p>
<p>MBV1065R6 ALFA ROMEO 147 (937), 156 (932), 156 Sportwagon (932), GT, GTV (916C_), SPIDER (916S_) BMW 3 (E90), 3 Coupe (E92) CHRYSLER 300 M (LR) CITROËN C4 (LC_), C4 Coupe (LA_), EVASION (22, U6), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2) FIAT ULYSSE (220) LANCIA KAPPA (838A), KAPPA SW (838B), LYBRA (839AX), LYBRA SW (839BX), ZETA (220) MITSUBISHI GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), GALANT VI (EA_), GALANT VI Estate (EA_), SIGMA (F16A) NISSAN MURANO (Z50), PATHFINDER (R50) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 405 II (4B), 405 II Break (4E), 406 (8B), 406 Break (8E/F), 806 (221), EXPERT (224), EXPERT Box (222) SEAT AROSA (6H), CORDOBA (6K2/C2),</p>	<p>MBV1080R4 HYUNDAI TERRACAN (HP) KIA CARENS I (FC), SHUMA (FB), SHUMA II (FB), SORENTO (JC) MITSUBISHI L 400 Box (PAOV), L 400 Bus (PAOV), SPACE GEAR (PA/B/D_V/W) SUZUKI GRAND VITARA (FT, GT), VITARA (ET, TA) TATA (TELCO) SAFARI (42_FD) TOYOTA HILUX Pickup (_N_), PASEO Convertible (EL54), PASEO Coupe (EL54)</p>	<p>MBV1090R4 SUZUKI GRAND VITARA (FT, GT) TOYOTA STARLET (EP91)</p>
<p>MBV1090R5 FIAT DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230) LANCIA DEDRA (835) MITSUBISHI CARISMA (DA_), CARISMA Saloon (DA_), COLT V (C_A), COLT V (C_A), GALANT VI (EA_), GALANT VI Estate (EA_), PAJERO PININ (H6_W, H7_W), SPACE RUNNER (N50), SPACE STAR (DGO), SPACE WAGON (N5_W) PEUGEOT BOXER Box (230L), BOXER Bus (230P) PROTON IMPIAN TOYOTA COROLLA (_E10_), COROLLA Compact (_E10_), COROLLA Liftback (_E10_), COROLLA Wagon (_E10_), PICNIC (_XM10), RAV 4 I (SX1_), RAV 4 I Cabrio (SX1_) VOLVO S40 I (VS), V40 Estate (VW)</p>	<p>MBV1080R6 ALFA ROMEO 145 (930), 146 (930), 147 (937), 156 (932), 156 Sportwagon (932), GTV (916C_), SPIDER (916S_) AUDI A2 (8Z0), A4 (8E2, B6), A4 Avant (8E5, B6) 7 (E32), 8 (E31) BMW BERLINGO (MF), BERLINGO Box (M_) CITROËN EVASION (22, U6), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y4), XM Break (Y4), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2) FIAT ULYSSE (220) HONDA PRELUDE V (BB)</p>	<p>MBV1090R5 FIAT DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230) LANCIA DEDRA (835) MITSUBISHI CARISMA (DA_), CARISMA Saloon (DA_), COLT V (C_A), COLT V (C_A), GALANT VI (EA_), GALANT VI Estate (EA_), PAJERO PININ (H6_W, H7_W), SPACE RUNNER (N50), SPACE STAR (DGO), SPACE WAGON (N5_W) PEUGEOT BOXER Box (230L), BOXER Bus (230P) PROTON IMPIAN TOYOTA COROLLA (_E10_), COROLLA Compact (_E10_), COROLLA Liftback (_E10_), COROLLA Wagon (_E10_), PICNIC (_XM10), RAV 4 I (SX1_), RAV 4 I Cabrio (SX1_) VOLVO S40 I (VS), V40 Estate (VW)</p>



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







 	 	 
MVB1090R7 TOYOTA HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_), HILUX Pickup, HILUX Pickup (N_)	PEUGEOT 306 (7B, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 405 II (4B), 405 II Break (4E), BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (ZCT_)	TOYOTA MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), SCENIC (JA0/1_), THALIA (LBO/1/2_)
MVB1100R4 ALFA ROMEO 164 (164) FIAT CROMA (154) LANCIA THEMA (834), THEMA SW (834) NISSAN ALMERA I (N15), ALMERA I Hatchback (N15) TOYOTA 4 RUNNER (N130), CRESSIDA Saloon (X6_), HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_), PASEO Convertible (EL54), PASEO Coupe (EL54)	RENAULT CLIO I (B/C57_, 5/357_), ESPACE IV (JK0/1_), SUPER 5 (B/C40_), VEL SATIS (BJ0_) SEAT ALTEA (5P1), ALTEA XL (5P5), CORDOBA (6K2/C2), CORDOBA (6L2), IBIZA II (6K1), IBIZA IV (6L1) SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), OCTAVIA (1Z3), OCTAVIA Combi (1Z5)	AVENSIS (T22_), AVENSIS (T25), AVENSIS Estate (T25), AVENSIS Liftback (T22_), AVENSIS Saloon (T25), AVENSIS Station Wagon (T22_), CAMRY (V1_), CAMRY (V2_), CAMRY Liftback (V1), CAMRY Saloon (V1), CAMRY Station Wagon (V2_), CAMRY Station Wagon (V10), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), CARINA II (T15_), CARINA II (T17_), CARINA II Saloon (T15_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), COROLLA (E9_), COROLLA (E10_), COROLLA (E11_), COROLLA (E12U_, E12J_), COROLLA Compact (E9_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA Estate (E12J_, E12T_), COROLLA Liftback (E9_), COROLLA Liftback (E9I), COROLLA Liftback (E11_), COROLLA Saloon (E12J_, E12T_), COROLLA Verso (E12J_), COROLLA Verso (ZER_, ZZE_), COROLLA Wagon (E11_), PICNIC (XM10), RAV 4 I (SXA1_)
MVB1100R5 ALFA ROMEO 164 (164) AUDI A6 (4F2), A6 Avant (4F5) CITROËN JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (230), JUMPER Flatbed / Chassis (244) FIAT CROMA (154), DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230), DUCATO Flatbed / Chassis (244) HONDA ACCORD IV (CB3, CB7), ACCORD IV Aerodeck (CB8, CC), ACCORD V (CC7), ACCORD VI (CE, CF), NSX Convertible (NA), NSX Coupe (NA) LANCIA KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), THEMA (834), THEMA SW (834) PEUGEOT BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), BOXER Flatbed / Chassis (ZCT_) ROVER 600 (RH) TOYOTA CAMRY (V2_), CAMRY (V20), CAMRY Station Wagon (V2_), CARINA E (T19_), CARINA E Saloon (T19_), CARINA II (T17_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CELICA (ST16_), CELICA Convertible (T16_), CELICA Convertible (T18_), CELICA Coupe (T18_), CELICA Coupe (T16F), CELICA Hatchback (T16), COROLLA (E9_), COROLLA (E10_), COROLLA Compact (E9_), COROLLA Compact (E10_), COROLLA Liftback (E9_), COROLLA Liftback (E10_), COROLLA Station Wagon (E9_), COROLLA Wagon (E10_)	VW CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), GOLF III (1H1), GOLF III Variant (1H5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, POLO (6N2), POLO (9N_), POLO Saloon, VENTO (1H2) MVB1103R7 BMW 1 (E81, E87), 1 Convertible (E88), 3 (E90), 3 Convertible (E93), 3 Coupe (E92), 3 Touring (E91) OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9) VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD) MVB1105R6 ALFA ROMEO 156 (932), 156 Sportwagon (932) CITROËN XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y4), XM Break (Y4) FIAT DUCATO Bus (230), MAREA (185), MAREA Weekend (185), PALIO (178BX), SCUDO Box (220L), SCUDO Combinato (220P), SIENA (178_), ULYSSE (220) HONDA ACCORD VII (CG), ACCORD VII Coupe (CG), ACCORD VII Hatchback (CH) LANCIA KAPPA (838A), KAPPA SW (838B), ZETA (220) NISSAN MAXIMA QX (A32), MAXIMA QX (A33), MAXIMA Station Wagon PEUGEOT 306 (7B, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 806 (221) MVB1110R4 HONDA ACCORD VII Coupe (CG) KIA CLARUS (K9A), CLARUS Estate (GC) TOYOTA 4 RUNNER (N130) MVB1110R5 AUDI A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), ALLROAD (4BH), Q7 DACIA LOGAN, LOGAN MCV, SOLENZA HYUNDAI H-1 Bus (KMF), HIGHWAY VAN, SANTA FE (SM), SONATA III (EF), TRAJET (FO) KIA SORENTO (JC) MITSUBISHI COLT IV (CA_A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), LANCER V (CB/D_A) PROTON PERSONA 300 (C9_M), Satria (C9_M) RENAULT CLIO II (BB0/1/2_, CB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), LOGAN (LS_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_)	VW CARINA II Station Wagon (T17_), COROLLA (E9_), COROLLA (E10_), COROLLA (E11_), COROLLA (E12U_, E12J_), COROLLA Liftback (E9I), COROLLA Liftback (E11_), COROLLA Saloon (E12J_, E12T_), COROLLA Verso (E12J_), COROLLA Verso (ZER_, ZZE_), COROLLA Wagon (E11_), PICNIC (XM10), RAV 4 I (SXA1_) TOUAREG (7LA, 7L6, 7L7) MVB1115R6 AUDI A3 (8P1), A3 Sportback (8PA) CITROËN BERLINGO (MF), BERLINGO Box (M_), EVASION (22, U6), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_) FIAT SCUDO Box (220L), SCUDO Combinato (220P), ULYSSE (220) HONDA ACCORD IV Coupe (CC1), ACCORD V Aerodeck (CE), ACCORD V Coupe (CD7, CD9) LADA 2170 NISSAN ALMERA II (N16), ALMERA II Hatchback (N16), ALMERA TINO (V10), PRIMERA (P11), PRIMERA Hatchback (P11), PRIMERA Traveller (WP11) PEUGEOT 306 (7B, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 605 (6B), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F) SEAT ALTEA (5P1), ALTEA XL (5P5), LEON (1P1), TOLEDO III (5P2) SUZUKI SAMURAI (SJ) VW PASSAT (3C2), PASSAT Variant (3C5), TIGUAN
MVB1100R6 CITROËN JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (230), ZX (N2), ZX Break (N2) FIAT DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230) NISSAN ALMERA II (N16), ALMERA II Hatchback (N16), ALMERA TINO (V10), PRIMERA (P11), PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P11), PRIMERA Hatchback (P12), PRIMERA Traveller (WP11)	KIA SORENTO (JC) MITSUBISHI COLT IV (CA_A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), LANCER V (CB/D_A) PROTON PERSONA 300 (C9_M), Satria (C9_M) RENAULT CLIO II (BB0/1/2_, CB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), LOGAN (LS_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_)	NISSAN INTERSTAR Box (X70), INTERSTAR Bus (X70), INTERSTAR Flatbed / Chassis RENAULT MASTER III Box (HD, FD), MASTER III Bus (JD), MASTER III Flatbed / Chassis (ED, UD), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL) MVB1120R5 AUDI A5 BMW 3 (E36), 3 Convertible (E36), 3 Coupe (E36), 7 (E38), Z3, Z3 Coupe







					
CITROËN LADA MITSUBISHI NISSAN OPEL PEUGEOT RENAULT TOYOTA VAUXHALL VOLVO	XM (Y3), XM Break (Y3) 110, 111, 112, KALINA Estate (1117), KALINA Hatchback (1119), KALINA Saloon (1118) CARISMA (DA_), CARISMA Saloon (DA_), COLT IV (CA_A), LANCER V (CB/D_A), LANCER V Station Wagon (CB_W, CD_W), SPACE STAR (DGO) INTERSTAR Box (X70), INTERSTAR Bus (X70), PRIMASTAR Box (X83), PRIMASTAR Bus (X83) MOVANO Box (F9), MOVANO Combi (J9), VIVARO Box (F7), VIVARO Combi (J7), VIVARO Flatbed / Chassis (E7) 605 (6B) ESPACE III (JEO_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MASTER II Box (FD), MASTER II Bus (JD/ND), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL) CAMRY (_V2_), CAMRY Liftback (V1), CAMRY Saloon (V1), CAMRY Station Wagon (_V2_), CARINA II (_T15_), CARINA II (_T17_), CARINA II Saloon (_T15_), CARINA II Saloon (_T17_), CARINA II Station Wagon (_T17_), CELICA (_T20_), CELICA Convertible (_T20_), COROLLA (_E8_), COROLLA (_E9_), COROLLA (_E10_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA FX Compact (E8B), COROLLA Liftback (_E8_), COROLLA Liftback (_E9_), COROLLA Liftback (_E10_), COROLLA Station Wagon (_E7_), COROLLA Station Wagon (_E9_), COROLLA Wagon (_E10_), RAV 4 II (XA2) MOVANO Combi (J9), MOVANO Van (FD), VIVARO Box, VIVARO Combi S40 I (VS), S80 (TS, XY), S80 II, V40 Estate (VW), V70 II Estate (P80_), V70 III Estate, XC70 CROSS COUNTRY, XC70 II	SEAT SKODA VW RENAULT RENAULT CITROËN HYUNDAI OPEL PEUGEOT RENAULT AUDI DACIA HYUNDAI KIA MITSUBISHI NISSAN RENAULT TOYOTA	ALHAMBRA (7V8, 7V9), AROSA (6H), CORDOBA (6K2/C2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), LEON (1M1), TOLEDO II (1M2) FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5), OCTAVIA (1U2), OCTAVIA Combi (1U5) BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY II Pickup (9U7), CADDY III Box (2KA, 2KH), GOLF IV (111), GOLF IV Variant (1J5), LUPO (6X1, 6E1), MULTIVAN V (7HM, 7HF), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), POLO (6N1), POLO (6N2), POLO (9N_), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Saloon, POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HJ), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ) GRAND SCENIC (JM0/1_), MEGANE Cabriolet (EA0/1_), MEGANE II (BM0/1_, CM0/1_), MEGANE II Coupé-Cabriolet (EM0/1_), MEGANE II Estate (KM0/1_), MEGANE II Saloon (LM0/1_), SCENIC II (JM0/1_) BX (XB-), BX Break (XB-), XANTIA (X1), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), ZX (N2), ZX Break (N2) LANTRA II (J-2), LANTRA II Wagon (J2) MOVANO Box (F9) 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 405 I (15B), 405 II (4B), 405 II Break (4E) CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_) A6 (4F2), A6 Allroad (4FH), A6 Avant (4F5), A8 (4E_) LOGAN, LOGAN MCV TERRACAN (HP) SORENTO (JC) PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), PAJERO SPORT (K90) ALMERA II (N16), ALMERA II Hatchback (N16), KUBISTAR (X76), MICRA (K12) CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), CLIO III (BR0/1, CR0/1), GRAND SCENIC (JM0/1_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LOGAN (LS_), MEGANE II (BM0/1_, CM0/1_), MEGANE II Coupé-Cabriolet (EM0/1_), MEGANE II Estate (KM0/1_), MEGANE II Saloon (LM0/1_), MODUS (F//PO_), SCENIC II (JM0/1_), THALIA (LB0/1/2_) AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_), CARINA E (_T19_), CARINA E Saloon (_T19_), CARINA E Sportswagon (_T19_)	MVB1137R6 ARO FIAT HONDA LANCIA MITSUBISHI OPEL RENAULT SUZUKI VAUXHALL VOLVO VW MVB1141R5 CITROËN FORD LAND ROVER MAZDA PEUGEOT MVB1148R5 FIAT LANCIA MAZDA MG MITSUBISHI PROTON ROVER TOYOTA MVB1150R6 CITROËN FIAT FORD	10 BRAVO (182), COUPE (FA/175), MAREA (185), MAREA Weekend (185) JAZZ (GD), S2000 (AP) LYBRA (839AX), LYBRA SW (839BX) CARISMA (DA_), CARISMA Saloon (DA_) ARENA Box (TB, TF), ARENA Combi (THB) 9 (L42_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), ESPACE III (JEO_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), SCENIC (JA0/1_), TRAFIC Box (TXX), TRAFIC Bus (TXW) SAMURAI (SJ) ARENA Combi, ARENA Van S40 I (VS), V40 Estate (VW) CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KI), MULTIVAN V (7HM, 7HF), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HJ), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ) XM (Y3), XM Break (Y3) ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (J5_, J3_), FIESTA Box (JV_), FIESTA IV (JA_, JB_) RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN) 121 III (JASM, JBSM) 605 (6B) 500, BRAVO, DOBLO (119), DOBLO Cargo (223), GRANDE PUNTO (199), IDEA, LINEA, PANDA (169), PANDA Van (141_), PUNTO (188), STILO (192), STILO Multi Wagon (192) MUSA, YPSILON 626 IV (GE), 626 IV Hatchback (GE) MG ZR, MG ZS, MG ZS Hatchback SPACE RUNNER (N1_W, N2_W), SPACE WAGON (N3_W, N4_W) PERSONA 300 (C9_M), PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S), WIRA 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW), COUPE, STREETWISE AVENSIS VERSO (AC_), PREVIA (ACR_) JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), ZX (N2), ZX Break (N2) DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), STILO (192) GALAXY (WGR)



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







 	 	 
<p>MITSUBISHI 3000 GT (Z16A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), SIGMA (F16A)</p> <p>NISSAN INTERSTAR Box (X70), INTERSTAR Bus (X70), INTERSTAR Flatbed / Chassis, PRIMASTAR Box (X83), PRIMASTAR Bus (X83)</p> <p>OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumpttruck (H9), MOVANO Flatbed / Chassis (U9, E9), VIVARO Box (F7), VIVARO Combi (J7)</p> <p>PEUGEOT 306 (7B, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 307 Break (3E), 307 SW (3H), 405 I (15B), 405 II (4B), 405 II Break (4E), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_)</p> <p>RENAULT 19 I (B/C53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD), TRAFIC Box (TXX), TRAFIC Bus (TXW), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL)</p> <p>SEAT ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L)</p> <p>SUZUKI VITARA (ET, TA), VITARA Cabrio (ET, TA)</p> <p>VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD), VIVARO Box, VIVARO Combi</p> <p>VW CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV (1J1), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), VENTO (1H2)</p>	<p>SEAT ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L)</p> <p>SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG)</p> <p>VOLVO 440 K (445), 460 L (464), 480 E</p> <p>VW CADDY II Box (9K9A), CADDY II Estate (9K9B), CORRADO (53I), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV Cabriolet (1E7), LUPO (6X1, 6E1), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), VENTO (1H2)</p> <p>MVB1165R4 ARO SPARTANA RENAULT TWINGO (C06_), TWINGO Box (S06_) TOYOTA YARIS (_CP10), YARIS VERSO (NC/LP2_)</p> <p>MVB1165R5 AUDI A4 (8EC), A4 Avant (8ED), A4 Convertible (8H7, 8HE) BMW 7 (E32) CITROËN XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) FORD USA PROBE II (ECP) MAZDA 323 F VI (BJ), 323 S VI (BJ), 626 IV (GE), 626 IV Hatchback (GE), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), MPV II (LW), MX-6 (GE6), PREMACY (CP) MG MG ZR, MG ZS, MG ZS Hatchback PEUGEOT 605 (6B) RENAULT 9 (L42_) ROVER 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 200 Coupe (XW), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), 600 (RH), 800 (XS), 800 Hatchback (XS), STREETWISE</p>	<p>MVB1173R6 AUDI A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4) CITROËN ZX (N2), ZX Break (N2) HONDA ACCORD VII Coupe (CG) NISSAN 350 Z (Z33), 350 Z Roadster, PATHFINDER (R50) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 405 I (15B), 405 II (4B), 405 II Break (4E) RENAULT 9 (L42_), 11 (B/C37_), 11 Box (S37_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_) TOYOTA YARIS VERSO (NC/LP2_) VOLVO 440 K (445), 460 L (464)</p> <p>MVB1173R8 MAZDA 5 (CR19), 6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY)</p> <p>MVB1175R5 FIAT PUNTO (188), PUNTO Van (188AX)</p> <p>MVB1180R6 AUDI 80 (8C, B4), 80 Avant (8C, B4) CITROËN JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (244) DAIHATSU CUORE VIII FIAT 500, DOBLO (119), DOBLO Cargo (223), DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (244), FIORINO Box, GRANDE PUNTO (199), IDEA, LINEA, PANDA (169), PANDA Van (141_), PUNTO (188), PUNTO Van (188AX), STRADA (178E) FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), PUMA (E_) HONDA ACCORD VI (CE, CF), ACCORD VII (CG), ACCORD VII Hatchback (CH), CIVIC V Fastback (MB) LANCIA MUSA, YPSILON LAND ROVER FREELANDER (LN), FREELANDER Soft Top MAZDA 121 III (JASM, JBSM) MG MG ZR, MG ZS, MG ZS Hatchback OPEL AGILA, AGILA (H00), ASTRA H, ASTRA H Estate, ASTRA H GTC, COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W5L), CORSA D, MERIVA, TIGRA TwinTop PEUGEOT BOXER Box (230L), BOXER Box (244), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244) ROVER 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 400 (RT), 400 Hatchback (RT), 600 (RH), STREETWISE SEAT CORDOBA (6K2/C2), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), IBIZA V (6J5), IBIZA V SPORTCOUPE (6J1), INCA (6K9) SKODA FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Saloon (6Y3), PRAKTIK, ROOMSTER (5I) SUZUKI IGNIS II, SPLASH, SWIFT III (SG), WAGON R+ (MM) VAUXHALL AGILA, ASTRA MK V Estate, ASTRA MK V Hatchback, COMBO, CORSA Mk II, CORSA Mk III, CORSAVAN MK II, MERIVA, TIGRA TwinTop VW CADDY II Box (9K9A), CADDY II Estate (9K9B), POLO (9N_), POLO CLASSIC (6KV2), POLO Variant (6KV5)</p>
<p>MVB1150R7 OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumpttruck (H9), MOVANO Flatbed / Chassis (U9, E9) RENAULT MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD), MASTER III Box (HD, FD), MASTER III Bus (JD), MASTER III Flatbed / Chassis (ED, UD) TOYOTA LAND CRUISER (J12), LAND CRUISER 90 (_J9_) VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD)</p>	<p>MVB1165R6 CITROËN BERLINGO (MF), BERLINGO Box (M_), EVASION (22, U6), JUMPER Box, JUMPER Bus, JUMPER Flatbed / Chassis, JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), ZX (N2) FIAT DUCATO Box, DUCATO Bus, DUCATO Bus (230), DUCATO Flatbed / Chassis, SCUDO Box (220L), SCUDO Combinato (220P), ULYSSE (220) LANCIA ZETA (220) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 605 (6B), 806 (221), BOXER Box, BOXER Bus, BOXER Flatbed / Chassis, EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F) RENAULT 9 (L42_), 19 I (B/C53_), 19 I Box (S53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), CLIO I (B/C57_, 5/357_)</p>	<p>MVB1155R5 BMW 8 (E31) CITROËN XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) FIAT PUNTO (188), PUNTO Van (188AX), STILO (192) HONDA JAZZ (GD) PEUGEOT 605 (6B)</p>
<p>MVB1155R6 CITROËN JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230) FIAT DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230) PEUGEOT 307 (3A/C), 307 Break (3E), 307 SW (3H), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_) RENAULT MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE I (BA0/1_)</p>	<p>MVB1165R6 CITROËN BERLINGO (MF), BERLINGO Box (M_), EVASION (22, U6), JUMPER Box, JUMPER Bus, JUMPER Flatbed / Chassis, JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), ZX (N2) FIAT DUCATO Box, DUCATO Bus, DUCATO Bus (230), DUCATO Flatbed / Chassis, SCUDO Box (220L), SCUDO Combinato (220P), ULYSSE (220) LANCIA ZETA (220) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 605 (6B), 806 (221), BOXER Box, BOXER Bus, BOXER Flatbed / Chassis, EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F) RENAULT 9 (L42_), 19 I (B/C53_), 19 I Box (S53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), CLIO I (B/C57_, 5/357_)</p>	<p>MVB1155R5 BMW 8 (E31) CITROËN XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) FIAT PUNTO (188), PUNTO Van (188AX), STILO (192) HONDA JAZZ (GD) PEUGEOT 605 (6B)</p>







 	 	 
<p>MVB1180R7 ALFA ROMEO 164 (164) MINI MINI</p> <p>MVB1188R5 CITROËN XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) FIAT PALIO Weekend (178DX), SIENA (178_), STRADA (178E) LAND ROVER FREELANDER (LN), FREELANDER Soft Top MITSUBISHI LANCER Saloon PEUGEOT 605 (6B) TOYOTA COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA Liftback (E10_), COROLLA Liftback (E11_), COROLLA Verso (E12_), COROLLA Wagon (E11_), COROLLA Wagon (E10_), RAV 4 II (XA2), YARIS (CP10), YARIS VERSO (NC/LP2_)</p>	<p>MEGANE Classic (LA0/1_), MEGANE II (BMO/1_, CM0/1_), MEGANE II Coupé-Cabriolet (EM0/1_), MEGANE II Estate (KMO/1_), MEGANE II Saloon (LMO/1_), MODUS (F/PO_), SCENIC II (JMO/1_), THALIA (LBO/1/2_) ROVER 45 (RT), 45 Saloon (RT), 75 (RJ), 75 Tourer (RJ), 400 (RT), 400 Hatchback (RT), 800 (XS), 800 Hatchback (XS) VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD)</p>	<p>MVB1215R4 AUDI A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5) PEUGEOT 205 Box, 205 I (741A/C), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A), 309 II (3C, 3A) RENAULT CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), RAPID Box (F40_, G40_), SAFRANE I (B54_)</p>
<p>MVB1188R6D SEAT AROSA (6H) VW LUPO (6X1, 6E1), POLO (6N2), POLO (9N_), POLO Saloon</p>	<p>MVB1200R6 BMW 7 (E38), 8 (E31) CITROËN BERLINGO, BERLINGO Box, C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C6 (TD_), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y4), XM Break (Y4), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68) DACIA LOGAN, LOGAN MCV DAIHATSU SIRION (M3_) FIAT IDEA, PUNTO (188), PUNTO Van (188AX), ULYSSE (179AX) FORD GALAXY, S-MAX HYUNDAI XG KIA OPIRUS LANCIA MUSA NISSAN KUBISTAR (X76), NOTE (E11), TIIDA Saloon (SC11X) PEUGEOT 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 407 (6D_), 407 SW (6E_), 605 (6B), 607 (9D, 9U), 807 (E), PARTNER Box, PARTNER Tepee</p>	<p>MVB1215R5 CHEVROLET ALERO OPEL ASTRA G Box (F70), ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), MERIVA, TIGRA TwinTop, ZAFIRA, ZAFIRA (F75_) TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CAMRY (V2_), CAMRY Liftback (V1), CAMRY Saloon (V1), CAMRY Station Wagon (V2_), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), CARINA II (T15_), CARINA II (T17_), CARINA II Saloon (T15_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), COROLLA (E8_), COROLLA (E9_), COROLLA Compact (E9_), COROLLA FX Compact (E8B), COROLLA Liftback (E8_), COROLLA Liftback (E9_), COROLLA Station Wagon (E9_) VAUXHALL ASTRA Mk III Convertible, ASTRA Mk IV, ASTRA MK IV Convertible, ASTRA Mk IV Coupe, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, ASTRAVAN Mk IV, COMBO, CORSA Mk II, MERIVA, TIGRA TwinTop, ZAFIRA</p>
<p>MVB1190R4 MAZDA 323 III Station Wagon (BW) NISSAN MAXIMA (J30) RENAULT RAPID Box (F40_, G40_) TOYOTA 4 RUNNER (N130), YARIS (CP10), YARIS VERSO (NC/LP2_)</p>	<p>RENAULT CLIO Grandtour (KRO/1_), CLIO II (BBO/1/2_, CBO/1/2_), CLIO II Box (SBO/1/2_), CLIO III (BRO/1, CRO/1), GRAND SCENIC (JMO/1_), LOGAN (LS_), MEGANE Classic (LA0/1_), MEGANE Grandtour (KA0/1_), MEGANE II (BMO/1_, CM0/1_), MEGANE II Coupé-Cabriolet (EM0/1_), MEGANE II Estate (KMO/1_), MEGANE II Saloon (LMO/1_), MODUS (F/PO_), SCENIC II (JMO/1_), TWINGO (CNO_) VOLVO S80 II, V70 III Estate, XC 90, XC70 CROSS COUNTRY</p>	<p>MVB1215R6 CITROËN C1 (PM_, PN_), C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C8 (EA_, EB_), JUMPY, JUMPY Box FIAT SCUODO, SCUODO Box, SCUODO Flatbed / Chassis, ULYSSE (179AX) FORD C-MAX, FOCUS C-MAX, FOCUS II (DA_), FOCUS II Convertible, FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), KUGA LANCIA PHEDRA (179) NISSAN QASHQAI (J10), X-TRAIL (T31) PEUGEOT 107, 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_) RENAULT CLIO II (BBO/1/2_, CBO/1/2_), CLIO II Box (SBO/1/2_), CLIO III (BRO/1, CRO/1), KANGOO (KCO/1_), KANGOO Express (FCO/1_) TOYOTA AYGO, COROLLA (E12U_, E12L_), COROLLA Estate (E12L_, E12T_), COROLLA Saloon (E12L_, E12T_), YARIS VOLVO C30, C70 Convertible, S40 II (MS), V50 (MW)</p>
<p>MVB1190R6 BMW 7 (E38) CITROËN C5 (DC_), C5 Break (DE_), C8 (EA_, EB_), EVASION (22, U6), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XM (Y4), XM Break (Y4) DACIA SOLENZA DODGE AVENGER FIAT SCUODO Box (220L), SCUODO Combinato (220P), ULYSSE (179AX), ULYSSE (220) LANCIA PHEDRA (179), ZETA (220) PEUGEOT 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 605 (6B), 806 (221), 807 (E), EXPERT (224), EXPERT Box (222) RENAULT 19 I Chamade (L53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_), CLIO I (B/C57_, 5/357_), CLIO II (BBO/1/2_, CBO/1/2_), CLIO II Box (SBO/1/2_), KANGOO, KANGOO (KCO/1_), KANGOO Express (FCO/1_), THALIA (LBO/1/2_)</p>	<p>MVB1200R6D AUDI A3 (8L1), TT (8N3), TT Roadster (8N9) FORD GALAXY (WGR) SEAT ALHAMBRA (7V8, 7V9), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), LEON (1M1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5) VW BORA (1J2), BORA Estate (1J6), CADDY III Box (2KA, 2KH), GOLF IV (1J1), GOLF IV Variant (1J5), MULTIVAN V (7HM, 7HF), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HI), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)</p>	<p>MVB1215R6 CITROËN C1 (PM_, PN_), C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C8 (EA_, EB_), JUMPY, JUMPY Box FIAT SCUODO, SCUODO Box, SCUODO Flatbed / Chassis, ULYSSE (179AX) FORD C-MAX, FOCUS C-MAX, FOCUS II (DA_), FOCUS II Convertible, FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), KUGA LANCIA PHEDRA (179) NISSAN QASHQAI (J10), X-TRAIL (T31) PEUGEOT 107, 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_) RENAULT CLIO II (BBO/1/2_, CBO/1/2_), CLIO II Box (SBO/1/2_), CLIO III (BRO/1, CRO/1), KANGOO (KCO/1_), KANGOO Express (FCO/1_) TOYOTA AYGO, COROLLA (E12U_, E12L_), COROLLA Estate (E12L_, E12T_), COROLLA Saloon (E12L_, E12T_), YARIS VOLVO C30, C70 Convertible, S40 II (MS), V50 (MW)</p>
<p>MVB1200R5 CHRYSLER VOYAGER I (ES) LAND ROVER FREELANDER (LN), FREELANDER Soft Top, RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN) MG MG TF, MG ZS, MG ZS Hatchback, MG ZT, MG ZT-T, MGF (RD) NISSAN ALMERA II (N16), ALMERA II Hatchback (N16), KUBISTAR (X76), MICRA (K12) OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9) RENAULT CLIO II (BBO/1/2_, CBO/1/2_), CLIO II Box (SBO/1/2_), GRAND SCENIC (JMO/1_), KANGOO (KCO/1_), KANGOO Express (FCO/1_), MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD),</p>	<p>MVB1200R6D AUDI A3 (8L1), TT (8N3), TT Roadster (8N9) FORD GALAXY (WGR) SEAT ALHAMBRA (7V8, 7V9), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), LEON (1M1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5) VW BORA (1J2), BORA Estate (1J6), CADDY III Box (2KA, 2KH), GOLF IV (1J1), GOLF IV Variant (1J5), MULTIVAN V (7HM, 7HF), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HI), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)</p>	<p>MVB1215R6 CITROËN C1 (PM_, PN_), C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C8 (EA_, EB_), JUMPY, JUMPY Box FIAT SCUODO, SCUODO Box, SCUODO Flatbed / Chassis, ULYSSE (179AX) FORD C-MAX, FOCUS C-MAX, FOCUS II (DA_), FOCUS II Convertible, FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), KUGA LANCIA PHEDRA (179) NISSAN QASHQAI (J10), X-TRAIL (T31) PEUGEOT 107, 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_) RENAULT CLIO II (BBO/1/2_, CBO/1/2_), CLIO II Box (SBO/1/2_), CLIO III (BRO/1, CRO/1), KANGOO (KCO/1_), KANGOO Express (FCO/1_) TOYOTA AYGO, COROLLA (E12U_, E12L_), COROLLA Estate (E12L_, E12T_), COROLLA Saloon (E12L_, E12T_), YARIS VOLVO C30, C70 Convertible, S40 II (MS), V50 (MW)</p>



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits






  <p>MVB1215R6D SEAT ALHAMBRA (7V8, 7V9) VW CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), MULTIVAN V (7HM, 7HF), SHARAN (7M8, 7M9, 7M6), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HJ), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)</p>	  <p>RENAULT CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_) SKODA SUPERB (3U4) TOYOTA LAND CRUISER 100 (J10_) VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)</p>	  <p>RENAULT MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_)</p>
<p>MVB1220R7 LANCIA THEMA (834)</p>	<p>MVB1238R6 AUDI A3 (8P1), A3 Sportback (8PA) RENAULT LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SAFRANE I (B54_), SAFRANE II (B54_) TOYOTA AURIS, COROLLA Saloon (E12_, E12T_) VW GOLF V (1K1)</p>	<p>MVB1260R6 FORD FIESTA III (GF) SEAT LEON (1M1), TOLEDO II (1M2) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), MULTIVAN V (7HM, 7HF), NEW BEETLE (9C1, 1C1), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HJ), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)</p>
<p>MVB1225R5 CITROËN BERLINGO (MF) MITSUBISHI COLT VI PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5) SEAT AROSA (6H) SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5) SMART FORFOUR TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), PICNIC (XM10) VW CADDY II Pickup (9U7), LUPO (6X1, 6E1), POLO (6N1), POLO (6N2), POLO Box (6NF)</p>	<p>MVB1240R5 HYUNDAI SONATA I (Y-2), SONATA II (Y-3) MITSUBISHI SIGMA Station Wagon (F07W) OPEL SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS SAAB 9-3 (YS3F), 9-3 Estate TOYOTA AVENSIS VERSO (AC_), PREVIA (ACR3_) VAUXHALL SIGNUM, VECTRA Estate, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS</p>	<p>MVB1263R5 DAEWOO ESPERO (KLE) MERCEDES-BENZ A-CLASS (W168), Vaneo (414) RENAULT MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_)</p>
<p>MVB1225R6 CITROËN NEMO (AA_) PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), BIPPER (AA_)</p>	<p>MVB1240R7 ALFA ROMEO 164 (164) FIAT CROMA (154) LANCIA THEMA (834), THEMA SW (834)</p>	<p>MVB1270R5 CITROËN BX (XB-_) MERCEDES-BENZ A-CLASS (W168) PEUGEOT 309 I (3C, 3A), 405 I (15B) PORSCHE CARRERA GT</p>
<p>MVB1230R4 CITROËN BX (XB-_), BX Break (XB-_) LADA NIVA (2121) PEUGEOT 205 Box, 205 I (741A/C), 205 II (20A/C), 309 I (10C, 10A), 309 II (3C, 3A)</p>	<p>MVB1245R4 CITROËN BX (XB-_), BX Break (XB-_) LANCIA THEMA (834)</p>	<p>MVB1270R6 FIAT BRAVO, STILO (192), STILO Multi Wagon (192) FORD SCORPIO I (GAE, GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)</p>
<p>MVB1230R5 CITROËN BX (XB-_), BX Break (XB-_) OPEL AGILA (H00), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, COMBO Box Body / Estate, COMBO Tour, CORSA B (73_, 78_, 79_, F35_), CORSA C (F08, F68), CORSA C Box (F08, W5L), CORSA D, MERIVA, TIGRA TwinTop PEUGEOT 405 I (15B), 405 I Break (15E) SUZUKI WAGON R+ (EM) VAUXHALL AGILA, ASTRA MK V Estate, ASTRA MK V Hatchback, COMBO, CORSA, CORSA Mk II, CORSA Mk III, CORSAVAN MK II, MERIVA, TIGRA TwinTop</p>	<p>MVB1250R6 CHRYSLER VOYAGER III (RG) FIAT BRAVO, STILO (192), STILO Multi Wagon (192) HYUNDAI i30, i30 CW Estate KIA CEE'D Estate, CEE'D Hatchback, PRO CEE'D OPEL ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W5L), CORSA D, MERIVA, ZAFIRA VAUXHALL ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, COMBO, CORSA Mk II, CORSA Mk III, CORSAVAN MK II VOLVO 850 (LS), 850 Estate (LW), 960 (964), 960 II (964), 960 II Estate (965), 960 Kombi (965), C70 Convertible, C70 Coupe, S70 (P80_), S90, V70 I Estate (P80_), V70 II Estate (P80_), V90 Estate</p>	<p>HONDA CIVIC VI Hatchback (EU_, EP_) OPEL ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W5L), MERIVA VAUXHALL ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, ASTRAVAN Mk IV, CORSA Mk II, MERIVA VOLVO 850 (LS), 850 Estate (LW), 960 (964), 960 II (964), 960 II Estate (965), 960 Kombi (965), C70 Convertible, C70 Coupe, S70 (P80_), S90, V70 I Estate (P80_), V70 II Estate (P80_), V90 Estate</p>
<p>MVB1230R6 FIAT PUNTO (188), PUNTO Van (188AX) FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) HYUNDAI XG TOYOTA AURIS</p>	<p>MVB1255R5 CITROËN BERLINGO (MF), BERLINGO Box (M_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), ZX (N2), ZX Break (N2) OPEL ZAFIRA (F75_) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), PARTNER Box (5), PARTNER Combispace (5F) TOYOTA AVENSIS (T25), AVENSIS Estate (T25), AVENSIS Saloon (T25), COROLLA Verso (ZER_, ZZE_) VAUXHALL ZAFIRA</p>	<p>MVB1270R7 NISSAN NAVARA (D40), PATHFINDER (R51)</p> <p>MVB1272R4 CITROËN BX (XB-_), BX Break (XB-_) RENAULT MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_)</p>
<p>MVB1230R8 MAZDA 3 (BK14), 3 Saloon (BK12), 5 (CR19), 6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY), MPV II (LW)</p>	<p>MVB1260R4 LAND ROVER RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN)</p>	<p>MVB1285R5 ALFA ROMEO 155 (167), 164 (164) MERCEDES-BENZ A-CLASS (W168), Vaneo (414) NISSAN PATHFINDER (R50) TOYOTA SUPRA (MA70)</p> <p>MVB1285R7 FORD GALAXY (WGR) HONDA CIVIC VI Hatchback (EU_, EP_) MERCEDES-BENZ V-CLASS (638/2) VW CORRADO (53I), GOLF III (1H1),</p>







  <p>GOLF III Variant (1H5), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), SHARAN (7M8, 7M9, 7M6), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), VENTO (1H2)</p>	  <p>MVB1335R6 AUDI A6 (4A, C4), A6 Avant (4A, C4) CHRYSLER 300 M (LR), NEW YORKER, SEBRING (JR), SEBRING Convertible (JR), STRATUS (JA), STRATUS Convertible (JX), VISION, VOYAGER II (GS) CITROËN BERLINGO Box (M_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68) DODGE STRATUS FORD FIESTA V (JH_, JD_), FIESTA Van, FUSION (JU_) MAZDA 2 (B2W) PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K) VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	  <p>SHARAN (7M8, 7M9, 7M6), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), VENTO (1H2)</p>
<p>MVB1290R6 AUDI 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4) FIAT STILO (192), STILO Multi Wagon (192)</p>	<p>MVB1345R5 HYUNDAI GALLOPER II (JK01) LANCIA DELTA I (831AB0), PRISMA (831AB0) MITSUBISHI CARISMA (DA_), CARISMA Saloon (DA_), PAJERO I (L04_G, L14_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), PAJERO PININ (H6_W, H7_W), SPACE STAR (DGO) S40 I (VS), V40 Estate (VW)</p>	<p>MVB1369R6 CHRYSLER STRATUS (JA) DODGE STRATUS LAND ROVER DISCOVERY I, DISCOVERY II (LJ, LT) MITSUBISHI PAJERO CLASSIC (V2_W), PAJERO III (V60, V70), PAJERO SPORT (K90) OPEL ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, ZAFIRA VAUXHALL ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, ZAFIRA Mk II</p>
<p>MVB1300R5 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), CABRIOLET (8G7, B4) MERCEDES-BENZ A-CLASS (W169), B-CLASS (W245) MITSUBISHI COLT IV (CA_A), COLT V (CJ_A), LANCER V (CB/D_A) SKODA SUPERB (3U4) TOYOTA SUPRA (MA70) VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)</p>	<p>MVB1352R6 CITROËN BERLINGO Box, BERLINGO Box (M_), JUMPY, JUMPY Box, NEMO (AA_) FORD ESCORT V (GAL), ESCORT VI (GAL), ESCORT VII (GAL, AAL, ABL), FOCUS C-MAX, FOCUS II (DA_), FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_) MERCEDES-BENZ C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C208), CLK Convertible (A208), E-CLASS (W210), E-CLASS Estate (S210), SLK (R170) PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), BIPPER (AA_), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_), PARTNER Box, PARTNER Box (5), PARTNER Combispacer (5F), PARTNER Tepee VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	<p>MVB1370R5 DODGE STRATUS MITSUBISHI GALANT VI (EA_), GALANT VI Estate (EA_) OPEL COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W5L), MERIVA, TIGRA TwinTop VAUXHALL COMBO, CORSA Mk II, CORSA Mk III, MERIVA, TIGRA TwinTop</p>
<p>MVB1306R6 FIAT 500, DOBLO (119), DOBLO Cargo (223), IDEA, PANDA (169), PANDA Van (141_), PUNTO (188), PUNTO Van (188AX), STRADA (178E) FORD C-MAX, FOCUS C-MAX, FOCUS II (DA_), FOCUS II Convertible, FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_) LANCIA MUSA, YPSILON MAZDA 3 (BK14), 3 Saloon (BK12), 5 (CR19) NISSAN PRAIRIE PRO (M11) OPEL ASTRA H, ASTRA H Estate, ASTRA H GTC VAUXHALL ASTRA MK V Estate, ASTRA MK V Hatchback VOLVO C30, S40 II (MS), V50 (MW)</p>	<p>MVB1360R5 MAZDA RX 7 III (FD) OPEL AGILA (H00), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, CORSA B (73_, 78_, 79_, F35_), CORSA C (F08, F68), CORSA C Box (F08, W5L), CORSA D SUZUKI WAGON R+ (EM) VAUXHALL AGILA, ASTRA MK V Estate, ASTRA MK V Hatchback, CORSA, CORSA Mk II, CORSA Mk III, CORSAVAN MK II</p>	<p>MVB1370R6 MINI MINI, MINI Convertible SUZUKI LIANA (ER), LIANA Estate (ER)</p> <p>MVB1375R5 RENAULT ESPACE III (JE0_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_)</p> <p>MVB1388R5 CITROËN XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) HYUNDAI H-1 Bus (KMF), HIGHWAY VAN, SANTA FE (SM), SONATA III (EF), SONATA IV (EU4), TRAJET (FO) KIA MAGENTIS (GD), SORENTO (JC) MITSUBISHI SPACE RUNNER (N50), SPACE WAGON (N5_W) PEUGEOT 605 (6B)</p>
<p>MVB1311R4 CHRYSLER NEON II, PT CRUISER (PT_) DODGE NEON II</p>	<p>MVB1360R6 FIAT BRAVO, STILO (192), STILO Multi Wagon (192)</p> <p>MVB1360R7 TOYOTA COASTER Bus</p>	<p>MVB1388R6 CITROËN BERLINGO (MF), BERLINGO Box (M_), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0) FIAT GRANDE PUNTO (199), PALIO (178BX), SCUDO Box (220L), SEDICI, SIENA (178_) MINI MINI, MINI Convertible PEUGEOT 206 Hatchback (2A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), EXPERT Box (222), EXPERT Flatbed / Chassis, EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispacer (5F) SUZUKI SX4</p>
<p>MVB1318R6 FIAT FIORINO Box, GRANDE PUNTO (199), LINEA OPEL AGILA, AGILA (H00), COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W5L), CORSA D, MERIVA, TIGRA TwinTop SUZUKI IGNIS II, SPLASH, SWIFT III (SG), WAGON R+ (MM) VAUXHALL AGILA, COMBO, CORSA Mk II, CORSA Mk III, CORSAVAN MK II, MERIVA, TIGRA TwinTop</p>	<p>MVB1360R7D FORD GALAXY (WGR) MERCEDES-BENZ V-CLASS (638/2) VW CORRADO (53I), GOLF III (1H1), GOLF III Variant (1H5), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I),</p>	<p>MVB1388R7 HONDA STREAM (RN)</p> <p>MVB1400R6 CHRYSLER SEBRING (JR), SEBRING Convertible (JR) DACIA SOLENZA HYUNDAI i30 KIA CEE'D Estate, CEE'D Hatchback, PRO CEE'D RENAULT CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO, KANGOO (KC0/1_), KANGOO Express (FC0/1_), THALIA (LBO/1/2_) TOYOTA AURIS, COROLLA (_E12U_, _E12J_), COROLLA Estate (_E12L_, _E12T_), COROLLA Saloon (_E12J_, _E12T_), COROLLA Verso (_E12L_), MR 2 (_W3_)</p>
<p>MVB1325R4 CHEVROLET S10 Pick Up LAND ROVER DEFENDER (LD), DEFENDER Station Wagon (LD), DISCOVERY II (LJ, LT)</p>	<p>MVB1360R6 FIAT BRAVO, STILO (192), STILO Multi Wagon (192)</p>	<p>MVB1388R7 HONDA STREAM (RN)</p>
<p>MVB1325R6 AUDI 100 (4A, C4), 100 Avant (4A, C4) MERCEDES-BENZ C-CLASS (W202), C-CLASS Estate (S202), CLK (C208), CLK Convertible (A208), E-CLASS (W210), E-CLASS Estate (S210), SLK (R170)</p>	<p>MVB1360R6 FIAT BRAVO, STILO (192), STILO Multi Wagon (192)</p>	<p>MVB1400R6 CHRYSLER SEBRING (JR), SEBRING Convertible (JR) DACIA SOLENZA HYUNDAI i30 KIA CEE'D Estate, CEE'D Hatchback, PRO CEE'D RENAULT CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO, KANGOO (KC0/1_), KANGOO Express (FC0/1_), THALIA (LBO/1/2_) TOYOTA AURIS, COROLLA (_E12U_, _E12J_), COROLLA Estate (_E12L_, _E12T_), COROLLA Saloon (_E12J_, _E12T_), COROLLA Verso (_E12L_), MR 2 (_W3_)</p>
<p>MVB1325R6D AUDI TT (8N3), TT Roadster (8N9) FORD GALAXY (WGR)</p>	<p>MVB1360R7D FORD GALAXY (WGR) MERCEDES-BENZ V-CLASS (638/2) VW CORRADO (53I), GOLF III (1H1), GOLF III Variant (1H5), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I),</p>	<p>MVB1400R6 CHRYSLER SEBRING (JR), SEBRING Convertible (JR) DACIA SOLENZA HYUNDAI i30 KIA CEE'D Estate, CEE'D Hatchback, PRO CEE'D RENAULT CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO, KANGOO (KC0/1_), KANGOO Express (FC0/1_), THALIA (LBO/1/2_) TOYOTA AURIS, COROLLA (_E12U_, _E12J_), COROLLA Estate (_E12L_, _E12T_), COROLLA Saloon (_E12J_, _E12T_), COROLLA Verso (_E12L_), MR 2 (_W3_)</p>
<p>MVB1330R5 MITSUBISHI CARISMA (DA_), CARISMA Saloon (DA_), COLT IV (CA_A), COLT V (CJ_A), GALANT VI (EA_), GALANT VI Estate (EA_), PAJERO PININ (H6_W, H7_W) RENAULT 25 (B29_)</p>	<p>MVB1360R7D FORD GALAXY (WGR) MERCEDES-BENZ V-CLASS (638/2) VW CORRADO (53I), GOLF III (1H1), GOLF III Variant (1H5), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I),</p>	<p>MVB1400R6 CHRYSLER SEBRING (JR), SEBRING Convertible (JR) DACIA SOLENZA HYUNDAI i30 KIA CEE'D Estate, CEE'D Hatchback, PRO CEE'D RENAULT CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO, KANGOO (KC0/1_), KANGOO Express (FC0/1_), THALIA (LBO/1/2_) TOYOTA AURIS, COROLLA (_E12U_, _E12J_), COROLLA Estate (_E12L_, _E12T_), COROLLA Saloon (_E12J_, _E12T_), COROLLA Verso (_E12L_), MR 2 (_W3_)</p>



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







					
MVB1400R7 CHRYSLER VOYAGER II (GS)		MVB1440R6 CHRYSLER PT CRUISER (PT.)			ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), COMBO (71_), CORSA B (73_, 78_, 79_, F35_), CORSA B Box (73_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), SENATOR B (29_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_)
MVB1413R6 FORD ESCORT '95 Box (AVL), ESCORT VI (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW), SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SCORPIO II (GFR, GGR), SCORPIO II Estate (GNR, GGR), SIERRA Hatchback (GBC, GBG), TRANSIT Box (E_), TRANSIT Bus (E_), TRANSIT Flatbed / Chassis (E_)		CITROËN BERLINGO (MF), BERLINGO Box (M_), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0)		RENAULT 19 I (B/C53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_)	
OPEL SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS		FIAT SCUDO Box (220L), SCUDO Combinato (220P)		ROVER 19 I (B/C53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_)	
PORSCHE 911 (964)		FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_)		ROVER 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 400 (RT), 400 Hatchback (RT), 600 (RH), STREETWISE	
RENAULT 19 I (B/C53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_)		HYUNDAI ACCENT (LC), ACCENT Saloon (LC), GETZ (TB), MATRIX (FC)		SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3)	
ROVER 800 (XS), 800 Hatchback (XS)		MAZDA 121 III (JASM, JBSM)		VAUXHALL ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, SENATOR Mk II, VECTRA, VECTRA Estate, VECTRA Hatchback	
SAAB 9-3 (Y33F), 9-3 Convertible (Y33F), 9-3 Estate		MITSUBISHI LANCER VI (CK/P_A)		VAUXHALL ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, SENATOR Mk II, VECTRA, VECTRA Estate, VECTRA Hatchback	
VAUXHALL SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS		PEUGEOT 206 Hatchback (2A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), EXPERT Box (222), EXPERT Flatbed / Chassis, EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F)		VAUXHALL ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, SENATOR Mk II, VECTRA, VECTRA Estate, VECTRA Hatchback	
MVB1420R4 CHRYSLER PT CRUISER (PT.)		MVB1450R5 CITROËN XM (Y3), XM (Y4)		VW POLO (9N_), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	
NISSAN 300 ZX (Z31)		OPEL ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, CORSA D, MERIVA, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA, ZAFIRA (F75_)		MVB1469R6 CITROËN BERLINGO (MF), BERLINGO Box (M_), EVASION (22, U6), JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (244), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68)	
MVB1420R6 CHRYSLER VOYAGER II (GS), VOYAGER III (RG)		PEUGEOT 605 (6B)		FIAT DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (244), SCUDO Box (220L), SCUDO Combinato (220P), ULYSSE (220)	
FORD ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW), ORION III (GAL), TOURNEO CONNECT, TRANSIT CONNECT (P65_, P70_, P80_)		VAUXHALL ASTRA MK IV Convertible, ASTRA Mk IV Estate, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, ASTRA TwinTop, CORSA Mk III, MERIVA, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II		HONDA S2000 (AP)	
TOYOTA AVENSIS (T25), AVENSIS Estate (T25), AVENSIS Saloon (T25)		BMW Z4 (E85)		LANCIA ZETA (220)	
VOLVO 850 (LS), 850 Estate (LW)		CHRYSLER NEON II		PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 806 (221), BOXER Box (230L), BOXER Box (244), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis, PARTNER Box (5), PARTNER Combispace (5F)	
MVB1428R6 CHRYSLER STRATUS (JA), STRATUS Convertible (IX)		CITROËN BERLINGO (MF), BERLINGO Box, BERLINGO Box (M_), C5 (DC_), C5 Break (DE_), XANTIA (X2), XANTIA Break (X2), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68)		SUZUKI GRAND VITARA (FT, GT)	
DODGE STRATUS		FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), KA (RB_)		MVB1475R7 TOYOTA HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_), HILUX Pickup (L_N_)	
FORD GALAXY (WGR), TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_)		PEUGEOT 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), PARTNER Box (5), PARTNER Combispace (5F)		MVB1488R4 FORD TRANSIT Box (E_), TRANSIT Bus (E_), TRANSIT Flatbed / Chassis (E_)	
RENAULT LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_)		ROVER 200 Coupe (XW), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), 600 (RH), 800 (XS), 800 Hatchback (XS)		MVB1488R6 PEUGEOT 406 (8B), 406 Break (8E/F), 406 Coupe (8C)	
VOLVO 850 (LS), 850 Estate (LW), S70 (P80_), S80 (TS, XY), V70 I Estate (P80_), V70 II Estate (P80_)		SEAT CORDOBA (6L2), IBIZA IV (6L1)		TOYOTA COROLLA (E11_), COROLLA Compact (E11_)	
MVB1432R5 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A6 (4B, C5), A6 Avant (4B, C5)		SKODA FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), PRAKTIK, ROOMSTER (5I)			
SKODA SUPERB (3U4)		VW FOX (5Z1), POLO (9N_)			
VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)		MVB1460R6 BMW 3 (E90), 3 Convertible (E46), 3 Coupe (E46), 3 Coupe (E92), Z3, Z3 Coupe, Z4 (E85), Z4 Coupe			
		HONDA ACCORD VI (CE, CF), ACCORD VII (CG), ACCORD VII Hatchback (CH), CIVIC V Aerodeck (MC), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK13/4)			
		LAND ROVER FREELANDER (LN), FREELANDER Soft Top			
		MG MG ZR, MG ZS, MG ZS Hatchback			
		OPEL ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon,			







					
VW	COROLLA Liftback (E11), COROLLA Wagon (E11) LUPO (6X1, 6E1)	VW	COROLLA Wagon (E11), RAV 4 II (XA2) BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5)	FORD	XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68) SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)
MVB1500R5	CHRYSLER SEBRING Coupe ROVER 800 (XS), 800 Coupe, 800 Hatchback (XS)	MVB1540R4	RENAULT CLIO II (BB0/1/2, CB0/1/2), CLIO II Box (SB0/1/2), KANGOO (KC0/1), KANGOO Express (FC0/1), THALIA (LB0/1/2)	LAND ROVER	FREELANDER (LN)
MVB1510R4	FORD TRANSIT Box (E), TRANSIT Box (T), TRANSIT Bus (E), TRANSIT Flatbed / Chassis (E), TRANSIT Flatbed / Chassis (T)	MVB1550R5	ALFA ROMEO 159, 159 Sportwagon FIAT CROMA (194) OPEL ASTRA G Convertible, ASTRA G Coupe (F07), ASTRA G Estate (F35), ASTRA G Hatchback (F48, F08), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, CORSA D, MERIVA, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA, ZAFIRA (F75)	MG	MG ZS, MG ZS Hatchback, MG ZT, MG ZT-T
MVB1513R6	BMW 3 (E36), 3 Convertible (E36), 3 Coupe (E36), Z3, Z3 Coupe HYUNDAI ELANTRA (XD), ELANTRA Saloon (XD), GRANDEUR, SANTA FE (CM), SANTA FE (SM), SONATA V, TRAJET (FO), TUCSON (JM) KIA CARENS II (FJ), CARENS III, CERATO, CERATO Saloon, MAGENTIS, SPORTAGE (JE)	SUZUKI	BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), GRAND VITARA, GRAND VITARA (FT, GT), VITARA (ET, TA), VITARA Cabrio (ET, TA)	PEUGEOT	206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), BIPPER (AA), PARTNER Box (5), PARTNER Combispace (5F)
MVB1515R5	RENAULT CLIO II (BB0/1/2, CB0/1/2), CLIO II Box (SB0/1/2), KANGOO (KC0/1), KANGOO Express (FC0/1)	VAUXHALL	ASTRA MK IV Convertible, ASTRA Mk IV Estate, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, ASTRA TwinTop, CORSA Mk II, MERIVA, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II	ROVER	45 (RT), 45 Saloon (RT), 75 (R), 75 Tourer (R)
MVB1520R4	FORD TRANSIT Box (E), TRANSIT Box (T), TRANSIT Bus (E), TRANSIT Bus (T), TRANSIT Flatbed / Chassis (E), TRANSIT Flatbed / Chassis (T)	MVB1550R6	BMW 1 (E81, E87), 1 Convertible (E88), 1 Coupe (E82), 3 (E36), 3 Compact (E36), 3 Convertible (E36), 3 Coupe (E36), 3 Touring (E36), 5 (E34), 5 (E39), 5 (E60), 5 Touring (E34), 5 Touring (E39), 5 Touring (E61), 6 (E63), 6 Convertible (E64), 7 (E38), 7 (E65, E66), X5 (E53), Z3, Z3 Coupe ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GF), FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW) QUATTROPORTE III	TOYOTA	AVENSIS (T22), AVENSIS Liftback (T22), AVENSIS Station Wagon (T22), COROLLA (E11), COROLLA Compact (E11), COROLLA Liftback (E11), COROLLA Verso (ZER, ZZE), COROLLA Wagon (E11)
MVB1520R6	FORD FOCUS C-MAX, FOCUS II (DA), FOCUS II Saloon (DA), FOCUS II Turnier (DAW) SKODA OCTAVIA (1U2) VW LUPO (6X1, 6E1)	FORD	MASERATI 911 (964) PORSCHE 911 (964) RENAULT 19 I (B/C53), 19 I Box (S53), 19 I Chamade (L53), 19 II (B/C53), 19 II Box (S53), 19 II Chamade (L53) ROVER 800 (XS), 800 Coupe, 800 Hatchback (XS) SEAT LEON (1M1), LEON (1P1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5) VOLVO 440 K (445), 460 L (464), 480 E, V70 I Estate (P80), V70 II Estate (P80) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	CHRYSLER 300 M (LR) FORD GALAXY (WGR)	
MVB1530R6	KIA CERATO Saloon OPEL ASTRA F (56, 57), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51, 52), ASTRA F Hatchback (53, 54, 58, 59), ASTRA G Estate (F35), CORSA B (73, 78, 79, F35), TIGRA (95), VECTRA B (36), VECTRA B Estate (31), VECTRA B Hatchback (38) TOYOTA COROLLA Verso (E12) VAUXHALL ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CORSA, TIGRA, VECTRA, VECTRA Estate, VECTRA Hatchback	MASERATI 911 (964) PORSCHE 911 (964) RENAULT 19 I (B/C53), 19 I Box (S53), 19 I Chamade (L53), 19 II (B/C53), 19 II Box (S53), 19 II Chamade (L53) ROVER 800 (XS), 800 Coupe, 800 Hatchback (XS) SEAT LEON (1M1), LEON (1P1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5) VOLVO 440 K (445), 460 L (464), 480 E, V70 I Estate (P80), V70 II Estate (P80) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	LANCIA PHEDRA (179) PEUGEOT 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 607 (9D, 9U), 807 (E) RENAULT AVANTIME (DE0), CLIO II (BB0/1/2, CB0/1/2), LAGUNA II (BG0/1), LAGUNA II Grandtour (KG0/1)		
MVB1538R6	BMW 3 (E46), 3 Compact (E46), 3 Convertible (E46), 3 Coupe (E46), 3 Touring (E46), 5 (E39), 5 (E60), 5 Touring (E39), 5 Touring (E61), 7 (E38), 7 (E65, E66), X3 (E83), X5 (E53), Z3, Z3 Coupe FORD ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), FIESTA III (GF), ORION III (GAL) FORD USA PROBE I TOYOTA CELICA (ZZT23), COROLLA (E11), COROLLA Compact (E11), COROLLA Liftback (E11), COROLLA Verso (E12)	BMW 1 (E81, E87), 1 Convertible (E88), 1 Coupe (E82), 3 (E36), 3 Compact (E36), 3 Convertible (E36), 3 Coupe (E36), 3 Touring (E36), 5 (E34), 5 (E39), 5 (E60), 5 Touring (E34), 5 Touring (E39), 5 Touring (E61), 6 (E63), 6 Convertible (E64), 7 (E38), 7 (E65, E66), X5 (E53), Z3, Z3 Coupe ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GF), FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW) QUATTROPORTE III MASERATI 911 (964) PORSCHE 911 (964) RENAULT 19 I (B/C53), 19 I Box (S53), 19 I Chamade (L53), 19 II (B/C53), 19 II Box (S53), 19 II Chamade (L53) ROVER 800 (XS), 800 Coupe, 800 Hatchback (XS) SEAT LEON (1M1), LEON (1P1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5) VOLVO 440 K (445), 460 L (464), 480 E, V70 I Estate (P80), V70 II Estate (P80) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	LANCIA Y (840A)		
				MVB1575R5	LANCIA Y (840A)
				MVB1580R6	ALFA ROMEO 159, 159 Sportwagon, BRERA, SPIDER CITROËN C5 (DC), C5 (RC), C5 Break (DE), C5 Break (RE), C8 (EA, EB) DAIHATSU MATERIA (M4) FIAT ULYSSE (179AX) KIA CARNIVAL (UP), CARNIVAL II LANCIA PHEDRA (179) PEUGEOT 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 607 (9D, 9U), 807 (E) RENAULT AVANTIME (DE0), CLIO II (BB0/1/2, CB0/1/2), LAGUNA II (BG0/1), LAGUNA II Grandtour (KG0/1)
				MVB1580R7	LAND ROVER DEFENDER (LD), DEFENDER Station Wagon (LD), DISCOVERY II (LI, LI)
				MVB1588R6	AUDI A4 (8E2, B6), A4 (8K2), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A5, A6 (4B, C5), A6 Avant (4B, C5) CITROËN C5 (RD), C5 Break (TD), C6 (TD) FORD MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP) OPEL ASTRA G Estate (F35), ASTRA G Hatchback (F48, F08), ASTRA G Saloon (F69), COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W5L), MERIVA PEUGEOT 407 (6D), 407 Coupe (6C), 407 SW (6E), 607 (9D, 9U) RENAULT CLIO II (BB0/1/2, CB0/1/2), LAGUNA II (BG0/1), LAGUNA II Grandtour (KG0/1) SUBARU LEGACY IV, LEGACY IV Estate (B13), OUTBACK VAUXHALL ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, COMBO, CORSA Mk II, CORSAVAN MK II



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







 	 	 
VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	CITROËN TT Roadster (8J9) XANTIA (X1), XANTIA (X2), XANTIA Break (X2), XM (Y4), XM Break (Y4)	MBV1650R6 CITROËN XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y4), XM Break (Y4)
MBV1588R7 TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), AVENSIS VERSO (AC_), PREVIA (ACR3_), RAV 4 II (XA2), RAV 4 III (ACA_ , ACE_)	HONDA CIVIC VI Hatchback (EU_ , EP_) OPEL ASTRA H, ASTRA H Estate, ASTRA H GTC VAUXHALL ASTRA Mk IV Estate, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, ASTRAVAN Mk IV	FORD ESCORT '95 Box (AVL), ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GF)
MBV1590R5 ALFA ROMEO 159, 159 Sportwagon AUDI A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4B, C5), A6 Avant (4B, C5) FIAT BRAVA (182), BRAVO (182) KIA CARNIVAL (UP), CARNIVAL II, CARNIVAL III (UVP_) LANCIA Y (840A) SAAB 9000, 9000 Hatchback VW PASSAT (3B2), PASSAT Variant (3B5)	VOLVO 850 (LS), 850 Estate (LW), 960 (964), 960 II (964), 960 II Estate (965), 960 Kombi (965), S40 I (VS), V40 Estate (VW) VW EOS, GOLF V (1K1), PASSAT (3C2), PASSAT Variant (3C5)	VW CORRADO (531), GOLF II (19E, 1G1), PASSAT (3A2, 351), PASSAT Variant (3A5, 351)
MBV1600R6 CHRYSLER 300 M (LR), PT CRUISER (PT_) CITROËN EVASION (22, U6), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2) FIAT ULYSSE (220) LANCIA ZETA (220) OPEL ASTRA G Estate (F35_), ASTRA G Hatchback (F48_ , F08_), ASTRA G Saloon (F69_), COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W51), MERIVA PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 605 (6B), 806 (221) RENAULT ESPACE III (JEO_), LAGUNA (B56_ , 556_), LAGUNA Grandtour (K56_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), SAFRANE II (B54_), SCENIC (JA0/1_) VAUXHALL ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, CORSA Mk II, MERIVA VW GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, TOURAN (1T1, 1T2)	MBV1635R6 AUDI 80 (8C, B4), 80 Avant (8C, B4), A6 (4A, C4), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), CABRIOLET (8G7, B4) FORD ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ORION III (GAL), TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_) SUZUKI GRAND VITARA (FT, GT), VITARA (ET, TA)	MBV1660R6 AUDI A3 (8L1) BMW 3 (E36), 3 Compact (E36), 3 Convertible (E36), 3 Coupe (E36), 5 (E34), 5 Touring (E34) CHEVROLET BLAZER S10 CITROËN BERLINGO (MF), BERLINGO Box (M_), EVASION (22, U6), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y4), XM Break (Y4), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2) FIAT ULYSSE (220) LANCIA ZETA (220) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 405 II (4B), 405 II Break (4E), 406 (8B), 406 Break (8E/F), 605 (6B), 806 (221), EXPERT (224), EXPERT Box (222), PARTNER CombiSpace (5F) RENAULT CLIO II (BB0/1/2_ , CB0/1/2_), ESPACE III (JEO_), LAGUNA (B56_ , 556_), LAGUNA Grandtour (K56_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_) SEAT CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), INCA (6K9), LEON (1M1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5) VW BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5)
MBV1605R7 BMW 5 (E34), 5 Touring (E34), 7 (E32), 7 (E38), 8 (E31) LAND ROVER DEFENDER (LD), DEFENDER Station Wagon (LD), DISCOVERY II (LJ, LT) MAZDA XEDOS 9 (TA)	MBV1635R7 BMW 5 (E39), 5 Touring (E39), 7 (E38), 8 (E31), X5 (E53) LAND ROVER RANGE ROVER III (LM)	MBV1638R5 SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), GRAND VITARA, GRAND VITARA (FT, GT), VITARA (ET, TA), VITARA Cabrio (ET, TA)
MBV1610R5 SAAB 9000, 9000 Hatchback	MBV1638R7 HONDA CIVIC VI Hatchback (EU_ , EP_), CIVIC VII Hatchback (FD_) NISSAN PATROL GR II (Y61), TERRANO II (R20) TOYOTA LAND CRUISER (J12), LAND CRUISER 90 (J9_)	SEAT TOLEDO II (1M2)
MBV1613R6 AUDI A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4F2), A6 Avant (4F5) FIAT REGATA (138), REGATA Weekend FORD FIESTA Box (J5_ , J3_), FIESTA Box (JV_), FIESTA IV (JA_ , JB_) LANCIA PRISMA (831AB0) OPEL CORSA D VAUXHALL CORSA Mk III VOLVO S40 I (VS), V40 Estate (VW) VW PASSAT (3C2), PASSAT Variant (3C5)	MBV1642R6 ARO 10 BMW 1 (E81, E87), 3 (E46), 3 Compact (E46), 3 Convertible (E46), 3 Coupe (E46), 3 Touring (E46), Z4 (E85) FORD MONDEO III (B5Y), MONDEO III Estate (BWY), MONDEO III Saloon (B4Y), TRANSIT Box (FA_), TRANSIT Bus (FD_ , FB_ , FS_ , FZ_ , FC_), TRANSIT Flatbed / Chassis (FM_ , FN_) JAGUAR X-TYPE (CF1), X-TYPE Estate MITSUBISHI CARISMA (DA_), CARISMA Saloon (DA_) RENAULT ESPACE III (JEO_), LAGUNA (B56_ , 556_), LAGUNA Grandtour (K56_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), SCENIC (JA0/1_) SUBARU OUTBACK (BE, BH) VOLVO 960 (964), 960 II (964), 960 II Estate (965), 960 Kombi (965), S40 I (VS), S90, V40 Estate (VW), V90 Estate VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE)	MBV1675R6 AUDI 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), A8 (4D2, 4D8), CABRIOLET (8G7, B4), COUPE (89, 8B) CITROËN BERLINGO Box (M_), JUMPER Box, JUMPER Bus, JUMPER Flatbed / Chassis, JUMPY (U6U), JUMPY Box (BS_ , BT_ , BY_ , BZ_) FIAT DUCATO Box, DUCATO Bus, DUCATO Flatbed / Chassis, SCUDO Combinato (220P) FORD ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL),






					
PEUGEOT	ABL, ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (IV_), FIESTA III (GFJ), TRANSIT Box, TRANSIT Bus, TRANSIT Flatbed / Chassis, TRANSIT TOURNEO BOXER Box, BOXER Bus, BOXER Flatbed / Chassis, EXPERT Box (222), EXPERT Flatbed / Chassis, EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispacer (5F)	MVB1700R6 CITROËN	BERLINGO, BERLINGO Box, XANTIA (X1), ZX (N2), ZX Break (N2)	MVB1715R7	ALFA ROMEO 155 (167), 164 (164) LANCIA THEMA (834) LAND ROVER DEFENDER (LD), DEFENDER Pickup (LD.), DEFENDER Station Wagon (LD), DISCOVERY II (LJ, LT)
PROTON	GEN 2 (CM_)	FORD	FIESTA V (JH_, JD_), FIESTA Van, KA (RB_), STREET KA	MVB1725R5	MERCEDES-BENZ A-CLASS (W168), Vaneo (414)
SKODA	FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5)	HYUNDAI	COUPE (GK), HIGHWAY VAN, SONATA IV (EU4), TRAJET (FO)	MVB1725R6	AUDI A6 (4A, C4), A6 Avant (4A, C4) CHEVROLET LACETTI, REZZO CITROËN XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y4), XM Break (Y4), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68)
TOYOTA	COROLLA (_E12U_, _E12J_), COROLLA Estate (_E12L_, _E12T_), COROLLA Saloon (_E12L_, _E12T_), COROLLA Verso (_E12J_)	KIA	MAGENTIS (GD)	DAEWOO	LACETTI Hatchback (KLAN), NUBIRA (KLAJ), NUBIRA Saloon (KLAN), NUBIRA Saloon (KLAN), NUBIRA Wagon (KLAJ), NUBIRA Wagon (KLAN), REZZO (KLAU)
VOLVO	850 (LS), 850 Estate (LW)	PEUGEOT	206 Hatchback (2A/C), 306 (7B, N3, N5), 405 II (4B), 405 II Break (4E), PARTNER Box, PARTNER Tepee	LADA	110
MVB1675R7	LANCIA THEMA (834)	TOYOTA	AURIS, COROLLA Saloon (_E12L_, _E12T_)	OPEL	ASTRA F (56_, 57_), ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), FRONTERA A (5_MWL4), FRONTERA B (6B_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), SINTRA, VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_)
MVB1680R5	HYUNDAI TERRACAN (HP) OPEL ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, SPEEDSTER, ZAFIRA, ZAFIRA (F75_)	VW	GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), TIGUAN, TOURAN (1T1, 1T2)	PEUGEOT	206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 605 (6B), 806 (221) 9-5 (YS3E), 9-5 Estate (YS3E)
MVB1685R6	AUDI 100 (4A, C4), 100 Avant (4A, C4) BMW 1 (E81, E87) FORD FIESTA Box (J5_, J3_), FIESTA Box (JV_), FIESTA IV (JA_, JB_), FIESTA V (JH_, JD_), FIESTA Van, GALAXY, MONDEO IV, MONDEO IV Turnier, S-MAX RENAULT LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_) VOLVO 850 (LS), 850 Estate (LW), S70 (P80_), S80 (TS, XY), V70 I Estate (P80_), V70 II Estate (P80_) VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE)	FIAT	SCUDO, SCUDO Box, SCUDO Box (220L), SCUDO Combinato (220P), SCUDO Flatbed / Chassis, ULYSSE (179AX), ULYSSE (220)	SAAB	BALENO (EG), BALENO Hatchback (EG)
MVB1690R6	AUDI 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4) HYUNDAI TUCSON (JM) KIA SPORTAGE (JE_) LANCIA KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), THESIS (841AX) RENAULT 19 I (B/C53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_) TOYOTA COROLLA (_E12U_, _E12J_), MR 2 (_W3_) VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	FORD	FIESTA V (JH_, JD_), FIESTA Van, FUSION (JU_) LANCIA PHEDRA (179), ZETA (220) MAZDA 2 (B2W) PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 407 (6D_), 407 SW (6E_), 607 (9D, 9U), 806 (221), 807 (E), BIPPER (AA_), EXPERT (224), EXPERT Box (222), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_), PARTNER Box, PARTNER Box (5), PARTNER Combispacer (5F), PARTNER Tepee	VAUXHALL	ASTRA Mk II Convertible, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, FRONTERA, FRONTERA Mk II, FRONTERA Sport, OMEGA, OMEGA Estate, SINTRA, VECTRA, VECTRA Estate, VECTRA Hatchback
MVB1698R6D	BMW 1 (E81, E87), 1 Convertible (E88), 1 Coupe (E82), 3 (E90), 3 Coupe (E92), 3 Touring (E91)	RENAULT	5 (122_), 21 (B48_), 21 Saloon (L48_), SUPER 5 (B/C40_), SUPER 5 Box (S40_)	MVB1730R7	HONDA CR-V II (RD_) HYUNDAI H-1 Box, H-1 Bus (KMF) KIA SORENTO (JC)
		MVB1715R6	DODGE CALIBER FORD FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), TOURNEO CONNECT, TRANSIT CONNECT (P65_, P70_, P80_) JEEP COMPASS, PATRIOT LANCIA KAPPA (838A), KAPPA SW (838B) MITSUBISHI GRANDIS, LANCER Saloon, OUTLANDER SUZUKI LIANA (ER), LIANA Estate (ER) VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	MVB1740R6	ALFA ROMEO 159, 159 Sportwagon, 166 (936) AUDI A3 (8P1), A3 Sportback (8PA), A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4B, C5), A6 Avant (4B, C5), ALLROAD (4BH) BMW 3 (E36), 3 (E46), 3 Compact (E36), 3 Convertible (E36), 3 Coupe (E36), 3 Coupe (E46), 3 Touring (E36), 3 Touring (E46), Z3 CITROËN BERLINGO (MF), BERLINGO Box (M_), C5 (DC_), C5 (RC_), C5 Break (DE_), C5 Break (RE_), C8 (EA_, EB_), C-CROSSER (EP_), EVASION (22, U6), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68), ZX (N2), ZX Break (N2)



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







  <p>FIAT DUCATO Bus (230), MAREA (185), MAREA Weekend (185), SCUDDO Box (220L), SCUDDO Combinato (220P), ULYSSE (179AX), ULYSSE (220)</p> <p>FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW)</p> <p>HYUNDAI LANTRA II (J-2), LANTRA II Wagon (J2)</p> <p>LANCIA KAPPA (838A), KAPPA SW (838B), PHEDRA (179), THESIS (841AX), ZETA (220)</p> <p>MAZDA 121 III (JASM, JBSM)</p> <p>MINIBUS OUTLANDER</p> <p>PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 607 (9D, 9U), 806 (221), 807 (E), 4007 (GP_), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis, EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F)</p> <p>RENAULT SAFRANE I (B54_)</p> <p>SEAT CORDOBA (6L2), IBIZA IV (6L1)</p> <p>SKODA FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), OCTAVIA (1Z3), OCTAVIA Combi (1Z5), ROOMSTER (5I)</p> <p>SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG)</p> <p>VOLVO 850 (LS), 850 Estate (LW), C70 Convertible, C70 Coupe, S70 (P80_), V70 I Estate (P80_), V70 II Estate (P80_)</p> <p>VW EOS, GOLF V (1K1), GOLF V PLUS (5M1), GOLF Variant, JETTA III (1K2), PASSAT (3C2), PASSAT Variant (3C5), POLO (9N_), TOURAN (1T1, 1T2)</p>	  <p>LAND ROVER DISCOVERY I, DISCOVERY II (LJ, LT)</p> <p>MAZDA 121 III (JASM, JBSM)</p> <p>PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 806 (221), EXPERT Box (222), EXPERT Flatbed / Chassis, EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F)</p> <p>RENAULT CLIO II (BB0/1/2_, CB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), THALIA (LB0/1/2_)</p> <p>VOLVO 960 (964), 960 II (964), 960 II Estate (965), 960 Kombi (965), S40 I (VS), S90, V40 Estate (VW), V90 Estate</p> <p>VW CORRADO (53I), GOLF II (19E, 1G1), LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	  <p>MAZDA 121 III (JASM, JBSM)</p> <p>MERCEDES-BENZ C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C208), CLK Convertible (A208), E-CLASS (W210), E-CLASS Estate (S210), SLK (R170)</p> <p>MINIBUS LANCER VI (CK/P_A)</p> <p>RENAULT AVANTIME (DEO_), ESPACE III (JE0_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), VEL SATIS (BJ0_)</p> <p>TOYOTA COROLLA (E11_), COROLLA Compact (E11_), COROLLA Liftback (E11_), COROLLA Wagon (E11_)</p>
<p>MVB1745R5</p> <p>HYUNDAI MATRIX (FC)</p> <p>KIA CERATO, CERATO Saloon</p> <p>MERCEDES-BENZ A-CLASS (W169), B-CLASS (W245)</p>	<p>MVB1760R6</p> <p>ALFA ROMEO 156 (932), 156 Sportwagon (932)</p> <p>AUDI A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8)</p> <p>CHEVROLET TRANS SPORT</p> <p>FIAT BARCHETTA (183), MAREA (185), MAREA Weekend (185), PUNTO (188)</p> <p>FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), KA (RB_)</p> <p>JEEP WRANGLER I (YJ, SJ), WRANGLER II (TJ)</p> <p>LANCIA LYBRA (839AX), LYBRA SW (839BX)</p> <p>MERCEDES-BENZ C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C208), CLK Convertible (A208), E-CLASS (W210), E-CLASS Estate (S210)</p> <p>TOYOTA YARIS</p> <p>VOLVO S40 I (VS), V40 Estate (VW)</p> <p>VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)</p>	<p>MVB1775R7</p> <p>HONDA STREAM (RN)</p> <p>LAND ROVER DISCOVERY II (LJ, LT)</p> <p>RENAULT ESPACE IV (JK0/1_)</p>
<p>MVB1750R5</p> <p>DACIA LOGAN, LOGAN MCV, SOLENZA</p> <p>MERCEDES-BENZ A-CLASS (W168), Vaneo (414)</p> <p>RENAULT CLIO II (BB0/1/2_, CB0/1/2_), ESPACE III (JE0_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), LOGAN (LS_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), SCENIC (JA0/1_), THALIA (LB0/1/2_)</p>	<p>MVB1760R7</p> <p>BMW 7 (E65, E66)</p> <p>HONDA ACCORD VIII (CL_, CM_), ACCORD VIII Tourer (CM_), CIVIC VI Hatchback (EU_, EP_)</p>	<p>MVB1785R7</p> <p>RENAULT ESPACE IV (JK0/1_)</p> <p>MVB1788R7</p> <p>NISSAN INTERSTAR Box (X70), INTERSTAR Bus (X70), INTERSTAR Flatbed / Chassis, PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P12)</p> <p>OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumpertruck (H9), MOVANO Flatbed / Chassis (U9, E9), VIVARO Box (F7), VIVARO Combi (J7), VIVARO Flatbed / Chassis (E7)</p> <p>RENAULT LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD), MASTER III Box (HD, FD), MASTER III Bus (JD), MASTER III Flatbed / Chassis (ED, UD), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL), VEL SATIS (BJ0_)</p> <p>VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD), VIVARO Box, VIVARO Flatbed / Chassis</p>
<p>MVB1755R6</p> <p>ALFA ROMEO 156 (932)</p> <p>CITROËN BERLINGO (MF), BERLINGO Box (M_), C5 (DC_), C5 Break (DE_), EVASION (22, U6), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XANTIA (X2), XANTIA Break (X2), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0)</p> <p>FIAT ULYSSE (220)</p> <p>FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), PUMA (EC_), SCORPIO II (GFR, GGR), SCORPIO II Estate (GNR, GGR)</p> <p>LANCIA ZETA (220)</p>	<p>MVB1765R5</p> <p>MERCEDES-BENZ A-CLASS (W169), B-CLASS (W245)</p> <p>MVB1768R6</p> <p>FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), PUMA (EC_)</p> <p>TOYOTA YARIS (CP10)</p> <p>VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	<p>MVB1790R5</p> <p>KIA PICANTO (BA)</p> <p>MINIBUS COLT VI</p> <p>ROVER 800 (XS), 800 Coupe, 800 Hatchback (XS)</p> <p>MVB1795R6</p> <p>ALFA ROMEO 145 (930), 146 (930)</p> <p>BMW 1 (E81, E87), 1 Convertible (E88), 1 Coupe (E82)</p> <p>FIAT BARCHETTA (183), BRAVA (182), BRAVO (182), PUNTO (188)</p> <p>FORD USA PROBE I</p> <p>MINIBUS CARISMA (DA_), CARISMA Saloon (DA_), LANCER Saloon (CS_A), SPACE STAR (DGO)</p> <p>NISSAN INTERSTAR Box (X70), INTERSTAR Bus (X70), INTERSTAR Flatbed / Chassis, PRIMASTAR Box (X83), PRIMASTAR Bus (X83)</p> <p>OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumpertruck (H9), MOVANO Flatbed / Chassis (U9, E9), VIVARO Box (F7), VIVARO Combi (J7), VIVARO Flatbed / Chassis (E7)</p> <p>RENAULT AVANTIME (DEO_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD), MASTER III Box (HD, FD), MASTER III Bus (JD),</p>
<p>MVB1775R4</p> <p>TOYOTA YARIS (CP10)</p> <p>MVB1775R6</p> <p>ALFA ROMEO 145 (930), 146 (930)</p> <p>FIAT BRAVA (182), BRAVO (182)</p> <p>FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), PUMA (EC_), TRANSIT Box (FA_), TRANSIT Bus (E_), TRANSIT Bus (FD_, FB_, FS_, FZ_, FC_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (FM_, FN_)</p>	<p>MVB1775R4</p> <p>TOYOTA YARIS (CP10)</p> <p>MVB1775R6</p> <p>ALFA ROMEO 145 (930), 146 (930)</p> <p>FIAT BRAVA (182), BRAVO (182)</p> <p>FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), PUMA (EC_), TRANSIT Box (FA_), TRANSIT Bus (E_), TRANSIT Bus (FD_, FB_, FS_, FZ_, FC_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (FM_, FN_)</p>	<p>MVB1775R4</p> <p>TOYOTA YARIS (CP10)</p> <p>MVB1775R6</p> <p>ALFA ROMEO 145 (930), 146 (930)</p> <p>FIAT BRAVA (182), BRAVO (182)</p> <p>FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), PUMA (EC_), TRANSIT Box (FA_), TRANSIT Bus (E_), TRANSIT Bus (FD_, FB_, FS_, FZ_, FC_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (FM_, FN_)</p>







  <p>MASTER III Flatbed / Chassis (ED, UD), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL), VEL SATIS (BJ0_) VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD), VIVARO Box, VIVARO Combi VOLVO S40 I (VS), S80 (TS, XY), V40 Estate (VW), V70 I Estate (P80_), V70 II Estate (P80_)</p>	  <p>LAND ROVER RANGE ROVER II (LP) OPEL OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_) VAUXHALL OMEGA, OMEGA Estate MBV1817R6D BMW 1 (E81, E87), 1 Convertible (E88), 1 Coupe (E82), 3 (E90), 3 Coupe (E92), 3 Touring (E91), 5 (E60), 5 Touring (E61), X3 (E83)</p>	  <p>TOYOTA COROLLA (_E11_), COROLLA Compact (_E11_), COROLLA Liftback (_E11_), COROLLA Wagon (_E11_) MBV1850R5 BMW 5 (E39), 5 Touring (E39), 7 (E38) HYUNDAI MATRIX (FC) KIA CERATO, CERATO Saloon MBV1850R6D VOLVO C70 Convertible, C70 Coupe, S70 (P80_), V70 I Estate (P80_), V70 II Estate (P80_), XC70 CROSS COUNTRY</p>
<p>MBV1800R5 HYUNDAI ACCENT (MC), ACCENT Saloon (MC), i30, i30 CW Estate KIA CEE'D Estate, CEE'D Hatchback, CERATO, CERATO Saloon, PRO CEE'D, RIO II, RIO II Saloon</p>	<p>MBV1820R6 DACIA LOGAN, LOGAN MCV DAIHATSU TERIOS (J2) FIAT BARCHETTA (183), DOBLO (119), DOBLO Cargo (223), PALIO Weekend (178DX), PUNTO (188), STRADA (178E) FORD COUGAR (EC_), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), FIESTA III (GF), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), ORION III (GAL), SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)</p>	<p>MBV1855R6 ALFA ROMEO 145 (930), 146 (930), 147 (937), 156 (932), 156 Sportwagon (932), GTV (916C_), SPIDER (916S_) AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), ALLROAD (4BH) FIAT BRAVA (182), BRAVO (182), COUPE (FA/175), MAREA (185), MAREA Weekend (185), STRADA (178E) JEEP CHEROKEE, CHEROKEE (XJ) MERCEDES-BENZ 190 (W201), G-CLASS (W461), G-CLASS (W463), G-CLASS Cabrio (W463) OPEL FRONTERA B (6B_) VAUXHALL FRONTERA Mk II</p>
<p>MBV1800R7 LAND ROVER DEFENDER (LD), DEFENDER Pickup (LD_), DEFENDER Station Wagon (LD), DISCOVERY II (LJ, LT)</p>	<p>RENAULT LAGUNA II (BGO/1_), LAGUNA II Grandtour (KG0/1_) TOYOTA COROLLA (_E11_), COROLLA Compact (_E11_), COROLLA Liftback (_E11_), COROLLA Verso (_E12_), COROLLA Wagon (_E11_) MBV1825R6D VOLVO C70 Convertible, C70 Coupe, S60, S70 (P80_), S80 (TS, XY), S80 II, V70 I Estate (P80_), V70 II Estate (P80_), XC90</p>	<p>MBV1855R7 BMW 1 Convertible (E88), 1 Coupe (E82), 3 (E90), 3 Convertible (E93), 3 Coupe (E92), 3 Touring (E91) CHRYSLER VIPER, VIPER Convertible LAND ROVER DISCOVERY I, DISCOVERY II (LJ, LT) MBV1865R6 AUDI 80 (8C, B4), 80 Avant (8C, B4), A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 Avant (4A, C4), A8 (4D2, 4D8), CABRIOLET (8G7, B4), COUPE (89, 8B) CITROËN XM (Y4), XM Break (Y4) MERCEDES-BENZ C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C208), CLK Convertible (A208), E-CLASS (W210), E-CLASS Estate (S210) OPEL SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA (F75_) PEUGEOT 605 (6B) VAUXHALL SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA</p>
<p>MBV1805R6 FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) JEEP CHEROKEE (XJ), GRAND CHEROKEE I (Z), WRANGLER I (Y), SJ_, WRANGLER II (T) OPEL ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), ASTRA G Box (F70), ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), COMBO (71_), CORSA B (73_, 78_, 79_, F35_), CORSA B Box (73_), FRONTERA B (6B_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), SIGNUM, SINTRA, TIGRA (95_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_), VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA (F75_) RENAULT LAGUNA II (BGO/1_), LAGUNA II Grandtour (KG0/1_) SAAB 9-3 (YS3D), 9-3 Cabriolet (YS3D) VAUXHALL ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRAVAN Mk III, ASTRAVAN Mk IV, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, FRONTERA Mk II, OMEGA, OMEGA Estate, SIGNUM, SINTRA, TIGRA, VECTRA, VECTRA Estate, VECTRA Hatchback, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA</p>	<p>MBV1833R6 ALFA ROMEO 147 (937), 156 (932), 156 Sportwagon (932), GT 1 (E81, E87), 3 (E90), 3 Convertible (E93), 3 Coupe (E92), 3 Touring (E91), Z4 (E85), Z4 Coupe BMW EPICA (KL1_) CHEVROLET BRAVA (182), BRAVO (182), MAREA (185), MAREA Weekend (185), MULTIPLA (186) FIAT LYBRA (839AX), LYBRA SW (839BX) LANCIA LANCER Estate (CS_W), LANCER Saloon (CS_A), OUTLANDER MITSUBISHI VIVARO Box (F7), VIVARO Combi (J7) OPEL MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL) RENAULT VIVARO Box, VIVARO Combi</p>	<p>MBV1870R7 LAND ROVER DISCOVERY I, DISCOVERY II (LJ, LT), RANGE ROVER II (LP) LEXUS IS TOYOTA AURIS, RAV 4 III (ACA_, ACE_) MBV1875R6 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4A, C4), A6 (4B, C5), A6 (4F2), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8) BMW 1 (E81, E87), 3 (E46), 3 (E90), 3 Compact (E46), 3 Convertible (E46), 3 Coupe (E46), 3 Coupe (E92), 3 Touring (E46), 3 Touring (E91), X3 (E83), Z4 (E85) CHEVROLET AVEO Saloon, KALOS, KALOS Saloon, LACETTI, LOVA, NUBIRA Estate, NUBIRA Saloon, REZZO</p>
<p>MBV1813R7 LAND ROVER DISCOVERY II (LJ, LT) TOYOTA LAND CRUISER (J12), LAND CRUISER 90 (_J9_)</p>	<p>MBV1838R6D VOLVO C70 Convertible, C70 Coupe, S40 I (VS), S60, S70 (P80_), S80 (TS, XY), V40 Estate (VW), V70 I Estate (P80_), V70 II Estate (P80_), XC90, XC70 CROSS COUNTRY</p>	<p>MBV1842R6 ALFA ROMEO 145 (930), 146 (930), 147 (937), 155 (167), 156 (932), 156 Sportwagon (932), GT FIAT BARCHETTA (183), BRAVA (182), BRAVO (182), COUPE (FA/175), MAREA (185), MAREA Weekend (185), PUNTO (188) LANCIA Y (840A) MAZDA 2</p>
<p>MBV1815R5 BMW 3 (E36), 3 Touring (E36), 5 (E34), 5 (E39), 5 Touring (E34), 5 Touring (E39) CHRYSLER LE BARON, LE BARON Convertible, VOYAGER I (ES)</p>	<p>MBV1842R6 ALFA ROMEO 145 (930), 146 (930), 147 (937), 155 (167), 156 (932), 156 Sportwagon (932), GT FIAT BARCHETTA (183), BRAVA (182), BRAVO (182), COUPE (FA/175), MAREA (185), MAREA Weekend (185), PUNTO (188) LANCIA Y (840A) MAZDA 2</p>	<p>MBV1842R6 ALFA ROMEO 145 (930), 146 (930), 147 (937), 155 (167), 156 (932), 156 Sportwagon (932), GT FIAT BARCHETTA (183), BRAVA (182), BRAVO (182), COUPE (FA/175), MAREA (185), MAREA Weekend (185), PUNTO (188) LANCIA Y (840A) MAZDA 2</p>



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







					
DAEWOO	KALOS, KALOS (KLAS), LACETTI Hatchback (KLAN), NUBIRA (KLA), NUBIRA Saloon (KLA), NUBIRA Saloon (KLAN), NUBIRA Wagon (KLA), NUBIRA Wagon (KLAN), REZZO (KLAU)	FORD	NUBIRA Saloon (KLA), NUBIRA Wagon (KLA) ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), FIESTA Box (J5_, J3_), FIESTA III (GF), FIESTA IV (JA_, JB_), ORION III (GAL), SCORPIO II (GFR, GGR), SCORPIO II Estate (GNR, GGR)	VAUXHALL	MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD)
DAIHATSU	TERIOS (J2_)	MAZDA	121 III (JASM, JBSM)		MBV1930R6
MERCEDES-BENZ	C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C208), CLK Convertible (A208), E-CLASS (W210), E-CLASS Estate (S210), SLK (R170)	OPEL	ASTRA F (56_, 57_), ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), FRONTERA B (6B_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), SINTRA, VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_)		AUDI A8 (4E_) FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_, KA (RB_), PUMA (EC_), TRANSIT Box (E_), TRANSIT Bus (E_), TRANSIT Flatbed / Chassis (E_) LEXUS GS (JZS147), GS (JZS160), IS (GXE10), IS SportCross MAZDA 121 III (JASM, JBSM) PORSCHE 911 (996), 911 Convertible (996), BOXSTER (986) TOYOTA CELICA (ZZT23_), SUPRA (JZA80)
MITSUBISHI	GRANDIS	SAAB	9-3 (YS3D), 9-3 (YS3F), 9-5 (YS3E), 9-5 Estate (YS3E), 900 II, 900 II Convertible, 900 II Coupe		MBV1933R7
OPEL	ASTRA G Box (F70), ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA (F75_)	TOYOTA	AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_)		TOYOTA AVENSIS (T25), AVENSIS Estate (T25), AVENSIS Saloon (T25), CAMRY (_V30), LAND CRUISER (J12), LAND CRUISER 90 (_J9_), RAV 4 II (XA2)
SEAT	CORDOBA (6L2), IBIZA IV (6L1)	VAUXHALL	ASTRA Mk II Convertible, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, FRONTERA Mk II, OMEGA, OMEGA Estate, SINTRA, VECTRA, VECTRA Estate, VECTRA Hatchback		MBV1950R6
SKODA	FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), PRAKTIK, ROOMSTER (5J), SUPERB (3U4)				FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG), TRANSIT Box (FA_), TRANSIT Bus (FD_ , FB_ , FS_ , FZ_ , FC_), TRANSIT Flatbed / Chassis (FM_ , FN_)
TOYOTA	COROLLA Verso (ZER_, ZZE_)				MERCEDES-BENZ 190 (W201)
VAUXHALL	ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRAMAN Mk IV, SIGNUM, VECTRA Estate, VECTRA Hatchback, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS				RENAULT ESPACE III (JE0_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SAFRANE II (B54_)
VW	FOX (5Z1), LUPO (6X1, 6E1), PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6), POLO (9N_), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	MBV1910R7	FORD SCORPIO II (GFR, GGR), SCORPIO II Estate (GNR, GGR)		MBV1952R7
		TOYOTA	RAV 4 III (ACA_, ACE_)		ALFA ROMEO 145 (930), 146 (930), 155 (167), GTV (916C_), SPIDER (916S_)
MBV1885R5		MBV1913R6	FORD FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW)		LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836)
BMW	3 (E36), 3 Compact (E36), 3 Touring (E36)	FORD USA	TAURUS (P5_), TAURUS Wagon (P5_)		MBV1960R6
MBV1885R6		JEEP	WRANGLER II (TI)		ALFA ROMEO 147 (937), 156 (932), 156 Sportwagon (932), 166 (936), GT, GTV (916C_), SPIDER (916S_)
AUDI	A4 (8EC), A4 Avant (8ED)	TOYOTA	AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_)		FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)
BMW	X5 (E70)				LANCIA LYBRA (839AX), LYBRA SW (839BX)
CHEVROLET	CAPTIVA, EPICA (KL1_), EVANDA, LACETTI, NUBIRA Estate, NUBIRA Saloon, REZZO	MBV1920R6	AUDI A6 (4F2), A6 Avant (4B, C5), A6 Avant (4F5)		SUZUKI JIMNY (F)
CITROËN	C5 (RD_), C5 Break (TD_), C6 (TD_)	CHEVROLET	BLAZER S10, S10 Pick Up		MBV1969R7
DAEWOO	EVANDA (KLAL), LACETTI Hatchback (KLAN), LEGANZA (KLAV), NUBIRA (KLA), NUBIRA Saloon (KLA), NUBIRA Saloon (KLAN), NUBIRA Wagon (KLA), NUBIRA Wagon (KLAN), REZZO (KLAU)	FORD	ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GF)		ALFA ROMEO 145 (930), 156 (932), 164 (164), 166 (936), GTV (916C_), SPIDER (916S_)
FORD	FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW)	FORD USA	TAURUS (P5_), TAURUS Wagon (P5_)		CHRYSLER VIPER, VIPER Convertible
MERCEDES-BENZ	190 (W201), COUPE (C124), KOMBI Estate (S124), Saloon (W124), T1 Box (601), T1 Bus (601), T1 Flatbed / Chassis (601)	OPEL	SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS		LANCIA KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B)
MITSUBISHI	AIRTREK, OUTLANDER	RENAULT	ESPACE IV (JK0/1_), VEL SATIS (BJ0_)		NISSAN PRIMASTAR Box (X83), PRIMASTAR Bus (X83)
OPEL	ANTARA	SAAB	9-5 (YS3E), 9-5 Estate (YS3E)		OPEL VIVARO Box (F7), VIVARO Combi (J7), VIVARO Flatbed / Chassis (E7)
PEUGEOT	407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U)	VAUXHALL	SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS		RENAULT ESPACE IV (JK0/1_), LAGUNA II (BGO/1_), LAGUNA II Grandtour (KG0/1_), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL), VEL SATIS (BJ0_)
SAAB	9000, 9000 Hatchback				TOYOTA AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_)
TOYOTA	CELICA (ZZT23_), RAV 4 II (XA2)				VAUXHALL VIVARO Box, VIVARO Combi, VIVARO Flatbed / Chassis
VAUXHALL	ANTARA				MBV1980R6
MBV1889R7		MBV1920R7	OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Flatbed / Chassis (U9, E9)		ALFA ROMEO 145 (930), 146 (930), 147 (937), 156 (932), 156 Sportwagon (932), 166 (936), GTV (916C_), SPIDER (916S_)
LAND ROVER	DISCOVERY II (LJ, LT)	RENAULT	MASTER III Box (HD, FD), MASTER III Bus (JD), MASTER III Flatbed / Chassis (ED, UD)		FORD COUGAR (EC_), FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW), MAVERICK, MONDEO II (BAP),
MBV1904R6		TOYOTA	AVENSIS VERSO (AC_), PREVIA (ACR3_), RAV 4 III (ACA_, ACE_)		
AUDI	80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), A8 (4D2, 4D8), CABRIOLET (8G7, B4), COUPE (89, 8B)				
DAEWOO	LEGANZA (KLAV), NUBIRA (KLA),				







					
JEEP	MONDEO II Estate (BNP), MONDEO II Saloon (BFP), TOURNEO CONNECT, TRANSIT Box (E...), TRANSIT Bus (E...), TRANSIT CONNECT (P65_, P70_, P80_), TRANSIT Flatbed / Chassis (E...)	OPEL	T1 Flatbed / Chassis (602), V-CLASS (638/2), VITO Box (638), VITO Bus (638) CALIBRA A (85_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), SINTRA, VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_)	OPEL	G-CLASS (W460), G-CLASS (W461), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), M-CLASS (W163), Saloon (W124), SLK (R170) FRONTERA A (5_MWL4) FRONTERA, FRONTERA Sport
LANCIA	DELTA II (836), LYBRA (839AX), LYBRA SW (839BX)	SAAB	9-5 (YS3E), 9-5 Estate (YS3E)	VAUXHALL	ALFA ROMEO 164 (164)
MAZDA	TRIBUTE (EP)	VAUXHALL	CALIBRA, OMEGA, OMEGA Estate, SINTRA, VECTRA, VECTRA Estate, VECTRA Hatchback		MBV2060R5
MERCEDES-BENZ	190 (W201), COUPE (C124), KOMBI Estate (S124), Saloon (W124), T1 Box (601), T1 Box (602), T1 Bus (601), T1 Bus (602), T1 Flatbed / Chassis (601), T1 Flatbed / Chassis (602)	MBV2025R5			BMW 3 (E46), 3 Touring (E46), 5 (E39), 5 Touring (E39), 7 (E38), X5 (E53)
SAAB	9-5 (YS3E), 9-5 Estate (YS3E)	BMW	3 (E46), 3 Touring (E46), 5 (E39), 5 Touring (E39)		MBV2063R6
MBV1995R6		LAND ROVER	FREELANDER (LN)		BMW 3 (E90), 3 Coupe (E92), 3 Touring (E91), X3 (E83)
ALFA ROMEO	147 (937), 156 (932), 156 Sportwagon (932), 166 (936), GT, GTV (916C_), SPIDER (916S_)	MG	MG ZT, MG ZT-T		CHEVROLET CAPTIVA
BMW	1 (E81, E87), 3 (E90), 3 Convertible (E93), 3 Coupe (E92), 3 Touring (E91), 5 (E60), 5 Touring (E61), 6 (E63), 6 Convertible (E64), 7 (E65, E66), X3 (E83)	ROVER	75 (R1), 75 Tourer (R1)		MERCEDES-BENZ E-CLASS (W210), E-CLASS Estate (S210)
HYUNDAI	SONATA III (EF), TUCSON (JM), XG				OPEL ANTARA
JEEP	WRANGLER I (Y, SJ_)	MBV2030R6			VAUXHALL ANTARA
KIA	SPORTAGE (JE_)	MERCEDES-BENZ	190 (W201), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), E-CLASS Estate (S124), G-CLASS (W461), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), Saloon (W124), T1 Box (601), T1 Box (602), T1 Bus (601), T1 Bus (602), T1 Flatbed / Chassis (601), T1 Flatbed / Chassis (602)		VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)
LANCIA	KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), THESIS (841AX)	MBV2035R7			MBV2080R6
MERCEDES-BENZ	T1 Box (601), T1 Box (602), T1 Bus (601), T1 Bus (602), T1 Flatbed / Chassis (601), T1 Flatbed / Chassis (602), VITO Box (638), VITO Bus (638)	JEEP	COMMANDER, GRAND CHEROKEE III		BMW 3 (E46), 3 Compact (E46), 3 Convertible (E46), 3 Coupe (E46), 3 Touring (E46), 5 (E60), 5 Touring (E61), 6 (E63), 6 Convertible (E64), 7 (E65, E66), X3 (E83), X5 (E53)
OPEL	SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS	MERCEDES-BENZ	C CLASS (W204), C CLASS T-Model (S204), C-CLASS (W203), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), CLS (C219), E-CLASS (W211), E-CLASS T-Model (S211), GL-CLASS (X164), R-CLASS (W251), SPRINTER 3,5 Flatbed / Chassis (906), SPRINTER 3,5-t Box (906), SPRINTER 3-t Box (906), SPRINTER 3-t Flatbed / Chassis (906), SPRINTER 5-t Box (906), SPRINTER 5-t Flatbed / Chassis (906), VIANO (W639), VITO Box (W639), VITO Bus (W639)		CHRYSLER 300 C, 300 C Touring, LE BARON, LE BARON Convertible, VOYAGER I (ES)
SAAB	9-5 (YS3E), 9-5 Estate (YS3E)				FORD COUGAR (EC_), MAVERICK, MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), MONDEO III (B5Y), MONDEO III Estate (BWY), MONDEO III Saloon (B4Y)
VAUXHALL	SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS	MBV2040R6			FORD USA TAURUS (P5_), TAURUS Wagon (P5_)
VW	CRAFTER 30-35 Bus (2E), CRAFTER 30-50 Box (2E), CRAFTER 30-50 Flatbed / Chassis (2E), LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	DODGE	KORANDO (K), KORANDO Cabrio (K), MUSSO (F)		JEEP CHEROKEE, CHEROKEE (X), COMMANDER, GRAND CHEROKEE III, WRANGLER I (Y, SJ_)
MBV2000R7		FORD	SCORPIO II (GFR, GGR), SCORPIO II Estate (GNR, GGR)		MAZDA MPV II (LW), TRIBUTE (EP)
OPEL	VIVARO Box (F7), VIVARO Combi (I7), VIVARO Flatbed / Chassis (E7)	ISUZU	TROOPER, TROOPER Open Off-Road Vehicle		MERCEDES-BENZ C-CLASS (W202), C-CLASS Estate (S202), E-CLASS (W124), E-CLASS (W210), E-CLASS Estate (S124), E-CLASS Estate (S210), KOMBI Estate (S124), Saloon (W124)
TOYOTA	AVENSIS (T25), AVENSIS Estate (T25), AVENSIS Saloon (T25), COROLLA Verso (ZER_, ZZE_)	JEEP	COMPASS, PATRIOT		MBV2040R8
VAUXHALL	VIVARO Box, VIVARO Combi, VIVARO Flatbed / Chassis	MERCEDES-BENZ	C-CLASS (W202), C-CLASS Estate (S202), CLK (C208), CLK Convertible (A208), COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), E-CLASS Estate (S210), KOMBI Estate (S124), Saloon (W124)		BMW 3 (E46), 3 Compact (E46), 3 Touring (E46)
MBV2013R6		OPEL	FRONTERA B (6B_), MONTEREY B		MBV2100R6
KIA	SEPHIA (FA), SEPHIA Saloon (FA)	VAUXHALL	FRONTERA Mk II		CHRYSLER 300 C, 300 C Touring, VOYAGER III (RG)
MAZDA	3 (BK14), 3 Saloon (BK12)				DAEWOO KORANDO (K), KORANDO Cabrio (K), MUSSO (F)
SAAB	900 II, 900 II Convertible, 900 II Coupe	MBV2050R6			FORD COUGAR (EC_), FOCUS (DAW, DBW),
MBV2020R6		CHRYSLER	VOYAGER II (GS)		
MERCEDES-BENZ	C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Flatbed / Chassis (904), T1 Box (601), T1 Box (602), T1 Bus (601), T1 Bus (602), T1 Flatbed / Chassis (601),	DAEWOO	KORANDO (K), KORANDO Cabrio (K), MUSSO (F)		
		HYUNDAI	SANTA FE (CM), SANTA FE (SM)		
		KIA	CARNIVAL III (UVP_), MAGENTIS		
		MERCEDES-BENZ	190 (W201), C-CLASS (W202), C-CLASS Estate (S202), CLK (C208), CLK Convertible (A208), E-CLASS (W124), E-CLASS (W210), E-CLASS Estate (S210),		



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







  <p>FOCUS Estate (DNW), FOCUS Saloon (DFW), MAVERICK, MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), TOURNEO CONNECT, TRANSIT CONNECT (P65_, P70_, P80_)</p> <p>LEXUS LS</p> <p>MAZDA MPV II (LW), TRIBUTE (EP)</p> <p>MERCEDES-BENZ 190 (W201), C-CLASS (W202), E-CLASS (W210), E-CLASS Estate (S124), E-CLASS Estate (S210), G-CLASS (W461), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), Saloon (W124), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904), V-CLASS (638/2), VITO Box (638), VITO Bus (638)</p> <p>VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	  <p>MVB2135R6 KIA CERATO Saloon MERCEDES-BENZ C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C208), CLK Convertible (A208), COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), E-CLASS Estate (S210), G-CLASS (W463), KOMBI Estate (S124), Saloon (W124), S-CLASS (W140), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Flatbed / Chassis (904)</p> <p>MVB2145R6 ALFA ROMEO 159, 159 Sportwagon, BRERA, SPIDER JEEP CHEROKEE (KJ), WRANGLER II (TI) MERCEDES-BENZ Saloon (W124), S-CLASS (W140), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903) VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE)</p>	  <p>C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C209), E-CLASS (W210), E-CLASS Estate (S210), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904)</p> <p>MVB2196R6 FORD GALAXY, MONDEO IV, MONDEO IV Saloon, MONDEO IV Turnier, S-MAX</p> <p>MVB2205R6 CHEVROLET ALERO FORD TRANSIT Box, TRANSIT Flatbed / Chassis JEEP CHEROKEE (KJ), COMMANDER, GRAND CHEROKEE II (WJ, WG), GRAND CHEROKEE III MERCEDES-BENZ CABRIOLET (A124), C-CLASS (W202), COUPE (C124), KOMBI Estate (S124), Saloon (W124), S-CLASS (W140), SL (R129), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904), V-CLASS (638/2), VITO Box (638), VITO Bus (638)</p> <p>VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE)</p>
<p>MVB2120R6 DAEWOO KORANDO (KJ), KORANDO Cabrio (KJ), MUSSO (FJ) FORD COUGAR (EC_), FOCUS (DAW, DBW), FOCUS Estate (DNW), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP)</p> <p>LEXUS GS (GRS_, UZS_)</p> <p>MERCEDES-BENZ 190 (W201), C-CLASS (W202), C-CLASS Estate (S202), E-CLASS (W124), E-CLASS (W210), G-CLASS (W460), G-CLASS (W461), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), Saloon (W124), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904)</p> <p>OPEL SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS</p> <p>PORSCHE 911 (996), 911 (997), 911 Convertible (996), 911 Convertible (997), BOXSTER, BOXSTER (986), CAYMAN</p> <p>VAUXHALL SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS</p> <p>VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE)</p>	<p>MVB2153R6 DAEWOO KORANDO (KJ), KORANDO Cabrio (KJ), MUSSO (FJ) MERCEDES-BENZ C-CLASS (W202), C-CLASS Estate (S202), CLK (C208), CLK Convertible (A208), E-CLASS (W124), E-CLASS (W210), E-CLASS Estate (S124), E-CLASS Estate (S210), G-CLASS (W461), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), M-CLASS (W163), Saloon (W124), SLK (R170) VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE)</p> <p>MVB2160R6 BMW 5 (E60), 5 Touring (E61), 6 (E63), 6 Convertible (E64), 7 (E65, E66) MAZDA 6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY), MX-5 III (NC) MERCEDES-BENZ C-CLASS (W202), C-CLASS Estate (S202), V-CLASS (638/2), VITO Box (638), VITO Bus (638)</p> <p>MVB2170R6 FORD FIESTA V (JH_, JD_), FIESTA Van MERCEDES-BENZ 190 (W201), CABRIOLET (A124), C-CLASS (W202), COUPE (C124), E-CLASS (W124), E-CLASS Estate (S124), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), Saloon (W124), S-CLASS (W126), SL (R107), SL (R129) VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	<p>MVB2215R6 CHEVROLET BLAZER '94, S10 Pick Up FORD FIESTA V (JH_, JD_) JEEP GRAND CHEROKEE II (WJ, WG), GRAND CHEROKEE III 6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY) MAZDA 6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY) MERCEDES-BENZ SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904) VOLVO V70 III Estate VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>
<p>MVB2125R6 CHRYSLER 300 C, 300 C Touring MERCEDES-BENZ C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), E-CLASS (W210), E-CLASS Estate (S210), SL (R129)</p> <p>VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	<p>MVB2188R8 JEEP CHEROKEE (XJ), GRAND CHEROKEE I (Z) OPEL FRONTERA A (5_MWL4), FRONTERA A Sport (5_SUD2) VAUXHALL FRONTERA, FRONTERA Sport</p> <p>MVB2190R6 FORD KA (RB_), STREET KA JEEP CHEROKEE (KJ), CHEROKEE (XJ) MERCEDES-BENZ C CLASS (W204), C CLASS F-Model (S204), C-CLASS (W202), C-CLASS (W203),</p>	<p>MVB2225R6 DAEWOO REXTON (GAB_) FORD FIESTA V (JH_, JD_), MONDEO III (B5Y), MONDEO III Estate (BWY), MONDEO III Saloon (B4Y) JEEP CHEROKEE (KJ), GRAND CHEROKEE II (WJ, WG) LEXUS LS (UCF20) MERCEDES-BENZ C-CLASS (W202), E-CLASS (W210), S-CLASS (W140), SL (R129) OPEL OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), SENATOR B (29_) SAAB 9000, 9000 Hatchback VAUXHALL CARLTON Mk III, CARLTON Mk III Estate, SENATOR Mk II VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW),</p>




					
	TRANSPORTER IV Flatbed / Chassis (70XD)	MVB2265R7		MAZDA	3 (BK14), 6 (GG), CX-7
MVB2240R6		HONDA	ACCORD VIII (CL_, CM_), ACCORD VIII Tourer (CM_), CR-V II (RD_), CR-V III, FR-V	MERCEDES-BENZ	C-CLASS (W203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), E-CLASS (W210), E-CLASS Estate (S210), G-CLASS (W463), G-CLASS Cabrio (W463), M-CLASS (W163), VIANO (W639)
JEEP	GRAND CHEROKEE II (WJ, WG), WRANGLER II (TJ)	JEEP	GRAND CHEROKEE I (Z)		
MAZDA	6 (GH), 6 Estate (GH), 6 Hatchback (GH)	KIA	SORENTO (JC)		
MERCEDES-BENZ	C-CLASS (W202), C-CLASS Estate (S202), E-CLASS (W211), E-CLASS T-Model (S211)	LAND ROVER	DISCOVERY I, DISCOVERY II (LJ, LT), RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN)		
VW	TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	MVB2271R6		MVB2315R7	
		FORD	MAVERICK	LAND ROVER	RANGE ROVER II (LP)
MVB2250R6		FORD USA	TAURUS (P5_)	MERCEDES-BENZ	C CLASS (W204), C CLASS T-Model (S204), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), E-CLASS (W211), E-CLASS T-Model (S211), SLK (R171)
DAEWOO	KORANDO (KJ), MUSSO (F)	JEEP	CHEROKEE (XJ)		
FORD	GALAXY, MONDEO IV, MONDEO IV Saloon, MONDEO IV Turnier, S-MAX	MERCEDES-BENZ	C-CLASS (W202), C-CLASS Estate (S202), E-CLASS (W210), E-CLASS Estate (S210), M-CLASS (W163), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (903), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 4-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904), VIANO (W639), VITO Box (W639), VITO Bus (W639)	MVB2325R6	
JEEP	WRANGLER II (TJ)	OPEL	OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), SENATOR B (29_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)	CHEVROLET	TRAILBLAZER (KC_)
LEXUS	GS (JZS160), LS (FE), LS (UCF10), LS (UCF20)	VAUXHALL	CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, SENATOR Mk II	JEEP	CHEROKEE (KJ), GRAND CHEROKEE I (Z), WRANGLER II (TJ)
MAZDA	6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY), MX-5 III (NC)			MERCEDES-BENZ	CABRIOLET (A124), COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), KOMBI Estate (S124), Saloon (W124), S-CLASS (W140), SL (R129)
MERCEDES-BENZ	C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), E-CLASS (W124), E-CLASS (W210), E-CLASS Estate (S124), G-CLASS (W461), G-CLASS (W463)			SAAB	9000, 9000 Hatchback
NISSAN	PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P12), X-TRAIL (T30)	MVB2271R7		MVB2337R7	
TOYOTA	LAND CRUISER 100 (J10_)	HYUNDAI	H-1 Box, H-1 Bus (KMF)	JAGUAR	XJ (NAW, NBW), XK 8 Convertible (QDV), XK 8 Coupe (QEV)
		JEEP	GRAND CHEROKEE I (Z)	LAND ROVER	RANGE ROVER II (LP)
MVB2265R6		KIA	SORENTO (JC)	MERCEDES-BENZ	S-CLASS (W220), S-CLASS Coupe (C215), S-CLASS Coupe (C216), SL (R230)
AUDI	80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), CABRIOLET (8G7, B4), COUPE (89, 8B)	LAND ROVER	RANGE ROVER III (LM)		
LEXUS	SC	MERCEDES-BENZ	E-CLASS (W211), G-CLASS (W463), G-CLASS Cabrio (W463), M-CLASS (W163), S-CLASS (W220)	MVB2338R8	
MAZDA	6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY)	MVB2275R8		MERCEDES-BENZ	S-CLASS (W140)
MERCEDES-BENZ	190 (W201), C CLASS (W204), C CLASS T-Model (S204), CABRIOLET (A124), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), CLK (C209), COUPE (C124), E-CLASS (W211), E-CLASS T-Model (S211), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), Saloon (W124), S-CLASS (W126), S-CLASS (W220), SL (R107), SL (R129), SPRINTER 2-t Box (901, 902), SPRINTER 2-t Bus (901, 902), SPRINTER 2-t Flatbed / Chassis (901, 902), SPRINTER 3,5 Flatbed / Chassis (906), SPRINTER 3,5-t Box (906), SPRINTER 3,5-t Bus (906), SPRINTER 3-t Box (903), SPRINTER 3-t Bus (906), SPRINTER 3-t Flatbed / Chassis (903), SPRINTER 3-t Flatbed / Chassis (906), SPRINTER 3,5-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904), SPRINTER 5-t Box (906), SPRINTER 5-t Flatbed / Chassis (906), VIANO (W639), VITO Box (W639), VITO Bus (W639)	CHRYSLER	VOYAGER II (GS)		
		JEEP	CHEROKEE (XJ), GRAND CHEROKEE I (Z)	MVB2350R6	
		MVB2280R6		CHEVROLET	TAHOE (B2W)
		AUDI	100 (4A, C4), 100 Avant (4A, C4)	MERCEDES-BENZ	C CLASS (W204), C CLASS T-Model (S204), CABRIOLET (A124), CLS (C219), COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), Saloon (W124), S-CLASS (W221), S-CLASS Coupe (C216), SL (R129), SL (R230)
		ISUZU	TROOPER, TROOPER Open Off-Road Vehicle	SAAB	9-3 (YS3D), 9-3 Cabriolet (YS3D), 9-7X
		JEEP	GRAND CHEROKEE I (Z), WRANGLER II (TJ), WRANGLER III (JK)	MVB2365R7	
		MAZDA	6 (GH), 6 Estate (GH), 6 Hatchback (GH), CX-7, MPV II (LW)	MERCEDES-BENZ	S-CLASS (W221), S-CLASS Coupe (C216)
		MERCEDES-BENZ	CABRIOLET (A124), COUPE (C124), KOMBI Estate (S124), Saloon (W124), SL (R129), SPRINTER 3,5 Flatbed / Chassis (906), SPRINTER 3,5-t Box (906), SPRINTER 3,5-t Bus (906), SPRINTER 3-t Box (906), SPRINTER 3-t Bus (906), SPRINTER 3-t Flatbed / Chassis (906), SPRINTER 4-t Box (904), SPRINTER 4-t Bus (904), SPRINTER 4-t Flatbed / Chassis (904), SPRINTER 5-t Box (906), SPRINTER 5-t Flatbed / Chassis (906), VIANO (W639), VITO Box (W639), VITO Bus (W639)	VW	TOUAREG (7LA, 7L6, 7L7)
		OPEL	FRONTERA B (6B_), MONTEREY B	MVB2373R6	
		PORSCHE	911 (996), 911 (997), 911 Convertible (996), 911 Convertible (997)	MERCEDES-BENZ	CLK (C209), CLK Convertible (A209), E-CLASS (W211), E-CLASS T-Model (S211), M-CLASS (W163), M-CLASS (W164), R-CLASS (W251), S-CLASS (W220), VIANO (W639), VITO Box (W639), VITO Bus (W639)
		VAUXHALL	FRONTERA Mk II	VW	PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)
		MVB2300R6		MVB2380R6	
		MAZDA	6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY)	CHEVROLET	S10 Pick Up
		SAAB	9-7X, 900 II, 900 II Convertible, 900 II Coupe	MERCEDES-BENZ	C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), CLS (C219), COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS (W211), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), E-CLASS T-Model (S211), G-CLASS (W463), G-CLASS Cabrio (W463), KOMBI Estate (S124), M-CLASS (W164), R-CLASS (W251),
		MVB2315R6			
		JEEP	CHEROKEE (XJ), WRANGLER II (TJ)		



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits

 	 	 
<p>Saloon (W124), S-CLASS (W220), S-CLASS Coupe (C215), SL (R230), SLK (R171)</p> <p>MVB2390R6</p> <p>JAGUAR S-TYPE (CCX)</p> <p>MERCEDES-BENZ C-CLASS (W202), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS Estate (S202), C-CLASS T-Model (S203), CLK (C208), CLK (C209), CLK Convertible (A208), CLK Convertible (A209), E-CLASS (W210), E-CLASS (W211), E-CLASS Estate (S210), G-CLASS (W463), G-CLASS Cabrio (W463), M-CLASS (W163), S-CLASS (W220), S-CLASS Coupe (C215), SL (R129), SL (R230), SLK (R170)</p>	<p>E-CLASS (W124), E-CLASS (W210), E-CLASS (W211), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), E-CLASS T-Model (S211), G-CLASS (W463), KOMBI Estate (S124), Saloon (W124), S-CLASS (W140), SL (R129)</p> <p>MVB2460R6</p> <p>AUDI A4 (8EC), A4 (8K2), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A5, A6 (4F2), A6 Allroad (4FH), A6 Avant (4F5), A8 (4E_), V8 (44_, 4C_)</p> <p>CHRYSLER VOYAGER II (GS), VOYAGER III (RG)</p> <p>JAGUAR X-TYPE (CF1), X-TYPE Estate</p> <p>JEEP CHEROKEE (X), GRAND CHEROKEE I (Z), WRANGLER I (Y), SJ_, WRANGLER II (T)</p> <p>MERCEDES-BENZ E-CLASS (W124), S-CLASS (W140), S-CLASS Coupe (C140), S-CLASS (W220), S-CLASS Coupe (C140), S-CLASS Coupe (C215), SL (R129), SL (R230)</p>	<p>MVB2680R6</p> <p>AUDI A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8)</p> <p>MVB2710R7</p> <p>FORD TRANSIT Box, TRANSIT Box (FA_), TRANSIT Bus, TRANSIT Bus (FD_, FB_, FS_, FZ_, FC_), TRANSIT Flatbed / Chassis, TRANSIT Flatbed / Chassis (FM_, FN_)</p> <p>LAND ROVER DISCOVERY II (LJ, LT)</p> <p>MVB2875R7</p> <p>FORD TRANSIT Box (FA_), TRANSIT Bus (FD_, FB_, FS_, FZ_, FC_), TRANSIT Flatbed / Chassis (FM_, FN_)</p>
<p>MVB2403R6</p> <p>AUDI A4 (8D2, B5), A4 (8E2, B6), A4 (8EC), A4 (8K2), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Avant (8K5), A4 Convertible (8H7, 8HE), A5, A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH)</p> <p>CHEVROLET CAPTIVA</p> <p>JEEP WRANGLER I (Y), SJ_, WRANGLER II (T)</p> <p>MERCEDES-BENZ C-CLASS (W204), C-CLASS T-Model (S204), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), CLS (C219), E-CLASS (W211), E-CLASS T-Model (S211), GL-CLASS (X164), M-CLASS (W164), R-CLASS (W251), S-CLASS (W221), S-CLASS Coupe (C216), SL (R230), SLK (R171), SPRINTER 3,5 Flatbed / Chassis (906), SPRINTER 3,5-t Box (906), SPRINTER 3, 5-t Bus (906), SPRINTER 3-t Bus (906), SPRINTER 3-t Flatbed / Chassis (906)</p> <p>OPEL ANTARA</p> <p>SKODA SUPERB (3U4)</p> <p>VAUXHALL ANTARA</p> <p>VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)</p>	<p>MVB2460R8</p> <p>MERCEDES-BENZ E-CLASS (W124), Saloon (W124), S-CLASS (W140), S-CLASS Coupe (C140)</p> <p>MVB2475R6</p> <p>AUDI V8 (44_, 4C_)</p> <p>HYUNDAI GRANDEUR, SONATA V</p> <p>JEEP CHEROKEE (X)</p> <p>KIA OPIRUS</p> <p>MERCEDES-BENZ COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), KOMBI Estate (S124), Saloon (W124)</p> <p>VW PHAETON (3D2)</p> <p>MVB2488R8</p> <p>JEEP GRAND CHEROKEE II (WJ, WG)</p> <p>MVB2490R6</p> <p>AUDI A4 (8EC), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A5, A6 (4F2), A6 Allroad (4FH), A6 Avant (4F5), A8 (4E_), Q7</p> <p>CHRYSLER VOYAGER I (ES)</p> <p>VW TOUAREG (7LA, 7L6, 7L7)</p>	<p>SVB10550</p> <p>FIAT REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A)</p> <p>PEUGEOT 205 Box, 205 I (741A/C), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), 405 II (4B), 405 II Break (4E) HORIZON</p> <p>SVB10600</p> <p>AUDI 80 (81, 85, B2), 100 (43, C2), 100 Avant (43, C2)</p> <p>CITROËN C25 Box (280_, 290_), C25 Bus (280_, 290_), CX II, CX II Break, ID Break</p> <p>PEUGEOT 309 II (3C, 3A), 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D), J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L), J9 Box, J9 Bus, J9 Flatbed / Chassis</p> <p>RENAULT 5 (122_), 5 Box (238_)</p> <p>SUZUKI SAMURAI (SJ), VITARA (ET, TA), VITARA Cabrio (ET, TA)</p> <p>TALBOT EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1500 Flatbed / Chassis, EXPRESS 1000 -1800 Box</p> <p>VW TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis</p>
<p>MVB2415R6</p> <p>AUDI A4 (8EC), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4F2), A6 Allroad (4FH), A6 Avant (4F5)</p> <p>CHEVROLET BLAZER '94, S10 Pick Up</p> <p>JEEP CHEROKEE (X)</p> <p>MERCEDES-BENZ 190 (W201), CABRIOLET (A124), COUPE (C124), E-CLASS (W124), E-CLASS (W210), E-CLASS Convertible (A124), E-CLASS Coupe (C124), E-CLASS Estate (S124), G-CLASS (W463), KOMBI Estate (S124), Saloon (W124), S-CLASS (W126), SL (R129)</p> <p>SAAB 9-5 (YS3E), 9-5 Estate (YS3E)</p> <p>MVB2418R7</p> <p>MERCEDES-BENZ C-CLASS (W204), C-CLASS T-Model (S204), C-CLASS (W203), C-CLASS Coupe (CL203), C-CLASS T-Model (S203), CLK (C209), CLK Convertible (A209), E-CLASS (W211), E-CLASS T-Model (S211), SLK (R171)</p> <p>MITSUBISHI PAJERO III (V60, V70)</p> <p>MVB2440R8</p> <p>MERCEDES-BENZ S-CLASS (W140)</p> <p>MVB2450R6</p> <p>MERCEDES-BENZ CABRIOLET (A124), CLS (C219), COUPE (C124),</p>	<p>MVB2510R6</p> <p>CHRYSLER VOYAGER I (ES), VOYAGER II (GS), VOYAGER III (RG)</p> <p>HYUNDAI SONATA V</p> <p>KIA CARENS III</p> <p>MERCEDES-BENZ E-CLASS (W210), E-CLASS Estate (S210), S-CLASS (W140), S-CLASS Coupe (C140)</p> <p>MVB2540R6</p> <p>MERCEDES-BENZ E-CLASS (W124), Saloon (W124), S-CLASS (W140), S-CLASS Coupe (C140), SL (R129)</p> <p>MVB2553R6</p> <p>DODGE CALIBER</p> <p>JEEP COMPASS, PATRIOT</p> <p>SAAB 9000, 9000 Hatchback</p> <p>MVB2585R6</p> <p>HYUNDAI SONATA V</p> <p>KIA CARENS III, MAGENTIS</p> <p>MERCEDES-BENZ S-CLASS (W140), SL (R129)</p> <p>VW CRAFTER 30-35 Bus (2E), CRAFTER 30-50 Box (2E), CRAFTER 30-50 Flatbed / Chassis (2E)</p> <p>MVB2613R6</p> <p>AUDI 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), A8 (4D2, 4D8)</p> <p>SAAB 9-5 (YS3E), 9-5 Estate (YS3E)</p> <p>MVB2625R6</p> <p>SAAB 900 II, 900 II Convertible, 900 II Coupe</p>	<p>SVB10610</p> <p>AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3)</p> <p>DAEWOO TICO (KLY3)</p> <p>LAND ROVER DISCOVERY I</p> <p>PEUGEOT 205 I (741A/C), 205 I Convertible (741B, 20D), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A), 309 II (3C, 3A), 505 (551A), 505 Break (551D), J5 Box (290L), J5 Bus (290P), J5 Flatbed / Chassis (290L)</p> <p>SUBARU REX III</p> <p>SUZUKI CAPPUCINO</p> <p>TALBOT EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1800 Box, HORIZON</p> <p>VW PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)</p> <p>SVB10625</p> <p>ALFA ROMEO 164 (164)</p> <p>CITROËN BX (XB-), BX Break (XB-), C25 Bus (280_, 290_), CX II, CX II Break</p> <p>FORD ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ORION II (AFF)</p> <p>RENAULT 4 (112_), 4 Box (R21_, R23_), 6 (118_),</p>






  <p>SEAT SUBARU VW</p> <p>18 (134_), 18 Variable (135_), FUEGO (136_), RODEO 5 TOLEDO I (1L) VIVIO CORRADO (53I), GOLF I Cabriolet (155), GOLF II (19E, 1G1), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), SCIROCCO (53B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis</p>	  <p>SEAT SUBARU VW</p> <p>TERRA (24), TERRA Box (024A) JUSTY I (KAD), REX II, REX III POLO (86C, 80), POLO CLASSIC (86C, 80), POLO Coupe (86C, 80)</p> <p>SVB10690 AUDI FIAT</p> <p>80 (81, 85, B2) PALIO (178BX), PUNTO (176), PUNTO Convertible (176C), REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A), SCUODO Box (220L), SCUODO Combinato (220P), SIENA (178_), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) FIESTA Box (FVD), FIESTA II (FBD), FIESTA III (GF), SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) JEEP LANCIA</p> <p>CHEROKEE (XJ) DEDRA (835), DEDRA SW (835), DELTA II (836), THEMA (834)</p> <p>OPEL RENAULT</p> <p>CALIBRA A (85_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) 4 (112_), 4 Box (R21_, R23_), 19 I (B/C53_), 19 I Box (S53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_), CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), RAPID Box (F40_, G40_) SUBARU VAUXHALL</p> <p>CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback GOLF I (17), GOLF II (19E, 1G1), JETTA I (16), JETTA II (19E, 1G2), PASSAT (32B), PASSAT Variant (32B), POLO (86C, 80), SCIROCCO (53B)</p>	  <p>SVB10710 AUDI AUSTIN CITROËN FIAT FORD HONDA LADA LANCIA PEUGEOT PORSCHE RENAULT ROVER ZAZ</p> <p>80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE) AX (ZA-), BERLINGO (MF), BERLINGO Box (M_), BX (XB-), BX Break (XB-), C15 (VD-), JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), SAXO (S0, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), ZX (N2), ZX Break (N2) CROMA (154), DUCATO Box (230L), DUCATO Bus (230) SIERRA Estate (BNC), SIERRA Hatchback (GBC) CANCERTO (HW) SAMARA (2108, 2109), SAMARA FORMA (21099) THEMA (834), THEMA SW (834) 106 I (1A, 1C), 106 II (1), 205 I Convertible (741B, 20D), 205 II (20A/C), 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), 405 II (4B), 405 II Break (4E), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_), PARTNER Box (5), PARTNER Combispace (5F) 911, 911 Convertible, 911 Targa 5 (122_) 200 Hatchback (XW), 400 (XW), 400 Tourer (XW), MAESTRO, MONTEGO, MONTEGO Estate (XE) TAVRIJA</p>
<p>SVB10635 ARO AUDI CITROËN FIAT LANCIA VW</p> <p>240-244 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) AXEL CROMA (154) THEMA (834), THEMA SW (834) GOLF II (19E, 1G1), JETTA II (19E, 1G2), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis</p>	<p>SVB10700 AUDI AUSTIN CITROËN DAIHATSU FIAT MG PEUGEOT</p> <p>80 (81, 85, B2) MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE) AX (ZA-), C25 Box (280_, 290_), C25 Bus (280_, 290_), CX II, CX II Break, XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4), ZX (N2) CUORE VI (L7_), MOVE (L6, L9), SIRION (M1), YRV (M2) DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230) MAESTRO, MONTEGO 106 I (1A, 1C), 504 (A_, M_), 504 Convertible, 504 Coupe, J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L) 5 (122_), 5 Box (238_), 6 (118_) 100 (METRO) (XP) TOLEDO I (1L) LIBERO Bus (E10, E12) EXPRESS 1000 -1500 Bus, E XPRESS 1000 -1500 Flatbed / Chassis, EXPRESS 1000 -1800 Box, HORIZON GOLF I (17), GOLF I Cabriolet (155), GOLF II (19E, 1G1), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), POLO (86C, 80), POLO CLASSIC (86C, 80), POLO Coupe (86C, 80), SANTANA (32B), SCIROCCO (53B), TRANSPORTER III Box, TRANSPORTER III Bus</p>	<p>SVB10725 ALFA ROMEO BMW FIAT FORD LANCIA PEUGEOT PORSCHE RENAULT TATA (TELCO) ZAZ</p> <p>145 (930), 146 (930), 155 (167) 3 (E36), 3 Coupe (E36) 126 SIERRA Estate (BNC), SIERRA Hatchback (GBC) DEDRA (835), DEDRA SW (835), DELTA II (836) 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D) 911, 911 Convertible, 911 Targa 5 (122_), 19 I (B/C53_), 19 I Box (S53_) SAFARI (42_FD) TAVRIJA</p>
<p>SVB10650 ALFA ROMEO CITROËN FIAT JAGUAR PEUGEOT RENAULT TALBOT VW</p> <p>75 (162B), 90 (162) BX (XB-), C15 (VD-), VISA, ZX (N2), ZX Break (N2) BRAVA (182), BRAVO (182), REGATA (138), REGATA Weekend, TEMPRA (159), TEMPRA S.W. (159), TIPO (160) XJS Coupe 205 Box, 205 II (20A/C), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D), 604 (561A_), J9 Box, J9 Bus, J9 Flatbed / Chassis 5 (122_), 5 Box (238_) TAGORA TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis, TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	<p>SVB10735 AUDI LANCIA SEAT VW</p> <p>80 (81, 85, B2), 100 (44, 44Q, C3), 100 Avant (44, 44Q, C3) FULVIA TOLEDO I (1L) CADDY I (14), CORRADO (53I), GOLF I Cabriolet (155), GOLF II (19E, 1G1), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), SCIROCCO (53B)</p>	<p>SVB10740 AUDI DAIHATSU FIAT LANCIA PEUGEOT ROVER VW</p> <p>80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) COPEN CINQUECENTO (170), CROMA (154), REGATA (138), REGATA Weekend, RITMO II (138A), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) DEDRA (835), DELTA I (831ABO), PRISMA (831ABO) 505 (551A), 505 Break (551D) 800 (XS), 800 Coupe, 800 Hatchback (XS) CORRADO (53I), GOLF II (19E, 1G1), JETTA I (16),</p>
<p>SVB10665 CITROËN DAEWOO PEUGEOT RENAULT VAUXHALL VW</p> <p>CX II, CX II Break, XM (Y3), XM Break (Y3) MATIZ (KLVA) 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D) 4 (112_), 4 Box (R21_, R23_), 5 (122_), 5 Box (238_), 6 (118_), RODEO 5 MIDI, MIDI II CORRADO (53I), GOLF II (19E, 1G1), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I)</p>	<p>SVB10675 AUTOBIANCHI CITROËN DAIHATSU FIAT FORD LANCIA LAND ROVER PEUGEOT RENAULT</p> <p>Y10 CX II, CX II Break, JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_) MOVE (L6, L9) PANDA (141A_), PANDA Van (141_), TIPO (160), UNO (146A/E) FIESTA Box (FVD), FIESTA II (FBD) Y10 (156) DISCOVERY I, RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN) 205 II (20A/C), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223), J9 Box, J9 Bus, J9 Flatbed / Chassis 6 (118_)</p>	<p>SVB10735 AUDI LANCIA SEAT VW</p> <p>80 (81, 85, B2), 100 (44, 44Q, C3), 100 Avant (44, 44Q, C3) FULVIA TOLEDO I (1L) CADDY I (14), CORRADO (53I), GOLF I Cabriolet (155), GOLF II (19E, 1G1), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), SCIROCCO (53B)</p>
<p>SVB10675 AUTOBIANCHI CITROËN DAIHATSU FIAT FORD LANCIA LAND ROVER PEUGEOT RENAULT</p> <p>Y10 CX II, CX II Break, JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_) MOVE (L6, L9) PANDA (141A_), PANDA Van (141_), TIPO (160), UNO (146A/E) FIESTA Box (FVD), FIESTA II (FBD) Y10 (156) DISCOVERY I, RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN) 205 II (20A/C), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223), J9 Box, J9 Bus, J9 Flatbed / Chassis 6 (118_)</p>	<p>SVB10740 AUDI DAIHATSU FIAT LANCIA PEUGEOT ROVER VW</p> <p>80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) COPEN CINQUECENTO (170), CROMA (154), REGATA (138), REGATA Weekend, RITMO II (138A), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) DEDRA (835), DELTA I (831ABO), PRISMA (831ABO) 505 (551A), 505 Break (551D) 800 (XS), 800 Coupe, 800 Hatchback (XS) CORRADO (53I), GOLF II (19E, 1G1), JETTA I (16),</p>	<p>SVB10740 AUDI DAIHATSU FIAT LANCIA PEUGEOT ROVER VW</p> <p>80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) COPEN CINQUECENTO (170), CROMA (154), REGATA (138), REGATA Weekend, RITMO II (138A), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) DEDRA (835), DELTA I (831ABO), PRISMA (831ABO) 505 (551A), 505 Break (551D) 800 (XS), 800 Coupe, 800 Hatchback (XS) CORRADO (53I), GOLF II (19E, 1G1), JETTA I (16),</p>



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







 	 	 
<p>JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B)</p> <p>SVB10750</p> <p>ALFA ROMEO 164 (164) AUSTIN MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE) BEDFORD RASCAL Box, RASCAL Bus CITROËN 2 CV, ACADIANE, MEHARI FIAT ARGENTA (132A), CROMA (154) LANCIA FULVIA, THEMA (834) MERCEDES-BENZ S-CLASS (W126), S-CLASS Coupe (C126), SL (R107) MG MAESTRO, MONTEGO PEUGEOT 505 (551A), 505 Break (551D), 604 (561A_) PORSCHE 911 (993) RENAULT 18 (134_), 18 Variable (135_) ROVER MONTEGO, MONTEGO Estate (XE) SEAT IBIZA I (021A), MALAGA (023A), RONDA (022A) SUZUKI CARRY Box (ST90V), SAMURAI (SJ), SJ 410, SJ 410 Cabrio, SUPER CARRY Bus (ED) TALBOT TAGORA VOLVO 340-360 (343, 345), 340-360 Saloon (344), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765)</p>	<p>DAIHATSU CUORE II (L80, L81), CUORE III (L201), HIJET II Box (S85) FIAT CROMA (154), REGATA (138), REGATA Weekend ESCORT '81 Express (AVA), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) LANCIA DELTA I (831ABO), FULVIA, PRISMA (831ABO), THEMA (834) LAND ROVER 88/109, 90/110 (DHMC) PEUGEOT 205 I (741A/C), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A) PIAGGIO PORTER Box, PORTER Flatbed / Chassis PORSCHE 911 (964), 911 (993), 911 Convertible (964), 911 Convertible (993), 911 Targa (993) ROVER MAESTRO SAAB 99, 99 Combi Coupe SUZUKI CARRY Box (FD), WAGON R+ (EM) TALBOT HORIZON, SOLARA TOYOTA STARLET (_P7_), STARLET (_P8_) VW PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)</p> <p>SVB10790</p> <p>ALFA ROMEO 164 (164) AUDI 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), 200 (44, 44Q), 200 Avant (44, 44Q) AUTOBIANCHI A 112 CITROËN C25 Box (280_, 290_), C25 Bus (280_, 290_), C25 Flatbed / Chassis (280_, 290_) DAIHATSU CHARADE III (G100, G101, G102), CUORE II (L80, L81), CUORE IV (L501), CUORE V (L5), FERROZA Hard Top (F300), FERROZA Soft Top (F300), MOVE (L6, L9) 127, DUCATO Box (280), DUCATO Panorama (280) FIAT CIVIC II Shuttle (EE), CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED) HONDA RX 7 I (SA), RX 7 II (FC) MAZDA BLUEBIRD (U11) NISSAN ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), FRONTERA A Sport (5_SUD2), KADETT E Hatchback (33_, 34_, 43_, 44_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), SENATOR B (29_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) PEUGEOT 305 II (581M), 305 II Break (581E), 505 (551A), 505 Break (551D), J5 Box (280L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L) PORSCHE 911 (964) TALBOT EXPRESS 1000-1500 Bus, EXPRESS 1000-1500 Flatbed / Chassis, EXPRESS 1000-1800 Box, HORIZON, SOLARA VAUXHALL ASTRA Mk II Convertible, ASTRA Mk II Hatchback, ASTRA Mk III Hatchback, CALIBRA, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, FRONTERA Sport, SENATOR Mk II</p>	<p>200 (43), 200 (44, 44Q), COUPE (81, 85), QUATTRO (85) AUTOBIANCHI A 112 BMW 3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E34) CITROËN BX (XB-_), BX Break (XB-_), C25 Box (280_, 290_), C25 Bus (280_, 290_), C25 Flatbed / Chassis (280_, 290_), ID Break DAEWOO LUBLIN II Box, LUBLIN II Flatbed / Chassis DAIHATSU CHARADE II (G11, G30), CHARADE III (G100, G101, G102), CUORE IV (L501), HIJET I Box, HIJET I Bus, HIJET II Box (S85), HIJET II Bus (S85), SPARCAR Box, SPARCAR Bus FIAT 126, 127, CINQUECENTO (170), FIORINO (127), PANDA (141A_), PANDA Van (141_), SEICENTO (187), SEICENTO Van (187), UNO (146A/E) FORD ESCORT IV Estate (AWF, AVF), FIESTA Box (WFVT), FIESTA III (GFJ) FSO 126P, 127P HONDA CRX I (AF, AS), CRX II (ED, EE) LANCIA A 112 MAZDA RX 7 I (SA), RX 7 II (FC) OPEL ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), REKORD E (17_-19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) PEUGEOT 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D), J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L) RENAULT 5 (122_), 9 (L42_), 11 (B/C37_), 18 (134_), 18 Variable (135_), FUEGO (136_), SUPER 5 (B/C40_), SUPER 5 Box (S40_) SEAT FURA (025A), PANDA (141A), RONDA (022A), TERRA (24), TERRA Box (024A) TALBOT EXPRESS 1000-1500 Bus, EXPRESS 1000-1500 Flatbed / Chassis, EXPRESS 1000-1800 Box VAUXHALL ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CARLTON Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback VOLVO 240 (P242, P244), 240 Kombi (P245) VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (291-512), P ASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)</p>
<p>SVB10760</p> <p>AUDI 80 (81, 85, B2), COUPE (81, 85) BEDFORD MIDI Box, MIDI Bus DAIHATSU CUORE II (L80, L81), HIJET I Box, HIJET I Bus, HIJET II Box (S85) FORD ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ORION III (GAL) ISUZU CAMPO (KB), TROOPER Open Off-Road Vehicle (UBS) OPEL CAMPO (TF_), FRONTERA A (5_MWL4), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_) PIAGGIO PORTER Box, PORTER Flatbed / Chassis PORSCHE 911 (964), 911 (993), 911 Convertible (964), 911 Convertible (993), 911 Targa (993) SUZUKI CAPPUCINO, SAMURAI (SJ), SJ 413 VAUXHALL ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback, BRAVA Pickup, MIDI, MIDI II VW PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis</p>	<p>DAIHATSU CUORE II (L80, L81), CUORE III (L201), HIJET II Box (S85) FIAT CROMA (154), REGATA (138), REGATA Weekend ESCORT '81 Express (AVA), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) LANCIA DELTA I (831ABO), FULVIA, PRISMA (831ABO), THEMA (834) LAND ROVER 88/109, 90/110 (DHMC) PEUGEOT 205 I (741A/C), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A) PIAGGIO PORTER Box, PORTER Flatbed / Chassis PORSCHE 911 (964), 911 (993), 911 Convertible (964), 911 Convertible (993), 911 Targa (993) ROVER MAESTRO SAAB 99, 99 Combi Coupe SUZUKI CARRY Box (FD), WAGON R+ (EM) TALBOT HORIZON, SOLARA TOYOTA STARLET (_P7_), STARLET (_P8_) VW PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)</p> <p>SVB10800</p> <p>AUDI 80 (81, 85, B2), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3),</p>	<p>200 (43), 200 (44, 44Q), COUPE (81, 85), QUATTRO (85) AUTOBIANCHI A 112 BMW 3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E34) CITROËN BX (XB-_), BX Break (XB-_), C25 Box (280_, 290_), C25 Bus (280_, 290_), C25 Flatbed / Chassis (280_, 290_), ID Break DAEWOO LUBLIN II Box, LUBLIN II Flatbed / Chassis DAIHATSU CHARADE II (G11, G30), CHARADE III (G100, G101, G102), CUORE IV (L501), HIJET I Box, HIJET I Bus, HIJET II Box (S85), HIJET II Bus (S85), SPARCAR Box, SPARCAR Bus FIAT 126, 127, CINQUECENTO (170), FIORINO (127), PANDA (141A_), PANDA Van (141_), SEICENTO (187), SEICENTO Van (187), UNO (146A/E) FORD ESCORT IV Estate (AWF, AVF), FIESTA Box (WFVT), FIESTA III (GFJ) FSO 126P, 127P HONDA CRX I (AF, AS), CRX II (ED, EE) LANCIA A 112 MAZDA RX 7 I (SA), RX 7 II (FC) OPEL ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), REKORD E (17_-19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) PEUGEOT 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D), J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L) RENAULT 5 (122_), 9 (L42_), 11 (B/C37_), 18 (134_), 18 Variable (135_), FUEGO (136_), SUPER 5 (B/C40_), SUPER 5 Box (S40_) SEAT FURA (025A), PANDA (141A), RONDA (022A), TERRA (24), TERRA Box (024A) TALBOT EXPRESS 1000-1500 Bus, EXPRESS 1000-1500 Flatbed / Chassis, EXPRESS 1000-1800 Box VAUXHALL ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CARLTON Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback VOLVO 240 (P242, P244), 240 Kombi (P245) VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (291-512), P ASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)</p>
<p>SVB10775</p> <p>ALFA ROMEO 164 (164) AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3) AUSTIN MAESTRO (XC) CITROËN AXEL, BX (XB-_), BX Break (XB-_), LNA, VISA</p>	<p>SVB10800</p> <p>AUDI 80 (81, 85, B2), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3),</p>	<p>200 (43), 200 (44, 44Q), COUPE (81, 85), QUATTRO (85) AUTOBIANCHI A 112 BMW 3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E34) CITROËN BX (XB-_), BX Break (XB-_), C25 Box (280_, 290_), C25 Bus (280_, 290_), C25 Flatbed / Chassis (280_, 290_), ID Break DAEWOO LUBLIN II Box, LUBLIN II Flatbed / Chassis DAIHATSU CHARADE II (G11, G30), CHARADE III (G100, G101, G102), CUORE IV (L501), HIJET I Box, HIJET I Bus, HIJET II Box (S85), HIJET II Bus (S85), SPARCAR Box, SPARCAR Bus FIAT 126, 127, CINQUECENTO (170), FIORINO (127), PANDA (141A_), PANDA Van (141_), SEICENTO (187), SEICENTO Van (187), UNO (146A/E) FORD ESCORT IV Estate (AWF, AVF), FIESTA Box (WFVT), FIESTA III (GFJ) FSO 126P, 127P HONDA CRX I (AF, AS), CRX II (ED, EE) LANCIA A 112 MAZDA RX 7 I (SA), RX 7 II (FC) OPEL ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), REKORD E (17_-19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) PEUGEOT 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D), J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L) RENAULT 5 (122_), 9 (L42_), 11 (B/C37_), 18 (134_), 18 Variable (135_), FUEGO (136_), SUPER 5 (B/C40_), SUPER 5 Box (S40_) SEAT FURA (025A), PANDA (141A), RONDA (022A), TERRA (24), TERRA Box (024A) TALBOT EXPRESS 1000-1500 Bus, EXPRESS 1000-1500 Flatbed / Chassis, EXPRESS 1000-1800 Box VAUXHALL ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CARLTON Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback VOLVO 240 (P242, P244), 240 Kombi (P245) VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (291-512), P ASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)</p>







					
SVB10813	AUDI 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3)		FIESTA II (FBD), FIESTA IV (JA_, JB_), KA (RB_), ORION II (AFF), TRANSIT Box (V_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (T_), TRANSIT Flatbed / Chassis (V_)	IVECO Daily I	
AUSTIN MINI MK I		JAGUAR XJ		JAGUAR XJ, XJS Coupe, XJS Convertible	
AUTOBIANCHI A 112		LANCIA DELTA I (831AB0), PRISMA (831AB0), THEMA (834)		LANCIA DELTA I (831AB0), PRISMA (831AB0)	
BMW 3 (E30), 5 (E28)		MG METRO		MOSKVICH 407	
DAIHATSU CHARADE II (G11, G30), CHARADE III (G100, G101, G102)		MOSKVICH 412, 427 Estate, 2140, ASLK 2137 Estate, ASLK 2140		NISSAN CHERRY (N12)	
FIAT CROMA (154), REGATA (138), REGATA Weekend		OPEL FRONTERA A (5_MWL4), REKORD E (17_19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)		OPEL ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_)	
FORD FIESTA Box (WPFV)		RENAULT 5 (122_), 5 Box (238_), 18 (134_), 18 Variable (135_), FUJEO (136_)		PEUGEOT 505 (551A), J9 Box, J9 Bus, J9 Flatbed / Chassis	
HYUNDAI PONY, PONY Wagon, STELLAR (F31_, SF2_)		ROVER MINI MK I, MINI MK I Convertible (XN)		TOYOTA CELICA (TA60, RA40, RA6_), CELICA Coupe (RA6), COROLLA Coupe (AE86), LITEACE Box (CM3_V, KM3_V), LITEACE Bus (CM30_G, KM30_G)	
LANCIA A 112, DELTA I (831AB0), PRISMA (831AB0), THEMA (834), THEMA SW (834)		SAAB 99, 99 Combi Coupe, 900 I (AC4, AM4), 900 I Combi Coupe, 900 I Convertible, 9000 Hatchback		VAUXHALL CAVALIER Mk II, CAVALIER Mk II Convertible, CAVALIER Mk II Estate, CAVALIER Mk II Hatchback	
MINI MINI-MOKE		SEAT IBIZA I (021A), MALAGA (023A), RONDA (022A)		VOLVO 240 (P242, P244), 240 Kombi (P245)	
OPEL ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), SENATOR B (29_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)		SUZUKI ALTO II (EC), SWIFT I (AA)		VW GOLF I (17), GOLF I Cabriolet (155), JETTA I (16), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SCIROCCO (53B)	
PEUGEOT 505 (551A), 505 Break (551D)		VAUXHALL CARLTON Mk II, CARLTON Mk II Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, FRONTERA		ZASTAVA YUGO FLORIDA	
ROVER MINI MK I, MINI MK I Convertible (XN)		VW GOLF I (17), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SCIROCCO (53B)		SVB10865	
SAAB 99, 99 Combi Coupe		ZASTAVA 101 (1100), YUGO, YUGO FLORIDA		ALFA ROMEO 33 (905), 33 (907A), 33 Sport Wagon (907B), 33 Sportwagon (905A)	
SEAT IBIZA I (021A), MARBELLA (28), MARBELLA Box (028A)		SVB10840		BMW 3 (E30), 3 (E30), 3 Touring (E30), 5 (E28), 5 (E34), 7 (E32)	
VAUXHALL ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, SENATOR Mk II		ALFA ROMEO 75 (162B), 90 (162), 164 (164), RZ, SZ		FIAT PANDA (141A), TEMPRA (159), TEMPRA S.W. (159), TIPO (160), UNO (146A/E)	
VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)		AUDI 100 (44, 44Q, C3), 100 Avant (44, 44Q, C3)		FORD TRANSIT Box (V_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (V_)	
SVB10825		AUSTIN METRO, MINI MK I		SEAT TOLEDO I (11)	
ALFA ROMEO 33 (905), 33 (907A), 33 Sport Wagon (907B), 33 Sportwagon (905A), 75 (162B), 90 (162), 145 (930), 146 (930), 164 (164), ALFASUD Coupe (902.A), GIULIETTA (116), GTV (116), SPIDER (115)		CHRYSLER VOYAGER I (ES)		TALBOT TAGORA	
AUDI 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), COUPE (81, 85), QUATTRO (85)		CITROËN CX II, CX II Break		VOLVO 340-360 (343, 345), 340-360 Saloon (344), 740 (744)	
AUSTIN METRO, MINI MK I		FIAT ARGENTA (132A), CROMA (154), RITMO I (138A), RITMO II (138A), UNO (146A/E)		VW GOLF I Cabriolet (155), GOLF II (19E, 1G1), JETTA II (19E, 1G2), SCIROCCO (53B), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 70B, 70D), TRANSPORTER IV Flatbed / Chassis (70XD)	
AUTOBIANCHI A 112		FORD ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT III (GAA), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Estate (AWF, AVF), FIESTA Box (FVD), FIESTA II (FBD), ORION I (AFD), ORION II (AFF) CHEROKEE (XJ)		SVB10875	
BMW 3 (E21), 3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E12), 5 (E28), 5 (E34), 5 Touring (E34)		JEEP		ALFA ROMEO 33 (905), 33 (907A), 33 Sport Wagon (907B), 33 Sportwagon (905A), ALFASUD Coupe (902.A)	
CITROËN C35 Box, C35 Bus, C35 Pickup		LANCIA DELTA I (831AB0), PRISMA (831AB0), THEMA (834)		AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), CABRIOLET (8G7, B4), COUPE (81, 85), COUPE (89, 8B)	
FIAT CROMA (154), ELBA (146_), FIORINO (147), FIORINO Box (146 Uno), REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A), UNO (146A/E)		MINI MINI-MOKE		AUSTIN MAESTRO (XC), MONTEGO (XE)	
FORD ECONOVAN (KBA, KCA), ECONOVAN Box (KAA), ESCORT '86 Express (AVF), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Estate (AWF, AVF), ESCORT VII Estate (GAL, ANL), FIESTA Box (FVD), FIESTA Box (J5_, J3_), FIESTA Box (WPFV)		ROVER MINI MK I, MINI MK I Convertible (XN)		BMW 3 (E21), 3 (E30), 5 (E12), 5 (E28)	
		SEAT IBIZA I (021A), MALAGA (023A), RONDA (022A)		DAIHATSU CHARMANT (A)	
		SUZUKI SAMURAI (SJ), SJ 413, SWIFT I (AA)		FIAT REGATA (138), REGATA Weekend	
		TOYOTA CELICA (TA60, RA40, RA6_), LITEACE Box (M2_V), LITEACE Wagon (M2_G)		HONDA INTEGRA (DA_)	
		VOLVO 240 (P242, P244), 240 Kombi (P245)		HYUNDAI PONY, PONY Saloon	
		VW TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis		IVECO Daily I	
		ZASTAVA YUGO		NISSAN PRAIRIE (M10, NM10), STANZA (T11), STANZA Hatchback (T11)	
		SVB10850		OPEL ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CORSA A Box, CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), FRONTERA A (5_MWL4), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_)	
		ALFA ROMEO 33 (905), 33 (907A), 33 Sport Wagon (907B), 33 Sportwagon (905A), ALFASUD Coupe (902.A), GTV (116)			
		AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 100 (4A, C4), 100 Avant (4A, C4), COUPE (81, 85), COUPE (89, 8B), QUATTRO (85)			
		BMW 3 (E21), 3 Touring (E30), 5 (E12)			
		FIAT RITMO I (138A), RITMO II (138A), TIPO (160)			
		FSO 132P			



NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits

 	 	 
<p>PEUGEOT MONZA A (22_), REKORD E (17_19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), SENATOR A (29_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D) PORSCHE 928 ROVER MAESTRO, MONTEGO Estate (XE) SAAB 900 I Combi Coupe SEAT RONDA (022A) TOYOTA 4 RUNNER (N130), CELICA (TA60, RA40, RA6_), CELICA Coupe (RA6), COROLLA Station Wagon (E7_), CRESSIDA Saloon (X6_), CRESSIDA Station Wagon (X6K), HILUX Pickup (N_), LAND CRUISER (J7_), LITEACE Box (R2_V), LITEACE Box (CM3_V, KM3_V), LITEACE Box (M2_V), LITEACE Bus (R2_LG), LITEACE Bus (CM30_G, KM30_G), LITEACE Wagon (M2_G) VAUXHALL ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback, CARLTON Mk II, CARLTON Mk II Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, FRONTERA, NOVA, NOVA Hatchback, ROYALE, ROYALE Coupe VOLVO 240 (P242, P244), 240 Kombi (P245), 740 (744), 740 Kombi (745), 940 (944), 940 Kombi (945) VW CADDY I (14), GOLF I (17), GOLF II (19E, 1G1), JETTA I (16), PASSAT Variant (32B), TARO, TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis</p>	<p>MOSKVICHI 412, 427 Estate NISSAN URVAN Box (E24), URVAN Bus (E23), URVAN Bus (E24) OPEL ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), FRONTERA A (5_MWL4), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), MANTA B (58_, 59_), MANTA B CC (53_, 55_), MONZA A (22_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), REKORD E (17_19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), SENATOR A (29_), SENATOR B (29_) PEUGEOT 504 (A_, M_), 504 Convertible, 504 Coupe, J5 Box (280L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L), J9 Box, J9 Bus, J9 Flatbed / Chassis PORSCHE 924 ROVER 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Tourer (XW), CABRIOLET (XW) TALBOT EXPRESS 1000-1500 Bus, EXPRESS 1000-1500 Flatbed / Chassis, EXPRESS 1000-1800 Box TOYOTA CARINA Station Wagon (TA4K, TA6K), CELICA (TA60, RA40, RA6_), CELICA Coupe (TA4C, TA60), COROLLA Coupe (AE86), COROLLA Station Wagon (E7_) VAUXHALL ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback, CARLTON Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Convertible, CAVALIER Mk II Estate, CAVALIER Mk II Hatchback, FRONTERA, ROYALE, ROYALE Coupe, SENATOR Mk II VOLVO 240 (P242, P244), 240 Kombi (P245)</p>	<p>PORSCHE 924 SUBARU LEONE II VAUXHALL CARLTON Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, FRONTERA, ROYALE VW KAEFER, KAEFER Convertible (15), KARMANN GHIA Coupe (14, 34), LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis SVB10913 ALFA ROMEO 164 (164) AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4), COUPE (89, 8B) BMW 7 (E23) CITROËN BX (XB-), BX Break (XB-), C15 (VD-), CX II, CX II Break, LNA, VISA, VISA Convertible DAEWOO NEXIA Saloon (KLETN) FIAT ARGENTA (132A), DUCATO Box (280), DUCATO Box (290), DUCATO Flatbed / Chassis (280), DUCATO Flatbed / Chassis (290), DUCATO Panorama (280), DUCATO Panorama (290), ELBA (146_), FIORINO (147), FIORINO Box (146 Uno), FIORINO Pick up (146), REGATA (138), REGATA Weekend, TALENTO Box (290), TALENTO Bus (290), TALENTO Flatbed / Chassis (290), TIPO (160), UNO (146A/E) FORD P 100 II, SCORPIO I (GAE, GGE), SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG), TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_), TRANSIT Flatbed / Chassis (V_) FSO 125P, 125P Estate, POLONEZ I, POLONEZ II IVECO Daily I LANCIA DELTA I (831AB0), PRISMA (831AB0) LAND ROVER 88/109, 88/109 Hardtop MAZDA 323 S V (BA) MERCEDES-BENZ S-CLASS (W116), SL (R107), SL Coupe (C107) NISSAN PICK UP (720), PICK UP (D21) OPEL ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), CALIBRA A (85_), COMBO (71_), CORSA A Box,</p>
<p>SVB10888 ALFA ROMEO ALFASUD Coupe (902.A) AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4) BMW 5 (E28), 6 (E24) CITROËN C25 Box (280_, 290_), C25 Bus (280_, 290_), C25 Flatbed / Chassis (280_, 290_) DAIHATSU CHARMANT (A) FIAT DUCATO Box (280), DUCATO Box (290), DUCATO Flatbed / Chassis (280), DUCATO Flatbed / Chassis (290), DUCATO Panorama (280), DUCATO Panorama (290), DUNA (146 B), DUNA Weekend (146 B), FIORINO (147), FIORINO Box (146 Uno), FIORINO Pick up (146), REGATA (138), REGATA Weekend, RITMO II (138A), TALENTO Box (290), TALENTO Bus (290), TALENTO Flatbed / Chassis (290), UNO (146A/E) FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), TRANSIT Box (V_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (V_) HONDA CIVIC II, CIVIC II Hatchback (AL, AJ, AG, AH), CONCERTO (HW), CONCERTO Saloon (HWW) JAGUAR XJ PRIDE (DA), PRIDE Estate KIA 121 I (DA), 323 F VI (BJ), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), 323 P V (BA), 323 S V (BA), 323 S VI (BJ), FESTIVA, RX 7 I (SA)</p>	<p>SVB10900 AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (43, C2), 100 Avant (43, C2), A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4) BMW 3 (E30), 5 (E12), 5 (E28), 6 (E24), 7 (E23) FIAT ARGENTA (132A) FORD MAVERICK (UDS, UNS), SIERRA Hatchback (GBC, GBG) HONDA ACCORD II (AC, AD), ACCORD II Hatchback (AC, AD), ACCORD III (CA4, CA5), ACCORD III Aerodeck (CA5), INTEGRA (DA_), PRELUDE III (BA) JAGUAR XJ LDV SHERPA Bus (FR) MAZDA RX 7 II (FC) NISSAN PICK UP (720), PICK UP (D21), PICK UP (D22), TERRANO II (R20) OPEL FRONTERA A (5_MWL4), MANTA B (58_, 59_), MANTA B CC (53_, 55_), MONZA A (22_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), REKORD E (17_19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), SENATOR A (29_) PEUGEOT 104, 104 Coupe, 504 (A_, M_), 504 Convertible, 504 Coupe, 505 (551A)</p>	

					
PEUGEOT	CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), CORSA B (73_, 78_, 79_, F35_), CORSA B Box (73_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), REKORD E (17_-19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), SENATOR A (29_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)	PEUGEOT	ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), ASTRA G Box (F70), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), CALIBRA A (85_), COMBO (71_), CORSA A Box, CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), CORSA B (73_, 78_, 79_, F35_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)	MG	MAESTRO
ROVER	2000-3500 Hatchback (SD1)	ROVER	2000-3500 Hatchback (SD1), MAESTRO, MONTEGO, MONTEGO Estate (XE)	MITSUBISHI	L 200 (K__T), L 300 Box (L03_P), L 300 Box (PO_W, P1_W), L 300 Bus (L03_P/G, LO_2P), L 300 Flatbed / Chassis (L03_P), PAJERO I Open Off-Road Vehicle (L04_G), SPACE WAGON (DO_V/W), STARION (A18_A)
SUBARU	1800 XT COUPE (XT), LEONE II	SKODA	100, 110, 110 Coupe	NISSAN	BLUEBIRD (U11), PICK UP (D21), TERRANO I (WD21)
TALBOT	SAMBA (51A), SAMBA Convertible (51E), TAGORA	TALBOT	EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1500 Flatbed / Chassis, EXPRESS 1000 -1800 Box	PEUGEOT	505 (551A)
VAUXHALL	ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CARLTON Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, NOVA, NOVA Hatchback	TOYOTA	CROWN Saloon (S_1_)	ROVER	200 Coupe (XW), 200 Hatchback (XW), 400 (XW), 2000-3500 Hatchback (SD1), CABRIOLET (XW), MAESTRO, MONTEGO, MONTEGO Estate (XE)
	740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 Kombi (945)	VAUXHALL	ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CARLTON Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, NOVA, NOVA Hatchback	VAUXHALL	CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CHEVETTE, CHEVETTE Estate, CHEVETTE Hatchback, SENATOR Mk II
VOLVO	740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 Kombi (945)		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRAVAN Mk III, ASTRAVAN Mk IV, CALIBRA, CAVALIER Mk II, CAVALIER Mk II Convertible, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	VOLVO	240 (P242, P244), 240 Kombi (P245), 340-360 (343, 345), 340-360 Saloon (344), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765)
VW	TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, NOVA, NOVA Hatchback	VW	CADDY I (14), GOLF I (17), GOLF I Cabriolet (155), GOLF II (19E, 1G1), JETTA I (16), JETTA II (19E, 1G2), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SCIROCCO (53B)
SVB10925			ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, NOVA, NOVA Hatchback	SVB10950	
CITROËN	C25 Box (280_, 290_), C25 Bus (280_, 290_), C25 Flatbed / Chassis (280_, 290_)		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, NOVA, NOVA Hatchback	AUDI	80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 100 (43, C2), 100 (44, 44Q, C3), 100 (4A, C4), 100 Avant (43, C2), 100 Avant (44, 44Q, C3), 100 Avant (4A, C4), COUPE (81, 85), COUPE (89, 88)
FIAT	CROMA (154), DUCATO Box (280), DUCATO Box (290), DUCATO Flatbed / Chassis (280), DUCATO Flatbed / Chassis (290), DUCATO Panorama (280), DUCATO Panorama (290), TALENTO Box (290), TALENTO Bus (290), TALENTO Flatbed / Chassis (290)		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, NOVA, NOVA Hatchback	AUSTIN	MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE)
FORD	SIERRA Estate (BNC), SIERRA Hatchback (GBC), TRANSIT Box (V_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (V_)		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	BMW	3 (E21), 3 (E30), 5 (E12), 5 (E28)
FSO	125P, 125P Estate, POLONEZ III, POLONEZ III Saloon		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	CHRYSLER	VOYAGER I (ES)
IVECO	Daily I		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	DAEWOO	LUBLIN II Box, LUBLIN II Flatbed / Chassis
LANCIA	THEMA (834)		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	FIAT	ELBA (146_), FIORINO Box (146 Uno), FIORINO Pick up (146), TEMpra (159), TEMpra S.W. (159), TIPO (160)
MERCEDES-BENZ	/8 (W114), /8 (W115), COUPE (C123), KOMBI Estate (S123), Saloon (W123), S-CLASS (W126), SL (R107), SL Coupe (C107)		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	FORD	SIERRA Estate (BNC), SIERRA Hatchback (GBC) 125P, 125P Estate
OPEL	ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_)		ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	FSO	PRELUDE II (AB)
			ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	HONDA	Daily I
			ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	IVECO	1200-1500 Estate, 1200-1600, NADESCHDA (2120), NIVA (2121), NIVA II (2123), NOVA (2105, 2108, 2109), NOVA Estate (2104), TOSCANA
			ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	LADA	1200-1500 Estate, 1200-1600, NADESCHDA (2120), NIVA (2121), NIVA II (2123), NOVA (2105, 2108, 2109), NOVA Estate (2104), TOSCANA
			ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	LANCIA	DELTA I (831AB0), PRISMA (831AB0)
			ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRAVAN Mk III, CALIBRA, CAVALIER Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CORSA, NOVA, NOVA Hatchback, NOVAVAN	MERCEDES-BENZ	/8 (W114), /8 (W115), /8 Coupe (W114), COUPE (C123), G-CLASS (W460), KOMBI Estate (S123), Saloon (W123), T1 Bus (601), T1 Flatbed / Chassis (601)

NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







						
SEAT	TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)	FORD	SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG)	VW	CABRIOLET (8G7, B4) PASSAT (3B2), PASSAT Variant (3B5)	
SKODA	TOLEDO I (1L) FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5)	MAZDA	RX 7 II (FC)	SEAT	TOLEDO I (1L)	
VAUXHALL	ASTRA Hatchback, ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, CHEVETTE, CHEVETTE Estate, CHEVETTE Hatchback, COMBO, CORSA, CORSAVAN, VECTRA, VECTRA Hatchback	MERCEDES-BENZ	/8 (W115), COUPE (C123), KOMBI Estate (S123), Saloon (W123), S-CLASS (W116), S-CLASS (W126)	VW	PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	
VOLVO	740 (744), 740 Kombi (745), 940 (944), 940 Kombi (945)	MITSUBISHI	PAJERO II (V2_W, V4_W), STARION (A18_A)	FORD	FIESTA II (FBD)	
VW	CADDY I (14), CORRADO (53I), GOLF I (17), GOLF I Cabriolet (155), GOLF II (19E, 1G1), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B), SCIROCCO (53B)	NISSAN	VANETTE Bus (C22), VANETTE Bus (KC120)	SEAT	ALHAMBRA (7V8, 7V9)	
ZASTAVA	101 (1100), YUGO	OPEL	MANTA B (58_, 59_), MANTA B CC (53_, 55_), REKORD E (17_19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_)	VW	SHARAN (7M8, 7M9, 7M6)	
SVB10960		PORSCHE	911, 911 (964), 911 (993), 911 Convertible, 911 Convertible (964), 911 Convertible (993), 911 Targa, 911 Targa (993)	SVB12685	SEAT	CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L)
AUDI	100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3)	ROVER	2000-3500 Hatchback (SD1)	VW	CADDY II Box (9K9A), CADDY II Estate (9K9B), CORRADO (53I), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), VENTO (1H2)	
BMW	3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E28)	SAAB	90, 99, 99 Combi Coupe, 900 I (AC4, AM4), 900 I Combi Coupe, 900 I Convertible, 9000 Hatchback	SVB12710	SEAT	IBIZA II (6K1), TERRA (24), TERRA Box (024A)
CHRYSLER	LE BARON, LE BARON Convertible, VOYAGER I (ES)	SKODA	FAVORIT (781), FAVORIT Forman (785)	VW	GOLF II (19E, 1G1), JETTA II (19E, 1G2), POLO (86C, 80), POLO Box (86CF), POLO CLASSIC (86C, 80), POLO Coupe (86C, 80)	
DAIHATSU	CUORE I (L55, L60)	TALBOT	HORIZON, SOLARA	SVB12735	FORD	GALAXY (WGR)
FIAT	REGATA (138)	TOYOTA	DYNA Flatbed / Chassis, HIACE II Box (H5_), HIACE II Wagon (H5_), HILUX Pickup (N_), LAND CRUISER (J7_)	SEAT	ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L)	
HYUNDAI	H100 Bus (P)	VAUXHALL	CARLTON Mk II, CARLTON Mk II Estate	VW	CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV (1J1), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), VENTO (1H2)	
MAZDA	323 II (BD), 323 II Hatchback (BD), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), RX 7 II (FC)	VOLVO	240 (P242, P244), 240 Kombi (P245), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765)	SVB12760	FORD	ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), E SCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ORION II (AFF) CHEROKEE (XJ)
MERCEDES-BENZ	/8 (W114), /8 (W115), /8 Coupe (W114), COUPE (C123), G-CLASS (W460), KOMBI Estate (S123), Saloon (W123), S-CLASS (W116), S-CLASS (W126), SL (R107), SL Coupe (C107), T1 Box (601), T1 Box (602), T1 Bus (601), T1 Flatbed / Chassis (601), T1 Flatbed / Chassis (602)	VW	TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	JEEP	CHEROKEE (XJ)	
MITSUBISHI	L 300 Box (L03_P), L 300 Bus (L03_P/G, L0_2P), PAJERO CLASSIC (V2_W), PAJERO III (V60, V70)	SVB10990	ALFA ROMEO	75 (162B), 90 (162), RZ, SZ	RENAULT	21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE II (I/S63_), FUEGO (136_), MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), SAFRANE I (B54_), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)
OPEL	OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), REKORD E (17_19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), SENATOR B (29_)	BMW	5 (E28), 5 (E34)	SEAT	ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L)	
TOYOTA	CARINA Station Wagon (TA4K, TA6K)	CHEVROLET	S10 Pick Up	VW	CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV (1J1), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), VENTO (1H2)	
VAUXHALL	CARLTON Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, SENATOR Mk II	CHRYSLER	LE BARON, LE BARON Convertible, VOYAGER I (ES)	SVB11790	SEAT	ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L)
VOLVO	240 (P242, P244), 240 Kombi (P245)	FORD	SIERRA Hatchback (GBC, GBG)	VW	CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV (1J1), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), VENTO (1H2)	
VW	ILTIS (183), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis, TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	ISUZU	TROOPER, TROOPER Open Off-Road Vehicle	SVB12528	AUDI	A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5),
SVB10975		MERCEDES-BENZ	S-CLASS (W126), S-CLASS Coupe (C126), SL (R107), SL Coupe (C107)			
AUDI	100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3)	NISSAN	CHERRY (N12), PRAIRIE (M10, NM10), SUNNY I (B11), SUNNY I Coupe (B11), SUNNY I Traveller (B11)			
BMW	3 (E21), 5 (E12)	OPEL	MONTEREY B			
CITROËN	ID Break	TOYOTA	HIACE II Box (H5_), HIACE II Wagon (H5_), TERCEL (L1_, L2_), TERCEL (AL2_)			
DAIHATSU	CHARMANT (A)	VOLVO	240 (P242, P244), 240 Kombi (P245), 760 (704, 764), 760 Kombi (704, 765), 780			




  <p>SVB12775 FORD ESCORT '86 Express (AVF), ESCORT III (GAA), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ORION II (AFF), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)</p>	  <p>LANCER IV (C6_A, C7_A), LANCER IV Saloon (C6_A), SPACE WAGON (DO_V/W)</p> <p>SVB13655 HYUNDAI ACCENT (LC), COUPE (GK), COUPE (RD), ELANTRA (XD), ELANTRA Saloon (XD), GETZ (TB), LANTRA II (J-2), LANTRA II Wagon (J2), MATRIX (FC), SONATA I (Y-2), SONATA II (Y-3)</p>	  <p>L 300 Bus (PO_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), PAJERO I Open Off-Road Vehicle (L04_G), STARION (A18_A)</p> <p>NISSAN PRAIRIE (M10, NM10), SERENA (C23M), STANZA (T11), STANZA Hatchback (T11), VANETTE Box (C22), VANETTE Bus (C22)</p>
<p>SVB12785 FORD ESCORT III (GAA), ESCORT III Convertible (ALD), ESCORT IV Estate (AWF, AVF), ORION I (AFD)</p>	<p>KIA CERATO, CERATO Saloon, RIO II, RIO II Saloon</p> <p>MERCEDES-BENZ 100 Box (631), 100 Bus (631), 100 Flatbed / Chassis (631)</p>	<p>SVB13775 DAIHATSU ROCKY Hard Top (F7, F8), ROCKY Soft Top (F7, F8), TAFT, WILDCAT/ROCKY (F70), WILDCAT/ROCKY (F75)</p>
<p>SVB12795 FORD ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT '91 Express (AVL), ESCORT III (GAA), ESCORT III Convertible (ALD), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA III (GFJ), ORION I (AFD), ORION II (AFF), ORION III (GAL)</p>	<p>MITSUBISHI COLT III (C5_A), GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), LANCER IV (C6_A, C7_A), LANCER IV Saloon (C6_A), SAPPORO III (E16A), SPACE WAGON (N3_W, N4_W)</p> <p>SVB13675 HYUNDAI ACCENT (X-3), COUPE (RD), LANTRA I (J-1), LANTRA II (J-2), LANTRA II Wagon (J2), PONY, PONY (X-2), PONY Saloon, SANTAMO, SONATA II (Y-3)</p> <p>KIA JOICE</p> <p>MITSUBISHI COLT II (C1_A), COLT III (C5_A), ECLIPSE I (D2_A), GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), LANCER III (C1_A, C6_A), LANCER III Station Wagon (C1_V, C3_V), SANTAMO, SPACE WAGON (DO_V/W)</p>	<p>FIAT CROMA (154)</p> <p>HYUNDAI ATOS (MX), ATOS PRIME (MX)</p> <p>IVECO Daily III</p> <p>KIA RETONA (CE), SPORTAGE (K00)</p> <p>MAZDA E 2000, 2200 Box (SR2), E 2000, 2200 Bus (SR1)</p> <p>NISSAN PATROL GR I (Y60), PATROL Hardtop (K260), PATROL Station Wagon (W260), PICK UP (D22)</p> <p>SEAT RONDA (Q22A)</p> <p>SVB13780 DAIHATSU ROCKY Hard Top (F7, F8), ROCKY Soft Top (F7, F8)</p> <p>HYUNDAI GALLOPER I, GALLOPER II (JK-01), TERRACAN (HP)</p> <p>MERCEDES-BENZ /8 (W114), /8 Coupe (W114), S-CLASS (W116), SL (R107), SL Coupe (C107)</p> <p>MITSUBISHI GALLOPER (JK-01), L 200 (K__T), PAJERO I (L04_G, L14_G), PAJERO I Open Off-Road Vehicle (L04_G)</p> <p>NISSAN BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11)</p>
<p>SVB12825 AUDI 100 (44, 44Q, C3), 100 (4A, C4), 100 Avant (44, 44Q, C3), 100 Avant (4A, C4), 200 (44, 44Q), 200 Avant (44, 44Q), QUATTRO (85)</p>	<p>NISSAN SUNNY Box (Y10), SUNNY II (N13), SUNNY II Hatchback (N13), SUNNY II Traveller (B12)</p> <p>SVB13710 ALFA ROMEO 75 (162B)</p> <p>FIAT TEMPRA (159), TEMPRA S.W. (159), TIPO (160)</p> <p>MAZDA 626 III (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV)</p> <p>MERCEDES-BENZ 100 Box (631), 100 Bus (631), 100 Flatbed / Chassis (631)</p>	<p>SVB13800 ALFA ROMEO 164 (164)</p> <p>AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), CABRIOLET (8G7, B4), COUPE (81, 85), COUPE (89, 8B)</p>
<p>SVB12865 AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), CABRIOLET (8G7, B4), COUPE (81, 85), COUPE (89, 8B)</p> <p>FORD TRANSIT Box (V__), TRANSIT Bus (V__), TRANSIT Flatbed / Chassis (V__)</p> <p>VW GOLF II (19E, 1G1), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I)</p>	<p>SVB13725 LAND ROVER 90/110 (DHMC), DEFENDER (LD), DEFENDER Station Wagon (LD)</p> <p>MAZDA B-SERIE (UF)</p> <p>NISSAN BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11)</p> <p>RENAULT 25 (B29__), ESPACE II (J/S63_)</p>	<p>BMW 3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E12), 5 (E28), 5 (E34), 6 (E24), 7 (E23)</p> <p>DAIHATSU CHARMANT (AI)</p> <p>FIAT CROMA (154)</p> <p>HYUNDAI GALLOPER II (JK-01)</p> <p>IVECO Daily I</p> <p>JAGUAR XJ, XJS Coupe, XJSC Convertible</p> <p>LANCIA THEMA (834), THEMA SW (834)</p> <p>LAND ROVER 88/109, 88/109 Hardtop, 90/110 (DHMC)</p> <p>MAZDA RX 7 I (SA)</p> <p>MITSUBISHI COLT IV (CA_A), LANCER V (CB/D_A), PAJERO I (L04_G, L14_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W)</p>
<p>SVB12875 FORD SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG)</p>	<p>NISSAN BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11)</p> <p>RENAULT 25 (B29__), ESPACE II (J/S63_)</p>	<p>BMW 3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E12), 5 (E28), 5 (E34), 6 (E24), 7 (E23)</p> <p>DAIHATSU CHARMANT (AI)</p> <p>FIAT CROMA (154)</p> <p>HYUNDAI GALLOPER II (JK-01)</p> <p>IVECO Daily I</p> <p>JAGUAR XJ, XJS Coupe, XJSC Convertible</p> <p>LANCIA THEMA (834), THEMA SW (834)</p> <p>LAND ROVER 88/109, 88/109 Hardtop, 90/110 (DHMC)</p> <p>MAZDA RX 7 I (SA)</p> <p>MITSUBISHI COLT IV (CA_A), LANCER V (CB/D_A), PAJERO I (L04_G, L14_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W)</p>
<p>SVB12885 FORD SCORPIO I (GAE, GGE), SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG)</p> <p>VOLVO 240 (P242, P244), 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945)</p>	<p>SVB13750 ALFA ROMEO 155 (167), 164 (164)</p> <p>ARO 240-244</p> <p>FIAT COUPE (FA/175), CROMA (154), TEMPRA (159), TEMPRA S.W. (159), TIPO (160)</p> <p>HYUNDAI H-1 Bus (KMF), H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup</p> <p>ISUZU CAMPO (KB), TROOPER Open Off-Road Vehicle (UBS)</p>	<p>NISSAN ALMERA I (N15), ALMERA I Hatchback (N15), CHERRY (N12), PRAIRIE (M10, NM10), PRIMERA (P10), PRIMERA Hatchback (P10), PRIMERA Traveller (W10), SUNNY I (B11), SUNNY I Coupe (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10)</p> <p>TOYOTA COROLLA Coupe (AE86), TERCEL (L1_, L2_), TERCEL (AL2_)</p> <p>VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512),</p>
<p>SVB12915 VW KAEFER, KAEFER Convertible (15)</p>	<p>IVECO Daily I</p> <p>JAGUAR XJ</p> <p>LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836), KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), THEMA (834), THEMA SW (834)</p>	<p>NISSAN ALMERA I (N15), ALMERA I Hatchback (N15), CHERRY (N12), PRAIRIE (M10, NM10), PRIMERA (P10), PRIMERA Hatchback (P10), PRIMERA Traveller (W10), SUNNY I (B11), SUNNY I Coupe (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10)</p> <p>TOYOTA COROLLA Coupe (AE86), TERCEL (L1_, L2_), TERCEL (AL2_)</p> <p>VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512),</p>
<p>SVB12950 SEAT TOLEDO I (1L)</p> <p>VW GOLF II (19E, 1G1), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I)</p>	<p>LAND ROVER 88/109, 88/109 Hardtop, 90/110 (DHMC)</p> <p>MAZDA 929 II (HB), 929 II Coupe (HB)</p> <p>MERCEDES-BENZ /8 (W115), 190 (W201), COUPE (C123), G-CLASS (W460), G-CLASS (W461), G-CLASS Cabrio (W463), KOMBI Estate (S123), Saloon (W123), Saloon (W124)</p>	<p>NISSAN ALMERA I (N15), ALMERA I Hatchback (N15), CHERRY (N12), PRAIRIE (M10, NM10), PRIMERA (P10), PRIMERA Hatchback (P10), PRIMERA Traveller (W10), SUNNY I (B11), SUNNY I Coupe (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10)</p> <p>TOYOTA COROLLA Coupe (AE86), TERCEL (L1_, L2_), TERCEL (AL2_)</p> <p>VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512),</p>
<p>SVB13610 MITSUBISHI COLT IV (CA_A), LANCER V (CB/D_A)</p>	<p>LAND ROVER 88/109, 88/109 Hardtop, 90/110 (DHMC)</p> <p>MAZDA 929 II (HB), 929 II Coupe (HB)</p> <p>MERCEDES-BENZ /8 (W115), 190 (W201), COUPE (C123), G-CLASS (W460), G-CLASS (W461), G-CLASS Cabrio (W463), KOMBI Estate (S123), Saloon (W123), Saloon (W124)</p>	<p>NISSAN ALMERA I (N15), ALMERA I Hatchback (N15), CHERRY (N12), PRAIRIE (M10, NM10), PRIMERA (P10), PRIMERA Hatchback (P10), PRIMERA Traveller (W10), SUNNY I (B11), SUNNY I Coupe (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10)</p> <p>TOYOTA COROLLA Coupe (AE86), TERCEL (L1_, L2_), TERCEL (AL2_)</p> <p>VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512),</p>
<p>SVB13625 HYUNDAI LANTRA I (J-1), PONY (X-2), PONY/EXCEL Saloon (X-2), S COUPE (SLC)</p> <p>MITSUBISHI COLT II (C1_A), COLT III (C5_A), GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), LANCER III (C1_A, C6_A), LANCER III Station Wagon (C1_V, C3_V),</p>	<p>MITSUBISHI L 200 (K__T), L 300 Box (L03_P), L 300 Box (PO_W, P1_W),</p>	<p>TOYOTA COROLLA Coupe (AE86), TERCEL (L1_, L2_), TERCEL (AL2_)</p> <p>VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512),</p>



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits


					
	LT 40-55 I Flatbed / Chassis (293-909), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)		626 III Station Wagon (GV), 626 IV (GE), 626 IV Hatchback (GE), 929 II (HB), 929 II Coupe (HB), B-SERIE (UF)		MITSUBISHI GALANT IV (E3_A), GALANT IV Saloon (E3_A), L 200 (K_T), PAJERO II (V2_W, V4_W), PAJERO SPORT (K90) NISSAN CHERRY (N12), LAUREL (JC31), LAUREL (JC32), PATHFINDER (R50), PATROL Hardtop (K160), PATROL Station Wagon (W160), PRAIRIE (M10, NM10), SUNNY I (B11), SUNNY I Traveller (B11) OPEL CALIBRA A (85_), CAMPO (TF_), CORSA A Box, CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) RENAULT 18 (134_), 18 Variable (135_), 25 (B29_), FUEGO (136_) TOYOTA CARINA II (_T15_), CARINA II Saloon (_T15_), CELICA (ST16_), CELICA Hatchback (T16), DYNA Flatbed / Chassis, HIACE II Box (H5_), HIACE II Wagon (H5_), HILUX Pickup (_N_), LAND CRUISER (_J7_), LAND CRUISER Hardtop (_J7_) VAUXHALL ASTRA Mk II Hatchback, BRAVA Pickup, CALIBRA, CAVALIER Mk II, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, MIDI, NOVA, NOVA Hatchback, NOVAVAN VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909), TARO
SVB13825		MERCEDES-BENZ S-CLASS (W116), SL (R107), SL Coupe (C107) NISSAN ALMERA I (N15), ALMERA I Hatchback (N15), PRIMERA (P10), PRIMERA (P11), PRIMERA Hatchback (P10), PRIMERA Hatchback (P11), PRIMERA Traveller (W10), PRIMERA Traveller (WP11), SERENA (C23M), SILVIA (S12), SUNNY Box (Y10), SUNNY II (N13), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10), URVAN Box (E24), URVAN Bus (E23), URVAN Bus (E24), VANETTE Box (C22), VANETTE Bus (KC120), VANETTE CARGO Box (HC 23), VANETTE CARGO Bus (HC 23) RENAULT 18 (134_), 18 Variable (135_), FUEGO (136_) ROVER 2000-3500 Hatchback (SD1) SUZUKI GRAND VITARA (FT, GT), VITARA (ET, TA) TOYOTA CAMRY Liftback (V1), CAMRY Saloon (V1), CARINA II (_T15_), CARINA II (_T17_), CARINA II Saloon (_T15_), CARINA II Saloon (_T17_), CARINA II Station Wagon (_T17_), COROLLA (_E8_), COROLLA (_E9_), COROLLA Compact (_E9_), COROLLA FX Compact (E8B), COROLLA Liftback (_E8_), COROLLA Liftback (_E9_), COROLLA Station Wagon (_E7_), COROLLA Station Wagon (_E9_), DYNA Flatbed / Chassis, HIACE III Box (_H10_), HIACE III Wagon (_H10_), HILUX Pickup (_N_)		SVB13882 IVECO Daily I	
SVB13840	FIAT CINQUECENTO (170)	SVB13875 ALFA ROMEO 155 (167), 164 (164) AUDI 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) BEDFORD MIDI Box, MIDI Bus DAEWOO ESPERO (KLEI) DAIHATSU ROCKY Hard Top (F7, F8), ROCKY Soft Top (F7, F8) FIAT COUPE (FA/175), CROMA (154), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) ISUZU CAMPO (KB), TROOPER Open Off-Road Vehicle (UBS) IVECO Daily I JAGUAR XJ KIA BESTA Box, K2700 (SD), PREGIO Box (TB) LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836), KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), THEMA (834), THEMA SW (834) LAND ROVER RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN) MAZDA 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), 929 I (LA), 929 II (HB), 929 II Coupe (HB), 929 II Station Wagon (HV), E 2000,2200 Box (SR2), E 2000,2200 Bus (SR1) MERCEDES-BENZ 190 (W201), COUPE (C123), G-CLASS (W460), G-CLASS (W461), G-CLASS Cabrio (W463), KOMBI Estate (S123), Saloon (W123), Saloon (W124), S-CLASS (W126), S-CLASS Coupe (C126), SL (R107), SL Coupe (C107)	SVB13890 ISUZU TROOPER Open Off-Road Vehicle (UBS) LDV 400 Box, 400 Bus, 400 Flatbed / Chassis		
SVB13850	ALFA ROMEO 75 (162B), 90 (162), 155 (167), 164 (164) ARO 240-244 BMW 3 Touring (E30), 5 (E34), 7 (E32) DAEWOO LANOS (KLAT), LANOS Saloon (KLAT) DAIHATSU CHARMANT (A) FIAT CINQUECENTO (170), COUPE (FA/175), CROMA (154), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) FORD ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ORION II (AFF) HONDA CIVIC II, CIVIC II Hatchback (AL, AJ, AG, AH) HYUNDAI PONY (X-2), PONY/EXCEL Saloon (X-2), S COUPE (SLC) KIA RETONA (CE), SPORTAGE (K00) LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836), THEMA (834), THEMA SW (834) LAND ROVER 88/109, 90/110 (DHMC), RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN) MAZDA 323 F VI (B), 323 P V (BA), 323 S VI (B), 626 III (GD), 626 III Hatchback (GD),	SVB13900 AUDI 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3), 200 (43), 200 (44, 44Q) BEDFORD MIDI Box, MIDI Bus BMW 3 (E30) DAIHATSU ROCKY Hard Top (F7, F8), ROCKY Soft Top (F7, F8), TAFT, WILDCAT/ROCKY (F70), WILDCAT/ROCKY (F75) FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG) HONDA INTEGRA (DA_) ISUZU CAMPO (KB), TROOPER Open Off-Road Vehicle (UBS) IVECO Daily III KIA RETONA (CE), SPORTAGE (K00) MAZDA 323 C IV (BG), 323 F IV (BG), 323 F VI (B), 323 III Station Wagon (BW), 323 S IV (BG), 323 S VI (B), 626 III (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), 929 I (LA), 929 II (HB), 929 II Coupe (HB), 929 II Station Wagon (HV), E 2000,2200 Box (SR2), E 2000,2200 Bus (SR1), MX-5 I (NA), PREMACY (CP) MERCEDES-BENZ S-CLASS (W126), SL (R107) MITSUBISHI GALANT IV (E3_A), GALANT IV Saloon (E3_A), L 200, L 400 Box (PAOV), L 400 Bus (PAOV),	SVB13900 AUDI 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3), 200 (43), 200 (44, 44Q) BEDFORD MIDI Box, MIDI Bus BMW 3 (E30) DAIHATSU ROCKY Hard Top (F7, F8), ROCKY Soft Top (F7, F8), TAFT, WILDCAT/ROCKY (F70), WILDCAT/ROCKY (F75) FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG) HONDA INTEGRA (DA_) ISUZU CAMPO (KB), TROOPER Open Off-Road Vehicle (UBS) IVECO Daily III KIA RETONA (CE), SPORTAGE (K00) MAZDA 323 C IV (BG), 323 F IV (BG), 323 F VI (B), 323 III Station Wagon (BW), 323 S IV (BG), 323 S VI (B), 626 III (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), 929 I (LA), 929 II (HB), 929 II Coupe (HB), 929 II Station Wagon (HV), E 2000,2200 Box (SR2), E 2000,2200 Bus (SR1), MX-5 I (NA), PREMACY (CP) MERCEDES-BENZ S-CLASS (W126), SL (R107) MITSUBISHI GALANT IV (E3_A), GALANT IV Saloon (E3_A), L 200, L 400 Box (PAOV), L 400 Bus (PAOV),		







 	 	 
<p>NISSAN SPACE GEAR (PA/B/D_V/W) ALMERA II (N16), ALMERA II Hatchback (N16), ALMERA TINO (V10), BLUEBIRD (T72 , T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11), LAUREL (JC31), LAUREL (JC32), PATROL GR I (Y60), PATROL GR II (Y61), PATROL Hardtop (K160), PATROL Hardtop (K260), PATROL Station Wagon (W160), PATROL Station Wagon (W260), PICK UP (D22), PRAIRIE (M10, NM10), PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P12), TERRANO I (WD21), X-TRAIL (T30)</p> <p>OPEL COMBO (71_), CORSA B (73_, 78_, 79_, F35_), CORSA B Box (73_)</p> <p>PEUGEOT 305 II (581M), 305 II Break (581E)</p> <p>TOYOTA 4 RUNNER (N130), MODELL F Bus (R2_, 31)</p> <p>VAUXHALL COMBO, CORSA, CORSAVAN, MIDI, MIDI II</p> <p>VOLVO 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945), 960 (964), 960 Kombi (965) PASSAT Variant (32B)</p> <p>VW</p>	<p>OPEL SUNNY II Traveller (B12), TERRANO I (WD21), TERRANO II (R20), URVAN Box (E24), URVAN Bus (E23), URVAN Bus (E24), VANETTE Box (C22), VANETTE Bus (C22) ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), COMBO (71_), CORSA B (73_, 78_, 79_, F35_), CORSA B Box (73_), KADETT E (39_, 49_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Hatchback (38_) 25 (B29_), ESPACE II (I/S63_)</p> <p>RENAULT 1800 XT COUPE (XT), LEONE II, LEONE II Estate</p> <p>SUBARU GRAND VITARA (FT, GT), VITARA (ET, TA)</p> <p>SUZUKI DYNA Flatbed / Chassis, HIACE II Box (H5_), HIACE II Wagon (H5_)</p> <p>TOYOTA</p> <p>VAUXHALL ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, VECTRA, VECTRA Hatchback 240 (P242, P244), 240 Kombi (P245), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 Kombi (945), 960 (964), 960 Kombi (965)</p>	<p>RENAULT 19 I (B/C53_), 19 I Box (S53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_)</p> <p>SEAT IBIZA I (021A), MALAGA (023A), TOLEDO I (1L)</p> <p>SUBARU 1800 XT COUPE (XT), LEONE II, LEONE II Estate</p> <p>TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CAMRY (V2_), CAMRY Station Wagon (V2_), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), CARINA II (T17_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CELICA (TA60, RA40, RA6_), CELICA Coupe (TA4C, TA60), COROLLA (E9_), COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E9_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA Liftback (E9_), COROLLA Liftback (E10_), COROLLA Liftback (E11_), COROLLA Station Wagon (E9_), COROLLA Wagon (E11_), COROLLA Wagon (E10_), CROWN Saloon (S1_), DYNA Flatbed / Chassis, HIACE II Box (H5_), HIACE II Wagon (H5_), PICNIC (XM10)</p> <p>VAUXHALL MIDI</p> <p>VOLVO 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945)</p> <p>VW CORRADO (53I), GOLF I (17), GOLF I Cabriolet (155), GOLF II (19E, 1G1), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), SCIROCCO (53B)</p>
<p>SVB13925</p> <p>ALFA ROMEO 75 (162B), 90 (162)</p> <p>AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), 100 (44, 44Q, C3), 100 Avant (44, 44Q, C3), 200 (44, 44Q), 200 Avant (44, 44Q), CABRIOLET (8G7, B4), COUPE (81, 85), COUPE (89, 8B)</p> <p>DAIHATSU CHARMANT (A)</p> <p>FIAT CROMA (154)</p> <p>FORD MAVERICK (UDS, UNS)</p> <p>HYUNDAI GALLOPER I, GALLOPER II (JK-01), H-1 Box, H-1 Bus (KMF), H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup</p> <p>KIA K2500 (SD), K2700 (SD), PREGIO Box (TB)</p> <p>LANCIA THEMA (834), THEMA SW (834)</p> <p>LAND ROVER 88/109, 90/110 (DHMC), DISCOVERY I, RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN)</p> <p>MAZDA 323 C IV (BG), 323 III Station Wagon (BW), 323 S IV (BG), 626 II (GC), 626 II Hatchback (GC), 626 III Station Wagon (GV), 626 IV (GE), 626 IV Hatchback (GE), E 2000, 2200 Box (SR2)</p> <p>MERCEDES-BENZ KOMBI Estate (S123), Saloon (W123), S-CLASS (W126), S-CLASS Coupe (C126), SL (R107)</p> <p>MITSUBISHI 3000 GT (Z16A), GALANT III (E1_A), GALLOPER (JK-01), L 300 Box (PO_W, P1_W), L 300 Bus (PO_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), PAJERO CLASSIC (V2_W), PAJERO I (L04_G, L14_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), PAJERO III (V60, V70), SIGMA (F16A), SIGMA Station Wagon (F07W), SPACE WAGON (N3_W, N4_W)</p> <p>NISSAN 300 ZX (Z31), LAUREL (JC31), LAUREL (JC32), PATROL Hardtop (K160), PATROL Hardtop (K260), PATROL Station Wagon (W160), PATROL Station Wagon (W260), PICK UP (D21), PICK UP (D22), SERENA (C23M), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13),</p>	<p>SVB13950</p> <p>ALFA ROMEO 33 (905), 33 (907A), 33 Sport Wagon (907B), 33 Sportswagon (905A), 145 (930), 146 (930), ALFASUD Coupe (902A)</p> <p>AUDI 100 (44, 44Q, C3), 100 Avant (44, 44Q, C3), 200 (44, 44Q), 200 Avant (44, 44Q), QUATTRO (85)</p> <p>BEDFORD MIDI Box, MIDI Bus</p> <p>DAIHATSU CHARMANT (A)</p> <p>FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE)</p> <p>HYUNDAI H-1 Box, H-1 Bus (KMF), SONATA I (Y-2), STAREX (H1)</p> <p>ISUZU CAMPO (KB), TROOPER Open Off-Road Vehicle (UBS)</p> <p>KIA PREGIO Box (TB)</p> <p>MAZDA 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), 929 I (LA), 929 II (HB), 929 II Coupe (HB), 929 II Station Wagon (HV), 929 III (HC), B-SERIE (UF), B-SERIE (UN), E 2000, 2200 Box (SR2), E 2000, 2200 Bus (SR1), MPV I (LV)</p> <p>MERCEDES-BENZ G-CLASS (W460), S-CLASS (W126), S-CLASS Coupe (C126), SL (R107)</p> <p>MITSUBISHI GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), L 300 Box (PO_W, P1_W), L 300 Bus (PO_W, P1_W, P2_W), LANCER V (CB/D_A), LANCER V Station Wagon (CB_W, CD_W), PAJERO I Open Off-Road Vehicle (L04_G), PAJERO II (V2_W, V4_W), SPACE RUNNER (N1_W, N2_W), SPACE WAGON (DO_V/W), SPACE WAGON (N3_W, N4_W)</p> <p>NISSAN PATROL GR I (Y60), PATROL Hardtop (K160), PATROL Station Wagon (W160), PICK UP (720), SERENA (C23M), VANETTE CARGO Box (HC 23), VANETTE CARGO Bus (HC 23)</p> <p>PORSCHE 928</p>	<p>SVB13975</p> <p>ALFA ROMEO 164 (164)</p> <p>BMW 5 (E34), 5 Touring (E34)</p> <p>FORD TRANSIT Box (E_), TRANSIT Bus (E_), TRANSIT Flatbed / Chassis (E_)</p> <p>HYUNDAI H-1 Box, H-1 Bus (KMF), H100 Bus (P), PORTER Box, PORTER Pickup, SONATA I (Y-2), SONATA II (Y-3), STAREX (H1), TERRACAN (HP)</p> <p>JAGUAR XJ (X300), XJ (XJ 40, 81), XJS Coupe, XJS Convertible</p> <p>JEEP CHEROKEE (XJ)</p> <p>MAZDA 323 S V (BA), B-SERIE (UD), B-SERIE (UF), B-SERIE (UN), BT-50, RX 7 II (FC)</p> <p>MERCEDES-BENZ G-CLASS (W460)</p> <p>MITSUBISHI L 300 Box (L03_P), L 300 Box (PO_W, P1_W), L 300 Bus (L03_P/G, L0_2P), L 300 Bus (PO_W, P1_W, P2_W), PAJERO CLASSIC (V2_W), PAJERO III (V60, V70), PAJERO SPORT (K90), STARION (A18_A)</p> <p>NISSAN ALMERA II (N16), ALMERA II Hatchback (N16), ALMERA TINO (V10), PATROL Hardtop (K160), PATROL Hardtop (K260), PATROL Station Wagon (W160), PATROL Station Wagon (W260), PICK UP (720), PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P12), X-TRAIL (T30)</p> <p>PORSCHE 928</p> <p>SUBARU 1800 XT COUPE (XT), LEONE II, LEONE II Estate</p> <p>TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CARINA Station Wagon (TA4K, TA6K), LITEACE Box (CM3_V, KM3_V), LITEACE Bus (CM30_G, KM30_G),</p>



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits

 	 	 
<p>VOLVO MODELL F Bus (R2_, 31), TERCEL (L1_, L2_), TERCEL (AL2_) 240 (P242, P244), 240 Kombi (P245), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945)</p>	<p>LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)</p>	<p>OPEL PAJERO SPORT (K90) MONZA A (22_), REKORD E (17_-19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), SENATOR A (29_)</p>
<p>SVB17850 NISSAN PRAIRIE (M10, NM10) TOYOTA LAND CRUISER (J6_)</p>	<p>SVB101025 ALFA ROMEO GIULIETTA (116) AUDI 100 (43, C2), 100 Avant (43, C2) BMW 3 (E30), 3 (E36), 3 Coupe (E36), 5 (E34), 5 Touring (E34)</p>	<p>ROVER 800 (XS), 800 Coupe, 800 Hatchback (XS) SEAT RONDA (022A) TOYOTA TERCEL (L1_, L2_), TERCEL (AL2_) VAUXHALL CARLTON Mk II, CARLTON Mk II Estate, ROYALE, ROYALE Coupe</p>
<p>SVB101000 AUTOBIANCHI Y10 BMW 3 (E30), 3 Touring (E30), 5 (E28), 5 (E34) CHRYSLER LE BARON, LE BARON Convertible CITROËN CX II, CX II Break FIAT 127, 127 Panorama, DUNA (146 B), DUNA Weekend (146 B), FIORINO (127), FIORINO (147), FIORINO Box (146 Uno), FIORINO Pick up (146), FIORINO Pick up (147), RITMO I (138A), UNO (146A/E)</p>	<p>CITROËN XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) FIAT CROMA (154), PANDA (141A_) GAZ VOLGA (3102), VOLGA Estate (3102) ISUZU TROOPER (UB), TROOPER Open Off-Road Vehicle (UB)</p>	<p>VOLVO 760 (704, 764), 760 Kombi (704, 765) VW TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis, TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>
<p>FORD SIERRA Estate (BNC), SIERRA Hatchback (GBC) JAGUAR XJ (X300), XJS Coupe, XJS Convertible LANCIA Y10 (156)</p>	<p>LAND ROVER 88/109, 88/109 Hardtop, 90/110 (DHMC), DEFENDER (LD), DEFENDER Station Wagon (LD) LDV SHERPA Bus (FR)</p>	<p>WARTBURG 353, 353 Tourist</p>
<p>MERCEDES-BENZ 190 (W201), COUPE (C123), G-CLASS (W460), G-CLASS (W461), G-CLASS Cabrio (W463), KOMBI Estate (S123), Saloon (W123), Saloon (W124), S-CLASS (W116), S-CLASS (W126), S-CLASS Coupe (C126), SL (R107), SL Coupe (C107), T1 Box (601), T1 Bus (601), T1 Flatbed / Chassis (601)</p>	<p>MERCEDES-BENZ KOMBI Estate (S123) OPEL FRONTERA A Sport (5_SUD2), MONTEREY A (UBS_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_)</p>	<p>SVB101090 ALFA ROMEO 164 (164) CHRYSLER LE BARON, LE BARON Convertible, VOYAGER I (ES) CITROËN XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) FIAT CROMA (154)</p>
<p>OPEL CALIBRA A (85_), FRONTERA A Sport (5_SUD2), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)</p>	<p>PEUGEOT 505 (551A), 505 Break (551D), J9 Box, J9 Bus, J9 Flatbed / Chassis</p>	<p>HYUNDAI H-1 Box, H-1 Bus (KMF), PORTER Box, PORTER Pickup JEEP CHEROKEE, CHEROKEE (XJ), WRANGLER I (YI, SJ_), WRANGLER II (TJ)</p>
<p>PEUGEOT 504 (A_, M_), 504 Convertible, 504 Coupe, 505 (551A), 505 Break (551D), 605 (6B)</p>	<p>PORSCHE 911, 911 Targa RENAULT 25 (B29_), MASTER I Box (T_), MASTER I Bus (T_), TRAFIC Box (T1, T3, T4), TRAFIC Bus (T5, T6, T7), TRAFIC Flatbed / Chassis (P6)</p>	<p>LANCIA THEMA (834) MITSUBISHI L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), PAJERO II Open Off-Road Vehicle (V2_W, V4_W)</p>
<p>RENAULT 18 (134_), 18 Variable (135_), 21 (B48_), 21 Estate (K48_), 21 Saloon (L48_), ESPACE I (J11_), ESPACE II (J/S63_), MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)</p>	<p>VAUXHALL CARLTON Mk III, CARLTON Mk III Estate, FRONTERA Sport, MONTEREY</p>	<p>SVB101100 ALFA ROMEO 75 (162B), 90 (162) CARBODIES FL2, FX4, FX4R FIAT ARGENTA (132A) FSO 132P HYUNDAI GALLOPER I, GALLOPER II (JK-01), H-1 Box, H-1 Bus (KMF), H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup, STAREX (H1)</p>
<p>SKODA 100, 105, 120 (742), 105, 120 (744), 110, 110 Coupe, 130</p>	<p>VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)</p>	<p>MERCEDES-BENZ S-CLASS (W126), S-CLASS Coupe (C126), SL (R107), SL Coupe (C107)</p>
<p>TOYOTA COASTER Bus, LAND CRUISER (J7_), LAND CRUISER 80 (J8_), LAND CRUISER 100 (J10_)</p>	<p>SVB101050 CHRYSLER LE BARON, LE BARON Convertible, NEON (PL), VOYAGER I (ES) DODGE NEON FIAT REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A)</p>	<p>MITSUBISHI GALLOPER (JK-01), L 300 Flatbed / Chassis (P1_T), L 400 Box (PAOV), L 400 Bus (PAOV), SPACE GEAR (PA/B/D_V/W)</p>
<p>VAUXHALL CALIBRA, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, FRONTERA Sport</p>	<p>HONDA LEGEND I (HS, KA), LEGEND I Coupe (KA3) IVECO Daily I LANCIA DELTA I (831AB0), PRISMA (831AB0) LAND ROVER 88/109, 88/109 Hardtop, 90/110 (DHMC) MAZDA 323 P V (BA), 323 S V (BA) NISSAN BLUEBIRD (U11) PEUGEOT 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D), 604 (561A_) PORSCHE 924 ROVER 800 (XS), 2000-3500 Hatchback (SD1) SKODA 100, 110, 110 Coupe TALBOT TAGORA UAZ 3160</p>	<p>PEUGEOT 504 Coupe, 604 (561A_) ROVER 2000-3500 Hatchback (SD1) VAUXHALL ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback VOLVO 240 (P242, P244), 240 Kombi (P245), 760 (704, 764), 760 Kombi (704, 765), 780 VW TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis</p>
<p>SVB101010 BMW 3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E34) RENAULT 18 (134_), 18 Box, 18 Variable (135_), FUEGO (136_), TRAFIC Box (T1, T3, T4), TRAFIC Bus (T5, T6, T7), TRAFIC Flatbed / Chassis (P6) VOLVO 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945), 960 (964), 960 Kombi (965) VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363),</p>	<p>TOYOTA COASTER Bus</p>	<p>SVB101113 ARO 240-244</p>
	<p>SVB101060 FIAT 127, 127 Panorama, FIORINO (147), FIORINO Pick up (147), PANDA (141A_), UNO (146A/E) TOYOTA COASTER Bus</p>	<p>SVB101125 CITROËN C15 (VD_), XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) LANCIA THEMA (834) PEUGEOT 504 (A_, M_), 504 Break (D_, F_), 504 Pickup (E_), 505 (551A), 505 Break (551D), 604 (561A_) ROVER 2000-3500 Hatchback (SD1) TALBOT TAGORA TOYOTA CRESSIDA Saloon (X6_) VOLVO 240 (P242, P244), 240 Kombi (P245) VW GOLF I (17), SCIROCCO (53B)</p>
	<p>SVB101075 FIAT ARGENTA (132A) FORD SIERRA Estate (BNC), SIERRA Hatchback (GBC) HONDA LEGEND I (HS, KA) IVECO Daily I MITSUBISHI L 200 (K_T), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W),</p>	<p>SVB101140 CHEVROLET S10 Pick Up</p>







  <p>MERCEDES-BENZ S-CLASS (W126) NISSAN PATROL GR I (Y60) PEUGEOT 504 (A, M,), 504 Break (D, F,), 504 Pickup (E,), 505 (551A), 505 Break (551D) RENAULT 5 (122,), 9 (L42,), 11 (B/C37,), 11 Box (S37,), 19 I (B/C53,), 19 I Box (S53,), 19 I Chamade (L53,), 19 II (B/C53,), 19 II Box (S53,), 19 II Chamade (L53,), 21 (B48,), 21 Saloon (L48,), CLIO I (B/C57, 5/357,), CLIO I Box (S57,), RAPID Box (F40, G40,), SUPER 5 (B/C40,), SUPER 5 Box (S40,) VW LT 28-35 I Box (281-363), LT 28-35 I Flatbed / Chassis (281-363), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	  <p>LAND ROVER 1310 Saloon (U, X), 88/109, 90/110 (DHMC), RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN) PEUGEOT J9 Box, J9 Bus, J9 Flatbed / Chassis RENAULT TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Flatbed / Chassis (P6)</p>	  <p>SVB121170 FORD SCORPIO I (GAE, GGE), SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG), TRANSIT Box (E,), TRANSIT Box (T,), TRANSIT Box (V,), TRANSIT Bus (E,), TRANSIT Bus (T,), TRANSIT Bus (V,), TRANSIT Flatbed / Chassis (E,), TRANSIT Flatbed / Chassis (T,)</p>
<p>SVB101150 ALFA ROMEO 33 (905), 33 (907A), 33 Sportwagon (905A) ARO SPARTANA CITROËN CX II, CX II Break MERCEDES-BENZ S-CLASS (W116), SL (R107), SL Coupe (C107) RENAULT 5 (122,), SUPER 5 (B/C40,), SUPER 5 Box (S40,), TWINGO (C06,), TWINGO Box (S06,) VOLVO 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945), 960 (964), 960 Kombi (965) VW GOLF I (17), SCIROCCO (53B), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD) WARTBURG 353, 353 Tourist</p>	<p>SVB101237 VOLVO 240 (P242, P244), 240 Kombi (P245), 340-360 (343, 345), 340-360 Saloon (344), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765)</p> <p>SVB101250 FORD TRANSIT Box (V,), TRANSIT Bus (V,), TRANSIT Flatbed / Chassis (V,) RENAULT SAFRANE I (B54,) SAAB 900 I (AC4, AM4), 900 I Combi Coupe WARTBURG 353, 353 Tourist</p>	<p>SVB131000 AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3), 200 (43), 200 (44, 44Q), 200 Avant (44, 44Q), CABRIOLET (8G7, B4), COUPE (81, 85), COUPE (89, 8B), QUATTRO (85) 5 (E34), 5 Touring (E34) BMW RANGER (TU,) FORD HYUNDAI H-1 Box, H-1 Bus (KMF), H100 Bus (P), STAREX (H1) ISUZU TROOPER Open Off-Road Vehicle (UBS) JAGUAR XJ LAND ROVER 88/109, 90/110 (DHMC), DISCOVERY I, RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN)</p>
<p>SVB101175 CITROËN C35 Box, C35 Bus, C35 Pickup FORD TRANSIT Box (V,), TRANSIT Bus (V,), TRANSIT Flatbed / Chassis (V,) MERCEDES-BENZ S-CLASS (W116), SL Coupe (C107) PEUGEOT 504 (A, M,), 504 Break (D, F,), 504 Pickup (E,), 505 (551A), 505 Break (551D) RENAULT 9 (L42,), 11 (B/C37,), 11 Box (S37,), 21 (B48,), 21 Saloon (L48,), SUPER 5 (B/C40,) SAAB 900 I (AC4, AM4), 900 I Combi Coupe, 900 I Convertible, 9000 Hatchback VW TRANSPORTER III Box, TRANSPORTER III Bus</p>	<p>SVB101275 JEEP CJ5 - CJ8 VOLVO 740 (744), 740 Kombi (745), 940 (944), 940 Kombi (945), 960 (964), 960 Kombi (965)</p> <p>SVB101300 CHEVROLET S10 Pick Up FORD TRANSIT Box (V,), TRANSIT Bus (V,), TRANSIT Flatbed / Chassis (V,) PEUGEOT J9 Box, J9 Bus, J9 Flatbed / Chassis RENAULT 18 (134,), 18 Box, 18 Variable (135,), FUEGO (136,)</p>	<p>MAZDA 929 I (LA), 929 II (HB), 929 II Coupe (HB), 929 II Station Wagon (HV), 929 III (HC), B-SERIE (JF), B-SERIE (UN), E 2000, 2200 Box (SR2), E 2000, 2200 Bus (SR1), MPV I (LV)</p>
<p>SVB101200 CHEVROLET S10 Pick Up CHRYSLER LE BARON, LE BARON Convertible, VOYAGER I (ES) JEEP CJ5 - CJ8 MERCEDES-BENZ S-CLASS (W116), SL (R107), SL Coupe (C107) PEUGEOT 305 II (581M), 305 II Break (581E) RENAULT 9 (L42,), 11 (B/C37,)</p>	<p>SVB101350 FORD TRANSIT Box (V,), TRANSIT Bus (V,) JEEP CHEROKEE, CJ5 - CJ8</p> <p>SVB101375 CHRYSLER VISION FORD SIERRA Estate (BNC), SIERRA Hatchback (GBC) TOYOTA COASTER Bus</p> <p>SVB101400 CHRYSLER 300 M (LR), NEW YORKER, VISION TOYOTA COASTER Bus VOLVO 240 (P242, P244), 240 Kombi (P245)</p>	<p>MERCEDES-BENZ G-CLASS (W460), S-CLASS (W116), T1 Box (601), T1 Box (602), T1 Bus (601), T1 Flatbed / Chassis (601), T1 Flatbed / Chassis (602) MITSUBISHI COLT II (C1_A), COLT III (C5_A), GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W), LANCER III (C1_A, C6_A), LANCER III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A), LANCER IV Saloon (C6_A), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), SPACE WAGON (D0_V/W), SPACE WAGON (N3_W, N4_W)</p>
<p>SVB101215 CHEVROLET S10 Pick Up CHRYSLER LE BARON, LE BARON Convertible, NEON (PL), VOYAGER I (ES) DODGE NEON LAND ROVER 90/110 (DHMC) PEUGEOT J9 Box, J9 Bus, J9 Flatbed / Chassis VOLVO 340-360 (343, 345), 340-360 Saloon (344)</p>	<p>SVB121015 FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) VOLVO 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945)</p> <p>SVB121030 JEEP CHEROKEE (XJ) RENAULT 21 (B48,), 21 Box (S48,), 21 Estate (K48,), 21 Saloon (L48,), 25 (B29,), ESPACE I (J11,), ESPACE II (J/S63,), MASTER I Flatbed / Chassis (P,), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)</p>	<p>NISSAN SILVIA (S12), URVAN Box (E23), URVAN Bus (E23) OPEL FRONTERA A (5_MWL4), FRONTERA A Sport (5_SUD2) PEUGEOT 505 (551A), 505 Break (551D), 604 (561A,) PORSCHKE 928 TOYOTA 4 RUNNER, 4 RUNNER (N130), CRESSIDA Saloon (X6,), CRESSIDA Station Wagon (X6K), CROWN Saloon (S1,), LAND CRUISER (J7,), LAND CRUISER 90 (J9,), LAND CRUISER Hardtop (J7,), LITEACE Box (R2_V), LITEACE Box (CM3_V, KM3_V), LITEACE Bus (R2_LG), LITEACE Bus (CM30_G, KM30_G), MODELL F Bus (R2, 31)</p>
<p>SVB101225 ARO 10 CHEVROLET S10 Pick Up CHRYSLER LE BARON, LE BARON Convertible DACIA 1300, 1300 Estate, 1310 Estate,</p>	<p>SVB121040 FORD SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG) VOLVO 740 Kombi (745), 940 (944), 940 Kombi (945), 960 (964), 960 Kombi (965)</p>	<p>VAUXHALL MIDI, MIDI II VOLVO 340-360 (343, 345), 340-360 Saloon (344), 740 (744) VW PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)</p>



NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







					
SVB131015 ISUZU TROOPER Open Off-Road Vehicle (UBS) MERCEDES-BENZ 100 Box (631), 100 Bus (631), 100 Flatbed / Chassis (631), G-CLASS (W460)		NISSAN RX 7 I (SA), RX 7 II (FC) 300 ZX (Z31), PATROL GR I (Y60), PICK UP (D22), SERENA (C23M), VANETTE Box (C22), VANETTE Bus (C22)		VW	HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_), HILUX Pickup (N_), LAND CRUISER (J7_) GOLF I (17), SCIROCCO (53B), TARO, TRANSPORTER IV Box (70XA), TRANSPORTER IV Flatbed / Chassis (70XD)
SVB131025 ALFA ROMEO 164 (164) AUDI 80 (8C, B4), 80 Avant (8C, B4), 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3), 200 (43), 200 (44, 44Q), COUPE (89, 8B) BEDFORD MIDI Box, MIDI Bus FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG), TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_) ISUZU CAMPO (KB), TROOPER Open Off-Road Vehicle (UBS) LANCIA DEDRA (835), DEDRA SW (835) LAND ROVER DISCOVERY I LDV 400 Box, 400 Bus, 400 Flatbed / Chassis MAZDA 929 III (HC), B-SERIE (UD), MPV I (LV) MERCEDES-BENZ G-CLASS (W460), KOMBI Estate (S123), Saloon (W123), S-CLASS (W116), T1 Box (601), T1 Box (602), T1 Bus (601), T1 Flatbed / Chassis (601), T1 Flatbed / Chassis (602) METROCAB TAXI MITSUBISHI GALANT IV (E3_A), GALANT IV Saloon (E3_A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), GALANT VI (EA_), GALANT VI Estate (EA_), LANCER IV (C6_A, C7_A), LANCER V (CB/D_A), LANCER V Station Wagon (CB_W, CD_W), SPACE RUNNER (N1_W, N2_W), SPACE WAGON (N3_W, N4_W), STARION (A18_A) OPEL CAMPO (TF_) PORSCHE 928 PROTON PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S) RENAULT 9 (L42_), 11 (B/C37_), 11 Box (S37_), 19 I (B/C53_), 19 I Box (S53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_) TOYOTA DYNA Bus, DYNA Flatbed / Chassis, LAND CRUISER (J6_), LAND CRUISER (J7_) VAUXHALL BRAVA Pickup, MIDI, MIDI II VW GOLF I (17), GOLF I Cabriolet (155), JETTA I (16), SCIROCCO (53B)		PORSCHE 928 TOYOTA HIACE II Box (H5_), HIACE II Wagon (H5_), HIACE III Box (H10_), HIACE III Wagon (H10_), HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_), HILUX Pickup (N_), LAND CRUISER (J7_), LAND CRUISER Hardtop (J7_), LITEACE Box (R2_V), LITEACE Bus (R2_LG), MODELL F Bus (R2_, 31) VW GOLF I (17), SCIROCCO (53B), TARO, TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)		SVB131138 ARO 240-244 MAZDA 323 S V (BA) MITSUBISHI PAJERO II Open Off-Road Vehicle (V2_W, V4_W)	
		SVB131060 MAZDA 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), B-SERIE (UN) VOLVO 740 (744)		SVB131150 ARO 240-244 CARBODIES FL2, FX4, FX4R FORD MAVERICK (UDS, UNS), SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG) JAGUAR XJ MERCEDES-BENZ G-CLASS (W460), KOMBI Estate (S123), Saloon (W123) MITSUBISHI PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W) NISSAN LAUREL (J32), PATROL GR I (Y60), PICK UP (D21), PICK UP (D22), TERRANO I (WD21), TERRANO II (R20), URVAN Box (E24), URVAN Bus (E23), URVAN Bus (E24) PORSCHE 911, 911 (964), 911 Convertible, 911 Convertible (964) SUBARU 1800 XT COUPE (XT), LEONE II, LEONE II Estate VW TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis	
		SVB131075 FORD TRANSIT Bus (E_) JAGUAR XJ, XJS Coupe, XJSC Convertible MAZDA RX 7 I (SA) NISSAN LAUREL (J32), PATROL GR I (Y60), PATROL GR II (Y61), PATROL Hardtop (K260), PATROL Station Wagon (W260) PORSCHE 911 (964), 911 Convertible (964), 928 ROVER 2000-3500 Hatchback (SD1) TATA (TELCO) SAFARI (42_FD) TOYOTA LAND CRUISER (J4_), LAND CRUISER Pickup (J4_) VOLVO 240 (P242, P244), 240 Kombi (P245), 740 (744), 760 (704, 764), 760 Kombi (704, 765)		SVB131175 FORD SCORPIO I (GAE, GGE), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG) JAGUAR XJ JEEP CHEROKEE, CHEROKEE (XJ), WRANGLER I (Y), SJ_, WRANGLER II (TJ) LAND ROVER RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN) LDV 400 Box, 400 Bus, 400 Flatbed / Chassis MAZDA B-SERIE (UN), E 2000, 2200 Box (SR2), E 2000, 2200 Bus (SR1) NISSAN PICK UP (720), PICK UP (D21), TERRANO I (WD21) ROVER 2000-3500 Hatchback (SD1) SAAB 900 I (AC4, AM4), 900 I Combi Coupe, 900 I Convertible, 9000 Hatchback SUZUKI GRAND VITARA (FT, GT), VITARA (ET, TA) TOYOTA 4 RUNNER, 4 RUNNER (N130), CELICA (TA60, RA40, RA6_), LAND CRUISER (J6_), LAND CRUISER (J7_), LAND CRUISER 80 (J8_), LAND CRUISER 90 (J9_), LAND CRUISER Hardtop (J7_) VOLVO 960 (964), 960 Kombi (965) VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	
		SVB131085 PORSCHE 911 (964), 911 (993), 911 Convertible (964), 911 Convertible (993), 911 Targa (993)		SVB131200 FORD SCORPIO I (GAE, GGE), SCORPIO I Estate (GGE), SCORPIO I Saloon (GGE), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG), TRANSIT Bus (E_) LAND ROVER RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN)	
		SVB131100 ALFA ROMEO 75 (162B) FORD RANGER (TU_) MAZDA B-SERIE (UF), B-SERIE (UN), BT-50, MPV I (LV) NISSAN SERENA (C23M), VANETTE CARGO Box (HC 23), VANETTE CARGO Bus (HC 23) PORSCHE 911, 911 Convertible, 911 Targa SUBARU 1800 XT COUPE (XT), LEONE II, LEONE II Estate TOYOTA DYNA Flatbed / Chassis			
		SVB131125 ALFA ROMEO 90 (162) CARBODIES FL2, FX4, FX4R FORD ECONOVAN (KBA, KCA), ECONOVAN Box (KAA) JAGUAR XJ KIA BESTA Box, RETONA (CE) MAZDA 323 II (BD), 323 II Hatchback (BD), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), B-SERIE (UF), E 2000, 2200 Box (SR2), E 2000, 2200 Bus (SR1) NISSAN LAUREL (J31), LAUREL (J32), PATROL Hardtop (K160), PATROL Hardtop (K260), PATROL Station Wagon (W160), URVAN Box (E24), URVAN Bus (E23), URVAN Bus (E24), VANETTE Bus (C22) PORSCHE 911, 928 TOYOTA 4 RUNNER (N130), CRESSIDA Saloon (X6_), CRESSIDA Station Wagon (X6K), HIACE III Box (H10_), HIACE III Wagon (H10_)			
SVB131050 ALFA ROMEO 164 (164) AUDI 100 (43, C2), 100 Avant (43, C2) BMW 3 Touring (E30), 5 (E12), 5 (E28), 5 (E34), 6 (E24), 7 (E23), 7 (E32) DAIHATSU ROCKY Hard Top (F7, F8), ROCKY Soft Top (F7, F8) FIAT TEMPRRA (159), TEMPRRA S.W. (159), TIPO (160) LADA NIVA (2121) LANCIA DEDRA (835), DELTA II (836) MAZDA 323 C IV (BG), 323 F VI (BI), 323 III Station Wagon (BW), 323 S IV (BG), 323 S VI (BJ), 626 II (GC), 626 II Hatchback (GC), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), PREMACY (CP),					







					
MERCEDES-BENZ S-CLASS (W116) PORSCHE 911, 911 Convertible, 911 Targa SAAB 900 I (AC4, AM4), 900 I Combi Coupe, 900 I Convertible, 9000 Hatchback TOYOTA 4 RUNNER (L130), CROWN Saloon (S1_), HILUX Pickup (N_), LAND CRUISER (J7_), LAND CRUISER Hardtop (J7_) VOLVO 740 (744), 740 Kombi (745), 940 (944), 940 Kombi (945), 960 (964), 960 Kombi (965)		TOYOTA LAND CRUISER (J6_) VAUXHALL BRAVA Pickup, MIDI SVB131400 HYUNDAI H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup LANCIA THEMA (834) TOYOTA CROWN Saloon (S1_), LAND CRUISER (J6_) VOLVO 240 (P242, P244), 240 Kombi (P245), 760 (704, 764), 760 Kombi (704, 765)		SVB171205 TOYOTA DYNA Bus, DYNA Flatbed / Chassis, LAND CRUISER (J4_), LAND CRUISER (J7_), LAND CRUISER Pickup (J4_) SVB171500 TOYOTA LAND CRUISER (J6_), LAND CRUISER (J7_) TB101 FORD SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (V_) VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)	
SVB131225 ARO 240-244 CARBODIES FL2, FX4, FX4R FORD SIERRA Estate (BNC), SIERRA Hatchback (GBC) LANCIA THEMA (834) TOYOTA CROWN Saloon (S1_), HIACE IV Box (H1_, H2_), HIACE IV Wagon (H1_, H2_) VW TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis		SVB131425 NISSAN 300 ZX (Z31) VOLVO 760 (704, 764), 760 Kombi (704, 765), 780 SVB131450 ISUZU TROOPER (UB), TROOPER (UBS), TROOPER Open Off-Road Vehicle (UB) PICK UP (720) NISSAN CAMPO (TF_), FRONTERA A (5_MWL4), FRONTERA A Sport (5_SUD2), MONTEREY A (UBS_) VAUXHALL FRONTERA, FRONTERA Sport, MONTEREY		TB102 FIAT REGATA (138) FORD P 100 II, SCORPIO I (GAE, GGE), SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG), TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_), TRANSIT Flatbed / Chassis (V_) LADA 1200-1600, NOVA (2105, 2108, 2109), NOVA Estate (2104), TOSCANA	
SVB131250 ALFA ROMEO GIULIETTA (116), GTV (116) ISUZU TROOPER, TROOPER Open Off-Road Vehicle NISSAN PATROL GR I (Y60), SILVIA (S12) OPEL MONTEREY B, VECTRA B (36_), VECTRA B Hatchback (38_) SAAB 9000, 9000 Hatchback TOYOTA CELICA (TA60, RA40, RA6_), DYNA Flatbed / Chassis, HIACE II Box (H5_), HIACE II Wagon (H5_), HILUX Pickup (N_) VAUXHALL VECTRA, VECTRA Hatchback VW TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis		SVB131500 ISUZU CAMPO (KB), TROOPER (UBS), TROOPER Open Off-Road Vehicle (UBS) NISSAN PATROL Hardtop (K160), PATROL Hardtop (K260), PATROL Station Wagon (W160), PATROL Station Wagon (W260), URVAN Box (E23), URVAN Bus (E23) OPEL CAMPO (TF_) VAUXHALL BRAVA Pickup SVB131525 ISUZU CAMPO (KB), D-MAX (8DH), TROOPER (UB), TROOPER (UBS), TROOPER Open Off-Road Vehicle (UB), TROOPER Open Off-Road Vehicle (UBS) JAGUAR XJ, XJS Coupe, XJS Convertible OPEL CAMPO (TF_), FRONTERA A (5_MWL4), FRONTERA A Sport (5_SUD2), MONTEREY A (UBS_) VAUXHALL FRONTERA, FRONTERA Sport, MONTEREY		TB103 FORD TRANSIT Box (V_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (V_) TB106 ALFA ROMEO 33 (905), 33 (907A), 33 Sport Wagon (907B), 33 Sportwagon (905A), ALFASUD Coupe (902.A) NISSAN CHERRY (N12) TB107 AUDI 80 (81, 85, B2) VW GOLF I (17), GOLF I Cabriolet (155), GOLF II (19E, 1G1), JETTA I (16), JETTA II (19E, 1G2), PASSAT (32B), PASSAT Variant (32B), POLO (86C, 80), POLO CLASSIC (86C, 80), POLO Coupe (86C, 80), SANTANA (32B), SCIROCCO (53B)	
SVB131275 MERCEDES-BENZ COUPE (C123), G-CLASS (W460), KOMBI Estate (S123), Saloon (W123), S-CLASS (W126), SL (R107), SL Coupe (C107) NISSAN PATROL Hardtop (K160), PATROL Hardtop (K260), PATROL Station Wagon (W160), PATROL Station Wagon (W260) SAAB 9000, 9000 Hatchback TOYOTA CROWN Saloon (S1_), HILUX Pickup (N_), LAND CRUISER (J7_), LAND CRUISER 80 (J8_) VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)		SVB171000 ISUZU TROOPER Open Off-Road Vehicle (UBS) MAZDA 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW)		TB108 AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3), COUPE (81, 85), COUPE (89, 8B) PORSCHE 924 SEAT CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L) VW CADDY I (14), CADDY II Box (9K9A), CADDY II Estate (9K9B), CORRADO (53I), GOLF I (17), GOLF I Cabriolet (155), GOLF II (19E, 1G1), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363),	
SVB131300 MERCEDES-BENZ /8 (W114), /8 Coupe (W114), S-CLASS (W116)		SVB171045 NISSAN VANETTE Box (C22), VANETTE Bus (C22)			
SVB131325 MERCEDES-BENZ /8 (W114), /8 Coupe (W114) OPEL CAMPO (TF_) VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)		SVB171055 ISUZU CAMPO (KB), TROOPER (UB), TROOPER (UBS), TROOPER Open Off-Road Vehicle (UB), TROOPER Open Off-Road Vehicle (UBS) OPEL CAMPO (TF_), FRONTERA A (5_MWL4), FRONTERA A Sport (5_SUD2), MONTEREY A (UBS_) TOYOTA LAND CRUISER (J4_), LAND CRUISER (J6_), LAND CRUISER 80 (J8_), LAND CRUISER Pickup (J4_) VAUXHALL BRAVA Pickup, FRONTERA, FRONTERA Sport, MONTEREY			
SVB131350 LAND ROVER DISCOVERY I, RANGE ROVER I (AE, AN, HAA, HAB, HAM, HBM, RE, RN) MERCEDES-BENZ /8 (W114), /8 Coupe (W114), G-CLASS (W460), Saloon (W123) PEUGEOT 604 (561A_) VOLVO 240 (P242, P244), 240 Kombi (P245)		SVB171115 MITSUBISHI L 200 (K_), L 300 Box (L03_P), PAJERO I Open Off-Road Vehicle (L04_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W) TOYOTA LAND CRUISER (J6_)			
SVB131375 ISUZU CAMPO (KB) MERCEDES-BENZ /8 (W115), KOMBI Estate (S123), Saloon (W123) OPEL CAMPO (TF_) PEUGEOT 505 (551A), 604 (561A_)					



NUMERICAL PARTS LIST





Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







  <p>LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), POLO CLASSIC (6KV2), POLO Variant (6KV5), SANTANA (32B), SCIROCCO (53B), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD), VENTO (1H2)</p>	  <p>LANCIA DELTA I (831AB0), PRISMA (831AB0) PEUGEOT 505 (551A), 505 Break (551D)</p> <p>TB127 HONDA ACCORD II (AC, AD), ACCORD II Hatchback (AC, AD) NISSAN BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), PRAIRIE (M10, NM10), SILVIA (S12), STANZA (T11), STANZA Hatchback (T11)</p> <p>TB128 NISSAN 300 ZX (Z31), MAXIMA (J30), TERRANO I (WD21)</p>	  <p>TB138 BMW 3 (E21), 3 (E30), 5 (E28)</p> <p>TB143 FIAT 127, 127 Panorama, FIORINO (147), FIORINO Pick up (147), PANDA (141A_), UNO (146A/E)</p> <p>TB148 FIAT ARGENTA (132A) FSO 132P</p> <p>TB150 FIAT REGATA (138), RITMO II (138A) SEAT IBIZA I (021A), MALAGA (023A), RONDA (022A)</p>
<p>TB110 DAIHATSU CHARADE II (G11, G30), CHARADE III (G100, G101, G102), HIJET I Box, HIJET I Bus, SPARCAR Box, SPARCAR Bus NISSAN MICRA (K10)</p>	<p>TB129 AUTOBIANCHI Y10 FIAT PANDA (141A_), PANDA Van (141_), PUNTO (176), PUNTO Van (176L), TIPO (160), UNO (146A/E) LANCIA Y (840A), Y10 (156) OPEL ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), CORSA A Box, CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), MANTA B (58_, 59_), MANTA B CC (53_, 55_)</p>	<p>TB155 OPEL ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), ASTRA F (56_, 57_), ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), FRONTERA A Sport (5_SUD2), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), MANTA B (58_, 59_), MANTA B CC (53_, 55_), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), REKORD E (17_-19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)</p>
<p>TB112 FIAT ARGENTA (132A), REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A) FSO 132P LANCIA DELTA I (831AB0), PRISMA (831AB0)</p>	<p>VAUXHALL ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback, CAVALIER Mk II, CAVALIER Mk II Hatchback, NOVA, NOVA Hatchback</p>	<p>VAUXHALL ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CARLTON Mk II, CARLTON Mk II Estate, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk II, CAVALIER Mk II Convertible, CAVALIER Mk II Estate, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, FRONTERA Sport</p>
<p>TB113 FSO 132P SEAT RONDA (022A)</p>	<p>TB131 AUDI 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3) VOLVO 240 (P242, P244), 240 Kombi (P245), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 Kombi (945), 960 (964), 960 Kombi (965)</p>	<p>TB156 JEEP CHEROKEE (XJ) RENAULT 18 (134_), 18 Box, 18 Variable (135_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE I (J11_), ESPACE II (J/S63_), FUEGO (136_), MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), SAFRANE I (B54_), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)</p>
<p>TB114 FIAT REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A), UNO (146A/E) LANCIA DELTA I (831AB0), PRISMA (831AB0) PEUGEOT 505 (551A) RENAULT 18 (134_), 18 Variable (135_), FUEGO (136_), MASTER I Box (T_), MASTER I Flatbed / Chassis (P_), TRAFIC Box (T1, T3, T4), TRAFIC Bus (T5, T6, T7), TRAFIC Flatbed / Chassis (P6) ZASTAVA 101 (1100), YUGO, YUGO FLORIDA</p>	<p>TB134 ALFA ROMEO 75 (162B), 90 (162), 164 (164), GTV (116), RZ, SZ</p> <p>TB135 FIAT ARGENTA (132A), DUCATO Box (280), DUCATO Flatbed / Chassis (280), DUCATO Panorama (280) IVECO Daily I RENAULT MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)</p>	<p>TB160 HYUNDAI PONY, PONY (X-2), PONY Saloon MITSUBISHI COLT II (C1_A), LANCER III (C1_A, C6_A), LANCER III Station Wagon (C1_V, C3_V)</p>
<p>TB115 FSO POLONEZ I, POLONEZ II SEAT FURA (025A), RONDA (022A)</p>	<p>VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)</p>	<p>TB161 TOYOTA CARINA II (T17_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CELICA Coupe (T18_), COROLLA (E9_), COROLLA Compact (E9_), COROLLA Liftback (E9_), COROLLA Station Wagon (E9_)</p>
<p>TB118 FIAT REGATA (138) VOLVO 240 (P242, P244), 240 Kombi (P245), 340-360 (343, 345), 340-360 Saloon (344), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 Kombi (945)</p>	<p>TB136 AUDI 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3) VOLVO 240 (P242, P244), 240 Kombi (P245), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945), 960 (964), 960 Kombi (965)</p>	<p>TB161 TOYOTA CARINA II (T17_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CELICA Coupe (T18_), COROLLA (E9_), COROLLA Compact (E9_), COROLLA Liftback (E9_), COROLLA Station Wagon (E9_)</p>
<p>TB121 AUTOBIANCHI Y10 FIAT 127, 127 Panorama, FIORINO (127), FIORINO (147), FIORINO Pick up (147), RITMO I (138A) LANCIA Y10 (156)</p>	<p>VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)</p>	<p>TB161 TOYOTA CARINA II (T17_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CELICA Coupe (T18_), COROLLA (E9_), COROLLA Compact (E9_), COROLLA Liftback (E9_), COROLLA Station Wagon (E9_)</p>
<p>TB122 FIAT ARGENTA (132A), RITMO I (138A), RITMO II (138A)</p>	<p>TB136 AUDI 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3) VOLVO 240 (P242, P244), 240 Kombi (P245), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945), 960 (964), 960 Kombi (965)</p>	<p>TB161 TOYOTA CARINA II (T17_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CELICA Coupe (T18_), COROLLA (E9_), COROLLA Compact (E9_), COROLLA Liftback (E9_), COROLLA Station Wagon (E9_)</p>
<p>TB123 SUZUKI CARRY Box (ST90V), SJ 410, SJ 410 Cabrio</p> <p>TB124 AUSTIN MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE) LDV SHERPA Bus (FR) MG MAESTRO, MONTEGO ROVER 2000-3500 Hatchback (SD1)</p>	<p>TB136 AUDI 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3) VOLVO 240 (P242, P244), 240 Kombi (P245), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945), 960 (964), 960 Kombi (965)</p>	<p>TB161 TOYOTA CARINA II (T17_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CELICA Coupe (T18_), COROLLA (E9_), COROLLA Compact (E9_), COROLLA Liftback (E9_), COROLLA Station Wagon (E9_)</p>
<p>TB126 FIAT ELBA (146_), FIORINO (147), FIORINO Box (146 Uno), REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A), UNO (146A/E)</p>	<p>VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)</p>	<p>ZAZ TAVRIJA</p>

					
TB162 CHEVROLET ISUZU OPEL	S10 Pick Up CAMPO (KB), TROOPER (UBS), TROOPER Open Off-Road Vehicle (UBS) CAMPO (TF_)		ASTRA Mk II Hatchback, CAVALIER Mk II, CAVALIER Mk II Hatchback		ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Estate (AWF, AVF), FIESTA Box (FVD), FIESTA II (FBD), ORION I (AFD), ORION II (AFF)
TB164 MAZDA	626 II (GC), 626 II Hatchback (GC), 929 II (HB), 929 II Coupe (HB), 929 II Station Wagon (HV), E 2000,2200 Box (SR2), E 2000,2200 Bus (SR1)	TB179 OPEL	MANTA B (58_, 59_), MANTA B CC (53_, 55_), REKORD E (17_-19_, 11_, 14_, 16_), REKORD E Estate (61_, 66_, 67_)	TB202 HONDA	ACCORD II (AC, AD), ACCORD II Hatchback (AC, AD), ACCORD III (CA4, CA5), ACCORD III Aerodeck (CA5), PRELUDE II (AB)
TB168 NISSAN	LAUREL (JC31), LAUREL (JC32)	TB181 HONDA	JAZZ (AA)	TB203 HONDA	CIVIC II, CIVIC II Hatchback (AL, AJ, AG, AH), CRX I (AF, AS), INTEGRA (DA_)
TB169 MAZDA NISSAN	626 II (GC), 626 II Hatchback (GC) CHERRY (N12), PRAIRIE (M10, NM10), SUNNY I (B11), SUNNY I Coupe (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13), SUNNY II Traveller (B12)	TB184 NISSAN	BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11), PRAIRIE (M10, NM10), PRAIRIE PRO (M11)	TB204 AUSTIN	MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE)
TB171 BEDFORD DAIHATSU SUBARU	RASCAL Box, RASCAL Bus CHARMANT (A) JUSTY I (KAD), LIBERO Bus (E10, E12), REX II, REX III	TB186 FIAT TOYOTA	REGATA (138), REGATA Weekend CAMRY (V2_), CAMRY Liftback (V1), CAMRY Saloon (V1), CAMRY Station Wagon (V2_), CARINA II (T15_), CARINA II Saloon (T15_)	TB207 ROVER	200 (XH), MAESTRO, MONTEGO, MONTEGO Estate (XE)
SUZUKI TOYOTA	ALTO II (EC), ALTO IV (FF), SAMURAI (SJ), SJ 410, SJ 410 Cabrio, SUPER CARRY Bus (ED) CARINA II (T15_), CARINA II Saloon (T15_), CELICA (ST16_), CELICA Hatchback (T16), COROLLA (E8_), COROLLA Liftback (E8_), TERCEL (L1_, L2_), TERCEL (AL2_)	TB187 TOYOTA	CRESSIDA Saloon (X6_), CRESSIDA Station Wagon (X6K), CROWN Saloon (S1_), DYNA Flatbed / Chassis, HIACE II Box (H5_), HIACE II Wagon (H5_), HILUX Pickup (N_), LAND CRUISER (J7_)	TB209 AUDI	80 (81, 85, B2), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), 100 (44, 44Q, C3), 100 Avant (44, 44Q, C3), 200 (43), 200 (44, 44Q), 200 Avant (44, 44Q), COUPE (81, 85), QUATTRO (85)
TB172 TOYOTA	CRESSIDA Saloon (X6_), CRESSIDA Station Wagon (X6K), CROWN Saloon (S1_)	TB188 TOYOTA	CELICA SUPRA (MA61)	TB211 VW	PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)
TB173 MITSUBISHI	L 300 Box (LO3_P), L 300 Bus (LO3_P/G, LO_2P)	TB189 RENAULT VOLVO	9 (L42_), 11 (B/C37_), 11 Box (S37_), RAPID Box (F40_, G40_), SUPER 5 (B/C40_), SUPER 5 Box (S40_) 340-360 (343, 345), 340-360 Saloon (344)	TB209 BEDFORD VAUXHALL	MIDI Box, MIDI Bus MIDI, MIDI II
TB175 CITROËN	BERLINGO (MF), BERLINGO Box (M_), BX (XB-), BX Break (XB-), C15 (VD-), C25 Bus (280_, 290_), EVASION (22, U6), JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), VISA, XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2)	TB190 OPEL	CORSA A Box, CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_)	TB211 MAZDA	626 II (GC), 626 II Hatchback (GC), 929 II (HB), 929 II Coupe (HB), 929 II Station Wagon (HV), B-SERIE (UF), E 2000,2200 Box (SR2), E 2000,2200 Bus (SR1)
LADA	NIVA (2121)	TB195 RENAULT VOLVO	9 (L42_), 11 (B/C37_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), SUPER 5 (B/C40_), TRAFIC Box (T1, T3, T4), TRAFIC Bus (T5, T6, T7), TRAFIC Flatbed / Chassis (P6) 340-360 (343, 345), 340-360 Saloon (344), 480 E	TB212 MAZDA	626 II (GC), 626 II Hatchback (GC)
TB177 CITROËN	C25 Box (280_, 290_), C25 Bus (280_, 290_), CX II, CX II Break	TB197 SEAT	IBIZA I (021A), MALAGA (023A), RONDA (022A)	TB213 HYUNDAI MITSUBISHI	SONATA I (Y-2), SONATA II (Y-3) GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), L 300 Box (LO3_P), L 300 Box (PO_W, P1_W), L 300 Bus (LO3_P/G, LO_2P), L 300 Bus (PO_W, P1_W, P2_W), SPACE WAGON (DO_V/W), STARION (A18_A)
PEUGEOT	J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L)	TB198 TOYOTA	CELICA (ST16_), CELICA (TA60, RA40, RA6_), CELICA Coupe (RA6), CELICA Hatchback (T16), COROLLA Compact (E9_), COROLLA Coupe (AE86), COROLLA FX Compact (E8B), COROLLA Liftback (E9_), MR 2 (W1_)	TB218 AUSTIN	MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE)
TALBOT	EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1500 Flatbed / Chassis, EXPRESS 1000 -1800 Box	TB200 FIAT	ARGENTA (132A), REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A)	TB218 LDV OPEL	SHERPA Bus (FR) ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)
TB178 OPEL	ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_)	TB201 LANCIA	DELTA I (831ABO), PRISMA (831ABO)	TB219 VAUXHALL	ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, CAVALIER Mk II, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, NOVA, NOVA Hatchback
VAUXHALL	ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Estate,	TB201 FORD	ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT III (GAA),	TB219 ROVER	MAESTRO, MONTEGO, MONTEGO Estate (XE)

NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits

																																	
TB221 OPEL ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) VAUXHALL ASTRA Mk II Hatchback, ASTRA Mk III Hatchback, CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback	TB230 FORD SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)	TB247 AUTOBIANCHI Y10 127, DUNA (146 B), DUNA Weekend (146 B), FIORINO (147), FIORINO Box (146 Uno), FIORINO Pick up (146) LANCIA Y10 (156)	TB231 LDV SHERPA Bus (FR) MG MAESTRO, MONTEGO ROVER MONTEGO, MONTEGO Estate (XE)	TB248 AUTOBIANCHI Y10 DUNA (146 B), DUNA Weekend (146 B), FIORINO (147), FIORINO Box (146 Uno), FIORINO Pick up (147), REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A), UNO (146A/E) LANCIA Y10 (156)	TB222 SUZUKI SAMURAI (SJ), SJ 413, SWIFT Convertible (SF413), SWIFT I (AA), SWIFT II (AH, AJ), SWIFT II Hatchback (EA, MA)	TB232 LADA SAMARA (2108, 2109), SAMARA FORMA (21099) TB234 ROVER 25 (RF), 100 (METRO) (XP), 100 Convertible (XP), 200 (RF), 200 Hatchback (XW), 400 Hatchback (RT)	TB249 FIAT REGATA (138), REGATA Weekend, RITMO I (138A), RITMO II (138A), TIPO (160) LANCIA DELTA I (831AB0), PRISMA (831AB0)	TB223 FORD TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (T_), TRANSIT Flatbed / Chassis (V_) METROCAB TAXI	TB235 DAIHATSU CHARADE II (G11, G30), CHARADE III (G100, G101, G102)	TB250 FIAT DUCATO Flatbed / Chassis (280), DUCATO Panorama (280) IVECO Daily I	TB224 OPEL ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) VAUXHALL ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CAVALIER Mk II, CAVALIER Mk II Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback	TB237 FORD ESCORT '86 Express (AVF), ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA Box (FVD), FIESTA III (GFJ), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), ORION II (AFF), ORION III (GAL), P 100 II, SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)	TB251 FORD ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT III (GAA), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ORION I (AFD), ORION II (AFF)	TB225 AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) VW CADDY I (14), GOLF I (17), GOLF II (19E, 1G1), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis	TB239 FORD ESCORT '81 Express (AVA), ESCORT III (GAA), ESCORT III Convertible (ALD), ESCORT III Estate (AWA), ORION I (AFD), ORION II (AFF)	TB252 FORD ESCORT '86 Express (AVF), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), FIESTA Box (F3L, F5L), FIESTA Box (FVD), FIESTA III (GFJ), ORION II (AFF)	TB226 CITROËN BX (XB-), BX Break (XB-), VISA, ZX (N2) PEUGEOT 205 I (741A/C), 205 I Convertible (741B, 20D), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E)	TB240 FORD ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT '91 Express (AVL), ESCORT III (GAA), ESCORT III Convertible (ALD), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), FIESTA Box (FVD), FIESTA II (FBD), FIESTA III (GFJ), ORION I (AFD), ORION II (AFF), ORION III (GAL), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)	TB253 SEAT TERRA (24), TERRA Box (024A) VW POLO (86C, 80), POLO Box (86CF), POLO CLASSIC (86C, 80), POLO Coupe (86C, 80)	TB227 CITROËN C25 Box (280_, 290_), C25 Bus (280_, 290_), CX II, CX II Break PEUGEOT J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L) TALBOT EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1500 Flatbed / Chassis, EXPRESS 1000 -1800 Box	TB241 BMW 3 (E21), 3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E28), 5 (E34)	TB254 SEAT TERRA (24), TERRA Box (024A) VW POLO (86C, 80), POLO Box (86CF), POLO CLASSIC (86C, 80), POLO Coupe (86C, 80)	TB228 AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) VW CADDY I (14), GOLF I (17), GOLF II (19E, 1G1), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis	TB242 BMW 3 (E30), 3 (E36), 3 Convertible (E30), 3 Touring (E30), 5 (E34), 5 Touring (E34)	TB255 SEAT TERRA (24), TERRA Box (024A) VW POLO (86C, 80), POLO Box (86CF), POLO CLASSIC (86C, 80), POLO Coupe (86C, 80)	TB229 AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) VW CADDY I (14), GOLF I (17), GOLF II (19E, 1G1), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis	TB243 CITROËN AX (ZA-), ZX (N2) PEUGEOT 106 I (1A, 1C) ROVER 100 (METRO) (XP)	TB256 RENAULT 9 (L42_), 11 (B/C37_), 19 I (B/C53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), CLIO I (B/C57_, 5/357_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SUPER 5 (B/C40_), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (P6) VOLVO 340-360 (343, 345), 340-360 Saloon (344), 440 K (445), 460 L (464), 480 E	TB233 AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) VW CADDY I (14), GOLF I (17), GOLF II (19E, 1G1), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis	TB244 FIAT CROMA (154), REGATA (138)	TB257 RENAULT 19 I (B/C53_), 19 I Box (S53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_), CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), RAPID Box (F40_, G40_)	TB234 AUDI 80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3) VW CADDY I (14), GOLF I (17), GOLF II (19E, 1G1), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis	TB245 ARO 10 RENAULT 9 (L42_), 11 (B/C37_), 11 Box (S37_), 19 I (B/C53_), 19 I Box (S53_), 19 I Chamade (L53_),

  <p>VOLVO 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), MEGANE I (BA0/1_), RAPID Box (F40_, G40_), SUPER 5 (B/C40_), SUPER 5 Box (S40_) 340-360 (343, 345), 340-360 Saloon (344), 440 K (445), 460 L (464), S40 I (VS), V40 Estate (VW)</p>	  <p>L 300 Flatbed / Chassis (L03_P), PAJERO I (L04_G, L14_G), PAJERO I Open Off-Road Vehicle (L04_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W)</p> <p>TB269 DAIHATSU CHARADE II (G11, G30), CHARADE III (G100, G101, G102)</p>	  <p>DUCATO Panorama (280), DUCATO Panorama (290), TALENTO Box (290), TALENTO Bus (290), TALENTO Flatbed / Chassis (290)</p>
<p>TB259 CITROËN AX (ZA_), BERLINGO (MF), BERLINGO Box (M_), BX (XB_), BX Break (XB_), C15 (VD_), SAXO (S0, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), ZX (N2), ZX Break (N2)</p> <p>PEUGEOT 106 I (1A, 1C), 106 II (1), 205 I (20A/C), 205 II (20A/C), 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), PARTNER Box (5), PARTNER Combispace (5F)</p>	<p>TB271 KIA BESTA Box</p> <p>MAZDA B-SERIE (UF), E 2000,2200 Box (SR2), E 2000,2200 Bus (SR1)</p> <p>TB272 CHRYSLER LE BARON, LE BARON Convertible, VOYAGER I (ES)</p> <p>HONDA CIVIC III Hatchback (EC, ED, EE), CONCERTO (HW), CONCERTO Saloon (HWW), CRX II (ED, EE), PRELUDE III (BA)</p> <p>ROVER 200 Coupe (XW), 200 Hatchback (XW), 400 (XW), CABRIOLET (XW)</p>	<p>TB287 ROVER 800 (XS), 800 Hatchback (XS)</p> <p>TB289 KIA PRIDE (DA), PRIDE Estate, RIO (DC_), RIO Estate (DC), SEPHIA (FA), SEPHIA Saloon (FA), SHUMA Saloon (FB)</p> <p>MAZDA 121 I (DA), 121 II (DB), 323 C IV (BG), 323 C V (BA), 323 F IV (BG), 323 F VI (BJ), 323 II (BD), 323 II Hatchback (BD), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), 323 P V (BA), 323 S IV (BG), 323 S V (BA), 323 S VI (BJ), DEMIO (DW), FESTIVA, MX-3 (EC)</p>
<p>TB260 MAZDA 626 II (GC), 626 II Hatchback (GC), 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD)</p>	<p>TB274 ALFA ROMEO 33 (907A), 33 Sport Wagon (907B), 145 (930), 146 (930)</p>	<p>TB290 HYUNDAI COUPE (RD), ELANTRA (XD), ELANTRA Saloon (XD), LANTRA II (J-), LANTRA II Wagon (J2), MATRIX (FC)</p> <p>NISSAN ALMERA I (N15), ALMERA I Hatchback (N15), PRIMERA (P10), PRIMERA (P11), PRIMERA Hatchback (P10), PRIMERA Hatchback (P11), PRIMERA Traveller (W10), PRIMERA Traveller (WP11), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10)</p>
<p>TB261 NISSAN CHERRY (N12), SUNNY I (B11), SUNNY I Coupe (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Hatchback (N13)</p>	<p>TB275 DAIHATSU CUORE II (L80, L81), CUORE III (L201), CUORE IV (L501), CUORE V (L5), MOVE (L6, L9)</p>	<p>TB291 ISUZU CAMPO (KB), TROOPER (UB), TROOPER (UBS), TROOPER Open Off-Road Vehicle (UB)</p> <p>OPEL CAMPO (TF_), FRONTERA A (5_MWL4), FRONTERA A Sport (5_SUD2), MONTEREY A (UBS_)</p> <p>VAUXHALL BRAVA Pickup, FRONTERA, FRONTERA Sport, MONTEREY</p>
<p>TB262 TOYOTA STARLET (_P7_), STARLET (_P8_)</p>	<p>TB276 MAZDA 323 C IV (BG), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), 323 S IV (BG)</p>	<p>TB292 RENAULT CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), RAPID Box (F40_, G40_)</p>
<p>TB263 TOYOTA COROLLA (_E8_), COROLLA (_E9_), COROLLA (_E10_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA FX Compact (E8B), COROLLA Liftback (_E8_), COROLLA Liftback (_E9_), COROLLA Liftback (_E10_), COROLLA Station Wagon (_E9_), COROLLA Wagon (_E10_), STARLET (_P7_), STARLET (_P8_)</p>	<p>TB278 CITROËN C25 Bus (280_, 290_), C25 Flatbed / Chassis (280_, 290_)</p> <p>FIAT DUCATO Box (230L), DUCATO Box (290), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), DUCATO Flatbed / Chassis (290), DUCATO Panorama (290)</p>	<p>TB293 AUDI 100 (44, 44Q, C3), 100 (4A, C4), 100 Avant (44, 44Q, C3), 100 Avant (4A, C4)</p> <p>VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>
<p>TB264 MAZDA 626 II (GC), 626 II Hatchback (GC), B-SERIE (UF), E 2000,2200 Box (SR2), E 2000,2200 Bus (SR1)</p>	<p>TB279 NISSAN MICRA (K10)</p>	<p>TB294 KIA SHUMA (FB), SHUMA Saloon (FB)</p> <p>MAZDA 323 C IV (BG), 323 C V (BA), 323 F IV (BG), 323 F V (BA), 323 III (BF), 323 III Hatchback (BF), 323 S IV (BG), 323 S V (BA), MX-3 (EC), MX-5 I (NA), MX-5 II (NB), XEDOS 6 (CA)</p>
<p>TB265 ISUZU CAMPO (KB), TROOPER Open Off-Road Vehicle (UBS)</p> <p>OPEL CAMPO (TF_)</p> <p>VAUXHALL BRAVA Pickup</p>	<p>TB280 KIA CLARUS (K9A), CLARUS Estate (GC), RETONA (CE), SPORTAGE (K00)</p>	<p>TB295 FSO POLONEZ III</p> <p>MG MG TF, MG ZR, MG ZS Hatchback, MGF (RD)</p> <p>ROVER 25 (RF), 45 (RT), 45 Saloon (RT), 100 (METRO) (XP), 100 Convertible (XP), 200 (RF), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW), COUPE, STREETWISE</p>
<p>TB266 MAZDA 121 I (DA), 323 II (BD), 323 II Hatchback (BD), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), FESTIVA</p>	<p>TB281 SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), GRAND VITARA (FT, GT), SWIFT II (AH, AJ), VITARA (ET, TA), VITARA Cabrio (ET, TA), X-90 (EL)</p>	<p>TB297 VOLVO 740 (744), 740 Kombi (745), 940 (944), 940 Kombi (945), 960 (964), 960 Kombi (965)</p>
<p>TB267 MITSUBISHI COLT II (C1_A), COLT III (C5_A), GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), LANCER III (C1_A, C6_A), LANCER III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A), LANCER IV Saloon (C6_A), SPACE WAGON (D0_V/W), SPACE WAGON (N3_W, N4_W)</p>	<p>TB282 MAZDA 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV)</p>	<p>TB298 FIAT TIPO (160)</p>
<p>TB268 HYUNDAI H100 Box, H100 Bus (P)</p> <p>MITSUBISHI L 200 (K_T), L 300 Box (L03_P), L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W)</p>	<p>TB283 SEAT CORDOBA (6K2/C2), IBIZA II (6K1)</p> <p>VW GOLF II (19E, 1G1), GOLF III (1H1), GOLF III Variant (1H5), JETTA II (19E, 1G2), POLO (86C, 80), POLO Box (86CF), POLO CLASSIC (86C, 80), POLO Coupe (86C, 80), VENTO (1H2)</p>	<p>TB299 FIAT TEMPRA (159), TEMPRA S.W. (159), TIPO (160)</p>



NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







  <p>TB300 NISSAN LAUREL (JC32), PATROL GR I (Y60), PATROL Hardtop (K260), PATROL Station Wagon (W260)</p>	  <p>CELICA (ST16_), CELICA Convertible (_T16_), CELICA Convertible (_T18_), CELICA Coupe (_T18_), CELICA Coupe (T16F), CELICA Hatchback (T16), MR 2 (_W2_)</p>	  <p>TB322 SUBARU JUSTY I (KAD), JUSTY II (JMA, MS) SUZUKI SAMURAI (SJ), SWIFT Convertible (SF413), SWIFT II (AH, AJ), SWIFT II Hatchback (EA, MA)</p>
<p>TB301 KIA SPORTAGE (K00) MAZDA 626 II Hatchback (GC), 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV), 929 II Station Wagon (HV), 929 III (HC), E 2000, 2200 Box (SR2), E 2000, 2200 Bus (SR1)</p>	<p>TB310 TOYOTA CELICA SUPRA (MA61), CROWN Saloon (_S1_)</p>	<p>TB323 SUBARU 1800 XT COUPE (XT), LEONE II, LEONE II Estate</p>
<p>TB302 HYUNDAI H-1 Box, H-1 Bus (KMF), H100 Bus (P), SONATA I (Y-2), SONATA II (Y-3), STAREX (H1) MITSUBISHI COLT II (C1_A), COLT III (C5_A), GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), L 300 Box (LO3_P), L 300 Box (P0_W, P1_W), L 300 Bus (LO3_P/G, LO_2P), L 300 Bus (P0_W, P1_W, P2_W), LANCER III (C1_A, C6_A), LANCER III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A), LANCER IV Saloon (C6_A), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), SAPPORO III (E16A), SPACE WAGON (D0_V/W), SPACE WAGON (N3_W, N4_W), STARION (A18_A)</p>	<p>TB311 TOYOTA AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_), CAMRY (_V2_), CAMRY (_V20), CAMRY Station Wagon (_V2_), CAMRY Station Wagon (_V10), CARINA E (_T19_), CARINA E Saloon (_T19_), CARINA E Sportswagon (_T19_), CARINA II (_T17_), CARINA II Saloon (_T17_), CARINA II Station Wagon (_T17_), PICNIC (_XM10), RAV 4 I (SXA1_), RAV 4 I Cabrio (SXA1_)</p>	<p>TB324 SUBARU 1800 XT COUPE (XT), LEONE II, LEONE II Estate</p>
<p>TB303 ALFA ROMEO 164 (164) FIAT CROMA (154), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) LANCIA DEDRA (835), DEDRA SW (835), DELTA I (831AB0), DELTA II (836), PRISMA (831AB0), THEMA (834), THEMA SW (834)</p>	<p>TB312 HONDA LEGEND I (HS, KA), LEGEND I Coupe (KA3) ROVER 800 (XS), 800 Coupe, 800 Hatchback (XS)</p>	<p>TB325 HYUNDAI LANTRA I (J-1), SANTAMO, SONATA II (Y-3) KIA JOICE MITSUBISHI COLT III (C5_A), ECLIPSE I (D2_A), ECLIPSE II (D3_), GALANT IV (E3_A), GALANT IV Saloon (E3_A), LANCER Estate (CS_W), LANCER Saloon (CS_A), LANCER VI (CK/P_A), OUTLANDER, SANTAMO</p>
<p>TB304 CITROËN AX (ZA-), BERLINGO (MF), BERLINGO Box (M_), BX (XB-), C15 (VD-), SAXO (S0, S1), ZX (N2) PEUGEOT 106 I (1A, 1C), 106 II (1), 205 I Convertible (741B, 20D), 205 II (20A/C), 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 309 II (3C, 3A), PARTNER Box (5), PARTNER CombiSpace (5F)</p>	<p>TB313 HONDA ACCORD III (CA4, CA5), PRELUDE III (BA)</p>	<p>TB326 HYUNDAI LANTRA I (J-1), SANTAMO, SONATA II (Y-3) KIA JOICE MITSUBISHI AIRTREK, COLT III (C5_A), ECLIPSE I (D2_A), ECLIPSE II (D3_), GALANT IV (E3_A), GALANT IV Saloon (E3_A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), GALANT VI (EA_), GALANT VI Estate (EA_), GRANDIS, L 200 (K_T), L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W), L 300 Flatbed / Chassis (P1_T), L 400 Box (PAOV), LANCER Saloon (CS_A), LANCER V (CB/D_A), LANCER V Station Wagon (CB_W, CD_W), LANCER VI (CK/P_A), OUTLANDER, PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), SANTAMO, SPACE GEAR (PA/B/D_V/W), SPACE RUNNER (N1_W, N2_W), SPACE RUNNER (N50), SPACE WAGON (N3_W, N4_W), SPACE WAGON (N5_W) PROTON PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S)</p>
<p>TB305 CITROËN JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_) FIAT ELBA (146_), FIORINO Box (146 Uno), FIORINO Pick up (146), PALIO (178BX), PUNTO (176), PUNTO Convertible (176C), SCUDDO Box (220L), SCUDDO Combinato (220P), SIENA (178_), TEMPRA (159), TEMPRA S.W. (159), TIPO (160), UNO (146A/E) LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836) PEUGEOT EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223) ZASTAVA YUGO FLORIDA</p>	<p>TB314 TOYOTA HIACE III Box (_H10_), HIACE III Wagon (_H10_), HIACE IV Box (_H1_, _H2_), HIACE IV Wagon (_H1_, _H2_), HILUX Pickup (_N_), LAND CRUISER (J7_), LAND CRUISER Hardtop (J7_) VW TARO</p>	<p>TB327 DAIHATSU CHARADE III (G100, G101, G102)</p>
<p>TB306 FIAT TIPO (160), UNO (146A/E)</p>	<p>TB316 HONDA CIVIC II Shuttle (EE), CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED), CIVIC IV (EG, EH), CIVIC IV Coupe (EJ), CIVIC IV Fastback (MA, MB), CIVIC IV Hatchback (EG), CONCERTO (HW), CONCERTO Saloon (HWW)</p>	<p>TB328 DAIHATSU CHARADE III (G100, G101, G102), CHARADE IV (G200, G202), HIJET I Box, HIJET I Bus, HIJET II Box (S85), HIJET II Bus (S85) SUBARU LIBERO Bus (E10, E12)</p>
<p>TB307 ALFA ROMEO 145 (930), 146 (930), 155 (167) FIAT BRAVA (182), BRAVO (182), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836)</p>	<p>TB317 HONDA CIVIC II Shuttle (EE), CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED), CIVIC IV Fastback (MA, MB), CONCERTO (HW), CONCERTO Saloon (HWW), PRELUDE III (BA) ROVER 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW)</p>	<p>TB330 DAIHATSU CHARADE III (G100, G101, G102), CHARADE III Saloon (G102), CHARADE IV (G200, G202), HIJET II Box (S85), TERIOS (J1) PIAGGIO PORTER Box, PORTER Flatbed / Chassis</p>
<p>TB308 ROVER 200 Hatchback (XW), 400 (XW), 800 (XS), 800 Hatchback (XS)</p>	<p>TB318 AUDI 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), 100 (44, 44Q, C3), 100 Avant (44, 44Q, C3), 200 (44, 44Q), 200 Avant (44, 44Q), COUPE (81, 85), COUPE (89, 8B), QUATTRO (85)</p>	<p>TB333 AUDI 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), COUPE (89, 8B) NISSAN 200 SX (S13), BLUEBIRD (T72, T12), BLUEBIRD Hatchback (T72, T12), SUNNY II (N13), SUNNY II Coupe (B12), SUNNY II Hatchback (N13)</p>
<p>TB309 TOYOTA CARINA E (_T19_), CARINA E Saloon (_T19_)</p>	<p>TB319 CITROËN XM (Y3), XM Break (Y3), XM Break (Y4) FORD ESCORT VI (GAL), ESCORT VII (GAL, AAL, ABL), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG) PEUGEOT 605 (6B) UAZ 31512</p>	<p>TB334 TOYOTA STARLET (_P7_), STARLET (_P8_)</p>
	<p>TB320 CITROËN EVASION (22, U6), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) FIAT ULYSSE (220) LANCIA ZETA (220) PEUGEOT 406 (8B), 406 Break (8E/F), 605 (6B), 806 (221)</p>	<p>TB335 NISSAN MICRA (K10)</p>
		<p>TB336 CHEVROLET AVEO Saloon, KALOS</p>

					
DAEWOO	ESPERO (KLEI), KALOS, KALOS (KLAS), LANOS (KLAT), LANOS Saloon (KLAT), NEXIA (KLETN), NEXIA Saloon (KLETN)	TB348 FIAT CROMA (154) LANCIA THEMA (834), THEMA SW (834)			L 300 Flatbed / Chassis (L03_P), LANCER III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A)
OPEL	ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), ASTRA G Box (F70), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), COMBO (71_), COMBO Box Body / Estate, COMBO Tour, CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), CORSA B (73_, 78_, 79_, F35_), CORSA B Box (73_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), MERIVA, VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_)	TB349 FIAT REGATA (138), REGATA Weekend, RITMO II (138A) TB350 FIAT REGATA (138), REGATA Weekend TB351 FIAT REGATA (138), REGATA Weekend, RITMO II (138A) LANCIA DELTA I (831AB0), PRISMA (831AB0) TB352 FIAT REGATA (138), REGATA Weekend, RITMO II (138A) LANCIA DELTA I (831AB0), PRISMA (831AB0) TB353 HONDA ACCORD IV (CB3, CB7), ACCORD IV Aerodeck (CB8, CC), ACCORD IV Coupe (CC1), ACCORD V (CC7), ACCORD V Aerodeck (CE), ACCORD V Coupe (CD7, CD9), ACCORD VI (CE, CF), PRELUDE IV (BB), PRELUDE V (BB), SHUTTLE (RA) 600 (RH) TB354 HONDA ACCORD IV (CB3, CB7), ACCORD IV Aerodeck (CB8, CC), ACCORD IV Coupe (CC1), ACCORD V (CC7), ACCORD V Aerodeck (CE), ACCORD V Coupe (CD7, CD9), ACCORD VI (CE, CF), ACCORD VII (CG), ACCORD VII Coupe (CG), ACCORD VII Hatchback (CH), PRELUDE IV (BB), PRELUDE V (BB), SHUTTLE (RA) ROVER 600 (RH) TB355 HONDA CRX I (AF, AS), CRX II (ED, EE), INTEGRA (DA_) TB356 HYUNDAI H-1 Box, H-1 Bus (KMF), H100 Bus (P), SONATA I (Y-2), STAREX (H1) MITSUBISHI GALANT III (E1_A), L 300 Bus (P0_W, P1_W, P2_W), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), SAPPORO III (E16A) TB357 FIAT CINQUECENTO (170), PUNTO (176), PUNTO Van (176L), SEICENTO (187), SEICENTO Van (187), UNO (146A/E) 323 III Hatchback (BF) TB358 FORD USA PROBE I MAZDA 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV), 929 III (HC), B-SERIE (UF), B-SERIE (UN) TB359 HYUNDAI H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup MITSUBISHI L 200 (K_T), L 300 Box (L03_P), L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), PAJERO I (L04_G, L14_G), PAJERO I Open Off-Road Vehicle (L04_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W) TB360 MITSUBISHI COLT II (C1_A), L 300 Box (L03_P), L 300 Box (P0_W, P1_W), L 300 Bus (L03_P/G, L0_2P),			TB361 NISSAN BLUEBIRD (T72, T12), BLUEBIRD (U11), BLUEBIRD Hatchback (T72, T12), BLUEBIRD Station Wagon (WU11) TB362 TOYOTA STARLET (P7_) TB363 LAND ROVER 90/110 (DHMC) TB365 LAND ROVER DEFENDER (LD), DEFENDER Station Wagon (LD), DISCOVERY I TB366 HYUNDAI ACCENT (X-3), ACCENT Saloon (X-3), LANTRA II (J-2), LANTRA II Wagon (J2) MITSUBISHI COLT III (C5_A), COLT IV (CA_A), LANCER III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A), LANCER IV Saloon (C6_A), LANCER V (CB/D_A) PROTON PERSONA 300 (C9_M), PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S), SATRIA (C9_M), WIRA, WIRA Hatchback TB367 LAND ROVER DISCOVERY I, DISCOVERY II (LJ, LT) ROVER 200 Coupe (XW), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), 600 (RH), 800 (XS), 800 Hatchback (XS) TB368 CITROËN JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (230), JUMPER Flatbed / Chassis (244) FIAT DUCATO Box (230L), DUCATO Box (244), DUCATO Box (290), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230), DUCATO Flatbed / Chassis (244), DUCATO Flatbed / Chassis (290), DUCATO Panorama (290) OPEL ARENA Box (TB, TF), ARENA Combi (THB), MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9) PEUGEOT BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), BOXER Flatbed / Chassis (ZCT_) RENAULT MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD), TRAFIC Box (TXX), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (PXX) VAUXHALL ARENA Combi, ARENA Van, MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD) TB370 FORD TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_) METRO CAB TAXI
VAUXHALL	ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRAMAN Mk III, ASTRAMAN Mk IV, CAVALIER Mk II, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, MERIVA, NOVA, NOVA Hatchback, VECTRA, VECTRA Estate, VECTRA Hatchback				
TB337 FIAT	DUNA (146 B), DUNA Weekend (146 B), ELBA (146_), FIORINO (147), FIORINO Box (146 Uno), FIORINO Pick up (146), PALIO Weekend (178DX), PUNTO (176), PUNTO Van (176L), STRADA (178E), UNO (146A/E)				
TB338 ALFA ROMEO	33 (905), 33 (907A), 33 Sport Wagon (907B), 33 Sportwagon (905A), 145 (930), 146 (930), ALFASUD Coupe (902.A)				
TB339 SUBARU	FORESTER (SF), IMPREZA Coupe (GFC), IMPREZA Estate (GF), IMPREZA Saloon (GC), LEGACY I (BC), LEGACY I Estate (BJF), LEGACY II (BD, BG), LEGACY II Estate (BD, BG)				
TB343 BMW	3 (E21), 5 (E12)				
TB344 BMW	3 (E30), 3 Touring (E30), 5 (E28), 5 (E34)				
TB345 CITROËN PEUGEOT	BX (XB_) 309 II (3C, 3A), 405 I (15B)				
TB347 DAIHATSU	APPLAUSE I (A101, A111), APPLAUSE II, CHARADE IV (G200, G202), CHARADE IV Saloon (G203), FERROZA Hard Top (F300), FERROZA Soft Top (F300), GRAN MOVE (G3)				

NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







  <p>TB371 FORD USA PROBE II (ECP) MAZDA 323 F VI (BJ), 323 S VI (BJ), 626 IV (GE), 626 IV Hatchback (GE), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), MPV II (LW), MX-6 (GE6), PREMACY (CP)</p>	  <p>TB383 ALFA ROMEO 155 (167), 164 (164), GTV (916C_), SPIDER (916S_) FIAT CROMA (154) LANCIA THEMA (834), THEMA SW (834)</p>	  <p>TB394 LANCIA DELTA I (831ABO), THEMA (834), THEMA SW (834)</p>
<p>TB372 VOLVO 850 (LS), 850 Estate (LW), 960 (964), 960 Kombi (965)</p>	<p>TB384 AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), CABRIOLET (8G7, B4) FORD GALAXY (WGR) SEAT ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L)</p>	<p>TB395 MAZDA 626 II (GC), 626 II Hatchback (GC)</p> <p>TB396 MAZDA 626 II (GC), 626 II Hatchback (GC)</p> <p>TB397 MAZDA 323 III (BF), 323 III Hatchback (BF)</p> <p>TB398 MAZDA 323 F VI (BJ), 323 S VI (BJ), 626 IV (GE), 626 IV Hatchback (GE), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), PREMACY (CP)</p>
<p>TB373 AUDI 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 Avant (4A, C4), A8 (4D2, 4D8), CABRIOLET (8G7, B4), COUPE (89, 8B)</p>	<p>TB374 AUDI 100 (4A, 44Q, C3), 100 (4A, C4), 100 Avant (4A, 44Q, C3), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4)</p> <p>TB375 AUDI 100 (4A, C4), 100 Avant (4A, C4) VW TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p> <p>TB376 CITROËN AX (ZA-), BX (XB-), BX Break (XB-), C15 (VD-), SAXO (SO, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), XSARA PICASSO (N68) PEUGEOT 106 I (1A, 1C), 106 II (1), 205 I Convertible (741B, 20D), 205 II (20A/C), 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 309 II (3C, 3A), 405 II (4B), 405 II Break (4E)</p>	<p>TB399 FORD USA PROBE II (ECP) MAZDA 323 F V (BA), 626 IV Hatchback (GE), MX-3 (EC), MX-6 (GE6), XEDOS 6 (CA), XEDOS 9 (TA)</p>
<p>TB377 HONDA CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED), CIVIC IV (EG, EH), CIVIC IV Hatchback (EG), CIVIC V (EJ9, EK3/4), CIVIC V Coupe (EJ6, EJ8), CIVIC V Hatchback (EJ9, EK1/3/4), CRX II (ED, EE), CRX III (EH, EG)</p>	<p>TB386 DAIHATSU ROCKY Hard Top (F7, F8), ROCKY Soft Top (F7, F8), TAFT, WILDCAT/ROCKY (F70), WILDCAT/ROCKY (F75)</p>	<p>TB400 HYUNDAI SONATA I (Y-2), SONATA II (Y-3) MITSUBISHI GALANT IV (E3_A), GALANT IV Saloon (E3_A)</p>
<p>TB378 HONDA ACCORD V (CC7), PRELUDE IV (BB) ROVER 600 (RH)</p>	<p>TB389 FORD ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GFJ), ORION III (GAL), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)</p>	<p>TB401 CHRYSLER LE BARON, LE BARON Convertible, VOYAGER I (ES) HYUNDAI GALLOPER II (JK-01), SONATA I (Y-2), SONATA II (Y-3) MITSUBISHI PAJERO I (L04_G, L14_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), SIGMA Station Wagon (F07W)</p>
<p>TB379 MITSUBISHI COLT IV (CA_A), LANCER IV (C6_A, C7_A), LANCER V (CB/D_A), LANCER V Station Wagon (CB_W, CD_W) PROTON PERSONA 300 (C9_M), PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S), WIRA</p>	<p>TB390 FORD ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GFJ), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), ORION III (GAL)</p>	<p>TB402 HYUNDAI LANTRA I (J-1) MITSUBISHI COLT III (C5_A)</p>
<p>TB380 MITSUBISHI COLT IV (CA_A), LANCER V (CB/D_A) PROTON PERSONA 300 (C9_M), SATRIA (C9_M)</p>	<p>TB391 HONDA LEGEND II (KA7), LEGEND II Coupe (KA8)</p>	<p>TB403 MITSUBISHI 3000 GT (Z16A), GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), SIGMA (F16A)</p>
<p>TB381 MITSUBISHI GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), SPACE RUNNER (N1_W, N2_W), SPACE WAGON (N3_W, N4_W) PROTON PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S)</p>	<p>TB393 ISUZU TROOPER (UB), TROOPER Open Off-Road Vehicle (UB) OPEL MONTEREY A (UBS_) VAUXHALL MONTEREY</p>	<p>TB404 MITSUBISHI L 300 Bus (P0_W, P1_W, P2_W), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W) VOLVO 240 (P242, P244), 240 Kombi (P245), 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945)</p>
<p>TB382 MAZDA 626 III (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV), 626 IV (GE), 626 IV Hatchback (GE)</p>		<p>TB405 HYUNDAI SONATA II (Y-3) MITSUBISHI L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W)</p>
		<p>TB406 DODGE STRATUS MITSUBISHI GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), L 200 (K_T), L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W), L 300 Flatbed / Chassis (P1_T), L 400 Box (PAOV), SPACE GEAR (PA/B/D_V/W), SPACE WAGON (N3_W, N4_W)</p>
		<p>TB407 MITSUBISHI L 200 (K_T), SPACE GEAR (PA/B/D_V/W), SPACE WAGON (N3_W, N4_W)</p>
		<p>TB412 NISSAN SERENA (C23M), VANETTE Box (C22), VANETTE Bus (C22)</p>
		<p>TB413 MAZDA 323 S V (BA) OPEL ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), COMBO (71_), CORSA A Box, CORSA A Hatchback (93_, 94_, 98_, 99_)</p>

  <p>CORSA A TR (91_, 92_, 96_, 97_), CORSA B (73_, 78_, 79_, F35_), CORSA B Box (73_), KADETT E (39_, 49_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Hatchback (38_) ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, NOVA, NOVA Hatchback, NOVAVAN, VECTRA, VECTRA Hatchback</p>	  <p>TB426 SUZUKI SWIFT I (AA)</p> <p>TB428 TOYOTA COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA Liftback (E11_), COROLLA Wagon (E11_), COROLLA Wagon (E10_), STARLET (EP91)</p> <p>TB430 VOLVO 740 (744), 740 Kombi (745), 940 (944), 940 Kombi (945), 960 (964), 960 Kombi (965)</p> <p>TB431 RENAULT ESPACE III (JE0_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_) VOLVO 440 K (445), 460 L (464), 480 E</p>	  <p>TB443 SUBARU REX III</p> <p>TB444 LEXUS ES (F1, F2) TOYOTA CAMRY (V2_), CAMRY Station Wagon (V2_)</p> <p>TB445 TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA Liftback (E10_), COROLLA Liftback (E11_), COROLLA Wagon (E11_), COROLLA Wagon (E10_)</p>
<p>TB419 CITROËN BERLINGO (MF), BERLINGO Box (M_), BX (XB-), BX Break (XB-), EVASION (22, U6), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2) FIAT ULYSSE (220) LANCIA ZETA (220) PEUGEOT 205 I Convertible (741B, 20D), 205 II (20A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), 405 II (4B), 405 II Break (4E), 406 (8B), 406 Break (8E/F), 605 (6B), 806 (221), EXPERT (224), EXPERT Box (222), PARTNER Combi (5F)</p>	<p>TB434 RENAULT LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SAFRANE II (B54_) VOLVO 850 (LS), 850 Estate (LW), 960 (964), 960 II (964), 960 II Estate (965), 960 Kombi (965), C70 Convertible, C70 Coupe, S40 I (VS), S70 (P80_), V40 Estate (VW), V70 I Estate (P80_), V70 II Estate (P80_)</p> <p>TB435 TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), CELICA (T20_), COROLLA Compact (E10_), COROLLA Liftback (E10_), COROLLA Wagon (E11_), COROLLA Wagon (E10_)</p>	<p>TB446 TOYOTA CARINA E (T19_), CARINA E Saloon (T19_), CELICA (T20_), CELICA Convertible (T20_), MR 2 (W2_)</p> <p>TB447 TOYOTA 4 RUNNER, 4 RUNNER (N130), LAND CRUISER (J7_), LAND CRUISER 90 (J9_), LAND CRUISER Hardtop (J7_)</p> <p>TB448 FIAT CROMA (154) LANCIA THEMA (834), THEMA SW (834) RENAULT SAFRANE I (B54_)</p>
<p>TB420 RENAULT 21 Saloon (L48_)</p>	<p>TB436 ISUZU TROOPER, TROOPER Open Off-Road Vehicle LEXUS ES (F1, F2) OPEL FRONTERA B (6B_), MONTEREY B TOYOTA CAMRY (V1_), CAMRY Station Wagon (V10) VAUXHALL FRONTERA Mk II</p>	<p>TB450 HONDA CIVIC IV (EG, EH), CIVIC IV Fastback (MA, MB), CIVIC IV Hatchback (EG), CIVIC V (EJ9, EK3/4), CIVIC V Aerodeck (MC), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK1/3/4), CIVIC V Hatchback (EU_, EP_) ROVER 400 (RT), 400 Hatchback (RT)</p>
<p>TB421 CITROËN CX II, CX II Break PEUGEOT 505 (551A) RENAULT 18 (134_), 18 Variable (135_), 21 (B48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE I (J11_), ESPACE II (J/S63_), MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), SAFRANE I (B54_), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)</p>	<p>TB437 RENAULT LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_)</p> <p>TB438 VOLVO 850 (LS), 850 Estate (LW)</p> <p>TB439 VOLVO 850 (LS), 850 Estate (LW), S70 (P80_), V70 I Estate (P80_)</p>	<p>TB451 HONDA ACCORD VII (CG), CIVIC IV (EG, EH), CIVIC IV Coupe (EI), CIVIC IV Hatchback (EG), CIVIC V (EJ9, EK3/4), CIVIC V Aerodeck (MC), CIVIC V Coupe (EJ6, EJ8), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK1/3/4), CRX III (EH, EG), HR-V (GH) ROVER 400 (RT), 400 Hatchback (RT)</p>
<p>TB422 CITROËN CX II, CX II Break PEUGEOT 505 (551A), 505 Break (551D) RENAULT 18 (134_), 21 (B48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE I (J11_), ESPACE II (J/S63_), MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), SAFRANE I (B54_), TRAFIC Box (TXX), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (PXX)</p>	<p>TB440 VOLVO 940 (944), 940 II (944), 940 II Estate (945), 940 Kombi (945), 960 (964), 960 Kombi (965) VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)</p>	<p>TB453 CITROËN XANTIA (X1), ZX (N2) PEUGEOT 306 (7B, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 405 II (4B), 405 II Break (4E)</p> <p>TB454 CITROËN JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (230) FIAT DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230) PEUGEOT BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (ZCT_)</p>
<p>TB423 RENAULT 19 I (B/C53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), CLIO I (B/C57_, 5/357_), MEGANE Cabriolet (EA0/1_), MEGANE Coach (DA0/1_), MEGANE I (BA0/1_), SPORT SPIDER (EFO_)</p>	<p>TB441 SEAT CORDOBA (6K2/C2), IBIZA II (6K1), TOLEDO I (1L) VW GOLF III (1H1), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I)</p> <p>TB442 SEAT CORDOBA (6K2/C2), IBIZA II (6K1) VW GOLF III (1H1), VENTO (1H2)</p>	<p>TB455 SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), CARRY Box (FD), JIMNY (FJ), SWIFT II Hatchback (EA, MA), WAGON R+ (MM)</p> <p>TB456 SUBARU JUSTY II (JMA, MS) SUZUKI ALTO III (EF), SWIFT II (AH, AJ), SWIFT II Hatchback (EA, MA)</p>

NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







  <p>TB457 CITROËN AX (ZA-), SAXO (S0, S1), XSARA (N1), XSARA Break (N2) NISSAN MICRA (K11) PEUGEOT 106 I (1A, 1C), 106 II (1) ROVER 100 (METRO) (XP)</p>	  <p>VW CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY II Pickup (9U7), GOLF III (1H1), GOLF III Variant (1H5), POLO (6N1), POLO CLASSIC (6KV2), POLO Variant (6KV5), VENTO (1H2)</p>	  <p>LITEACE Box (CM3_V, KM3_V), LITEACE Bus (_R2_LG), LITEACE Bus (CM30_G, KM30_G), LITEACE Wagon (M2_G), MODELL F Bus (_R2_, 31), PICNIC (_XM10)</p>
<p>TB458 CHEVROLET AVEO Saloon, KALOS, KALOS Saloon, LACETTI, LOVA, NUBIRA Estate, NUBIRA Saloon, REZZO DAEWOO ESPERO (KLEJ), KALOS, KALOS (KLAS), LACETTI Hatchback (KLAN), LANOS (KLAT), LANOS Saloon (KLAT), NEXIA (KLETN), NEXIA Saloon (KLETN), NUBIRA (KLAJ), NUBIRA Saloon (KLAN), NUBIRA Wagon (KLAJ), NUBIRA Wagon (KLAN), REZZO (KLAU)</p>	<p>TB468 ALFA ROMEO 145 (930), 146 (930), 147 (937), 155 (167), 156 (932), 156 Sportwagon (932), 166 (936), GT, GTV (916C_), SPIDER (916S_) FIAT BARCHETTA (183), BRAVA (182), BRAVO (182), COUPE (FA/175), MAREA (185), MAREA Weekend (185), PUNTO (188), STILO (192) LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836), KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), LYBRA (839AX), LYBRA SW (839BX), THESIS (841AX)</p>	<p>TB474 ALFA ROMEO 155 (167) FIAT COUPE (FA/175), CROMA (154), TIPO (160) LANCIA DEDRA (835), DEDRA SW (835), DELTA I (831ABO), DELTA II (836), KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), THEMA (834), THEMA SW (834)</p> <p>TB477 HONDA ACCORD VI (CE, CF), ACCORD VII (CG), ACCORD VII Hatchback (CH), CIVIC V Aerodeck (MC), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK1/3/4)</p>
<p>TB459 CITROËN JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), XM (Y4), XM Break (Y4) PEUGEOT 605 (6B), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_)</p>	<p>TB469 NISSAN SUNNY Box (Y10)</p> <p>TB470 FIAT BRAVA (182), BRAVO (182), MAREA (185), MAREA Weekend (185) LANCIA Y (840A)</p>	<p>MG MG ZR, MG ZS, MG ZS Hatchback ROVER 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 400 (RT), 400 Hatchback (RT), 600 (RH), STREETWISE</p> <p>TB478 LAND ROVER DEFENDER (LD), DEFENDER Station Wagon (LD), DISCOVERY II (LJ, LT)</p>
<p>TB460 MAZDA 323 C V (BA), 323 F V (BA), 323 P V (BA), 323 S V (BA)</p>	<p>TB471 FIAT BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185), MULTIPLA (186), PALIO (178BX), PALIO Weekend (178DX), SIENA (178_), STILO (192), STILO Multi Wagon (192)</p>	<p>TB479 CITROËN EVASION (22, U6), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y4), XM Break (Y4), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2)</p>
<p>TB462 FIAT BRAVO (182), COUPE (FA/175), MAREA (185), MAREA Weekend (185) LANCIA KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), LYBRA (839AX), LYBRA SW (839BX)</p>	<p>LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836), LYBRA (839AX), LYBRA SW (839BX)</p>	<p>FIAT ULYSSE (220) LANCIA ZETA (220) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 605 (6B), 806 (221)</p>
<p>TB463 AUDI A4 (8D2, B5), A4 Avant (8D5, B5) SEAT CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), TOLEDO I (1L) VW GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV Cabriolet (1E7), PASSAT (3B2), PASSAT Variant (3B5), POLO CLASSIC (6KV2), POLO Variant (6KV5), VENTO (1H2)</p>	<p>TB472 FORD C-MAX, FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), FIESTA V (JH_, JD_), FOCUS (DAW, DBW), FOCUS C-MAX, FOCUS Estate (DNW), FOCUS II (DA_), FOCUS II Convertible, FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), FOCUS Saloon (DFW), FUSION (JU_), MONDEO IV, MONDEO IV Turnier, PUMA (EC_) MAZDA 2 (B2W), 121 III (JASM, JBSM) VOLVO C30, S40 II (MS), V50 (MW)</p>	<p>FIAT ZETA (220) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 605 (6B), 806 (221)</p> <p>TB480 DAEWOO ESPERO (KLEJ)</p>
<p>TB464 AUDI A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), CABRIOLET (8G7, B4) VW PASSAT (3B2), PASSAT Variant (3B5)</p>	<p>TB473 TOYOTA AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_), CAMRY (_V2_), CAMRY Liftback (V1), CAMRY Saloon (V1), CAMRY Station Wagon (_V2_), CARINA E (_T19_), CARINA E Saloon (_T19_), CARINA E Sportswagon (_T19_), CARINA II (_T15_), CARINA II (_T17_), CARINA II Saloon (_T15_), CARINA II Saloon (_T17_), CARINA II Station Wagon (_T17_), CARINA Station Wagon (TA4K, TA6K), COROLLA (_E8_), COROLLA (_E9_), COROLLA (_E10_), COROLLA (_E11_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA Compact (_E11_), COROLLA FX Compact (E8B), COROLLA Liftback (_E8_), COROLLA Liftback (_E9_), COROLLA Liftback (_E10_), COROLLA Liftback (_E11_), COROLLA Station Wagon (_E7_), COROLLA Station Wagon (_E9_), COROLLA Wagon (_E11_), COROLLA Wagon (_E10_), LITEACE Box (_R2_V),</p>	<p>SAAB 9-5 (YS3E), 9-5 Estate (YS3E), 900 II, 900 II Convertible, 900 II Coupe, 9000, 9000 Hatchback VAUXHALL CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, OMEGA, OMEGA Estate, SIGNUM, SINTRA, VECTRA, VECTRA Estate, VECTRA Hatchback, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS</p>
<p>TB465 VW POLO (6N1), POLO Box (6NF)</p>		<p>TB481 OPEL CALIBRA A (85_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), SIGNUM, SINTRA, VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_), VECTRA C, VECTRA C Estate, VECTRA C GTS 9-5 (YS3E), 9-5 Estate (YS3E), 900 II, 900 II Convertible, 900 II Coupe, 9000, 9000 Hatchback</p>
<p>TB466 SEAT AROSA (6H), CORDOBA (6K2/C2), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), INCA (6K9) VW CADDY II Box (9K9A), CADDY II Estate (9K9B), FOX (5Z1), GOLF III (1H1), GOLF III Variant (1H5), LUPO (6X1, 6E1), POLO (6N1), POLO (6N2), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), VENTO (1H2)</p>		<p>TB482 NISSAN KUBISTAR (X76) RENAULT CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (S80/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), TWINGO (C06_), TWINGO (CNO_), TWINGO Box (S06_)</p>
<p>TB467 SEAT CORDOBA (6K2/C2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), INCA (6K9) SKODA FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5), OCTAVIA (1U2), OCTAVIA Combi (1U5)</p>		<p>TB487 LDV CUB NISSAN SERENA (C23M), VANETTE CARGO Box (HC 23), VANETTE CARGO Bus (HC 23)</p>

					
TB488 VOLVO	960 (964), 960 II (964), 960 II Estate (965), 960 Kombi (965), S80 (TS, XY), S90, V90 Estate		MONDEO II Estate (BNP), MONDEO II Saloon (BFP), ORION II (AFF), ORION III (GAL), P 100 II, SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)		TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD), VENTO (1H2)
TB489 HYUNDAI	GALLOPER I, GALLOPER II (JK-01), H-1 Box, H-1 Bus (KMF), H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup, STAREX (H1), TERRACAN (HP)	MAZDA	121 III (JASM, JBSM)	TB508 OPEL	ASTRA F (56_, 57_), ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), FRONTERA A Sport (5_SUD2), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_)
KIA	K2500 (SD), PREGIO Box (TB)	FORD	ESCORT '95 Box (AVL), ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA Box (J5_, J3_), FIESTA Box (JV_), FIESTA III (GFI), FIESTA IV (JA_, JB_), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP)	VAUXHALL	ASTRA Mk II Convertible, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, FRONTERA Sport, OMEGA, OMEGA Estate
MITSUBISHI	GALLOPER (JK-01), L 200 (K_T), L 300 Box (PO_W, P1_W), L 300 Bus (PO_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), L 300 Flatbed / Chassis (P1_T), L 400 Box (PAOV), L 400 Bus (PAOV), PAJERO CLASSIC (V2_W), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), PAJERO III (V60, V70), PAJERO SPORT (K90), SPACE GEAR (PA/B/D_V/W)	MAZDA	121 III (JASM, JBSM)	TB509 OPEL	ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), ASTRA G Box (F70), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), CALIBRA A (85_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)
RENAULT	ESPACE III (EEO_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SAFRANE II (B54_)	MAZDA	121 III (JASM, JBSM)	VAUXHALL	ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRAVAN Mk III, ASTRAVAN Mk IV, CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback
TB490 HYUNDAI	GALLOPER I, GALLOPER II (JK-01), H-1 Box, H-1 Bus (KMF), H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup, STAREX (H1), TERRACAN (HP)	TB498 PORSCHE	924, 944, 944 Convertible, 968, 968 Convertible	TB513 HONDA	ACCORD VI (CE, CF), ACCORD VII (CG), ACCORD VII Hatchback (CH), CIVIC V Fastback (MB)
KIA	K2500 (SD), PREGIO Box (TB)	TB499 PORSCHE	924, 944	MG	MG ZR, MG ZS, MG ZS Hatchback
MITSUBISHI	GALLOPER (JK-01), L 200 (K_T), L 300 Box (PO_W, P1_W), L 300 Bus (PO_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), L 300 Flatbed / Chassis (P1_T), L 400 Box (PAOV), L 400 Bus (PAOV), PAJERO CLASSIC (V2_W), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), PAJERO III (V60, V70), PAJERO SPORT (K90), SPACE GEAR (PA/B/D_V/W)	TB502 PORSCHE	944, 944 Convertible, 968, 968 Convertible	ROVER	25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 400 (RT), 400 Hatchback (RT), 600 (RH), STREETWISE
TB491 CHEVROLET	MATIZ	SUZUKI	SWIFT II Hatchback (EA, MA)	TB515 FIAT	UNO (146A/E)
DAEWOO	MATIZ (KLYA), TICO (KLY3)	NISSAN	ALMERA I (N15), ALMERA I Hatchback (N15), CHERRY (N12), PRIMERA (P10), PRIMERA Hatchback (P10), PRIMERA Traveller (W10), SUNNY Box (Y10), SUNNY I (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10)	TB516 RENAULT	LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_)
MITSUBISHI	COLT V (CJ_A), LANCER VI (CK/P_A)	TB504 AUDI	80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 90 (89, 89Q, 8A, B3), 100 (4A, C4), 100 Avant (4A, C4), 200 (44, 44Q), 200 Avant (44, 44Q), A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4), COUPE (81, 85), COUPE (89, 8B), QUATTRO (85)	TB517 MAZDA	929 III (HC), MPV I (LV)
TB492 MITSUBISHI	CARISMA (DA_), CARISMA Saloon (DA_), COLT IV (CA_A), COLT V (CJ_A), LANCER V (CB/D_A)	TB505 AUDI	80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4), COUPE (89, 8B)	TB518 HYUNDAI	LANTRA I (J-1), PONY (X-2), PONY/EXCEL Saloon (X-2), S COUPE (SLC)
TB493 MITSUBISHI	CARISMA (DA_), CARISMA Saloon (DA_), PAJERO PININ (H6_W, H7_W), SPACE STAR (DGO)	SEAT	CORDOBA (6K2/C2), IBIZA II (6K1), TOLEDO I (1L)	MITSUBISHI	COLT II (C1_A), COLT III (C5_A), LANCER III (C1_A, C6_A), LANCER III Station Wagon (C1_V, C3_V), LANCER IV (C6_A, C7_A), LANCER IV Saloon (C6_A), MIRAGE Hatchback
TB495 FORD	ESCORT '86 Express (AVF), ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA Box (FVD), FIESTA Box (J5_, J3_), FIESTA Box (JV_), FIESTA III (GFI), FIESTA IV (JA_, JB_), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP),	VW	JETTA II (19E, 1G2), PASSAT (3A2, 351), PASSAT Variant (3A5, 351), SCIROCCO (53B)	TB519 ISUZU	TROOPER Open Off-Road Vehicle (UBS)
		SEAT	CORDOBA (6K2/C2), IBIZA II (6K1), TOLEDO I (1L)		
		VW	CORRADO (531), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV Cabriolet (1E7), PASSAT (3A2, 351), PASSAT Variant (3A5, 351), SHARAN (7M8, 7M9, 7M6), TRANSPORTER IV Box (70XA),		

NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits




 	 	 
TB520 VOLVO 740 (744), 740 Kombi (745)	TB536 FORD RANGER (TU_) MAZDA B-SERIE (UF), B-SERIE (UN), MPV I (LV)	TB552 AUDI A3 (8L1), A3 (8P1), A3 Sportback (8PA), A4 (8D2, B5), A4 (8E2, B6), A4 (8EC), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Avant (8ED)
TB521 NISSAN CHERRY (N12), SUNNY Box (Y10), SUNNY I (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Hatchback (N13), SUNNY II Traveller (B12)	TB537 HYUNDAI ACCENT (LC), ACCENT (MC), ACCENT (X-3), ACCENT Saloon (LC), ACCENT Saloon (MC), ACCENT Saloon (X-3), COUPE (GK), COUPE (RD), ELANTRA (XD), ELANTRA Saloon (XD), GETZ (TB), MATRIX (FC) KIA CERATO, CERATO Saloon, RIO II, RIO II Saloon	SEAT ALHAMBRA (7V8, 7V9), ALTEA (5P1), ALTEA XL (5P5), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), LEON (1M1), LEON (1P1), TOLEDO II (1M2), TOLEDO III (5P2)
TB522 VAUXHALL MIDI, MIDI II	TB538 HONDA ACCORD VI (CE, CF), ACCORD VII (CG), ACCORD VII Coupe (CG), ACCORD VII Hatchback (CH), SHUTTLE (RA)	SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA (1Z3), OCTAVIA Combi (1U5), OCTAVIA Combi (1Z5), SUPERB (3U4)
TB524 CHEVROLET CAPTIVA DAEWOO LEGANZA (KLAV) OPEL ANTARA, FRONTERA A (5_MWL4), FRONTERA B (6B_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), SINTRA VAUXHALL ANTARA, FRONTERA, FRONTERA Mk II, OMEGA, OMEGA Estate, SINTRA	TB539 HYUNDAI COUPE (GK), COUPE (RD), ELANTRA (XD), ELANTRA Saloon (XD), i30, i30 CW Estate, LANTRA II (J-2), LANTRA II Wagon (J2), TRAJET (FO), TUCSON (JM) KIA CARENS II (FJ), CEE'D Estate, CEE'D Hatchback, CERATO, CERATO Saloon, PRO CEE'D, SPORTAGE (JE_)	VW BORA (1J2), BORA Estate (1J6), CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), GOLF IV (1J1), GOLF IV Variant (1J5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), MULTIVAN V (7HM, 7HF), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), PASSAT (3B2), PASSAT (3B3), PASSAT (3C2), PASSAT Variant (3B5), PASSAT Variant (3B6), PASSAT Variant (3C5), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), TOURAN (1T1, 1T2), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HJ), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)
TB525 CITROËN JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230) PEUGEOT BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_)	TB540 MITSUBISHI GALANT VI (EA_), GALANT VI Estate (EA_), SPACE RUNNER (N50), SPACE WAGON (N5_W)	TB553 SEAT CORDOBA (6K2/C2), IBIZA II (6K1) VW POLO (6N1)
TB526 PORSCHE 911 (964), 911 (993), 911 Convertible (964), 911 Convertible (993)	TB541 MAZDA 323 F VI (BJ), 323 P V (BA), 323 S V (BA), 323 S VI (BJ)	TB554 AUDI A3 (8L1), A4 (8D2, B5), A4 (8E2, B6), A4 (8EC), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), TT (8N3), TT Roadster (8N9)
TB527 TOYOTA PASEO Convertible (EL54), PASEO Coupe (EL54)	TB542 NISSAN PATROL GR I (Y60), PATROL GR II (Y61), PATROL Station Wagon (W260)	SEAT ALHAMBRA (7V8, 7V9), CORDOBA Hatchback (6K2), IBIZA III (6K1), IBIZA IV (6L1), LEON (1M1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5), SUPERB (3U4) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6), POLO (9N_), SHARAN (7M8, 7M9, 7M6)
TB528 ALFA ROMEO 145 (930), 146 (930), 147 (937), 156 (932), 156 Sportwagon (932)	TB545 ARO 10 MITSUBISHI CARISMA (DA_), CARISMA Saloon (DA_) OPEL ARENA Box (TB, TF), ARENA Combi (THB) RENAULT MEGANE Classic (LA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), TRAFIC Box (TXX), TRAFIC Bus (TXW) SUZUKI SAMURAI (SJ) VAUXHALL ARENA Combi, ARENA Van VOLVO S40 I (VS), V40 Estate (VW)	TB555 AUDI A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), CABRIOLET (8G7, B4) VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5)
TB529 DACIA LOGAN, LOGAN MCV, SOLENZA RENAULT CLIO I (B/C57_, 5/357_), CLIO II (B80/1/2_, CB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LOGAN (LS_), MEGANE Classic (LA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), THALIA (LBO/1/2_)	TB546 RENAULT ESPACE III (JEO_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), SCENIC (JA0/1_) VOLVO S40 I (VS), V40 Estate (VW)	TB556 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), A8 (4E_) SKODA SUPERB (3U4) VW PASSAT (3B2), PASSAT (3B3)
TB531 ALFA ROMEO 164 (164) LANCIA KAPPA (838A), KAPPA SW (838B)	TB547 MG MG TF, MG ZR, MGF (RD) ROVER 25 (RF), 200 (RF), 400 Tourer (XW), COUPE	TB556 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), A8 (4E_)
TB532 ALFA ROMEO 147 (937), 156 (932), 156 Sportwagon (932), 166 (936), GT, GTV (916C_), SPIDER (916S_) LANCIA KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), THESIS (841AX)	TB548 KIA CARENS I (FC), CARENS II (FJ), CLARUS (K9A), CLARUS Estate (GC), SEPHIA (FA), SEPHIA Saloon (FA), SHUMA (FB), SHUMA II (FB)	TB556 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), A8 (4E_) SKODA SUPERB (3U4) VW PASSAT (3B2), PASSAT (3B3)
TB533 AUDI A3 (8L1) SEAT CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), INCA (6K9), LEON (1M1), TOLEDO II (1M2) SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA Combi (1U5) VW BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5)	TB550 MITSUBISHI PAJERO II (V2_W, V4_W), PAJERO III (V60, V70)	TB556 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), A8 (4E_) SKODA SUPERB (3U4) VW PASSAT (3B2), PASSAT (3B3)
TB534 LAND ROVER FREELANDER (LN), FREELANDER Soft Top MG MG TF, MG ZR, MGF (RD) ROVER 25 (RF), 200 (RF), 400 Tourer (XW), COUPE	TB551 SUBARU IMPREZA Coupe (GFC), IMPREZA Estate (GF), IMPREZA Saloon (GC), LEGACY I (BC), LEGACY I Estate (BJF), LEGACY II (BD, BG), LEGACY II Estate (BD, BG)	TB556 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), A8 (4E_) SKODA SUPERB (3U4) VW PASSAT (3B2), PASSAT (3B3)
TB535 SUZUKI SWIFT II Hatchback (EA, MA)	TB551 SUBARU IMPREZA Coupe (GFC), IMPREZA Estate (GF), IMPREZA Saloon (GC), LEGACY I (BC), LEGACY I Estate (BJF), LEGACY II (BD, BG), LEGACY II Estate (BD, BG)	TB556 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), A8 (4E_) SKODA SUPERB (3U4) VW PASSAT (3B2), PASSAT (3B3)

					
	PASSAT Variant (3B5), PASSAT Variant (3B6), PHAETON (3D2), TOUAREG (7LA, 7L6, 7L7)	TB567 BMW 3 (E21), 5 (E12) TOYOTA CRESSIDA Saloon (X6_)		TB629 FORD TRANSIT Box (E_), TRANSIT Bus (E_), TRANSIT Flatbed / Chassis (E_) LDV CONVOY Box, CONVOY Flatbed / Chassis TAXI METRO CAB	
TB557	850 (LS), 850 Estate (LW), S70 (P80_), S80 (TS, XY), V70 I Estate (P80_), V70 II Estate (P80_)	TB571 NISSAN MICRA (K10)		TB631 CITROËN BERLINGO (MF), BERLINGO Box (M_), C15 (VD_), JUMPY (U6U), JUMPY Box (BS_ , BT_ , BY_ , BZ_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO) FIAT SCUDDO Box (220L), SCUDDO Combinato (220P) PEUGEOT 206 Hatchback (2A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), EXPERT Box (222), EXPERT Flatbed / Chassis, EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F) TOYOTA COROLLA (E11_), COROLLA Compact (E11_), COROLLA Liftback (E11_), COROLLA Wagon (E11_)	
VW	LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)	TB577 FIAT 127, 127 Panorama, FIORINO (147), FIORINO Pick up (147)			
TB558	FIAT DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230) IVECO Daily II OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9) RENAULT MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD) VAUXHALL MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD)	TB578 LANCIA THEMA (834)			
		TB579 ALFA ROMEO 155 (167) FIAT COUPE (FA/175), CROMA (154), TEMPRA (159), TEMPRA S.W. (159), TIPO (160) LANCIA DEDRA (835), DEDRA SW (835), DELTA I (831ABO), DELTA II (836), KAPPA (838A), KAPPA Coupe (838), KAPPA SW (838B), THEMA (834), THEMA SW (834)			
TB559	ALFA ROMEO 145 (930), 146 (930), 155 (167), 156 (932), 156 Sportwagon (932), GT FIAT BARCHETTA (183), MAREA (185), MAREA Weekend (185), PUNTO (188), STILO (192), STILO Multi Wagon (192) LANCIA LYBRA (839AX), LYBRA SW (839BX), THESIS (841AX)	TB580 ZASTAVA YUGO FLORIDA		TB632 CITROËN BERLINGO (MF), BERLINGO Box (M_), C5 (DC_), C5 Break (DE_), EVASION (22, U6), JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (244), JUMPY (U6U), JUMPY Box (BS_ , BT_ , BY_ , BZ_), JUMPY Flatbed / Chassis (BU_ , BV_ , BW_ , BX_), XANTIA (X2), XANTIA Break (X2), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), XSARA PICASSO (N68) FIAT DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (244), SCUDDO Box (220L), SCUDDO Combinato (220P), ULYSSE (220) LANCIA ZETA (220) PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 307 Break (3E), 307 SW (3H), 406 (8B), 406 Break (8E/F), 607 (9D, 9U), 806 (221), BOXER Box (230L), BOXER Box (244), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis, PARTNER Box (5), PARTNER Combispace (5F) SUZUKI GRAND VITARA (FT, GT)	
		TB590 FORD ECONOVAN (KBA, KCA), ECONOVAN Box (KAA) KIA RETONA (CE), SPORTAGE (K00) MAZDA E 2000, 2200 Box (SR2) SUZUKI GRAND VITARA (FT, GT), VITARA (ET, TA)			
		TB593 MASERATI BITURBO (70, 77), BITURBO Coupe			
		TB597 TOYOTA SUPRA (MA70)			
TB560	FIAT DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), SCUDDO Box (220L), SCUDDO Combinato (220P), ULYSSE (220) FSO POLONEZ II, POLONEZ III HONDA CONCERTO (HW) HYUNDAI LANTRA II (J-2), LANTRA II Wagon (J2) PEUGEOT 205 Box, 205 I (741A/C), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), 405 II (4B), 405 II Break (4E), 406 (8B), 406 Break (8E/F), 806 (221), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223), J5 Box (290L), J5 Bus (290P), J5 Flatbed / Chassis (290L), PARTNER Box (5), PARTNER Combispace (5F) ROVER 200 Hatchback (XW), 400 (XW), 400 Tourer (XW) SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), SAMURAI (S), VITARA (ET, TA), VITARA Cabrio (ET, TA) TALBOT EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1800 Box, HORIZON	TB600 PORSCHE 928			
		TB602 AUDI 80 (81, 85, B2), 90 (81, 85, B2), 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3), 200 (43), 200 (44, 44Q), 200 Avant (44, 44Q), COUPE (81, 85), QUATTRO (85) VW PASSAT (32B), PASSAT Variant (32B), SANTANA (32B)			
		TB603 VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)			
		TB604 AUDI 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), A8 (4D2, 4D8), V8 (44_ , 4C_)			
		TB607 ALFA ROMEO 145 (930), 146 (930), 155 (167), GTV (916C_), SPIDER (916S_)			
		TB608 FIAT BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185), PALIO Weekend (178DX), PUNTO (188), PUNTO Van (188AX), STRADA (178E) LANCIA KAPPA (838A), KAPPA SW (838B)			
TB561	CHRYSLER LE BARON, LE BARON Convertible	TB610 NISSAN BLUEBIRD (T72 , T12), BLUEBIRD (U11), BLUEBIRD Station Wagon (WU11)			
TB562	CHRYSLER VOYAGER I (ES)	TB616 HONDA CR-V I (RD)			
TB563	CHRYSLER LE BARON, LE BARON Convertible, VOYAGER I (ES)	TB621 DAIHATSU CUORE I (L55, L60)			
TB565	CHRYSLER NEON (PL), VOYAGER II (GS) DODGE NEON II	TB626 NISSAN 300 ZX (Z32)			

NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







					
VW	OCTAVIA (1U2), OCTAVIA (1Z3), OCTAVIA Combi (1U5), OCTAVIA Combi (1Z5), PRAKTIK, ROOMSTER (5J) BORA (1J2), BORA Estate (1I6), CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KI), GOLF IV (1J1), GOLF IV Variant (1J5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, LUPO (6X1, 6E1), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), POLO (6N1), POLO (6N2), POLO (9N_), POLO CLASSIC (6KV2), POLO Saloon, POLO Variant (6KV5)	LANCIA OPEL SAAB VAUXHALL	PUNTO (188), PUNTO Van (188AX), SEDICI, STILO (192), STILO Multi Wagon (192), STRADA (178E) KAPPA (838A), KAPPA SW (838B), LYBRA (839AX), LYBRA SW (839BX), MUSA, THESIS (841AX) ASTRA H, ASTRA H Estate, ASTRA H GTC, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA 9-3 (YS3F), 9-3 Estate ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II	TB649 FIAT	DOBLO (119), DOBLO Cargo (223), PALIO (178BX), PALIO Weekend (178DX), PANDA (169), PANDA Van (141_), PUNTO (176), PUNTO (188), PUNTO Convertible (176C), PUNTO Van (188AX), SIENA (178_), STRADA (178E)
TB636 DACIA NISSAN RENAULT	LOGAN, LOGAN MCV KUBISTAR (X76) CLIO II (BB0/1/2_, CB0/1/2_), CLIO III (BR0/1, CR0/1), GRAND SCENIC (JM0/1_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE II (BM0/1_, CM0/1_), MEGANE II Coupé-Cabriolet (EM0/1_), MEGANE II Estate (KM0/1_), MEGANE II Saloon (LM0/1_), MODUS (F/JPO_), SCENIC (JA0/1_), SCENIC II (JM0/1_), THALIA (LB0/1/2_)	TB640 LAND ROVER MG ROVER	FREELANDER (LN), FREELANDER Soft Top MG TF, MG ZR, MG ZS, MG ZS Hatchback, MG ZT, MG ZT-T, MGF (RD) 25 (RF), 45 (RT), 45 Saloon (RT), 75 (RJ), 75 Tourer (RJ), 200 (RF), 400 (RT), 400 Hatchback (RT), 400 Tourer (XW), STREETWISE	TB650 LAND ROVER MG ROVER	FREELANDER (LN), FREELANDER Soft Top MG ZR, MG ZS, MG ZS Hatchback 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 400 (RT), 400 Hatchback (RT), STREETWISE
TB637 FIAT	500, BRAVA (182), BRAVO, BRAVO (182), GRANDE PUNTO (199), IDEA, LINEA, MAREA (185), MAREA Weekend (185), PANDA (169), PUNTO (176), PUNTO (188), PUNTO Convertible (176C), SIENA (178_), STILO (192), STILO Multi Wagon (192) MUSA, Y (840A), YPSILON	TB641 AUDI	A4 (8D2, B5), A4 (8E2, B6), A4 (8EC), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH) SUPERB (3U4) PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)	TB651 LAND ROVER MG ROVER	FREELANDER (LN), FREELANDER Soft Top MG ZR, MG ZS, MG ZS Hatchback 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 400 (RT), 400 Hatchback (RT), STREETWISE
TB638 CHEVROLET OPEL	NUBIRA Estate, NUBIRA Saloon ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), MERIVA, SIGNUM, TIGRA TwinTop, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA, ZAFIRA (F75_) 9-3 (YS3F), 9-3 Estate	TB642 AUDI	A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8) PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)	TB652 NISSAN OPEL RENAULT	FREELANDER (LN), FREELANDER Soft Top MG ZR, MG ZS, MG ZS Hatchback 25 (RF), 45 (RT), 45 Saloon (RT), 200 (RF), 400 (RT), 400 Hatchback (RT), STREETWISE PRIMASTAR Box (X83), PRIMASTAR Bus (X83) VIVARO Box (F7), VIVARO Combi (J7), VIVARO Flatbed / Chassis (E7) AVANTIME (DE0_), CLIO III (BR0/1, CR0/1), ESPACE IV (JK0/1_), GRAND SCENIC (JM0/1_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MEGANE Cabriolet (EA0/1_), MEGANE II (BM0/1_, CM0/1_), MEGANE II Coupé-Cabriolet (EM0/1_), MEGANE II Estate (KM0/1_), MEGANE II Saloon (LM0/1_), SCENIC II (JM0/1_), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL), VEL SATIS (BJ0_) VIVARO Box, VIVARO Combi
SAAB VAUXHALL	ASTRA Mk IV, ASTRA Mk IV Convertible, ASTRA Mk IV Coupe, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, CORSA Mk II, MERIVA, SIGNUM, TIGRA TwinTop, VECTRA Estate, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA	TB643 FORD RENAULT VOLVO	FOCUS II (DA_), MONDEO IV, MONDEO IV Saloon, MONDEO IV Turnier, S-MAX LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SAFRANE II (B54_) C30, C70 Convertible, C70 Coupe, S40 I (VS), S40 II (MS), S60, S70 (P80_), S80 (TS, XY), S80 II, V40 Estate (VW), V50 (MW), V70 I Estate (P80_), V70 II Estate (P80_), V70 III Estate, XC 90, XC70 CROSS COUNTRY	TB653 MITSUBISHI NISSAN OPEL RENAULT	CARISMA (DA_), CARISMA Saloon (DA_), SPACE STAR (DG0) INTERSTAR Box (X70), INTERSTAR Bus (X70), PRIMASTAR Box (X83), PRIMASTAR Bus (X83) MOVANO Box (F9), MOVANO Combi (J9), VIVARO Box (F7), VIVARO Combi (J7) ESPACE IV (JK0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MASTER II Box (FD), MASTER II Bus (JD/ND), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL) MOVANO Combi (JD), MOVANO Van (FD), VIVARO Box, VIVARO Combi S40 I (VS), V40 Estate (VW)
TB639 ALFA ROMEO	145 (930), 146 (930), 147 (937), 156 (932), 156 Sportwagon (932), 159, 159 Sportwagon, 166 (936) BRAVA (182), BRAVO, BRAVO (182), CROMA (194), DOBLO (119), DOBLO Cargo (223), GRANDE PUNTO (199), IDEA, MAREA (185), MAREA Weekend (185), MULTIPLA (186),	TB644 RENAULT	CLIO II (BB0/1/2_, CB0/1/2_), ESPACE III (JE0_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), MEGANE Classic (LA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), SCENIC (JA0/1_) ALMERA I (N15), ALMERA I Hatchback (N15), PRIMERA (P11), PRIMERA Hatchback (P11), PRIMERA Traveller (WP11), SUNNY III Traveller (Y10)	TB654 OPEL RENAULT	MOVANO Box (F9) CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), ESPACE III (JE0_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), MEGANE Classic (LA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), SCENIC (JA0/1_) AVENSIS (T22_), AVENSIS (T25), AVENSIS Estate (T25), AVENSIS Liftback (T22_), AVENSIS Saloon (T25), AVENSIS Station Wagon (T22_), AVENSIS VERSO (AC_), COROLLA (E11_), COROLLA (E12U_, E12L_)
FIAT		TB645 NISSAN		TB655 TOYOTA	
		TB647 OPEL	ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, SPEEDSTER, ZAFIRA, ZAFIRA (F75_) ASTRA MK IV Convertible, ASTRA MK IV Coupe, ASTRA Mk IV Hatchback, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, ASTRA TwinTop, VX220, ZAFIRA, ZAFIRA Mk II		



 <p>COROLLA Compact (E11), COROLLA Estate (E12, E12T), COROLLA Liftback (E11), COROLLA Saloon (E12, E12T), COROLLA Verso (E12), COROLLA Verso (ZER, ZZE), COROLLA Wagon (E11), PREVIA (ACR3), RAV 4 II (XA2)</p>	 <p>LANCIA Y (840A)</p> <p>TB667 TOYOTA COROLLA (E8), COROLLA Liftback (E8), STARLET (P7)</p> <p>TB669 SUZUKI VITARA (ET, TA), VITARA Cabrio (ET, TA)</p> <p>TB671 MITSUBISHI GALANT V (E5_A, E7_A, E8_A), GALANT V Saloon (E5_A, E7_A, E8_A), GALANT VI (EA), GALANT VI Estate (EA), LANCER IV (C6_A, C7_A), LANCER V (CB/D_A), LANCER V Station Wagon (CB_W, CD_W), SPACE RUNNER (N1_W, N2_W), SPACE WAGON (N3_W, N4_W)</p> <p>PROTON PERSONA 400 (C9_S), PERSONA 400 Hatchback (C9_C, C9_S)</p>	 <p>LUPO (6X1, 6E1), MULTIVAN V (7HM, 7HF), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), PASSAT (3B2), PASSAT (3B3), PASSAT (3C2), PASSAT Variant (3B5), PASSAT Variant (3B6), PASSAT Variant (3C5), POLO (6N2), POLO (9N), POLO Saloon, SHARAN (7M8, 7M9, 7M6), TOURAN (1T1, 1T2), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HJ), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)</p>
<p>TB656 OPEL ASTRA G Estate (F35), ASTRA G Hatchback (F48, F08), ASTRA G Saloon (F69), ASTRA H, ASTRA H Estate, ASTRA H GTC, COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), CORSA C Box (F08, W5L), CORSA D, MERIVA, ZAFIRA</p> <p>VAUXHALL ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, COMBO, CORSA Mk II, CORSA Mk III, CORSAVAN MK II, MERIVA</p>	<p>TB673 CHRYSLER SEBRING Coupe, STRATUS (JA), STRATUS Convertible (JX)</p> <p>DODGE STRATUS</p> <p>MITSUBISHI PAJERO II (V2_W, V4_W), P AJERO II Open Off-Road Vehicle (V2_W, V4_W), PAJERO SPORT (K90)</p>	<p>TB681 FORD FIESTA Box (J5, J3), FIESTA Box (JV), FIESTA IV (JA, JB), FOCUS (DAW, DBW), FOCUS C-MAX, FOCUS Estate (DNW), FOCUS II (DA), FOCUS II Saloon (DA), FOCUS II Turnier (DAW), FOCUS Saloon (DFW), GALAXY, MONDEO IV, MONDEO IV Turnier, S-MAX, TOURNEO CONNECT, TRANSIT CONNECT (P65, P70, P80)</p>
<p>TB657 SEAT AROSA (6H)</p> <p>SKODA FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5)</p> <p>VW CADDY II Pickup (9U7), LUPO (6X1, 6E1), POLO (6N1), POLO (6N2), POLO Box (6NF)</p>	<p>TB674 DAIHATSU CHARADE II (G11, G30), CHARADE III (G100, G101, G102)</p>	<p>TB682 CHRYSLER PT CRUISER (PT), SEBRING (JR), SEBRING Convertible (JR)</p>
<p>TB658 AUDI A2 (8Z0)</p> <p>SEAT AROSA (6H), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), IBIZA IV (6L1), IBIZA V (6J5), IBIZA V SPORTCOUPE (6J1), INCA (6K9), LEON (1M1), LEON (1P1), TOLEDO II (1M2)</p> <p>SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA (1Z3), OCTAVIA Combi (1U5)</p> <p>VW BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), GOLF IV (1J1), GOLF IV Variant (1J5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, LUPO (6X1, 6E1), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), POLO (6N1), POLO (6N2), POLO (9N), POLO CLASSIC (6KV2), POLO Saloon, POLO Variant (6KV5)</p>	<p>TB676 FIAT CINQUECENTO (170), PANDA (141A), PANDA (169), PANDA Van (141), PUNTO (176), PUNTO Van (176L), SEICENTO (187), SEICENTO Van (187), UNO (146A/E) Y (840A)</p> <p>TB678 CITROËN C5 (DC), C5 (RC), C5 Break (DE), C5 Break (RE), C8 (EA, EB)</p> <p>FIAT ULYSSE (179AX)</p> <p>LANCIA PHEDRA (179)</p> <p>PEUGEOT 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 607 (9D, 9U), 807 (E)</p> <p>TB679 HYUNDAI ACCENT (LC), ACCENT Saloon (LC), GETZ (TB), LANTRA II (J-2)</p> <p>TB680 AUDI A2 (8Z0), A3 (8L1), A3 (8P1), A3 Sportback (8PA), A4 (8D2, B5), A4 (8E2, B6), A4 (8EC), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5)</p>	<p>TB683 CITROËN C4 (LC), C4 Coupe (LA), C5 (DC), C5 (RC), C5 Break (DE), C5 Break (RE), C8 (EA, EB), EVASION (22, U6), JUMPY (U6U), JUMPY Box (BS, BT, BY, BZ), JUMPY Flatbed / Chassis (BU, BV, BW, BX), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68)</p> <p>FIAT SCUDDO Box (220L), SCUDDO Combinato (220P), ULYSSE (179AX), ULYSSE (220)</p> <p>LANCIA PHEDRA (179), ZETA (220)</p> <p>PEUGEOT 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 407 (6D), 407 Coupe (6C), 407 SW (6E), 607 (9D, 9U), 806 (221), 807 (E), EXPERT (224), EXPERT Box (222)</p>
<p>TB659 AUDI A3 (8L1)</p> <p>SEAT CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), IBIZA IV (6L1), INCA (6K9), LEON (1M1), TOLEDO II (1M2)</p> <p>SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA Combi (1U5)</p> <p>VW BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), POLO (6N2), POLO (9N), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Saloon, POLO Variant (6KV5)</p>	<p>FORD GALAXY (WGR)</p> <p>SEAT ALHAMBRA (7V8, 7V9), ALTEA (5P1), ALTEA XL (5P5), AROSA (6H), CORDOBA (6L2), IBIZA IV (6L1), IBIZA V (6J5), IBIZA V SPORTCOUPE (6J1), LEON (1M1), LEON (1P1), TOLEDO II (1M2), TOLEDO III (5P2)</p> <p>SKODA FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA (1Z3), OCTAVIA Combi (1U5), OCTAVIA Combi (1Z5), PRAKTIK, ROOMSTER (5I), SUPERB (3U4)</p>	<p>TB684 MITSUBISHI CARISMA (DA), CARISMA Saloon (DA), SPACE STAR (DGO)</p> <p>VOLVO S40 I (VS), V40 Estate (VW)</p> <p>TB685 MAZDA 323 F VI (BJ), 323 S VI (BJ), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), PREMACY (CP)</p>
<p>TB660 FIAT PALIO (178BX), PALIO Weekend (178DX), PUNTO (176), PUNTO Convertible (176C), SIENA (178), STRADA (178E)</p>	<p>VW BORA (1J2), BORA Estate (1J6), CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), EOS, FOX (5Z1), GOLF IV (1J1), GOLF IV Variant (1J5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2),</p>	<p>TB687 TOYOTA HIACE IV Box (H1, H2), HIACE IV Wagon (H1, H2), HILUX Pickup, HILUX Pickup (N), LAND CRUISER (J12), LAND CRUISER 90 (J9)</p> <p>TB692 TOYOTA 4 RUNNER (N130)</p> <p>TB694 MITSUBISHI PAJERO II (V2_W, V4_W)</p> <p>TB695 TOYOTA COASTER Bus, LAND CRUISER (J7)</p> <p>TB696 LEXUS RX (MCU), RX (XU1)</p> <p>TOYOTA CAMRY (V20), CAMRY (V30)</p>



NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







  <p>TB699 CITROËN BERLINGO (MF), BERLINGO Box (M_), C2 (JM_), C3 (FC_), SAXO (S0, S1) PEUGEOT 106 II (1), 206 Hatchback (2A/C), 206 SW (2E/K), PARTNER Box (5), PARTNER Combispace (5F)</p>	  <p>MASTER II Flatbed / Chassis (ED/HD/UD), MASTER III Box (HD, FD), MASTER III Bus (JD), MASTER III Flatbed / Chassis (ED, UD), TRAFIC II Box (FL), TRAFIC II Bus (JL), TRAFIC II Flatbed / Chassis (EL), VEL SATIS (BJO_)</p>	  <p>TB720 CITROËN C1 (PM_, PN_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), C8 (EA_, EB_), EVASION (22, U6), JUMPY (U6U), NEMO (AA_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO) FIAT SCUDO Box (220L), SCUDO Combinato (220P), ULYSSE (179AX), ULYSSE (220) FORD FIESTA V (JH_, JD_), FIESTA Van, FUSION (JU_) LANCIA PHEDRA (179), ZETA (220) MAZDA 2 (B2W) PEUGEOT 107, 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 806 (221), 807 (E), 1007 (KM_), BIPPER (AA_), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis SUZUKI GRAND VITARA (FT, GT) TOYOTA AYGO</p>
<p>TB700 CITROËN BERLINGO, BERLINGO (MF), BERLINGO Box, BERLINGO Box (M_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), C4 (LC_), C4 Coupe (LA_), SAXO (S0, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), XSARA PICASSO (N68) PEUGEOT 106 II (1), 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 1007 (KM_), PARTNER Box, PARTNER Combispace (5F), PARTNER Tepee</p>	<p>VAUXHALL TB711 CITROËN BERLINGO (MF), BERLINGO Box (M_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), NEMO (AA_), SAXO (S0, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO) PEUGEOT 106 II (1), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 207 SW (WK_), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 1007 (KM_), BIPPER (AA_), PARTNER Box (5), PARTNER Combispace (5F)</p>	<p>TB721 CITROËN C3 (FC_) SUZUKI LIANA (ER), LIANA Estate (ER)</p>
<p>TB701 FIAT DUCATO Box (230L), DUCATO Box (290), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), DUCATO Flatbed / Chassis (290), DUCATO Panorama (290) RENAULT MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_)</p>	<p>TB712 RENAULT CLIO II (BB0/1/2_, CB0/1/2_), CLIO III (BR0/1, CR0/1), KANGOO (KC0/1_), KANGOO Express (FC0/1_), MODUS (F/JP0_), THALIA (LB0/1/2_), TWINGO (C06_), TWINGO (CNO_)</p>	<p>TB722 CITROËN JUMPER Box (244), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (244) PEUGEOT BOXER Box (244), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244)</p>
<p>TB702 CITROËN C5 (DC_), C5 Break (DE_) PEUGEOT 406 (8B), 406 Break (8E/F)</p>	<p>TB713 DACIA LOGAN, LOGAN MCV NISSAN ALMERA II (N16), ALMERA II Hatchback (N16), KUBISTAR (X76), MICRA (K12), NOTE (E11), QASHQAI (Q10), TIIDA Hatchback (C11X), TIIDA Saloon (SC11X) RENAULT CLIO Grandtour (KR0/1_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), CLIO III (BR0/1, CR0/1), GRAND SCENIC (JM0/1_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LOGAN (LS_), MEGANE II (BMO/1_, CMO/1_), MEGANE II Coupé-Cabriolet (EMO/1_), MEGANE II Estate (KMO/1_), MEGANE II Saloon (LMO/1_), MODUS (F/JP0_), SCENIC II (JM0/1_), THALIA (LB0/1/2_), TWINGO (CNO_) SUZUKI JIMNY (FJ)</p>	<p>TB723 FIAT DUCATO Box, DUCATO Box (244), DUCATO Bus, DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis, DUCATO Flatbed / Chassis (244) IVECO Daily II, Daily III</p>
<p>TB703 ALFA ROMEO 166 (936)</p>	<p>TB714 HYUNDAI ACCENT (LC), ACCENT Saloon (LC), ELANTRA (XD), ELANTRA Saloon (XD), GETZ (TB), GRANDEUR, i30, MATRIX (FC), SANTA FE (CM), SANTA FE (SM), SONATA V, TRAJET (FO), TUCSON (JM) KIA CARENS II (FJ), CARENS III, CEE'D Estate, CEE'D Hatchback, CERATO, CERATO Saloon, MAGENTIS, PRO CEE'D, SPORTAGE (JE_)</p>	<p>TB724 CITROËN BERLINGO Box, BERLINGO Box (M_), C2 (JM_), C3 (FC_), C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), JUMPY, JUMPY Box, XSARA (N1), XSARA Coupe (NO), XSARA PICASSO (N68) FIAT SCUDO, SCUDO Box, SCUDO Flatbed / Chassis FORD C-MAX, FIESTA V (JH_, JD_), FOCUS c-MAX, FOCUS II (DA_), FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), FUSION (JU_) MAZDA 3 (BK14), 3 Saloon (BK12) PEUGEOT 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 207 CC (WD_), 207 SW (WK_), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 307 Break (3E), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 407 (6D_), 407 SW (6E_), 1007 (KM_), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_), PARTNER Box, PARTNER Box (5), PARTNER Combispace (5F), PARTNER Tepee VOLVO S40 II (MS), V50 (MW)</p>
<p>TB704 RENAULT LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_)</p>	<p>TB715 HONDA ACCORD VII (CG), PRELUDE IV (BB), PRELUDE V (BB)</p>	<p>TB725 ALFA ROMEO 147 (937), 156 (932), 156 Sportwagon (932), 166 (936), GT FIAT STILO (192), STILO Multi Wagon (192) LANCIA THESIS (841AX)</p>
<p>TB705 CHRYSLER PT CRUISER (PT_), PT CRUISER Convertible, SEBRING (JR), SEBRING Convertible (JR), STRATUS (JA), VOYAGER II (GS), VOYAGER III (RG) DODGE STRATUS JEEP CHEROKEE (KJ), WRANGLER II (TJ) VOLVO S80 (TS, XY), XC 90</p>	<p>TB716 HYUNDAI TERRACAN (HP) KIA CARNIVAL (UP), CARNIVAL II</p>	<p>TB726 AUDI A2 (8Z0) VW LUPO (6X1, 6E1)</p>
<p>TB706 KIA CARNIVAL (UP)</p>	<p>TB717 KIA CARNIVAL (UP), CARNIVAL II</p>	<p>TB727 CITROËN C5 (DC_), C5 (RC_), C5 (RD_), C5 Break (DE_), C5 Break (RE_), C5 Break (TD_), C6 (TD_), C8 (EA_, EB_), XANTIA (X1), XANTIA (X2), XANTIA Break (X2), XM (Y4), XM Break (Y4)</p>
<p>TB707 HYUNDAI COUPE (GK), HIGHWAY VAN, SANTA FE (SM), SONATA III (EF), SONATA IV (EU4), TRAJET (FO), TUCSON (JM), XG KIA MAGENTIS (GD), SPORTAGE (JE_)</p>	<p>TB718 MITSUBISHI PAJERO PININ (H6_W, H7_W)</p>	
<p>TB708 HYUNDAI HIGHWAY VAN, SANTA FE (SM), SONATA III (EF), SONATA IV (EU4), TRAJET (FO) KIA MAGENTIS (GD)</p>	<p>TB719 CHRYSLER VOYAGER III (RG) JEEP CHEROKEE (KJ) LDV MAXUS Box, MAXUS Bus</p>	
<p>TB709 KIA CARENS II (FJ), RIO (DC_), RIO Estate (DC), SHUMA II (FB), SHUMA II Saloon (FB)</p>		
<p>TB710 NISSAN INTERSTAR Box (X70), INTERSTAR Bus (X70), INTERSTAR Flatbed / Chassis, PRIMASTAR Box (X83), PRIMASTAR Bus (X83) OPEL MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9), VIVARO Box (F7), VIVARO Combi (J7), VIVARO Flatbed / Chassis (E7) RENAULT AVANTIME (DEO_), ESPACE III (JEO_), ESPACE IV (JK0/1_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MASTER II Box (FD), MASTER II Bus (JD/ND),</p>		

					
FIAT LANCIA PEUGEOT RENAULT	ULYSSE (179AX) PHEDRA (179) 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 605 (6B), 607 (9D, 9U), 807 (E) AVANTIME (DE0_), CLIO II (B80/1/2_, CB0/1/2_), ESPACE III (JE0_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (B60/1_), LAGUNA II Grandtour (KG0/1_), SAFRANE II (B54_)	TB741 ALFA ROMEO FIAT OPEL VAUXHALL	159, 159 Sportwagon CROMA (194) ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, CORSA D, MERIVA, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA, ZAFIRA (F75_) ASTRA MK IV Convertible, ASTRA MK IV Estate, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, ASTRA TwinTop, CORSA Mk III, MERIVA, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II	TB748 VOLVO TB749 HONDA ISUZU OPEL TB750 OPEL RENAULT SAAB VAUXHALL	C30, C70 Convertible, S40 II (MS), S60, S80 (TS, XY), S80 II, V50 (MW), V70 II Estate (P80_), V70 III Estate, XC 90, XC70 CROSS COUNTRY, XC70 II CIVIC VI, CIVIC VI Coupe (EM), CIVIC VI Hatchback (EU_, EP_), FR-V, STREAM (RN) TROOPER, TROOPER Open Off-Road Vehicle MONTEREY B SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS ESPACE IV (JK0/1_), VEL SATIS (BJ0_) 9-5 (YS3E), 9-5 Estate (YS3E) SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS
TB728 DAIHATSU	CHARADE (L2_), CUORE VI (L7_), CUORE VII (L251), MOVE (L6, L9), SIRION (M1), TREVIS, YRV (M2)	TB742 CITROËN	C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C8 (EA_, EB_), JUMPY, JUMPY Box	TB751 MAZDA	6 (GG), 6 Hatchback (GG), 6 Station Wagon (GY), MPV II (LW)
TB729 TOYOTA	4 RUNNER (N130), LAND CRUISER 90 (J9_)	FIAT	SCUDO, SCUDO Box, SCUDO Flatbed / Chassis, ULYSSE (179AX)	TB753 AUDI	A3 (8P1), A3 Sportback (8PA), A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4F2), A6 Avant (4F5), TT (8J3), TT Roadster (8J9)
TB730 HYUNDAI	ATOS (MX), ATOS PRIME (MX), GETZ (TB)	FORD	C-MAX, FOCUS C-MAX, FOCUS II (DA_), FOCUS II Convertible, FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), GALAXY, KUGA, MONDEO IV, MONDEO IV Saloon, MONDEO IV Turnier, S-MAX	SEAT	ALTEA (5P1), ALTEA XL (5P5), LEON (1P1), TOLEDO III (5P2)
KIA	PICANTO (BA)	LANCIA	PHEDRA (179)	SKODA	OCTAVIA (1Z3), OCTAVIA Combi (1Z5)
TB731 MAZDA	323 CV (BA), 323 FV (BA), 323 FVI (BJ), 323 PV (BA), 323 SV (BA), 323 S VI (BJ)	PEUGEOT	307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U), 807 (E), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Teepee (VF3V_)	VW	GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), PASSAT (3C2), PASSAT Variant (3C5), TOURAN (1T1, 1T2)
TB732 ALFA ROMEO	147 (937), 156 (932), 156 Sportwagon (932), GTV (916C_), SPIDER (916S_)	TB743 AUDI	A3 (8P1), A3 Sportback (8PA), A4 (8EC), A4 Avant (8ED), A6 (4F2), A6 Avant (4F5)	NISSAN	PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P12)
TB733 LADA	110, 111, 112, KALINA Estate (1117), KALINA Hatchback (1119), KALINA Saloon (1118), SAMARA (2108, 2109), SAMARA FORMA (21099)	MITSUBISHI	GRANDIS, OUTLANDER	RENAULT	GRAND SCENIC (JM0/1_), LAGUNA II (BGO/1_), LAGUNA II Grandtour (KG0/1_), MEGANE II (BM0/1_, CM0/1_), MEGANE II Coupé-Cabriolet (EM0/1_), MEGANE II Estate (KMO/1_), MEGANE II Saloon (LMO/1_), SCENIC II (JM0/1_)
TB734 LADA	110, 111, 112, KALINA Hatchback (1119), KALINA Saloon (1118)	SEAT	ALTEA (5P1), ALTEA XL (5P5), LEON (1P1), TOLEDO III (5P2)	SUZUKI	GRAND VITARA
TB735 DACIA	SOLENZA	SKODA	OCTAVIA (1Z3), OCTAVIA Combi (1Z5)	TB758 SUBARU	FORESTER (SF), FORESTER (SG), IMPREZA Estate (GF), IMPREZA Saloon (GC), IMPREZA Saloon (GD, GG), LEGACY IV Estate (B13_)
RENAULT	CLIO I (B/C57_, 5/357_), CLIO II (B80/1/2_, CB0/1/2_), CLIO II Box (S80/1/2_), KANGOO, KANGOO (KC0/1_), KANGOO Express (FC0/1_), RAPID Box (F40_, G40_), THALIA (LB0/1/2_)	VW	GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), PASSAT (3C2), PASSAT Variant (3C5), TOURAN (1T1, 1T2)	TB759 AUDI	A8 (4E_)
TB736 HONDA	CIVIC VI, CIVIC VI Hatchback (EU_, EP_), CIVIC VII Hatchback (FD_), LOGO (GA3)	TB744 CITROËN	C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C8 (EA_, EB_), JUMPY, JUMPY (U6U), JUMPY Box	TB760 AUDI	A4 (8EC), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4F2), A6 Allroad (4FH), A6 Avant (4F5), A8 (4E_), Q7 PHAETON (3D2), TOUAREG (7LA, 7L6, 7L7)
TB737 VOLVO	S70 (P80_), V70 I Estate (P80_)	PEUGEOT	206 Hatchback (2A/C), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 407 (6D_), 407 SW (6E_), 807 (E), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Teepee (VF3V_)	TB762 LEXUS	GS (JZS147), GS (JZS160), IS (GXE10), IS SportCross
TB738 AUDI	A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH)	TB745 AUDI	A3 (8P1), A4 (8E2, B6), A4 Avant (8E5, B6)	TOYOTA	SUPRA (JZAB0)
SKODA	SUPERB (3U4)	VW	GOLF V (1K1), TOURAN (1T1, 1T2)	TB780 OPEL	ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon,
TB739 HYUNDAI	H-1 Bus (KMF), HIGHWAY VAN, SANTA FE (SM), SONATA III (EF), SONATA IV (EU4), TRAJET (FO)	TB746 ROVER	CITYROVER		
KIA	MAGENTIS (GD), SORENTO (JC)	TATA (TELCO)	INDIGO (4_V2), INDIGO MARINA (4_V2)		
TB740 HONDA	CIVIC VI Hatchback (EU_, EP_)	TB747 KIA	CARNIVAL (UP), CARNIVAL II		
OPEL	ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC				
VAUXHALL	ASTRA MK IV, ASTRA MK IV Estate, ASTRA MK IV Hatchback, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, ASTRAVAN Mk IV				

NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







  <p>ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA G Estate (F35_), CORSA B (73_, 78_, 79_, F35_), TIGRA (95_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) VAUXHALL ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CORSA, TIGRA, VECTRA, VECTRA Estate, VECTRA Hatchback</p>	  <p>OPEL ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA SAAB 9-3 (YS3F), 9-3 Convertible (YS3F), 9-3 Estate, 9-5 (YS3E), 9-5 Estate (YS3E) VAUXHALL ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II</p>	  <p>TB814 CITROËN C5 (RD_), C5 Break (TD_), C6 (TD_) JAGUAR S-TYPE (CCX), XJ LAND ROVER DISCOVERY III (TAA), RANGE ROVER SPORT PEUGEOT 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U)</p>
<p>TB783 CHEVROLET EPICA (KL1_), EVANDA, LACETTI, NUBIRA Estate, NUBIRA Saloon, REZZO DAEWOO EVANDA (KLAL), LACETTI Hatchback (KLAN), LEGANZA (KLA), NUBIRA (KLAJ), NUBIRA Saloon (KLAJ), NUBIRA Saloon (KLAN), NUBIRA Wagon (KLAJ), NUBIRA Wagon (KLAN), REZZO (KLAU) OPEL ASTRA F (56_, 57_), ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) VAUXHALL ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, OMEGA, OMEGA Estate, VECTRA, VECTRA Estate, VECTRA Hatchback</p>	<p>TB792 HYUNDAI H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup TB793 NISSAN MAXIMA (J30), PATHFINDER (R50) TB794 FIAT PANDA (169) TB795 FSO POLONEZ III, POLONEZ III Saloon TB796 RENAULT MEGANE Cabriolet (EA0/1_), MEGANE Coach (DA0/1_) TB797 VW CRAFTER 30-35 Bus (2E), CRAFTER 30-50 Box (2E), CRAFTER 30-50 Flatbed / Chassis (2E) TB798 FIAT PALIO (178BX), SIENA (178_)</p>	<p>TB815 CITROËN C6 (TD_) JAGUAR S-TYPE (CCX), XJ LAND ROVER DISCOVERY III (TAA), RANGE ROVER SPORT PEUGEOT 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U)</p>
<p>TB785 AUDI 100 (44, 44Q, C3), 100 Avant (44, 44Q, C3), A6 (4A, C4), A6 Avant (4A, C4) VOLVO 850 (LS), 850 Estate (LW), S70 (P80_), S80 (TS, XV), V70 I Estate (P80_), V70 II Estate (P80_) VW LT 28-35 II Bus (2DM), LT 28-46 II Box (2DX0AE), LT 28-46 II Flatbed / Chassis (2DX0FE), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD)</p>	<p>TB800 CHEVROLET CAPTIVA, EPICA (KL1_), LACETTI, NUBIRA Estate OPEL ANTARA VAUXHALL ANTARA TB801 MITSUBISHI GALANT VI (EA_), GALANT VI Estate (EA_) TB802 MAZDA 3 (BK14), 3 Saloon (BK12), 5 (CR19), 6 (GG), 6 (GH), 6 Estate (GH), 6 Hatchback (GG), 6 Hatchback (GH), 6 Station Wagon (GY) TB804 HONDA CIVIC V Aerodeck (MC), CIVIC V Fastback (MB), INTEGRA (DC2) TB805 HONDA ACCORD VII Coupe (CG) TB810 CITROËN C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C6 (TD_), C-CROSSER (EP_) FIAT ULYSSE (179AX) FORD GALAXY, MONDEO IV, MONDEO IV Saloon, S-MAX PEUGEOT 407 (6D_), 407 SW (6E_), 607 (9D, 9U), 807 (E), 4007 (GP_)</p>	<p>TBK002 RENAULT 19 I (B/C53_), 19 I Box (S53_), 19 II (B/C53_), 19 II Box (S53_), 19 II Chamade (L53_), CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), RAPID Box (F40_, G40_)</p>
<p>TB786 CHEVROLET AVEO Saloon, KALOS, MATIZ DAEWOO KALOS (KLAS), MATIZ (KLYA) MITSUBISHI CARISMA Saloon (DA_), COLT V (CJ_A), LANCER Estate (CS_W), LANCER Saloon (CS_A), SPACE STAR (DGO) PROTON IMPIAN</p>	<p>TB811 LAND ROVER FREELANDER (LN) MG MG ZS, MG ZS Hatchback, MG ZT, MG ZT-T ROVER 45 (RT), 45 Saloon (RT), 75 (RJ), 75 Tourer (RJ), 800 (XS), 800 Coupe, 800 Hatchback (XS) TB812 LAND ROVER FREELANDER (LN) MG MG ZS, MG ZS Hatchback, MG ZT, MG ZT-T ROVER 45 (RT), 45 Saloon (RT), 75 (RJ), 75 Tourer (RJ), 800 (XS), 800 Coupe, 800 Hatchback (XS) TB813 CITROËN C2 (JM_), C3 (FC_), C4 (LC_), C4 Coupe (LA_) PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 307 SW (3H), 1007 (KM_)</p>	<p>TBK004 CITROËN AX (ZA-), BX (XB-), BX Break (XB-), C15 (VD-), SAXO (S0, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), XSARA PICASSO (N68) PEUGEOT 106 I (1A, 1C), 106 II (1), 205 I Convertible (741B, 20D), 205 II (20A/C), 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 309 II (3C, 3A), 405 II (4B), 405 II Break (4E)</p>
<p>TB787 FIAT 500, DOBLO (119), DOBLO Cargo (223), GRANDE PUNTO (199), IDEA, LINEA, PANDA (169), PANDA Van (141_), PUNTO (188), PUNTO Van (188AX) LANCIA MUSA, YPSILON</p>	<p>TB806 CITROËN C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C6 (TD_), C-CROSSER (EP_) FIAT ULYSSE (179AX) FORD GALAXY, MONDEO IV, MONDEO IV Saloon, S-MAX PEUGEOT 407 (6D_), 407 SW (6E_), 607 (9D, 9U), 807 (E), 4007 (GP_)</p>	<p>TBK005 CITROËN AX (ZA-), BERLINGO (MF), BERLINGO Box (M_), BX (XB-), C15 (VD-), SAXO (S0, S1), ZX (N2) PEUGEOT 106 I (1A, 1C), 106 II (1), 205 I Convertible (741B, 20D), 205 II (20A/C), 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 309 II (3C, 3A), PARTNER Box (5), PARTNER Combispace (5F)</p>
<p>TB788 MITSUBISHI GALANT VI (EA_), GALANT VI Estate (EA_), SPACE RUNNER (N50), SPACE WAGON (N5_W)</p>	<p>TB807 CITROËN AX (ZA-), BERLINGO (MF), BERLINGO Box (M_), BX (XB-), BX Break (XB-), C15 (VD-), SAXO (S0, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2) PEUGEOT 106 I (1A, 1C), 106 II (1), 205 I Convertible (741B, 20D), 205 II (20A/C), 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), PARTNER Box (5), PARTNER Combispace (5F) TBK008 CHEVROLET AVEO Saloon, KALOS DAEWOO ESPERO (KLEI), KALOS, KALOS (KLAS), LANOS (KLAT), LANOS Saloon (KLAT), NEXIA (KLETN), NEXIA Saloon (KLETN)</p>	<p>TBK006 AUTOBIANCHI Y10 FIAT PANDA (141A_), PANDA Van (141_), PUNTO (176), PUNTO Van (176L), TIPO (160), UNO (146A/E) LANCIA Y (840A), Y10 (156)</p>
<p>TB790 ALFA ROMEO 156 Sportwagon (932), 159, 159 Sportwagon, 166 (936), BRERA, SPIDER FIAT BRAVO, CROMA (194), STILO (192), STILO Multi Wagon (192) LANCIA THESIS (841AX)</p>	<p>TB813 CITROËN C2 (JM_), C3 (FC_), C4 (LC_), C4 Coupe (LA_) PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 307 SW (3H), 1007 (KM_)</p>	<p>TBK007 CITROËN AX (ZA-), BERLINGO (MF), BERLINGO Box (M_), BX (XB-), BX Break (XB-), C15 (VD-), SAXO (S0, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2) PEUGEOT 106 I (1A, 1C), 106 II (1), 205 I Convertible (741B, 20D), 205 II (20A/C), 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), PARTNER Box (5), PARTNER Combispace (5F)</p>







																																		
OPEL	ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), ASTRA G Box (F70), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), COMBO (71_), COMBO Box Body / Estate, COMBO Tour, CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), CORSA B (73_, 78_, 79_, F35), CORSA B Box (73_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Convertible (43B_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), MERIVA, VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_)	ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA Box (FVD), FIESTA III (GFJ), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), ORION II (AFF), ORION III (GAL), P 100 II, SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)	LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), POLO CLASSIC (6KV2), POLO Variant (6KV5), SANTANA (32B), SCIROCCO (53B), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD), VENTO (1H2)	RENAULT	9 (L42_), 11 (B/C37_), 19 I (B/C53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), CLIO I (B/C57_, 5/357_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SUPER 5 (B/C40_), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (P6)																													
	VAUXHALL					ASTRA Mk II Belmont, ASTRA Mk II Convertible, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRAVAN Mk III, ASTRAVAN Mk IV, CAVALIER Mk II, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, COMBO, CORSA, CORSAVAN, MERIVA, NOVA, NOVA Hatchback, VECTRA, VECTRA Estate, VECTRA Hatchback	TBK012	FORD	ESCORT '86 Express (AVF), ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA Box (FVD), FIESTA III (GFJ), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), ORION II (AFF), ORION III (GAL), P 100 II, SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)	VOLVO	340-360 (343, 345), 340-360 Saloon (344), 440 K (445), 460 L (464), 480 E																							
						TBK009	CITROËN	BX (XB-), BX Break (XB-), VISA, ZX (N2)	TBK013			CITROËN	XM (Y3), XM Break (Y3), XM Break (Y4)	AUDI	80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), CADDY I (14), GOLF I (17), GOLF II (19E, 1G1), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis																			
							PEUGEOT	205 I (741A/C), 205 I Convertible (741B, 20D), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E)				PEUGEOT	605 (6B)			VW	CADDY I (14), GOLF I (17), GOLF II (19E, 1G1), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis																	
								TBK010				CITROËN	BERLINGO (MF), BERLINGO Box (M_), BX (XB-), BX Break (XB-), EVASION (22, U6), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2)					UAZ	31512	FSO	POLONEZ II, POLONEZ III													
												FIAT	ULYSSE (220)					TBK014	FORD			ESCORT '95 Box (AVL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA Box (F3L, F5L), FIESTA Box (J5_, J3_), FIESTA III (GFJ), FIESTA IV (JA_, JB_), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP)	PEUGEOT	205 I (741A/C), 205 II (20A/C), 305 II (581M), 305 II Break (581E), 306 Hatchback (7A, 7C, N3, N5), 309 I (10C, 10A), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), 405 II (4B), 405 II Break (4E), J5 Box (290L), J5 Bus (290P), J5 Flatbed / Chassis (290L)										
													LANCIA						ZETA (220)			MAZDA			121 III (JASM, JBSM)	ROVER	200 Hatchback (XW), 400 (XW)							
																			PEUGEOT						205 I Convertible (741B, 20D), 205 II (20A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 309 II (3C, 3A), 405 I (15B), 405 I Break (15E), 405 II (4B), 405 II Break (4E), 406 (8B), 406 Break (8E/F), 605 (6B), 806 (221), EXPERT (224), EXPERT Box (222), PARTNER Combispace (5F)			TBK015	PEUGEOT	505 (551A)	TALBOT	EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1800 Box, HORIZON		
																									TBK011				FORD	18 (134_), 18 Variable (135_), FUEGO (136_), MASTER I Box (T_), MASTER I Flatbed / Chassis (P_), TRAFIC Box (T1, T3, T4), TRAFIC Bus (T5, T6, T7), TRAFIC Flatbed / Chassis (P6)			AUDI	80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3), COUPE (81, 85), COUPE (89, 8B)
																													TBK016	AUDI				
SEAT		CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L)	VW	CADDY I (14), CADDY II Box (9K9A), CADDY II Estate (9K9B), CORRADO (53I), GOLF I (17), GOLF I Cabriolet (155), GOLF II (19E, 1G1), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363),																														
	TBK017	RENAULT			9 (L42_), 11 (B/C37_), 19 I (B/C53_), 19 I Cabriolet (D53_), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Cabriolet (D53_, 853_), 19 II Chamade (L53_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), CLIO I (B/C57_, 5/357_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SUPER 5 (B/C40_), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (P6)					FIAT	DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), SCUDO Box (220L), SCUDO Combinato (220P), ULYSSE (220)																							
		TBK018			AUDI	80 (81, 85, B2), 80 (89, 89Q, 8A, B3), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), CADDY I (14), GOLF I (17), GOLF II (19E, 1G1), ILTIS (183), JETTA I (16), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (3A5, 35I), PASSAT Variant (32B), SANTANA (32B), TRANSPORTER III Box, TRANSPORTER III Bus, TRANSPORTER III Flatbed / Chassis			FSO					POLONEZ III																				
					TBK019	CITROËN	BX (XB-), BX Break (XB-), C15 (VD-), C25 Bus (280_, 290_), VISA, ZX (N2), ZX Break (N2)								HONDA	CONCERTO (HW)																		
						TBK020	CITROËN	BERLINGO (MF), BERLINGO Box (M_), C15 (VD-), EVASION (22, U6), JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2), ZX Break (N2)									HYUNDAI			LANTRA II (J-), LANTRA II Wagon (J2)														



NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits


					
LADA PEUGEOT	NIVA (2121) 205 Box, 205 II (20A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 405 II (4B), 405 II Break (4E), 406 (8B), 406 Break (8E/F), 806 (221), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F) 200 Hatchback (XW), 400 (XW), 400 Tourer (XW)	SEAT VW	A6 Avant (4A, C4), A6 Avant (4B, C5), CABRIOLET (8G7, B4) CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), TOLEDO I (1L) CADDY II Estate (9K9B), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV (1I1), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT (3B2), PASSAT Variant (3A5, 35I), PASSAT Variant (3B5), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), VENTO (1H2)	VAUXHALL	OMEGA B Estate (21_, 22_, 23_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) ASTRA Mk II Convertible, ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CARLTON Mk III, CARLTON Mk III Estate, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, FRONTERA Sport, OMEGA, OMEGA Estate
TBK021	OPEL	TBK027	CITROËN FIAT	TBK033	RENAULT
OPEL	CORSA A Box, CORSA A Hatchback (93_, 94_, 98_, 99_), CORSA A TR (91_, 92_, 96_, 97_), CORSA B (73_, 78_, 79_, F35_), KADETT E (39_, 49_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_) CORSA, NOVA, NOVA Hatchback, NOVAVAN	JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_) ELBA (146_), FIORINO Box (146 Uno), FIORINO Pick up (146), PUNTO (176), PUNTO Convertible (176C), SCUDO Box (220L), SCUDO Combinato (220P), TEMPRA (159), TEMPRA S.W. (159), TIPO (160), UNO (146A/E) DEDRA (835), DEDRA SW (835), DELTA II (836)	SAFRANE I (B54_)		
TBK022	OPEL	TBK028	OPEL	TBK035	CITROËN
OPEL	ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), COMBO (71_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) VAUXHALL	ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) VAUXHALL	EVASION (22, U6), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y3), XM (Y4), XM Break (Y3), XM Break (Y4) ULYSSE (220) ZETA (220) 406 (8B), 406 Break (8E/F), 605 (6B), 806 (221)		
TBK023	MAZDA OPEL	TBK029	CITROËN PEUGEOT	TBK037	CITROËN
MAZDA OPEL	323 S V (BA) ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), COMBO (71_), CORSA B (73_, 78_, 79_, F35_), CORSA B Box (73_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Hatchback (38_) VAUXHALL	JUMPER Box (230L), JUMPER Bus (230P), JUMPER Flatbed / Chassis (230), XM (Y4), XM Break (Y4) 605 (6B), BOXER Box (230L), BOXER Bus (230P), BOXER Flatbed / Chassis (ZCT_)	JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (230), JUMPER Flatbed / Chassis (244) FIAT		
TBK024	AUDI SEAT VW	TBK030	CITROËN PEUGEOT ROVER	TBK037	OPEL
AUDI SEAT VW	80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4) CORDOBA (6K2/C2), IBIZA II (6K1), TOLEDO I (1L) GOLF III (1H1), GOLF III Variant (1H5), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD), VENTO (1H2)	AX (ZA-), ZX (N2) 106 I (1A, 1C) 100 (METRO) (XP)	ARENA Box (TB, TF), ARENA Combi (THB), MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumpertruck (H9), MOVANO Flatbed / Chassis (U9, E9) BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), BOXER Flatbed / Chassis (ZCT_) RENAULT		
TBK025	AUDI SEAT	TBK031	OPEL	TBK037	PEUGEOT
AUDI SEAT	80 (8C, B4), 80 Avant (8C, B4) CORDOBA (6K2/C2), IBIZA II (6K1), INCA (6K9), TOLEDO I (1L)	ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) VAUXHALL	MASTER I Box (T_), MASTER I Bus (T_), MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD), TRAFIC Box (TXX), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (PXX) VAUXHALL		
TBK026	AUDI	TBK032	OPEL	TBK038	RENAULT
AUDI	80 (8C, B4), 80 Avant (8C, B4), A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4A, C4), A6 (4B, C5),	ASTRA F (56_, 57_), ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), FRONTERA A Sport (5_SUD2), OMEGA A (16_, 17_, 19_), OMEGA A Estate (66_, 67_), OMEGA B (25_, 26_, 27_),	9 (L42_), 11 (B/C37_), 11 Box (S37_), 19 I (B/C53_), 19 I Box (S53), 19 I Chamade (L53_), 19 II (B/C53_), 19 II Box (S53), 19 II Chamade (L53), 21 (B48), 21 Box (S48), 21 Estate (K48), 21 Saloon (L48), MEGANE I (BA0/1), RAPID Box (F40_, G40_), SUPER 5 (B/C40), SUPER 5 Box (S40_) VOLVO		
				TBK039	FIAT
				FIAT	DUCATO Box (230L), DUCATO Box (290), DUCATO Bus (230), DUCATO Flatbed / Chassis (230), DUCATO Flatbed / Chassis (290), DUCATO Panorama (290) RENAULT
				RENAULT	MASTER I Box (T_), MASTER I Bus (T_), MASTER II Flatbed / Chassis (P_)

  <p>TBK040 FIAT DUNA (146 B), DUNA Weekend (146 B), ELBA (146_), FIORINO (147), FIORINO Box (146 Uno), FIORINO Pick up (146), PALIO Weekend (178DX), PUNTO (176), PUNTO Van (176L), STRADA (178E), UNO (146A/E)</p>	  <p>TBK049 CITROËN C25 Box (280_, 290_), C25 Bus (280_, 290_), CX II, CX II Break PEUGEOT J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L) TALBOT EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1500 Flatbed / Chassis, EXPRESS 1000 -1800 Box</p>	  <p>TBK054 CITROËN C25 Box (280_, 290_), C25 Bus (280_, 290_), CX II, CX II Break PEUGEOT J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L) TALBOT EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1500 Flatbed / Chassis, EXPRESS 1000 -1800 Box</p>
<p>TBK041 CITROËN AX (ZA_), SAXO (S0, S1), XSARA (N1), XSARA Break (N2) NISSAN MICRA (K11) PEUGEOT 106 I (1A, 1C), 106 II (1) ROVER 100 (METRO) (XP)</p>	<p>TBK050 FORD ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT III (GAA), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Estate (AWF, AVF), FIESTA Box (FVD), FIESTA II (FBD), ORION I (AFD), ORION II (AFF)</p>	<p>TBK055 SEAT IBIZA I (021A), MALAGA (023A), RONDA (022A)</p> <p>TBK056 FORD TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (T_), TRANSIT Flatbed / Chassis (V_)</p>
<p>TBK042 FORD TRANSIT Box (V_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (V_)</p>	<p>TBK051 RENAULT 9 (L42_), 11 (B/C37_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), SUPER 5 (B/C40_), TRAFIC Box (T1, T3, T4), TRAFIC Bus (T5, T6, T7), TRAFIC Flatbed / Chassis (P6)</p>	<p>TBK057 FORD SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (V_)</p>
<p>TBK043 FIAT CINQUECENTO (170), PUNTO (176), PUNTO Van (176L), SEICENTO (187), SEICENTO Van (187), UNO (146A/E)</p>	<p>TBK052 TOYOTA AVENSIS (T22_), AVENSIS Liftback (T22_), AVENSIS Station Wagon (T22_), CAMRY (V2_), CAMRY Liftback (V1), CAMRY Saloon (V1), CAMRY Station Wagon (V2_), CARINA E (T19_), CARINA E Saloon (T19_), CARINA E Sportswagon (T19_), CARINA II (T15_), CARINA II (T17_), CARINA II Saloon (T15_), CARINA II Saloon (T17_), CARINA II Station Wagon (T17_), CARINA Station Wagon (TA4K, TA6K), COROLLA (E8_), COROLLA (E9_), COROLLA (E10_), COROLLA (E11_), COROLLA Compact (E9_), COROLLA Compact (E10_), COROLLA Compact (E11_), COROLLA FX Compact (E8B), COROLLA Liftback (E8_), COROLLA Liftback (E9_), COROLLA Liftback (E10_), COROLLA Liftback (E11_), COROLLA Station Wagon (E7_), COROLLA Station Wagon (E9_), COROLLA Wagon (E11_), COROLLA Wagon (E10_), LITEACE Box (R2_V), LITEACE Box (CM3_V, KM3_V), LITEACE Bus (R2_LG), LITEACE Bus (CM30_G, KM30_G), LITEACE Wagon (M2_G), MODELL F Bus (R2_, 31), PICNIC (XM10)</p>	<p>TBK058 FORD P 100 II, SCORPIO I (GAE, GGE), SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG), TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_), TRANSIT Flatbed / Chassis (V_)</p>
<p>TBK044 AUDI 100 (43, C2), 100 (44, 44Q, C3), 100 Avant (43, C2), 100 Avant (44, 44Q, C3) VOLVO 240 (P242, P244), 240 Kombi (P245), 740 (744), 740 Kombi (745), 760 (704, 764), 760 Kombi (704, 765), 940 (944), 940 Kombi (945), 960 (964), 960 Kombi (965) VW LT 28-35 I Box (281-363), LT 28-35 I Bus (281-363), LT 28-35 I Flatbed / Chassis (281-363), LT 40-55 I Box (291-512), LT 40-55 I Flatbed / Chassis (293-909)</p>	<p>TBK053 NISSAN ALMERA I (N15), ALMERA I Hatchback (N15), CHERRY (N12), PRIMERA (P10), PRIMERA Hatchback (P10), PRIMERA Traveller (W10), SUNNY Box (Y10), SUNNY I (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10)</p>	<p>TBK059 AUSTIN MAESTRO (XC), MONTEGO (XE), MONTEGO Estate (XE) ROVER 200 (XH), MAESTRO</p>
<p>TBK045 FIAT ARGENTA (132A), DUCATO Box (280), DUCATO Flatbed / Chassis (280), DUCATO Panorama (280) RENAULT MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)</p>	<p>TBK054 ALMERA I (N15), ALMERA I Hatchback (N15), CHERRY (N12), PRIMERA (P10), PRIMERA Hatchback (P10), PRIMERA Traveller (W10), SUNNY Box (Y10), SUNNY I (B11), SUNNY I Traveller (B11), SUNNY II (N13), SUNNY II Hatchback (N13), SUNNY II Traveller (B12), SUNNY III (N14), SUNNY III Hatchback (N14), SUNNY III Liftback (N14), SUNNY III Traveller (Y10)</p>	<p>TBK060 MITSUBISHI COLT II (C1_A), COLT III (C5_A), GALANT III (E1_A), GALANT IV (E3_A), GALANT IV Saloon (E3_A), L 300 Box (L03_P), L 300 Box (P0_W, P1_W), L 300 Bus (L03_P/G, L0_2P), L 300 Bus (P0_W, P1_W, P2_W), SAPPORO III (E16A), SPACE WAGON (D0_V/W), SPACE WAGON (N3_W, N4_W), STARION (A18_A)</p>
<p>TBK046 OPEL ASCONA C (81_, 86_, 87_, 88_), ASCONA C Hatchback (84_, 89_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_) VAUXHALL ASTRA Estate, ASTRA Hatchback, ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback, CAVALIER Mk II, CAVALIER Mk II Hatchback</p>	<p>TBK055 SEAT IBIZA I (021A), MALAGA (023A), RONDA (022A)</p>	<p>TBK061 BMW 3 (E30), 3 Touring (E30), 5 (E28), 5 (E34)</p>
<p>TBK047 RENAULT 9 (L42_), 11 (B/C37_), 11 Box (S37_), RAPID Box (F40_, G40_), SUPER 5 (B/C40_), SUPER 5 Box (S40_) VOLVO 340-360 (343, 345), 340-360 Saloon (344)</p>	<p>TBK056 FORD TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (T_), TRANSIT Flatbed / Chassis (V_)</p>	<p>TBK063 FIAT DUCATO Flatbed / Chassis (280), DUCATO Panorama (280)</p>
<p>TBK048 AUDI 80 (81, 85, B2), 90 (81, 85, B2), 90 (89, 89Q, 8A, B3), 100 (44, 44Q, C3), 100 Avant (44, 44Q, C3), 200 (43), 200 (44, 44Q), 200 Avant (44, 44Q), COUPE (81, 85), QUATTRO (85) VW PASSAT (32B), PASSAT Saloon (32B), PASSAT Variant (32B), SANTANA (32B)</p>	<p>TBK057 FORD SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (V_)</p>	<p>TBK064 TOYOTA CRESSIDA Saloon (X6_), CRESSIDA Station Wagon (X6K), CROWN Saloon (S1_), DYNA Flatbed / Chassis, HIACE II Box (H5_), HIACE II Wagon (H5_), HILUX Pickup (N_), LAND CRUISER (J7_)</p>
<p>TBK049 CITROËN C25 Box (280_, 290_), C25 Bus (280_, 290_), CX II, CX II Break PEUGEOT J5 Box (290L), J5 Bus (280P), J5 Bus (290P), J5 Flatbed / Chassis (280L), J5 Flatbed / Chassis (290L) TALBOT EXPRESS 1000 -1500 Bus, EXPRESS 1000 -1500 Flatbed / Chassis, EXPRESS 1000 -1800 Box</p>	<p>TBK058 FORD P 100 II, SCORPIO I (GAE, GGE), SIERRA (GBG, GB4), SIERRA Estate (BNC), SIERRA Estate (BNG), SIERRA Hatchback (GBC), SIERRA Hatchback (GBC, GBG), TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Box (V_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Bus (V_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_), TRANSIT Flatbed / Chassis (V_)</p>	<p>TBK065 ALFA ROMEO 145 (930), 146 (930), 155 (167) FIAT BRAVA (182), BRAVO (182), TEMpra (159), TEMpra S.W. (159), TIPO (160) LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836)</p>

NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits






  <p>TBK066 AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), COUPE (89, 8B) SEAT TOLEDO I (1L) VW CORRADO (53I), GOLF II (19E, 1G1), JETTA II (19E, 1G2), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), SCIROCCO (53B)</p>	  <p>TBK075 ISUZU CAMPO (KB), TROOPER (UB), TROOPER (UBS), TROOPER Open Off-Road Vehicle (UB) OPEL CAMPO (TF_), FRONTERA A (5_MWL4), FRONTERA A Sport (5_SUD2), MONTEREY A (UBS_) VAUXHALL BRAVA Pickup, FRONTERA, FRONTERA Sport, MONTEREY</p>	  <p>VAUXHALL ASTRA Mk II Belmont, ASTRA Mk II Estate, ASTRA Mk II Hatchback, ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, ASTRA Mk IV, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRAVAN Mk III, ASTRAVAN Mk IV, CAVALIER Mk III (87), CAVALIER Mk III Hatchback</p>
<p>TBK067 MITSUBISHI L 200 (K_T), L 300 Box (L03_P), L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), PAJERO I (L04_G, L14_G), PAJERO I Open Off-Road Vehicle (L04_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W)</p>	<p>TBK076 SEAT ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), IBIZA II (6K1), TOLEDO I (1L) VW CORRADO (53I), GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV Cabriolet (1E7), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), SHARAN (7M8, 7M9, 7M6), TRANSPORTER IV Box (70XA), TRANSPORTER IV Bus (70XB, 70XC, 7DB, 7DW), TRANSPORTER IV Flatbed / Chassis (70XD), VENTO (1H2)</p>	<p>TBK085 FIAT PALIO (178BX), PALIO Weekend (178DX), PUNTO (176), PUNTO Convertible (176C), SIENA (178_), STRADA (178E) LANCIA Y (840A)</p>
<p>TBK068 TOYOTA HIACE III Box (_H10_), HIACE III Wagon (_H10_), HIACE IV Box (_H1_, _H2_), HIACE IV Wagon (_H1_, _H2_), HILUX Pickup (_N_), LAND CRUISER (_J7_), LAND CRUISER Hardtop (_J7_) VW TARO</p>	<p>TBK077 FORD TRANSIT Box (E_), TRANSIT Box (T_), TRANSIT Bus (E_), TRANSIT Bus (T_), TRANSIT Flatbed / Chassis (E_), TRANSIT Flatbed / Chassis (T_)</p>	<p>TBK086 SEAT CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), TOLEDO I (1L) VW GOLF III (1H1), GOLF III Cabriolet (1E7), GOLF III Variant (1H5), GOLF IV Cabriolet (1E7), POLO CLASSIC (6KV2), POLO Variant (6KV5), VENTO (1H2)</p>
<p>TBK069 MITSUBISHI L 200 (K_T), L 300 Box (L03_P), L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), PAJERO I (L04_G, L14_G), PAJERO I Open Off-Road Vehicle (L04_G), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W)</p>	<p>TBK078 FORD ESCORT '91 Express (AVL), ESCORT '95 Box (AVL), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GFJ), ORION III (GAL), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)</p>	<p>TBK087 SEAT AROSA (6H), CORDOBA (6K2/C2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), INCA (6K9) VW CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF III (1H1), GOLF III Variant (1H5), LUPO (6X1, 6E1), POLO (6N1), POLO (6N2), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5), VENTO (1H2)</p>
<p>TBK070 HONDA CIVIC II Shuttle (EE), CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED), CIVIC IV Fastback (MA, MB), CONCERTO (HW), CONCERTO Saloon (HWW) ROVER 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW)</p>	<p>TBK079 FORD ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GFJ), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), ORION III (GAL)</p>	<p>TBK088 SEAT CORDOBA (6K2/C2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), INCA (6K9) SKODA FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5), OCTAVIA (1U2), OCTAVIA Combi (1U5) VW CADDY II Box (9K9A), CADDY II Estate (9K9B), CADDY II Pickup (9U7), GOLF III (1H1), GOLF III Variant (1H5), POLO (6N1), POLO CLASSIC (6KV2), POLO Variant (6KV5), VENTO (1H2)</p>
<p>TBK071 MG MG TF, MG ZR, MG ZS Hatchback, MGF (RD) ROVER 25 (RF), 45 (RT), 45 Saloon (RT), 100 (METRO) (XP), 100 Convertible (XP), 200 (RF), 200 Hatchback (XW), 400 (RT), 400 (XW), 400 Hatchback (RT), 400 Tourer (XW), CABRIOLET (XW), COUPE, STREETWISE</p>	<p>TBK080 NISSAN SERENA (C23M), VANETTE Box (C22), VANETTE Bus (C22)</p>	<p>TBK089 FIAT BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185), MULTIPLA (186), PALIO (178BX), PALIO Weekend (178DX), SIENA (178_), STILO (192), STILO Multi Wagon (192) LANCIA DEDRA (835), DEDRA SW (835), DELTA II (836), LYBRA (839AX), LYBRA SW (839BX)</p>
<p>TBK072 KIA PRIDE (DA), PRIDE Estate, RIO (DC_), RIO Estate (DC), SEPHIA (FA), SEPHIA Saloon (FA), SHUMA Saloon (FB) MAZDA 121 I (DA), 121 II (DB), 323 C IV (BG), 323 C V (BA), 323 F IV (BG), 323 F V (BI), 323 II (BD), 323 II Hatchback (BD), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW), 323 P V (BA), 323 S IV (BG), 323 S V (BA), 323 S VI (BI), DEMIO (DW), MX-3 (EC)</p>	<p>TBK081 OPEL ASTRA F (56_, 57_), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA F Van (55_), ASTRA G Box (F70), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), KADETT E (39_, 49_), KADETT E Box (37_, 47_), KADETT E Combo (38_, 48_), KADETT E Estate (35_, 36_, 45_, 46_), KADETT E Hatchback (33_, 34_, 43_, 44_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_)</p>	<p>TBK090 RENAULT ESPACE III (JE0_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SAFRANE II (B54_)</p>
<p>TBK074 BMW 3 (E30), 3 Convertible (E30), 3 Touring (E30), 5 (E34)</p>		<p>TBK091 OPEL CALIBRA A (85_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) SAAB 900 II, 900 II Convertible, 900 II Coupe, 9000, 9000 Hatchback VAUXHALL CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, OMEGA, OMEGA Estate, VECTRA, VECTRA Estate, VECTRA Hatchback</p>

						
TBK092 NISSAN RENAULT	KUBISTAR (X76) CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_, KANGOO (KC0/1_), KANGOO Express (FC0/1_), TWINGO (C06_), TWINGO (CNO_), TWINGO Box (S06_)		PASSAT (3B3), PASSAT (3C2), PASSAT Variant (3B5), PASSAT Variant (3B6), PASSAT Variant (3C5), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6), TOURAN (1T1, 1T2), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HI), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)		XANTIA (X2), XANTIA Break (X2), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), XSARA PICASSO (N68) FIAT DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (244), SCUDO Box (220L), SCUDO Combinato (220P), ULYSSE (220) PEUGEOT 206 Hatchback (2A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 806 (221), BOXER Box (230L), BOXER Box (244), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis, PARTNER Box (5), PARTNER Combispace (5F)	
TBK093 SKODA VW	FELICIA I (6U1), FELICIA I Estate (6U5), FELICIA I Fun (797), FELICIA II (6U1), FELICIA II Estate (6U5) CADDY II Pickup (9U7), POLO (6N1), POLO (6N2), POLO Box (6NF)	TBK101 AUDI SEAT SKODA VW	A3 (8L1), A6 (4B, C5), A6 Avant (4B, C5), TT (8N3), TT Roadster (8N9) ALHAMBRA (7V8, 7V9), LEON (1M1), TOLEDO II (1M2) OCTAVIA (1U2), OCTAVIA Combi (1U5) BORA (1J2), BORA Estate (1J6), GOLF IV (1I1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), SHARAN (7M8, 7M9, 7M6)		206 Hatchback (2A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 806 (221), BOXER Box (230L), BOXER Box (244), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (244), EXPERT (224), EXPERT Box (222), EXPERT Flatbed / Chassis, PARTNER Box (5), PARTNER Combispace (5F)	
TBK094 FIAT	BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), PALIO Weekend (178DX), PUNTO (188), PUNTO Van (188AX), STRADA (178E)					
TBK096 DACIA RENAULT	LOGAN, LOGAN MCV, SOLENZA CLIO I (B/C57_, 5/357_), CLIO II (BB0/1/2_, CB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LOGAN (LS_), MEGANE Classic (LA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), THALIA (LB0/1/2_)	TBK102 FIAT IVECO OPEL RENAULT VAUXHALL	DUCATO Box (230L), DUCATO Bus (230), DUCATO Flatbed / Chassis (230) Daily II MOVANO Box (F9), MOVANO Combi (J9), MOVANO Dumptruck (H9), MOVANO Flatbed / Chassis (U9, E9) MASTER II Box (FD), MASTER II Bus (JD/ND), MASTER II Flatbed / Chassis (ED/HD/UD) MOVANO Chassis/Cab (ED, UD, HD), MOVANO Combi (JD), MOVANO Van (FD)		TBK107 AUDI SEAT SKODA VW	A3 (8L1) CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), INCA (6K9), LEON (1M1), TOLEDO II (1M2) OCTAVIA (1U2), OCTAVIA Combi (1U5) BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5)
TBK097 RENAULT	CLIO I (B/C57_, 5/357_), CLIO I Box (S57_), KANGOO, RAPID Box (F40_, G40_)				TBK108 BMW	3 (E36), 5 (E34), 5 Touring (E34)
TBK098 OPEL RENAULT VAUXHALL	ARENA Box (TB, TF), ARENA Combi (THB) MEGANE Classic (LA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE Scenic (JA0/1_), TRAFIC Box (TXX), TRAFIC Bus (TXW) ARENA Combi, ARENA Van	TBK103 OPEL VAUXHALL	ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), CORSA C (F08, F68), ZAFIRA (F75_) ASTRA Mk IV, ASTRA MK IV Convertible, ASTRA Mk IV Coupe, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, CORSA Mk II, ZAFIRA		TBK109 AUDI	80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4), COUPE (89, 8B)
TBK099 RENAULT	ESPACE III (JE0_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), SCENIC (JA0/1_) S40 I (VS), V40 Estate (VW)	TBK104 ALFA ROMEO FIAT LANCIA	156 (932), 156 Sportwagon (932), 166 (936) DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185) KAPPA (838A), KAPPA SW (838B), LYBRA (839AX), LYBRA SW (839BX), THESIS (841AX)		TBK111 OPEL VAUXHALL	ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_) ASTRA Mk III Hatchback, CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback
TBK100 AUDI SEAT SKODA VW	A3 (8L1), A3 (8P1), A3 Sportback (8PA), A4 (8D2, B5), A4 (8E2, B6), A4 (8EC), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Avant (8ED) ALHAMBRA (7V8, 7V9), ALTEA XL (5P5), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), LEON (1M1), LEON (1P1), TOLEDO II (1M2), TOLEDO III (5P2) FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA (1Z3), OCTAVIA Combi (1U5), OCTAVIA Combi (1Z5), SUPERB (3U4) BORA (1J2), BORA Estate (1J6), CADDY III Box (2KA, 2KH), CADDY III Estate (2KB, 2KJ), GOLF IV (1I1), GOLF IV Variant (1J5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), MULTIVAN V (7HM, 7HF), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), PASSAT (3B2),	TBK105 CITROËN FIAT PEUGEOT TOYOTA	BERLINGO (MF), BERLINGO Box (M_), C15 (VD-), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO) SCUDO Box (220L), SCUDO Combinato (220P) 206 Hatchback (2A/C), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), EXPERT Box (222), EXPERT Flatbed / Chassis, EXPERT Flatbed / Chassis (223), PARTNER Box (5), PARTNER Combispace (5F) COROLLA (_E11_), COROLLA Compact (_E11_), COROLLA Liftback (_E11_), COROLLA Wagon (_E11_)		TBK112 SEAT VW	AROSA (6H) LUPO (6X1, 6E1), POLO (6N1), POLO (6N2), POLO Box (6NF)
		TBK106 CITROËN	BERLINGO (MF), BERLINGO Box (M_), EVASION (22, U6), JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (244, Z_), JUMPER Flatbed / Chassis (244), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_),		TBK113 CITROËN FIAT PEUGEOT	EVASION (22, U6), XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XM (Y4), XM Break (Y4), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), ZX (N2) ULYSSE (220) 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 605 (6B), 806 (221)
					TBK114 RENAULT VOLVO	ESPACE III (JE0_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), SCENIC (JA0/1_) S40 I (VS), V40 Estate (VW)

NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits







					
TBK115 AUDI A3 (8L1), A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4B, C5), A6 Avant (4B, C5), TT (8N3), TT Roadster (8N9) SEAT ALHAMBRA (7V8, 7V9), ORDOBA Hatchback (6K2), IBIZA III (6K1), LEON (1M1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), PASSAT (3B2), PASSAT Variant (3B5), SHARAN (7M8, 7M9, 7M6)			FIESTA Box (J5_, J3_), FIESTA Box (JV_), FIESTA IV (JA_, JB_), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP) 121 III (JASM, JBSM) MAZDA TBK122 CITROËN XANTIA (X1), XANTIA (X2), XANTIA Break (X1), XANTIA Break (X2), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), ZX (N2), ZX Break (N2) PEUGEOT 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Convertible (7D, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 406 (8B), 406 Break (8E/F)	VAUXHALL ASTRA Mk IV, ASTRA MK IV Convertible, ASTRA Mk IV Coupe, ASTRA Mk IV Estate, ASTRA Mk IV Hatchback, ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, CORSA Mk II, MERIVA, SIGNUM, TIGRA TwinTop, VECTRA Estate, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA TBK246 AUDI A2 (8Z0) SEAT AROSA (6H), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), IBIZA IV (6L1), IBIZA V (6J5), IBIZA V SPORTCOUPE (6J1), INCA (6K9), LEON (1M1), LEON (1P1), TOLEDO II (1M2) SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA (1Z3), OCTAVIA Combi (1U5), OCTAVIA Combi (1Z5), PRAKTIK, ROOMSTER (5J) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, LUPO (6X1, 6E1), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), POLO (6N1), POLO (6N2), POLO (9N_), POLO CLASSIC (6KV2), POLO Saloon, POLO Variant (6KV5)	
TBK116 AUDI A3 (8L1) SEAT CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), LEON (1M1), TOLEDO II (1M2) SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA Combi (1U5) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5)		TBK123 JEEP CHEROKEE (X1) RENAULT 18 (134_), 18 Box, 18 Variable (135_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE I (J11_), ESPACE II (J/S63_), FUEGO (136_), MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)	TBK207 ALFA ROMEO 145 (930), 146 (930), 147 (937), 156 (932), 156 Sportwagon (932) TBK225 AUDI A2 (8Z0), A3 (8L1), A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A6 (4B, C5), A6 Avant (4B, C5) FORD GALAXY (WGR) SEAT ALHAMBRA (7V8, 7V9), AROSA (6H), LEON (1M1), TOLEDO II (1M2) SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA Combi (1U5), SUPERB (3U4) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), LUPO (6X1, 6E1), NEW BEETLE (9C1, 1C1), PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6), POLO (6N2), POLO (9N_), POLO Saloon, SHARAN (7M8, 7M9, 7M6)	TBK260 OPEL ASTRA F (56_, 57_), ASTRA F CLASSIC Estate, ASTRA F CLASSIC Hatchback, ASTRA F CLASSIC Saloon, ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), ASTRA G Estate (F35_), CORSA B (73_, 78_, 79_, F35_), TIGRA (95_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) VAUXHALL ASTRA Mk III, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CORSA, TIGRA, VECTRA, VECTRA Estate, VECTRA Hatchback	
TBK117 JEEP CHEROKEE (X1) RENAULT 18 (134_), 18 Box, 18 Variable (135_), 21 (B48_), 21 Box (S48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE I (J11_), ESPACE II (J/S63_), FUEGO (136_), MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_), TRAFIC Box (T1, T3, T4), TRAFIC Box (TXX), TRAFIC Bus (T5, T6, T7), TRAFIC Bus (TXW), TRAFIC Flatbed / Chassis (P6), TRAFIC Flatbed / Chassis (PXX)		TBK230 CITROËN C1 (PM_, PN_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), NEMO (AA_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0) FORD FIESTA V (JH_, JD_), FIESTA Van, FUSION (JU_) 2 (B2W) PEUGEOT 107, 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 1007 (KM_), BIPPER (AA_) TOYOTA AYGO TBK240 CHEVROLET NUBIRA Estate, NUBIRA Saloon OPEL ASTRA G Convertible, ASTRA G Coupe (F07_), ASTRA G Estate (F35_), ASTRA G Hatchback (F48_, F08_), ASTRA G Saloon (F69_), ASTRA H, ASTRA H Estate, ASTRA H GTC, ASTRA H TwinTop, COMBO Box Body / Estate, COMBO Tour, CORSA C (F08, F68), MERIVA, SIGNUM, TIGRA TwinTop, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA, ZAFIRA (F75_) SAAB 9-3 (YS3F), 9-3 Estate	TBK261 CHEVROLET EPICA (KL1_), EVANDA, LACETTI, NUBIRA Estate, NUBIRA Saloon, REZZO DAEWOO EVANDA (KLAL), LACETTI Hatchback (KLAN), LEGANZA (KLAV), NUBIRA (KLAI), NUBIRA Saloon (KLAJ), NUBIRA Saloon (KLAN), NUBIRA Wagon (KLAJ), NUBIRA Wagon (KLAN), REZZO (KLAU) OPEL ASTRA F (56_, 57_), ASTRA F Convertible (53_B), ASTRA F Estate (51_, 52_), ASTRA F Hatchback (53_, 54_, 58_, 59_), CALIBRA A (85_), OMEGA B (25_, 26_, 27_), OMEGA B Estate (21_, 22_, 23_), VECTRA A (86_, 87_), VECTRA A Hatchback (88_, 89_), VECTRA B (36_), VECTRA B Estate (31_), VECTRA B Hatchback (38_) VAUXHALL ASTRA Mk III, ASTRA Mk III Convertible, ASTRA Mk III Estate, ASTRA Mk III Hatchback, CALIBRA, CAVALIER Mk III (87), CAVALIER Mk III Hatchback, OMEGA, OMEGA Estate, VECTRA, VECTRA Estate, VECTRA Hatchback		
TBK118 FIAT TEMPRA (159), TEMPRA S.W. (159), TIPO (160) LANCIA DEDRA (835), DEDRA SW (835), DELTA I (831AB0), DELTA II (836), THEMA (834), THEMA SW (834)					
TBK119 AUDI 80 (8C, B4), 80 Avant (8C, B4) SEAT TOLEDO I (1L) VW GOLF III (1H1), GOLF III Variant (1H5), PASSAT (3A2, 35I), PASSAT Variant (3A5, 35I), VENTO (1H2)					
TBK120 FORD ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), ESCORT VI (GAL), ESCORT VI Convertible (ALL), ESCORT VI Estate (GAL), ESCORT VI Saloon (GAL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), E SCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL), FIESTA III (GF), MONDEO I (GBP), MONDEO I Estate (BNP), MONDEO I Saloon (GBP), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), ORION III (GAL)					
TBK121 FORD ESCORT '95 Box (AVL), ESCORT CLASSIC (AAL, ABL), ESCORT CLASSIC Turnier (ANL), ESCORT VII (GAL, AAL, ABL), ESCORT VII Convertible (ALL), ESCORT VII Estate (GAL, ANL), ESCORT VII Saloon (GAL, AFL),					







  <p>TBK262 AUDI A3 (8P1), A3 Sportback (8PA), A4 (8EC), A4 Avant (8ED), A6 (4F2), A6 Avant (4F5) SEAT ALTEA (5P1), ALTEA XL (5P5), TOLEDO III (5P2) SKODA OCTAVIA (1Z3), OCTAVIA Combi (1Z5) VW GOLF V (1K1), GOLF V PLUS (5M1), JETTA III (1K2), PASSAT (3C2), PASSAT Variant (3C5), TOURAN (1T1, 1T2)</p>	  <p>CADDY III Estate (2KB, 2KJ), EOS, FOX (5Z1), GOLF IV (1J1), GOLF IV Variant (1J5), GOLF V (1K1), GOLF V PLUS (5M1), GOLF V Variant, JETTA III (1K2), LUPO (6X1, 6E1), MULTIVAN V (7HM, 7HF), NEW BEETLE (9C1, 1C1), NEW BEETLE Convertible (1Y7), PASSAT (3B3), PASSAT (3C2), PASSAT Variant (3B6), PASSAT Variant (3C5), POLO (6N2), POLO (9N_), POLO Saloon, SHARAN (7M8, 7M9, 7M6), TOURAN (1T1, 1T2), TRANSPORTER V Box (7HA, 7HH), TRANSPORTER V Bus (7HB, 7HI), TRANSPORTER V Flatbed / Chassis (7JD, 7JE, 7JL, 7JY, 7JZ)</p>	  <p>TBK276 FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_), FIESTA V (JH_, JD_), FOCUS (DAW, DBW), FOCUS C-MAX, FOCUS Estate (DNW), FOCUS II (DA_), FOCUS II Turnier (DAW_), FOCUS Saloon (DFW), FUSION (JU_), PUMA (EC_) 2 (B2W), 121 III (JASM, JB5M)</p>
<p>TBK263 SEAT LEON (1M1), TOLEDO II (1M2) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), LUPO (6X1, 6E1), POLO (6N1)</p>	<p>TBK272 AUDI A3 (8L1) SEAT CORDOBA Hatchback (6K2), CORDOBA Vario (6K5), IBIZA III (6K1), INCA (6K9), LEON (1M1), TOLEDO II (1M2) SKODA OCTAVIA (1U2), OCTAVIA Combi (1U5) VW BORA (1J2), BORA Estate (1J6), CADDY II Box (9K9A), CADDY II Estate (9K9B), GOLF IV (1J1), GOLF IV Variant (1J5), NEW BEETLE (9C1, 1C1), POLO Box (6NF), POLO CLASSIC (6KV2), POLO Variant (6KV5)</p>	<p>TBK277 FIAT DOBLO (119), DOBLO Cargo (223), PALIO (178BX), PALIO Weekend (178DX), PANDA (169), PANDA Van (141_), PUNTO (176), PUNTO (188), PUNTO Convertible (176C), PUNTO Van (188AX), SIENA (178_), STRADA (178E) Y (840A), YPSILON</p>
<p>TBK267 DACIA LOGAN, LOGAN MCV RENAULT CLIO II (BB0/1/2_, CB0/1/2_), CLIO III (BR0/1, CR0/1), GRAND SCENIC (JM0/1_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MEGANE Cabriolet (EA0/1_), MEGANE Classic (LA0/1_), MEGANE Coach (DA0/1_), MEGANE Grandtour (KA0/1_), MEGANE I (BA0/1_), MEGANE II (BM0/1_, CM0/1_), MEGANE II Estate (KM0/1_), MEGANE II Saloon (LM0/1_), MODUS (F/JPo_), SCENIC (JA0/1_), SCENIC II (JM0/1_), THALIA (LBO/1/2_)</p>	<p>TBK273 NISSAN ALMERA II (N16), ALMERA II Hatchback (N16), MICRA (K12) RENAULT CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO (KC0/1_), KANGOO Express (FC0/1_), MEGANE II (BM0/1_, CM0/1_), SCENIC II (JM0/1_), THALIA (LBO/1/2_)</p>	<p>TBK278 FORD FIESTA Box (J5_, J3_), FIESTA Box (JV_), FIESTA IV (JA_, JB_), FOCUS (DAW, DBW), FOCUS C-MAX, FOCUS Estate (DNW), FOCUS II (DA_), FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), FOCUS Saloon (DFW), GALAXY, MONDEO IV, MONDEO IV Turnier, S-MAX, TOURNEO CONNECT, TRANSIT CONNECT (P65_, P70_, P80_)</p>
<p>TBK269 AUDI A2 (8Z0), A3 (8L1), A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A6 (4B, C5), A6 Avant (4B, C5) FORD GALAXY (WGR) SEAT ALHAMBRA (7V8, 7V9), AROSA (6H), LEON (1M1), TOLEDO II (1M2) SKODA FABIA (6Y2), FABIA Combi (6Y5), FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA Combi (1U5), SUPERB (3U4) VW BORA (1J2), BORA Estate (1J6), GOLF IV (1J1), GOLF IV Variant (1J5), LUPO (6X1, 6E1), NEW BEETLE (9C1, 1C1), PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6), POLO (6N2), POLO (9N_), POLO Saloon, SHARAN (7M8, 7M9, 7M6)</p>	<p>TBK274 CITROËN BERLINGO (MF), BERLINGO Box (M_), C5 (DC_), C5 Break (DE_), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), XSARA PICASSO (N68) FIAT SCUDO Box (220L), SCUDO Combinato (220P) LANCIA ZETA (220) PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 307 Break (3E), 307 SW (3H), 406 (8B), 406 Break (8E/F), 607 (9D, 9U), 806 (221), EXPERT Box (222), EXPERT Flatbed / Chassis, PARTNER Box (5), PARTNER Combispace (5F)</p>	<p>TBK279 CITROËN C4 (LC_), C4 Coupe (LA_), C5 (DC_), C5 (RC_), C5 Break (DE_), C5 Break (RE_), C8 (EA_, EB_), EVASION (22, U6), JUMPY (U6U), JUMPY Box (BS_, BT_, BY_, BZ_), JUMPY Flatbed / Chassis (BU_, BV_, BW_, BX_), XSARA (N1), XSARA Break (N2), XSARA Coupe (NO), XSARA PICASSO (N68) FIAT SCUDO Box (220L), SCUDO Combinato (220P), ULYSSE (179AX), ULYSSE (220) LANCIA PHEDRA (179), ZETA (220) PEUGEOT 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U), 806 (221), 807 (E), EXPERT (224), EXPERT Box (222)</p>
<p>TBK270 AUDI A2 (8Z0), A3 (8L1), A3 (8P1), A3 Sportback (8PA), A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5) FORD GALAXY (WGR) SEAT ALHAMBRA (7V8, 7V9), ALTEA (5P1), ALTEA XL (5P5), AROSA (6H), CORDOBA (6L2), IBIZA IV (6L1), IBIZA V (6J5), IBIZA V SPORTCOUPE (6J1), LEON (1M1), LEON (1P1), TOLEDO II (1M2), TOLEDO III (5P2) SKODA FABIA, FABIA (6Y2), FABIA Combi, FABIA Combi (6Y5), FABIA Praktik, FABIA Saloon (6Y3), OCTAVIA (1U2), OCTAVIA (1Z3), OCTAVIA Combi (1U5), OCTAVIA Combi (1Z5), PRAKTIK, ROOMSTER (5J), SUPERB (3U4) VW BORA (1J2), BORA Estate (1J6), CADDY III Box (2KA, 2KH),</p>	<p>TBK275 MITSUBISHI CARISMA (DA_), CARISMA Saloon (DA_), SPACE STAR (DGO) NISSAN INTERSTAR Box (X70), INTERSTAR Bus (X70), PRIMASTAR Box (X83), PRIMASTAR Bus (X83) OPEL MOVANO Box (F9), MOVANO Combi (J9), VIVARO Box (F7), VIVARO Combi (J7) RENAULT ESPACE IV (JK0/1_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MASTER II Box (FD), MASTER II Bus (JD/ND), TRAFIC II Box (FL), TRAFIC II Bus (IL), TRAFIC II Flatbed / Chassis (EL) VAUXHALL MOVANO Combi (JD), MOVANO Van (FD), VIVARO Box, VIVARO Combi VOLVO S40 I (VS), V40 Estate (VW)</p>	<p>TBK280 DACIA SOLENZA RENAULT CLIO I (B/C57_5/357_), CLIO II (BB0/1/2_, CB0/1/2_), CLIO II Box (SB0/1/2_), KANGOO, KANGOO (KC0/1_), KANGOO Express (FC0/1_), RAPID Box (F40_, G40_), THALIA (LBO/1/2_)</p>
	<p>TBK281 CITROËN CX II, CX II Break PEUGEOT 505 (551A) RENAULT 18 (134_), 18 Variable (135_), 21 (B48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE I (J11_), MASTER I Box (T_), MASTER I Bus (T_), MASTER I Flatbed / Chassis (P_)</p>	<p>TBK282 CITROËN CX II, CX II Break PEUGEOT 505 (551A), 505 Break (551D) RENAULT 18 (134_), 21 (B48_), 21 Estate (K48_), 21 Saloon (L48_), 25 (B29_), ESPACE I (J11_)</p>
	<p>TBK283 ALFA ROMEO 145 (930), 146 (930), 147 (937), 156 (932), 156 Sportwagon (932) FIAT BRAVA (182), BRAVO, BRAVO (182), DOBLO (119),</p>	



NUMERICAL PARTS LIST







Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits






  <p>LANCIA DOBLO Cargo (223), GRANDE PUNTO (199), IDEA, MAREA (185), MAREA Weekend (185), MULTIPLA (186), PUNTO (188), PUNTO Van (188AX), STILO (192), STILO Multi Wagon (192), STRADA (178E) LYBRA (839AX), LYBRA SW (839BX), MUSA</p>	  <p>MAZDA 626 III (GD), 626 III Coupe (GD), 626 III Hatchback (GD), 626 III Station Wagon (GV)</p>	  <p>FORD C-MAX, FIESTA V (JH_, JD_), FOCUS C-MAX, FOCUS II (DA_), FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), FUSION (JU_) 3 (BK14), 3 Saloon (BK12)</p>
<p>TBK284 LADA SAMARA (2108, 2109), SAMARA FORMA (21099)</p>	<p>TBK294 SUZUKI BALENO (EG), BALENO Estate (EG), BALENO Hatchback (EG), GRAND VITARA (FT, GT), SWIFT II (AH, AJ), VITARA (ET, TA), VITARA Cabrio (ET, TA), X-90 (EL)</p>	<p>MAZDA PEUGEOT 206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 207 CC (WD_), 207 SW (WK_), 307 (3A/C), 307 Break (3E), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 407 (6D_), 407 SW (6E_), 1007 (KM_), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_), PARTNER Box, PARTNER Box (5), PARTNER Combispace (5F), PARTNER Tepee S40 II (MS), V50 (MW)</p>
<p>TBK285 AUDI 80 (89, 89Q, 8A, B3), 80 (8C, B4), 80 Avant (8C, B4), 100 (4A, C4), 100 Avant (4A, C4), A6 (4A, C4), A6 Avant (4A, C4), CABRIOLET (8G7, B4), COUPE (81, 85), COUPE (89, 8B)</p>	<p>TBK295 FORD USA PROBE II (ECP) MAZDA 323 F VI (BJ), 323 S VI (BJ), 626 IV (GE), 626 IV Hatchback (GE), 626 V (GF), 626 V Hatchback (GF), 626 V Station Wagon (GW), MPV II (LW), MX-6 (G66), PREMACY (CP)</p>	<p>VOLVO TBK303 CITROËN C5 (DC_), C5 Break (DE_), C8 (EA_, EB_) ULYSSE (179AX) FIAT LANCIA PHEDRA (179) PEUGEOT 406 (8B), 406 Break (8E/F), 406 Coupe (8C), 607 (9D, 9U), 807 (E)</p>
<p>TBK286 MAZDA 121 I (DA), 323 II (BD), 323 II Hatchback (BD), 323 III (BF), 323 III Hatchback (BF), 323 III Station Wagon (BW)</p>	<p>TBK296 HONDA CIVIC IV (EG, EH), CIVIC IV Fastback (MA, MB), CIVIC IV Hatchback (EG), CIVIC V (EJ9, EK3/4), CIVIC V Aerodeck (MC), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK1/3/4), CIVIC VI Hatchback (EU_, EP_)</p>	<p>TBK304 CITROËN C4 (LC_), C4 Coupe (LA_) PEUGEOT 206 Hatchback (2A/C), 307 (3A/C), 307 Break (3E), 307 CC (3B), EXPERT Tepee (VF3V_)</p>
<p>TBK287 ALFA ROMEO 33 (905), 33 (907A), 33 Sport Wagon (907B), 33 Sportwagon (905A), 145 (930), 146 (930), ALFASUD Coupe (902A)</p>	<p>TBK297 HONDA ACCORD VII (CG), CIVIC IV (EG, EH), CIVIC IV Coupe (EJ), CIVIC IV Hatchback (EG), CIVIC V (EJ9, EK3/4), CIVIC V Aerodeck (MC), CIVIC V Coupe (EJ6, EJ8), CIVIC V Fastback (MB), CIVIC V Hatchback (EJ9, EK1/3/4), CRX III (EH, EG), HR-V (GH) 400 (RT)</p>	<p>TBK305 FORD GALAXY (WGR) SEAT ALHAMBRA (7V8, 7V9), CORDOBA (6K2/C2), CORDOBA Vario (6K5), IBIZA II (6K1), INCA (6K9) VW CADDY II Box (9K9A), CADDY II Estate (9K9B), POLO CLASSIC (6KV2), POLO Variant (6KV5), SHARAN (7M8, 7M9, 7M6)</p>
<p>TBK288 FORD ESCORT '81 Express (AVA), ESCORT '86 Express (AVF), ESCORT '91 Express (AVL), ESCORT III (GAA), ESCORT III Convertible (ALD), ESCORT III Estate (AWA), ESCORT IV (GAF, AWF, ABFT), ESCORT IV Convertible (ALF), ESCORT IV Estate (AWF, AVF), ESCORT V (GAL), ESCORT V Convertible (ALL), ESCORT V Estate (GAL, AVL), FIESTA Box (FVD), FIESTA II (FBD), FIESTA III (GFI), ORION I (AFD), ORION II (AFF), ORION III (GAL), SIERRA (GBG, GB4), SIERRA Estate (BNG), SIERRA Hatchback (GBC, GBG)</p>	<p>TBK298 ROVER 400 (RT)</p>	<p>TBK306 ALFA ROMEO 156 Sportwagon (932), 159, 159 Sportwagon FIAT BRAVO, CROMA (194), STILO (192), STILO Multi Wagon (192) OPEL ASTRA H, ASTRA H Estate, ASTRA H GTC, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA 9-3 (YS3F), 9-3 Convertible (YS3F), 9-3 Estate, 9-5 (YS3E), 9-5 Estate (YS3E) VAUXHALL ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II</p>
<p>TBK289 HONDA CIVIC III Hatchback (EC, ED, EE), CIVIC III Saloon (ED), CIVIC IV (EG, EH), CIVIC IV Coupe (EJ), CIVIC IV Fastback (MA, MB), CIVIC IV Hatchback (EG), CONCERTO (HW), CONCERTO Saloon (HWW)</p>	<p>TBK299 MAZDA 323 CV (BA), 323 FV (BA), 323 PV (BA), 323 S V (BA)</p>	<p>TBK307 HYUNDAI ACCENT (X-3), ACCENT Saloon (X-3), LANTRA II (J-2), LANTRA II Wagon (J2)</p>
<p>TBK290 HONDA ACCORD IV (CB3, CB7), ACCORD IV Aerodeck (CB8, CC), ACCORD V (CC7), ACCORD V Aerodeck (CE), ACCORD V Coupe (CD7, CD9), ACCORD VI (CE, CF), PRELUDE IV (BB), PRELUDE V (BB), SHUTTLE (RA) 600 (RH)</p>	<p>TBK300 FIAT BRAVA (182), BRAVO (182), MAREA (185), MAREA Weekend (185) Y (840A)</p>	<p>TBK308 CITROËN SAXO (S0, S1) PEUGEOT 106 II (1)</p>
<p>TBK291 HYUNDAI LANTRA I (J-1), PONY (X-2), PONY/EXCEL Saloon (X-2), S COUPE (SLC) MITSUBISHI COLT II (C1_A), LANCER III (C1_A, C6_A), MIRAGE Hatchback</p>	<p>TBK301 DACIA LOGAN, LOGAN MCV NISSAN ALMERA II (N16), ALMERA II Hatchback (N16), KUBISTAR (X76), MICRA (K12) RENAULT CLIO Grandtour (KRO/1_), CLIO II (BBO/1/2_, CBO/1/2_), CLIO II Box (SBO/1/2_), CLIO III (BRO/1, CRO/1), GRAND SCENIC (JMO/1_), KANGOO (KCO/1_), KANGOO Express (FCO/1_), LOGAN (LS_), MEGANE II (BMO/1_, CMO/1_), MEGANE II Coupé-Cabriolet (EMO/1_), MEGANE II Estate (KMO/1_), MEGANE II Saloon (LMO/1_), MODUS (F/PO_), SCENIC II (JMO/1_), THALIA (LBO/1/2_), TWINGO (CNO_)</p>	<p>TBK309 AUDI A4 (8D2, B5), A4 Avant (8D5, B5) VW PASSAT (3B2), PASSAT Variant (3B5)</p>
<p>TBK292 HYUNDAI H-1 Box, H-1 Bus (KMF), H100 Bus (P), SONATA I (Y-2), STAREX (H1) MITSUBISHI GALANT III (E1_A), L 300 Bus (P0_W, P1_W, P2_W), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), SAPPORO III (E16A)</p>	<p>TBK302 CITROËN BERLINGO Box, BERLINGO Box (M_), C2 (JM_), C3 (FC_), C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), JUMPY, JUMPY Box, XSARA PICASSO (N68)</p>	<p>TBK310 FORD FIESTA Box (J5_, J3_), FIESTA IV (JA_, JB_) MAZDA 121 III (JASM, JBSM) TBK311 HYUNDAI GALLOPER I, GALLOPER II (JK-01), H-1 Box, H-1 Bus (KMF), H100 Box, H100 Bus (P), PORTER Box, PORTER Pickup K2500 (SD), PREGIO Box (TB) GALLOPER (JK-01), L 200 (K_T), L 300 Box (P0_W, P1_W), L 300 Bus (P0_W, P1_W, P2_W), L 300 Flatbed / Chassis (L03_P), L 300 Flatbed / Chassis (P1_T),</p>

					
	PAJERO CLASSIC (V2_W), PAJERO II (V2_W, V4_W), PAJERO II Open Off-Road Vehicle (V2_W, V4_W), PAJERO III (V60, V70), PAJERO SPORT (K90), SPACE GEAR (PA/B/D_V/W)	VW	IBIZA II (6K1), IBIZA III (6K1), IBIZA IV (6L1), INCA (6K9) CADDY II Box (9K9A), CADDY II Estate (9K9B), FOX (5Z1), LUPO (6X1, 6E1), POLO (6N2), POLO CLASSIC (6KV2), POLO Variant (6KV5)	TBK332 AUDI A4 (8D2, B5), A4 Avant (8D5, B5)	
TBK312 CITROËN	BERLINGO (MF), BERLINGO Box (M_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), NEMO (AA_), SAXO (S0, S1), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0)	TBK321 LADA	110, 111, 112, KALINA Estate (1117), KALINA Hatchback (1119), KALINA Saloon (1118), SAMARA (2108, 2109), SAMARA FORMA (21099)	TBK333 AUDI A4 (8D2, B5), A4 Avant (8D5, B5)	
PEUGEOT	106 II (1), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 207 SW (WK_), 306 (7B, N3, N5), 306 Break (7E, N3, N5), 306 Hatchback (7A, 7C, N3, N5), 307 (3A/C), 1007 (KM_), BIPPER (AA_), PARTNER Box (5), PARTNER Combispace (5F)	TBK322 NISSAN	PRIMERA (P12), PRIMERA Estate (WP12), PRIMERA Hatchback (P12)	TBK334 FORD TRANSIT Box (E_), TRANSIT Bus (E_), TRANSIT Flatbed / Chassis (E_)	
TBK313 FIAT	500, BRAVA (182), BRAVO, BRAVO (182), GRANDE PUNTO (199), IDEA, LINEA, MAREA (185), MAREA Weekend (185), PANDA (169), PUNTO (176), PUNTO (188), PUNTO Convertible (176C), SIENA (178_), STILO (192), STILO Multi Wagon (192)	RENAULT	GRAND SCENIC (JM0/1_), LAGUNA II (BG0/1_), LAGUNA II Grandtour (KG0/1_), MEGANE II (BM0/1_, CM0/1_), MEGANE II Coupé-Cabriolet (EM0/1_), MEGANE II Estate (KM0/1_), MEGANE II Saloon (LM0/1_), SCENIC II (JM0/1_)	TBK335 AUDI A4 (8D2, B5), A4 Avant (8D5, B5) VW PASSAT (3B2), PASSAT Variant (3B5)	
LANCIA	MUSA, Y (840A), YPSILON	SUZUKI	GRAND VITARA	TBK336 CITROËN C2 (JM_), C3 (FC_), C4 (LC_), C4 Coupe (LA_) PEUGEOT 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 307 SW (3H), 1007 (KM_)	
TBK314 FIAT	CINQUECENTO (170), PANDA (141A_), PANDA (169), PANDA Van (141_), PUNTO (176), PUNTO Van (176L), SEICENTO (187), SEICENTO Van (187), UNO (146A/E)	TBK323 RENAULT	ESPACE III (JE0_), LAGUNA (B56_, 556_), LAGUNA Grandtour (K56_), SCENIC (JA0/1_)	TBK337 BMW 3 (E21), 3 (E30), 3 Convertible (E30), 5 (E28), 5 (E34)	
LANCIA	Y (840A)	TBK325 HYUNDAI	ACCENT (LC), ACCENT (MC), ACCENT (X-3), ACCENT Saloon (LC), ACCENT Saloon (MC), ACCENT Saloon (X-3), COUPE (GK), COUPE (RD), ELANTRA (XD), ELANTRA Saloon (XD), GETZ (TB), MATRIX (FC)	TBK338 CITROËN C4 (LC_), C4 Coupe (LA_), C4 Grand Picasso (UA_), C4 Picasso (UD_), C5 (RC_), C5 (RD_), C5 Break (RE_), C5 Break (TD_), C8 (EA_, EB_), JUMPY, JUMPY Box	
TBK315 RENAULT	CLIO II (BB0/1/2_, CB0/1/2_), CLIO III (BR0/1, CR0/1), KANGOO (KC0/1_), KANGOO Express (FC0/1_), MODUS (F/JPO_), THALIA (LB0/1/2_), TWINGO (C06_), TWINGO (CNO_)	KIA	CERATO, CERATO Saloon, RIO II, RIO II Saloon	FIAT SCUDDO, SCUDDO Box, SCUDDO Flatbed / Chassis, ULYSSE (179AX)	
TBK316 CITROËN	BERLINGO (MF), BERLINGO Box (M_), C2 (JM_), C3 (FC_), SAXO (S0, S1)	TBK326 FORD	COUGAR (EC_), FOCUS (DAW, DBW), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP)	FORD C-MAX, FOCUS C-MAX, FOCUS II (DA_), FOCUS II Convertible, FOCUS II Saloon (DA_), FOCUS II Turnier (DAW_), GALAXY, KUGA, MONDEO IV, MONDEO IV Saloon, MONDEO IV Turnier, S-MAX	
PEUGEOT	106 II (1), 206 Hatchback (2A/C), 206 SW (2E/K), PARTNER Box (5), PARTNER Combispace (5F)	TBK327 FORD	COUGAR (EC_), FOCUS (DAW, DBW), FOCUS Estate (DNW), FOCUS Saloon (DFW), MONDEO II (BAP), MONDEO II Estate (BNP), MONDEO II Saloon (BFP), TOURNEO CONNECT, TRANSIT CONNECT (P65_, P70_, P80_)	LANCIA PHEDRA (179) PEUGEOT 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 308 (4A_, 4C_), 308 SW, 407 (6D_), 407 Coupe (6C_), 407 SW (6E_), 607 (9D, 9U), 807 (E), EXPERT Box (VF3A_, VF3U_, VF3X_), EXPERT Flatbed / Chassis, EXPERT Tepee (VF3V_) VOLVO C30, C70 Convertible, S40 II (MS), V50 (MW), V70 III Estate	
TBK317 CHEVROLET	MATIZ	TBK328 HYUNDAI	ATOS (MX), ATOS PRIME (MX), GETZ (TB)	TBK339 HYUNDAI ACCENT (LC), ACCENT Saloon (LC), GETZ (TB)	
DAEWOO	MATIZ (KLYA), TICO (KLY3)	KIA	PICANTO (BA)	TBK340 MAZDA 323 C V (BA), 323 F V (BA), 323 F VI (BJ), 323 P V (BA), 323 S V (BA), 323 S VI (BJ)	
TBK318 CITROËN	BERLINGO (MF), BERLINGO Box, BERLINGO Box (M_), C3 (FC_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0)	TBK329 ALFA ROMEO	147 (937)	TBK341 AUDI A4 (8D2, B5), A4 (8E2, B6), A4 (8EC), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5)	
PEUGEOT	206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), PARTNER Box (5), PARTNER Combispace (5F)	FIAT	MULTIPLA (186), PUNTO (188), STILO (192), STILO Multi Wagon (192)	SKODA SUPERB (3U4)	
TBK319 CITROËN	BERLINGO, BERLINGO (MF), BERLINGO Box, BERLINGO Box (M_), C2 (JM_), C3 (FC_), C3 Pluriel (HB_), C4 (LC_), C4 Coupe (LA_), XSARA (N1), XSARA Break (N2), XSARA Coupe (N0), XSARA PICASSO (N68)	LANCIA	LYBRA (839AX), LYBRA SW (839BX)	VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5)	
PEUGEOT	206 CC (2D), 206 Hatchback (2A/C), 206 SW (2E/K), 207 (WA_, WC_), 307 (3A/C), 307 Break (3E), 307 CC (3B), 307 SW (3H), 1007 (KM_), PARTNER Box, PARTNER Combispace (5F), PARTNER Tepee	OPEL	ASTRA H, ASTRA H Estate, ASTRA H GTC, SIGNUM, VECTRA C, VECTRA C Estate, VECTRA C GTS, ZAFIRA 9-3 (YS3F), 9-3 Estate	TBK342 MAZDA 323 C IV (BG), 323 C V (BA), 323 F IV (BG), 323 F V (BA), 323 III (BF), 323 III Hatchback (BF), 323 S IV (BG), 323 S V (BA), MX-3 (EC), MX-5 I (NA), MX-5 II (NB), XEDOS 6 (CA)	
TBK320 SEAT	AROSA (6H), CORDOBA (6L2), CORDOBA Hatchback (6K2), CORDOBA Vario (6K5),	SAAB	ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II	TBK343 MAZDA 323 F VI (BJ), 323 S VI (BJ), 626 IV (GE), 626 V Hatchback (GF), 626 V Station Wagon (GW), PREMACY (CP)	
		VAUXHALL	ASTRA MK V Estate, ASTRA MK V Hatchback, ASTRA MK V Sport Hatch, SIGNUM, VECTRA Mk II, VECTRA Mk II Estate, VECTRA Mk II GTS, ZAFIRA Mk II	TBK344 CITROËN JUMPER Box (230L), JUMPER Box (244), JUMPER Bus (230P), JUMPER Bus (244, Z_)	

NUMERICAL PARTS LIST

Nummerische Teilenummernliste • Elenco riferimenti
Liste des références produits





					
FIAT	JUMPER Flatbed / Chassis (230) DUCATO Box (230L), DUCATO Box (244), DUCATO Bus (230), DUCATO Bus (244, Z_), DUCATO Flatbed / Chassis (230)	TBK357	AUDI A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4A, C4), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH)		
PEUGEOT	BOXER Box (230L), BOXER Box (244), BOXER Bus (230P), BOXER Bus (244, Z_), BOXER Flatbed / Chassis (ZCT_)	SKODA SUPERB (3U4)	VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)		
TBK345		TBK358	AUDI A4 (8D2, B5), A4 Avant (8D5, B5), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8)		
ALFA ROMEO	145 (930), 146 (930), 155 (167), 156 (932), GT	VW PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)			
FIAT	BARCETTA (183), PUNTO (188), STILO (192), STILO Multi Wagon (192)	TBK359	TOYOTA COROLLA (_E8_), COROLLA (_E9_), COROLLA (_E10_), COROLLA Compact (_E9_), COROLLA Compact (_E10_), COROLLA FX Compact (E8B), COROLLA Liftback (_E8_), COROLLA Liftback (_E9_), COROLLA Liftback (_E10_), COROLLA Station Wagon (_E9_), COROLLA Wagon (_E10_), STARLET (_P7_), STARLET (_P8_)		
TBK346					
HONDA	ACCORD VI (CE, CF), ACCORD VII (CG), ACCORD VII Coupe (CG), ACCORD VII Hatchback (CH)	TBK360	TOYOTA AVENSIS (_T22_), AVENSIS Liftback (_T22_), AVENSIS Station Wagon (_T22_), CAMRY (_V1_), CAMRY (_V2_), CAMRY (_V20), CAMRY Station Wagon (_V2_), CAMRY Station Wagon (_V10), CARINA E (_T19_), CARINA E Saloon (_T19_), CARINA E Sportswagon (_T19_), CARINA II (_T17_), CARINA II Saloon (_T17_), CARINA II Station Wagon (_T17_), PICNIC (_XM10), RAV 4 I (SXA1_), RAV 4 I Cabrio (SXA1_)		
TBK347					
LAND ROVER	FREELANDER (LN), FREELANDER Soft Top				
MG	MG TF, MG ZR, MG ZS, MG ZS Hatchback, MG ZT, MG ZT- T, MGF (RD)				
ROVER	25 (RF), 45 (RT), 45 Saloon (RT), 75 (RI), 75 Tourer (RI), 200 (RF), 400 (RT), 400 Hatchback (RT), 400 Tourer (XW), STREETWISE				
TBK348					
AUDI	A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH)				
SKODA	SUPERB (3U4)				
VW	PASSAT (3B3), PASSAT Variant (3B6)				
TBK350					
ALFA ROMEO	147 (937), 156 (932), 156 Sportwagon (932), GT				
FIAT	STILO (192), STILO Multi Wagon (192)				
TBK352					
FIAT	BRAVA (182), BRAVO (182), DOBLO (119), DOBLO Cargo (223), MAREA (185), MAREA Weekend (185), PALIO Weekend (178DX), STRADA (178E)				
LANCIA	KAPPA (838A), KAPPA SW (838B)				
TBK353					
AUDI	A4 (8D2, B5), A4 (8E2, B6), A4 Avant (8D5, B5), A4 Avant (8E5, B6), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4A, C4), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH)				
SKODA	SUPERB (3U4)				
VW	PASSAT (3B2), PASSAT (3B3), PASSAT Variant (3B5), PASSAT Variant (3B6)				
TBK354					
AUDI	A4 (8E2, B6), A4 (8EC), A4 Avant (8E5, B6), A4 Avant (8ED), A4 Convertible (8H7, 8HE), A6 (4B, C5), A6 Avant (4B, C5), A8 (4D2, 4D8), ALLROAD (4BH)				
SKODA	SUPERB (3U4)				
VW	PASSAT (3B3), PASSAT Variant (3B6)				
TBK355					
CITROËN	C5 (DC_), C5 (RC_), C5 Break (DE_), C5 Break (RE_), C8 (EA_, EB_)				
FIAT	ULYSSE (179AX)				
LANCIA	PHEDRA (179)				
PEUGEOT	406 (8B), 406 Break (8E/F), 607 (9D, 9U), 807 (E)				
TBK356					
ALFA ROMEO	145 (930), 146 (930), 147 (937), 155 (167), 156 (932), 156 Sportwagon (932), 166 (936), GTV (916C_), SPIDER (916S_)				
FIAT	BARCETTA (183), COUPE (FA/175)				
LANCIA	DEDRA (835), DEDRA SW (835), DELTA II (836)				





Kit	Belt	OE 	Teeth 	Width 	OE 	
TBK002	TB257	7700736969	95x17.00		7700736085	58
TBK004	TB376	081655	101x17.00		97535002/082919/082954	26
TBK005	TB304	081656	104x17.00		97535002/082919/082954	26
TBK006	TB129	636357	104x15.00		5972277	8
TBK007	TB259	081644	108x17.00		97535002/082919/082954	26
TBK008	TB336	90353179	111x17.00		636734/636740	79
TBK009	TB226	081667	113x17.00		91508298/082912	20
TBK010	TB419	95639605	114x17.00		9605266280	26
TBK011	TB237	6177887	116x20.00		6497120/7330712, 1005823/7053802	72, 40
TBK012	TB237+TB495	6177887+ 1005828	116+85x20+22,00		1005822/6988203, 6497120/7330712, 1005823/7053802	1, 72, 40
TBK013	TB496	1005824	116x22.00		1005516, 1005823/7053802	48, 40
TBK014	TB496+TB495	1110999+1005828	116+85x22+22,00		1005822/6988203, 6497120/7330712, 1005823/7053802	1, 72, 40
TBK015	TB114	7700618657	116x19.00		82910	23
TBK016	TB108	056109119A	121x18.00		026109243/026109243E	15
TBK017	TB256	7700725577	125x19.00		7700726440, 7700735486/09109609	51, 52
TBK018	TB225	068109119	135x25.40		068109243/F	17
TBK019	TB175	LHN10013	136x25.40		93501404/082911, 93501405/083002	21, 22
TBK020	TB175	LHN10013	136x25.40		9617188680, 96159	80, 81
TBK021	TB413	94385561	136x25.40		636731/636742, 636747	78, 18
TBK022	TB413	94385561	136x25.40		636735, 636730/636747	36, 18
TBK023	TB413	94385561	136x25.40		636741/636745, 636747	97, 18
TBK024	TB384	028109119D	137x25.40		068109243E/F	17
TBK025	TB384	028109119D	137x25.40		028109243E/F	74
TBK026	TB384	028109119D	137x25.40		028109243E/F, 028109244	74, 94
TBK027	TB305	081679	138x15.00		5972277	8
TBK028	TB221	636367	141x24.00		636732, 636423	76 77
TBK029	TB459	081668	141x28.00		81820, 083012	62, 63
TBK030	TB245	GTB1207	143x25.40		082930, 083011/083014	43, 44
TBK031	TB224	636364	146x24.00		636422	50
TBK032	TB508	5636351	146x20.00		9158003/5636429/636727	32
TBK033	TB156	T0663544	148x25.40		7700722452	54
TBK035	TB320	081654	149x25.40		081819, 083014/083011	71, 44
TBK036	TB292	7700114128	151x25.40		7700726440, 7700733489/7700863111	51, 70
TBK037	TB368	0816E5	152x30.00		4740847, 4740846/99432547	11, 10
TBK038	TB258	7700727166	153x25.40		7700726440, 77007	51, 52
TBK039	TB701	0816A3	153x30.00		4740846/99432547, 4740846/99432547	10, 10
TBK040	TB337	5889260	168x22.00		7553564, 7553565	4, 5
TBK041	TB457	GTB2006	136x25.40		83014, 08293	44, 43
TBK042	TB103	1500991	123x25.40		1500004	9
TBK043	TB129	636357	104x15.00		5972277	8
TBK044	TB131	069109119A	119x25.40		069109243B	16
TBK045	TB135	4720777	152x30.00		4740847, 4740846/99432547	11, 10
TBK046	TB178	636360	147x24.00		90180131/636421	29
TBK047	TB189	7700696055	153x25.40		7700696986, 7700696987/7700708337	53, 56
TBK048	TB207	034109119	120x18.00		069109243B	16
TBK049	TB227	95496878	118x31.80		95495830/081817/081822	24
TBK050	TB201	6111516	98x19.10		6121780	27
TBK051	TB195	7700718752	124x19.00		7700720366, 77006	57, 56
TBK052	TB473	1356864011	177x25.40		13505-63020/63021, 13503-64020/64010	191, 14
TBK053	TB503	168060M900	76x19.00		13070-16A10/16A11	186
TBK054	TB177	95493977	62x19.00		5972277/082917	8
TBK055	TB197	SE021012012A	112x19.00		021012060A	59
TBK056	TB223	6138677	130x25.40		6121753/6121754	46
TBK057	TB101	073109119A	119x19.00		1496915	28



TB KIT COMPOSITION

Steuerriemensatz – Bestandteile • Contenuto kit cinghie di distribuzione
Composition des kits de courroie de distribution






Kit	Belt	OE 	Teeth  Width	OE 	
TBK058	TB102	7533266	122x19.00	1496915	28
TBK059	TB204	CAM9006	110x17.00	CAM9153	150
TBK060	TB302	2335632010	55x12.70	MD040754	205
TBK061	TB344	11311275973	138x28.50	11312241090	60
TBK063	TB250	4751143	153x30.00	4740846/99432547, 4740846/99432547	10, 10
TBK064	TB187	1356854050	130x25.40	13503-54020, 13505-54010	193, 192
TBK065	TB307	46461038	173x22.00	7596728, 7596727	61, 49
TBK066	TB505	027109119A	147x25.40	51109243	68
TBK067	TB268	2335642011	83x19.00	MD050125	208
TBK068	TB314	1356854070	129x31.00	13505-54020, 13503-54030	194, 195
TBK069	TB359	2431242101	163x25.40	MD050135	207
TBK070	TB317	FDU1466	107x24.00	14510-PM7-003/004	209
TBK071	TB295	CDU2749	143x23.00	CDU3558/LHP10015	151
TBK072	TB289	0K20112205	107x22.00	B630-12-700B/700C/700D	203
TBK074	TB242	11121721659	110x21.00	11311721245/11311721263, 11311708806/11311709646, 11311721264	38, 3, 2
TBK075	TB291	4301672	119x32.00	94382215/815971, 636383	217, 216
TBK076	TB506	037109119C	124x18.00	026109243/026109243E	15
TBK077	TB370	1056892	130x25.40	1C1Q6K254AA	110
TBK078	TB389	6711044	97x21.60	6182891	73
TBK079	TB390	1112531	131x25.40	6635941/928M6K254AC, 6635942/928M6M250BC	66, 67
TBK080	TB412	1680613C00	141x30.00	13070-05E10, 13074-05E10/05E11	184, 185
TBK081	TB509	5636355	176x24.00	636726/636737/5636738, 636418	30, 75
TBK085	TB660	46457061	108x15.00	5972277	8
TBK086	TB463	026109119B	121x18.00	026109243E	15
TBK087	TB466	030109119H	135x19.00	030109243 D/F//K	83
TBK088	TB467	032109119G	137x19.00	030109243D/F//K	83
TBK089	TB471	46400045	158x25.40	46416489, 4640005	86, 85
TBK090	TB489	2431242101	163x25.40	7700872531/7700873731, 7700862615	25, 133
TBK091	TB481	5636354	225x30.00	5636420/5636385, 636424/5636501	111, 112
TBK092	TB482	1680600QAM	87x17.00	7700736085	69
TBK093	TB657	028109119AC	137x23.00	028109243D/G	13
TBK094	TB608	46457742	193x24.00	7778565, 7763644	41, 78
TBK096	TB529	6001543400	96x17.00	7700273277	134
TBK097	TB292	7700114128	151x25.40	7700726440, 77008	51, 70
TBK098	TB258	7700727166	153x25.40	9110690, 09109609	52, 51
TBK099	TB546	7700100670	153x26.00	7700726440, 77001	51, 135
TBK100	TB552	06A109119B	138x23.00	06A109479/06A109479A/06A109479B/06A109479C	116
TBK101	TB554	06B109119A	150x23.00	06B109243, 06B109477	174, 128
TBK102	TB558	0816A4	154x30.00	4740846/99432547, 4740846/99432547	10, 10
TBK103	TB638	24451895	162x20.00	5636732/5636733, 5636416/5636426, 5636419/5636427	35, 89, 88
TBK104	TB639	46426983	190x24.00	7778565, 7763644	41, 87
TBK105	TB631	081693	140x25.40	9400829629, 94008	165, 166
TBK106	TB632	081696	141x25.40	9400829629, 94008	165, 166
TBK107	TB533	038109119	141x25.00	058109244, 038109244B/C/H, 038109244/F/G, 038109244E	93, 92, 126, 120
TBK108	TB242	11121721659	110x21.00	11311727611, 11311708806/11311709646, 11311721264	39, 3, 2
TBK109	TB506	037109119C	124x18.00	048109243A	37
TBK111	TB509	5636355	176x24.00	636726/636737, 636415, 636416	30, 31, 33
TBK112	TB657	028109119AC	137x23.00	028109243D/G, 028109244	13, 94
TBK113	TB479	081673	136x25.40	082935, 083014/083037, M10x25	84, 44
TBK114	TB546	7700100670	153x26.00	7700726440, 7700107249, 7700100671	51, 136, 135
TBK115	TB554	06B109119A	150x23.00	06B109477, 06B109243A	128, 115
TBK116	TB533	038109119	141x25.00	058109244, 038109244B/C/H, 038109244/F/G	93, 92, 126
TBK117	TB156	T0663544	148x25.40	7700871169	82
TBK118	TB303	5956125	142x18.00	7541718	12

Kit	Belt	OE 	Teeth 	Width	OE 	
TBK119	TB384	028109119D	137x25.40		028109243/B, 028109244	64, 94
TBK120	TB390	1112531	131x25.40		6635942/928M6M250BC, 6744307/928M6M250DC, 6635941/928M6K254AC	67, 69, 66
TBK121	TB496	1005824	116x22.00		1056697/1099552, 1040678/1099553, 1005822	104, 34, 1
TBK122	TB479	081673	136x25.40		082969, 083037/083014	102, 44
TBK123	TB156	T0663544	148x25.40		7700871169, 77007	82, 55
TBK207	TB528	55210627	163x24.00		60607965, 5519224	147, 100
TBK225	TB680	038109119L	120x30.00		045109244A, 045109243A	129, 124
TBK230	TB720	0816E6	114x25.40		83048, 082988	163, 164
TBK240	TB638	24451895	162x20.00		96413863, 96413864, 24426500	35, 113, 89
TBK246	TB634+TB658	036109119P+036109119Q	58+130x17+20,00		036109181A, 036109244C, 036109243AG, 036109243AB	119, 123, 118, 121
TBK260	TB780	24451896	169x20.00		5636415/5636419, 5636416/5636426, 5636732/5636733/5636740	88, 89, 35
TBK261	TB783	92063917	169x24.00		5636423/636415, 5636423/636415, 5636738/636726/636737	31, 31, 30
TBK262	TB743	03G109119	141x30.00		038109244J, 03G109244, 03G109243	161, 169, 173
TBK263	TB634+TB658	036109119P+036109119Q	58+130x17+20,00		036109244C, 036109181A, 036109243AB, 036109243F	119, 122, 118, 121
TBK267	TB636	8200537026	132x27.00		7700107150, 77001	138, 137
TBK269	TB680	038109119L	120x30.00		045109244A, 045109243A, 045109479B	129, 130, 124
TBK270	TB680	038109119L	120x30.00		038109244J, 038109243M	162, 161
TBK272	TB797	038109119M	141x25.00		038109244E, 058109244, 038109244B, 038109243F	126, 125, 93, 120
TBK273	TB713	8200344791	123x27.00		8200102941	156
TBK274	TB632	081696	141x25.40		83028, 082959	90, 91
TBK275	TB653	7700109601	132x26.00		4408922	141
TBK276	TB472	1004297	117x22.00		1039422	105
TBK277	TB649	46526291	129x15.00		81821	8
TBK278	TB681	1079390	91x9.52		1113174	167
TBK279	TB683	0816A1	153x25.40		83042, 082977	154, 153
TBK280	TB735	1680600QAP	151x25.40		7700733489, M343741	51, 70, 136
TBK281	TB421	7701468165	116x19.00		82910	23
TBK282	TB422	7701468166	118x19.00		82910	23
TBK283	TB639	46426983	190x24.00		55187100, 55183527, bolt, washer	41, 182
TBK284	TB232	21081006040	111x19.00		21051006118	65
TBK285	TB504	034109119A	147x19.00		54109479	152
TBK286	TB266	B63012205B	107x21.60		244102X000	203
TBK287	TB338	0060515034	100x17.00		534134, 534135	6, 7
TBK288	TB240	1653887	97x19.80		6182891	73
TBK289	TB316	06141PM3305	106x24.00		14510PM7003	209
TBK290	TB353+TB354	14400P4500	113+70x24+16,00		13404PT0003, 14510PT0003	212, 211
TBK291	TB518	2431221040	92x19.00		2441021010	204
TBK292	TB302+TB356	2335632010	55x12.70		2441032000, 23357	206
TBK293	TB280	0K95412205	168x25.40		0K95412730, 3895178	201, 202
TBK294	TB281	1140771C00	103x25.40		1281071C02	213
TBK295	TB371	3137439	135x25.40		3396014, 4132488	199, 200
TBK296	TB450	GTB1293XS	103x24.00		14510P08003	210
TBK297	TB451	104RU24B333	104x24.00		14510P08003	210
TBK298	TB458	96183352	127x25.40		96350526, 9635055	95, 215
TBK299	TB460	Z50112205	125x21.00		0K93812730, Z50112730, 9YJ6K254A	196, 197, 219
TBK300	TB470	7762910	134x18.00		55196971/7782192	47
TBK301	TB713	8200344791	123x27.00		8200102941	156
TBK302	TB724	0816G7	137x25.40		83048, 082988	164, 163
TBK303	TB678	0816A6	146x25.40		83028, 082962	91, 165
TBK304	TB744	0816G4	153x25.00		83042, 082977	154, 153
TBK305	TB384	028109119D	137x25.40		028109244, 028109243E	94, 74
TBK306	TB790	55183528	199x24.00		55187100, 5518352	182, 41
TBK307	TB366	2431222010	92x22.00		2441022000	214
TBK308	TB457	GTB2006	136x25.40		83046, 08293	170, 43



TB KIT COMPOSITION

Steuerriemensatz – Bestandteile • Contenuto kit cinghie di distribuzione
Composition des kits de courroie de distribution

Kit	 Belt	OE 	Teeth  Width	OE 	
TBK309	TB463	026109119B	121x18.00	026109243J	45
TBK310	TB472	1004297	117x22.00	1004409	103
TBK311	TB489+TB490	2431242101	163+99x25,4+19,00	2431742000, 23357	208, 207
TBK312	TB711	0816F2	104x17.00	82990	168
TBK313	TB637	46403659	124x22.00	46403679	101
TBK314	TB676	46736501	125x15.00	81821	8
TBK315	TB712	1172000QA0	95x23.40	8200035827	139
TBK316	TB699	0816F0	100x17.00	82990	168
TBK317	TB491	96352965	107x25.40	94580139	96
TBK318	TB700	081685	134x25.40	83020, 082982	148, 149
TBK319	TB700	081685	134x25.40	0829A1, 0829A0	175, 176
TBK320	TB466	030109119H	135x19.00	030109243L	158
TBK321	TB733	21081006040	111x19.00	21081006120	98
TBK322	TB756	13028AW300	133x26.00	8200071267	183
TBK323	TB654	4402638	153x26.00	7700116054, 77001	140, 99
TBK325	TB537	2431226000	105x22.00	2481026010, 2441	218, 214
TBK326	TB633	1000156	129x25.40	10383384, 1053942, 1000159	108, 109, 106
TBK327	TB633	1000156	129x25.40	1095025, 1000159	107, 106
TBK328	TB730	2431202701	101x20.00	2441002510	220
TBK329	TB639	46426983	190x24.00	55187100, 5518352	182, 41
TBK330	TB555	058109119B	153x25.00	058109244, 058109243C	93, 114
TBK331	TB555	058109119B	153x25.00	058109244, 058109243C, 058109479B	93, 114, 144
TBK332	TB555	058109119B	153x25.00	058109244, 058109243D	93, 157
TBK333	TB555	058109119B	153x25.00	058109244, 058109243D, 058109479B	93, 157, 144
TBK334	TB629	1049653	130x28.00	1136426/1C106K254AA	110
TBK335	TB384	028109119D	137x25.40	028109244, 028109243K	94, 159
TBK336	TB813	9646864480, 0816H5 , 0816G8	135x25.40	083052, 0829A5	171, 178
TBK337	TB241	11311713361	127x25.40	11311711153	19
TBK338	TB742	0816G3	116x25.00	083051, 0829A3	181, 177
TBK339	TB679	2431222611	110x22.00	2441022000	214
TBK340	TB731	Z50212205	123x22.00	0K93812730, 9YJ6K254A	197, 196
TBK341	TB554	06B109119A	150x23.00	06B109244, 06B109243B	155, 131
TBK342	TB294	0K20312205	145x22.00	0K93812730, 9YJ6K254A	197, 196
TBK343	TB398	FP0112205	133x25.40	3396014, FP0112700	200, 198
TBK344	TB454	081669	114x25.40	82935	84
TBK345	TB559	55210626	166x24.00	60607965, 5519224	147, 100
TBK346	TB538+TB354	06141POA305	112+70x24+16,00	13404PT0003, 14510PT0003	212, 211
TBK347	TB640	GTB1497XS	261x26.00	LHP100900L	172
TBK348	TB738+TB641	059198119+059130113	207+87x30+ 25,00	059109244A, 059109243D, 059109243F	143, 142, 160
TBK350	TB725	46791189	198x24.00	55187100, 5518352	182, 41
TBK352	TB608	46457742	193x24.00	71736493, 5518352	87, 41
TBK353	TB556	078109119C	253x30.00	078109244H, 078109487A, 078109243Q, 078109479E	117, 146, 125, 127
TBK354	TB738+TB641	059198119+059130113	207+87x30+25,00	059109244A, 059109487A, 059109243D, 059109243F, 059109479B	143, 145, 142, 160, 132
TBK355	TB678	0816A6	146x25.40	0829C4, 0829C3	180, 179
TBK356	TB468	55210628	168x24.00	60607965, 55192239	147, 42
TBK357	TB556	078109119C	253x30.00	078109244H, 078109243Q	117, 125
TBK358	TB642+TB641	059109119A+059130113A	207+87x32+ 25,00	059109244A, 059109243F, 059109243D	143, 160, 142
TBK359	TB263	1356811050	123x24.00	1350310011, 1350511010	190, 189
TBK360	TB311	1356803010	163x26.70	1350363010, 1350574010	188, 187

TB KIT IMAGES

Steuerriemensatz – Bilder • Immagini kit cinghie di distribuzione
Images des kits de courroie de distribution



1



2



3



4



5



6



7



8



9



10



11



12



13



14



15



16



17



18



19



20



21



22



23



24



25



26



27



28



29



30



31



32



33



34



35



36




37



38



39

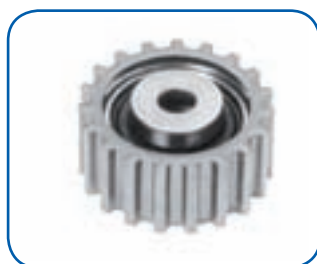

40



TB KIT IMAGES

Steuerriemensatz – Bilder • Immagini kit cinghie di distribuzione
Images des kits de courroie de distribution



41



42



43



44



45



46



47



48



49



50



51



52



53



54



55



56



57



58



59



60



61



62



63



64



65



66



67



68



69



70



71



72



73



74



75



76



77



78



79



80



TB KIT IMAGES

Steuerriemensatz – Bilder • Immagini kit cinghie di distribuzione
Images des kits de courroie de distribution



81



82



83



84



85



86



87



88



89



90



91



92



93



94



95



96



97



98



99



100



101



102



103



104



105



106



107



108



109



110



111



112



113



114



115



116



117



118



119



120



TB KIT IMAGES

Steuerriemensatz – Bilder • Immagini kit cinghie di distribuzione
Images des kits de courroie de distribution



121



122



123



124



125



126



127



128



129



130



131



132




133



134



135

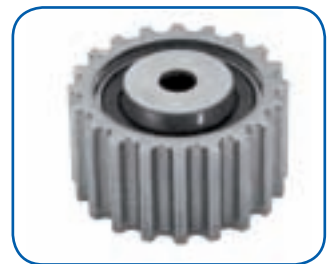

136



137



138



139



140



141



142



143



144



145



146



147



148



149



150



151



152



153



154



155



156



157



158



159



160



TB KIT IMAGES

Steuerriemensatz – Bilder • Immagini kit cinghie di distribuzione
Images des kits de courroie de distribution



161



162



163



164



165



166



167



168



169



170



171



172



173



174




175



176



177

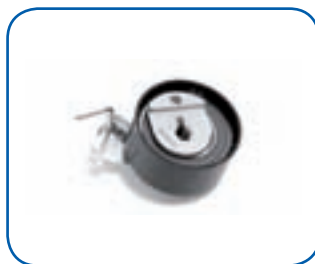

178



179



180



181



182



183



184



185



186



187



188



189



190



191



192



193



194



195



196



197



198



199



200



TB KIT IMAGES

Steuerriemensatz – Bilder • Immagini kit cinghie di distribuzione
Images des kits de courroie de distribution



201



202



203



204



205



206



207



208



209



210



211



212



213



214



215



216



217







218







219







220





OE		OE		OE		OE	
ALFA ROMEO		...ALFA ROMEO		...ALFA ROMEO		...ALFA ROMEO	
101947	SVB10888	55350421	MVB1550R5	60617858	MVB1083R7	60812429	MVB915R5
107037	SVB10875	55556430	MVB1588R6	60617859	MVB1952R7	60812430	MVB985R5
107037B	SVB10875	60503994	SVB10865	60617860	MVB1045R6	60812494	MVB1045R6
108017	SVB10875	60504835	SVB10850	60617861	MVB1045R6	60812714	MVB1952R7
110259	SVB10850	0060512902	SVB10790	60617862	MVB1842R6	60813203	TB532
130564	SVB101150	60512902	SVB10790	60617863	MVB1842R6	60813206	MVB1995R6
133481	SVB10865	60513081	SVB10750	60618584	MVB1969R7	60813505	MVB1105R6
134458	SVB10850	60513155	SVB13975	60618726	TB532	60813506	MVB1035R6
4176009	SVB131250	60513156	SVB13975	60620887	TB732	60813720	MVB1740R6
7552380	SVB10775	60513236	SVB131050	60625128	TB528	60813757	MVB1842R6
7574198	SVB10840	60513237	SVB131050	60625129	TB559	60814032	MVB1842R6
7609091	SVB10913	60513447	SVB13800	60625130	TB468	60814319	TB468
7614999	TB579	60513448	MVB825R5	60625590	MVB975R6	60814616	MVB1760R6
7621256	SVB13875	60513449	MVB985R5	60626658	MVB1995R6	60814847	MVB1035R6
7627908	SVB13850	0060513478	MVB1100R5	60630741	MVB1980R6	60815189	MVB1842R6
7629031	MVB906R5	60513478	MVB1100R5	60630747	MVB1855R6	60815621	MVB1842R6
7629229	MVB915R5	0060513614	SVB10625	60652358	MVB1969R7	60815666	MVB1775R6
7629235	SVB13750	60513614	SVB10625	60653027	MVB1025R6	60815805	MVB1795R6
7655543	SVB13850	60513650	SVB10825	60653028	MVB1842R6	60815887	MVB1842R6
7659062	TB474	60513663	SVB131025	60653029	MVB1065R6	60815889	MVB1045R6
7702169	MVB1050R5	60517424	SVB10875	60653030	MVB1960R6	60816054	MVB1842R6
7702740	MVB1035R5	60518176	SVB10840	60656340	TB528	60816055	MVB1795R6
7703305	SVB10725	60523210	SVB10650	60656341	TB559	60816661	MVB1760R6
7706132	MVB970R5	60524560	SVB101150	60656342	TB468	71712677	MVB2050R7
7710579	TB468	60533516	SVB101100	60662969	MVB1080R6	71719007	MVB985R5
7722331	TB607	60533611	SVB13710	60662991	MVB1855R6	71719394	MVB1842R6
7749145	MVB938R5	60534411	SVB10825	60663242	MVB1995R6	71719395	MVB1795R6
7766684	MVB1035R6	60534466	SVB13850	60666949	MVB1045R6	71719407	MVB970R5
7774591	TB474	60534566	SVB13925	60666950	MVB1842R6	71719648	TB468
7776571	SVB10725	0060542280	MVB1115R7	60670506	TB468	71719649	TB528
8517174	SVB13675	60543218	MVB885R4	60672888	TB528	71719650	TB559
46403659	TB637	60547821	SVB10825	60674528	TB532	71719651	TB639
46426983	TB639	60548814	SVB13950	60674888	TB528	71719738	MVB663R4
46439000	MVB1105R6	60551888	MVB960R4	60674890	TB468	71731639	TB639
46444537	MVB1740R6	60554148	MVB938R5	60676136	MVB1065R6	71732372	MVB1960R6
46474061	MVB1045R6	60555044	SVB13975	60676137	MVB1025R6	71732386	MVB1065R6
46474062	MVB1842R6	60556707	SVB10865	60704054	SVB13800	71734715	MVB1760R6
46479557	MVB1760R6	60558595	SVB10750	60800098	SVB10840	71734716	MVB1740R6
46510517	SVB101025	60559574	SVB131050	60800269	SVB10913	71736710	MVB2050R7
46510534	SVB101100	60560616	MVB1015R5	60800317	SVB10775	71736725	TBK345
46527337	MVB1775R6	60561247	MVB1969R7	60800359	SVB101090	71736726	TBK283
46540546	MVB1035R6	60566058	MVB648R4	60800454	SVB10840	71736727	TBK356
46555974	MVB1795R6	60566089	MVB800R5	60801493	SVB10825	71736729	TBK207
46749665	MVB1842R6	60567578	MVB1285R5	60805193	MVB1100R4	71736795	TBK104
46759720	MVB1842R6	60568842	MVB1240R7	60805194	SVB13850	71739605	SVB13750
46769821	MVB1755R6	60571125	MVB962R6	60805195	SVB13875	71739622	MVB1100R5
46787906	MVB1740R6	60573075	MVB1180R7	60805196	SVB13750	71739623	MVB960R4
46787907	MVB1760R6	60574777	SVB10775	60806472	SVB13850	71739873	TB741
46791189	TB725	60574816	SVB10813	60806474	SVB13750	71739905	MVB938R5
51768740	MVB2145R6	60575209	MVB763R4	60807260	TB579	71739915	MVB1842R6
51780011	MVB2145R6	60585396	MVB1015R5	60807261	MVB1035R5	71749454	MVB2050R7
053121039	SVB10888	60590385	MVB2050R7	60807358	MVB1050R5	76515588	MVB970R5
55183528	TB790	60591813	SVB10825	60807651	SVB10913	82404106	SVB10825
55185077	MVB1180R6	60595446	MVB1715R7	60808219	MVB763R4	164035011	SVB10840
55186364	MVB1740R6	60596949	MVB1000R5	60808385	MVB1240R7	1040002103	SVB10710
55189684	MVB1740R6	60597250	MVB875R5	60808684	MVB906R5	9400831279	TBK020
55189687	MVB1760R6	60597794	MVB1715R7	60808685	SVB10725	9400831409	TBK106
55192896	TB639	60604835	MVB1715R7	60808793	MVB970R5	9400831489	TBK113
55193360	MVB1580R6	60604889	TB703	60809019	MVB763R4	9400831589	TBK105
55201362	MVB1740R6	60606518	MVB865R5	60809415	TB474	9400831629	TBK106
55202621	MVB1318R6	60606519	MVB865R5	60810821	SVB10725	9467538580	TBK106
55210626	TB559	60607387	MVB1083R7	60811136	TB468	10200210300	SVB10840
55210627	TB528	60607950	MVB1952R7	60812344	TB468	105000210300	SVB10725
55210628	TB468	60607967	TB559	60812382	TB732	105121010300	SVB131250







OE		OE		OE		OE	
...ALFA ROMEO		...AUDI		...AUDI		...AUDI	
105140210300	SVB10840	03L903137A	MVB1580R6	028145271F	SVB10900	038903137I	MVB1660R6
105481010301	SVB101250	06A109119B	TB552	028198119	TBK024	045109119D	TB726
105560216300	SVB10775	06A109119C	TB552	028198119A	TBK025	045109119E	TB726
106000210302	SVB13850	06A145933D	MVB1125R6	028198119B	TBK119	045109119L	TB726
113150210300	SVB10840	06A198119	TBK100	028198119C	TBK026	045903137D	MVB1000R6
115881010302B	MVB938R5	06A198119B	TBK115	028198119D	TBK335	045903137E	MVB860R6
116100210300	SVB10813	06A260849	MVB1200R6D	028260849A	MVB1180R6	046109119	TB785
116100210300	SVB10825	06A260849C	MVB1200R6D	028260849F	MVB1180R6	046109119E	TB785
116680210300	SVB10850	06B109119A	TB554	028903137AJ	MVB1588R6	046130113	TB374
116760210300	SVB101025	06B109119B	TB554	028903137AK	MVB890R6	046130113A	TB374
116761010306	SVB13710	06B109119F	TB554	028903137AR	MVB1588R6	046130113C	TB374
117010210300	SVB10825	06B145933	MVB1080R6	028903137K	MVB890R6	046145271	SVB10800
117020210300	SVB101100	06B198119	TBK115	030198119A	TBK087	046145271A	SVB10900
117020210301	SVB101100	06B198119A	TBK341	032198119	TBK088	046198113	TB374
117022383400	SVB10650	06B260849A	MVB855R4	034109119A	TB504	046260849B	SVB13950
117131010300	SVB13850	06B903137	MVB1300R5	034260849	SVB13925	046903137A	MVB1325R6
119000210300	SVB10925	06B903137C	MVB1588R6	034260849B	SVB13925	046903137M	MVB1725R6
119001020700	SVB10875	06B903137D	MVB1588R6	034260849E	SVB131025	046903137N	MVB1335R6
119280210300	SVB10925	06B903137E	MVB1300R5	034903137	SVB10825	048109119D	TB506
162060710300	SVB101100	06B903137J	MVB1570R6	034903137	SVB12825	048903137	SVB10900
195112320200A	SVB10790	06C109119C	TB754	034903137A	SVB10825	049260849A	SVB13825
195112320300	SVB10790	06C903137C	MVB1930R6	034903137A	SVB12825	049903137A	SVB10950
195170710300	SVB10825	06C903137E	MVB1885R6	034903137B	MVB885R4	049903137B	SVB10950
195172383400	SVB131125	06D109119	TB745	035145271C	SVB131025	049903137D	SVB10940
195202710300	SVB13925	06D109119B	TB753	035145271E	SVB131025	050121039A	SVB10913
195320510300	SVB10750	06D903137C	MVB1570R6	035145271F	SVB131000	050260849	SVB13800
195320710301	SVB13975	06D903137E	MVB1570R6	035145271F	SVB131025	050903137	SVB10950
195322710300	SVB131050	06E903137A	MVB2415R6	035145271G	SVB10975	050903137A	SVB10950
195510510304	MVB825R5	06E903137C	MVB2460R6	035145271J	SVB10960	050903137B	MVB855R4
195510510305	MVB985R5	06E903137J	MVB2415R6	035260849A	SVB13900	050903137C	MVB855R4
195510510308	SVB13800	06E903137N	MVB2440R6	035260849A	SVB13925	051198119	TBK086
195510710300	MVB1100R5	06F198119A	TBK351	035260849C	SVB131000	052903137	SVB10700
195590710300	SVB10625	06F260849E	MVB1045R6	035260849G	SVB13925	052903137A	SVB10700
195592320300	SVB10825	06F260849L	MVB1050R6	035903137A	SVB10800	053121039	SVB10888
195592710300	SVB131025	06F903137E	MVB900R6	035903137B	SVB10800	053121039A	SVB10875
VM46510541A	SVB10825	06H903137C	MVB1588R6	035903137C	SVB10790	053121039A	SVB10888
VM46510552A	MVB1115R7	06J260849D	MVB1115R6	035903137E	SVB10800	053903137	SVB10900
VM46510586F	MVB1715R7	6K0198001A	TBK087	036109119P	TB634	053903137A	MVB885R4
VM46510591F	MVB2050R7	6K0198001B	TBK086	036109119Q	TB658	054109119A	TB504
VM46510600F	MVB1715R7	6K0198001D	TBK088	036145933AG	MVB736R6	054109119E	TB333
ALPINE		6Q0260849C	MVB1740R6	036145933AJ	MVB1080R6	054109119G	TB504
8517174	SVB13675	6Q0903137A	MVB1088R6	036145933F	MVB1088R6	054109119H	TB333
0855676000	SVB10725	07K145933R	MVB938R5	036145933M	MVB750R6	054903137	SVB10865
6000002810	SVB10675	07L903137C	MVB950R5	036198119A	TBK246	054903137	SVB12865
6000003202	SVB10675	07L903137E	MVB1135R5	037198119	TBK076	054903137A	MVB1285R6
6000003312	SVB10675	07L903137M	MVB950R5	038109119	TB533	054903137B	MVB1690R6
6001023554	MVB1725R5	022145933N	MVB1238R6	038109119B	TB533	054903137D	SVB10875
7700268230	SVB101250	022145933T	MVB1625R6	038109119D	TB533	054903137E	MVB1285R6
7700268232	SVB101250	026109119B	TB463	038109119L	TB680	054903137F	MVB1690R6
7700503052	SVB10850	026109119D	TB463	038109119M	TB797	055260849E	SVB131025
7700549230	SVB101225	026145271	SVB10735	038109119N	TB680	055903137G	SVB10850
7700565018	SVB10725	026260849A	SVB13800	038109119P	TB680	056903137	SVB10950
11281437929	MVB1550R6	026903137C	SVB10950	038109119S	TB680	057109119G	TB759
11287539831	MVB1550R6	027109119A	TB505	038198119	TBK225	057903137C	MVB2613R6
ARO		027109119C	TB505	038198119A	TBK270	058109119A	TB464
7700321502	SVB101225	027903137A	SVB10865	038198119D	TBK107	058109119B	TB555
AUDI		027903137A	SVB12865	038198119E	TBK272	058109119C	TB555
1L0198002A	TBK026	028109119AA	TB384	038198119F	TBK116	058109119D	TB464
03G109119	TB743	028109119D	TB384	038260849	MVB835R4	058145271	SVB12528
03G198119	TBK262	028109119J	TB384	038260849A	MVB835R4	058198119A	TBK332
03G903137A	MVB946R6	028109119K	TB384	038903137	MVB906R6	058198479	TBK331
03G903137B	MVB1050R6	028109119M	TB384	038903137E	MVB1660R6	058198479A	TBK333
03G903137E	MVB1613R6	028109119P	TB384	038903137G	MVB906R6	058260849	MVB855R4
03L903137	MVB1065R6	028109119S	TB384	038903137H	MVB1432R5	058260849A	MVB855R4





OE		OE		OE		OE	
...AUDI		...AUDI		...AUSTIN		...AUSTIN	
058903137B	MVB1300R5	078198119	TBK357	14400P45010	TB353	ERC304	SVB10913
058903137C	MVB1300R5	078198479	TBK353	14400PH7004	TB312	ERC0400	SVB13850
058903137E	MVB1300R5	078903119A	TB373	31110PA13420	SVB10950	ERC657	SVB13925
059109119A	TB642	078903137	MVB1675R6	56992PL20030	SVB101075	ERC675	SVB13925
059109119B	TB738	078903137AJ	MVB1904R6	56992PL26610	SVB101075	ERC1347	SVB13850
059109119C	TB555	078903137AN	MVB1635R6	56992PP2E010	SVB10888	ERC1742	SVB131050
059109119D	TB760	078903137AP	MVB1760R6	151209	SVB10913	ERC2774	SVB13850
059119137	SVB101025	078903137AQ	MVB1865R6	151515	SVB10900	ERC4272	SVB13800
059119137A	SVB101025	078903137AR	MVB1875R6	156489	SVB101100	ERC5146	SVB13750
059130113	TB641	078903137BC	MVB1875R6	201403	SVB101050	ERC5836	SVB101125
059130113A	TB641	078903137BD	MVB1875R6	212683	SVB101125	ERC6072	SVB13925
059198119	TBK348	078903137BH	MVB1740R6	214239	SVB101100	ERC6504	SVB101025
059198119B	TBK348	078903137BJ	MVB1875R6	214239	SVB101113	ERC6886	SVB101025
059260849B	MVB1238R4	078903137BL	MVB1855R6	214303	SVB101025	ERC8852	SVB10775
059260849D	MVB1215R4	078903137BM	MVB1740R6	214314	SVB101113	ERC8938	SVB101050
059903137	SVB10875	078903137C	MVB2280R6	214325	SVB101100	ERR0810	SVB131025
059903137AB	MVB2440R6	078903137F	MVB1685R6	214830	SVB101125	ERR1092	TB478
059903137P	MVB2440R6	078903137K	MVB2265R6	216632	SVB10888	ERR2073	SVB10675
059903137T	MVB2490R6	078903137P	MVB2265R6	217391	SVB101100	ETC4266	SVB10710
063903137	SVB13900	079903137A	MVB1110R5	217607	SVB10950	ETC4267	SVB10675
068121039C	SVB10610	079903137AA	MVB1110R5	219560	SVB10813	ETC4272	SVB13800
068121039E	SVB10690	079903137AB	MVB1120R5	247920	SVB10913	ETC4705	SVB10675
068121039G	SVB10610	079903137S	MVB1165R5	247939	SVB10950	ETC5815	SVB13725
068121039M	SVB10900	079903137T	MVB1135R5	511963	SVB10950	ETC7394	SVB101215
068121039Q	SVB10635	0775300490009	SVB101125	513907	SVB10888	ETC7469	SVB10610
068260849	SVB13950	0775300590009	SVB10735	522704	SVB10825	ETC7899	SVB10675
068260849B	SVB13950	AUSTIN		524200	SVB101050	ETC7939	SVB101025
068903137AC	SVB10760	1G2716	SVB10900	527288	SVB101050	ETC8550	TB365
068903137AF	SVB10600	1H1001	SVB10900	563132	SVB101025	ETC9002	SVB131200
068903137AP	SVB10710	2A414	SVB10813	563132	SVB101050	ETC9009	SVB131350
068903137B	SVB10875	2A801	SVB10813	574046	SVB10888	ETC9019	SVB131175
068903137C	SVB10600	3H2134	SVB17850	596433	SVB10900	ETC9080	SVB13875
068903137F	SVB10735	12B307	SVB131225	602319	SVB101150	FDU1464	TB272
068903137F	SVB10740	13H1329	SVB10865	603713	SVB13850	FDU1466	TB317
068903137J	SVB10775	13H1448	SVB131125	611612	SVB131000	GCB10700	SVB10700
068903137Q	SVB10740	13H1840	SVB131075	613602	SVB101225	GCB10706	SVB10710
068903137S	SVB10775	13H3726	SVB101050	614106	SVB13925	GCB10715	SVB10710
069145107	SVB10600	13H3820	SVB10888	614670	SVB131000	GCB10813	SVB10813
069145271	SVB131050	13H389	SVB10813	2014034	SVB101050	GCB10825	SVB10825
069903137C	SVB10800	13H4366	SVB10888	46510585A	SVB10740	GCB10914	SVB10925
074109119A	TB785	13H4583	SVB10888	88156489	SVB101100	GCB10937	SVB10940
074109119B	TB785	13H4706	SVB10850	AAU3550	SVB10800	GCB10950	SVB10950
074109119E	TB785	13H480	SVB131150	AAU3577	SVB10825	GCB50765	SVB10750
074109119F	TB375	13H503	SVB10925	AAU8072	SVB10875	GFB101	SVB10925
074109119H	TB375	13H5373	SVB10825	ADU4236	SVB10825	GFB102	SVB10813
075260849	SVB13875	13H589	SVB10813	ADU6528	SVB10940	GFB103	SVB10900
076109119A	TB797	13H6869	SVB101050	ADU7785	MVB825R4	GFB104	SVB10825
076903137	SVB10813	13H7104	SVB101175	ADU7786	MVB960R4	GFB105	SVB101113
077109119B	TB604	13H760	SVB101113	ADU8912	SVB10710	GFB120	SVB10865
077109119D	TB604	13H7975	SVB101050	ADU9401	SVB101050	GFB121	SVB10850
077109119E	TB604	13H8309	SVB10888	AEA489	SVB10900	GFB122	SVB101113
077903137D	MVB2440R6	13H8310	SVB10900	AEC932	SVB101113	GFB122	SVB101125
077903137G	MVB2475R6	13H8389	SVB10813	AEH473	SVB10975	GFB124	SVB101025
077903137H	MVB2475R6	13H859	SVB10813	AEH621	SVB10975	GFB124	SVB101050
077903137K	MVB2680R6	13H923	SVB10900	AEJ63	SVB10850	GFB127	SVB10888
077903137M	MVB2613R6	13H924	SVB10940	AHU2174	MVB885R4	GFB128	SVB131075
077903137Q	MVB2680R6	13H9620	SVB10950	CAM7910	SVB10950	GFB136	SVB10975
077903137R	MVB2613R6	17D29	SVB131175	CAM9989	SVB10710	GFB142	SVB101100
078109119A	TB373	17H760	SVB101100	CDU2749	TB295	GFB144	SVB101275
078109119C	TB556	2614A026	SVB10925	CFB10825	SVB10825	GFB145	SVB10975
078109119D	TB373	13405PP0004	TB354	DBP4131	TB203	GFB147	SVB131175
078109119G	TB556	14400P14004	TB378	DBP9289	TB203	GFB165	SVB101050
078109119H	TB556	14400P4500	TB353	ECP244	TB312	GFB168	SVB101025
078109119J	TB556	14400P45000	TB353	ERC0026	SVB131175	GFB170	SVB101125







OE		OE		OE		OE	
...AUSTIN		...AUSTIN		...AUTOBIANCHI		BMW	
GFB176	SVB10888	GMB40890	MVB885R4	4224377	SVB10825	0586236	SVB10950
GFB176	SVB10900	GTB1208	TB312	7535218	SVB10675	1721408	SVB101025
GFB182	SVB10888	GTB1233	TB317	7554701	TB129	1727136	SVB10725
GFB183	SVB10825	GTB1237	TB272	7610944	SVB10675	1727378	MVB855R4
GFB185	SVB10813	GTB1238	TB295	7619418	SVB10675	1734608	TB242
GFB189	SVB131075	GTB1238XS	TB295	7636448	MVB673R3	8502320	SVB10825
GFB192	SVB10825	GTB1253	TB234	7704978	MVB673R4	8502323	SVB10750
GFB193	SVB10813	GTB1253XS	TB234	8504135	SVB171320	9990150	SVB10850
GFB195	SVB10825	GTB1283XS	TB295	86842225	SVB171500	9990155	SVB10875
GFB196	SVB10888	GTB1289	TB367	0868040001	SVB171055	0711999175	SVB131050
GFB205	SVB10950	GTB1290	TB378	AVIA		07119990150	SVB10850
GFB206	SVB10950	GTB1291	TB353	007017	SVB10975	07119990151	SVB10825
GFB209	SVB101100	GTB1292	TB354	007026	SVB101000	07119990161	SVB10950
GFB211	SVB101225	GTB1293XS	TB450	0070108	SVB131250	07119990174	SVB131025
GFB212	SVB10950	GTB1497XS	TB640	0070113	SVB131375	07119990175	SVB131050
GFB213	SVB101100	GTB2003	TB477	BEDFORD		07119990178	SVB101125
GFB214	SVB10913	GTB2004	TB513	1340671VBELT	SVB10900	07119990181	SVB101075
GFB215	SVB131175	GTB2005	TB353	2687545	SVB101140	11212721659	TB242
GFB216	SVB13850	GTB2005XS	TB353	2688824	SVB10913	11211258120	SVB10975
GFB243	SVB131075	GTB2006	TB457	6322716	SVB10925	11221706788	SVB131050
GFB246	SVB101050	GTB2016XS	TB317	6352976	SVB10960	11231266125	SVB10950
GFB248	SVB101100	GTB2017XS	TB534	6355813	SVB10925	11231279479	SVB101000
GFB249	SVB10950	GTB2018XS	TB547	6376167	SVB10950	11231315137	SVB131050
GFB250	SVB10950	GTB2019XS	TB650	6376168	SVB10975	11231315353	SVB131000
GFB251	SVB10813	GTB9003XS	TB534	7180684	SVB101000	11231706668	SVB131050
GFB252	SVB10825	GTB9005	TB651	7180685	SVB10950	11231706788	SVB131050
GFB255	SVB10950	IG2716	SVB10900	7180686	SVB10975	11231709636	SVB10865
GFB258	SVB101050	IH1001	SVB10900	7184116	SVB101375	11231709638	SVB10865
GFB259	SVB13925	LHN10013	TB560	7184180	SVB101000	11231716201	SVB131050
GFB260	SVB10710	LHN10015	TB560	8825967	SVB10960	11231717952	SVB101010
GFB262	SVB10975	LHN10016	TB367	8835134	SVB101140	11231721408	SVB101025
GFB272	SVB10940	LHN100040	TB650	8835135	SVB131200	11232241172	SVB101000
GFB273	SVB10875	LHN100310B	TB560	8835402	SVB10913	11232242209	SVB13825
GFB303	SVB131000	LHN100390	TB534	8851716	SVB10950	11232243046	SVB101000
GFB357	SVB101050	LHN100400	TB547	8851717	SVB10913	11281247284	MVB1660R6
GFB362	SVB10710	LHN100560	TB640	8854515	SVB131200	11281247986	MVB1660R6
GFB369	SVB101075	LHN100760	TB651	90091742	SVB10888	11281401157	MVB1513R6
GFB370	SVB101075	MVF100040	TB650	90091743	SVB10900	11281401159	MVB1120R5
GFB376	SVB10700	PQS10037	SVB10740	91010950	SVB101375	11281401162	MVB788R5
GFB700	SVB10888	RKC5233	SVB10925	91073827	SVB101375	11281404018	MVB1513R6
GFB701	SVB10940	TCK0366	SVB10900	91073828	SVB101400	11281427250	MVB1550R6
GFB10706	SVB10710	TKC386	SVB10900	91078110	SVB101237	11281432724	MVB1635R7
GFB10725	SVB10710	TKC1616	SVB101100	91112347	SVB10750	11281433948	MVB950R5
GFB10775	SVB10775	TKC2165	SVB101100	93891553	SVB10750	11281435280	MVB1000R5
GFB10813	SVB10800	TKC2444	SVB13925	93891618	SVB13900	11281437368	MVB1550R6
GFB10813	SVB10813	TKC2802	SVB10940	93891628	SVB131025	11281437369	MVB1740R6
GFB10825	SVB10825	TKC6621	SVB101100	94111624	SVB131500	11281437449	MVB906R5
GFB10875	SVB10875	TRC2801	SVB10975	94111687	SVB13875	11281437450	MVB865R5
GFB10900	SVB10900	UAM1058	SVB10700	94141721	SVB131025	11281437475	MVB1538R6
GFB10950	SVB10950	UE31113RR	SVB101275	94218574	SVB131025	11281437872	MVB865R5
GFB10975	SVB10975	UE31855RR	SVB10975	94218575	SVB131375	11281437873	MVB906R5
GFB11044	SVB101050	WAM2804	TB234	94221435	TB522	11281437874	MVB950R5
GFB11065	SVB101050	XHM460	TB312	94222880	SVB13900	11281437875	MVB885R4
GFB20864	SVB13850	AUTOBIANCHI		94225209	SVB13875	11281437880	MVB1740R6
GFB21075	SVB131075	109937	SVB171320	94232287	SVB10760	11281437929	MVB1550R6
GFB50949	SVB10950	987107	SVB10775	94240372	SVB171055	11281438276	MVB1538R6
GFB60825	SVB10825	4028501	SVB10975	94256977	SVB10665	11281703561	MVB1550R6
GFB60937	SVB10940	4037771	SVB10800	94257037	SVB131000	11281703943	MVB887R5
GFB61038	SVB101050	4060534	SVB10750	94411860	SVB13900	11281703944	MVB906R5
GFB80760	MVB763R4	4156930	SVB10750	94449169	TB522	11281704719	MVB1035R7
GFB80823	MVB825R4	4156931	SVB10800	8941751700	SVB13875	11281706545	MVB1538R6
GFB80890	MVB885R4	4156931	SVB10813	8942322841	SVB13875	11281710958	MVB1190R6
GFB90790	MVB788R5	4164623	SVB10790	8942322872	SVB10760	11281715636	MVB1165R5
GFB90890	MVB887R5	4170927	SVB101075	8942323100	SVB13950	11281715770	MVB1080R6





OE		OE		OE		OE	
...BMW		...BMW		...BMW		...CHEVROLET	
11281725731	MVB1080R6	11287795601	MVB1685R6	64521304393	SVB131050	96814098	TB458
11281726689	MVB1550R6	11287796396	MVB1760R7	64521354948	SVB13800	2123104102010	MVB1885R5
11281726690	MVB887R5	11287800485	MVB1795R6	64521706826	SVB13800	CHRYSLER	
11281729211	MVB1150R6	11287802186	MVB1550R6	64521711056	SVB13800	1340A005	MVB938R5
11281735190	MVB1560R6	11287803476	MVB1885R6	64521722371	SVB13850	4027330	SVB101060
11281735194	MVB1560R6	11287830946	MVB830R5	64551716960	SVB13825	4060987	MVB2510R6
11281735195	MVB1570R6	11287832327	MVB1460R5	64551717954	SVB13850	4298096	MVB763R4
11281736717	MVB1080R6	11287833264	MVB1635R7	64551722990	SVB13825	4298097	SVB101237
11281736759	MVB975R5	11287833266	MVB975R5	64551727378	MVB855R4	4298115	MVB1040R4
11281736986	MVB1605R7	11287835483	MVB1088R6	64551734669	SVB13900	4315444	SVB101050
11281736988	MVB975R5	11287837898	MVB1460R5	64551739470	MVB885R4	4343490	SVB101090
11281738988	MVB906R5	11287838200	MVB1065R6	64552243732	MVB775R4	4343523	SVB101200
11281739470	MVB885R4	11287841529	MVB1100R6	64552245179	MVB790R4	4343524	SVB101215
11281739816	MVB1740R6	11311268697	SVB10975	64552245451	MVB775R4	4343524	SVB101225
11281741427	MVB1200R6	11311721699	TB242	64552245850	MVB835R4	4343824	TB562
11281742012	MVB1605R7	11311734608	TB242	64552246732	MVB775R4	4343946	TB561
11281742029	MVB1000R5	11341721274	TB242	64552247183	MVB836R5	4387534	TB563
11281742475	MVB1635R7	11511706710	SVB10960	64552247425	MVB813R5	4387549	TB272
11281743193	MVB885R4	11721312977	SVB13975	64552248190	MVB1120R5	4448639	MVB1815R5
11281744986	MVB865R5	11721315356	SVB13975	64557785212	MVB970R4	4483174	MVB975R4
11281747922	MVB1035R7	12311254121	SVB10875	64557786170	MVB813R5	4483204	SVB10990
11282243732	MVB775R4	12311254122	SVB10850	64557786171	MVB836R5	4483457	SVB10960
11282244179	MVB1815R5	12311254885	SVB10960	64557786705	MVB885R4	4536137	SVB101200
11282245848	MVB1815R5	12311254886	SVB131025	64557787898	MVB915R5	4573013	MVB1335R6
11282245948	MVB1885R5	12311256920	SVB131050	645221354948	SVB13800	4573013AB	MVB1335R6
11282247191	MVB2025R5	12311258400	SVB131050	CADILLAC		4573017	SVB101375
11282247493	MVB2060R5	12311260531	SVB131050	1340527	MVB2120R6	4573234	MVB1700R6
11284496457	MVB813R5	12311260568	SVB10975	12576447	MVB960R4	4573737	MVB970R4
11287507626	MVB1030R5	12311260569	SVB131050	12578001	MVB1200R6	4573974	MVB1335R6
11287508239	MVB1035R7	12311268675	SVB10875	12578002	MVB1180R6	4593668AA	MVB1420R4
11287509520	MVB1450R6	12311268678	SVB10850	55556404	MVB1030R5	4593684AA	MVB2100R6
11287511476	MVB1875R6	12311268697	SVB10975	93178812	TB790	04593823AA	MVB2020R6
11287512563	MVB845R4	12311278250	SVB10940	93185756	MVB2120R6	4612018	MVB2490R6
11287512762	MVB860R4	12311284317	SVB10950	120576447	MVB960R4	4612229	MVB850R4
11287512970	MVB1550R6	12311288475	SVB10960	CHEVROLET		4612247	SVB101215
11287512971	MVB860R4	12318602025	SVB10875	12579229	MVB2020R6	4612248	SVB101050
11287512972	MVB1035R7	12318602026	SVB10850	24422964	TB741	4612411	MVB2510R6
11287515316	MVB1642R6	32411258276	SVB10900	24451895	TB638	4612418	MVB2490R6
11287516181	MVB1550R6	32411266788	SVB10900	24466972	MVB1030R5	4612460	MVB2510R6
11287519955	MVB1635R7	32411268681	SVB10825	55186793	MVB1413R6	4612461	SVB10950
11287520072	MVB1560R6	32411270869	SVB10865	55350419	MVB1450R5	4612468	MVB900R4
11287525418	MVB1550R6	32411274563	SVB10913	92063917	TB783	4612470	MVB1420R6
11287527564	MVB1995R6	32411276314	SVB10825	92065902	TB524	4612669	MVB1045R6
11287529738	MVB1550R6	32411288291	SVB10813	92066312	TB783	4612716	MVB1400R7
11287529741	MVB1550R6	32411711144	SVB10913	96183108	MVB1875R6	4612828	MVB2510R6
11287532144	MVB1833R6	32421311578	SVB10813	96183110	MVB884R6	4612829	MVB2080R6
11287532145	MVB1875R6	32421316785	SVB10813	96183352	TB458	4612830	MVB2510R6
11287532146	MVB1642R6	32421706750	SVB10888	96239401	MVB915R4	4612928	MVB2490R6
11287539831	MVB1550R6	32421706825	SVB10825	96239408	MVB663R4	04621844	TB705
11287542864	MVB1550R6	32421711065	SVB10900	96309968	MVB1885R6	4621844	TB705
11287544786	MVB1550R6	32421717011	SVB10825	96352407	TB336	4663182	MVB900R4
11287549150	MVB1995R6	32421717953	SVB10800	96352965	TB491	4663199	MVB1369R6
11287549643	MVB1833R6	32421719953	SVB10800	96404087	MVB1833R6	4663515	TB682
11287552233	MVB1875R6	32421720644	SVB10850	96413861	TB638	4663950	SVB101400
11287552236	MVB1642R6	32421727136	SVB10725	96417177	TB458	4667606	TB565
11287568247	MVB1855R7	32421727180	SVB10725	96440343	TB800	4667611	TB682
11287785774	MVB2060R5	50211318004	SVB10950	96440421	MVB2063R6	4668180	MVB885R4
11287786075	MVB2080R6	50310724004	SVB10750	96570669	MVB715R4	04668241	MVB850R4
11287787368	MVB2025R5	64521258239	SVB13825	96570670	MVB663R4	4668249AB	MVB1125R4
11287787369	MVB2060R5	64521268683	SVB13825	96603461	MVB960R4	4668249AC	MVB1125R4
11287787897	MVB1760R7	64521268695	SVB13800	96610029	TB786	4668303	MVB975R4
11287789985	MVB2160R6	64521276096	SVB13825	96610562	MVB945R4	4668340	SVB101050
11287790450	MVB1833R6	64521277426	SVB13800	96610564	MVB835R4	04668380AA	MVB875R4
11287792059	MVB2063R6	64521289592	SVB13800	96628792	MVB1885R6	4668380AC	MVB875R4







OE		OE		OE		OE	
...CHRYSLER		...CHRYSLER		...CITROËN		...CITROËN	
04668382AB	MVB1420R4	5066928AA	TB719	0816F7	TB721	5750HE	MVB1675R6
4668382AB	MVB1420R4	5066931AA	MVB1420R6	0816G1	TB722	5750HH	MVB1740R6
04668382AC	MVB1420R4	5080313AB	MVB1600R6	0816G3	TB742	5750J0	MVB795R6
04668452	MVB1450R6	5086571AA	MVB1570R6	0816G4	TB744	5750J1	MVB915R6
4668452AB	MVB1450R6	5096317AA	MVB885R4	0816G7	TB724	5750J2	MVB1015R6
04668454AB	MVB890R6	5097758AA	MVB2390R6	0816H3	TB727	5750J3	MVB1080R6
4668454AB	MVB890R6	5203401	TB561	0816H6	TB700	5750J4	MVB1100R6
4723288	MVB1200R5	5281111	MVB2510R6	0816J6	TB724	5750J5	MVB1130R6
4723345	MVB788R5	5281140	MVB2080R6	0831K0	TBK338	5750J6	MVB1150R6
4751649	MVB1369R6	5281276	MVB2440R6	0831K2	TBK304	5750J7	MVB1660R6
4751659	MVB900R4	46510592	MVB788R5	0831K7	TBK355	5750J8	MVB1700R6
4763863	MVB1969R7	46510593	MVB1200R5	0831L3	TBK319	5750K3	MVB775R5
4763863AB	MVB1969R7	46510606	MVB960R3	0831L5	TBK336	5750K5	MVB960R5
04792070	MVB1570R6	46510625F	TB719	0831L7	TBK318	5750K6	MVB1865R6
4792070	MVB1570R6	46510626F	MVB1420R6	0831N3	TBK105	5750K8	MVB1065R6
04792070AB	MVB1600R6	46510641F	MVB1913R6	0831N5	TBK274	5750KV	MVB1335R6
4792070AC	MVB1570R6	53032817AB	MVB2205R6	0831P2	TBK302	5750L0	MVB1115R6
4792071	MVB1065R6	0149971892	MVB1600R6	0831P4	TBK302	5750L2	MVB1740R6
4792071AB	MVB1065R6	B0013411	SVB101050	4007CV	MVB865R5	5750L4	MVB1155R6
4792394AA	MVB1335R6	B0013431	SVB101090	4007J2	SVB10675	5750LA	MVB1469R6
4792408AA	MVB985R4	B0015386	SVB10960	5450L0	MVB1115R6	5750M0	MVB1200R6
04792409AC	MVB1400R6	B0015387	SVB10950	5750A1	MVB1660R6	5750M2	MVB1650R6
04792442	MVB1570R6	B0015387	SVB10960	5750A2	MVB1080R6	5750M3	MVB1190R6
04792442AA	MVB1570R6	B0015402	SVB101000	5750C9	MVB1150R6	5750M5	MVB1105R6
4792746AB	MVB1335R6	B0015475	SVB101200	5750D1	MVB1188R5	5750M7	MVB1725R6
04792746AD	MVB1335R6	B0015491	SVB101215	5750D3	MVB710R5	5750M9	MVB1165R6
4798388	MVB2510R6	B0015491	SVB101225	5750D8	MVB688R5	5750P1	MVB747R4
4841734AA	MVB1420R6	B4040382	MVB975R4	5750D9	MVB915R6	5750P6	MVB710R5
4861017	MVB1015R6	B4040410	MVB1040R4	5750E2	MVB1100R6	5750P8	MVB1030R5
4861322	MVB2440R6	B4040412	MVB1045R4	5750E5	MVB730R6	5750P9	MVB775R5
4861322AB	MVB2440R6	B4050715	MVB1815R5	5750EM	MVB1469R6	5750PC	MVB1150R6
4861400	MVB1420R6	D6510009	MVB1200R5	5750ET	MVB1190R6	5750PF	MVB1000R6
4861401	MVB900R4	MB938467	MVB885R4	5750EW	MVB1580R6	5750PG	MVB1215R6
04861733AC	MVB1250R6	MD100679	TB401	5750EY	MVB1440R6	5750PN	MVB1050R6
4861733AC	MVB1250R6	MD182295	TB326	5750F0	MVB1700R6	5750PQ	MVB1065R6
04861734AA	MVB1420R6	MD307487	TB673	5750F5	SVB10700	5750PT	MVB1885R6
4861734AA	MVB1420R6	MD308989	MVB1500R5	5750F6	SVB10710	5750PY	MVB1675R6
4863835	MVB960R3	MD336149	TB406	5750FC	MVB1725R6	5750Q0	MVB775R5
4864599	MVB2275R8	MN158101	MVB1200R6	5750FF	MVB750R6	5750Q1	MVB1050R5
04891505AB	MVB1440R6	MN158102	MVB900R4	5750FG	MVB1190R6	5750Q2	MVB1050R5
4891505AB	MVB1440R6	MN187017	MVB900R4	5750FJ	MVB1200R6	5750Q6	MVB1625R6
4891506AB	MVB884R6	MN195135	MVB1370R5	5750FR	MVB1225R5	5750Q7	MVB875R5
04891506AC	MVB884R6	TB000132	TB563	5750FT	MVB795R6	5750Q9	MVB855R4
4891506AC	MVB884R6	CITROËN		5750FW	MVB975R6	5750QH	MVB962R6
4891587AA	MVB2035R7	2N2316	SVB10950	5750G2	SVB10913	5750QK	MVB850R6
4891704AA	MVB1190R6	2N39118	SVB10800	5750G5	SVB101090	5750QN	MVB1215R6
04891804AA	MVB1725R6	5M5Q6C301BA	MVB1088R6	5750G8	MVB698R4	5750QT	MVB1180R6
4891875AA	MVB1760R6	0816A0	TB727	5750G9	MVB810R4	5750QV	MVB1588R6
04891935AB	MVB920R4	0816A1	TB683	5750GC	MVB730R6	5750R0	MVB1255R5
04892173AA	MVB1600R6	0816A3	TB701	5750GE	MVB1125R6	5750R1	MVB800R5
4892444AA	MVB900R4	0816A4	TB558	5750GF	MVB1740R6	5750R2	MVB1600R6
4892680AA	MVB2125R6	0816A6	TB678	5750GH	MVB1180R6	5750R5	MVB1740R6
04892711AA	MVB985R4	0816A9	TB632	5750GJ	MVB1388R6	5750R8	MVB1625R6
04892747AA	MVB985R4	0816C1	TB525	5750GK	MVB1740R6	5750R9	MVB1740R6
4892747AA	MVB985R4	0816C8	TB702	5750GX	MVB1155R6	5750RE	MVB1215R6
04892748AA	MVB1400R6	0816E0	TB700	5750GZ	MVB1560R6	5750RF	MVB1560R6
4892748AA	MVB1400R6	0816E2	TB724	5750H1	MVB960R4	5750RG	MVB906R6
4892749AA	MVB900R4	0816E4	TB720	5750H2	MVB1245R4	5750RH	MVB1700R6
04892749AB	MVB900R4	0816E5	TB368	5750H3	MVB700R5	5750RK	MVB870R6
4892749AB	MVB900R4	0816E6	TB720	5750H4	MVB710R5	5750RN	MVB1675R6
4892750AA	MVB1400R6	0816E7	TB720	5750H5	MVB845R5	5750RT	MVB1165R6
4892840AA	MVB2100R6	0816F0	TB699	5750H7	MVB1165R5	5750RX	MVB1350R6
5015593	MVB2050R6	0816F2	TB711	5750H8	MVB698R6	5750RZ	MVB1200R6
5037542AA	MVB2080R6	0816F4	TB683	5750H9	MVB730R6	5750S2	MVB860R6





OE		OE		OE		OE	
...CITROËN		...CITROËN		...CITROËN		...CITROËN	
5750S4	MVB1025R6	6453AE	MVB1030R5	083161	TBK303	91508762	MVB960R4
5750S6	MVB1388R6	6453CV	MVB1100R5	083162	TBK106	91511597	SVB10913
5750SE	MVB875R5	6453CY	MVB1030R5	083177	TBK308	91512961	TB226
5750SF	MVB865R5	6453FK	MVB1100R5	083178	TBK274	91516768	MVB835R4
5750SP	SVB10700	6453W0	MVB925R6	083179	TBK274	91517722	TB226
5750SQ	MVB698R4	051651	TB574	083181	TBK230	91522116	SVB10913
5750SW	MVB1270R5	55356	SVB10710	083182	TBK106	91536222	MVB698R4
5750T0	MVB1625R6	081644	TB259	083183	TBK106	91536224	MVB835R4
5750T4	MVB830R5	081653	TB319	083185	TBK316	91536227	MVB1020R4
5750T6	MVB1450R6	081654	TB320	083187	TBK312	91536229	MVB1245R4
5750T8	MVB1740R6	081655	TB376	083188	TBK279	91536297	SVB10600
5750TF	MVB1100R6	081656	TB304	083189	TBK279	91536298	SVB10625
5750TJ	MVB698R6	081658	TB175	128019	MVB925R5	91536302	SVB10790
5750TK	MVB1130R6	081659	TB175	128027	MVB855R4	91536303	SVB10800
5750TT	MVB1255R5	081665	TB453	128028	MVB945R4	91536308	SVB101000
5750TW	MVB710R5	081667	TB226	128034	MVB890R6	91536311	SVB101090
5750V0	MVB860R4	081668	TB459	128036	MVB900R4	91536338	SVB10710
5750VF	MVB1440R6	081669	TB454	128040	MVB940R3	91536700	SVB10925
5750VG	MVB1725R6	081671	TB419	128041	MVB940R3	91536703	MVB960R4
5750VJ	MVB1190R6	081672	TB457	128044	MVB915R6	91538177	MVB710R5
5750VK	MVB1225R5	081673	TB479	128047	MVB1000R6	91541144	MVB725R5
5750VL	MVB795R6	081685	TB700	128051	MVB946R6	91541175	MVB725R5
5750VP	MVB1335R6	081688	TB525	128065	MVB946R6	91541176	MVB1015R5
5750VX	MVB1740R6	081689	TB727	128066	MVB915R6	91541177	MVB800R4
5750VY	MVB1700R6	081693	TB631	128067	MVB1000R6	91541178	MVB1230R4
5750W0	MVB1740R6	081696	TB632	400366	SVB10800	91541179	MVB1225R5
5750W2	MVB1045R6	081698	TB479	452737	SVB13710	93010362	TB175
5750W3	MVB1755R6	083101	TBK049	456918	SVB10650	93010364	TB175
5750W9	MVB775R5	083102	TBK005	520007	SVB101025	93013132	TB319
5750WA	MVB775R5	083103	TBK007	575027	MVB1755R6	93501082	MVB970R5
5750WC	MVB960R5	083105	TBK009	575073	SVB10710	93501676	MVB698R4
5750WG	MVB1560R6	083106	TBK010	575098	MVB1065R6	93502487	MVB698R4
5750WN	MVB730R6	083109	TBK019	5347213S	SVB10975	93502642	MVB970R5
5750WR	MVB1105R6	083111	TBK035	5414408L	SVB10975	93510091	TB175
5750WS	MVB1725R6	083113	TBK005	5414629N	SVB101175	94560702	TB304
5750WY	MVB1050R6	083114	TBK007	5415743X	SVB101113	95005666	MVB688R5
5750WZ	MVB1065R6	083117	TBK010	5423412F	SVB10610	95006268	MVB1120R5
5750X4	MVB860R6	083120	TBK019	5427290H	SVB10775	95006782	SVB101025
5750X6	MVB1388R6	083121	TBK013	5430452C	SVB10825	95492927	SVB10625
5750X7	MVB1740R6	083122	TBK035	5440191	SVB10800	95493061	SVB10675
5750X8	MVB1469R6	083124	TBK004	5445113L	SVB10665	95493077	SVB10665
5750XA	MVB1560R6	083127	TBK020	5445114	SVB10600	95493420	SVB101150
5750XC	MVB1885R6	083128	TBK004	5445114X	SVB10600	95493421	SVB10913
5750XG	MVB1000R6	083130	TBK041	5490426L	SVB10665	95493443	SVB101150
5750XK	MVB1588R6	083131	TBK020	5490426U	SVB10665	95495339	SVB10635
5750XN	MVB1215R6	083134	TBK344	5490803S	SVB10725	95495480	SVB10635
5750XT	MVB1469R6	083135	TBK344	5491191J	SVB10725	95495585	SVB10775
5750XY	MVB775R5	083136	TBK029	7618111	MVB925R5	95496822	SVB10625
5750Y2	MVB1200R6	083137	TBK029	75292376	SVB10610	95496836	SVB10800
5750Y3	MVB1725R6	083140	TBK106	75490809	SVB10775	95496894	SVB10650
5750Y4	MVB1560R6	083141	TBK106	75491758	SVB10700	95496930	SVB10775
5750YC	MVB1450R6	083144	TBK030	75491768	SVB10700	95612377	MVB747R4
5750YF	MVB1740R6	083145	TBK030	75492093	SVB10825	95639605	TB419
5750YH	MVB1675R6	083146	TBK041	75492285	SVB10665	95640434	MVB688R5
5750YP	MVB795R6	083147	TBK041	75492376	SVB10610	95661735	MVB810R4
5750YQ	MVB975R6	083149	TBK113	75492514	SVB10610	95666985	MVB1020R4
5750Z1	MVB1450R6	083150	TBK013	75492515	SVB10775	96001122	MVB698R4
5750Z3	MVB1560R6	083151	TBK013	75492554	SVB10600	96001123	MVB960R4
5750Z5	MVB1740R6	083152	TBK035	75519264	SVB10725	96010219	MVB1141R5
5750Z7	MVB1755R6	083153	TBK035	75519754	SVB10610	96010220	MVB710R5
5750Z9	MVB1440R6	083156	TBK122	90013344	TB320	96011188	MVB810R4
5750ZG	MVB1200R6	083157	TBK122	90538288	MVB710R5	96014241	MVB1270R5
5750ZH	MVB1700R6	083158	TBK105	91001158	MVB1245R4	96015521	SVB10800
6453AC	MVB1030R5	083159	TBK105	91506949	SVB10925	96019294	MVB855R4







OE		OE		OE		OE	
...CITROËN		...CITROËN		...CITROËN		...DACIA	
96019295	MVB855R4	96155949	MVB1700R6	9630425880	TB525	7700111671	MVB1750R5
96021924	MVB700R5	96155951	MVB1700R6	9631718780	MVB1725R6	7700273650	TB529
96021925	MVB700R5	96161326	MVB1450R5	9632959380	TB727	7700321502	SVB101225
96027231	SVB10700	96161327	MVB1388R5	9633010980	MVB1740R6	7701472725	TBK096
96029000	TB304	96161329	MVB845R5	9633478280	MVB1469R6	7701477014	TBK267
96030324	MVB1245R4	96163410	MVB688R5	9633923080	TB479	7701477024	TBK096
96031400	MVB735R5	96165811	MVB775R5	9633923180	TB479	8200020924	MVB1135R5
96031955	SVB101125	96173680	MVB768R5	9634106180	TB722	8200061673	MVB1110R5
96033798	TB259	96182679	TB727	9634740180	TB722	8200211651	MVB715R4
96035624	SVB10650	96183873	MVB1188R5	9635438380	TB702	8200243021	MVB1200R6
96035624	SVB10665	96188278	TB226	9635438480	TB702	8200344791	TB713
96046090	MVB845R5	96188881	MVB1740R6	9637240580	TB683	8200356268	MVB1820R6
96046092	MVB845R5	96197629	TB700	9637914380	TB700	8200537021	TB529
96046101	MVB1388R5	96197874	TB479	9637914580	TB724	8200537026	TB636
96046105	MVB1388R5	96200344	TB479	9637914680	TB724	8200537033	TB713
96046630	MVB1272R4	96209044	MVB1740R6	9638007780	MVB1560R6	8200821813	MVB1200R6
96049648	TB320	96211951	MVB1700R6	9638027180	MVB1580R6	8200821816	MVB1130R6
96053938	MVB1165R5	96223131	TB631	9638355980	TB721	8200833541	MVB1750R5
96056833	MVB1165R5	96229218	MVB940R3	9639842180	TB700	8200841132	MVB1110R5
96056835	MVB735R5	96236952	MVB1600R6	9640419580	TB721	DAEWOO	
96058570	TB419	96236953	MVB1650R6	9640669280	TB720	12761A78B00	TB491
96059322	MVB688R5	96236954	MVB1650R6	9640810680	TB720	12761A78B00000	TB491
96059324	MVB710R5	96239499	TB700	9640828680	TB742	12761A80D00000	TB491
96059540	MVB1450R5	96252153	TB631	9642574680	MVB1740R6	17521A78B00	SVB10610
96059541	MVB1450R5	96261574	TB632	9642697380	MVB1150R6	1276178B00	TB491
96072342	TB459	96261720	MVB1050R5	9643903780	MVB860R4	1752170D00	SVB10610
96088735	TB376	96267902	MVB1388R6	9644351580	MVB1740R6	9128722	TB524
96097062	TB259	96273679	MVB710R5	9645583280	MVB1388R6	90499525	TB524
96100168	TB419	96273681	MVB775R5	9645717480	TB724	92063917	TB783
96100984	TB459	96287933	MVB1030R5	9645717580	TB724	92065902	TB524
96101064	TB453	96290822	TB632	9647367480	TB744	92066312	TB783
96117374	MVB810R4	96294081	MVB1625R6	9647610080	TB683	96103128	TB458
96120257	MVB915R6	96294858	MVB860R6	9651255780	MVB1560R6	96144327	MVB1255R5
96126957	MVB1030R5	96295878	MVB1755R6	9651695680	MVB1885R6	96144846	SVB10800
96129654	MVB1255R5	96300343	MVB1625R6	9651765080	MVB1725R6	96144932	MVB869R5
96129662	MVB875R5	96308935	MVB1755R6	9652258880	MVB1740R6	96144933	MVB970R5
96129664	MVB1255R5	96315206	MVB830R5	9652746780	MVB1740R6	96144934	MVB1000R5
96135989	MVB945R4	96334782	MVB1469R6	9653204180	MVB1000R6	96182007	SVB13825
96138810	MVB855R4	96337272	MVB1450R6	9653319680	MVB1050R6	96182008	SVB13875
96140147	TB304	96372505	MVB1469R6	9653319780	MVB1065R6	96183108	MVB1875R6
96140606	MVB1865R6	97522929	TB259	9656444980	MVB1137R6	96183110	MVB884R6
96141369	TB419	97522930	TB304	AK53217	SVB10775	96183351	TB458
96142525	TB175	97532676	TB304	AM53217	SVB10800	96183352	TB458
96142839	MVB698R6	99456476	TB368	AM53217A	SVB10775	96183353	TB336
96144504	MVB730R6	7700630569	SVB10913	AY53217	SVB10750	96185000	SVB13875
96144507	MVB730R6	7700658289	SVB101000	DD39118	SVB10800	96239401	MVB915R4
96144509	MVB1130R6	7700718836	TB422	DF39118	SVB10750	96239407	SVB10665
96144510	MVB1130R6	7700729580	TB421	DM2316	SVB10950	96239408	MVB663R4
96152078	MVB1660R6	7813076000	SVB10888	DS2316	SVB10913	96309968	MVB1885R6
96152079	MVB1660R6	9350226880	MVB985R4	DS31410	SVB10550	96350327	MVB1725R6
96152080	MVB698R6	9464034380	TB720	DX2316A	SVB10990	96350467	SVB13850
96152082	MVB1065R6	9604964880	TB468	DX2316D	SVB10975	96350548	MVB1904R6
96152083	MVB1065R6	9612966480	MVB1255R5	DX31410	SVB10600	96352407	TB336
96152084	MVB1080R6	9613855980	TB259	DX231213A	SVB10975	96352517	MVB735R4
96152085	MVB1080R6	9614014780	TB304	GX1110101A	SVB10610	96352605	MVB1875R6
96152088	MVB1100R6	9618337580	TB727	HG2316A	SVB101113	96352965	TB491
96152090	MVB1150R6	9623549880	MVB1725R6	HY2316	SVB101300	96417177	TB458
96152091	MVB1150R6	9623549980	MVB1105R6	HY2316B	SVB101275	96565821	SVB10665
96154391	MVB795R6	9624542280	MVB1200R6	HY39118	SVB10913	96569402	MVB735R4
96155010	MVB1015R6	9624542980	MVB1725R6	DACIA		96570669	MVB715R4
96155377	MVB875R5	9624543180	MVB1200R6	6000583845	SVB101175	96570670	MVB663R4
96155378	MVB800R5	9626157480	TB632	6000589954	SVB101200	96603461	MVB960R4
96155379	MVB1255R5	9629082280	TB632	6001543400	TB529	96610029	TB786
96155380	MVB1030R5	9630425480	TB525	6001548021	MVB715R4	96610562	MVB945R4





OE		OE		OE		OE	
DAEWOO		...DAF		...DAIHATSU		...DAIHATSU	
96814098	TB458	0396574	SVB131325	4431887707	MVB538R3	9091602052	SVB13900
DAF		0482544	SVB10940	4436087704	MVB563R3	9091602060	SVB13900
0067664	SVB101050	0490269	MVB1400R8	8845887101	MVB835R4	9091602122	MVB800R3
0067667	SVB131025	0494104	SVB101025	8845887102	MVB835R4	9194008300	MVB835R4
0067668	SVB131150	544262	SVB131150	8845887103	MVB835R4	9932100791	SVB10800
0067670	SVB131300	0555461	SVB131300	8845887701	MVB813R5	9932100870	SVB10875
0067671	SVB131325	0634077	SVB131450	8845887702	MVB900R5	9932100885	SVB10888
0067673	SVB131375	0655043	SVB131475	8845887704	MVB845R4	9932100895	SVB10900
0067676	SVB131450	0677716	SVB131325	8845887705	MVB845R4	9932100898	SVB10900
0067677	SVB131475	0679733	SVB10975	8845887710	MVB825R4	9932150791	SVB10800
0067681	SVB131600	0701363	SVB131375	8845887712	MVB800R4	9932150961	SVB10960
0067690	MVB1400R8	0759749	SVB131025	8845887713	MVB800R4	9932150975	SVB10975
0068229	SVB131500	0894415	SVB131075	8859497201	MVB715R4	9932200860	SVB13850
0107561	SVB131350	1236816	SVB131250	8859497205	MVB715R4	9932200875	SVB13875
0192145	SVB131150	1251720	SVB101250	9004831002	MVB780R3	9932200880	SVB13875
0211144	SVB131400	1256081	SVB131300	9004831003	MVB775R4	9932200890	SVB13900
2111144	SVB131400	1256304	SVB131400	9004831004	MVB775R4	9932200930	SVB13925
0211749	SVB131325	1265391	SVB101250	9004831005	MVB975R5	9932200950	SVB13950
211749	SVB131325	1289208	SVB131075	9004831008	MVB706R4	9932201050	SVB131050
0212253	SVB131450	1393280	MVB2040R8	9004831009	MVB706R4	9932210870	SVB13875
0212269	SVB131425	1425709	SVB131000	9004831012	MVB790R4	9933110811	SVB10813
212269	SVB131425	3040662	MVB1015R6	9004831013	MVB790R4	9933150665	SVB10675
0212523	SVB131450	CBU1182	MVB1400R8	9004831017	MVB775R4	9933150666	SVB10675
212523	SVB131450	CBU1532	MVB1400R8	9004831018	MVB790R4	9933150706	SVB10700
0215177	SVB131350	ERC6886	SVB101025	9004831019	MVB775R4	9933200805	SVB13800
215177	SVB131350	ETC4821	SVB101050	9004831020	MVB715R4	9933200890	SVB13900
0215357	SVB131300	LBU5127	SVB101050	9004831024	MVB763R4	9933210761	SVB13775
215357	SVB131300	LBU5146	SVB10940	9004831030	MVB1708R4	9933210786	SVB13780
0215402	SVB131375	DAIHATSU		9004831046	MVB860R6	9936400830	MVB835R4
215402	SVB131375	1356889050	TB347	9004831047	MVB1200R6	9936450830	MVB835R4
217177	SVB131350	493069	SVB10760	9004831059	MVB1580R6	9936470830	MVB835R4
233564	SVB131500	1351487707	TB674	9004831064	MVB1875R6	9936480830	MVB835R4
234125	SVB131425	1351487710	TB674	9004831065	MVB1820R6	9936500820	MVB825R5
236631	SVB131400	1351487711	TB328	9004831071	MVB1180R6	9936500920	MVB915R5
236632	SVB131425	1351487713	TB674	9004831500	MVB975R5	9936550820	MVB825R5
236633	SVB131375	1351487783	TB328	9004832002	SVB10790	9952110789	SVB10790
236634	SVB131350	1351487785	TB674	9004832024	SVB10875	9952110929	SVB10925
236635	SVB131350	1351497201	TB728	9004832035	SVB10925	9952110959	SVB10950
236636	SVB131450	1351497204	TB728	9004832036	SVB10925	1356887103000	TB347
0237784	SVB131500	1356864011	TB473	9004832040	SVB10760	1356887104000	TB347
237784	SVB131500	1356887081	TB473	9004832041	SVB10790	1356887183000	TB347
0237785	SVB131450	1356887101	TB330	9004832044	SVB10800	9932200880000	SVB13875
0238770	SVB131475	1356887102	TB330	9004832045	SVB10790	9933201055000	SVB131050
238770	SVB131475	1356887103	TB347	9004832049	SVB10800	DAIMLER	
239484	SVB13950	1356887104	TB347	9004832050	SVB10800	C28956	SVB131175
243341	SVB131600	1356887105	TB330	9004832051	SVB10760	C28957	SVB13875
243941	SVB131600	1356887106	TB347	9004832052	SVB10760	C29607	SVB10900
243947	SVB131600	1356887107	TB330	9004832053	SVB10775	DODGE	
0252790	SVB131375	1356887181	TB330	9004832056	SVB10825	4483457	SVB10960
0252807	SVB131300	1356887182	TB330	9004832060	SVB10790	4536137	SVB101200
0256063	SVB131025	1356887183	TB347	9004832061	SVB10790	4573013AC	MVB1335R6
0276451	SVB131475	1356887184	TB347	9004832062	SVB10790	04593665AB	MVB2020R6
0276741	SVB131375	1356887306	TB386	9004832063	SVB10760	4593684AA	MVB2100R6
0283164	SVB131450	1356887380	TB386	9004832066	SVB10790	4612247	SVB101215
0287978	SVB131375	1356887707	TB327	9004832067	SVB10775	4612461	SVB10950
0288857	SVB131375	1356887708	TB328	9004832069	SVB10775	4612669	MVB1045R6
0289362	SVB131150	1356887709	TB328	9004832076	SVB10775	4612828	MVB2510R6
0289842	SVB131325	1356887783	TB327	9004832077	SVB10800	4621844	TB705
0293009	SVB131475	4431887201	MVB735R3	9004832087	SVB10790	4667606	TB565
0293028	SVB131150	4431887401	MVB1015R4	9004832088	SVB10790	4667611	TB682
0295063	SVB131025	4431887701	MVB825R3	9004832089	SVB10775	4668180AB	MVB885R4
0377254	SVB131375	4431887703	MVB760R3	9004832095	SVB10740	4792746AB	MVB1335R6
0378324	SVB131250	4431887704	MVB563R3	9004931004	MVB775R4	4854258	MVB2020R6
0378724	SVB131250	4431887706	MVB538R3	9086108800	SVB13875	4861322AB	MVB2440R6



OE		OE		OE		OE	
...DODGE		...FIAT		...FIAT		...FIAT	
4861322AC	MVB2440R6	4025787	SVB10960	4478580	SVB10825	5978842	SVB10913
4861400	MVB1420R6	4028502	SVB10975	4537928	SVB131300	5980075	SVB10740
4861401	MVB900R4	4037771	SVB10800	4538873	SVB101100	5985207	SVB10775
4891598AB	MVB2553R6	4042901	SVB10950	4547433	SVB131425	5990576	SVB10888
04891661AA	MVB1715R6	4045907	SVB10750	4547443	SVB131425	5990578	MVB836R5
4891661AA	MVB1715R6	4049101	SVB10950	4547446	SVB101050	5990649	SVB10913
4891704AA	MVB1190R6	4060336	SVB10950	4574091	SVB101000	5990790	SVB10888
4892680AA	MVB2125R6	4060534	SVB10750	4606269	SVB131425	5992345	SVB10960
4892747AA	MVB985R4	4061402	SVB10775	4606270	SVB101050	7026196	SVB10850
4892749AA	MVB900R4	4062365	SVB10913	4610482	SVB10975	7301221	SVB10913
4892750AA	MVB1400R6	4068295	SVB10725	4610657	SVB10960	7301775	SVB10900
5103564AA	MVB2271R6	4068295	SVB10735	4615469	SVB101100	7302203	SVB10900
5103565AA	MVB2265R6	4070393	SVB10725	4615474	SVB101100	7302791	SVB10635
5281140	MVB2080R6	4070393	SVB10735	4616155	SVB10960	7302819	SVB10710
53013905AC	MVB2205R6	4099852	SVB101000	4617480	SVB131300	7303004	SVB10925
53032037AL	MVB2225R6	4108792	SVB10750	4619689	SVB10925	7303315	SVB10775
53032125AB	MVB2240R6	4108793	SVB10750	4619691	SVB10925	7303462	SVB10813
53032125AE	MVB2205R6	4146392	SVB10775	4619695	SVB101250	7533397	SVB10775
53032755AA	MVB2225R6	4150202	SVB10888	4619699	SVB101250	7535218	SVB10675
53032817AA	MVB2205R6	4153056	SVB10750	4624734	SVB10925	7540063	SVB10813
53032817AB	MVB2205R6	4153106	SVB10725	4624745	SVB101250	7546910	SVB10875
B0015387	SVB10960	4153106	SVB10735	4631961	SVB131450	7548076	TB579
B0015396	SVB10990	4153107	SVB10750	4638401	SVB101375	7552380	SVB10775
MD100679	TB401	4153752	SVB10950	4645911	SVB131450	7553224	MVB845R5
MD322330	MVB900R4	4153753	SVB10913	4645913	SVB131450	7554502	SVB10750
MD336149	TB406	4156931	SVB10800	4646105	SVB131425	7554701	TB129
MD365263	MVB1370R5	4156931	SVB10813	4646107	SVB131425	7564923	SVB10800
MD368275	MVB1200R6	4158457	SVB10850	4646108	SVB101050	7565945	MVB1613R6
MD376691	MVB938R5	4164623	SVB10790	4647062	MVB1842R6	7575315	SVB101000
FERRARI		4164887	SVB101000	4649011	SVB101075	7576114	SVB101090
125772	SVB10900	4165189	SVB10850	4650438	SVB131300	7580223	SVB10960
127132	SVB10813	4170927	SVB101075	4654911	SVB101075	7580224	SVB101025
130493	SVB10800	4171293	SVB10813	4665641	SVB101025	7581316	SVB10825
133228	MVB865R5	4174521	SVB10625	4683770	SVB101125	7581464	SVB10675
133262	MVB810R4	4176009	SVB131250	4683771	SVB101125	7581805	SVB13710
138325	MVB735R5	4181524	SVB10790	4688852	SVB101100	7589248	SVB13825
139449	MVB946R6	4181525	SVB10700	4717332	SVB131300	7596397	SVB101025
156329	MVB1015R6	4200845	SVB10975	4726920	SVB101350	7604445	MVB985R5
156703	MVB768R5	4206718	SVB101075	4758123	SVB10913	7604702	SVB10825
156708	MVB1000R6	4218720	SVB101100	4765100	SVB10925	7604704	SVB10550
158102	MVB1250R6	4224377	SVB10825	4829182	SVB13925	7609091	SVB10913
166453	MVB1300R5	4225393	SVB10850	4834880	SVB13825	7609093	SVB10888
201448	MVB1513R6	4229143	SVB10940	4872967	SVB101525	7610476	SVB10710
260292A	SVB101075	4229144	SVB101275	5414629	SVB101175	7610944	SVB10675
260297A	SVB10950	4229145	SVB10913	5430452	SVB10825	7611334	SVB10650
260469A	SVB10925	4279749	SVB10913	5491758	SVB10700	7614957	SVB10740
260475A	SVB10840	4301066	SVB101025	5492554	SVB10600	7614999	TB579
FIAT		4306859	SVB10813	5518907	SVB10825	7615058	MVB985R5
5553	SVB171000	4306862	SVB101275	5882989	SVB10925	7617214	SVB131050
561490	SVB171320	4313390	SVB10825	5889259	TB129	7617278	SVB13850
561492	SVB17850	4332785	SVB10813	5889277	SVB10675	7617420	SVB10940
568082	SVB131150	4335587	SVB10813	5924372	SVB10690	7617421	MVB885R4
574527	SVB131075	4337104	SVB101025	5924385	SVB10550	7618111	MVB925R5
575732	SVB171000	4371913	SVB101000	5930833	SVB10825	7618732	SVB10690
759681	SVB171320	4382104	SVB101050	5931889	SVB101075	7619418	SVB10675
761473	SVB131325	4434797	SVB10775	5947596	SVB101075	7621046	MVB1060R5
761474	SVB131325	4434806	SVB10700	5948450	SVB101050	7621256	SVB13875
761499	SVB131375	4440806	SVB101060	5948451	SVB101050	7623460	SVB13850
761769	SVB131375	4440806	SVB101075	5948451	SVB101060	7623828	SVB10690
863607	SVB171000	4458068	SVB10865	5948451	SVB101075	7623829	SVB10690
987107	SVB10775	4464043	SVB10825	5949332	SVB10690	7627106	MVB915R5
999447	SVB171000	4466209	SVB10850	5949504	SVB10800	7627201	MVB1015R5
1395572	SVB101375	4467845	SVB10825	5953873	SVB10940	7627908	SVB13850
1752164J00	MVB836R5	4470182	SVB10888	5956599	SVB10825	7628729	SVB10725





OE		OE		OE		OE	
...FIAT		...FIAT		...FIAT		...FIAT	
7629031	MVB906R5	7710579	TB468	46413020	MVB975R5	46550322	MVB1588R6
7629229	MVB915R5	7718418	MVB1100R5	46424623	MVB1000R3	46555974	MVB1795R6
7629235	SVB13750	7720922	SVB131050	46426983	TB639	46556131	MVB1795R6
7629316	SVB13800	7720923	SVB131050	46428896	MVB975R4	465557131	MVB775R4
7629479	MVB906R5	7721293	MVB938R5	46429443	MVB673R4	46557132	MVB545R4
7631375	MVB925R5	7721703	SVB10675	46429444	MVB706R4	46736500	TB649
7631670	SVB10850	7722331	TB607	46429930	MVB1833R6	46736501	TB676
7631671	SVB10850	7723828	SVB10690	46434651	TB798	46736814	MVB663R4
7632090	MVB960R5	7723829	SVB10690	46439000	MVB1105R6	46738444	MVB938R5
7633335	SVB10740	7730052	MVB890R6	46439824	MVB938R6	46738445	MVB668R3
7633936	MVB1100R4	7730054	MVB925R6	46443510	MVB775R4	46746017	MVB835R4
7635566	MVB1100R4	7732138	MVB887R5	46444537	MVB1740R6	46749664	MVB1833R6
7636057	MVB1045R4	7732676	TB462	464446830	MVB1833R6	46749665	MVB1842R6
7636058	MVB1045R4	7736314	SVB10690	464446963	MVB900R4	46750865	TB676
7636059	MVB1050R4	7742320	TB660	46448693	MVB938R5	46751200	MVB673R4
7636060	MVB1050R4	7743134	SVB10690	46448694	MVB960R4	46755987	MVB825R6
7636448	MVB673R3	7743660	MVB870R4	46451652	MVB855R4	46759720	MVB1842R6
7636895	MVB915R3	7745354	MVB706R4	46451885	MVB1035R6	46770210	MVB673R4
7636896	MVB915R3	7749145	MVB938R5	46451888	MVB1833R6	46770217	MVB986R6
7638224	SVB10740	7753474	MVB945R4	46454225	MVB1030R5	46770219	MVB900R4
7638225	SVB10740	7758970	MVB925R5	46456894	MVB960R4	46770222	MVB975R5
7640256	MVB906R5	7758972	MVB960R4	46457061	TB660	46770223	MVB938R6
7640257	MVB985R5	7761146	MVB940R4	46457742	TB608	46770224	MVB945R4
7640258	MVB925R5	7761147	MVB938R5	46462943	MVB668R3	46775098	MVB1137R6
7640261	SVB10913	7762910	TB470	46462944	MVB938R5	46780505	TB639
7644467	MVB960R5	7762982	SVB13840	46462949	MVB938R6	46786740	MVB1775R6
7644875	MVB960R4	7763320	SVB131050	46462950	MVB986R6	46787905	MVB915R3
7644876	MVB960R4	7763980	MVB900R4	46468650	MVB950R5	46787907	MVB1760R6
7644928	SVB10800	7764585	SVB10675	46471757	MVB950R5	46791187	TB608
7646725	TB660	7764894	MVB925R4	46473060	MVB950R5	46791188	TB639
7646849	MVB1050R5	7764914	TB608	46473645	MVB940R4	46791189	TB725
7649219	SVB13850	7765715	MVB925R5	46474060	MVB755R4	46798891	MVB1150R6
7650608	SVB10850	7765716	MVB915R4	46474061	MVB1045R6	46801955	MVB1050R6
7651197	MVB915R4	7765717	MVB960R5	46474062	MVB1842R6	46801957	MVB1820R6
7651198	MVB915R4	7765718	MVB960R4	46474063	MVB1035R6	46803270	MVB1050R6
7651549	SVB13750	7765719	MVB887R5	46474064	MVB1833R6	46803271	MVB1820R6
7651558	MVB970R5	7765720	SVB10690	46474432	TB357	46806144	MVB1088R6
7652117	SVB10865	7766106	MVB1137R6	46478610	TB305	46806145	MVB1855R6
7652245	MVB1100R4	7766684	MVB1035R6	46479557	MVB1760R6	46809420	MVB663R4
7655543	SVB13850	7768335	SVB10740	46514671	TB471	46811573	MVB1270R6
7655544	SVB13750	7771529	MVB1000R4	46515401	TB660	46818260	MVB1150R6
7657701	MVB925R4	7771530	SVB10690	46516743	MVB900R4	46820062	MVB1180R6
7657703	MVB925R4	7774591	TB474	46517850	MVB835R4	46820063	MVB1306R6
7658133	MVB1000R5	7776569	SVB10700	46517851	MVB698R4	46820063A696	MVB1306R6
7659062	TB474	7776570	SVB10650	46520499	MVB1388R6	51758124	MVB1388R6
7659699	SVB10675	7778459	MVB940R3	46520501	MVB747R4	55183446	TB787
7662411	SVB10913	7780420	MVB938R6	46520502	MVB747R4	55183528	TB790
7671401	SVB10950	7780556	MVB986R6	46526291	TB649	55185077	MVB1180R6
7671402	SVB10913	7780557	MVB986R6	46527337	MVB1775R6	55188191	TB471
7675213	MVB545R4	7781034	MVB755R4	46527552	MVB698R4	55189680	MVB1820R6
7685362	SVB101060	7798722	MVB698R6	46528833	MVB648R3	55189686	MVB1740R6
7685363	SVB101060	7799581	MVB855R4	46533490	MVB1125R6	55189689	MVB1760R6
7685363	SVB101075	8822704	SVB131375	46537099	MVB960R4	55191004	MVB1270R6
7689128	SVB13775	8823607	SVB101250	46540494	SVB10690	55191005	MVB1270R6
7691010	SVB13875	14730110	TB454	46540546	MVB1035R6	55191006	MVB1200R6
7692630	SVB10888	46400045	TB471	46541065	TB462	55192799	MVB938R5
7692828	SVB10865	46400047	MVB668R3	46542138	MVB938R5	55192802	MVB668R3
7692829	SVB10865	46403146	MVB945R4	46542139	MVB950R5	55192896	TB639
7695968	MVB1035R5	46403659	TB637	46542302	MVB960R4	55193659	TB794
7702169	MVB1050R5	46403854	MVB938R5	46542303	MVB855R4	55194752	MVB1050R6
7702175	MVB900R4	46406340	MVB940R4	46546254	TB798	55200255	MVB1050R6
7702740	MVB1035R5	46411594	MVB668R3	46548288	TB608	55202378	MVB1250R6
7704978	MVB673R4	46411595	MVB960R4	46548454	MVB1175R5	55202379	MVB795R6
7706132	MVB970R5	46412707	MVB925R6	46549624	MVB1188R5	55202584	MVB795R6







OE		OE		OE		OE	
...FIAT		...FIAT		...FIAT		...FIAT	
55202586	MVB1180R6	71719645	MVB1820R6	71749421	MVB960R5	500385160	MVB1000R6
55202621	MVB1318R6	71719648	TB468	71749424	MVB915R4	500388408	MVB1083R7
55203784	TB794	71719650	TB559	71749430	MVB1050R5	504012393	MVB985R4
55203785	TB787	71719651	TB639	71749441	MVB925R6	504076915	TB723
55203786	TB676	71719652	TB649	71749447	MVB1175R5	504092340	MVB1165R6
55210626	TB559	71719738	MVB663R4	71749457	MVB938R6	504171190	MVB946R6
55217612	TB787	71719745	MVB906R5	71749474	TB660	504171191	MVB1000R6
55350419	MVB1450R5	71728659	MVB1088R6	71753156	TB787	1300342080	MVB938R5
55350421	MVB1550R5	71728660	MVB1855R6	73501580	MVB1760R6	1313020080	MVB962R6
55351458	MVB1030R5	71731639	TB639	73501649	MVB1200R6	1473011080	TB454
55556430	MVB1588R6	71732394	MVB1795R6	73502928	MVB1360R6	7549175810	SVB10700
55559175	MVB2120R6	71734715	MVB1760R6	73502929	MVB1360R6	7813076000	SVB10888
60565258	MVB790R4	71734716	MVB1740R6	73636895	MVB915R3	9001334480	TB468
60568842	MVB1240R7	71734717	MVB1820R6	76770211	MVB673R4	9150694980	SVB10925
60573075	MVB1180R7	71736242	MVB1270R6	82398036	SVB10775	9153633880	SVB10710
60575209	MVB763R4	71736257	MVB1360R6	82404106	SVB10825	9153670080	SVB10925
60610910	MVB1842R6	71736714	TBK094	91536338	SVB10710	9400816190	TB683
60610911	MVB1045R6	71736715	TBK089	94008165	TB560	9400816549	TB320
60617860	MVB1045R6	71736717	TBK313	94633780	MVB1388R6	9400816589	TB560
60617861	MVB1045R6	71736718	TBK277	96142840	MVB698R6	9400816939	TB631
60617862	MVB1842R6	71736719	TBK314	96152078	MVB1660R6	9400816969	TB632
60617863	MVB1842R6	71736720	TBK037	96152079	MVB1660R6	9400816989	TB479
60620887	TB732	71736726	TBK283	96152082	MVB1065R6	9400831119	TBK035
60625130	TB468	71736729	TBK207	96152084	MVB1080R6	9400831279	TBK020
60656341	TB559	71736795	TBK104	96152085	MVB1080R6	9400831349	TBK344
60656342	TB468	71738160	MVB950R5	96152089	MVB1100R6	9400831409	TBK106
60662991	MVB1855R6	71739006	MVB545R4	96170126	MVB1165R6	9400831489	TBK113
60666949	MVB1045R6	71739512	MVB1270R6	96188879	MVB1115R6	9400831529	TBK035
60666950	MVB1842R6	71739605	SVB13750	96188881	MVB1740R6	9400831559	TBK279
60667050	MVB1285R6	71739606	MVB545R4	96197793	TB419	9400831589	TBK105
60667257	MVB1820R6	71739607	MVB673R4	96205509	MVB1600R6	9400831609	TBK303
60670506	TB468	71739608	MVB706R4	96209038	MVB730R6	9400831629	TBK106
60672889	TB559	71739609	MVB940R4	96225212	MVB1115R6	9400831789	TBK106
60674147	MVB1795R6	71739610	MVB960R5	96225213	MVB1740R6	9400831829	TBK106
60676137	MVB1025R6	71739618	MVB887R5	96236847	MVB1165R6	9400831869	TBK312
60807260	TB579	71739620	MVB938R6	96242335	MVB747R4	9400831889	TBK279
60808684	MVB906R5	71739621	MVB945R4	96242336	MVB747R4	9400831929	TBK338
60808954	MVB1180R7	71739873	TB741	96242337	MVB1740R6	9463380180	TB678
60809160	MVB938R5	71739900	SVB10913	96242338	MVB1105R6	9463380680	TB632
60812382	TB732	71739905	MVB938R5	96267903	MVB1388R6	9464034380	TB720
60813756	MVB1045R6	71739908	SVB10650	96284665	MVB1740R6	9464464980	TB683
60814395	MVB1855R6	71739910	MVB1755R6	96290540	MVB1740R6	9464640380	TB742
60814603	TB639	71739911	MVB975R5	96294857	MVB860R6	9464867280	MVB1675R6
60815988	MVB1855R6	71739914	MVB1952R7	96294872	MVB1025R6	9467544580	TBK355
60816232	TB559	71739916	MVB1795R6	96307961	MVB1755R6	9467565880	TB724
60816661	MVB1760R6	71739918	TB320	96313338	MVB1740R6	9467581780	TB711
71712149	MVB1050R5	71739919	TB560	96324103	MVB1740R6	9614284080	MVB698R6
71718718	MVB673R4	71739921	MVB1660R6	96324104	MVB1740R6	9615207880	MVB1660R6
71718838	MVB835R4	71739922	TB419	96330104	MVB1045R6	9615208280	MVB1065R6
71719007	MVB985R5	71739923	MVB1740R6	96334781	MVB1469R6	9615208480	MVB1080R6
71719039	MVB698R4	71739924	MVB1740R6	98415921	TB701	9615208980	MVB1100R6
71719079	MVB925R5	71739925	MVB775R4	98419390	TB368	9617012680	MVB1150R6
71719174	MVB915R4	71739928	MVB915R6	98455448	MVB887R5	9618887980	MVB1115R6
71719394	MVB1842R6	71739929	MVB946R6	98487322	MVB890R6	9620550980	MVB1600R6
71719396	MVB986R6	71742126	MVB810R4	99456476	TB368	9620903880	MVB730R6
71719397	MVB950R5	71742127	MVB836R5	99456477	TB558	9622521280	MVB1115R6
71719398	MVB915R3	71743889	MVB1388R6	99461393	MVB915R6	9623436980	MVB1155R6
71719400	MVB1137R6	71744462	MVB1250R6	99462544	MVB1100R5	9623684780	MVB1150R6
71719401	MVB1775R6	71744463	MVB795R6	465462540	TB798	9624233580	MVB747R4
71719407	MVB970R5	71745115	MVB1180R6	500323627	TB701	9624233680	MVB747R4
71719640	SVB131050	71746353	TBK314	500344281	MVB1100R5	9624233880	MVB1105R6
71719641	SVB10865	71746481	MVB795R6	500345344	MVB915R6	9629054080	MVB1740R6
71719643	TB608	71746482	MVB1250R6	500346828	MVB946R6	9630796180	MVB1755R6
71719644	MVB1050R6	71746714	MVB1388R6	500371975	TB723	9632959380	TB727





OE		OE		OE		OE	
...FIAT		...FORD		...FORD		...FORD	
9633010080	MVB860R6	3M5Q6K288AB	TB724	78TF8620CA	SVB121015	85TF6C301DB	SVB121040
9633010480	MVB1045R6	3M5Q6K288BA	TB742	78TF8620EA	SVB101150	85TF6C301F1A	SVB13900
9633478180	MVB1469R6	3M5Q6K288CA	TB724	79EF8620CA	SVB10760	85TF6C301F2A	SVB13900
9637053980	TB683	3M5Q8A615AA	TBK302	79TF6C301DA	SVB10975	85TF6C301FA	SVB13900
9637240580	TB683	3M5Q8A615AB	TBK302	79TF8A615AA	SVB101010	85TF6C301GA	SVB131175
9637513980	TB678	3M5Q8A615BA	TBK338	79TF8A615AA	SVB121015	85TF8A615D1A	SVB131175
9637514080	TB678	3M5Q8A615CA	TBK302	80HF6C301BA	SVB10865	85TF8A615D2A	SVB131175
9637529480	MVB1440R6	3S5Q6C301BA	MVB2190R6	80HF6C301BA	SVB12865	85TF8A615DA	SVB131175
9638027080	MVB1580R6	4L5E8620EA	MVB2205R6	80TF6C301BA	SVB131150	85TF8A615EA	SVB121040
9638234780	MVB1469R6	4L5Z8620EA	MVB2205R6	80TF6C301DA	SVB101000	86AB2M016AB	TB251
9638464180	MVB1740R6	4M5Q6C301CA	MVB795R6	81AB6C301DB	SVB10760	86AB2M016AC	TB251
9640669280	TB720	4M5Q6C301DA	MVB975R6	81AB6C301DB	SVB12770	86AB6C301AA	SVB10775
9640810680	TB720	4M5Q6C301EB	MVB1215R6	81AB6C301EB	SVB10800	86AB6C301AA	SVB12770
9641069580	MVB1190R6	4M5Q6C301EC	MVB1215R6	81AB6C301EB	SVB12795	86AB6C301BA	SVB10750
9641198680	MVB1440R6	4M5Q6C301FC	MVB1215R6	81SM6268GE	TB239	86AB6C301BA	SVB10760
9642430680	MVB1180R6	4S4Q6C301CB	MVB2225R6	81SM6268HE	TB240	86AB6C301BA	SVB12760
9644846680	MVB1740R6	4U3Q6C301AA	MVB1885R6	82DB8N620BB	SVB101000	86BB8A615AA	SVB10913
9647463180	MVB1469R6	5L8Q6C301AB	MVB2271R6	82EF6C301AA	SVB10775	86EF6C301AA	SVB131150
9651255780	MVB1560R6	5M5Q6C301CA	MVB1350R6	83BB6C301AA	SVB10913	86EF6C301BA	SVB131025
9652250480	MVB870R6	5S6G6006AA	MVB2215R6	83BB6C301AB	SVB10913	86EF6C301CA	SVB10690
9652250580	MVB870R6	5S6G6006AC	MVB2215R6	83DB10C318AA	MVB825R5	86SF6C301AA	SVB10690
9652746480	MVB1180R6	5S6Q6C301BA	MVB2215R6	83EF8620AA	SVB10950	86SM6268EA	TB239
9655945780	MVB1215R6	6C1Q6C301CB	MVB1675R6	83EF8620CA	SVB101075	86SM6268FA	TB240
9658643680	MVB1200R6	6C1Q6C301CC	MVB1675R6	83EF8A615AA	SVB10950	86TF6C301AA	SVB101010
9662806680	MVB1675R6	6G9Q6C301BA	MVB1200R6	83GB6C301AA	SVB101000	86TF6C301AA	SVB121015
9664471589	MVB1388R6	6G9Q6C301CA	MVB2196R6	83HF6C301AA	SVB10875	86TF6C301BA	SVB10975
EA03231005	SVB10750	6G9Q6C301DB	MVB1685R6	83HF6C301AA	SVB12875	86TF6C301CA	SVB10888
EA03231005	SVB10750	6G9Q6C301EA	MVB1685R6	83HF8A615AA	SVB101175	86TF6C301CA	SVB12885
ES03231002	SVB10750	6H5Q6C301BA	MVB1740R6	83HF8A615AA	SVB121170	87SF6C301CA	MVB788R5
ES03231000	SVB10750	6M5Q6C301FA	MVB795R6	83TF6C301CA	SVB131225	87TF8A615A1A	SVB131200
FORD		7G9Q6C301BA	MVB2250R6	83TF6C301DA	SVB101000	87TF8A615A2A	SVB131200
1C1Q6C301BA	MVB1775R6	69DB2890BA	SVB131025	84AB6C301AA	SVB10800	88EF6C301AC	SVB13950
1C1Q6C301CB	MVB1950R6	70TF8620AA	SVB101075	84AB6C301AA	SVB12795	88EF6C301BA	SVB131025
1C1Q6C301DA	MVB1642R6	70TF8620DA	SVB131200	84AB6C301BA	SVB10790	88EF6C301CA	SVB131150
1C1Q6K288AA	TB629	70TF8620EA	SVB101000	84AB6C301BA	SVB12785	88HF6C301AA	SVB131025
1C1Q6K288BA	TB370	70TN8620AA	SVB101175	84FM6268AA	TB201	88WF6C301B1A	MVB1820R6
1C1Q6M260AA	TBK334	70TN8620PA	SVB101050	84HF6C301AA	SVB10888	88WF6C301B1B	MVB1820R6
1C1Q6M260BA	TBK077	71HF8620AB	SVB10865	84HF6C301AA	SVB12885	88WF6C301B2A	MVB1820R6
1F1E8620AB	MVB2160R6	71HF8620CA	SVB10865	84HF6C301BA	SVB10875	88WF6C301C1B	MVB1560R6
1M216268AA	TB384	71TF8620AA	SVB101000	84HF6C301BA	SVB12875	88WF6C301C2B	MVB1560R6
1S4Q6C301AA	MVB1420R6	72HF8620BA	SVB10875	84SF6C301AB	SVB10675	88WF6C301D1A	MVB1960R6
1S4Q6C301BA	MVB1715R6	72TF8620BA	SVB131175	84SF6C301AC	SVB10665	88WF6C301E2B	MVB1270R6
1S7Q6C301AA	MVB2225R6	72TF8620DA	SVB101150	84SF6C301AC	SVB12670	88WF6C301F2A	MVB1820R6
1S7Q6C301AB	MVB2225R6	74TF8620EA	SVB131225	85BB6C301AA	SVB10925	88WF6C301G1A	MVB1805R6
1S7Q6C301CA	MVB1642R6	74TF8620FA	SVB131275	85EF8620AA	SVB10710	88WF6C301G2A	MVB1805R6
2C1Q6C301AA	MVB1642R6	76HF8620BA	SVB10865	85EF8620AB	SVB10710	88WF6C301H1A	MVB1950R6
2M5V6C301AA	MVB2120R6	76HF8620CA	SVB10865	85EF8620CA	SVB101075	88WF6C301H2A	MVB1950R6
2S616C301CA	MVB1335R6	76HF8620CA	SVB12865	85EF8A615AA	SVB10950	89AB6C301AB	MVB915R6
2S6G6C301AA	MVB2240R6	76TF8620BA	SVB101000	85HF6C301AA	SVB12885	89BF6C301A1A	SVB10800
2S6G6C301BA	MVB2190R6	76TF8620DA	SVB101150	85HF6C301BB	SVB101175	89BF6C301A1A	SVB12795
2S6G6C301CA	MVB2190R6	77BF6C301AC	SVB10800	85HF6C301BB	SVB121170	89BF6C301A1B	SVB10800
2S6G6C301JA	MVB1685R6	77DB2890AA	SVB131025	85HF6C301F1A	SVB10913	89BF6C301A1B	SVB12795
2S6G6C301KA	MVB2170R6	78EF8620CA	SVB101200	85HF6C301F2A	SVB10913	89BF6C301A2B	SVB10800
2S6Q6K288AA	TB720	78EF8620DA	SVB10690	85HF6C301FA	SVB10913	89BF6C301A2B	SVB12795
2S6Q6K288AB	TB720	78EF8620EA	SVB10760	85HF6C301I1A	SVB10975	89FB2M016AA	TB252
2S6Q6K288AC	TB720	78HF8620BA	SVB121040	85HF8509AA	SVB101175	89FF10039AB	MVB648R3
2S6Q8A615AA	TBK230	78HF8620BB	SVB101010	85HF8509AA	SVB121170	89FF6268AA	TB495
2S6Q8A615AB	TBK230	78HF8620BB	SVB121015	85HF8A615AA	SVB10888	89FF6268AB	TB495
2T1Q6K288AA	TB681	78HF8620CA	SVB10865	85HF8A615AA	SVB12885	89FF6C301A2C	MVB648R3
2T1Q6M260AA	TBK278	78HF8620CA	SVB12865	85HF8A615BB	SVB101175	89FF6C301A2D	MVB648R3
3M216268AA	TB680	78HF8A615AA	SVB121040	85HF8A615BB	SVB121170	89FF6C301B1A	MVB825R3
3M5Q6C301AA	MVB1306R6	78TF6C301BA	SVB131275	85HF8A615CA	SVB10913	89FF6C301B2B	MVB825R3
3M5Q6C301AA01	MVB1306R6	78TF6C301CA	SVB131275	85SF6C301AA	SVB10675	89FF6C301D1A	MVB1025R3
3M5Q6K288AA	TB724	78TF8620CA	SVB101010	85TF6C301AA	SVB121015	89FF6C301D2B	MVB1025R3







OE		OE		OE		OE	
...FORD		...FORD		...FORD		...FORD	
89FF6C301E2A	MVB810R3	95VW6268DA	TB384	404E8620	SVB10960	974F6C301AA	SVB13975
89FF6C301E2B	MVB810R3	95VW6268DB	TB384	622E8620A	SVB131150	974F6C301BA	MVB1488R4
89FF6K288AB	TB237	95VW6C301AA	MVB1150R6	683F8620BA	SVB131150	974F6C301CA	MVB1510R4
89FF6K288AC	TB237	95VW6C301AB	MVB1150R6	683F8620GAA	SVB131350	974F6C301CE	MVB1510R4
89SM6268AC	TB240	95VW6C301AC	MVB1150R6	691F8620AA	SVB10750	974F6K288AB	TB629
89SM6268BC	TB239	95VW6C301CA	MVB1045R6	692F8A602AA	SVB101250	974F6K288AC	TB629
89VB6C301AA	SVB131075	95VW6C301CB	MVB1050R6	703F8620ACA	SVB131350	978M6268A1A	TB633
90FF6268BA	TB495	95VW6C301JA	MVB1285R7	703F8620ADA	SVB131150	978M6268A1B	TB633
91FF6C301A1A	MVB1015R5	95VW6C301KA	MVB1360R7D	715F2890AAA	SVB10925	988M6268A2A	TB633
91FF6C301A2A	MVB1015R5	95WF6C301EB	MVB1570R6	715F2890ABA	SVB10925	988M6268A2B	TB633
91SF6C301A1A	MVB1635R6	95WF6C301GA	MVB1755R6	715F2890ABA	SVB10940	2400E8620A	SVB101025
91SF6C301A2A	MVB1635R6	95WF6C301HA	MVB1904R6	715F8620ABA	SVB10888	2400E8A602A	SVB101350
91SF6C301A2B	MVB1635R6	95X1003LA	SVB101000	715F8620ACA	SVB101250	2703E8620A	SVB131375
91SF6C301B1A	MVB1420R6	95X1007LA	SVB101000	715F8620ADA	SVB101300	2706E8620	SVB131150
91SF6C301B2A	MVB1420R6	95X1175LA	MVB101175	715F8620AEA	SVB101175	2715E8A615B	SVB101475
91SF6C301B2C	MVB1420R6	96FB6C301AA	SVB10825	718F8620AAA	SVB101050	2720E8A6028	SVB101325
91SF6C301C1B	MVB1000R6	96FB6C301AC	MVB860R6	722F820EB	SVB101325	2720E8A602B	SVB101325
91SF6C301C2B	MVB1000R6	96FB6C301BC	MVB1740R6	722F8620DC	SVB13900	2720E8A602B2	SVB101325
91SF6C301C2C	MVB1000R6	96FB6C301CD	MVB1440R6	722F8620EB	SVB101325	2720E8A602C	SVB101375
91SM6268AA	TB389	96FF6268DA	TB495	722F8620FA	SVB101300	2724E8A602B	SVB101225
91SM6268AAA	TB389	96FF6268DB	TB495	723F8620AAA	SVB131150	2725E8A602A	SVB101300
91SM6268BA	TB240	96FF6C301A2A	MVB1015R5	723F8620AEA	SVB101175	2733E8620A	SVB10750
91TF6C301A1D	MVB1413R6	96FF6C301AC	MVB887R5	723F8620AHA	SVB101200	2735E8620A	SVB10800
91TF6C301A2D	MVB1413R6	96FF6C301AE	MVB887R5	742F8620AA	SVB13900	2735E8620C	SVB10800
91TF6C301B1C	MVB960R4	96FF6C301AF	MVB887R5	742F8620BA	SVB101350	3020E8620A	SVB10790
91TF6C301B2C	MVB960R4	96FF6C301BC	MVB1135R5	761F8620AA	SVB10800	11950G2401	SVB131150
91TX6C301A1D	MVB1413R6	96FF6C301BE	MVB1141R5	762F8620AA	SVB101300	117200F000	SVB131150
91XF6C301B1B	MVB1350R6	96FF6C301CC	MVB675R5	762F8620BA	SVB101325	117200F300	SVB10900
91XF6C301B2B	MVB1350R6	96FF6C301CD	MVB675R5	785F8620AAA	SVB101250	119200F000	SVB13925
91XX6C301B1B	MVB1350R6	96FF6C301DA	MVB1015R5	801F6C301DA	SVB10813	119200F300	SVB13925
92FB6C301AA	SVB10800	96FF6C301EA	MVB1030R5	821F6C301AA	SVB10825	119500F300	SVB131150
92FB6C301AA	SVB12795	96FF6C301FA	MVB1030R5	821F6C301AC	SVB10825	0436104	SVB101100
92FF6C301A2A	MVB673R3	96FF6C301GA	MVB710R5	826F8620EDA	SVB131450	0436795	SVB101125
92FF6C301BB	MVB710R5	96FF6K288AA	TB496	826F8620EEA	SVB131500	504101	SVB10825
92FJ6C301A2A	MVB673R3	96FF6K288AB	TB496	844F8620AA	SVB101275	526149	SVB10850
92SF6C301A2A	MVB1050R5	96MF6C301AC	MVB1180R6	864F8620A1A	MVB1520R4	800722	SVB101175
92TF6C301B1A	MVB1413R6	96MF6C301BC	MVB1755R6	864F8620A2A	MVB1520R4	801779	SVB101000
92TF6C301B2A	MVB1413R6	96MF6C301CC	MVB1930R6	864F8620AA	MVB1520R4	1000156	TB633
92XF8620BA	MVB1510R4	96MF6C301DB	MVB1775R6	924F6C301AA	SVB131025	1000158	TB633
93BB6C301AA	MVB1715R6	96MM6K288A1A	TB472	924F6K288AA	TB370	1000459	SVB13975
93BB6C301AB	MVB1715R6	96MM6K288A2A	TB472	924F6K288AB	TB370	1004297	TB472
93BB6C301BD	MVB2080R6	96WF6C301BA	MVB1755R6	924F6K288AC	TB370	1004299	TB472
93BB6C301BE	MVB2080R6	97AB6C301AA	MVB1675R6	924F8620AA	MVB1488R4	1004484	MVB1180R6
93BB6C301CD	MVB869R5	97FF6C301AD	MVB1141R5	924F8620BA	MVB1520R4	1004485	MVB1755R6
93BB6C301DD	MVB575R5	97KB6C301BA	MVB1760R6	928F6C301A1C	MVB915R6	1004486	MVB1930R6
93BB6C301EC	MVB887R5	97KB6C301DA	MVB1930R6	928F6C301C1A	MVB1904R6	1004487	MVB1775R6
93FF6C301AA	MVB1015R5	97WF6C301BA	MVB1570R6	928F6C301C1B	MVB1904R6	1004582	MVB860R6
93FF6C301DA	MVB1015R5	97WF6C301CA	MVB1904R6	928F6C301C2A	MVB1904R6	1004583	MVB1740R6
93TF6C301A1A	MVB975R4	98BB6C301AA	MVB1980R6	928F6C301E1A	MVB1538R6	1005824	TB496
93TF6C301A2A	MVB975R4	98BB6C301BA	MVB2100R6	928F6C301E2A	MVB1538R6	1005828	TB495
94AB6C301AA	MVB1675R6	98BB6C301CA	MVB2120R6	928M6268A1A	TB390	1009900	MVB1440R6
94AB6C301C1A	MVB1015R6	98FB6C301AA	SVB10825	928M6268A1B	TB390	1011614	MVB1950R6
94AB6C301D1B	MVB1650R6	98FF6C301CD	MVB1413R6	928M6268A2C	TB390	1011616	MVB1413R6
94FB6C301A2C	MVB938R6	98FF6C301DD	MVB1715R6	928M6268A2D	TB390	1011696	MVB1350R6
94FB6C301B2A	MVB915R6	98KB6C301AA	MVB1450R6	928X6C301A1C	MVB915R6	1011697	MVB915R6
94FF6C301AC	MVB648R4	98MF6C301BC	MVB1740R6	928X6C301C1B	MVB1904R6	1011698	MVB1904R6
94WF6C301A1B	MVB1413R6	98MF6C301CC	MVB1885R6	930X8620DA	SVB101175	1013197	MVB2100R6
94WF6C301B1B	MVB1775R6	98MF6C301DA	MVB1913R6	930X8620DA	SVB121170	1013202	MVB2080R6
94WF6C301D1B	MVB1930R6	98VW6A359CA	MVB1200R6D	944F6C301CA	MVB1635R6	1014374	MVB1715R6
94WF6C301E1A	MVB1980R6	105E8620	SVB10750	948F6C301AB	MVB1260R6	1015694	MVB1420R6
95BB6C301AA	MVB2100R6	105E8620A	SVB10750	948F6C301BA	MVB1538R6	1017591	MVB887R5
95TF6C301BA	MVB1015R4	118E8620A	SVB10750	948F6C301DA	MVB1550R6	1017592	MVB1141R5
95VW3F572CA	SVB12735	204E8620B	SVB10850	954F8620AB	MVB1488R4	1017593	MVB675R5
95VW3F572FA	SVB12735	204E8620C	SVB10850	954F8620BB	MVB1510R4	1019889	MVB1440R6

OE		OE		OE		OE	
...FORD		...FORD		...FORD		...FORD	
1028278	MVB1015R5	1122448	TB629	1430000	SVB101475	1669898	TB384
1028279	MVB1030R5	1124040	TBK278	1430423	SVB10790	1718757	SVB101025
1028280	MVB710R5	1124040KIT	TBK278	1434283	MVB1675R6	1719095	SVB131075
1033063	MVB1910R7	1125415	MVB1642R6	1438244	MVB1215R6	1776433	SVB131150
1033500	MVB1755R6	1127235	MVB1685R6	1446647	TB724	1798078	SVB101375
1036916	MVB1930R6	1127408	MVB1775R6	1446648	TBK302	1805736	SVB131400
1036917	MVB1760R6	1129181	MVB2710R7	1456704	SVB101350	1820459	SVB101450
1037149	TB384	1129182	MVB2875R7	1462109	SVB131025	1822583	SVB131400
1037660	TB633	1129745	MVB1950R6	1471768	MVB2250R6	1827214	SVB131450
1039797	SVB12735	1131812	TB680	1473402	MVB2215R6	1827336	SVB131400
1039799	MVB1141R5	1133958	MVB1420R6	1473889	SVB10865	1836785	SVB131400
1039800	MVB925R6	1133960	MVB1715R6	1477934	SVB101075	1845565	SVB131400
1040760	MVB1570R6	1135354	TB629	1482546	SVB101000	1952516	SVB10900
1041193	MVB1755R6	1135355	TB370	1489119	TB720	1952536	SVB13925
1041194	MVB1930R6	1135358	TBK077	1494726	SVB131175	1952550	SVB131150
1049578	MVB1980R6	1135719	MVB1150R6	1502521	SVB10888	1952551	SVB131150
1049613	MVB2100R6	1136426	TBK334	1502917	SVB10925	1952553	SVB131150
1049653	TB629	1137008	MVB1913R6	1502917	SVB10940	1956125	SVB13925
1050417	MVB2120R6	1141314	MVB1335R6	1502948	SVB101250	1956127	SVB131150
1053837	TB633	1145904	TB384	1502949	SVB101175	1956128	SVB13925
1056892	TB370	1145950	TB720	1503819	SVB10925	3023801	MVB2080R6
1057840	MVB1488R4	1195043G00	SVB131150	1505426	SVB101300	3137439	TB371
1058723	SVB12735	1201255	TBK278	1506943	SVB101150	3252663	TB590
1059982	MVB1510R4	1202679	MVB1685R6	1508233	SVB101050	3252729	SVB131125
1063290	SVB10825	1202680	MVB2170R6	1511349	SVB13900	3256730	TB590
1068252	MVB1904R6	1206466	MVB1642R6	1517293	SVB101300	3396755	TB371
1072316	MVB1740R6	1211185	TBK230	1539585	MVB795R6	3396756	TB399
1072317	MVB1885R6	1215977	TB681	1540766	SVB131150	3396930	MVB1030R5
1079383	MVB1413R6	1217320	TB633	1561698	SVB131075	3396931	MVB920R4
1079384	MVB1715R6	1229548	MVB795R6	1576572	SVB10690	3396932	MVB1165R5
1079390	TB681	1229549	MVB975R6	1576573	SVB101200	3396934	MVB865R5
1084993	MVB1675R6	1229723	TB724	1576983	SVB10760	3396935	MVB1015R5
1085038	MVB1450R6	1229768	TBK302	1599251	SVB131450	3406363	MVB920R4
1087286	MVB887R5	1231960	MVB1215R6	1612264	SVB10950	3501607	MVB2415R6
1089877	MVB1700R6	1231976	TB742	1612265	SVB10725	3593430	TB536
1093816	MVB1141R5	1231979	TBK338	1612266	SVB101075	3610825	SVB131475
1094675	MVB1930R6	1232500	MVB1306R6	1617272	SVB101000	3730289	MVB1015R5
1095321	MVB1030R5	1250636	TB680	1629874	SVB10913	3815689	SVB131000
1097332	MVB1050R6	1253937	MVB1215R6	1629875	SVB101175	3900579	TB358
1099892	MVB2710R7	1303612	MVB673R3	1629875	SVB121170	3902552	MVB1165R5
1099893	MVB2875R7	1303613	MVB1015R5	1631113	SVB10710	3904815	SVB13775
1100672	TB680	1303929	MVB2190R6	1634741	SVB10900	3910825	SVB131475
1102331	TB496	1308095	MVB2225R6	1634792	SVB10775	3919416	SVB131450
1102826	MVB1613R6	1316337	MVB1350R6	1634792	SVB12770	3933965	SVB13950
1102827	MVB1642R6	1320286	MVB1675R6	1638510	SVB10975	3935008	MVB2080R6
1108752	TBK012	1343139	MVB2215R6	1638514	SVB10888	3950922	SVB13825
1108756	TBK121	1343681	MVB2271R6	1638514	SVB12885	3968234	MVB2170R6
1108758	TBK121	1346473	TB720	1639171	TB319	3973814	MVB1015R5
1110999	TBK014	1348648	TBK230	1643815	SVB10913	3973914	MVB1015R5
1111241	MVB1325R6D	1361185	MVB1350R6	1646285	SVB10975	4001215	MVB1820R6
1111242	MVB1325R6D	1373250	TB724	1646286	SVB131000	4005448	SVB131175
1111928	MVB1200R6D	1373306	TBK302	1648292	SVB10913	4024820	MVB1820R6
1112530	TBK110	1376104	MVB2205R6	1648398	SVB10913	4038260	MVB920R4
1112531	TB390	1380026	TBK326	1650770	MVB1820R6	4070307	TB358
1112854	MVB1930R6	1380026	TBK327	1650771	MVB1960R6	4071946	MVB2190R6
1112954	MVB1930R6	1381643	MVB1200R6	1652627	TB252	4160169	MVB2080R6
1113169	TB495	1381645	MVB1685R6	1653887	TB240	4187984	MVB2160R6
1113179	TB496	1383663	MVB1675R6	1653888	TB239	4188176	MVB2160R6
1113180	TB681	1387692	MVB2225R6	1654387	MVB915R6	4188206	MVB1820R6
1113182	TB496	1387693	MVB2215R6	1657013	TB495	4335876	MVB2080R6
1119151	MVB1260R6	1416245	MVB2196R6	1660554	TB240	4404004	MVB2120R6
1120198	MVB2225R6	1418182	MVB1685R6	1660555	TB239	4600280	MVB2080R6
1120199	MVB735R4	1422141	MVB2215R6	1663391	TB390	5013543	SVB10950
1122447	TB370	1427353	MVB1740R6	1663392	TB390	5016346	SVB13850







OE		OE		OE		OE	
...FORD		...FORD		...FORD		...FORD	
5016347	SVB10625	6144781	SVB13900	6196579	SVB10800	7019148	MVB1538R6
5029455	SVB101175	6144787	SVB131175	6196579	SVB12795	7040340	MVB825R4
5029455	SVB121170	6146114	SVB121040	6198309	MVB1270R6	7064725	MVB1413R6
5030074	MVB1510R4	6146160	SVB10888	6200264	MVB1904R6	7064726	MVB1775R6
6008696	SVB101200	6146160	SVB12885	6200265	MVB1904R6	7064727	MVB1930R6
6025814	SVB131225	6146161	SVB10875	6200268	MVB1538R6	7064728	MVB1980R6
6033739	SVB101350	6146161	SVB12875	6200269	MVB1538R6	7082866	MVB1015R4
6044423	SVB10800	6146319	MVB1520R4	6460878	MVB1413R6	7120853	MVB1635R6
6044992	SVB10865	6146320	MVB1520R4	6460879	SVB10990	7136447	MVB1015R6
6044992	SVB12865	6147689	SVB10950	6475968	TB495	7136449	MVB1650R6
6044993	SVB101000	6153229	SVB10913	6483250	MVB1000R6	7143870	MVB1675R6
6044994	SVB101150	6154540	SVB101175	6483251	MVB1000R6	7158659	MVB648R4
6044995	SVB10800	6154540	SVB121170	6511601	MVB1560R6	7174114	TB237
6044996	SVB101300	6155206	SVB10913	6511602	MVB1560R6	7198530	MVB1150R6
6049674	SVB10813	6155998	SVB101010	6518069	MVB1488R4	7198532	MVB1045R6
6052763	SVB131275	6155998	SVB121015	6518322	MVB1520R4	7198535	MVB1285R7
6057341	SVB131275	6156360	SVB10925	6534254	MVB960R4	7198536	MVB1360R7D
6057343	SVB101010	6156990	TB251	6534255	MVB960R4	7204035	MVB1820R6
6057343	SVB121015	6158123	SVB13900	6550963	MVB1350R6	7204036	MVB1588R6
6058147	SVB121040	6158124	SVB13900	6550964	MVB1350R6	7239510	MVB1570R6
6058199	SVB101010	6158131	SVB131175	6592377	MVB1050R5	7252517	MVB1488R4
6058199	SVB121015	6158132	SVB131175	6593893	MVB673R3	7252518	MVB1510R4
6058200	SVB10865	6158518	SVB10760	6606513	MVB1413R6	7310608	MVB1755R6
6058200	SVB12865	6158691	SVB10675	6606514	MVB1413R6	7310609	MVB1904R6
6058201	SVB101150	6158758	SVB10950	6613362	MVB1413R6	7410970	MVB1015R5
6065559	SVB101250	6158759	SVB10710	6613363	MVB1413R6	10111698	MVB1904R6
6069433	SVB131025	6161559	SVB10975	6680459	MVB648R3	11425146	SVB10950
6070707	SVB10975	6162731	TB239	6680460	MVB810R3	11436104	SVB101100
6077865	SVB10813	6162732	TB240	6711044	TB389	11436795	SVB101125
6086008	SVB101010	6166102	SVB131150	6711046	TB240	11436796	SVB101250
6086008	SVB121015	6166103	SVB131025	6727879	MVB1715R6	11436933	SVB101215
6088696	SVB131500	6166104	SVB10690	6738365	MVB915R6	11436934	SVB101100
6090671	SVB10800	6167901	SVB10690	6738366	MVB915R6	11446026	SVB10950
6090671	SVB12795	6168158	MVB1820R6	6758562	MVB1635R6	11446055	SVB101000
6092137	TB239	6169928	SVB131200	6758564	MVB1000R6	11448389	SVB101225
6092138	TB240	6169929	SVB131200	6764161	TB390	11464038	SVB101075
6094632	SVB101275	6170166	MVB825R3	6764162	TB390	028260849D	MVB1150R6
6096292	SVB131150	6174131	SVB131025	6776020	MVB887R5	028903137AM	MVB925R6
6098572	SVB101000	6174797	SVB10800	6788619	MVB1805R6	028903137T	MVB1045R6
6104232	SVB10825	6174797	SVB12795	6788621	MVB1950R6	038109119N	TB680
6104676	SVB10775	6175292	SVB10913	6788622	MVB1950R6	839718381A	SVB13950
6107712	SVB10875	6177887	TB237	6792801	SVB10800	9640115880	MVB795R6
6107712	SVB12875	6180848	MVB1015R5	6792801	SVB12795	9640115980	MVB795R6
6107729	SVB101175	6180849	MVB1015R5	6793377	MVB975R4	9642383780	MVB975R6
6107729	SVB121170	6180852	MVB1635R6	6793378	MVB975R4	9642383980	MVB975R6
6109189	TB239	6180853	MVB1635R6	6805275	MVB985R4	9648968580	TB724
6109190	TB240	6180854	MVB1420R6	6811351	MVB2080R6	9659795080	TB724
6109565	SVB131225	6180855	MVB1420R6	6830821	TB389	9936621040	MVB1035R6
6110531	SVB10913	6182205	MVB1520R4	6830822	TB240	A86AX6C301AA	SVB13850
6111516	TB201	6182328	MVB648R3	6833788	MVB1820R6	A86AX6C301BA	SVB10625
6112414	SVB101000	6182475	SVB131025	6833789	MVB1904R6	A850X8620BCA	SVB10950
6122575	SVB101075	6182476	SVB131150	6842244	MVB869R5	C5NE8620B	SVB131400
6126515	SVB10675	6182611	MVB788R5	6844096	MVB1650R6	C7NN8620A	SVB101450
6132587	SVB10888	6182615	MVB1820R6	6904228	MVB1015R5	C9NN10C318A	SVB131400
6132587	SVB12885	6183196	TB251	6911495	MVB575R5	C9NN10C318B	SVB131400
6132588	SVB101175	6185100	MVB1025R3	6958518	SVB10750	CC5TZ8A615L	SVB131075
6132588	SVB121170	6185651	MVB648R3	6958518	SVB12760	D2AE8A615FA	SVB131075
6134738	SVB10800	6185652	MVB810R3	6960612	MVB1260R6	D2NN8620A	SVB131450
6134738	SVB12795	6187610	TB495	6961947	MVB1650R6	D3NN10C318A	SVB131400
6134739	SVB10790	6188985	SVB131075	6992533	MVB938R6	D3NN10C318C	SVB131400
6134739	SVB12785	6189780	SVB13950	6994216	MVB710R5	D4NN10C318A	SVB131400
6138211	SVB121040	6195101	TB370	7003984	MVB915R6	D5NN10C318C	SVB13775
6141305	SVB10665	6196578	SVB10800	7007791	MVB860R4	D6NN8620B	SVB131475
6141305	SVB12670	6196578	SVB12795	7008652	MVB1550R6	D8NN10C318AA	SVB131450





OE		OE		OE		OE	
...FORD		...FORD		...HONDA		...HONDA	
E0TA8620C	SVB10813	XS4Q6K288AA	TB681	14400P7A004	TB736	31110P75004	MVB790R4
EJ3V0897	SVB13900	XS4Q6K288AB	TB681	14400P7J004	TB616	31110PA17410	SVB10950
EJ3V1080	SVB131075	XS6E6C301BB	MVB1700R6	14400P8AA01	TB805	31110PA17420	SVB10950
EJ4K1010	MVB1015R4	XS6E6C301JA	MVB1930R6	14400P8AA02	TB805	31110PA6003	SVB10950
EJ6K1350	MVB1350R6	XS6E6C301JB	MVB1930R6	14400PAAA01	TB538	31110PA60030	SVB10950
EJ6K1415	MVB1413R6	XS6Q6K288BA	TB496	14400PAAA02	TB538	31110PA6004	SVB10950
EJ6K1654	MVB1650R6	XS6Q6K288BB	TB496	14400PC6004	TB202	31110PA60040	SVB10950
E0TA8620C	SVB10813	XS7E6C301CC	MVB735R4	14400PD2004	TB202	31110PA6911	SVB10975
E0TA8620C2	SVB10813	YC1E6C301AB	MVB2710R7	14400PDAE01	TB538	31110PA6912	SVB10975
F7PE8620BA	MVB2080R6	YC1E6C301BB	MVB2875R7	14400PE0004	TB203	31110PC10030	MVB975R3
F7PE8620BB	MVB2080R6	YC1E6C301CB	MVB2710R7	14400PE3004	TB203	31110PCXG01	MVB1137R6
F32Z6268A	TB371	YC1E6C301DB	MVB2875R7	14400PG6004	TB355	31110PD2003	MVB945R4
F32Z6268B	TB399	YM216C301CA	MVB1325R6D	14400PG6014	TB355	31110PD2004	MVB945R4
F32Z8620A	MVB1030R5	YM216C301EA	MVB1260R6	14400PH7003	TB312	31110PDAE01	MVB946R6
F32Z8620B	MVB920R4	YS4J6K288AA	TBK012	14400PH7004	TB312	31110PE00030	MVB735R3
F32Z8620C	MVB1165R5	YS4J6K288BA	TBK014	14400PH7014	TB312	31110PE0004	MVB735R3
F32Z8620J	MVB1015R5	YS4J6K288CA	TBK121	14400PH70140	TB312	31110PE00040	MVB735R3
F32Z8620K	MVB920R4	YS4J6K288DA	TBK121	14400PK1004	TB317	31110PE8601	MVB960R3
F53E8620AB	MVB1820R6	YS4Q6M260AA	TBK278	14400PK2004	TB272	31110PE8602	MVB960R3
F53E8620AP	MVB1820R6	YS6E6C301AB	MVB1613R6	14400PLA004	TB736	31110PFB003	MVB668R3
F53E8620BP	MVB1588R6	YS6E6C301BB	MVB1685R6	14400PLM014	TB749	31110PG60030	MVB715R3
F83E8620AA	MVB1820R6	YS7J6268AB	TBK110	14400PLZD00	TB740	31110PG60040	MVB715R3
F89E8620CB	MVB2170R6	YS7J6268BA	TB390	14400PM3004	TB316	31110PG6030	MVB715R3
FS0112205A	TB371	YS7J6268CA	TBK326	14400PM6004	TB317	31110PG7661	MVB715R3
FS0515909	MVB1165R5	FORD USA		14400PM7004	TB272	31110PG76610	MVB715R3
FS1115907	MVB1030R5	6C1Q6C301FA	MVB2205R6	14400PMMMA01	TB749	31110PH0003	MVB938R5
FS1218381A	MVB920R4	FSO		14400PMMMA02	TB749	31110PH2003	MVB938R5
H72AB8620AA	SVB10825	066111	TB795	14400PR3004	TB377	31110PH2004	MVB938R5
KL0112205	TB399	4153752	SVB10950	14400PR4004	TB616	31110PH20040	MVB938R5
KL1118381B	MVB865R5	4168467	SVB10925	14400PT0004	TB353	31110PH2J01	MVB938R5
KL6415908	MVB1015R5	93010362	TB560	14400PT0004	TB353	31110PH3003	MVB813R3
RF0112205	TB590	96001122	MVB698R4	14400PY3004	TB391	31110PH3004	MVB813R3
RF0112205A	TB590	GMB40750	MVB755R4	19230PHM004	MVB938R5	31110PH30040	MVB813R3
RF0118381	SVB131125	HONDA		31110P01003	MVB775R4	31110PH3J01	MVB813R3
V86BB6C301AA	SVB10900	103RU22B333	TB736	31110P01004	MVB775R4	31110PH6003	MVB813R3
V86HF6268AA	TB319	104RU22B333	TB749	31110P0BA01	MVB938R6	31110PH6004	MVB813R3
V87VB6C301AA	SVB10975	104RU24B333	TB451	31110P0BA11	MVB938R6	31110PJ70030	MVB690R3
V87VB6C301BA	SVB131000	06141P0A305	TB538	31110P0BA12	MVB938R6	31110PJ70040	MVB690R3
V90HF6C301AA	MVB1413R6	06141PC6305	TB202	31110P12A01	MVB950R5	31110PJ70130	MVB715R3
V90HF6C301BA	SVB10990	06141PM3305	TB316	31110P12A02	MVB950R5	31110PJ70140	MVB715R3
V92HF6C301AA	MVB985R4	06141PT0305	TB353	31110P13003	MVB915R6	31110PJ7505	MVB715R3
V93XF6C301AA	MVB1650R6	13405PAAA01	TB354	31110P1KE01	MVB790R4	31110PK2003	MVB875R5
V93XF6C301BA	MVB1650R6	13405PAAA02	TB354	31110P1KE03	MVB790R4	31110PK2004	MVB875R5
V94BF6C301AB	MVB825R4	13405PT0004	TB354	31110P1R003	MVB836R5	31110PLAE01	MVB860R6
V94BF6C301BA	MVB860R4	13405PT0004	TB354	31110P1R004	MVB836R5	31110PLAE02	MVB860R6
V97DD6C301AA	MVB1910R7	14320P5TG00	TB513	31110P2A003	MVB800R4	31110PLR003	MVB986R6
V97MF6C301AA	MVB1755R6	14400P08004	TB450	31110P2A004	MVB800R4	31110PLZD00	MVB1270R6
V97MF6C301BA	MVB1930R6	14400P0A004	TB538	31110P2J003	MVB800R4	31110PM3003	MVB760R3
VM46510610	MVB1910R7	14400P13004	TB715	31110P2T003	MVB775R4	31110PM30030	MVB760R3
WLL715908A	SVB13975	14400P14004	TB378	31110P2T004	MVB775R4	31110PM3004	MVB760R3
XF2E8620JB	MVB2160R6	14400P1GE01	TB450	31110P30003	MVB775R4	31110PM30040	MVB760R3
XL2E8620BA	MVB2190R6	14400P1HE01	TB451	31110P300030	MVB775R4	31110PM3005	MVB760R3
XM343F572AA	SVB13825	14400P1JE01	TB316	31110P30004	MVB775R4	31110PM3014	MVB760R3
XM3419D621AB	SVB131000	14400P1KE01	TB317	31110P300040	MVB775R4	31110PNEG01	MVB1388R7
XM3419D621DA	SVB131175	14400P28004	TB451	31110P30901	MVB775R4	31110PNEG02	MVB1388R7
XM216268AA	TB680	14400P2A004	TB450	31110P30902	MVB775R4	31110PO1003	MVB775R4
XM216268BA	TB680	14400P2E004	TB451	31110P3F004	MVB825R4	31110PO10032	MVB775R4
XM346268AA	TB536	14400P2FA01	TB451	31110P44G03	MVB950R5	31110PO1004	MVB775R4
XM346268BA	TB358	14400P2T004	TB377	31110P5G003	MVB938R5	31110PP4E01	MVB780R3
XM348620DA	SVB13950	14400P45G00	TB353	31110P5M003	MVB915R6	31110PP4E010	MVB780R3
XS2E8620HB	MVB2080R6	14400P45G01	TB353	31110P5M004	MVB915R6	31110PR3003	MVB775R4
XS2E8620MA	MVB1820R6	14400P5TG00	TB477	31110P72004	MVB790R4	31110PR30030	MVB775R4
XS2E8620MB	MVB1820R6	14400P72004	TB804	31110P72902	MVB775R4	31110PR3004	MVB775R4
XS2E8620NA	MVB1820R6	14400P72014	TB804	31110P73A01	MVB763R4	31110PR4A05	MVB775R4







OE		OE		OE		OE	
...HONDA		...HONDA		...HONDA		...HONDA	
31110PR4A06	MVB775R4	38920PG6006	SVB13900	56992P0A004	MVB1065R4	96142525	TB560
31110PR50030	MVB763R4	38920PH1003	MVB915R4	56992P0AA01	MVB1065R4	9194009101	MVB915R4
31110PR7A01	MVB1100R5	38920PH3003	MVB915R4	56992P0AJ01	MVB1065R4	19511500000	SVB10600
31110PR7A12	MVB1100R5	38920PHM003	MVB1110R5	56992P0AJ02	MVB1065R4	19511551010	SVB101075
31110PRA013	MVB1285R7	38920PK1003	MVB1050R5	56992P11003	MVB1020R4	19511568040	SVB101075
31110PT0003	MVB950R5	38920PK1004	MVB1050R5	56992P13003	MVB1020R4	31110679004	SVB10875
31110PT0004	MVB950R5	38920PL2013	MVB915R4	56992P1J01	MVB845R4	31110679014	SVB10875
31110PV0003	MVB835R4	38920PLC003	MVB1000R6	56992P1KE03	MVB810R4	31110689003	SVB10975
31110PV0004	MVB835R4	38920PLC004	MVB1000R6	56992P2A003	MVB845R4	38763671003	SVB101050
31110PV0004	MVB835R4	38920PLR003	MVB986R6	56992P2A004	MVB845R4	38763689003	SVB101075
31110PWAG01	MVB845R5	38920PLR004	MVB986R6	56992P2T003	MVB875R4	38920671003	SVB13800
31110PY3003	MVB938R5	38920PLZ000	MVB1625R6	56992P2T004	MVB875R4	56992671000	SVB10690
31110PY3A01	MVB938R5	38920PM3003	MVB870R4	56992P30003	MVB870R4	56992689004	SVB10690
31110RNA003	MVB1855R7	38920PM30030	MVB870R4	56992P30004	MVB870R4	56992692004	SVB10940
31110RNA004	MVB1855R7	38920PM3014	MVB870R4	56992P3F003	MVB900R4	56992692013	SVB10940
31110RRBA01	MVB1638R7	38920PM30140	MVB870R4	56992P5G003	MVB945R4	311106570100	SVB10940
38920P01003	MVB800R4	38920PM5A11	MVB870R4	56992P5K004	MVB1045R4	311106710030	SVB10960
38920P01004	MVB800R4	38920PM5A12	MVB870R4	56992P5TG00	MVB1180R6	311106890030	SVB10960
38920P04003	MVB850R4	38920PMET01	MVB986R6	56992P5TG01	MVB1180R6	569926920040	SVB10940
38920P04004	MVB850R4	38920PNA003	MVB1775R7	56992P5TG20	MVB1460R5	569926920130	SVB10940
38920P08003	MVB870R4	38920PNA004	MVB1775R7	56992P72003	MVB920R4	3111106340030	SVB10940
38920P08004	MVB870R4	38920PNB003	MVB1730R7	56992P72004	MVB920R4	GCB10715	SVB10710
38920P0A003	MVB1115R6	38920PNB004	MVB1730R7	56992P76003	MVB1020R4	GTB2003	TB477
38920P0A004	MVB1115R6	38920PO1003	MVB800R4	56992P8AA01	MVB1110R4	GTB2004	TB513
38920P0AJ01	MVB1115R6	38920PO1004	MVB800R4	56992PAAA01	MVB1065R4	HYUNDAI	
38920P0AJ02	MVB1115R6	38920PO8003	MVB870R4	56992PC6003	SVB10900	OK88R12205	TB716
38920P13J01	MVB1045R6	38920PO8004	MVB870R4	56992PC60030	SVB10900	OK88R15987	MVB1680R5
38920P1E003	MVB1088R6	38920PP4E01	MVB810R4	56992PC6004	SVB10900	57161H1300	MVB1080R4
38920P1EJ01	MVB1088R6	38920PP4E02	MVB810R4	56992PDAE01	MVB1065R4	57161H1500	MVB835R4
38920P1EJ02	MVB1088R6	38920PR3003	MVB835R4	56992PDEE01	MVB1020R4	2521228020	MVB1250R6
38920P2A003	MVB825R4	38920PR30030	MVB835R4	56992PE0003	SVB10875	252123C100	MVB2475R6
38920P2T003	MVB845R4	38920PR3004	MVB835R4	56992PE0003	SVB10888	252123E000	MVB2050R6
38920P30003	MVB835R4	38920PR7A01	MVB975R4	56992PE0004	SVB10875	252124A000	MVB2271R7
38920P30004	MVB835R4	38920PR7A02	MVB975R4	56992PEJ004	MVB887R3	252124A010	MVB1730R7
38920P30505	MVB835R4	38920PRA004	MVB1638R7	56992PG6003	SVB10900	571702D000	MVB668R3
38920P3F003	MVB845R4	38920PRA013	MVB1638R7	56992PG6004	SVB10900	571702D101	MVB673R3
38920P3F004	MVB845R4	38920PSGT01	MVB1000R6	56992PH1003	SVB10900	571814A000	MVB1050R4
38920P54003	MVB810R4	38920PT0003	MVB1100R5	56992PH1004	SVB10900	977132D000	MVB10R4
38920P54004	MVB810R4	38920PT00032	MVB1100R5	56992PH3004	SVB10900	977132D100	MVB855R4
38920P5A004	MVB950R5	38920PT0004	MVB1100R5	56992PH7003	SVB101050	977134A000	SVB13925
38920P5L003	MVB1080R6	38920PV0003	MVB920R4	56992PK1003	MVB975R4	977134A010	SVB13950
38920P5L004	MVB1080R6	38920PV0004	MVB920R4	56992PK1004	MVB975R4	977134A060	SVB13975
38920P73003	MVB810R4	38920PW0001	MVB845R4	56992PK1013	MVB975R4	977134A080	SVB13975
38920P75A010	MVB870R4	38920PW0003	MVB850R4	56992PL2003	MVB101075	997132E000	MVB855R4
38920P75A02	MVB870R4	38920PW0004	MVB850R4	56992PLM003	MVB1015R4	96188881	MVB1740R6
38920PAAA01	MVB1105R6	38920PW0G01	MVB845R4	56992PM3003	SVB10790	96209043	MVB1130R6
38920PAAA02	MVB1105R6	38920PW0G02	MVB845R4	56992PM30031	SVB10790	2312724001	SVB13850
38920PC6003	SVB13950	38920PW0J01	MVB1150R6	56992PM3004	SVB10790	2312724010	SVB13825
38920PC6004	SVB13950	38920PWA004	MVB1137R6	56992PM30041	SVB10790	2312724710	SVB13825
38920PCA003	MVB1080R6	38920PWA901	MVB1141R5	56992PM7003	SVB10800	2312728100	MVB915R4
38920PCA004	MVB1080R6	38920PWAJ01	MVB1150R6	56992PM7004	SVB10800	2312728240	MVB940R4
38920PCX004	MVB1469R6	38920PY3003	MVB960R5	56992PQ2003	MVB810R4	2312733020	SVB13950
38920PCX024	MVB1469R6	38920PY3A01	MVB960R5	56992PQ2004	MVB810R4	2312733100	SVB13950
38920PDAE01	MVB1105R6	38920RBAE01	MVB1760R7	56992PP2E010	SVB10888	2312733300	MVB960R4
38920PDAE03	MVB1105R6	38920RBAE02	MVB1760R7	56992PP2E020	SVB10888	2312736000	SVB13975
38920PE0013	SVB13850	38920RBDE01	MVB2265R7	56992PP5E01	SVB10940	2335632010	TB302
38920PE0014	SVB13850	38920RBDE02	MVB2265R7	56992PP5E02	SVB10940	2335632020	TB302
38920PE1701	SVB13825	38920RCAA03	MVB2135R6	56992PSA004	MVB1025R4	2335632030	TB302
38920PE1711	SVB13825	38920RCAA05	MVB2135R6	56992PT0003	MVB1045R4	2335632050	TB302
38920PEC003	MVB800R4	56992P02003	MVB810R4	56992PT0004	MVB1045R4	2335632051	TB302
38920PEC004	MVB800R4	56992P02004	MVB810R4	56992PV0003	MVB735R4	2335633110	TB326
38920PFB004	MVB668R3	56992P04004	MVB1065R4	56992PV0004	MVB735R4	2335633120	TB326
38920PG6003	SVB13900	56992P04J02	MVB1065R4	56992PY3004	MVB945R4	2335633130	TB326
38920PG6004	SVB13900	56992P0A003	MVB1065R4	91920PL2013	MVB915R4	2335633140	TB326

OE		OE		OE		OE	
...HYUNDAI		...HYUNDAI		...HYUNDAI		ISUZU	
2335633150	TB326	2521222020	MVB900R4	5723123500	MVB640R4	31110P01003	MVB775R4
2335633160	TB326	2521222030	MVB900R4	5723124000	SVB13625	31110P01004	MVB775R4
2335638000	TB739	2521223000	MVB875R4	5723128000	SVB13625	38920P01003	MVB800R4
2335638010	TB739	2521223700	MVB885R4	5723128100	SVB13625	38920P010031	MVB800R4
2335638011	TB739	2521224320	MVB870R4	5723128400	SVB13675	38920P01004	MVB800R4
2335638020	TB739	2521224350	MVB870R4	5723128410	SVB13675	56992P02003	MVB810R4
2335642200	TB792	2521225000	MVB2585R6	5723129000	SVB13655	56992P02004	MVB810R4
2335642500	TB490	2521225020	MVB2510R6	5723129050	MVB611R4	1340655	SVB10990
2413232010	TB213	2521226000	MVB850R4	5723129100	SVB13655	1854729	SVB131250
2431202701	TB730	2521226001	MVB845R4	5723129200	SVB13675	1854733	MVB2280R6
2431222010	TB366	2521227000	MVB1513R6	5723131000	SVB13975	4291734	SVB13900
2431222020	TB366	2521227001	MVB1513R6	9765243000	SVB13925	4300241	SVB131375
2431222611	TB679	2521227002	MVB1513R6	9765243000	SVB13950	4300342	SVB131500
2431222612	TB679	2521227010	MVB1513R6	9765243010	SVB13975	4300521	SVB171055
2431222613	TB679	2521227160	MVB1400R6	9771302000	MVB673R4	4300616	SVB13875
2431223001	TB290	2521227400	MVB1513R6	9771322000	MVB875R4	4302118	SVB131025
2431223002	TB290	2521227501	MVB1440R6	9771322060	MVB835R4	5636375	TB436
2431223201	TB539	2521227502	MVB1440R6	9771322260	MVB825R4	5636376	TB749
2431223202	TB539	2521227551	MVB1440R6	9771322261	MVB810R4	91145737	SVB13900
2431223400	TB539	2521232510	MVB975R4	9771323200	MVB945R4	93891618	SVB13900
2431224000	TB518	2521232520	MVB975R4	9771324710	SVB13825	93891628	SVB131025
2431224010	TB518	2521232550	MVB975R4	9771326300	MVB1200R6	94029871	SVB171000
2431224050	TB518	2521233000	MVB975R4	9771328240	MVB940R4	94029958	SVB131375
2431226000	TB537	2521233050	MVB975R4	9771329000	MVB850R4	94030761	SVB131500
2431226001	TB537	2521233060	MVB975R4	9771329500	MVB850R4	94111624	SVB131500
2431227000	TB714	2521233100	MVB995R4	9771333310	SVB13975	94111687	SVB13875
2431227250	TB714	2521233150	MVB995R4	9771333340	MVB960R4	94141721	SVB131025
2431232555	TB400	2521233160	MVB995R4	HJ820002A	SVB13950	94161841	SVB171055
2431232560	TB405	2521235010	MVB1240R5	HJ820003	SVB13925	94174306	TB519
2431232610	TB356	2521235020	MVB1240R5	HJ820008	SVB131425	94175170	SVB13875
2431232620	TB356	2521235050	MVB1240R5	MB166386	SVB13780	94218574	SVB131025
2431232630	TB356	2521236070	MVB1345R5	MB166986	SVB13780	94218575	SVB131375
2431232820	TB213	2521237101	MVB1995R6	MB553430	SVB13800	94221435	TB522
2431232830	TB213	2521237102	MVB1995R6	MD005350	SVB10813	94222880	SVB13900
2431233010	TB402	2521237160	MVB1700R6	MD025522	SVB13950	94225209	SVB13875
2431233020	TB402	2521237161	MVB1700R6	INNOCENTI		94232287	SVB10760
2431233030	TB402	2521237162	MVB1690R6	13H8389	SVB10813	94240372	SVB171055
2431233040	TB402	2521237181	MVB1995R6	13H859	SVB10813	94256977	SVB10665
2431233050	TB402	2521238000	MVB945R4	13H923	SVB10900	94257037	SVB131000
2431233060	TB402	2521238001	MVB945R4	4171293	SVB10813	94411860	SVB13900
2431233110	TB325	2521239800	MVB1135R5	4371913	SVB101000	94440010	SVB131500
2431233120	TB325	2521442060	SVB101100	7575315	SVB101000	94449169	TB522
2431233130	TB325	2521542020	SVB101100	7662411	SVB10913	94452904	SVB131025
2431233140	TB325	2521542021	SVB101100	7670173	MVB1000R5	94472378	SVB13875
2431233150	TB325	2521542040	SVB101100	7671401	SVB10950	94478173	SVB131000
2431233160	TB325	2521542060	SVB101090	7671402	SVB10913	97130560	MVB2280R6
2431235000	TB401	2521542061	SVB101090	7732138	MVB887R5	97136321	TB436
2431235010	TB401	3733029000	MVB1130R6	7765719	MVB887R5	97143724	TB749
2431235040	TB401	3733029100	MVB1740R6	33402327	SVB10813	809218140	MVB875R5
2431237100	TB707	3733029102	MVB1740R6	34402332	SVB10900	894174306	TB519
2431237400	TB707	5717002710	MVB755R4	46406340	MVB940R4	894232287	SVB10760
2431237500	TB707	5717033900	SVB13675	46456894	MVB960R4	894385561	TB413
2431238010	TB708	5717033910	SVB13675	46537099	MVB960R4	894449307	TB413
2431238020	TB708	5717034000	SVB13655	46542302	MVB960R4	897086863	TB522
2431542200	TB359	5717036100	SVB13655	46770220	MVB887R5	1136713010	SVB131450
2434129000	TB560	5717038000	MVB1110R5	58401328	SVB10813	5136711060	SVB131500
2521111000	SVB10813	5717038010	MVB1388R5	71719174	MVB915R4	5136711110	SVB131350
2521121000	SVB10875	5717039000	MVB906R5	71719641	SVB10865	5136711130	SVB131500
2521132000	SVB10960	5718143000	SVB13750	82404106	SVB10825	5860014030	MVB1065R4
2521132400	SVB10960	5718143100	SVB131000	554021602	SVB10950	5860077170	MVB1115R6
2521202500	MVB775R4	5723102000	SVB13775	9952110959	SVB10950	5860090350	MVB800R4
2521202550	MVB775R4	5723121000	SVB13675	AAE3550	SVB10813	5860107930	MVB845R4
2521221200	MVB870R4	5723122000	MVB611R4	GFB102	SVB10813	5866867210	MVB884R6
2521221220	MVB870R4	5723122500	SVB13675	GFB193	SVB10813	5867168190	MVB1995R6







OE		OE		OE		OE	
...ISUZU		...ISUZU		...IVECO		...IVECO	
5867237830	MVB1600R6	8944400100	SVB131500	4758123	SVB10925	99472776	MVB1025R4
5867257200	MVB1995R6	8944411480	MVB1035R6	4758645	SVB101100	99481768	SVB131375
8924252090	SVB13900	8944411500	MVB938R6	4758646	SVB101100	500323627	TB701
8940307610	SVB131500	8944503950	SVB131450	4759595	SVB131450	500324346	MVB1050R6
8941077651	SVB10925	8944529040	SVB131015	4759597	SVB131450	500329310	MVB1015R4
8941116240	SVB131500	8944529040	SVB131025	4764805	SVB101050	500341618	MVB1045R4
8941116870	SVB13900	8944680621	MVB750R6	4764807	SVB101025	500368902	MVB1050R6
8941245583	SVB13750	8944710770	SVB13975	4764808	SVB101050	500371975	TB723
8941245590	SVB10925	8944781730	SVB131000	4776672	SVB131475	504012393	MVB985R4
8941316290	SVB13900	8944781731	SVB131000	4786727	SVB131425	504019980	MVB1100R5
8941316300	SVB13950	8970163260	TB393	4799024	SVB131075	504076915	TB723
8941316311	SVB13750	8970422680	TB519	4799496	SVB101100	504092335	MVB1215R6
8941339760	SVB13850	8970435510	SVB171055	4799498	SVB101100	JAGUAR	
8941374780	MVB698R4	8970438660	MVB1100R6	4803951	SVB101000	1S7Q6C301CA	MVB1642R6
8941417200	SVB131000	8970629131	SVB171055	4813541	SVB131450	1X4E8620DB	MVB2460R6
8941417210	SVB131025	8970631740	MVB1538R6	4814275	SVB101025	5W9Q6C301AD	MVB2050R6
8941464550	SVB13950	8970861530	TB522	4815459	SVB131425	C2S24900	MVB2460R6
8941464950	SVB13950	8971437240	SVB10990	4815464	SVB131425	C2S27001	MVB1642R6
8941509881	SVB13875	8971863950	MVB1250R6	4818162	SVB101025	C7898	SVB101025
8941618410	SVB171055	8972290710	MVB1588R6	4818164	SVB101025	C10912	SVB10950
8941675880	SVB13750	8972292770	TB750	4818791	SVB131450	C13593	SVB10925
8941675890	SVB13900	8973261400	MVB1625R6	4827114	SVB13750	C13595	SVB101025
8941675900	SVB13950	8973858450	MVB1250R6	4827115	SVB101075	C15840	SVB131000
8941737031	SVB13750	8973858460	MVB1613R6	4827116	SVB10850	C20887	SVB13750
8941743060	TB519	9136713160	SVB171000	4838527	SVB131325	C23138	SVB10913
8941751700	SVB13875	IVECO		4843796	SVB131400	C23344	SVB131200
8941751700	SVB13900	1119276	SVB131075	4851300	SVB101010	C27844	SVB131125
8942179190	SVB13950	1161989	SVB13950	4855023	SVB131300	C28955	SVB13775
8942179200	SVB10760	1161993	SVB10975	4898546	MVB1230R8	C28956	SVB131175
8942179210	SVB10760	1168314	SVB131075	7303462	SVB10813	C28957	SVB13875
8942185740	SVB131025	1172921	SVB101025	9832114	SVB101000	C29607	SVB10900
8942185741	SVB131015	1175745	SVB10975	41756335	SVB101525	C29608	SVB10850
8942185750	SVB131375	2234343	SVB101375	42522867	SVB101025	C29849	SVB10825
8942213270	SVB13925	2235177	SVB101400	61318427	SVB131400	C32690	SVB13800
8942214350	TB522	2235178	SVB101100	61672688	SVB131425	C36122	SVB10875
8942224690	SVB13750	2235532	SVB101350	61689613	SVB131475	C37891	SVB131075
8942228791	SVB13950	2235713	SVB10950	61689963	SVB131425	C43070	SVB13850
8942228800	SVB13900	2237477	SVB10975	93193061	SVB13875	C145351	SVB131000
8942252090	SVB13875	2416716	SVB10975	98410144	SVB101050	C147231	SVB13950
8942252090	SVB13900	2418962	SVB131075	98415921	TB701	EAC3850	SVB101000
8942292691	SVB13950	4156931	SVB10800	98419390	TB368	EAC3878	SVB13975
8942292691	SVB131000	4335587	SVB10813	98420262	SVB131300	EAC7033	MVB995R4
8942314130	SVB13780	4624730	SVB101100	98420263	SVB131300	EAC9369	MVB835R4
8942322841	SVB13875	4624733	SVB10975	98429196	SVB131300	EBC11220	MVB1020R4
8942322872	SVB10760	4631961	SVB131450	98429205	SVB131350	EBC11306	MVB975R5
8942322873	SVB10760	4640604	SVB101075	98432114	SVB101000	ERC8852	SVB10775
8942323100	SVB13950	4645910	SVB131450	98432116	SVB101100	ERC8938	SVB101050
8942353950	SVB13950	4645911	SVB131450	98434371	SVB131475	GFB220	SVB131075
8942403720	SVB171055	4645913	SVB131450	98435429	SVB131300	GFB227	SVB131175
8942523420	SVB131375	4645914	SVB101075	98436428	SVB13950	GFB233	SVB13850
8942569771	SVB10665	4665640	SVB101025	98447276	SVB10925	GFB264	SVB131075
8942570371	SVB131000	4688853	SVB101125	98462373	SVB10925	NAC2211BA	MVB830R5
8943349870	SVB131250	4688859	SVB10975	98464571	SVB131425	NBD3700BA	MVB975R5
8943358490	MVB706R4	4705361	SVB101125	98465812	SVB13950	JEEP	
8943627320	MVB1045R6	4716471	SVB131325	98466498	SVB131150	4612277	MVB2460R6
8943645800	MVB946R6	4726678	SVB131350	98473728	SVB131475	4621844	TB705
8943795970	MVB962R6	4732571	SVB131025	99430032	TB558	4796033	MVB2188R8
8943801590	MVB962R6	4732574	SVB131025	99436608	SVB13875	4841734AA	MVB1420R6
8943821050	SVB101025	4749444	SVB131000	99454341	SVB10940	4854033	MVB2240R6
8943821051	SVB101025	4749445	SVB131000	99454342	SVB13800	4854033AB	MVB2240R6
8943821060	MVB960R4	4756335	SVB101525	99456476	TB368	4864599	MVB2275R8
8943821071	MVB800R4	4756336	SVB101525	99456477	TB558	4891587AA	MVB2035R7
8944118600	SVB13950	4757583	SVB131425	99459239	SVB131325	4891598AB	MVB2553R6
8944273530	SVB13825	4757590	SVB101050	99462143	SVB101050	04891661AA	MVB1715R6





OE		OE		OE		OE	
...JEEP		...JEEP		...KIA		...LADA	
4891661AA	MVB1715R6	JY013432	SVB101090	571702D101	MVB673R3	96142597	TB560
4892791AA	MVB2205R6	KIA		571814A000	MVB1050R4	11113701720	SVB10825
5015068AA	MVB2488R8	OAM0618381A	SVB13925	977131C200	MVB810R4	21011308020	SVB10940
05015962AA	MVB2488R8	OK01118381A	MVB920R4	977132D510	MVB855R4	21011308026	SVB10940
05015962AB	MVB2488R8	OK01232611	SVB13775	0811818381	SVB13875	21071308020	SVB10940
05037542AA	MVB2080R6	OK01612205	TB271	2335633160	TB326	21083701720	SVB10710
5066928AA	TB719	OK01618381	SVB131125	2335638010	TB739	21101041020	MVB1115R6
5142579AA	TB719	OK01618381B	SVB131125	2335642500	TB490	21103701720	MVB750R6
5175961AA	MVB2035R7	OK01732611	SVB13850	2431202701	TB730	21108114096	MVB1125R6
5281315AC	MVB2325R6	OK05412205	TB590	2431223002	TB290	21231041020	MVB1815R5
5281351AC	MVB2325R6	OK05418381	SVB131125	2431223202	TB539	210823701720	MVB698R6
46510601F	MVB2188R8	OK20112205	TB289	2431226001	TB537	1111370172001	SVB10825
46510614	MVB2488R8	OK20312205	TB294	2431227000	TB714	2112100604002	TB479
46510628F	MVB2488R8	OK20A15908	MVB900R4	2431227250	TB714	2123104102001	MVB1515R5
53001119	MVB1995R6	OK20B15909	MVB1015R4	2431233160	TB325	2123104102031	MVB1885R5
53001120	MVB2080R6	OK21A18381	MVB885R4	2431237500	TB707	LANCIA	
53001772	SVB13825	OK24415909A	MVB1045R4	2431238010	TB708	103201A	SVB10888
53001773	SVB10840	OK24712205	TB548	2431542200	TB359	301201A	SVB10888
53001774	SVB10690	OK2A315909	MVB1080R4	2521202550	MVB775R4	2068003	SVB101000
53002341	SVB13975	OK2AA15907	MVB925R4	2521223000	MVB875R4	2068027	SVB13975
53002900	MVB1855R6	OK2AA15908	MVB960R4	2521223700	MVB885R4	2068028	SVB10913
53006870	MVB2475R6	OK2AA32907	MVB920R4	2521224350	MVB870R4	2068038	SVB101100
53007539	MVB2440R6	OK2CP15909	MVB1050R4	2521225000	MVB2585R6	2068043	SVB10775
53007595	MVB1805R6	OK2FT15908	MVB845R4	2521225020	MVB2510R6	2068047	SVB10735
53008722	MVB2190R6	OK2JV15909	MVB1020R4	2521226000	MVB850R4	2068048	SVB10750
53008744	MVB2271R7	OK30E12205	TB709	2521227002	MVB1513R6	2068059	SVB101400
53010010	MVB1760R6	OK41018381A	SVB131450	2521227010	MVB1513R6	2107171	SVB101075
53010150	MVB2325R6	OK55112205B	TB706	2521227160	MVB1400R6	2115483	SVB131500
53010234	MVB2271R6	OK55215909	MVB870R4	2521227350	MVB1513R6	2137077	SVB10888
53010254	MVB1980R6	OK55315987	MVB1588R6	2521227351	MVB1513R6	2156019	SVB10960
53010269	MVB2475R6	OK65B15907C	SVB13900	2521227360	MVB1513R6	2173818	SVB131450
53010275	MVB2460R6	OK65B32611	SVB13875	2521233160	MVB995R4	2175808	SVB10650
53010276	MVB2440R6	OK71W18381	MVB940R4	2521237162	MVB1690R6	2189953	SVB10735
53010283	MVB1760R6	OK72A15909A	SVB13925	2521237181	MVB1995R6	4156931	SVB10813
53010284	MVB1805R6	OK88R12205	TB716	2521239800	MVB1135R5	4158457	SVB10850
53010285	MVB1805R6	OK88R12205B	TB716	5717002710	MVB755R4	4218720	SVB101100
53010288	MVB2190R6	OK94115908	MVB1045R4	5717033910	SVB13675	4313390	SVB10825
53010289	MVB2271R7	OK95412205	TB280	5717038010	MVB1388R5	4371913	SVB101000
53010311	MVB1980R6	OK95418381	MVB760R3	5717039000	MVB906R5	4829182	SVB13925
53010314	MVB2415R6	OK95K15909	MVB1580R6	5723129100	SVB13655	4833708	SVB13925
53011012	MVB1904R6	OK97212205	TB301	9771302000	MVB673R4	4833709	SVB10635
53011097	MVB2265R7	OK9A015909	MVB1110R4	9771311200	MVB810R4	4834880	SVB13825
53011097AB	MVB2265R7	OK9A115909	MVB1110R4	9771326300	MVB1200R6	5882989	SVB10925
53011098	MVB2271R7	OK9AA15907	MVB940R4	AA10012205B	TB328	5889269	SVB10635
53012002	MVB2415R6	OK9AC15907	MVB950R5	B3C715907C	MVB850R4	5948450	SVB101050
53012009	MVB2250R6	OK9BV12205	TB717	B3C715909C	MVB960R4	5949504	SVB10813
53013209AC	MVB1913R6	OK9BV12206	TB747	B3C718381B	MVB875R4	5953873	SVB10940
53013298AA	MVB2250R6	OW06532611	SVB13875	B30115909	MVB945R4	5956599	SVB10825
53013352AC	MVB2145R6	57161H1300	MVB1080R4	KK0115908B	SVB10888	5978842	SVB10913
53013676AB	MVB2080R6	243120Z000	TB328	KK0118381A	SVB10888	5980075	SVB10740
53013905AA	MVB2190R6	243122X000	TB709	KK14015909	MVB925R4	5992144	MVB869R5
53031118	MVB1805R6	243122Y000	TB548	KK35012205	TB289	7031864	SVB101125
53032037	MVB2215R6	252122A000	MVB1790R5	KK37115909	MVB900R4	7302791	SVB10635
53032037AC	MVB2225R6	252122A001	MVB1790R5	KKI0218381	SVB10888	7302819	SVB10710
53032037AF	MVB2225R6	252122B000	MVB2135R6	KKY0115908B	SVB10888	7303004	SVB10925
53032037AI	MVB2225R6	252122B010	MVB1530R6	KKY0118381A	SVB10888	7303315	SVB10775
53032037AJ	MVB2205R6	252122B020	MVB1250R6	KKY0218381	SVB10888	7303462	SVB10813
53054339	MVB2271R6	252123C100	MVB2475R6	MB3C718381B	MVB875R4	7533397	SVB10775
53054449	MVB2280R6	252123E000	MVB2050R6	MB36615907	MVB885R4	7535218	SVB10675
530010314	MVB2415R6	252123E050	MVB2050R6	MB36615907A	MVB885R4	7540063	SVB10813
B0013431	SVB101090	252124A000	MVB2271R7	MB37615907	MVB800R4	7541662	SVB10913
B0017465	SVB131175	252124A010	MVB1730R7	MBP0112205B	TB289	7547752	MVB1345R5
J3226936	SVB131175	252124A100	MVB2265R7	LADA		7552281	SVB101090
J3239615	SVB101090	252124A400	MVB2265R7	91541178	MVB1230R4	7552380	SVB10775







OE		OE		OE		OE	
...LANCIA		...LANCIA		...LANCIA		...LANCIA	
7553224	MVB845R5	7706132	MVB970R5	46736501	TB676	60816660	MVB1740R6
7553226	MVB845R5	7710579	TB468	46736814	MVB663R4	60816719	TB532
7553716	SVB10690	7718418	MVB1100R5	46738444	MVB938R5	71718718	MVB673R4
7554502	SVB10750	7720922	SVB131050	46738445	MVB668R3	71718838	MVB835R4
7554605	SVB101125	7722331	TB607	46749665	MVB1842R6	71719039	MVB698R4
7554701	TB129	7723828	SVB10690	46750865	TB676	71719398	MVB915R3
7565945	MVB1613R6	7723829	SVB10690	46751200	MVB673R4	71719559	MVB1575R5
7575315	SVB101000	7732676	TB462	46759720	MVB1842R6	71719642	MVB1100R4
7576113	SVB101125	7743134	SVB10690	46775098	MVB1137R6	71719648	TB468
7576114	SVB101090	7745354	MVB706R4	46780505	TB639	71719651	TB639
7581316	SVB10825	7749145	MVB938R5	46787905	MVB915R3	71719652	TB649
7581317	SVB10825	7750729	MVB810R4	46787907	MVB1760R6	71719738	MVB663R4
7581464	SVB10675	7758972	MVB960R4	46809420	MVB663R4	71719745	MVB906R5
7589248	SVB13825	7761147	MVB938R5	46820062	MVB1180R6	71731639	TB639
7597169	MVB1200R7	7762910	TB470	46820063	MVB1306R6	71734716	MVB1740R6
7597531	SVB10813	7763320	SVB131025	46820063A	MVB1306R6	71736717	TBK313
7604702	SVB10825	7764914	TB608	55183446	TB787	71736718	TBK277
7609091	SVB10913	7765715	MVB925R5	55183528	TB790	71736726	TBK283
7610944	SVB10675	7765717	MVB960R5	55187103	TB725	71736727	TBK356
7614957	SVB10740	7766106	MVB1137R6	55191006	MVB1200R6	71736795	TBK104
7614999	TB579	7766684	MVB1035R6	55192799	MVB938R5	71739605	SVB13750
7615058	MVB985R5	7771530	SVB10690	55192802	MVB668R3	71739905	MVB938R5
7617214	SVB131025	7774591	TB474	55202377	MVB1180R6	71739922	TB419
7617278	SVB13850	7776571	SVB10725	55203785	TB787	71745115	MVB1180R6
7619418	SVB10675	7788011	MVB1690R6	55210626	TB559	71749433	MVB906R5
7621256	SVB13875	7788553	MVB825R4	55210628	TB468	71779650	TB559
7627908	SVB13850	7799581	MVB855R4	60565258	MVB790R4	73500782	MVB1575R5
7629031	MVB906R5	46129497	MVB1215R3	60568842	MVB1240R7	82068038	SVB101100
7629229	MVB915R5	46129991	MVB850R3	60573075	MVB1180R7	82288389	SVB101000
7629235	SVB13750	46130771	MVB1245R4	60575209	MVB763R4	82308185	SVB101010
7629316	SVB13800	46136505	MVB850R3	60603101	MVB1995R6	82310543	SVB101175
7629650	MVB1675R7	46400045	TB471	60605423	MVB1969R7	82329974	SVB101100
7631375	MVB925R5	46400047	MVB668R3	60611305	TB532	82332275	SVB10700
7632090	MVB960R5	46403659	TB637	60617858	MVB1083R7	82336411	SVB101225
7633335	SVB10740	46403854	MVB938R5	60617859	MVB1952R7	82342730	SVB101140
7633936	MVB1100R4	46411594	MVB668R3	60617860	MVB1045R6	82398036	SVB10775
7635566	MVB1100R4	46414859	MVB1065R6	60617862	MVB1842R6	82401268	SVB131400
7636057	MVB1045R4	46414860	MVB1715R6	60618584	MVB1969R7	82401269	SVB131225
7636058	MVB1045R4	46426983	TB639	60618726	TB532	82404105	SVB10825
7636059	MVB1050R4	46429443	MVB673R4	60620887	TB732	96152078	MVB1660R6
7636060	MVB1050R4	46439000	MVB1105R6	60625130	TB468	96152082	MVB1065R6
7636448	MVB673R3	46444537	MVB1740R6	60625927	MVB1952R7	96152084	MVB1080R6
7636895	MVB915R3	46448693	MVB938R5	60626658	MVB1995R6	96188881	MVB1740R6
7636896	MVB915R3	46451652	MVB855R4	60630741	MVB1980R6	96197793	TB419
7638224	SVB10740	46456894	MVB960R4	60656341	TB559	96205509	MVB1600R6
7638225	SVB10740	46457061	TB660	60656342	TB468	96236847	MVB1165R6
7640256	MVB906R5	46457742	TB608	60666949	MVB1045R6	96242338	MVB1105R6
7640257	MVB985R5	46462943	MVB668R3	60666950	MVB1842R6	96324103	MVB1740R6
7640258	MVB925R5	46462944	MVB938R5	60674528	TB532	98435955	SVB10635
7644467	MVB960R5	46474062	MVB1842R6	60807260	TB579	98455448	MVB887R5
7646725	TB660	46479557	MVB1760R6	60808954	MVB1180R7	9400816190	TB683
7646849	MVB1050R5	46514671	TB471	60809160	MVB938R5	9400816549	TB320
7649219	SVB13850	46515401	TB660	60810651	MVB1969R7	9400816969	TB632
7651197	MVB915R4	46517850	MVB835R4	60812001	MVB1969R7	9400816989	TB479
7651549	SVB13750	46517851	MVB898R4	60812329	MVB1083R7	9400831069	TB419
7653808	MVB1715R7	46526291	TB649	60812350	MVB1952R7	9400831119	TB320
7655543	SVB13850	46537099	MVB960R4	60812382	TB732	9400831119	TBK035
7655544	SVB13750	46540146	MVB1690R6	60813206	MVB1995R6	9400831279	TBK020
7659062	TB474	46540546	MVB1035R6	60813756	MVB1045R6	9400831409	TBK106
7695968	MVB1035R5	46541065	TB462	60814576	MVB1980R6	9400831489	TBK113
7702169	MVB1050R5	46542138	MVB938R5	60814603	TB639	9400831529	TBK035
7702740	MVB1035R5	46542302	MVB960R4	60815412	MVB1080R6	9400831589	TBK105
7703305	SVB10725	46550322	MVB1588R6	60815414	MVB1980R6	9400831609	TBK303
7704978	MVB673R4	46736500	TB649	60816232	TB559	9400831629	TBK106





OE		OE		OE		OE	
...LANCIA		...LAND ROVER		...LEXUS		...MAZDA	
9400831789	TBK106	GFB101750	MVB1755R6	9091602231	MVB2250R6	96FF6268DA	TB495
9400831889	TBK279	GMB50735	MVB735R5	9091602309	MVB1930R6	96FF6C301AE	MVB887R5
9400831929	TBK338	GMB51190	MVB1188R5	9091602310	MVB1930R6	96FF6C301BE	MVB1141R5
9463380180	TB678	GMB61185	MVB1180R6	9091602353	SVB101125	96FF6C301CD	MVB675R5
9463380680	TB632	GMB61465	MVB1460R5	9091602360	MVB2250R6	96FF6K288AA	TB496
9464034380	TB720	LHN10016	TB367	9091602371	MVB1930R6	96MF6C301AC	MVB1180R6
9464464980	TB683	LHN100390	TB534	9091602373	MVB1050R6	96MF6C301BC	MVB1755R6
9464640380	TB742	LHN100560L	TB640	9091602386	MVB875R4	96MF6C301CC	MVB1930R6
9467544580	TBK355	MVF100040	TB650	9091602404	MVB2225R6	96MF6C301DB	MVB1775R6
9619779380	TB419	PQR500240	MVB2271R7	9091602405	MVB2225R6	96MM6K288A1A	TB472
9620550980	MVB1600R6	PQS000100	MVB1635R7	9091602412	MVB1930R6	97FF6C301AC	MVB1141R5
9624233880	MVB1105R6	PQS000180	MVB887R5	9091602437	MVB2196R6	98BB6C301BA	MVB2100R6
9629054080	MVB1740R6	PQS000190	MVB813R5	9091602462	MVB2265R6	1037660	TB633
9630796180	MVB1755R6	PQS000220	MVB1000R5	9091602463	MVB2250R6	1049578	MVB1980R6
9631333880	MVB1740R6	PQS10061	MVB1755R6	9091602583	MVB2265R6	1049613	MVB2100R6
9632410380	MVB1740R6	PQS100840	MVB735R5	9091602584	MVB2265R6	3707248	MVB2080R6
9633478180	MVB1469R6	PQS100850	MVB1460R5	9091602585	MVB2240R6	022218381	SVB13850
9637053980	TB683	PQS100900	MVB1369R6	9091602586	MVB2250R6	022218381A	SVB13850
9638027080	MVB1580R6	PQS101030	MVB1180R6	9091602592	MVB2120R6	024918381B	SVB101000
9638234780	MVB1469R6	PQS101130	MVB1188R5	9091602632	MVB2050R6	029018381B	SVB13950
9641069580	MVB1190R6	PQS101261	MVB1285R6	9091602637	MVB2100R6	30518381	SVB13975
9644846680	MVB1740R6	PQS101261L	MVB1285R6	9091602658	MVB2100R6	030518381A	SVB13975
9655945780	MVB1215R6	PQS101271	MVB1560R6	9091602661	MVB915R4	030579252	SVB13925
9658643680	MVB1200R6	PQS101271L	MVB1560R6	9936300890	MVB887R3	032418381	SVB10790
C103201A	SVB10888	PQS101272L	MVB1560R6	9936430900	MVB900R4	032418381A	SVB10790
LAND ROVER		PQS101300	MVB2025R5	9936480880	MVB875R4	032418381B	SVB10790
669N8620BB	MVB1200R6	PQS101300L	MVB2025R5	MAZDA		050418381B	SVB13950
563132	SVB101025	PQS101310	MVB869R5	1E0315907	MVB1740R6	060418381B	SVB13950
603713	SVB13850	PQS101310L	MVB869R5	1E0315907A	MVB1740R6	060518381	SVB131000
611612	SVB131000	PQS101490	MVB1715R7	1E0315907B	MVB1740R6	075018381A	SVB131125
614106	SVB13925	PQS101500	MVB1800R7	1E0315908	MVB1440R6	082018381	SVB10825
614670	SVB131000	PQS101501	MVB1800R7	1E0315908A	MVB1440R6	96423837	MVB975R6
11282245850	MVB835R4	PQS101510	MVB1889R7	1E0315909	MVB1904R6	112118381	SVB10825
ADU9401	SVB101050	PQS101520	MVB1813R7	1E0315909A	MVB1904R6	156218381	SVB10825
ERC675	SVB13925	PQS101630	MVB2337R7	1E0315909B	MVB1904R6	175713715	SVB10888
ERC5146	SVB13750	STC2134	MVB1815R5	1E0315909D	MVB1904R6	175718381	SVB10800
ERC8852	SVB10775	STC2326	MVB855R4	1E0318381	MVB860R6	227618381A	SVB13950
ERC8938	MVB101050	STC3397	MVB835R4	1E0318381A	MVB860R6	227618381B	SVB13900
ERR416	MVB1200R5	STC4455	MVB1815R5	1E0512205	TB472	232913715	SVB10825
ERR810	SVB131025	LDV		1E0515907	MVB1755R6	267718381	SVB13850
ERR0914	MVB1141R5	280S8M1760	TB719	1E0515908	MVB1775R6	298118381	SVB13850
ERR914	MVB1141R5	130287C000	TB487	1E0515909	MVB1930R6	387418381	SVB131075
ERR1092	TB478	46510639F	TB719	1E0518381	MVB1180R6	489318382	SVB131225
ERR2073	SVB10675	46510641F	MVB1913R6	1E0612205	TB472	811818381	SVB13875
ERR2215	MVB1325R4	510990259	TB719	1E0712205	TB496	83118381A	SVB10790
ERR2678	MVB1260R4	523000002	MVB1913R6	1E0713823	TB495	839718381A	SVB13950
ERR3287	MVB1605R7	LBU5825	TB560	1E0713823A	TB495	851915906	SVB131050
ERR4623	MVB2265R7	LBU7432	TB629	1E0715907	MVB1141R5	853178022	SVB13975
ERR5911	MVB1580R7	LEXUS		1E0715907A	MVB1141R5	856215906	SVB131050
ERR6191	MVB1855R7	99366C2200	MVB2196R6	1E0715907B	MVB1141R5	887118381	SVB10790
ERR6896	MVB2710R7	99366C2230	MVB2225R6	1E0715909	MVB675R5	887118381	SVB10800
ERR6899	MVB1775R7	99366D2230	MVB2225R6	1E0718381	MVB887R5	AJ0315908	MVB2080R6
ETC4272	SVB13800	1356829025	TB696	1E0718381A	MVB887R5	AJ0315908A	MVB2080R6
ETC5815	SVB13725	1356849036	TB762	1E1012205	TB681	AJ0315908B	MVB2080R6
ETC7394	SVB101215	1356862020	TB444	1E1115907	MVB1613R6	AJ5215908	MVB2080R6
ETC7469	SVB10610	1356862030	TB436	1E1212205A	TB496	AM0618381A	SVB13950
ETC7899	SVB10675	1356862040	TB444	1E1212205B	TB496	AM2118381	SVB10950
ETC7939	SVB101025	1356869025	TB436	1E1312205	TBK278	AS0115907C	MVB900R4
ETC8550	TB365	9008021040	MVB1035R6	1E1312205A	TBK278	AS0315909	MVB1795R6
ETC9002	SVB131200	9008091088	MVB875R4	3BC715909C	MVB960R4	AY0215908	SVB10710
ETC9009	SVB131350	9008091147	MVB1035R6	95WF6C301HA	MVB1904R6	AY14060922	MVB925R6
ETC9019	SVB131175	9008091212	MVB875R4	96FB6C301AC	MVB860R6	AZ0115908	SVB10740
ETC9080	SVB13875	9008091239	MVB1035R6	96FB6C301BC	MVB1740R6	AZ2815908	SVB10790
ETC9101	MVB835R4	9091602177	MVB760R3	96FB6C301CD	MVB1440R6	AZ2818381A	SVB10635







OE		OE		OE		OE	
...MAZDA		...MAZDA		...MAZDA		...MAZDA	
B3C715907B	MVB845R4	B66012205A	TB397	F80815381	MVB875R4	JE7415907	MVB915R4
B3C715907C	MVB850R4	B66012205B	TB397	F80815907A	MVB648R4	JE7415908	MVB985R5
B3C715909A	MVB960R4	B66012205C	TB397	F85118381A	SVB13775	JE7412205	TB517
B3C715909C	MVB960R4	B66015908	MVB885R4	F85218381	SVB13950	JE7412205A	TB517
B3C718381	MVB875R4	B66115909	MVB995R4	F87418381	SVB13825	JE7412205B	TB517
B3C718381A	MVB875R4	BP4W15907A	MVB860R4	F202122059A	TB358	JE7412205C	TB517
B3C718381B	MVB875R4	BP4W15907B	MVB855R4	F210122059A	TB358	JE7412205D	TB517
B3J215909	MVB960R4	BP4W18381	MVB885R4	FE1H12205	TB301	JE7412205E	TB517
B3P515908	MVB875R4	BP0112205	TB289	FE1H12205A	TB301	JE7415908	SVB131000
B3P715908	MVB875R4	BP0112205A	TB289	FE1H12205A9A	TB301	JE74118381A	SVB131025
B5A118381	MVB875R4	BP0112205B	TB289	FE1H15907	SVB13825	JE741125F0D	TB517
B5C715909	MVB960R4	BP0212205	TB289	FE1J12205	TB301	K80515907A	MVB920R4
B5C815909	MVB960R4	BP0212205A	TB289	FE3N12205	TB280	K80515907B	MVB920R4
B6A915908A	MVB900R4	BP0212205B90	TB289	FE3N122059A	TB280	K80515908A	MVB1015R5
B6A915909A	MVB1000R4	BP2515908	MVB885R4	FE4N15909A	MVB1060R5	K80515908B	MVB1015R5
B6BF15907	MVB885R4	BP2515908A	MVB885R4	FE4618381	SVB131000	K80518381A	MVB865R5
B6BF18381	MVB885R4	BPD415909	MVB1000R4	FE6518381	SVB13850	K80518381B	MVB865R5
B6BF18381A	MVB885R4	BPE615909	MVB1000R4	FE7018381	SVB13750	KF3315907	MVB920R4
B6C715909	MVB945R4	BPE715909	MVB1000R4	FE8218381	SVB13950	KFC815907	MVB900R4
B6DG15909	MVB995R4	BPE815908	MVB850R4	FEB118381	SVB131025	KJ0118381A	MVB1605R7
B6S712205A	TB294	BPE815909A	MVB945R4	FEDK18381	SVB13950	KL0112205	TB399
B6S712205B	TB294	BPF315909A	MVB945R4	FEIH12205A	TB301	KL4715907	MVB920R4
B6S712205C	TB294	BPH715909	MVB1000R4	FEIH12205A9A	TB301	KL4715908	MVB1000R5
B6S712205C9A	TB294	C20112201	TB472	FEMJ18381	MVB1180R6	KL4715908A	MVB1000R5
B6S712205D	TB294	C20112201A	TB472	FP0112205	TB398	KL7015908	MVB1000R5
B6S715909	MVB1015R4	D41015907	SVB13950	FP0112205A	TB398	KL7015908A	MVB1000R5
B6S718381A	SVB13900	D53015907	MVB870R4	FP0112205A9A	TB398	L3B615909	MVB2280R6
B6S718381B	SVB13900	D53015909	MVB1080R4	FP0115907	MVB1030R5	L32715909	MVB2215R6
B6SF18381A	SVB13900	E30115907	SVB131125	FP0115907A9F	MVB1030R5	L32715909A	MVB2215R6
B6SF18381B	SVB13900	E30118381	SVB10960	FP0415907A	MVB1030R5	L32715909B	MVB2215R6
B6Y1125F0	TB397	E33115907	MVB1190R4	FS1E18381	MVB925R4	L32915909	MVB2300R6
B61H18381A	SVB13900	E35618381	SVB10960	FS0112205	TB371	L32915909A	MVB2300R6
B61P15907	MVB870R4	E56115907	MVB1040R4	FS0112205A	TB371	L32915909B	MVB2300R6
B61P15907A	MVB855R4	F2F618381	MVB760R3	FS0112205A9A	TB371	L33615909	MVB2280R6
B63H15909	MVB960R4	F2J418381	SVB131000	FS0212205	TB371	L33615909A	MVB2280R6
B30115909	MVB945R4	F8A618381	SVB13950	FS0505909	MVB1165R5	L33615909B	MVB2280R6
B30318381	SVB10888	F8B212205	TB282	FS0515907	MVB1030R5	L37315909	MVB1325R6
B36015907A	MVB875R4	F8B212205A	TB282	FS0515909	MVB1165R5	L51015909B	MVB2280R6
B36615907	MVB885R4	F8B312205	TB282	FS0518381	MVB920R4	LF4J15909B	MVB2240R6
B36615908	MVB885R4	F8B518381	MVB810R4	FS1115907	MVB1030R5	LF1715909	MVB2160R6
B36615908A	MVB885R4	F8B518381C	MVB810R4	FS1115907A	MVB1030R5	LF1715909A	MVB2160R6
B36615909	MVB1000R4	F8Y812205	TB212	FS1215909	MVB1165R5	LF1715909B	MVB2160R6
B50115908	MVB885R4	F8Y912205	TB212	FS1215909A	MVB1165R5	LF1915909	MVB2250R6
B58718381	MVB885R4	F82A15909	MVB975R4	FS1215909B	MVB1165R5	LF1915909A	MVB2250R6
B58815909	MVB1015R4	F82A18381A	MVB925R4	FS1218381	MVB920R4	LF1915909B	MVB2250R6
B59515909	MVB995R4	F82B15909	MVB975R4	FS1218381A	MVB920R4	LF5015909	MVB1306R6
B59615907	MVB885R4	F20115907A	MVB1015R5	FS5918381	MVB920R4	LF5015909A	MVB1306R6
B59615909	MVB995R4	F20115908A	MVB950R5	FS5918381A	MVB920R4	LF5115909	MVB1306R6
B59618381	MVB885R4	F20115909A	MVB1060R5	FS5918381B	MVB920R4	LF6115909B	MVB2250R6
B59712205	TB294	F20118381A	MVB760R3	FSJ218381	MVB920R4	LFH115909B	MVB2265R6
B60118381	SVB10960	F20118908A	MVB950R5	FSM318381	MVB920R4	LFJ515909B	MVB2160R6
B60118381A	SVB10888	F20212205	TB358	G60115908	SVB131175	N3A115907	MVB925R6
B61115908	SVB13950	F20312205	TB358	G60115908A	SVB131175	N3A115908	MVB1045R6
B61115908A	SVB13950	F21012205	TB358	G60118381	SVB131075	N3A118381	MVB1360R5
B61215909A	MVB975R4	F23015909	MVB1060R5	GY0215908	MVB2100R6	N3H115908	MVB775R4
B63012205B	TB266	F26218381A	MVB760R3	GY0218381A	MVB2100R6	N3H115908A	MVB775R4
B63012205C	TB266	F80115381A	MVB810R4	J50315381A	MVB1400R6	N3H118381	MVB825R5
B63012205D	TB266	F80215907A	MVB975R5	J50315908	MVB1025R4	N3H118381A	MVB825R5
B63012205E	TB266	F80312205	TB212	JE4815908	MVB1020R4	N23613715C	SVB10925
B63012205E9A	TB266	F80412205	TB212	JE5315908A	MVB1000R4	N24915906B	SVB131075
B63015907	MVB875R4	F80712205	TB212	JE5318381	MVB1000R4	N30413715	SVB10900
B63015907A	MVB875R4	F80715907	MVB1015R5	JE5718381	SVB131025	N32615908	SVB13975
B63015907B	MVB875R4	F80715908A	MVB950R5	JE5718381A	SVB131025	N32615909	SVB131050
B63212205	TB266	F80715909A	MVB1050R5	JE7215908	SVB131000	N33213813A	SVB10975





OE		OE		OE		OE	
...MAZDA		...MAZDA		...MERCEDES-BENZ		...MERCEDES-BENZ	
N35018381	SVB10800	WL1115908	SVB131000	0009933796	MVB2373R6	0029976892	SVB131150
N37013813A	SVB10960	WL1115908A	SVB131000	0009934596	MVB2040R8	0029977692	SVB101150
NF0115909	SVB131000	WL8112205	TB536	0009936696	MVB2315R7	0029978392	SVB10925
PN1115909	SVB131050	WL8115908A	SVB131000	0009936796	MVB2418R7	0029978692	SVB13825
PN1118381	SVB13875	WLL715908A	SVB13975	0009937696	MVB2365R7	0029979092	SVB131150
PN1215908	SVB171000	XS2E8620HA	MVB2080R6	0009970892	SVB10940	0029979492	SVB13780
PN1215909	SVB131075	XS2Z8620HA	MVB2080R6	0009972492	SVB10850	0029979592	SVB10960
PN1218381	SVB13875	Y40112205	TB720	0009973592	SVB10850	0029979992	SVB131375
PN1315909	SVB13925	Y40112205A	TB720	0009975192	SVB13975	0039970192	SVB131025
PN4018381	SVB13900	Y40115907	MVB1335R6	0009975492	SVB131000	0039970392	SVB131350
R2S215907	SVB13900	Y60112205	TB724	0009975892	SVB13950	0039970592	SVB131150
R20112205	TB271	Y60115909	MVB975R6	0009975992	SVB10875	0039970692	SVB131150
R20112205A	TB271	Y60215909	MVB795R6	0009976892	SVB10950	0039970792	SVB131250
RF1G12205	TB541	Y70112205	TB413	0009977092	SVB131025	0039971992	SVB131375
RF1G18380	SVB10888	Y70115907	SVB10913	0009977192	SVB10925	0039972392	SVB131475
RF1H18380	SVB101050	Y70118381	SVB13975	0009977292	SVB10775	0039972592	SVB10913
RF1S18380A	SVB131050	YF0912205	TB633	0009977392	SVB10960	0039972692	SVB131200
RF2A12205	TB685	YF0915908	MVB2100R6	0009977592	SVB10913	0039972992	SVB131475
RF2A12205A	TB685	YF0915909	MVB1980R6	0009978192	SVB131425	0039973192	SVB131500
RF2A12205B	TB685	YF7112205	TB633	0009978392	SVB10925	0039973392	SVB131325
RF2L18380A	SVB13900	YF7112205A	TB633	0009978692	SVB131250	0039973492	SVB10940
RF2L18380B	SVB13900	Z50112205	TB460	0009978892	SVB131325	0039973592	SVB10975
RF5C12205	TB751	Z50115909	MVB995R4	0009978992	SVB131450	0039974392	SVB131400
RF5C12205A	TB751	Z50212205	TB731	0009979892	SVB131300	0039974592	SVB101200
RF5D15909	MVB1230R8	Z60115909	MVB1875R6	0019937596	MVB2035R7	0039975092	SVB131000
RF5G15909	MVB1230R8	ZJ3815909	MVB1842R6	0019938396	MVB2350R6	0039975392	SVB131300
RF7112205	TB802	ZJ3815909B	MVB1842R6	0019971592	SVB131325	0039975492	SVB131475
RF7L15909	MVB1230R8	ZL0115907	MVB885R4	0019972392	SVB131325	0039975592	SVB10913
RF0112205B	TB590	ZZ3S18381	MVB648R4	0019972592	SVB131400	0039975692	SVB131400
RF0118381	SVB131125	ZZS018381	SVB10650	0019972692	SVB131000	0039976292	SVB131325
RF0315930	SVB13925	ZZS318381	MVB648R4	0019972892	SVB10800	0039976892	SVB10960
RF0315980	SVB13925	ZZS418381	MVB663R4	0019973292	SVB131500	0039976992	SVB131150
RF0515980	SVB131050	ZZS618381	MVB835R4	0019973692	SVB131375	0039977792	SVB131325
RF7112205	TB382	ZZSA18381A	SVB10750	0019974192	SVB13780	0039978292	SVB13850
RF7115907	SVB13850	ZZSC18381	SVB10690	0019974592	SVB10875	0039979592	SVB101175
RF7115907A	SVB13850	MERCEDES-BENZ		0019975092	SVB131400	0049970192	SVB131300
RF7115907B	SVB13850	95X1000N275	SVB101000	0019975692	SVB131475	0049970292	SVB131300
RF7115908	SVB13900	95X1100	SVB101100	0019975892	SVB131350	0049970592	SVB13950
RF7118381	SVB13900	95X1225N275	SVB101225	0019976492	SVB13750	0049970892	SVB10925
RF7118381A	SVB13900	95X1275N275	SVB101275	0019976792	SVB131375	0049971392	SVB131450
RF7118381B	SVB13900	95X1350N275	SVB101350	0019976892	SVB131125	0049971792	SVB131325
RF7118381C	SVB13900	95X750N275	SVB10750	0019976992	SVB131475	0049973392	SVB131350
RF7120737	SVB13710	95X825N275	SVB10825	0019977292	SVB131475	0049973592	SVB13875
RF7120737A	SVB13710	95X850N275	SVB10850	0019978092	SVB13875	0049973892	SVB131025
RF7912205	TB382	95X875N275	SVB10875	0019979092	SVB131500	0049973992	SVB101025
RFC618381	SVB13850	95X900N275	SVB10900	22035575	MVB2080R6	0049974092	SVB131375
RFG113813	MVB688R5	95X925	SVB10925	0029970492	SVB131325	0049975892	SVB131475
RFG113813A	MVB688R5	95X925N275	SVB10925	0029970692	SVB101000	0049975992	SVB131475
RFG115908	SVB13925	95X950N275	SVB10950	0029970892	SVB10940	0049976392	SVB131425
RFG118380	SVB13850	95X975N275	SVB10975	0029970992	SVB10940	0049977492	SVB13875
RFG118380A	SVB13850	125X1000	SVB131000	0029971092	SVB10950	0049977792	SVB10940
RFG118380B	SVB13850	125X1000N275	SVB131000	0029971992	SVB131000	0049977992	SVB131350
RFG118381	SVB13850	125X1025N275	SVB131025	0029972592	SVB13850	0049978092	SVB10960
RFG118381A	SVB13850	125X1300N275	SVB131300	0029973092	SVB13850	0049978492	SVB131150
RFG118381B	SVB13850	125X1425N275	SVB131425	0029973292	SVB101225	0049978592	SVB101000
RFJ515907	SVB13875	125X1450N275	SVB131450	0029973392	SVB131300	0049978792	SVB10940
RFJ518381	SVB131175	125X1475N275	SVB131475	0029973892	SVB131025	0049978892	SVB131325
RFN115908	SVB13925	125X1500N275	SVB131500	0029974492	SVB131350	0049979392	SVB13925
RS7L15909	MVB1230R8	125X1600N275	SVB131600	0029974892	SVB13780	0049979492	SVB13875
SE0178022	SVB131450	125X750N275	SVB13750	0029975092	SVB101175	0049979592	SVB13750
UC8732605	SVB13725	00775	SVB131325	0029975292	SVB13950	0049979992	SVB131150
W02932611	SVB13850	0009931995	SVB13950	0029975392	SVB13825	057903137H	MVB1625R6
W06532611	SVB13875	0009932896	MVB2040R8	0029975992	SVB131425	0059970192	SVB13875
WL0112205	TB536	0009933396	MVB790R4	0029976292	SVB101150	0059971092	SVB13950







OE		OE		OE		OE	
...MERCEDES-BENZ		...MERCEDES-BENZ		...MERCEDES-BENZ		...MERCEDES-BENZ	
0059971192	SVB13950	0089973492	MVB2120R6	0109979192	MVB2190R6	0139972392	MVB2265R6
0059972092	SVB131350	0089973592	MVB2030R6	0109979892	MVB2585R6	0139972592	MVB2080R6
0059973992	SVB131375	0089973692	MVB2100R6	0119970192	MVB1775R6	0139972692	MVB2160R6
0059975392	SVB131000	0089973792	MVB2080R6	0119970292	MVB1875R6	0139974092	MVB2020R6
0059975892	SVB10925	0089973892	MVB2145R6	0119970492	MVB2325R6	0139974192	MVB2125R6
0059976292	SVB13825	0089974292	SVB13950	0119970592	MVB2415R6	0139974492	MVB2271R7
0059976692	SVB101000	0089974892	SVB13950	0119970692	MVB2450R6	0139974592	MVB2135R6
0059976792	SVB101000	0089976392	MVB2020R6	0119970992	MVB2510R6	0139974792	MVB1875R6
0059976892	SVB131000	0089976692	SVB13710	0119971592	MVB2100R6	0139974892	MVB1865R6
0059976992	SVB131025	0089976992	MVB2170R6	0119971892	MVB2050R6	0139975092	MVB2271R7
0059977192	SVB131015	0089977092	MVB2257R6	0119972092	MVB2100R6	0139977392	MVB2315R7
0059977192	SVB131025	0089977092	MVB2265R6	0119972192	MVB2205R6	0139977492	MVB2418R7
0059977692	SVB13900	0089977192	MVB1015R6	0119972992	MVB2540R6	0139978292	SVB13950
0059977892	SVB101140	0089977292	MVB1885R6	0119973092	MVB2440R6	0139978792	MVB2373R6
0059978292	SVB13875	0089977392	MVB1980R6	0119973392	MVB1325R6	0149970492	MVB2271R6
0059978392	SVB10875	0089978792	MVB2205R6	0119973492	MVB2380R6	0149970692	MVB2265R6
0059979592	SVB101100	0089978892	MVB2280R6	0119973692	MVB1760R6	0149970892	MVB2080R6
0059979892	SVB131275	0089979092	MVB1995R6	0119973792	MVB1865R6	0149970992	MVB2190R6
0059979992	SVB131275	0089979292	MVB2050R6	0119973892	MVB2125R6	0149971092	MVB2240R6
0069970592	SVB13975	0099970292	SVB10990	0119974592	MVB2510R6	0149971092	MVB2250R6
0069970792	SVB101000	0099970392	SVB101000	0119974792	MVB2415R6	0149971192	MVB2160R6
0069970992	SVB13750	0099971392	MVB1855R6	0119974892	MVB2120R6	0149971392	MVB1255R5
0069971092	SVB131025	0099971692	MVB2415R6	0119974992	MVB2215R6	0149971592	MVB2271R7
0069971292	SVB13875	0099971792	MVB2350R6	0119975392	MVB1995R6	0149971692	MVB2271R7
0069971592	SVB101140	0099971892	MVB2450R6	0119975592	MVB2205R6	0149971792	MVB2265R6
0069971592	SVB101150	0099974392	SVB131475	0119975892	MVB1325R6	0149973292	MVB1285R5
0069971692	SVB131000	0099975292	SVB10990	0119976392	MVB2338R8	0149973392	MVB1750R5
0069971892	SVB10960	0099975392	SVB101000	0119976492	MVB2440R8	0149973792	MVB2337R7
0069972492	SVB10750	0099975492	MVB2170R6	0119976592	MVB2250R6	0149977192	MVB2380R6
0069972592	SVB10950	0099975892	MVB2440R6	0119976792	MVB2585R6	0159970292	MVB2250R6
0069972692	SVB10990	0099976592	SVB131350	0119976892	MVB2540R6	0159970392	MVB2271R7
0069972892	SVB101225	0099976692	SVB131375	0119976992	MVB1285R7	0159974792	MVB1300R5
0069973092	SVB10975	0099976792	SVB131400	0119977192	MVB1360R7D	0159974892	MVB1765R5
0069973292	SVB10940	0099976892	SVB131025	0119978092	MVB2120R6	0199977492	MVB2418R7
0069976092	SVB101100	0099976992	SVB131025	0119978292	MVB2350R6	1029970092	MVB1885R6
0069976392	SVB13925	0099977692	SVB131300	0119978492	MVB2063R6	1029977292	MVB1885R6
0069976492	SVB13875	0099977892	SVB131325	0119978592	MVB2120R6	1139970092	MVB2440R6
0069976892	SVB13825	0099978692	MVB2460R8	0119978792	MVB2390R6	1139970292	MVB2450R6
0069977192	SVB131375	0099978792	MVB2460R8	0119979192	MVB1285R5	1159970392	MVB2415R6
0069978492	SVB101100	0099979492	MVB1950R6	0119979292	MVB1750R5	1559970392	MVB2415R6
0069979292	SVB10975	0099979592	MVB2338R8	0119979392	MVB1285R5	3459971192	SVB131150
0069979392	SVB131450	0099979692	MVB2440R8	0119979492	MVB1750R5	6019970292	MVB2050R6
0069979792	SVB131025	0109970692	MVB2135R6	0119979792	MVB2390R6	6019970592	MVB1000R6
0079970392	SVB131025	0109972092	SVB131025	0129970092	MVB1270R5	6129970092	MVB2250R6
0079971092	SVB131450	0109973792	SVB131450	0129970192	MVB1725R5	6429970292	MVB2035R7
0079971692	SVB131025	0109974392	MVB2540R6	0129970592	MVB2190R6	007753009502	SVB10750
0079971892	SVB10975	0109974892	MVB2080R6	0129970692	MVB2160R6	007753009502	SVB10900
0079972692	SVB10975	0109975792	MVB2325R6	0129970792	MVB2271R6	007753009507	SVB10925
0079977692	SVB101100	0109975892	MVB2415R6	0129970892	MVB2240R6	0007753012500	SVB13750
0079978092	MVB1980R6	0109975992	MVB2170R6	0129971592	MVB2050R6	007753012500	SVB13750
0079978192	MVB2325R6	0109976292	MVB2050R6	0129973692	MVB2390R6	007753012505	SVB131000
0079978292	MVB2250R6	0109976392	MVB2450R6	0129974292	MVB2080R6	007753012508	SVB131075
0079978492	MVB2120R6	0109977092	MVB2050R6	0129974392	MVB2160R6	007753012510	SVB131125
0079979092	MVB1015R6	0109977292	MVB2325R6	0129975492	MVB1350R6	007753012514	SVB131325
0079979492	MVB1015R6	0109977392	MVB2585R8	0129975592	MVB1350R6	007753012515	SVB131325
0089970192	MVB2030R6	0109977492	MVB2540R6	0129975892	MVB2030R6	007753012519	SVB131425
0089970992	MVB2100R6	0109977892	MVB2540R6	129975892	MVB2030R6	007753012520	SVB131450
0089971792	MVB2170R6	0109977992	MVB2135R6	0129975992	MVB1775R6	007753012521	SVB131475
0089971892	MVB2265R6	0109978192	MVB2415R6	0129977092	MVB2390R6	007753012523	SVB131500
0089972192	MVB2080R6	0109978392	MVB2450R6	0129977492	MVB1270R5	007753012540	SVB131250
0089972392	SVB13655	0109978692	MVB2135R6	0129977592	MVB1725R5	007753012550	SVB131375
0089972692	MVB2100R6	0109978792	MVB2250R6	0139971492	MVB1285R5	007753012558	SVB13825
0089973292	MVB1015R6	0109978892	MVB2225R6	0139971592	MVB1750R5	007753012559	SVB13875
0089973392	MVB2050R6	0109978992	MVB2475R6	0139972292	MVB2190R6	007753112504	SVB131475





OE		OE		OE		OE	
...MERCEDES-BENZ		...MG		...MG		...MG	
9069970792	MVB1480R8	247939	SVB10950	ETC7469	SVB10610	GFB251	SVB10813
9069972392	MVB2040R8	511963	SVB10950	ETC7899	SVB10675	GFB252	SVB10825
014997109264	MVB2250R6	513907	SVB10888	ETC7939	SVB101025	GFB255	SVB10950
0077530012500	SVB131375	522704	SVB10825	ETC8550	TB365	GFB258	SVB101050
MG		524200	SVB101050	ETC9002	SVB131200	GFB259	SVB13925
1G2716	SVB10900	527288	SVB101050	ETC9009	SVB131350	GFB260	SVB10710
1H1001	SVB10900	563132	SVB101025	ETC9019	SVB131175	GFB262	SVB10975
2A414	SVB10813	563132	SVB101050	ETC9080	SVB13875	GFB272	SVB10940
2A801	SVB10813	574046	SVB10888	FDU1464	TB272	GFB273	SVB10875
3H2134	SVB17850	596433	SVB10900	FDU1466	TB317	GFB303	SVB131000
12B307	SVB131225	602319	SVB101150	GCB10700	SVB10700	GFB357	SVB101050
13H1329	SVB10865	603713	SVB13850	GCB10706	SVB10710	GFB362	SVB10710
13H1448	SVB131125	611612	SVB131000	GCB10715	SVB10710	GFB369	SVB101075
13H1840	SVB131075	613602	SVB101225	GCB10813	SVB10813	GFB370	SVB101075
13H3726	SVB101050	614106	SVB13925	GCB10825	SVB10825	GFB376	SVB10700
13H3820	SVB10888	614670	SVB131000	GCB10914	SVB10925	GFB700	SVB10888
13H389	SVB10813	2014034	SVB101050	GCB10937	SVB10940	GFB701	SVB10940
13H4366	SVB10888	46510585A	SVB10740	GCB10950	SVB10950	GFB10706	SVB10710
13H4583	SVB10888	88156489	SVB101100	GCB50765	SVB10750	GFB10725	SVB10710
13H4706	SVB10850	AAU3550	SVB10800	GFB101	SVB10925	GFB10775	SVB10775
13H480	SVB131150	AAU3577	SVB10825	GFB102	SVB10813	GFB10813	SVB10800
13H503	SVB10925	AAU8072	SVB10875	GFB103	SVB10900	GFB10813	SVB10813
13H5373	SVB10825	ADU4236	SVB10825	GFB104	SVB10825	GFB10825	SVB10825
13H589	SVB10813	ADU6528	SVB10940	GFB105	SVB101113	GFB10875	SVB10875
13H6869	SVB101050	ADU8912	SVB10710	GFB120	SVB10865	GFB10900	SVB10900
13H7104	SVB101175	ADU9401	SVB101050	GFB121	SVB10850	GFB10950	SVB10950
13H760	SVB101113	AEA489	SVB10900	GFB122	SVB101113	GFB10975	SVB10975
13H7975	SVB101050	AEC932	SVB101113	GFB122	SVB101125	GFB11044	SVB101050
13H8309	SVB10888	AEH473	SVB10975	GFB124	SVB101025	GFB11065	SVB101050
13H8310	SVB10900	AEH621	SVB10975	GFB124	SVB101050	GFB20864	SVB13850
13H8389	SVB10813	AEJ63	SVB10850	GFB127	SVB10888	GFB21075	SVB131075
13H859	SVB10813	AHU2174	MVB885R4	GFB128	SVB131075	GFB50949	SVB10950
13H923	SVB10900	CAM7910	SVB10950	GFB136	SVB10975	GFB60825	SVB10825
13H924	SVB10940	CAM9989	SVB10710	GFB142	SVB101100	GFB60937	SVB10940
13H9620	SVB10950	CDU2749	TB295	GFB144	SVB101275	GFB61038	SVB101050
17D29	SVB131175	CFB10825	SVB10825	GFB145	SVB10975	GFB80890	MVB885R4
17H760	SVB101100	DBP4131	TB203	GFB147	SVB131175	GFB90890	MVB887R5
2614A026	SVB10925	DBP9289	TB203	GFB165	SVB101050	GMB40890	MVB885R4
13405PP0004	TB354	ECP244	TB312	GFB168	SVB101025	GMB50735	MVB735R5
14400P14004	TB378	ERC0026	SVB131175	GFB170	SVB101125	GMB51202	MVB1200R5
14400P4500	TB353	ERC304	SVB10913	GFB176	SVB10888	GTB1208	TB312
14400P45000	TB353	ERC0400	SVB13850	GFB176	SVB10900	GTB1233	TB317
14400P45010	TB353	ERC657	SVB13925	GFB182	SVB10888	GTB1237	TB272
14400PH7004	TB312	ERC675	SVB13925	GFB183	SVB10825	GTB1238	TB295
31110PA13420	SVB10950	ERC1347	SVB13850	GFB185	SVB10813	GTB1238XS	TB295
56992PL20030	SVB101075	ERC1742	SVB131050	GFB189	SVB131075	GTB1253	TB234
56992PL26610	SVB101075	ERC2774	SVB13850	GFB192	SVB10825	GTB1253XS	TB234
56992PP2E010	SVB10888	ERC4272	SVB13800	GFB193	SVB10813	GTB1283XS	TB295
151209	SVB10913	ERC5146	SVB13750	GFB195	SVB10825	GTB1289	TB367
151515	SVB10900	ERC5836	SVB101125	GFB196	SVB10888	GTB1290	TB378
156489	SVB101100	ERC6072	SVB13925	GFB205	SVB10950	GTB1291	TB353
201403	SVB101050	ERC6504	SVB101025	GFB206	SVB10950	GTB1292	TB354
212683	SVB101125	ERC6886	SVB101025	GFB209	SVB101100	GTB1293XS	TB450
214239	SVB101100	ERC8852	SVB10775	GFB211	SVB101225	GTB1497XS	TB640
214239	SVB101113	ERC8938	SVB101050	GFB212	SVB10950	GTB2003	TB477
214303	SVB101025	ERR0810	SVB131025	GFB213	SVB101100	GTB2004	TB513
214314	SVB101113	ERR1092	TB478	GFB214	SVB10913	GTB2005	TB353
214325	SVB101100	ERR2073	SVB10675	GFB215	SVB131175	GTB2005XS	TB353
214830	SVB101125	ETC4266	SVB10710	GFB216	SVB13850	GTB2006	TB457
216632	SVB10888	ETC4267	SVB10675	GFB243	SVB131075	GTB2016XS	TB317
217391	SVB101100	ETC4272	SVB13800	GFB246	SVB101050	GTB2017XS	TB534
217607	SVB10950	ETC4705	SVB10675	GFB248	SVB101100	GTB2018XS	TB547
219560	SVB10813	ETC5815	SVB13725	GFB249	SVB10950	GTB2019XS	TB650
247920	SVB10913	ETC7394	SVB101215	GFB250	SVB10950	GTB9003XS	TB534







OE		OE		OE		OE	
...MG		MITSUBISHI		MITSUBISHI...		MITSUBISHI...	
GTB9005	TB651	1340A035	MVB1790R5	MB553431	SVB13625	MD106103	TB302
IG2716	SVB10900	1340A052	MVB1190R6	MB553742	SVB13625	MD106658	MVB870R4
IH1001	SVB10900	1340A058	MVB875R4	MB553792	SVB13975	MD110029	TB325
LHN10013	TB560	1340A065	MVB763R4	MB568898	MVB940R4	MD110041	TB402
LHN10015	TB560	1340A066	MVB775R4	MB568899	MVB945R4	MD110709	TB356
LHN10016	TB367	1340A078	MVB1188R5	MB636351	SVB13925	MD111147	MVB975R4
LHN10029	TB477	4451A020	MVB1715R6	MB636553	SVB131150	MD111427	TB401
LHN100040	TB650	4451A023	MVB800R4	MB657285	MVB995R4	MD112347	SVB101090
LHN100310B	TB560	4451A058	MVB985R4	MB813251	MVB1120R5	MD113564	TB518
LHN100390	TB534	4451A059	MVB1715R6	MB813272	MVB1110R5	MD113790	TB213
LHN100400	TB547	14451A023	MVB800R4	MB813344	SVB13925	MD115677	MVB1015R5
LHN100560	TB640	030768	SVB10865	MB813382	SVB13950	MD115977	TB326
LHN100760	TB651	0009932996	MVB1790R5	MB813600	MVB1150R6	MD116786	TB518
MVF10001	TB513	908619200	SVB13925	MB813806	MVB875R5	MD117356	MVB875R4
MVF100040	TB650	7700108148	MVB1120R5	MB831600	MVB1150R6	MD117358	MVB875R4
PQS10037	SVB10740	7700109477	MVB1795R6	MB879764	MVB1150R6	MD118572	MVB875R4
PQS100850	MVB1460R5	7700109601	TB653	MB897764	MVB1150R6	MD118716	MVB1635R6
PQS101030	MVB1180R6	7700865429	MVB1137R6	MB917985	MVB1110R5	MD120487	TB400
PQS101180	MVB1200R5	9086109100	SVB13925	MB917986	MVB865R5	MD120557	SVB131025
PQS101261	MVB1285R6	9086109200	SVB13925	MB918384	MVB1035R5	MD122602	MVB985R4
PQS101262	MVB1285R6	9086109300	MVB13925	MB946603	MVB1060R5	MD127134	SVB13975
PQS101271	MVB1560R6	M616942	MVB1120R5	MB946672	SVB13950	MD130766	MVB985R4
PQS101272	MVB1560R6	M809320	MVB1137R6	MB958695	MVB1240R5	MD132479	MVB985R4
PQS101300	MVB2025R5	M819189	MVB1642R6	MB958696	MVB940R4	MD133115	TB325
PQS101310	MVB869R5	M819383	TB258	MD005350	SVB10813	MD133116	TB402
PQS101450	MVB735R3	M864046	TB545	MD005351	SVB10813	MD134958	MVB1240R5
PSQ100840	MVB735R5	M883810	TB653	MD007528	SVB10940	MD134959	MVB1635R6
PSQ101590	MVB1165R5	M883832	MVB1795R6	MD007628	SVB10940	MD137594	MVB995R4
RKC5233	SVB10925	MB076629	SVB13625	MD009060	SVB10940	MD140070	TB403
TCK0366	SVB10900	MB166385	SVB131025	MD011351	SVB10865	MD140227	TB400
TCK386	SVB10900	MB166386	SVB13780	MD011764	SVB13950	MD140228	TB213
TKC1616	SVB101100	MB166411	SVB13750	MD015311	TB302	MD140229	TB356
TKC2165	SVB101100	MB167062	SVB13825	MD015701	TB213	MD142117	MVB1345R5
TKC2444	SVB13925	MB167064	SVB13875	MD017469	SVB171115	MD144817	MVB985R4
TKC2802	SVB10940	MB167065	SVB13900	MD021458	SVB13925	MD145713	TB325
TKC6621	SVB101100	MB167066	SVB13950	MD021663	SVB10940	MD145714	TB402
TRC2801	SVB10975	MB167067	SVB13975	MD025522	SVB13950	MD145716	TB326
UAM1058	SVB10700	MB167069	SVB131000	MD025523	SVB10960	MD145813	TB366
UE31113RR	SVB101275	MB178430	SVB13675	MD025826	SVB10940	MD153723	TB322
UE31855RR	SVB10975	MB182293	TB406	MD026572	SVB10940	MD159551	SVB171115
WAM2804	TB234	MB182294	TB407	MD027458	SVB10940	MD159552	SVB171115
XHM460	TB312	MB192976	SVB13975	MD030768	SVB10865	MD160103	TB302
MINI		MB192977	SVB13675	MD041390	TB213	MD161427	TB403
9682237080	MVB795R6	MB266253	SVB131025	MD041407	TB302	MD163032	MVB775R4
11280300802	MVB1370R6	MB272651	SVB13875	MD041704	SVB10975	MD165995	MVB1065R6
11281497435	MVB1050R6	MB272651	SVB13900	MD050180	SVB171115	MD171373	MVB775R4
11281505672	MVB890R6	MB272652	SVB13925	MD063845	SVB131000	MD171748	TB325
11287509992	MVB1035R6	MB272653	SVB13950	MD068173	TB356	MD171749	TB326
11287518249	MVB890R6	MB288838	SVB13625	MD069671	MVB870R4	MD172376	MVB920R4
11287518250	MVB1035R6	MB298267	SVB13925	MD069672	MVB940R4	MD172544	MVB950R5
11287518251	MVB1050R6	MB332253	SVB13800	MD070584	SVB131000	MD173201	MVB920R4
11287520199	MVB1388R6	MB350809	SVB13625	MD071350	SVB131000	MD173536	MVB760R3
11287526363	MVB890R6	MB351275	SVB13655	MD074251	MVB975R4	MD176386	TB379
11287526364	MVB1050R6	MB439336	MVB920R4	MD076885	SVB171115	MD176387	TB381
11287534703	MVB870R6	MB439494	MVB925R4	MD083704	SVB131000	MD176389	TB380
11287545120	MVB1370R6	MB439714	MVB915R4	MD095193	SVB131000	MD176793	SVB13610
11287566789	MVB906R6	MB501593	SVB13625	MD098491	TB213	MD176794	SVB13655
11287571377	MVB906R6	MB501594	SVB13675	MD098492	TB356	MD176795	SVB13625
11287791336	MVB1180R7	MB553390	SVB13655	MD100349	SVB131000	MD178429	SVB13625
11287791337	MVB935R7	MB553391	SVB13625	MD100814	TB518	MD178430	SVB13675
11287795036	MVB795R6	MB553392	SVB13675	MD101800	MVB1240R5	MD178431	SVB13675
11287798112	MVB975R6	MB553428	SVB13675	MD102249	TB213	MD179620	TB409
11317805957	TB724	MB553429	SVB13625	MD102970	SVB131000	MD179679	MVB920R4
		MB553430	SVB13800	MD102970	SVB131025	MD180106	MVB925R5





OE		OE		OE		OE	
MITSUBISHI...		MITSUBISHI...		MITSUBISHI...		MITSUBISHI...	
MD180574	MVB763R4	MD304887	MVB1345R5	MD343575	MVB775R4	MR360148	SVB13950
MD180581	SVB13750	MD306981	TB359	MD344478	MVB950R5	MR360150	SVB13875
MD182201	TB402	MD307487	TB673	MD345395	MVB865R5	MR460467	MVB790R4
MD182291	TB325	MD308925	MVB960R4	MD345397	MVB1060R5	MR984778	TB326
MD182292	TB684	MD310014	MVB1050R4	MD349465	MVB938R5	MR994718	MVB1875R6
MD182293	TB406	MD310371	MVB1035R5	MD350259	MVB1215R6	MW30621589	TBK275
MD182294	TB407	MD310484	TB490	MD350607	MVB715R4	MZ701085	MVB925R4
MD182295	TB326	MD310616	MVB985R4	MD353700	TB788	REMF6350	SVB13925
MD183005	TB403	MD310617	MVB698R4	MD355002	MVB975R4	MORRIS	
MD183556	MVB763R4	MD310836	TB493	MD356322	TB550	1G2716	SVB10900
MD184355	SVB131025	MD311554	MVB950R5	MD357086	MVB960R5	1H1001	SVB10900
MD184973	MVB945R4	MD311704	MVB1080R4	MD360214	MVB1775R6	2A414	SVB10813
MD185956	SVB13975	MD311757	SVB101100	MD360215	MVB1440R6	2A801	SVB10813
MD185959	SVB13925	MD311758	SVB101100	MD361162	MVB775R3	3H2134	SVB17850
MD185960	SVB13800	MD312400	MVB775R4	MD361164	MVB855R4	12B307	SVB131225
MD185961	SVB13625	MD313658	SVB101100	MD363022	MVB970R4	13H1329	SVB10865
MD185962	SVB13625	MD313659	SVB101100	MD363023	MVB1000R4	13H1448	SVB131125
MD185963	SVB13975	MD313660	SVB101090	MD363460	MVB960R5	13H1840	SVB131075
MD185964	SVB13780	MD313662	SVB101090	MD364114	TB550	13H3726	SVB101050
MD186111	MVB640R4	MD313663	SVB101075	MD366357	MVB865R5	13H3820	SVB10888
MD186123	MVB975R4	MD313664	SVB101075	MD366490	MVB2418R7	13H389	SVB10813
MD186124	MVB975R4	MD314456	TB492	MD368858	MVB1125R4	13H4366	SVB10888
MD186125	MVB985R4	MD314778	MVB588R4	MD369862	MVB1369R6	13H4583	SVB10888
MD186126	MVB995R4	MD316007	SVB131025	MD369960	TB718	13H4706	SVB10850
MD187461	MVB1240R5	MD316008	SVB131025	MD373620	MVB865R5	13H480	SVB131150
MD187462	MVB1345R5	MD316140	MVB1135R5	MD375935	MVB1060R5	13H503	SVB10925
MD187463	MVB1065R6	MD317142	MVB1065R6	MD377240	TB718	13H5373	SVB10825
MD188026	MVB950R5	MD317871	TB673	MD377381	MVB1440R6	13H589	SVB10813
MD188826	MVB1125R4	MD318667	MVB1065R6	MD501592	SVB13655	13H6869	SVB101050
MD189129	MVB648R4	MD318874	MVB1200R6	MD553429	SVB13625	13H7104	SVB101175
MD189130	MVB698R4	MD319023	TB684	MD568898	MVB940R4	13H760	SVB101113
MD189521	TB405	MD319266	TB801	MD636351	SVB13925	13H7975	SVB101050
MD189522	TB404	MD322330	MVB900R4	MD3130370	MVB985R5	13H8309	SVB10888
MD191218	MVB940R4	MD322641	TB694	ME035061	SVB171055	13H8310	SVB10900
MD191982	TB493	MD323455	TB407	ME035062	SVB171055	13H8389	SVB10813
MD192295	TB326	MD323573	MVB1200R6	ME900202	SVB13625	13H859	SVB10813
MD192319	TB671	MD325262	MVB975R5	ME909202	SVB13800	13H923	SVB10900
MD192808	MVB763R4	MD325599	MVB1060R5	MH014050	SVB10975	13H924	SVB10940
MD192809	MVB950R5	MD325600	MVB869R5	MH014051	SVB10975	13H9620	SVB10950
MD193874	TB403	MD325854	TB491	MH014054	SVB10975	17D29	SVB131175
MD193875	TB550	MD326025	TB325	MH014055	SVB10975	17H760	SVB101100
MD197136	TB213	MD326059	TB325	MH014065	SVB10960	2614A026	SVB10925
MD197137	TB400	MD326780	MVB940R4	MH014066	SVB10960	13405PP0004	TB354
MD197141	TB406	MD326781	MVB1388R5	MH014109	SVB13625	14400P14004	TB378
MD197142	TB325	MD326782	MVB1090R5	MH014377	SVB13655	14400P4500	TB353
MD197144	TB407	MD329639	TB540	MN128695	MVB1833R6	14400P45000	TB353
MD197145	TB401	MD331076	TB788	MN155725	MVB2418R7	14400P45010	TB353
MD197146	TB403	MD331884	MVB1300R5	MN155726	MVB970R4	14400PH7004	TB312
MD197147	TB550	MD334464	MVB775R4	MN155728	MVB1135R5	31110PA13420	SVB10950
MD197152	TB671	MD337406	MVB885R4	MN158794	MVB1795R6	56992PL20030	SVB101075
MD197722	MVB925R5	MD337407	MVB938R5	MN158795	MVB1450R6	56992PL26610	SVB101075
MD198169	SVB131025	MD337658	MVB1050R4	MN163085	MVB1875R6	56992PP2E010	SVB10888
MD199223	MVB1135R5	MD338288	TB406	MN176569	MVB1225R5	151209	SVB10913
MD199224	MVB1065R4	MD338461	MVB940R4	MN176570	MVB915R5	151515	SVB10900
MD199418	TB402	MD338462	MVB1370R5	MN183019	MVB900R5	156489	SVB101100
MD199826	MVB1125R4	MD338513	MVB865R5	MN183597	MVB2418R7	201403	SVB101050
MD300470	TB359	MD339052	TB407	MN183866	MVB1885R6	212683	SVB101125
MD300473	TB490	MD340589	MVB962R6	MN195737	MVB906R5	214239	SVB101100
MD300587	MVB698R4	MD340625	TB491	MN980100	TB743	214239	SVB101113
MD301833	MVB775R4	MD340660	SVB101075	MQ900831	MVB1110R4	214303	SVB101025
MD303031	MVB900R4	MD340661	SVB101075	MQ900832	MVB975R4	214314	SVB101113
MD303375	TB684	MD340887	MVB1450R6	MR148271	MVB940R4	214325	SVB101100
MD303478	SVB101075	MD342154	TB786	MR148321	SVB13875	214830	SVB101125
MD303972	SVB101075	MD343234	TB684	MR148323	MVB925R4	216632	SVB10888







OE		OE		OE		OE	
...MORRIS		...MORRIS		...MORRIS		...MORRIS	
217391	SVB101100	ETC4705	SVB10675	GFB248	SVB101100	GTB9005	TB651
217607	SVB10950	ETC5815	SVB13725	GFB249	SVB10950	IG2716	SVB10900
219560	SVB10813	ETC7394	SVB101215	GFB250	SVB10950	IH1001	SVB10900
247920	SVB10913	ETC7469	SVB10610	GFB251	SVB10813	LHN10013	TB560
247939	SVB10950	ETC7899	SVB10675	GFB252	SVB10825	LHN10015	TB560
511963	SVB10950	ETC7939	SVB101025	GFB253	SVB10840	LHN10016	TB367
513907	SVB10888	ETC8550	TB365	GFB255	SVB10950	LHN100040	TB650
522704	SVB10825	ETC9002	SVB131200	GFB258	SVB101050	LHN100310B	TB560
524200	SVB101050	ETC9009	SVB131350	GFB259	SVB13925	LHN100390	TB534
527288	SVB101050	ETC9019	SVB131175	GFB260	SVB10710	LHN100400	TB547
563132	SVB101025	ETC9080	SVB13875	GFB262	SVB10975	LHN100560	TB640
563132	SVB101050	FDU1464	TB272	GFB272	SVB10940	LHN100760	TB651
574046	SVB10888	FDU1466	TB317	GFB273	SVB10875	MVF100040	TB650
596433	SVB10900	GCB10700	SVB10700	GFB303	SVB131000	PQS10037	SVB10740
602319	SVB101150	GCB10706	SVB10710	GFB357	SVB101050	RKC5233	SVB10925
603713	SVB13850	GCB10715	SVB10710	GFB362	SVB10710	TCK0366	SVB10900
611612	SVB131000	GCB10813	SVB10813	GFB369	SVB101075	TKC386	SVB10900
613602	SVB101225	GCB10825	SVB10825	GFB370	SVB101075	TKC1616	SVB101100
614106	SVB13925	GCB10914	SVB10925	GFB376	SVB10700	TKC2165	SVB101100
614670	SVB131000	GCB10937	SVB10940	GFB700	SVB10888	TKC2444	SVB13925
2014034	SVB101050	GCB10950	SVB10950	GFB701	SVB10940	TKC2802	SVB10940
46510585A	SVB10740	GCB50765	SVB10750	GFB10706	SVB10710	TKC6621	SVB101100
88156489	SVB101100	GFB101	SVB10925	GFB10725	SVB10710	TRC2801	SVB10975
AAU3550	SVB10800	GFB102	SVB10813	GFB10775	SVB10775	UAM1058	SVB10700
AAU3577	SVB10825	GFB103	SVB10900	GFB10813	SVB10800	UE31113RR	SVB101275
AAU8072	SVB10875	GFB104	SVB10825	GFB10813	SVB10813	UE31855RR	SVB10975
ADU4236	SVB10825	GFB105	SVB101113	GFB10825	SVB10825	WAM2804	TB234
ADU6528	SVB10940	GFB120	SVB10865	GFB10875	SVB10875	XHM460	TB312
ADU8912	SVB10710	GFB121	SVB10850	GFB10900	SVB10900	MOSKVIC	
ADU9401	SVB101050	GFB122	SVB101113	GFB10950	SVB10950	4021308020	SVB10850
AEA489	SVB10900	GFB122	SVB101125	GFB10975	SVB10975	4121308020	SVB10825
AEC932	SVB101113	GFB124	SVB101025	GFB11044	SVB101050	9651308020A	SVB10950
AEH473	SVB10975	GFB124	SVB101050	GFB11065	SVB101050	NISSAN	
AEH621	SVB10975	GFB127	SVB10888	GFB20864	SVB13850	007234	SVB131250
AEJ63	SVB10850	GFB128	SVB131075	GFB21075	SVB131075	007237	SVB131275
CAM7910	SVB10950	GFB136	SVB10975	GFB50949	SVB10950	11720AA000	MVB885R4
CAM9989	SVB10710	GFB142	SVB101100	GFB60825	SVB10825	11720AD200	SVB13975
CDU2749	TB295	GFB144	SVB101275	GFB60838	SVB10840	11720AR000	MVB1950R6
CFB10825	SVB10825	GFB145	SVB10975	GFB60937	SVB10940	11720AR010	MVB1930R6
DBP4131	TB203	GFB147	SVB131175	GFB61038	SVB101050	11720AU600	SVB13975
DBP9289	TB203	GFB165	SVB101050	GTB1208	TB312	11720AW300	MVB1788R7
ECP244	TB312	GFB168	SVB101025	GTB1233	TB317	11720B1100	SVB101050
ERC0026	SVB131175	GFB170	SVB101125	GTB1237	TB272	11720B1101	SVB101050
ERC304	SVB10913	GFB176	SVB10888	GTB1238	TB295	11720BC21A	MVB1035R7
ERC0400	SVB13850	GFB176	SVB10900	GTB1238XS	TB295	11720BN700	MVB1135R5
ERC657	SVB13925	GFB182	SVB10888	GTB1253	TB234	11720BN701	MVB1200R5
ERC675	SVB13925	GFB183	SVB10825	GTB1253XS	TB234	11720BX000	MVB835R4
ERC1347	SVB13850	GFB185	SVB10813	GTB1283XS	TB295	11720BX005	MVB835R4
ERC1742	SVB131050	GFB189	SVB131075	GTB1289	TB367	11720BX010	MVB668R3
ERC2774	SVB13850	GFB192	SVB10825	GTB1290	TB378	11720BX015	MVB668R3
ERC4272	SVB13800	GFB193	SVB10813	GTB1291	TB353	11720CK80A	MVB1215R6
ERC5146	SVB13750	GFB195	SVB10825	GTB1292	TB354	11720D0101	SVB10875
ERC5836	SVB101125	GFB196	SVB10888	GTB1293XS	TB450	11720D2000	SVB10875
ERC6072	SVB13925	GFB205	SVB10950	GTB1497XS	TB640	11720D2005	SVB10875
ERC6504	SVB101025	GFB206	SVB10950	GTB2003	TB477	11720D2800	SVB13850
ERC6886	SVB101025	GFB209	SVB101100	GTB2004	TB513	11720D2811	SVB13850
ERC8852	SVB10775	GFB211	SVB101225	GTB2005	TB353	11720D3300	SVB10875
ERC8938	SVB101050	GFB212	SVB10950	GTB2005XS	TB353	11720D3301	SVB10875
ERR0810	SVB131025	GFB213	SVB101100	GTB2006	TB457	11720D3310	SVB10875
ERR1092	TB478	GFB214	SVB10913	GTB2016XS	TB317	11720D4001	MVB960R4
ERR2073	SVB10675	GFB215	SVB131175	GTB2017XS	TB534	11720D4007	MVB810R4
ETC4266	SVB10710	GFB216	SVB13850	GTB2018XS	TB547	11720D4007TM	MVB810R4
ETC4267	SVB10675	GFB243	SVB131075	GTB2019XS	TB650	11720D4008	MVB810R4
ETC4272	SVB13800	GFB246	SVB101050	GTB9003XS	TB534	11720D4017	MVB810R4





OE		OE		OE		OE	
...NISSAN		...NISSAN		...NISSAN		...NISSAN	
11720D4201	MVB730R6	11720V5300	MVB1020R4	11920V5001	SVB131425	117200F300	SVB10900
11720D4202	MVB706R4	11720V5302	MVB1025R4	11920V5012	SVB131425	117200M000	MVB825R4
11720D9700	SVB171045	11720V5303	MVB1020R4	11920V7301	MVB845R4	117200M010	MVB825R4
11720E011	SVB10865	11720V5312	MVB1025R4	11920V7302	MVB850R4	117200M311	MVB1100R4
11720E3000	SVB10865	11720V5313	MVB1025R4	11920V7311	MVB845R4	117200M313	MVB1110R4
11720E3001	SVB10900	11720V5500	SVB10875	11920W4400	SVB13850	117200N500	MVB1125R4
11720E3005	SVB10900	11720V5501	SVB10875	11920W5800	SVB13875	117200N502	MVB1125R4
11720E3010	SVB10865	11720V5510	SVB10875	11920W6800	SVB13875	117200P500	MVB1015R4
11720E3011	SVB10865	11720V7300	MVB870R4	11950AR000	MVB945R4	117200W000	MVB1065R6
11720E3015	SVB10865	11720V7301	MVB870R4	11950C8600	SVB131275	117200W002	MVB1065R6
11720E4600	SVB10850	11720V7302	MVB855R4	11950D2015	SVB13750	117201C501	SVB131050
11720E4615	SVB10850	11720V7310	MVB870R4	11950D2017	SVB13750	117201C502	SVB131050
11720E8700	SVB13850	11720V7311	MVB870R4	11950D4200	MVB940R4	117201F700	MVB675R6
11720EB300	MVB1270R7	11720VB500	SVB131075	11950D4201	MVB920R4	117201F710	MVB648R4
11720EB30A	MVB1270R7	11720VB510	SVB131075	11950D4210	MVB940R4	117201P100	MVB838R6
11720EL00A	MVB1200R6	11720VC101	MVB1638R7	11950D4211	MVB920R4	117201P101	MVB838R6
11720EN20A	MVB1215R6	11720VC102	MVB1638R7	11950EB300	MVB825R4	117202F000	MVB800R4
11720F6300	MVB1045R4	11720VC103	MVB1638R7	11950EB30A	MVB825R4	117202F005	MVB800R4
11720F6310	MVB1045R4	11720VC200	MVB1065R6	11950F6101	MVB1000R3	117202F200	MVB825R4
11720F6501	MVB1045R4	11720VJ200	MVB915R4	11950F6102	MVB1000R3	117202F205	MVB835R4
11720F6600	MVB1040R4	11720VS40A	MVB1638R7	11950F6111	MVB1000R3	117202F610	SVB13850
11720G0300	SVB10840	11720W0700	SVB13875	11950G2401	SVB131150	117202M310	MVB715R4
11720G3610	SVB13950	11720W3410	SVB131025	11950V5201	SVB131050	117204A0A1	MVB835R4
11720G5500	SVB171045	11720W3411	SVB131025	11950V5212	SVB131050	117204F100	MVB675R6
11720G5510	SVB171045	11720W4405	SVB10875	11950V7300	MVB825R3	117204F105	MVB884R6
11720G5510JP	SVB171045	11720Y4000	SVB13900	11950V7301	MVB838R3	117204F110	MVB648R4
11720G5510KE	SVB171045	11720Y4005	SVB13875	11950V7302	MVB825R3	117204M510	MVB825R6
11720G8000	SVB131050	11721H7200	SVB10960	11950V7310	MVB825R3	117204M511	MVB825R6
11720G8001	SVB131050	11721H7200	SVB10975	11950V7311	MVB838R3	117204M512	MVB825R6
11720H8500	SVB10975	11721H7201	SVB10975	11950V7710	MVB825R3	117204P10A	MVB1150R6
11720J0300	SVB10913	11721H7210	SVB10975	11950W4410	SVB13800	117206F900	MVB960R5
11720N8500	SVB10900	11721Y9501	SVB10975	13028AW300	TB756	117206F905	MVB775R5
11720N8503	SVB10950	11750C6000	SVB131350	13028AW301	TB756	117206N200	MVB2250R6
11720N9500	SVB10913	11750D1100	SVB13750	13028BN700	TB713	117209C603	SVB13850
11720N9510	SVB10975	11750D2810	SVB10610	13028BN701	TB713	117209F600	MVB825R6
11720N9515	SVB10950	11750G9600	SVB131125	13028D2800	TB521	117209F605	MVB825R6
11720N9520	SVB10975	11750N9520	SVB131250	13028D4211	TB333	117209F610	MVB825R6
11720N9590	SVB10913	11750V2000	SVB131125	13028DN700	TB713	119200E000	MVB1025R6
11720N9700	SVB10900	11750V5700	SVB13825	13028DN701	TB713	119200E001	MVB1025R6
11720N9710	SVB10888	11750Y4011	SVB131125	13028HC330	TB271	119200F000	SVB13925
11720P8000	SVB13900	11750Y4015	SVB131200	13028HC400	TB282	119200F300	SVB13925
11720P8010	SVB131125	11920AG900	MVB945R4	13028HC430	TB282	119200H600	MVB855R4
11720P0300	SVB10900	11920BX000	MVB1065R4	13028HC431	TB282	119200H610	MVB855R4
11720P0305	SVB13875	11920BX005	MVB1065R6	13028V7211	TB300	119200M800	MVB1015R6
11720Q5201	MVB810R4	11920C6000	SVB13975	13028V7225	TB300	119200P500	MVB960R4
11720R7400	SVB10850	11920C8600	SVB131500	13028V7285	TB300	119200W000	MVB1285R5
11720R7410	SVB10875	11920D1700	SVB17850	14853H9910	SVB101000	119200W001	MVB1285R5
11720S0101	SVB10865	11920D4007	MVB810R4	16806D5610	TB361	119200W002	MVB1285R5
11720T6200	SVB13975	11920D4201	MVB884R6	16806G5500	TB412	119201P100	MVB1015R4
11720U0105	SVB10888	11920F5100	SVB13925	16806G5510	TB412	119201P110	MVB1015R4
11720V0701	SVB13975	11920F6100	MVB1420R4	16806G5525	TB412	119202F200	MVB1025R6
11720V0702	SVB13975	11920F6110	MVB1420R4	16806V7200	TB300	119202F205	MVB1025R6
11720V0703	SVB13975	11920F6111	MVB1420R4	16806V7210	TB300	119202Y501	MVB1105R6
11720V0705	SVB131000	11920F6501	MVB960R4	16806V7225	TB300	119204M500	MVB1115R6
11720V0706	SVB131000	11920G2500	SVB13825	21066R8300	SVB131000	119205U011	MVB1025R6
11720V0707	SVB131000	11920H8900	SVB13800	21067L0100	SVB13925	119206J900	MVB1115R6
11720V0708	SVB131000	11920M6601	SVB13850	117200C800	MVB950R5	119206J910	MVB1115R6
11720V0709	SVB171000	11920M6660	SVB13850	117200C805	MVB950R5	119209C600	SVB13950
11720V0710	SVB13975	11920N9505	SVB13850	117200C810	MVB900R4	119209F500	MVB1025R6
11720V2000	SVB13875	11920Q5200	MVB835R4	117200E010	MVB825R4	119209F505	MVB1025R6
11720V2010	SVB13900	11920R2001	SVB13850	117200E400	SVB13850	119209F605	MVB1115R6
11720V5001	SVB13925	11920V1900	SVB13925	117200E401	SVB13850	119500F300	SVB131150
11720V5011	SVB13925	11920V2000	SVB13900	117200E410	SVB13850	119500M200	MVB810R4
11720V5012	SVB13925	11920V2100	SVB13825	117200F000	SVB131150	119500P600	MVB900R4







OE		OE		OE		OE	
...NISSAN		...NISSAN		...NISSAN		...NISSAN	
119500P610	MVB915R4	1172010G01	SVB13975	1175001B00	MVB625R3	1195031U00	MVB775R4
119500P611	MVB900R4	1172016A01	SVB13800	1175005E00	SVB13900	1195031U01	MVB775R4
119504F105	MVB763R4	1172016A02	SVB13900	1175005E10	SVB13900	1195031U02	MVB775R4
119505F600	MVB763R4	1172016A06	SVB13875	1175005E10KE	SVB13900	1195035F00	MVB835R4
119505J010	MVB855R4	1172016A10	SVB13800	1192001B10	MVB810R4	1195041B00	MVB763R4
119505J011	MVB855R4	1172016E01	MVB735R4	1192001M01	SVB13800	1195041B01	MVB763R4
119509F600	MVB845R4	1172016E02	MVB725R4	1192001M10	SVB13800	1195041B02	MVB763R4
119509F605	MVB845R4	1172016V01	MVB1110R4	1192001W00	SVB131350	1195042L00	MVB850R3
119509F610	MVB850R4	1172016V11	MVB1110R4	1192004U00	MVB945R4	1195042L10	MVB850R3
130280B700	TB793	1172017S00	SVB131000	1192004W00	SVB13825	1195043G00	SVB131150
130280B725	TB793	1172017S10	SVB131000	1192006P01	MVB945R4	1195043G01	SVB131150
130280B785	TB793	1172022J00	SVB131075	1192010G01	SVB131450	1195053J10	MVB845R4
130282J600	TB290	1172022J10	SVB131075	1192010G02	SVB131450	1195053J20	MVB845R4
130282J625	TB290	1172024U00	MVB875R4	1192015S00	SVB13925	1195054A00	SVB13675
130282J685	TB290	1172025A00	SVB13800	1192016A00	SVB13875	1195054A10	SVB13675
130286F900	TB457	1172026E02	MVB775R4	1192016A10	SVB13875	1195054C00	MVB920R4
130287C000	TB487	1172026E12	MVB775R4	1192016E01	MVB1200R6	1195054C10	MVB920R4
168060M900	TB503	1172028E10	MVB706R4	1192016V00	MVB915R4	1195058S01	MVB850R3
168060M925	TB503	1172029S00	SVB13850	1192016V10	MVB915R4	1195058S02	MVB850R3
168062J600	TB645	1172030R00	MVB1306R6	1192021B00	MVB835R4	1195059S02	MVB945R4
168062J625	TB645	1172030R10	MVB1306R6	1192021B05	MVB825R4	1195060U05	MVB1285R7
168069C600	TB487	1172030W00	SVB10940	1192021L00	SVB13925	1195065F10	MVB872R3
1172000Q1U	MVB1200R5	1172031U00	MVB884R6	1192021M00	SVB13800	1195067S00	MVB850R3
1172000QA0	TB712	1172031U02	MVB884R6	1192021M00	SVB13825	1195067S01	MVB850R3
1172000QA2	MVB1200R6	1172042L01	MVB850R4	1192028E10	MVB884R6	1195070J00	MVB845R4
1172000QAJ	MVB1120R5	1172042L02	MVB860R4	1192028L00	SVB13900	1195070J05	MVB845R4
1172000QAM	MVB890R6	1172042L03	MVB850R4	1192030R10	MVB875R4	1195071E00	MVB900R4
1172000QAN	MVB1135R5	1172042L12	MVB860R4	1192030W00	SVB13825	1195071E10	MVB900R4
1172000QAP	MVB1200R5	1172043G01	SVB131150	1192031U00	MVB1100R6	1195072B00	MVB725R4
1172000QAR	MVB735R4	1172043G02	SVB131150	1192031U02	MVB1100R6	1195072B01	MVB725R4
1172000QAS	MVB925R4	1172043G03	SVB131150	1192042L01	MVB920R4	1195080W00	SVB131175
1172000QAT	MVB900R4	1172043G91JP	SVB131150	1192053J00	MVB1035R6	1195080W10	SVB131175
1172000QAV	MVB735R3	1172050A00	MVB995R4	1192053J0010	MVB1035R6	1195085E00	MVB1040R4
1172001B00	MVB872R3	1172050A10	MVB995R4	1192053J01	MVB1035R6	1195086L00	MVB900R4
1172001B01	MVB915R3	1172052F00	MVB938R5	1192053J10	MVB1035R6	1195097E00	MVB985R4
1172001B02	MVB780R3	1172052F10	MVB938R5	1192053J20	MVB850R4	1302816A01	TB521
1172001B04	MVB780R3	1172053J10	MVB835R4	1192058S00	MVB920R4	1302816A10	TB521
1172001B05	MVB760R3	1172053Y00	MVB800R4	1192058S01	MVB925R4	1302816V00	TB626
1172002N00	SVB131150	1172053Y01	MVB800R4	1192060U01	MVB945R4	1302845P00	TB626
1172002N03	SVB131150	1172053Y10	MVB800R4	1192070J00	MVB1035R6	1302845P85	TB626
1172002N04	SVB131150	1172053Y20	MVB800R4	1192077A00	MVB835R4	1302851E00	TB333
1172003J00	SVB101140	1172054B00	MVB884R6	1192077A10	MVB835R4	1302851E10	TB333
1172003J01	SVB101140	1172059M00	SVB13850	1192077A12	MVB835R4	1302851E25	TB333
1172003N00	MVB900R5	1172059S01	MVB875R4	1192080W00	SVB13825	1302854A00	TB521
1172005E00	SVB13900	1172059Y00	SVB13850	1192080W10	SVB13825	1302854A01	TB521
1172005E05	SVB13900	1172067A00	MVB1015R4	1192085E01	MVB1190R4	1302854A10	TB521
1172005E10	SVB13900	1172067S00	MVB860R4	1192085E11	MVB1190R4	1302854A25	TB521
1172005E15	SVB13900	1172067S01	MVB860R4	1192097E20	MVB1190R4	1302854A85	TB521
1172005E60	SVB13780	1172069T01	SVB131150	1192097E26	MVB1190R4	1302857J00	TB290
1172005E65	SVB13725	1172070J00	MVB835R4	1195004U00	MVB945R4	1302857J01	TB290
1172005E70	SVB13780	1172070J05	MVB825R4	1195006E01	SVB10950	1302857J25	TB290
1172005E75	SVB13725	1172071E10	MVB725R4	1195006J00	SVB131250	1302859Y00	TB469
1172006E01	SVB101050	1172071J00	MVB810R4	1195008E00	SVB10950	1302859Y25	TB469
1172006E06	SVB10940	1172071J01	MVB810R4	1195008E01	SVB10950	1302881T00	TB542
1172006E11	SVB10790	1172071J05	MVB915R4	1195008E05	SVB10940	1302881T25	TB542
1172006J01	SVB131150	1172077A00	MVB915R4	1195008E15	SVB10940	1308221J85	TB690
1172006J02	SVB131150	1172077A00TM	MVB915R4	1195010G00	SVB131175	1680600QA1	TB636
1172008E01	SVB101050	1172077A10	MVB915R4	1195010G01	SVB131175	1680600QA2	TB713
1172008E02	SVB101050	1172077A12	MVB835R4	1195010G02	SVB131175	1680600QA7	TB636
1172008E06	SVB10940	1172080W00	SVB10940	1195011M03	SVB131000	1680600QAA	TB636
1172008E07	SVB10940	1172080W10	SVB10940	1195011M10	SVB131000	1680600QAC	TB653
1172008E15	SVB10790	1172085G00	MVB915R4	1195016E10	MVB1040R4	1680600QAD	TB710
1172008E16	SVB10790	1172085G10	MVB915R4	1195018E10	MVB1040R4	1680600QAH	TB710
1172010G00	SVB13975	1172097E10	MVB865R5	1195024U05	MVB970R4	1680600QAM	TB482





OE		OE		OE		OE	
...NISSAN		...NISSAN		...OPEL		...OPEL	
1680600QAN	TB482	0211790523	SVB13900	636352	TB413	1340614	MVB1904R6
1680600QAP	TB735	0211790525	SVB13900	636366	TB413	1340615	MVB2265R6
1680600QAZ	TB713	0211790526	SVB13900	636372	TB336	1340616	MVB1805R6
1680600QBC	TB713	0211791023	SVB13900	636561	TB336	1340617	MVB1460R5
1680600QBE	TB713	0211791523	SVB13925	636566	TB336	1340618	MVB1530R6
1680600QBF	TB482	0211792023	SVB13925	636568	TB508	1340619	MVB890R6
1680605E00	TB610	0211792023TM	SVB13925	636569	TB509	1340620	MVB1725R6
1680613C00	TB412	0211792033	SVB13925	636570	TB393	1340621	MVB1725R6
1680616A00	TB503	0211792523	SVB13925	636571	TB481	1340622	SVB10925
1680616A10	TB503	0211792523TM	SVB13925	636573	TB783	1340625	MVB1904R6
1680654A00	TB503	0211793523	SVB13900	636575	TB780	1340626	MVB1805R6
1680654A10	TB503	0211794513	SVB10950	636576	TB509	1340627	MVB1805R6
1680654A25	TB503	0211795013	SVB10950	636579	TB481	1340628	MVB1360R5
1680654A26	TB503	0211795023	SVB13950	636728	TBK091	1340629	MVB1225R5
1680659E00	TB361	0211799023	SVB131000	949602	MVB2188R8	1340632	SVB171055
2106629W00	SVB13925	780000120	SVB131175	950350	SVB10875	1340635	MVB1215R5
2106629W00JP	SVB13975	1172018000	SVB10840	950351	SVB10888	1340636	MVB1680R5
2106629W00KE	SVB13975	1172018001	SVB10840	950352	SVB10850	1340637	MVB938R5
117201600	MVB725R4	1172018002	SVB10840	950353	SVB10875	1340638	MVB1855R6
117202600	MVB775R4	1172021000	SVB10888	950353	SVB10925	1340639	MVB1875R6
117204007	MVB810R4	1172022101	SVB10913	950354	SVB10875	1340640	MVB885R4
0197810924	SVB13925	1172023100	SVB10888	950355	SVB10875	1340641	MVB1360R5
0197810934	SVB13950	1172029500	SVB13900	950356	SVB10875	1340642	MVB1225R5
0197810944	SVB13950	1172069000	SVB10875	950357	SVB101075	1340643	MVB1530R6
0197810964	SVB13975	1172069200	SVB10950	950358	SVB10875	1340644	MVB890R6
0197810994	SVB131000	1172069900	SVB10990	950359	SVB101075	1340645	MVB1460R5
0197811004	SVB13975	1172069901	SVB10990	950360	SVB10875	1340646	MVB1805R6
0197811264	SVB131275	1172069910	SVB10990	950361	SVB10850	1340647	MVB1904R6
0197811514	SVB131500	1172073000	SVB101050	950362	SVB10825	1340648	MVB1725R6
0211704023	SVB131050	1172073600	SVB10950	950363	SVB10760	1340649	MVB2020R6
0211704523	SVB131050	1172077701	SVB10975	950364	SVB10813	1340650	MVB1255R5
0211706039	SVB171045	1172077702	SVB10975	950365	SVB10800	1340651	MVB1865R6
0211707020	SVB131075	1172078000	SVB101050	950366	SVB10950	1340652	MVB1680R5
0211707023	SVB131075	1172078201	SVB101025	950367	SVB10813	1340654	SVB171055
0211707023KE	SVB131075	1172078221	SVB10950	950368	SVB10825	1340655	SVB10990
0211711022	SVB131125	1172083000	SVB13900	950370	SVB131375	1340656	SVB10925
0211711023	SVB131125	2106710600	SVB10975	950371	SVB10813	1340657	MVB1255R5
0211712523	SVB131125	2106710800	SVB10990	950372	SVB10690	1340658	MVB1215R5
0211714523	SVB131150	2106729913	SVB10840	950373	SVB131450	1340658VBELT	SVB171000
0211715023	SVB131150	2106737602	SVB13950	950375	SVB131450	1340659	MVB1865R6
0211716023	SVB131150	2106737603	SVB13950	950379	SVB10813	1340660	MVB1030R5
0211743523	SVB131475	2106773000	SVB101050	1312097	SVB101000	1340661	MVB875R5
0211744023	SVB131425	2106778500	SVB10865	1336671	SVB10900	1340662	MVB1588R6
0211744523	SVB131425	7700109632	TB653	1340007	SVB10888	1340663	MVB1904R6
0211775523	SVB13750	7700110203	TB710	1340272	MVB1904R6	1340664	MVB1805R6
0211776023	SVB13750	8200020924	MVB1135R5	1340273	MVB1904R6	1340665	MVB1875R6
0211777523	SVB13775	8200039519	TB713	1340275	MVB1550R6	1340666	MVB1865R6
0211778013	SVB10790	8200127627	TB710	1340279	MVB1450R6	1340667	MVB1030R5
0211778513	SVB10790	8200243021	MVB1200R6	1340283	MVB2390R6	1340668	MVB875R5
0211779523	SVB13800	8200356446	MVB1969R7	1340506	SVB13875	1340668VBELT	SVB10975
0211780523	SVB13800	A172A59M9AGA	SVB13850	1340510	MVB1865R6	1340669	MVB875R5
0211780528	SVB13800	A195A43G0AGA	SVB131150	1340527	MVB2120R6	1340671	MVB1360R5
0211782023	SVB13825	A6806D5610	TB361	1340600	MVB1250R6	1340671VBELT	SVB10900
0211782026	SVB13825	A6806G5510	TB412	1340601	MVB1588R6	1340672	MVB1360R5
0211784523	SVB13825	A172067A00	MVB1015R4	1340603	MVB960R4	1340673	SVB101075
0211784523	SVB13850	A195042L00	MVB850R3	1340604	SVB171055	1340674	MVB1030R5
0211786523	SVB13850	AY14060922	MVB925R6	1340605	SVB101025	1340674VBELT	SVB101050
0211787023	SVB13875	S526LD9	SVB131200	1340606	SVB171055	1340675	MVB875R5
0211787026	SVB13875	OPEL		1340607	MVB1795R6	1340676	SVB101350
0211788023	SVB13875	545481	SVB10800	1340608	MVB1904R6	1340677	MVB1030R5
0211788523	SVB13900	545482	SVB10800	1340609	SVB10913	1340677VBELT	SVB101025
0211790013	SVB10900	614531	MVB1030R5	1340611	MVB1815R5	1340678	MVB875R5
0211790023	SVB13900	636227	TB656	1340612	SVB10913	1340678VBELT	SVB10865
0211790513	SVB10900	636228	TB508	1340613	MVB1725R6	1340679	SVB10925







OE		OE		OE		OE	
...OPEL		...OPEL		...OPEL		...OPEL	
1340680	SVB10950	1854710	SVB10790	4500879	TB558	6340640	MBV1360R5
1340681	SVB13925	1854711	SVB10888	4501807	TBK102	6340651	SVB101000
1340682	SVB13900	1854712	SVB10875	4506086	TB710	6340656	MBV938R5
1340684	SVB101325	1854713	MVB2271R6	4506181	MVB1795R6	6340660	MBV1680R5
1340685	SVB101275	1854714	MVB2265R6	4506189	MVB1150R6	6340661	MBV1369R6
1340686	SVB101140	1854715	MVB800R4	4805292	TB524	6340662	MBV1306R6
1340687	SVB10888	1854718	SVB10790	4805335	TB800	6340663	MBV1050R6
1340689	SVB101150	1854722	MVB775R4	4808188	MVB1885R6	6340666	MBV1369R6
1340694	SVB101350	1854723	MVB2265R6	4810711	MVB1030R5	6340669	MBV1625R6
1340696	SVB10888	1854725	MVB775R4	5636086	TB656	6340671	MBV1250R6
1340697	SVB10900	1854726	SVB131500	5636343	TB639	6340672	MBV1613R6
1340699	SVB101140	1854727	SVB131500	5636344	TB790	6340675	MBV1413R6
1340703	SVB10900	1854728	MVB2020R6	5636350	TB524	9109429	TB710
1340704	SVB10888	1854729	SVB131250	5636351	TB508	9109601	TB545
1340705	SVB10950	1854730	SVB131325	5636354	TB481	9109649	MBV1137R6
1340707	SVB10950	1854733	MVB2280R6	5636355	TB509	9110116	MBV1137R6
1340709	SVB10913	1854736	MVB800R4	5636356	TB336	9110599	MBV1130R6
1340709	SVB10925	1855700	MVB2050R6	5636357	TB780	9110638	TB654
1340710	SVB10950	1855750	MVB2050R6	5636358	TB783	9111027	TB368
1340712	SVB10975	3009003	SVB10875	5636359	TB524	9111471	MBV850R6
1340713	SVB10925	3012097	SVB101000	5636361	TB508	9111472	MBV870R6
1340713	SVB10940	3013008	SVB10950	5636362	TB780	9112042	MBV870R6
1340714	SVB10913	3013009	SVB10913	5636363	TB783	9112043	MBV850R6
1340718	SVB10960	3013010	SVB10925	5636364	TB336	9112309	TB654
1340720	SVB101000	3013012	SVB10900	5636369	TB647	9117585	MBV1215R5
1340721	MVB1015R5	3013021	SVB10925	5636370	TB524	9117586	MBV1215R5
1340723	MVB101025	3013022	SVB10900	5636371	TB481	9117587	MBV1680R5
1340724	MVB970R5	4300241	SVB131375	5636372	TB524	9117588	MBV1680R5
1340725	SVB13875	4300342	SVB131500	5636373	TB638	9117589	MBV938R5
1340726	SVB10690	4300521	SVB171055	5636374	TB508	9117590	MBV938R5
1340727	SVB13925	4300616	SVB13875	5636375	TB436	9118367	MBV800R4
1340728	MVB1460R5	4302118	SVB131025	5636376	TB749	9118611	MBV1360R5
1340729	SVB10925	4304136	SVB13875	5636402	TB740	9118612	MBV1225R5
1340730	SVB10940	4401429	TB710	5636405	TB750	9118613	MBV1530R6
1340732	SVB101000	4401601	TB545	5636436	TB741	9118614	MBV890R6
1340734	SVB10940	4401649	MVB1137R6	5636452	TB741	9118616	MBV1460R5
1340735	SVB10960	4402116	MVB1137R6	5636463	TB639	9118617	MBV1805R6
1340736	MVB985R5	4402599	MVB1130R6	5636560	TB336	9118618	MBV1904R6
1340737	SVB101025	4402638	TB654	5636561	TB780	9118619	MBV1725R6
1340738	SVB10925	4403027	TB368	5636562	TB508	9118620	MBV2020R6
1340739	SVB10900	4403471	MVB850R6	5636563	TB783	9118624	MBV1865R6
1340742	MVB1904R6	4403472	MVB870R6	5636564	TB638	9118721	MBV1255R5
1340743	MVB1725R6	4404042	MVB870R6	5636565	TB780	9118722	MBV1680R5
1340745	MVB1795R6	4404043	MVB850R6	5636566	TB647	9120501	TBK091
1340746	MVB1530R6	4404309	TB654	6340602	MVB1995R6	9121108	MBV1150R7
1340747	MVB890R6	4405275	MVB1150R7	6340603	MVB1875R6	9121113	MBV1788R7
1340753	SVB10960	4405280	MVB1788R7	6340605	MVB1450R5	9128500	TB481
1354707	SVB13875	4408352	MVB1120R5	6340606	MVB1550R5	9128722	TB524
1606189	TBK103	4408392	TB652	6340613	MVB1370R5	9128723	TB336
1606190	TBK260	4409473	TB653	6340615	MVB1180R6	9128724	TB780
1606191	TBK261	4409485	TBK275	6340616	MVB1318R6	9128725	TB508
1606192	TBK261	4410172	MVB1795R6	6340617	MVB1270R6	9128726	TB783
1606193	TBK111	4411717	MVB1120R5	6340618	MVB1600R6	9128728	TB508
1606197	TBK028	4416576	TB652	6340619	MVB1050R6	9128952	MBV1215R5
1606262	TBK240	4418675	MVB1788R7	6340620	MVB1413R6	9129060	TB638
1606274	TBK260	4430217	MVB1833R6	6340622	MVB1875R6	9129061	TB647
1606281	TBK103	4430891	TBK275	6340623	MVB1805R6	9129460	MBV1225R5
1606359	TBK032	4431667	MVB1969R7	6340625	MVB1625R6	9129465	MBV1795R6
1606369	TBK008	4431763	TB710	6340626	MVB1215R5	9129468	MBV1904R6
1854700	SVB101475	4434866	MVB2000R7	6340627	MVB1215R5	9129851	MBV2020R6
1854704	SVB10888	4500033	MVB1200R5	6340628	SVB13925	9160333	MBV1200R5
1854706	SVB10790	4500034	MVB860R6	6340632	SVB10913	9160334	MBV860R6
1854707	SVB13875	4500056	MVB838R6	6340634	MVB1460R5	9160356	MBV838R6
1854708	MVB2225R6	4500831	TB368	6340639	MVB1225R5	9161131	TB368





OE		OE		OE		OE	
...OPEL		...OPEL		...OPEL		...OPEL	
9161179	TB558	90006265	SVB10975	90412993	TB780	90581641	MVB1255R5
9162107	TBK102	90006266	SVB10925	90442073	SVB10925	90581642	MVB1865R6
9192568	MVB1255R5	90006267	SVB10913	90444301	SVB10913	91126379	MVB1360R5
9194660	MVB1215R5	90076999	SVB101075	90444312	SVB10913	91126380	MVB1225R5
9194661	MVB1215R5	90088832	SVB10875	90444421	MVB1530R6	91126381	MVB1530R6
9194939	MVB1865R6	90091612	SVB10950	90444422	MVB1530R6	91126382	MVB890R6
9195191	MVB1030R5	90091742	SVB10888	90444423	MVB1795R6	91126384	MVB1460R5
9195192	MVB875R5	90091743	SVB10900	90444485	SVB10790	91126385	MVB1805R6
9196546	MVB1865R6	90096480	SVB10950	90444486	SVB10813	91126386	MVB1904R6
9196547	MVB1865R6	90156794	SVB10825	90444488	SVB10690	91126387	MVB1725R6
9198522	MVB1150R6	90169079	SVB10960	90448002	MVB2265R6	91126402	MVB1865R6
9198828	MVB1360R5	90169080	SVB10913	90448698	SVB10900	91126403	MVB1680R5
9198829	MVB1360R5	90169080	SVB10925	90466255	SVB10913	91131979	MVB1865R6
9201528	TB710	90169081	SVB10875	90466524	MVB1904R6	91132010	MVB1030R5
9201679	MVB1030R5	90169083	SVB10950	90467130	MVB1460R5	91140570	SVB10825
9201688	MVB875R5	90169084	SVB10850	90469984	TB508	91142246	SVB10875
9201722	MVB1030R5	90169195	SVB10925	90469985	TB783	91149464	SVB10913
9201723	MVB875R5	90169195	SVB10940	90469986	TB509	91149489	MVB1530R6
9201832	SVB13900	90169520	SVB10975	90469987	TB509	91150005	MVB1725R6
9201850	MVB1795R6	90183426	SVB10875	90486316	MVB890R6	91151716	MVB1805R6
9224265	MVB1360R5	90183427	SVB10888	90490781	MVB2271R6	91153769	MVB2188R8
9224371	MVB1680R5	90183440	SVB10913	90499525	TB524	91158702	TB653
09292426	SVB10888	90194098	SVB10760	90500227	MVB1725R6	91158706	TBK275
09292427	SVB10900	90194995	SVB10813	90500228	MVB1904R6	91159962	MVB1120R5
11053599	SVB10900	90215247	SVB10790	90500354	MVB2265R6	91159999	TB652
11063969	SVB10800	90231797	SVB101000	90500360	TB481	92061744	MVB2050R6
11064889	SVB10950	90233194	MVB1015R5	90501383	MVB1530R6	92061745	MVB2050R6
11072021	SVB10888	90271857	SVB101000	90501384	MVB1460R5	92062969	TB524
24404052	MVB1225R5	90280872	SVB10800	90501385	MVB2265R6	92063403	MVB1855R6
24413292	MVB1904R6	90281901	SVB101025	90501386	MVB1725R6	92063918	TB508
24413293	MVB1805R6	90285678	MVB2225R6	90502286	SVB10925	92063944	TB524
24413294	MVB1875R6	90285679	MVB1460R5	90502734	MVB1904R6	92065902	TB524
24419361	MVB1255R5	90299369	SVB13875	90502735	MVB1805R6	93160191	MVB1795R6
24419362	MVB1215R5	90299370	SVB10690	90509315	MVB1815R5	93160750	MVB1120R5
24422964	TB741	90299503	MVB970R5	90509751	MVB775R4	93161358	MVB1833R6
24426540	MVB1030R5	90351803	SVB10913	90510025	SVB10913	93161478	TBK275
24435940	MVB1030R5	90352613	SVB10813	90510253	MVB1805R6	93161809	MVB1969R7
24435953	MVB875R5	90352615	SVB10900	90510610	MVB1530R6	93161860	TB710
24445099	SVB101075	90352928	SVB10940	90510611	MVB890R6	93172395	MVB1995R6
24451895	TB638	90352931	SVB10790	90510612	MVB890R6	93172396	MVB1995R6
24451896	TB780	90353137	SVB10925	90512538	MVB775R4	93172397	MVB1875R6
24452031	MVB1875R6	90353179	TB336	90528761	MVB2020R6	93172398	MVB1875R6
24466972	MVB1030R5	90354782	TB336	90529809	TB647	93174119	TBK103
24466975	MVB1030R5	90397190	SVB10925	90529914	MVB1875R6	93174120	TBK260
24466976	MVB875R5	90409610	SVB101000	90530286	TB508	93174260	TBK261
46791188	TB639	90409781	MVB2271R6	90530598	TB509	93174261	TBK261
55185077	MVB1180R6	90409782	MVB1904R6	90530599	TB481	93174262	TBK111
55185078	MVB1318R6	90409800	SVB10940	90531033	TB509	93174266	TBK028
55202584	MVB795R6	90410223	TB336	90531677	TB336	93175325	MVB1875R6
55350420	MVB1450R5	90410316	MVB985R5	90531678	TB336	93178811	TB639
55350421	MVB1550R5	90410386	SVB10888	90531679	TB780	93178812	TB790
55351458	MVB1030R5	90410387	SVB10960	90531680	TB780	93179102	MVB1050R6
55351782	TB647	90410700	MVB1725R6	90531681	TB783	93180218	TBK240
55354681	MVB1875R6	90410768	TB481	90531682	TB783	93180219	TBK260
55562866	MVB1904R6	90410771	TB481	90531857	TB647	93180815	TB741
55563395	MVB1904R6	90411009	SVB101025	90531858	TB638	93181138	MVB1050R6
55563925	MVB1550R6	90411028	MVB1795R6	90531966	MVB1360R5	93181316	MVB1215R5
55564655KA	MVB1413R6	90411770	TB508	90531967	MVB1225R5	93181317	MVB1215R5
55565301	MVB1450R6	90411775	TB509	90541338	MVB1805R6	93181703	SVB13925
55567786	MVB2390R6	90411777	TB783	90542746	MVB1360R5	93181708	SVB10840
70091742	SVB10888	90412115	SVB10913	90542748	MVB1225R5	93181712	MVB1460R5
71731639	TB639	90412115	SVB10925	90570371	TB508	93181984	MVB1369R6
90006259	SVB10875	90412711	TB780	90571757	MVB885R4	93182238	MVB1225R5
90006263	SVB10888	90412885	MVB890R6	90573797	MVB938R5	93182241	MVB1360R5







OE		OE		OE		OE	
...OPEL		...OPEL		...PEUGEOT		...PEUGEOT	
93182256	SVB10813	97385845	MVB1250R6	0831L7	TBK318	5750M0	MVB1200R6
93182259	SVB101000	97385846	MVB1613R6	0831N2	TBK105	5750M1	MVB1600R6
93182264	MVB938R5	97714044	SVB131450	0831N4	TBK274	5750M3	MVB1190R6
93182272	MVB1680R5	98010046	MVB1625R6	0831P1	TBK302	5750M4	MVB1105R6
93183572	TBK103	98014186	TB656	4007J3	SVB10675	5750M6	MVB1725R6
93185336	TB639	98419390	TB368	5750A0	MVB1100R6	5750P0	MVB747R4
93185361	MVB1369R6	395464985	MVB1318R6	5750A1	MVB1660R6	5750P5	MVB710R5
93185569	MVB1255R5	894161840	SVB171055	5750A2	MVB1080R6	5750P7	MVB1030R5
93185756	MVB2120R6	1136713010	SVB131450	5750A5	MVB698R6	5750P9	MVB775R5
93188126	TBK008	5867298320	MVB1369R6	5750A6	MVB1130R6	5750PL	MVB1050R6
93188132	TBK032	5867314190	MVB2063R6	5750C0	MVB1150R6	5750PP	MVB1065R6
93188702	TB652	7700101840	TB545	5750C2	MVB1030R5	5750PR	MVB1560R6
93190605	MVB1413R6	7700109477	MVB1795R6	5750C3	MVB730R6	5750PS	MVB1885R6
93195485	MVB1788R7	7700116058	TB654	5750C4	MVB845R5	5750PV	MVB730R6
93198391	MVB1795R6	7700865429	MVB1137R6	5750C5	MVB768R5	5750Q1	MVB1050R5
93198427	MVB2000R7	7700875439	TB545	5750C7	MVB800R5	5750Q3	MVB1488R6
94029958	SVB131375	8200023912	MVB1150R6	5750C8	MVB1255R5	5750Q5	MVB1600R6
94108204	SVB131325	8200059423	MVB850R6	5750C9	MVB1150R6	5750QE	MVB1675R6
94111624	SVB131500	8200059425	MVB870R6	5750D0	MVB1188R5	5750QG	MVB962R6
94111687	SVB13875	8200113203	MVB1795R6	5750D2	MVB710R5	5750QJ	MVB850R6
94120507	TB413	8942185750	SVB131375	5750D4	MVB1165R5	5750QL	MVB1215R6
94161841	SVB171055	8943330980	SVB10950	5750D7	MVB700R5	5750QP	MVB1000R6
94175170	SVB13875	8943370040	SVB13925	5750E6	MVB915R6	5750QQ	MVB870R6
94218575	SVB131375	8943855610	TB413	5750E7	MVB795R6	5750QS	MVB1180R6
94232287	SVB10760	8944503950	SVB131450	5750E8	MVB1015R6	5750QW	MVB1588R6
94333098	SVB10950	8970435510	SVB171055	5750E9	MVB1150R6	5750R6	MVB1755R6
94334987	SVB131250	8972127270	TB656	5750EJ	MVB1580R6	5750R7	MVB1600R6
94337004	SVB13925	8972271920	TB740	5750EN	MVB1388R6	5750RC	MVB1215R6
94382105	SVB101025	8972328750	MVB1270R6	5750EX	MVB1440R6	5750RG	MVB906R6
94382106	MVB960R4	8972328760	MVB1625R6	5750FO	MVB1700R6	5750RH	MVB1700R6
94382107	MVB800R4	8980100460	MVB1625R6	5750FA	MVB1725R6	5750RS	MVB1165R6
94385561	TB413	8980141860	TB656	5750FH	MVB1200R6	5750RX	MVB1350R6
94440010	SVB131500	11282245848	MVB1815R5	5750FK	MVB1190R6	5750RZ	MVB1200R6
94442970	SVB131500	64552245451	MVB775R4	5750FN	MVB870R6	5750S0	MVB1740R6
94449307	TB413	PEUGEOT		5750FP	MVB1155R6	5750S1	MVB860R6
94452904	SVB131025	0816A0	TB727	5750FQ	MVB1225R5	5750S3	MVB1025R6
94468652	SVB13875	0816A1	TB683	5750FS	MVB795R6	5750S5	MVB1388R6
94472378	SVB13875	0816A3	TB701	5750FV	MVB975R6	5750S7	MVB1740R6
94482166	SVB131450	0816A4	TB558	5750FX	MVB1335R6	5750S9	MVB1600R6
96440343	TB800	0816A6	TB678	5750GG	MVB1180R6	5750SQ	MVB698R4
96440421	MVB2063R6	0816A9	TB632	5750GL	MVB1740R6	5750SR	SVB10925
96628792	MVB1885R6	0816C1	TB525	5750GN	MVB1125R6	5750SS	MVB960R4
97016326	TB393	0816C2	TB683	5750GP	MVB1388R6	5750ST	SVB10710
97043551	SVB171055	0816C8	TB702	5750GR	MVB1690R6	5750SY	MVB1141R5
97062913	SVB171055	0816E0	TB700	5750GW	MVB1150R6	5750SZ	MVB710R5
97074109	SVB13925	0816E2	TB724	5750GX	MVB1155R6	5750T1	MVB1450R6
97100606	SVB13875	0816E4	TB720	5750GY	MVB1560R6	5750T2	MVB1015R6
97130560	MVB2280R6	0816E5	TB368	5750HG	MVB1740R6	5750T3	MVB1560R6
97136321	TB436	0816E7	TB720	5750J9	MVB1700R6	5750T5	MVB1469R6
97141514	SVB171055	0816F0	TB699	5750K0	MVB1150R6	5750T7	MVB1740R6
97143724	TB749	0816F2	TB711	5750K2	MVB775R5	5750T9	MVB1755R6
97176245	SVB10990	0816F4	TB683	5750K4	MVB960R5	5750TA	MVB1120R5
97186395	MVB1250R6	0816G1	TB722	5750K6	MVB1865R6	5750TE	MVB1065R6
97186396	MVB1588R6	0816G3	TB742	5750K7	MVB1865R6	5750TF	MVB1100R6
97188281	SVB171055	0816G4	TB744	5750K9	MVB1115R6	5750TG	MVB1660R6
97212727	TB656	0816G7	TB724	5750KR	MVB1675R6	5750TH	MVB1080R6
97212728	TB656	0816H3	TB727	5750KX	MVB1560R6	5750TJ	MVB698R6
97227192	TB740	0816H6	TB700	5750KZ	MVB1469R6	5750TL	MVB1150R6
97229071	MVB1588R6	0816H7	TB700	5750L1	MVB1740R6	5750TP	MVB730R6
97229277	TB750	0816J6	TB724	5750L3	MVB1155R6	5750TR	MVB768R5
97232826	MVB1625R6	0831K6	TBK355	5750L7	MVB1025R4	5750TV	MVB1188R5
97232875	MVB1270R6	0831L2	TBK319	5750L9	MVB1165R6	5750VC	MVB1150R6
97232876	MVB1625R6	0831L4	TBK336	5750LC	MVB730R6	5750VH	MVB1200R6
97355691	MVB1600R6	0831L6	TBK318	5750LE	MVB1215R6	5750VL	MVB795R6





OE		OE		OE		OE	
...PEUGEOT		...PEUGEOT		...PEUGEOT		...PEUGEOT	
5750VN	MVB975R6	6455B2	MVB960R4	083147	TBK041	400366	SVB10800
5750VP	MVB1335R6	051651	TB574	083148	TBK113	400381	SVB10813
5750VR	MVB1180R6	081622	TB560	083149	TBK113	400387	SVB10610
5750VS	MVB1740R6	081624	TB226	083150	TBK013	400398	SVB10850
5750VT	MVB1125R6	081629	TB226	083151	TBK013	400720	SVB101300
5750VV	MVB1150R6	081631	TB421	083152	TBK035	400721	SVB101215
5750VX	MVB1740R6	081632	TB422	083153	TBK035	400735	SVB101225
5750VZ	MVB1150R6	081636	TB304	083156	TBK122	400799	MVB875R5
5750W1	MVB1045R6	081637	TB259	083157	TBK122	400906	SVB101025
5750W5	MVB1200R6	081642	TB304	083158	TBK105	400914	SVB10913
5750W6	MVB1725R6	081644	TB259	083159	TBK105	400922	SVB10650
5750W7	MVB750R6	081645	TB259	083160	TBK303	400941	MVB640R4
5750W8	MVB775R5	081646	TB560	083161	TBK303	400942	MVB1025R4
5750WE	MVB1865R6	081648	TB419	083162	TBK106	400972	MVB640R4
5750WG	MVB1560R6	081653	TB319	083176	TBK308	400978	MVB640R4
5750WH	MVB1469R6	081654	TB320	083177	TBK308	400986	MVB1025R4
5750WJ	MVB1155R6	081655	TB376	083178	TBK274	456902	SVB10625
5750WL	MVB1165R6	081656	TB304	083179	TBK274	456903	SVB10690
5750WN	MVB730R6	081658	TB560	083180	TBK230	456904	SVB10650
5750WQ	MVB1600R6	081659	TB560	083182	TBK106	456904	SVB10665
5750WV	MVB710R5	081660	TB419	083183	TBK106	456907	SVB10740
5750WY	MVB1050R6	081662	TB419	083184	TBK316	456908	SVB10650
5750WZ	MVB1065R6	081665	TB453	083185	TBK316	456909	SVB10600
5750X0	MVB860R6	081667	TB226	083186	TBK312	456911	SVB10610
5750X1	MVB1025R6	081668	TB459	083187	TBK312	456912	SVB10550
5750X2	MVB1388R6	081669	TB454	083188	TBK279	456914	SVB10600
5750X3	MVB1740R6	081671	TB419	083192	TBK338	456915	SVB10610
5750X9	MVB1469R6	081672	TB457	083193	TBK304	456916	SVB10610
5750XA	MVB1560R6	081673	TB479	128001	SVB10888	456917	SVB10600
5750XC	MVB1885R6	081685	TB700	128002	SVB101025	574090	SVB10750
5750XE	MVB1050R5	081686	TB711	128003	SVB101140	574901	SVB10600
5750XF	MVB962R6	081688	TB525	128004	SVB101113	574902	SVB10610
5750XG	MVB1000R6	081689	TB727	128005	SVB101125	574904	SVB10650
5750XJ	MVB1180R6	081693	TB631	128006	SVB101200	574905	SVB10650
5750XK	MVB1588R6	081696	TB632	128007	SVB101125	574908	SVB10700
5750XN	MVB1215R6	081698	TB479	128014	SVB101000	574909	SVB10725
5750XS	MVB1740R6	081699	TB368	128015	SVB10775	574910	SVB10725
5750XW	MVB1045R6	083101	TBK049	128016	SVB101125	574911	SVB10750
5750XZ	MVB860R6	083102	TBK005	128017	MVB1388R5	574912	SVB10775
5750Y0	MVB1388R6	083103	TBK007	128018	MVB1450R5	574912	SVB10790
5750Y1	MVB1388R6	083105	TBK009	128019	MVB925R5	574913	SVB10790
5750Y6	MVB1388R6	083106	TBK010	128023	MVB1388R5	574914	SVB10800
5750YC	MVB1450R6	083109	TBK019	128024	MVB1450R5	574915	SVB10813
5750YE	MVB1560R6	083111	TBK035	128025	MVB870R4	574918	SVB10850
5750YG	MVB1755R6	083113	TBK005	128026	MVB945R4	574919	SVB10888
5750YH	MVB1675R6	083114	TBK007	128035	MVB890R6	574921	SVB10900
5750YL	MVB1588R6	083117	TBK010	128037	MVB900R4	574921	SVB10913
5750YP	MVB795R6	083120	TBK019	128040	MVB940R3	574922	SVB10925
5750YQ	MVB975R6	083121	TBK013	128043	MVB890R6	574924	SVB10940
5750Z0	MVB1450R6	083122	TBK035	128045	MVB915R6	574928	SVB101000
5750Z2	MVB1560R6	083124	TBK004	128046	MVB1000R6	574929	SVB101025
5750Z4	MVB1740R6	083127	TBK020	128048	MVB946R6	574930	SVB101050
5750Z6	MVB1755R6	083128	TBK004	128050	MVB946R6	574932	SVB101125
5750Z8	MVB1440R6	083130	TBK041	128057	MVB1388R5	574933	SVB101140
6453A0	MVB1020R4	083131	TBK020	128058	MVB1450R5	574934	SVB101175
6453AF	MVB1030R5	083134	TBK344	128065	MVB946R6	574935	SVB101200
6453CT	MVB1100R5	083135	TBK344	128066	MVB915R6	575011	SVB101075
6453CZ	MVB1030R5	083136	TBK029	400308	SVB10913	575012	SVB10940
6453E5	MVB810R4	083137	TBK029	400313	SVB10913	575013	SVB101150
6453FJ	MVB1100R5	083140	TBK106	400325	SVB10900	575014	SVB10960
6453L2	MVB835R4	083141	TBK106	400325	SVB10913	575015	SVB101215
6453NY	MVB1100R5	083144	TBK030	400332	SVB101050	575016	SVB101113
6453TV	MVB1030R5	083145	TBK030	400365	SVB10800	575017	SVB10950
6453W1	MVB925R6	083146	TBK041	400366	SVB10790	575018	SVB10700







OE		OE		OE		OE	
...PEUGEOT		...PEUGEOT		...PEUGEOT		...PORSCHE	
575019	SVB101175	7618111	MVB925R5	96316038	MVB1560R6	94410221904	TB498
575020	SVB101000	9605062	MVB1025R4	96317187	MVB1725R6	94410515706	TB502
575022	SVB101113	91516768	MVB835R4	96334782	MVB1469R6	94410532300	TB502
575026	SVB10875	91536338	SVB10710	96337272	MVB1450R6	94410532301	TB502
575026	SVB10888	91541144	MVB725R5	96350076	TB683	94410532302	TB502
575028	SVB10675	91541175	MVB725R5	96375140	TB678	96414718702	TB526
575029	SVB10900	95496894	SVB10650	96375295	MVB1440R6	96414718703	TB526
575030	SVB10750	95639605	TB419	96410695	MVB1190R6	98010225102	MVB1270R5
575031	SVB101100	96001122	MVB698R4	96410697	MVB1200R6	99610215164	MVB1200R6
575032	SVB10900	96012051	MVB810R4	96420439	MVB1725R6	99610215165	MVB1930R6
575035	SVB101000	96014397	MVB1270R5	97518683	MVB1020R4	99610215166	MVB2120R6
575036	SVB10750	96019295	MVB855R4	98487322	MVB890R6	99610215193	MVB2265R6
575037	SVB10790	96021925	MVB700R5	99456476	TB368	99919200650	SVB10825
575040	SVB10725	96046092	MVB845R5	500345344	MVB915R6	99919201350	SVB10710
575042	SVB101000	96046099	MVB640R4	5003344281	MVB1100R5	99919209750	SVB10725
575044	SVB10750	96046101	MVB1388R5	9613855980	TB259	99919211750	SVB131050
575046	SVB10740	96050625	MVB1025R4	9616341080	MVB688R5	99919212750	SVB131025
575049	SVB101100	96058570	TB419	9618337580	TB727	99919212850	SVB13975
575051	SVB10750	96059324	MVB710R5	9626157480	TB632	99919213550	SVB10875
575052	SVB10925	96059541	MVB1450R5	9629082280	TB632	99919214650	SVB131075
575053	SVB10700	96072342	TB459	9631203080	TB711	99919214850	SVB131125
575054	SVB101175	96088735	TB376	9632959380	TB727	99919215450	SVB101050
575055	MVB698R4	96100168	TB419	9633713380	TB699	99919216150	SVB131050
575056	MVB970R4	96100984	TB459	9633923080	TB479	99919217350	SVB131200
575058	SVB10940	96106737	MVB715R4	9633923180	TB479	99919217650	SVB10710
575060	SVB10750	96120257	MVB915R6	9635007680	TB683	99919217750	SVB101050
575061	SVB10850	96124532	MVB715R4	9635007780	TB683	99919220050	SVB10888
575062	MVB985R4	96135989	MVB945R4	9635438380	TB702	99919220450	MVB735R5
575063	SVB10925	96140147	TB304	9635438480	TB702	99919220650	MVB1000R5
575066	MVB1215R4	96140606	MVB1865R6	9637122980	TB720	99919220750	MVB1000R5
575069	MVB715R4	96142597	TB560	9637123580	TB720	99919221450	MVB860R4
575070	MVB960R4	96142840	MVB698R6	9637240580	TB683	99919223650	SVB10950
575072	SVB101050	96144507	MVB730R6	9637914380	TB700	99919225450	SVB131150
575073	SVB10710	96147542	MVB1030R5	9637914580	TB724	99919225550	SVB131200
575074	MVB725R5	96152078	MVB1660R6	9637914680	TB724	99919225950	MVB887R5
575075	MVB1015R5	96152079	MVB1660R6	9639842180	TB700	99919226650	MVB860R6
575076	MVB800R4	96152083	MVB1065R6	9640323980	TB259	99919226950	MVB860R6
575077	MVB710R5	96152085	MVB1080R6	9640379480	MVB1155R6	99919228250	MVB715R6
575078	MVB1230R4	96152089	MVB1100R6	9640828680	TB742	99919228350	MVB1000R6
575079	MVB970R5	96155010	MVB1015R6	9642458680	MVB730R6	99919228450	MVB715R6
575080	MVB855R4	96155951	MVB1700R6	9645717480	TB724	99919228550	MVB1000R6
575081	MVB1225R5	96161329	MVB845R5	9645717580	TB724	99919228650	SVB131000
575082	SVB10675	96165809	MVB960R5	9647367480	TB744	99919229050	MVB715R6
575083	MVB700R5	96165811	MVB775R5	9647610080	TB683	99919229150	MVB1000R6
575084	MVB1270R5	96180219	MVB1150R6	9650686080	MVB1215R6	99919229550	MVB1000R6
575085	MVB845R5	96180220	MVB1150R6	9653204380	MVB1000R6	99919229950	MVB1000R6
575086	MVB700R5	96182679	TB727	9655279280	MVB1200R6	99919230550	SVB131125
575087	MVB1141R5	96188881	MVB1740R6	9655945780	MVB1215R6	99919230650	SVB13950
575088	MVB710R5	96197629	TB700	9682237380	MVB975R6	99919233550	SVB131075
575089	MVB1120R5	96200344	TB479	PLYMOUTH		99919233850	SVB10775
575090	SVB10775	96205509	MVB1600R6	4201481	SVB10610	99919234350	SVB10760
575091	MVB1165R5	96209042	MVB730R6	4298114	MVB1045R4	99919234550	SVB10790
575092	MVB735R5	96223131	TB631	4663950	SVB101400	99919234750	MVB870R6
575094	MVB715R4	96235499	MVB1105R6	5281102	SVB101200	99919235250	SVB131075
575095	MVB1030R5	96236849	MVB1165R6	PONTIAC		99919236350	SVB131075
575096	MVB1700R6	96236952	MVB1600R6	24508560	MVB1760R6	99919236350	SVB131085
575097	MVB698R6	96251516	MVB1600R6	24573322	MVB1141R5	99919236550	MVB1550R6
575098	MVB1065R6	96252153	TB631	PORSCHE		99919237250	SVB10750
645377	MVB835R4	96261574	TB632	047903137A	SVB10900	99919237350	SVB10750
645592	SVB131350	96273679	MVB710R5	54709305	SVB10825	99919237950	MVB2280R6
645627	SVB131350	96273681	MVB775R5	068903137D	SVB10960	99919253650	MVB1413R6
645641	SVB131375	96290822	TB632	90019200550	SVB10975	PROTON	
645701	SVB13900	96308935	MVB1755R6	90019202650	SVB131125	MB288838	SVB13625
645753	SVB131000	96313338	MVB1740R6	94410221902	TB498	MD069671	MVB870R4





OE		OE		OE		OE	
...PROTON		...RENAULT		...RENAULT		...RENAULT	
MD100814	TB518	23223142	SVB131475	5000666883	SVB131450	5001847819	TB701
MD106658	MVB870R4	0023223154	SVB131450	5000666884	SVB131450	5010019725	SVB131475
MD113564	TB518	0023223157	SVB10975	5000666887	SVB10813	5010248035	MVB1080R6
MD118572	MVB875R4	0023223161	SVB10940	5000666892	SVB10940	5010257794	SVB131300
MD145813	TB366	0038445003	SVB131600	5000667880	SVB101250	5010284590	SVB131500
MD171373	MVB775R4	96251516	MVB1600R6	5000670601	SVB131375	5010284593	SVB101075
MD176386	TB379	96294079	MVB1600R6	5000670635	SVB101350	5010284906	MVB1050R6
MD176387	TB381	96300342	MVB1600R6	5000670639	SVB131600	5010284916	MVB1015R4
MD176389	TB380	98412210	MVB563R4	5000670728	MVB1015R5	5010295531	MVB1065R6
MD180574	MVB763R4	98423681	MVB845R5	5000678324	SVB131350	5010330872	MVB1420R6
MD182295	TB326	98452287	MVB825R5	5000678543	MVB1250R6	5010359915	MVB1065R6
MD183556	MVB763R4	99456476	TB368	5000678605	MVB1538R5	5010359916	MVB1420R6
MD186111	MVB640R4	99456477	TB558	5000681020	SVB131375	5010412143	MVB1250R6
MD192319	TB671	500786245	SVB131475	5000681405	SVB131375	5010423320	MVB1350R6
MD192809	MVB950R5	771029704	SVB101250	5000686250	SVB131425	5010437106	MVB1050R6
MD303288	MVB588R4	0854249800	SVB10675	5000686286	SVB131450	5010437301	SVB131075
MD314778	MVB588R4	0854649000	SVB10625	5000686366	SVB131250	5010437309	SVB131075
MD316007	SVB131025	0854649100	SVB10650	5000686775	MVB1225R5	5010437598	MVB1050R6
PW502943	MVB870R4	0854679600	SVB101050	5000686828	SVB131450	5010437648	MVB1050R6
PW510580	MVB870R4	0854687200	SVB10975	5000686852	SVB131425	5010474688	SVB171320
PW510942	MVB950R5	0855242700	SVB101050	5000686864	SVB131350	5010502614	SVB171320
PW510943	MVB775R4	0855505800	SVB10850	5000686893	SVB131250	6000068014	MVB825R6
PW510944	MVB588R4	0855633900	SVB10625	5000689151	SVB131450	6001002611	SVB10665
PW850769	MVB588R4	0855676000	SVB10725	5000689152	SVB131450	6001004002	SVB10700
RELIANT		0855676100	SVB10850	5000691377	SVB101250	6001008128	SVB101200
204E8620B	SVB10850	855676100	SVB10850	5000693021	MVB1660R6	6001548021	MVB715R4
692F8A602AA	SVB101250	0855721100	SVB10750	5000785370	SVB131350	7439135733	TB434
722F8620EB	SVB101325	0855839800	SVB10700	5000785475	SVB101125	7439146899	MVB1238R6
2724E8A602B	SVB101225	0855931900	SVB10665	5000786244	SVB131425	7439146900	MVB1600R6
2725E8A602A	SVB101300	0855931900	SVB10675	5000786244	SVB131450	7439180954	TB434
RENAULT		0921232003	SVB13800	5000786245	SVB131475	7439440383	TB643
119202Y501	MVB1105R6	921232003	SVB13800	5000786466	SVB10813	7700006809	SVB101225
127627	TB710	2521227360	MVB1513R6	5000786518	SVB101350	7700100119	TB359
323225	SVB131325	5000041122	SVB101250	5000786661	SVB10940	7700100460	TB437
0000323580	SVB131450	5000047059	SVB101075	5000787170	SVB131400	7700100531	TB644
323580	SVB131450	5000047950	SVB101075	5000787245	SVB131475	7700100670	TB546
323586	SVB131450	5000048794	SVB101250	5000788120	SVB10975	7700101248	TB636
323591	SVB131475	5000048933	SVB131150	5000788121	SVB101125	7700101261	MVB1755R6
323610	SVB131075	5000049616	SVB131400	5000788122	SVB101350	7700101409	TB437
323665	SVB131325	5000131716	SVB10750	5000788123	SVB131075	7700101474	MVB1400R6
0000323786	SVB131450	5000132350	SVB101475	5000788221	SVB131250	7700101840	TB545
323889	SVB131450	5000133113	SVB101250	5000788483	SVB101125	7700102047	TB482
323890	SVB131475	5000136827	SVB131025	5000793150	SVB131075	7700103243	TB644
0000323948	SVB131450	5000138295	SVB101075	5000816443	SVB10950	7700104596	TB545
323948	SVB131450	5000168026	SVB131375	5000820750	SVB131425	7700105888	MVB1190R6
1195031U02	MVB775R4	5000168463	SVB131425	5000821492	SVB101125	7700106241	TB482
8517174	SVB13675	5000182327	SVB10975	5000831564	SVB10975	7700106243	TB644
8522958	SVB171115	5000183327	SVB10975	5000878607	SVB131375	7700107175	MVB1755R6
8535358	SVB171115	5000240844	SVB13750	5000882120	SVB13950	7700107261	TB546
8542498	SVB10700	5000293612	TB701	5000988950	SVB131075	7700107305	TB546
8546490	SVB10625	5000297575	SVB101350	5001014471	SVB131075	7700107493	MVB1110R5
8546491	SVB10650	5000297764	SVB101075	5001014573	SVB131150	7700107494	MVB1100R5
8546797	SVB10925	5000297765	SVB101000	5001014574	SVB131450	7700108148	MVB1120R5
8551364	SVB10925	5000566546	SVB131350	5001014844	SVB10735	7700108412	TB636
8555157	SVB10925	5000566547	SVB131450	5001014845	SVB10813	7700108589	MVB1137R6
8556014	SVB10950	5000612768	SVB10950	5001014847	SVB131085	7700109226	MVB1120R5
8556339	SVB10625	5000625394	SVB131425	5001821492	SVB101125	7700109477	MVB1795R6
23223047	SVB131500	5000626261	SVB131250	5001821740	SVB10940	7700109601	TB653
0023223073	SVB101500	5000659558	SVB101125	5001822055	SVB13875	7700109632	TB653
23223093	SVB101125	5000659559	SVB131075	5001822135	SVB101050	7700110203	TB710
0023223095	SVB101150	5000663785	SVB10975	5001822405	SVB131600	7700111671	MVB1750R5
0023223131	SVB131300	5000663786	SVB101350	5001822980	SVB131600	7700111761	TB546
23223141	SVB131450	5000666877	SVB131085	5001836605	TB368	7700111983	TB545
0023223142	SVB131475	5000666879	SVB131150	5001836608	TB558	7700111984	TB735







OE		OE		OE		OE	
...RENAULT		...RENAULT		...RENAULT		...RENAULT	
7700112528	TB796	7700567694	SVB10665	7700718261	MVB885R4	7700853990	MVB1215R4
7700112719	MVB1215R6	7700567694	SVB10675	7700718725	TB421	7700854083	SVB101250
7700113061	TB482	7700567695	SVB10650	7700718726	TB422	7700854163	TB421
7700113373	TB796	7700579245	SVB101075	7700718836	TB422	7700854326	MVB1065R4
7700113558	TB636	7700580482	SVB10850	7700720082	SVB13875	7700854327	SVB10760
7700113559	TB644	7700585501	SVB131025	7700720452	MVB869R5	7700854327	SVB12760
7700114127	TB735	7700586110	SVB10625	7700720582	SVB101010	7700854495	MVB887R3
7700114128	TB292	7700589404	SVB10700	7700720582	SVB101025	7700855096	MVB1050R4
7700114235	MVB1660R6	7700615317	SVB10665	7700720582	SVB121030	7700855098	MVB1740R6
7700114352	MVB1400R6	7700619572	SVB10625	7700720780	MVB1165R5	7700856107	MVB735R4
7700114635	MVB1125R6	7700621031	SVB10700	7700723964	MVB884R6	7700856351	TB422
7700114730	MVB1130R6	7700622509	SVB10665	7700725577	TB256	7700857065	MVB1165R6
7700116047	TB654	7700624261	SVB10725	7700729330	MVB875R4	7700857070	MVB1660R6
7700116058	TB654	7700624262	SVB10850	7700729371	SVB101150	7700857325	TB431
7700260886	MVB1025R6	7700624361	SVB10725	7700729540	MVB845R5	7700858053	MVB101000
7700260887	MVB1125R4	7700627033	SVB10813	7700729580	TB421	7700858058	SVB101000
7700260889	MVB1238R6	7700627459	SVB101075	7700729581	TB422	7700858344	TB431
7700267321	SVB13925	7700630569	SVB10900	7700729752	MVB1137R6	7700858762	SVB101150
7700267430	SVB13725	7700632624	SVB13950	7700731717	SVB101140	7700859638	MVB1950R6
7700267945	SVB13925	7700634518	SVB101000	7700731718	SVB101140	7700859639	MVB1015R6
7700268227	SVB13850	7700638898	SVB10760	7700731789	SVB101175	7700859654	MVB1685R6
7700268229	SVB10625	7700638898	SVB12760	7700732795	SVB101140	7700860463	MVB1642R6
7700268230	SVB101250	7700639484	SVB101300	7700733788	MVB887R5	7700860795	TB437
7700268232	SVB101250	7700640354	SVB10975	7700734955	MVB887R5	7700860833	MVB900R5
7700268296	SVB10760	7700646190	SVB10690	7700735904	MVB1690R6	7700860897	TB516
7700268296	SVB12760	7700646222	SVB10825	7700735905	MVB1460R5	7700861464	MVB650R5
7700268754	SVB101250	7700647366	SVB101075	7700736204	SVB101000	7700861465	MVB775R5
7700271121	SVB10690	7700647521	SVB101010	7700736969	TB257	7700861466	MVB1375R5
7700271122	SVB10725	7700648156	SVB10850	7700738035	MVB1100R6	7700861467	MVB960R4
7700271218	MVB775R3	7700649825	SVB10760	7700738783	MVB1413R6	7700862173	MVB1255R5
7700271603	MVB1190R4	7700649825	SVB12760	7700740637	MVB1165R6	7700862272	SVB101150
7700271648	MVB1550R6	7700658289	SVB101000	7700741506	TB256	7700863011	TB359
7700272653	MVB1165R4	7700658289	SVB101010	7700742336	SVB10690	7700863095	TB482
7700272741	MVB1550R6	7700662412	SVB10700	7700743548	MVB870R6	7700864019	MVB825R5
7700273010	MVB1260R4	7700663010	SVB101010	7700743777	TB156	7700864813	MVB1155R6
7700273239	SVB10665	7700664248	SVB101225	7700744380	MVB1165R6	7700865429	MVB1137R6
7700273245	MVB1272R4	7700667399	SVB101010	7700744391	SVB10725	7700865588	MVB1151R5
7700273279	TB529	7700667586	SVB13875	7700744961	MVB845R5	7700866063	MVB1215R6
7700273280	TB529	7700670935	SVB101225	7700745397	MVB1015R6	7700866437	MVB838R3
7700273611	TB529	7700673236	SVB10600	7700745599	SVB13950	7700867939	MVB906R5
7700273650	TB529	7700673239	SVB10665	7700746125	SVB101000	7700868273	MVB875R5
7700287945	SVB13925	7700677162	SVB13875	7700747381	MVB850R6	7700868878	MVB1125R6
7700300347	MVB1200R5	7700680398	SVB101300	7700749099	SVB121030	7700869440	MVB890R6
7700300348	MVB860R6	7700680399	SVB101010	7700749104	SVB101000	7700869538	MVB1642R6
7700300614	MVB838R6	7700682388	SVB10800	7700749108	SVB101000	7700869685	MVB995R4
7700315600	MVB870R6	7700683283	SVB10825	7700749115	SVB10760	7700869686	MVB1238R4
7700315601	MVB850R6	7700685633	SVB101140	7700749115	SVB12760	7700869687	MVB1035R3
7700332862	MVB1165R6	7700690029	SVB13825	7700749117	SVB12760	7700870367	MVB735R4
7700348137	SVB10665	7700690965	SVB101140	7700749118	SVB10760	7700870896	MVB735R4
7700503052	SVB10850	7700691465	SVB131025	7700749118	SVB12760	7700870961	MVB1685R6
7700523844	SVB10700	7700694741	SVB101010	7700749225	TB292	7700872023	TB735
7700525075	SVB101200	7700694741	SVB101025	7700749393	MVB900R6	7700872533	MVB875R5
7700525076	SVB101225	7700694741	SVB121030	7700836095	TB482	7700872579	TB735
7700532588	SVB10625	7700696825	SVB101025	7700850028	MVB810R3	7700874202	MVB1400R6
7700545221	SVB10825	7700696825	SVB121030	7700850113	MVB715R3	7700875412	TB359
7700546002	SVB10825	7700697947	SVB101175	7700850766	MVB1190R6	7700875439	TB545
7700546003	SVB10825	7700699438	SVB131025	7700851954	MVB1550R6	7700875520	TB258
7700547324	SVB10650	7700704697	SVB10700	7700853230	MVB1150R6	7701017999	SVB101050
7700549230	SVB101225	7700704698	SVB10710	7700853616	MVB1190R6	7701023183	SVB131300
7700550831	SVB10665	7700704701	SVB10700	7700853660	TB422	7701027182	SVB101350
7700550831	SVB10675	7700706942	SVB10750	7700853661	TB421	7701029704	SVB101250
7700557552	SVB10850	7700709398	MVB875R4	7700853838	MVB887R3	7701029705	SVB101250
7700559731	SVB10700	7700717284	TB421	7700853862	TB156	7701029706	SVB131300
7700565018	SVB10725	7700717899	MVB885R4	7700853887	MVB1215R4	7701029707	SVB101350





OE		OE		OE		OE	
...RENAULT		...RENAULT		...RENAULT		...ROVER	
7701029710	SVB101400	7701472645	TBK323	8200208422	TB636	13H4366	SVB10888
7701029711	SVB101450	7701472675	TBK092	8200211651	MVB715R4	13H4583	SVB10888
7701035242	TB368	7701472725	TBK096	8200211989	MVB1788R7	13H4706	SVB10850
7701035651	MVB563R4	7701472726	TBK002	8200221695	TB652	13H480	SVB131150
7701035652	MVB825R5	7701473001	TBK315	8200226493	MVB1660R6	13H503	SVB10925
7701039690	MVB925R5	7701473120	TBK273	8200241629	TB713	13H5373	SVB10825
7701040944	MVB563R4	7701473312	TBK275	8200243021	MVB1200R6	13H589	SVB10813
7701043483	TB368	7701473672	TBK323	8200248497	TB756	13H6869	SVB101050
7701044188	TB558	7701473837	TBK323	8200251983	TB756	13H7104	SVB101175
7701050368	TB750	7701474443	TBK322	8200322233	MVB1035R7	13H760	SVB101113
7701057891	MVB1638R7	7701474446	TBK099	8200344791	TB713	13H7975	SVB101050
7701063978	TB735	7701474514	MVB1105R6	8200356268	MVB1820R6	13H8309	SVB10888
7701063979	TB292	7701474517	MVB775R4	8200356446	MVB1969R7	13H8310	SVB10900
7701063980	TB546	7701474950	MVB1100R6	8200366318	TB713	13H8389	SVB10813
7701063999	TB644	7701475115	TBK301	8200461911	TB710	13H859	SVB10813
7701064005	TB796	7701476571	TBK301	8200466868	MVB1833R6	13H8673	SVB10840
7701064010	TB704	7701476745	TBK315	8200508612	TB713	13H923	SVB10900
7701064316	TB652	7701477012	TBK273	8200537021	TB529	13H924	SVB10940
7701064326	TB654	7701477013	TBK092	8200537023	TB636	13H9620	SVB10950
7701064333	MVB887R5	7701477014	TBK267	8200537026	TB636	17D29	SVB131175
7701064349	MVB875R5	7701477024	TBK096	8200537033	TB713	17H760	SVB101100
7701065088	MVB1215R6	7701477028	TBK301	8200542737	TB644	2614A026	SVB10925
7701348137	SVB10665	7701477046	TBK099	8200542739	TB652	13405PP0004	TB354
7701348228	SVB10725	7701477047	TBK099	8200542740	TB653	14400P14004	TB378
7701348230	SVB10760	7701477048	TBK275	8200542741	TB546	14400P4500	TB353
7701348230	SVB12760	7701477049	TBK323	8200542743	TB756	14400P45000	TB353
7701348323	SVB10650	7701477050	TBK322	8200542746	TB654	14400P45010	TB353
7701348346	SVB13850	8200004342	MVB1775R6	8200545581	TB482	14400PH7004	TB312
7701348507	SVB101010	8200020924	MVB1135R5	8200644900	MVB1115R7	31110P44G03	MVB950R5
7701348508	SVB101075	8200023912	MVB1150R6	8200795488	MVB1115R7	31110PA13420	SVB10950
7701348549	SVB10700	8200027520	MVB735R4	8200821813	MVB1200R6	31110PB00041	MVB950R5
7701348934	SVB101300	8200034222	TB704	8200821816	MVB1130R6	38920P1K505	MVB800R4
7701349028	SVB10825	8200034396	MVB1200R5	8200830182	MVB735R3	38920P2A003	MVB825R4
7701349038	SVB10825	8200035834	TB712	8200833541	MVB1750R5	38920PT00032	MVB1100R5
7701349225	SVB10600	8200036780	TB654	8200833543	MVB1600R6	56992PL20030	SVB101075
7701349245	SVB10800	8200039519	TB713	8200833550	MVB1125R7	56992PL26610	SVB101075
7701349538	SVB101140	8200041850	MVB925R4	8200833558	MVB1788R7	56992PP2E010	SVB10888
7701349590	SVB10950	8200041851	MVB900R4	8200833570	MVB1795R6	151209	SVB10913
7701349594	SVB101000	8200046148	TB652	8200846156	MVB1190R6	151209EVA	SVB10710
7701349620	SVB101010	8200058139	MVB1642R6	8200897097	TB636	151515	SVB10900
7701468162	TBK117	8200059395	MVB1137R6	8200897100	TB636	156489	SVB101100
7701468163	TBK047	8200059423	MVB850R6	8972292770	TB750	201403	SVB101050
7701468165	TBK281	8200059425	MVB870R6	9618337580	TB727	212683	SVB101125
7701468166	TBK282	8200061673	MVB1110R5	9629407980	MVB1600R6	214239	SVB101100
7701468167	TBK017	8200065601	MVB735R3	9630034080	MVB1600R6	214239	SVB101113
7701468168	TBK038	8200071399	MVB1785R7	9632391980	MVB1600R6	214303	SVB101025
7701469774	TBK036	8200072113	MVB1125R7	9632600080	MVB1600R6	214314	SVB101113
7701469821	TBK090	8200078576	MVB1600R6	9638027080	MVB1580R6	214325	SVB101100
7701469824	TBK033	8200087378	TB756	9638027180	MVB1580R6	214830	SVB101125
7701469833	TBK002	8200088894	TB644	9649592880	MVB1588R6	216632	SVB10888
7701471382	TBK267	8200089047	MVB1190R6	9652391980	MVB1600R6	217391	SVB101100
7701471426	TBK033	8200093814	MVB1805R6	ROVER		217607	SVB10950
7701471769	TBK045	8200098343	TB644	1G2716	SVB10900	219560	SVB10813
7701471770	TBK037	8200106085	TB712	1H1001	SVB10900	247920	SVB10913
7701471771	TBK037	8200111788	MVB1775R7	2A414	SVB10813	247939	SVB10950
7701471772	TBK063	8200113203	MVB1795R6	2A801	SVB10813	511963	SVB10950
7701471773	TBK039	8200127627	TB710	3H2134	SVB17850	513907	SVB10888
7701471774	TBK102	8200127693	MVB1785R7	12B307	SVB131225	522704	SVB10825
7701471864	TBK098	8200142350	TB636	13H1329	SVB10865	524200	SVB101050
7701471865	TBK099	8200181178	TB546	13H1448	SVB131125	527288	SVB101050
7701471866	TBK097	8200188959	MVB1833R6	13H1840	SVB131075	563132	SVB101025
7701471974	TBK267	8200200665	MVB1788R7	13H3726	SVB101050	563132	SVB101050
7701472185	TBK275	8200200666	MVB1150R7	13H3820	SVB10888	574046	SVB10888
7701472644	TBK092	8200206889	MVB1120R5	13H389	SVB10813	596433	SVB10900







OE		OE		OE		OE	
...ROVER		...ROVER		...ROVER		...ROVER	
602319	SVB101150	ETC7394	SVB101215	GFB213	SVB101100	GFB60838	SVB10840
603713	SVB13850	ETC7469	SVB10610	GFB214	SVB10913	GFB60937	SVB10940
611612	SVB131000	ETC7899	SVB10675	GFB215	SVB131175	GFB61038	SVB101050
613602	SVB101225	ETC7939	SVB101025	GFB216	SVB13850	GFB80743	MVB735R4
614106	SVB13925	ETC8550	TB365	GFB243	SVB131075	GFB80750	MVB755R4
614670	SVB131000	ETC9002	SVB131200	GFB246	SVB101050	GFB80755	MVB747R4
2014034	SVB101050	ETC9009	SVB131350	GFB248	SVB101100	GFB80760	MVB763R4
46510585A	SVB10740	ETC9019	SVB131175	GFB249	SVB10950	GFB80770	MVB775R4
88156489	SVB101100	ETC9080	SVB13875	GFB250	SVB10950	GFB80795	MVB800R4
9194009101	MVB915R4	FDU1464	TB272	GFB251	SVB10813	GFB80910	MVB915R4
279023126306	MVB725R4	FDU1464EVA	TB272	GFB252	SVB10825	GFB80925	MVB920R4
279105116303	TB746	FDU1466	TB317	GFB253	SVB10840	GFB90633	MVB638R5
AAU3550	SVB10800	FDU1817EVA	MVB760R3	GFB255	SVB10950	GFB90698	MVB700R5
AAU3577	SVB10825	FDU2906EVA	SVB10888	GFB258	SVB101050	GFB91165	MVB1165R5
AAU8072	SVB10875	GCB10700	SVB10700	GFB259	SVB13925	GFB91170	MVB1175R5
ADU4236	SVB10825	GCB10706	SVB10710	GFB260	SVB10710	GFB91205	MVB1200R5
ADU6528	SVB10940	GCB10715	SVB10710	GFB262	SVB10975	GFB91496	MVB1500R5
ADU8912	SVB10710	GCB10813	SVB10813	GFB272	SVB10940	GFB91790	MVB1790R5
ADU9401	SVB101050	GCB10825	SVB10825	GFB273	SVB10875	GFB101415	MVB1413R6
AEA489	SVB10900	GCB10838	SVB10840	GFB303	SVB131000	GFB101448	MVB1450R6
AEC932	SVB101113	GCB10914	SVB10925	GFB350	MVB735R3	GMB101	MVB790R4
AEH473	SVB10975	GCB10937	SVB10940	GFB357	SVB101050	GMB102	MVB800R4
AEH621	SVB10975	GCB10950	SVB10950	GFB358	MVB915R4	GMB103	MVB810R4
AEJ63	SVB10850	GCB50765	SVB10750	GFB360	MVB760R3	GMB104	MVB950R5
AEJ101	SVB10840	GFB101	SVB10925	GFB362	SVB10710	GMB108	MVB870R4
AHU2747	MVB1200R5	GFB102	SVB10813	GFB366	MVB735R3	GMB109	MVB825R4
AHU2749	MVB1450R6	GFB103	SVB10900	GFB367	MVB760R3	GMB30738	MVB735R3
CAM7910	SVB10950	GFB104	SVB10825	GFB369	SVB101075	GMB40750	MVB755R4
CAM9989	SVB10710	GFB105	SVB101113	GFB370	SVB101075	GMB40770	MVB775R4
CDU2749	TB295	GFB120	SVB10865	GFB372	MVB760R3	GMB40910	MVB915R4
CFB10825	SVB10825	GFB121	SVB10850	GFB373	MVB760R3	GMB50735	MVB735R5
DBP4066	MVB760R3	GFB122	SVB101113	GFB375	MVB870R4	GMB50830	MVB30R5
DBP4067	MVB760R3	GFB122	SVB101125	GFB376	SVB10700	GMB50956	MVB950R5
DBP4131	TB203	GFB124	SVB101025	GFB400	MVB810R4	GMB51165	MVB1165R5
DBP9213	MVB735R3	GFB124	SVB101050	GFB402	MVB950R5	GMB51165XS	MVB1165R5
DBP9214	MVB735R3	GFB127	SVB10888	GFB403	MVB950R5	GMB51496	MVB1500R5
DBP9289	TB203	GFB128	SVB131075	GFB404	MVB1100R5	GMB51790	MVB1790R5
ECP244	TB312	GFB136	SVB10975	GFB406	MVB1100R5	GMB61180	MVB1180R6
EDU1357EVA	SVB101075	GFB142	SVB101100	GFB407	MVB1100R5	GMB61185	MVB1180R6
EPC244EVA	TB312	GFB144	SVB101275	GFB408	MVB780R3	GMB61290	MVB1285R6
ERC0026	SVB131175	GFB145	SVB10975	GFB700	SVB10888	GMB61415	MVB1413R6
ERC304	SVB10913	GFB147	SVB131175	GFB701	SVB10940	GMB61448	MVB1450R6
ERC0400	SVB13850	GFB165	SVB101050	GFB702	MVB700R5	GMB61465	MVB1460R5
ERC657	SVB13925	GFB168	SVB101025	GFB1120	MVB2025R5	GMB61553	MVB1550R6
ERC675	SVB13925	GFB170	SVB101125	GFB1121	MVB869R5	GRP101448	MVB1450R6
ERC1347	SVB13850	GFB176	SVB10888	GFB1122	MVB1560R6	GTB1208	TB312
ERC1742	SVB131050	GFB176	SVB10900	GFB1123	MVB1285R6	GTB1233	TB317
ERC2774	SVB13850	GFB182	SVB10888	GFB10706	SVB10710	GTB1237	TB272
ERC4272	SVB13800	GFB183	SVB10825	GFB10725	SVB10710	GTB1238	TB295
ERC5146	SVB13750	GFB183	SVB10840	GFB10775	SVB10775	GTB1238XS	TB295
ERC5836	SVB101125	GFB185	SVB10813	GFB10813	SVB10800	GTB1253	TB234
ERC6072	SVB13925	GFB189	SVB131075	GFB10813	SVB10813	GTB1253XS	TB234
ERC6504	SVB101025	GFB192	SVB10825	GFB10825	SVB10825	GTB1283XS	TB295
ERC6886	SVB101025	GFB192	SVB10840	GFB10838	SVB10840	GTB1289	TB367
ERC8852	SVB10775	GFB193	SVB10813	GFB10875	SVB10875	GTB1289XS	TB367
ERC8938	SVB101050	GFB195	SVB10825	GFB10900	SVB10900	GTB1290	TB378
ERR0810	SVB131025	GFB196	SVB10888	GFB10950	SVB10950	GTB1291	TB353
ERR1092	TB478	GFB197	SVB10840	GFB10975	SVB10975	GTB1292	TB354
ERR2073	SVB10675	GFB205	SVB10950	GFB11044	SVB101050	GTB1293XS	TB450
ETC4266	SVB10710	GFB206	SVB10950	GFB11065	SVB101050	GTB1497XS	TB640
ETC4267	SVB10675	GFB209	SVB101100	GFB20864	SVB13850	GTB2003	TB477
ETC4272	SVB13800	GFB210	SVB10840	GFB21075	SVB131075	GTB2004	TB513
ETC4705	SVB10675	GFB211	SVB101225	GFB50949	SVB10950	GTB2005	TB353
ETC5815	SVB13725	GFB212	SVB10950	GFB60825	SVB10825	GTB2005XS	TB353





OE		OE		OE		OE	
...ROVER		...ROVER		...SAAB		...SEAT	
GTB2006	TB457	PQS101380	MVB800R4	5340534	MVB1904R6	06A260849C	MVB1200R6D
GTB2016XS	TB317	PQS101450	MVB735R3	5343280	MVB1904R6	06A260849E	MVB1200R6D
GTB2017XS	TB534	PQS101460	MVB825R4	5590344	MVB2415R6	06A260849K	MVB1035R6
GTB2018XS	TB547	PQS101590	MVB1165R5	5954557	TB750	06A903849K	MVB1035R6
GTB2019XS	TB650	PWS100730EVA	MVB1100R5	7511728	SVB10975	06B109119A	TB554
GTB9003XS	TB534	RKC5233	SVB10925	7551674	MVB1610R5	06B198119	TBK115
GTB9005	TB651	TCK0366	SVB10900	7579881	MVB1610R5	06D109119	TB745
IG2716	SVB10900	TKC386	SVB10900	7596679	MVB1588R6	06D109119B	TB753
IH1001	SVB10900	TKC1616	SVB101100	8322026	SVB10813	06F198119A	TBK351
JPB100045EVA	MVB810R4	TKC2165	SVB101100	8339921	SVB10825	06F260849E	MVB1045R6
LHN000060	TB451	TKC2444	SVB13925	8339939	SVB10875	06F260849L	MVB1050R6
LHN10013	TB560	TKC2802	SVB10940	8375735	SVB10775	06F903137E	MVB900R6
LHN10015	TB560	TKC6621	SVB101100	8384927	SVB10975	06J260849D	MVB1115R6
LHN10016	TB367	TRC2801	SVB10975	9323510	SVB10975	6K0198001A	TBK087
LHN10029	TB477	UAM1058	SVB10700	9339409	SVB101250	6K0198001B	TBK086
LHN100040	TB650	UE8591	SVB101325	9341314	SVB10975	6K0198001D	TBK088
LHN100310B	TB560	UE31113RR	SVB101275	9344623	SVB131200	6Q0260849A	MVB1740R6
LHN100320EVA	TB378	UE31855RR	SVB10975	9347048	SVB101250	6Q0903137A	MVB1088R6
LHN100370EVA	TB353	WAM2804	TB234	9361791	SVB101175	7M0145271	SVB12670
LHN100390	TB534	XHM460	TB312	9367020	SVB131175	7M0145271A	SVB12760
LHN100400	TB547	XHM5788EVA	MVB915R4	9382383	SVB131275	414639	SVB10775
LHN100460EVA	TB457	SAAB		24435940	MVB1030R5	3897656	SVB101000
LHN100560	TB640	707766	SVB101140	24451895	TB638	3899744	SVB10825
LHN100690	TB451	713053	SVB101025	24452030	MVB1904R6	3901232	SVB10775
LHN100730	TB450	713657	SVB101140	55201363	MVB1725R6	03931000	SVB131125
LHN100760	TB651	731053	SVB101025	55556404	MVB1030R5	3938725	SVB10875
LHN100830	TB534	800693	SVB101010	55564662	MVB1725R6	3938737	SVB10875
LHN100860	TB547	830050	SVB10825	90500360	TB481	3939739	SVB10800
LIB100000EVA	TB354	837573	SVB10775	90502734	MVB1904R6	3991260	SVB10813
MVF10001	TB513	838492	SVB10975	93178811	TB639	4061402	SVB10775
MVF100040	TB650	880397	SVB101100	93178812	TB790	4146147	SVB10750
PQS000367EVA	MVB760R3	880693	SVB101010	93181196	MVB1413R6	4146392	SVB10775
PQS000403EVA	MVB950R5	883391	SVB101100	93184450	MVB1413R6	4156392	SVB10800
PQS10009EVA	SVB10940	2717056	TB372	93185049	MVB2625R6	4156931	SVB10800
PQS10013	MVB755R4	4029195	MVB2325R6	93185050	MVB2350R6	4158457	SVB10850
PQS10013EVA	MVB755R4	4029203	MVB2553R6	93185336	TB639	4164623	SVB10790
PQS10028	MVB775R4	4165080	MVB1904R6	93185756	MVB2120R6	0004225393	SVB10850
PQS10028EVA	MVB775R4	4356291	SVB131250	SAN		4253056	SVB10750
PQS10035	MVB1450R6	4356887	MVB1588R6	1752151A00	MVB810R4	4616931	SVB10800
PQS10037	SVB10740	4356895	MVB2325R6	1752161A00	MVB800R4	5930833	SVB10825
PQS10043EVA	MVB700R5	4356903	MVB2553R6	3545086CA0	MVB1469R6	5949504	SVB10800
PQS10044	MVB1165R5	4359063	MVB2625R6	4918160A00	MVB790R4	0019973792	SVB10900
PQS10045EVA	MVB1413R6	4360111	MVB2300R6	9514160A50	MVB800R4	0019974592	SVB10875
PQS10065EVA	MVB780R3	4360467	MVB2300R6	9514160A60	MVB920R4	022145933G	MVB1325R6D
PQS010700EVA	SVB10700	4395422	MVB2300R6	SEAT		026109119B	TB463
PQS051495EVA	MVB1500R5	4395430	MVB1885R6	1K0260849B	MVB1100R6	026145271	SVB10735
PQS100760EVA	MVB1100R5	4395448	MVB2325R6	1L0198002A	TBK026	026903137C	SVB10950
PQS100840	MVB735R5	4395455	MVB2553R6	03C903137A	MVB1600R6	027109119A	TB505
PQS100850	MVB1460R5	4395463	MVB2225R6	03D145933AD	MVB1875R6	027109119B	TB505
PQS100950EVA	MVB1790R5	4504163	TB481	03D145933AG	MVB1450R6	027109119C	TB505
PQS101010	MVB810R4	4552648	MVB2020R6	03D145933S	MVB1460R5	027903137	SVB10625
PQS101030	MVB1180R6	4575528	MVB1904R6	03E260849A	MVB1875R6	027903137A	SVB10865
PQS101080	MVB790R4	4621348	TB481	03E260849B	MVB1875R6	028109119AA	TB384
PQS101140	MVB830R5	4752861	MVB2020R6	03G109119	TB743	028109119AC	TB657
PQS101160EVA	MVB950R5	4773545	TB481	03G198119	TBK262	028109119D	TB384
PQS101180	MVB1200R5	4773842	TBK091	03G903137A	MVB946R6	028109119K	TB384
PQS101210	MVB1550R6	4896312	MVB1995R6	03G903137B	MVB1050R6	028109119M	TB384
PQS101261	MVB1285R6	4899548	MVB2613R6	03G903137H	MVB825R6	028109119N	TB657
PQS101262	MVB1285R6	4899555	MVB2020R6	06A109119C	TB552	028109119P	TB384
PQS101271	MVB1560R6	4904728	MVB2625R6	06A109119D	TB552	028109119S	TB384
PQS101272	MVB1560R6	4961058	MVB1805R6	06A145933D	MVB1125R6	028145271G	SVB10725
PQS101300	MVB2025R5	4961066	MVB2350R6	06A145933L	MVB925R6	028145271G	SVB12735
PQS101310	MVB869R5	4965687	MVB1980R6	06A198119	TBK100	028145271H	SVB10790
PQS101340	MVB870R4	5340526	MVB1805R6	06A198119B	TBK115	028145271K	SVB12735







OE		OE		OE		OE	
...SEAT		...SEAT		SKODA		...SKODA	
028145271L	SVB10790	037903137H	MVB1035R6	1K0260849A	MVB1100R6	036109119P	TB634
028198119	TBK024	038109119B	TB533	03D145933A	MVB1740R6	036109119Q	TB658
028198119A	TBK025	038109119D	TB533	03D145933AD	MVB1875R6	036145933AG	MVB736R6
028198119B	TBK119	038109119L	TB680	03D145933AG	MVB1450R6	036145933AJ	MVB1080R6
028198119C	TBK026	038109119M	TB797	03D145933AH	MVB1875R6	036145933F	MVB1088R6
028198119E	TBK305	038109119N	TB680	03D145933AJ	MVB1450R6	036145933H	MVB1550R6
028198119F	TBK112	038109119P	TB680	03D145933S	MVB1460R5	036145933J	MVB1080R6
028260849D	MVB1150R6	038145933J	MVB1080R6	03E260849A	MVB1875R6	036145933M	MVB750R6
028260849J	MVB1150R6	038198119	MVB1225	03E260849B	MVB1875R6	036198119A	TBK246
028260849L	MVB1150R6	038198119A	TBK270	03G109119	TB743	036198119C	TBK246
028903137AD	MVB925R6	038198119D	TBK107	03G198119	TBK262	038109119B	TB533
028903137AM	MVB925R6	038198119F	TBK116	03G903137A	MVB946R6	038109119D	TB533
028903137AP	MVB1225R5	038903137AA	MVB1180R6	03G903137B	MVB1050R6	038109119L	TB680
028903137AS	MVB1050R6	038903137E	MVB1660R6	03G903137H	MVB825R6	038109119M	TB797
028903137BB	MVB1045R6	038903137G	MVB906R6	03L903137	MVB906R6	038109119N	TB680
028903137T	MVB1045R6	038903137J	MVB1660R6	03L903137B	MVB838R6	038109119P	TB680
030109119H	TB466	038903137L	MVB1180R6	06A109119B	TB552	038198119	TBK225
030109119M	TB466	039903137N	MVB1100R6	06A109119C	TB552	038198119A	TBK270
030109119S	TB466	045260849	MVB1188R6D	06A109119D	TB552	038198119C	TBK270
030145933	MVB1100R6	045903137D	MVB1000R6	06A145933D	MVB1125R6	038198119F	TBK116
030145933E	MVB1065R6	045903137E	MVB860R6	06A145933F	MVB925R6	038903137AA	MVB1180R6
030145933L	MVB1065R6	047903137E	MVB1875R6	06A198119	TBK100	038903137E	MVB1660R6
030145933M	MVB1065R6	047903137F	MVB1488R6	06A260849	MVB1200R6D	038903137G	MVB906R6
030145933R	MVB1065R6	048109119G	TB441	06A260849C	MVB1200R6D	038903137H	MVB1432R5
030198119A	TBK087	049903137B	SVB10950	06A260849G	MVB1035R6	038903137L	MVB1180R6
030198119B	TBK320	051198119	TBK086	06B109119A	TB554	038903137N	MVB1100R6
030903137E	SVB12710	052903137F	SVB10675	06B109119B	TB554	038903137T	MVB1432R5
030903137K	MVB736R6	059198119	TBK348	06B109119F	TB554	44105435	MVB945R4
030903137T	MVB750R6	066145933J	MVB1325R6D	06B260849A	MVB855R4	045903137B	MVB1000R6
032109119G	TB467	066145933K	MVB1260R6	06B260849B	MVB855R4	045903137D	MVB1000R6
032109119J	TB467	068145271B	SVB10740	06B260849D	MVB855R4	045903137E	MVB860R6
032145933	MVB1180R6	068145271B	SVB12735	06B903137	MVB1300R5	047145933	MVB1675R6
032145933C	MVB1125R6	068145271E	SVB10650	06B903137E	MVB1300R5	047145933E	MVB1675R6
032145933E	MVB1125R6	068145271E	SVB12650	06D109119	TB745	047903137AB	MVB1740R6
032145933G	MVB1125R6	068260849B	SVB13950	06D109119B	TB753	047903137R	MVB1225R5
032145933S	MVB1125R6	068260849G	SVB13950	06F198119A	TBK351	059109119B	TB738
032145933T	MVB1180R6	068903137AG	SVB10700	06F260849E	MVB1045R6	059130113A	TB641
032198119	TBK088	068903137AR	SVB10960	06F260849L	MVB1050R6	078109119H	TB556
036109119AG	TB658	068903137AR	SVB12950	06F903137E	MVB900R6	078198119	TBK357
036109119D	TB553	068903137D	SVB10960	06J260849D	MVB1115R6	078198479	TBK353
036109119H	TB553	068903137D	SVB12950	6Q0260849A	MVB1740R6	078903137BC	MVB1875R6
036109119HPDS	TB553	071145933F	MVB1285R6	6Q0260849C	MVB1740R6	101555435	SVB10925
036109119M	TB658	AG6A109119C	TB552	6Q0903137A	MVB1088R6	101565435	SVB101050
036109119P	TB634	EA03231005	SVB10750	06Q903137A	MVB1088R6	942100009	SVB101000
036109119Q	TB658	EA03231006	SVB10750	6U0903137A	MVB945R4	942105009	SVB101050
036145933AE	MVB1190R6	EA03231007	SVB10750	005435171	MVB945R4	942600009	SVB101000
036145933AG	MVB736R6	FA03231000	SVB10775	005435174	MVB1675R6	943095009	SVB10950
036145933AJ	MVB1080R6	FA03231001	SVB10775	022145933AG	MVB1613R6	943100010	SVB101000
036145933H	MVB1550R6	FA03231002	SVB10775	028109119AC	TB657	441054351716	MVB945R4
036145933J	MVB1080R6	FC03231001	SVB10850	028109119N	TB657	SMART	
036145933M	MVB750R6	FD03231000	SVB10800	028198119G	TBK093	0003177V003000000	MVB790R4
036198119A	TBK246	FD03231001	SVB10850	028903137AP	MVB1225R5	0003190V005000000	MVB850R3
036198119B	TBK263	FD03231002	SVB10850	030145933E	MVB1065R6	0018907V001000000	MVB790R4
036198119C	TBK246	GE03931000	SVB131125	030145933G	MVB1065R6	0018908V001000000	MVB850R3
037145271E	SVB10690	HB03231000	SVB10790	030145933K	MVB1080R6	0009932396	MVB1225R5
037145271E	SVB12685	ND03231051	SVB101000	030145933L	MVB1065R6	0009932496	MVB915R5
037145271F	SVB10750	SE020032310A	SVB10800	030903137AB	MVB750R6	0019930796	MVB800R4
037145271F	SVB12760	SE020032310A	SVB10813	030903137T	MVB750R6	0019934496	MVB800R4
037198119	TBK076	SE021039310A	SVB13950	032109119F	TB467	0129973992	MVB768R5
037260849	MVB1155R6	SE021040210A	SVB10750	032109119G	TB467	1609970092	MVB790R4
037260849C	MVB1155R6	SE700032310A	SVB10840	032109119J	TB467	1609970192	MVB850R3
037903137E	MVB890R6	SE700032310B	SVB10840	032145933AA	MVB1550R6	SSANGYONG	
037903137F	MVB975R6	XO39530760	SVB10840	032145933S	MVB1125R6	0079978292	MVB2250R6
037903137G	MVB975R6	XO39652540	SVB10813	036109119AG	TB658	0089973492	MVB2120R6





OE		OE		OE		OE	
...SSANGYONG		...SUBARU		...SUZUKI		...SUZUKI	
0089973692	MVB2100R6	809214070	MVB725R4	1752150F00	MVB648R4	9514160A10	MVB940R4
0109978892	MVB2225R6	809214290	MVB725R4	1752151A00	MVB810R4	9514160A50	MVB800R4
0119971592	MVB2100R6	809214320	MVB706R4	1752152E00	MVB945R4	9514160A60	MVB920R4
0119971892	MVB2050R6	809214470	MVB845R4	1752160A00	MVB810R4	9514160B10	MVB945R4
517039000	MVB906R5	809214550	MVB845R4	1752160B00	MVB810R3	9514160B50	MVB763R4
1629973392	MVB2225R6	809218010	MVB688R5	1752160B01	MVB810R3	9514160D01	SVB10760
2610103200	SVB131175	809218130	MVB875R5	1752160B10	MVB810R3	9514160D10	SVB10750
4714603050	SVB131500	809218140	MVB875R5	1752160B20	MVB810R3	9514160G40	MVB995R4
6619974692	MVB2100R6	809218150	MVB875R5	1752161A00	MVB800R4	9514160G50	MVB835R4
6659970392	MVB2250R6	809218160	MVB875R5	1752161A10	MVB800R4	9514160G60	MVB1000R4
SUBARU		809218170	MVB875R5	1752162G00	MVB1550R5	9514160G80	MVB1638R5
11718AA020	SVB13975	809218200	MVB887R5	1752164J00	MVB836R5	9514160G90	MVB1638R5
13028AA071	TB551	809218210	MVB875R5	1752166J00	MVB945R4	9514163B50	MVB790R4
13028AA072	TB551	809218240	MVB887R5	1752170B01	SVB10610	9514164A00	MVB835R4
13028AA200	TB758	809218250	MVB875R5	1752170B10	SVB10610	9514164A10	MVB945R4
13028AA240	TB758	809218270	MVB875R5	1752170D01	SVB10635	9514165D00	MVB1090R4
13028KA021	TB322	809218300	MVB875R5	1752176G01	SVB10710	9514170F01	MVB835R4
13028KA030	TB328	809218310	MVB875R5	1752177E00	MVB1550R5	9514171B00	SVB10740
13028KA031	TB328	809218380	MVB875R5	1752177E10	MVB1550R5	9514173J00	MVB1715R6
13028KA071	TB622	809218390	MVB875R5	1752178E00	SVB131175	9514177E80	SVB13850
13160AA060	TB551	809218400	MVB869R5	1752178F00	MVB810R4	9514177E81	SVB13850
13160AA090	TB551	809218410	MVB869R5	1752179J50	MVB1050R6	9514178A00	SVB10790
13160AA100	TB551	809218420	MVB869R5	1752180C00	SVB10840	9514178A20	SVB10775
73013AA000	MVB885R4	809218430	MVB875R5	1752180F51	MVB1040R4	9514184E00	MVB1318R6
73013PA000	MVB855R4	809218750	MVB875R5	1752181AA0	MVB985R4	9514185C60	MVB940R4
73013TA070	MVB960R4	809221050	MVB1642R6	1752183AA0	MVB995R4	9514186H00	MVB763R4
73036GA100	MVB985R4	809221080	MVB1588R6	1752183E00	MVB810R4	17521052E00	MVB945R4
73036GA110	MVB1125R4	809221090	MVB1625R6	1752184CA0	MVB1115R6	51758124	MVB1388R6
73036GA120	SVB13975	809221120	MVB1650R6	1752184H00	MVB850R4	55185078	MVB1318R6
73036GA130	SVB131150	1752186500	MVB810R4	1752185C00	MVB810R4	96142525	TB560
73036GA140	SVB13950	1752186520	MVB810R4	1752185E00	MVB1180R6	96198509	MVB1150R6
73323AA010	MVB900R4	8091101100	SVB10675	1752185FA0	MVB925R4	96209040	MVB1150R6
73323AC000	MVB900R4	G3012AA608	MVB885R4	1752186CA0	SVB10600	1140786501	TB426
73323AC010	MVB900R4	G3031FA613	MVB970R5	3534086CA0	MVB1150R6	1276186500	TB426
73323AC011	MVB900R4	SUZUKI		4818052E00	MVB945R4	1276186501	TB426
73323AP010	MVB900R4	12761M72F10	TB456	4918060B10	MVB945R4	1752171520	SVB10750
73323FA000	MVB885R4	12761N70C10	TB455	4918060B20	MVB850R4	1752175100	SVB10775
73323FA030	MVB885R4	1752188201	SVB10840	4918060G10	MVB900R4	1752176000	SVB10825
73323SA000	MVB855R4	17521M79F10	MVB706R4	4918063B10	MVB920R4	1752177300	SVB10750
1276163E00	TB322	1140770C00	TB455	4918063B20	MVB825R4	1752178000	SVB10825
1276172F00	TB456	1140771C00	TB281	4918063B50	MVB790R4	1752178100	SVB10825
1276172F10	TB456	1176163E00	TB322	4918063G10	MVB915R4	1752182010	SVB10840
1752152E00	MVB945R4	1274172F00	TB456	4918065G10	MVB1740R6	1752182020	SVB10840
1752160B00	MVB810R3	1276067JG1	TBK322	4918065G11	MVB1725R6	1752182030	SVB10840
1752160B20	MVB810R3	1276153B00	TB502	4918065G20	MVB1155R6	1752183010	SVB10840
1752161A00	MVB800R4	1276153B01	TB502	4918069G00	MVB940R4	1752185090	MVB1080R4
4918060B20	MVB850R4	1276160E00	TB535	4918073J00	MVB1370R6	1752185300	MVB1015R4
9514163B50	MVB790R4	1276163E00	TB322	4918084A80	MVB1960R6	1752186500	MVB810R4
809110020	SVB10913	1276166G00	SVB560	4918150J40	MVB1635R6	1752186510	MVB810R4
809110110	SVB10675	1276167G00	TB632	4918156B10	MVB810R4	1752186520	MVB810R4
809110140	SVB10913	1276167J00	TB720	4918160A00	MVB790R4	4918086000	MVB940R4
809110290	SVB10900	1276170C00	TB455	4918164J00	MVB885R4	8200059395	MVB1137R6
809110380	SVB10900	1276170C10	TB455	4918165D40	MVB1570R6	9008090155	MVB970R5
809110400	SVB10700	1276171C00	TB281	4918170A10	MVB706R4	9086007800	SVB10775
809110460	SVB10690	1276172F00	TB456	4918177E00	MVB1020R4	9086107300	SVB10710
809110490	SVB10610	1276173J00	TB721	4918178E00	SVB13925	9091602299	MVB800R4
809110540	SVB10625	1276178E01	TB590	9414160G90	MVB1638R5	9091602422	MVB1120R5
809110550	SVB10710	1276178E02	TB590	9514150F00	MVB835R4	9091602424	MVB70R4
809113050	SVB13925	1276179J50	TB639	9514150F01	MVB835R4	9091602433	MVB870R4
809113070	SVB13925	1276180C00	TB322	9514151K00	MVB763R4	9091602995	MVB1135R5
809211010	MVB648R3	1276184A00	TB713	9514155C00	MVB755R4	9497000730	MVB925R4
809211020	MVB735R3	1276184CT0	TB545	9514155C10	MVB855R4	9497000740	MVB940R4
809213010	MVB975R4	1276186CA0	TB560	9514157B50	MVB825R4	9514280000	SVB10790
809213040	MVB945R4	1752124J00	MVB836R5	9514160A00	MVB825R4	9936380740	MVB735R3







OE		OE		OE		OE	
TALBOT		...TATA (TELCO)		...TOYOTA		...TOYOTA	
26181A	SVB10888	254723116309	SVB121015	1356811010	TB667	1356865010	TB692
32471J	SVB10775	254723116315	SVB121015	1356811020	TB667	1356865020	TB692
36942N	SVB10790	254723126309	MVB1318R6	1356811050	TB263	1356867010	TB447
40996V	SVB10925	254723126320	MVB1318R6	1356811051	TB263	1356869025	TB436
50951H	SVB101300	254723126329	MVB1335R6	1356811052	TB263	1356869035	TB444
081622	TB560	254723126330	MVB1360R6	1356811053	TB263	1356869055	TB692
128001	SVB10888	279023116304	MVB875R4	1356811070	TB667	1356869065	TB473
128007	SVB101125	279023116307	MVB875R4	1356811071	TB667	1356869066	TB473
179439	SVB10775	279023126306	MVB725R4	1356811080	TB428	1356869067	TB473
347100	SVB10775	279105116303	TB746	1356811100	TB527	1356869075	TB692
400332	SVB101050	TOYOTA		1356811101	TB527	1356869085	TB447
407601	SVB10975	6PK1675	MVB1675R6	1356816010	TB198	1356869095	TB729
409105	SVB10975	6PK1720	MVB1715R6	1356816020	TB198	1356870090	TB803
409224	SVB10790	9936C1220	MVB1215R6	1356816040	TB445	1356874010	TB311
427169	SVB10865	38920PWAJ01	MVB1150R6	1356816050	TB445	1356874011	TB311
427944	SVB10913	90916A2007	MVB1930R6	1356816051	TB445	1356874012	TB311
427945	SVB10913	90916A2011	MVB1910R7	1356816060	TB435	1356874020	TB311
456908	SVB10650	90916T2005	MVB1090R7	1356816061	TB435	1356879025	TB311
456911	SVB10610	90916T2014	MVB1933R7	1356816070	TB435	1356879035	TB803
547197	SVB10888	90916W2002	MVB1215R6	1356817010	TB285	1356879045	TB309
574926	SVB10975	90916W2003	MVB850R6	1356817030	TB695	1356879095	TB311
575052	SVB10925	90916W2004	MVB1725R6	1356819015	TB334	1356879105	TB446
575055	MVB698R4	90916W2005	MVB1560R6	1356819016	TB334	1356879225	TB311
1214758	SVB10950	90916W2006	MVB1875R6	1356819025	TB263	1356888300	TB803
1238402	SVB10975	90916W2007	MVB1420R6	1356819045	TB445	1356888361	TB309
1238562	SVB10940	90916W2008	MVB1690R6	1356819046	TB445	1356888381	TB309
4099600	SVB10925	90916W2010	MVB2000R7	1356819055	TB435	1356888382	TB309
7100127	SVB101113	90916W2015	MVB1760R6	1356819056	TB435	9007274201	SVB13925
7100495	SVB101113	90916W2017	MVB1760R6	1356819065	TB285	9008021040	MVB1035R6
7100859	SVB101113	90916WX001	MVB795R6	1356819095	TB667	9008090155	MVB970R5
9226505	SVB10960	90916WX002	MVB962R6	1356819105	TB428	9008091049	MVB1110R5
9226506	SVB10960	99364C1050	MVB1045R4	1356819106	TB428	9008091050	MVB970R5
9226508	SVB101113	99365A0930	MVB938R5	1356819115	TB527	9008091051	MVB625R3
9226518	SVB101175	99365A1190	MVB1188R5	1356819116	TB527	9008091055	MVB970R5
9226534	SVB10813	99365C0930	MVB938R5	1356819145	TB198	9008091078	MVB625R3
9226584	SVB10975	99365C1110	MVB1110R5	1356819165	TB667	9008091079	MVB760R3
0013014900	SVB10790	99365C1190	MVB1188R5	1356819195	TB695	9008091082	MVB887R5
13014900	SVB10790	99365D1110	MVB1110R5	1356827010	TB655	9008091087	MVB1035R6
17841500	SVB10950	99366C1040	MVB1045R6	1356829015	TB696	9008091088	MVB875R4
0017943900	SVB10775	99366C1220	MVB1215R6	1356829025	TB696	9008091090	MVB1045R4
20454400	SVB101050	99366D1040	MVB1045R6	1356829035	TB655	9008091092	MVB940R4
0040760100	SVB10975	99366D1930	MVB1930R6	1356830010	TB687	9008091093	MVB875R4
55421100	SVB10900	99366H1040	MVB1045R6	1356839015	TB687	9008091099	MVB1110R5
71802863	SVB10840	99366K0910	MVB915R6	1356842010	TB597	9008091101	MVB1100R4
71803371	SVB10813	99366K1040	MVB1045R6	1356842011	TB597	9008091121	MVB1930R6
75221594	SVB10960	96223131	TB631	1356842012	TB597	9008091133	MVB1110R5
75221595	SVB10813	96252153	TB631	1356846021	TB762	9008091147	MVB1035R6
79226533	SVB101113	96368342	MVB1775R6	1356846030	TB762	9008091168	MVB1930R6
79226536	SVB101113	96391367	MVB1488R6	1356846035	TB762	9008091170	MVB850R4
79226577	SVB10825	900149367	SVB1310R5	1356849015	TB597	9008091183	MVB1488R6
522066100	SVB10790	1356803010	TB311	1356849035	TB762	9008091196	MVB1775R6
7932584733	SVB101050	1356803020	TB311	1356849036	TB762	9008091199	MVB1725R6
7932585109	SVB10650	1356809020	TB445	1356854070	TB314	9008091212	MVB875R4
7932585135	SVB101125	1356809030	TB435	1356854071	TB314	9008091214	MVB1933R7
9350050180	SVB10750	1356809041	TB311	1356854080	TB314	9009982008	SVB13925
9750987880	SVB10700	1356809130	TB687	1356859065	TB314	9009982018	MVB1050R5
C2028620S	SVB101275	1356810013	TB334	1356859066	TB314	9036300890	MVB940R3
P103652	SVB10950	1356810020	TB362	1356859067	TB314	9087108905	SVB13900
		1356810021	TB334	1356859106	TB314	9091602024	SVB10865
TATA (TELCO)	TB560	1356810022	TB334	1356862020	TB444	9091602030	SVB171115
254705116312		1356810023	TB334	1356862030	TB436	9091602044	SVB131075
254715146314	MVB1045R4	1356810024	TB334	1356862040	TB444	9091602045	SVB131075
254715146315	MVB1045R4	1356810030	TB362	1356864010	TB473	9091602048	SVB10840
254715146321	MVB1045R4	1356810031	TB362	1356864011	TB473	9091602055	SVB13900
254715146332	MVB1040R4						





OE		OE		OE		OE	
...TOYOTA		...TOYOTA		...TOYOTA		...TOYOTA	
9091602060	SVB13900	9091602219	MVB1000R5	9091602363	MVB800R3	9091602500	MVB1190R4
9091602061	SVB13900	9091602221	MVB920R4	9091602364	MVB845R4	9091602501	MVB1190R4
9091602070	SVB10940	9091602223	MVB945R4	9091602365	MVB875R4	9091602502	MVB1933R7
9091602073	SVB171055	9091602227	SVB101125	9091602370	MVB1030R5	9091602503	MVB1933R7
9091602074	SVB10900	9091602231	MVB2250R6	9091602372	SVB13950	9091602504	MVB1875R6
9091602076	MVB920R7	9091602232	MVB950R5	9091602373	MVB1050R6	9091602506	MVB1820R6
9091602076	SVB10925	9091602235	SVB131050	9091602374	MVB1050R6	9091602507	MVB1225R5
9091602078	SVB131225	9091602237	SVB13950	9091602375	SVB101300	9091602509	MVB1110R5
9091602080	SVB13825	9091602238	MVB865R5	9091602378	MVB1190R4	9091602510	MVB1150R7
9091602092	SVB101125	9091602243	SVB171115	9091602380	MVB2271R7	9091602511	MVB1638R7
9091602098	SVB10960	9091602244	SVB131025	9091602381	SVB131000	9091602512	MVB1813R7
9091602100	SVB101150	9091602246	MVB1141R5	9091602382	MVB1100R5	9091602513	MVB1933R7
9091602101	SVB17850	9091602248	SVB101000	9091602383	MVB1100R5	9091602516	MVB1675R6
9091602104	SVB131200	9091602256	MVB1100R5	9091602384	MVB1190R4	9091602517	MVB887R5
9091602107	SVB131200	9091602257	MVB1100R5	9091602385	SVB131000	9091602521	MVB850R3
9091602108	SVB101090	9091602262	SVB13850	9091602386	MVB875R4	9091602522	MVB850R3
9091602109	SVB10950	9091602265	MVB825R4	9091602387	SVB101375	9091602523	MVB1090R7
9091602112	SVB101250	9091602267	MVB835R4	9091602392	MVB1137R6	9091602524	MVB1475R7
9091602113	SVB13800	9091602268	MVB875R4	9091602395	MVB1120R5	9091602533	MVB1240R5
9091602116	MVB1100R5	9091602269	MVB875R4	9091602396	MVB1120R5	9091602534	MVB1885R6
9091602119	SVB10975	9091602270	MVB1110R5	9091602397	SVB131175	9091602535	MVB1538R6
9091602122	MVB800R3	9091602273	SVB10775	9091602399	MVB838R3	9091602537	MVB1690R6
9091602123	SVB10960	9091602281	SVB10975	9091602400	SVB131175	9091602539	MVB1400R6
9091602125	SVB13850	9091602283	SVB10990	9091602401	MVB1035R6	9091602540	MVB1930R6
9091602132	SVB10975	9091602284	SVB101060	9091602402	MVB1030R5	9091602545	MVB1420R6
9091602133	SVB131000	9091602285	SVB101400	9091602403	MVB1030R5	9091602546	MVB1690R6
9091602135	MVB810R4	9091602293	MVB1015R5	9091602404	MVB2225R6	9091602547	MVB1875R6
9091602136	MVB810R4	9091602294	MVB1015R5	9091602405	MVB2225R6	9091602549	MVB1690R6
9091602140	SVB13850	9091602295	MVB1000R5	9091602408	SVB101175	9091602550	MVB1255R5
9091602141	SVB171055	9091602296	MVB1000R5	9091602410	MVB825R4	9091602555	MVB1904R6
9091602142	SVB171205	9091602298	MVB800R4	9091602412	MVB1930R6	9091602557	MVB935R7
9091602144	SVB13975	9091602299	MVB800R4	9091602419	MVB101375	9091602558	MVB1180R7
9091602146	MVB1260R4	9091602301	SVB13950	9091602422	MVB1120R5	9091602559	MVB1725R6
9091602147	MVB938R5	9091602302	MVB1190R4	9091602424	MVB870R4	9091602560	MVB1775R4
9091602148	MVB830R5	9091602303	MVB970R5	9091602429	SVB131450	9091602563	MVB1910R7
9091602149	MVB830R5	9091602305	MVB1950R6	9091602432	MVB1885R6	9091602566	MVB1775R4
9091602152	SVB101175	9091602308	MVB1980R6	9091602440	MVB2215R6	9091602569	MVB1165R4
9091602154	SVB10775	9091602309	MVB1930R6	9091602441	MVB2215R6	9091602574	MVB1700R6
9091602157	MVB950R5	9091602310	MVB1930R6	9091602451	SVB101375	9091602575	MVB850R3
9091602158	MVB845R5	9091602314	MVB735R3	9091602452	SVB101000	9091602585	MVB2240R6
9091602162	SVB10990	9091602315	SVB131000	9091602458	MVB1885R6	9091602586	MVB2250R6
9091602169	SVB131000	9091602319	MVB825R4	9091602461	SVB13975	9091602596	MVB1588R7
9091602173	MVB985R5	9091602320	MVB810R4	9091602462	MVB2265R6	9091602597	MVB1588R7
9091602177	MVB760R3	9091602330	SVB101000	9091602463	MVB2250R6	9091602598	MVB1933R7
9091602183	SVB131000	9091602331	SVB101060	9091602465	SVB131225	9091602602	MVB870R6
9091602184	MVB845R5	9091602332	MVB810R4	9091602467	MVB1090R5	9091602606	MVB1215R6
9091602185	MVB845R5	9091602334	SVB101175	9091602468	MVB1538R6	9091602640	MVB2271R7
9091602186	MVB875R5	9091602335	MVB2020R6	9091602469	MVB1560R6	9091602641	MVB760R3
9091602191	MVB1060R5	9091602336	MVB865R5	9091602470	MVB1842R6	9091602647	MVB1188R5
9091602192	MVB1060R5	9091602337	MVB865R5	9091602475	MVB1775R4	9091602650	MVB1238R6
9091602194	MVB1190R4	9091602341	MVB825R4	9091602476	MVB1775R4	9091602652	MVB1910R7
9091602196	SVB131200	9091602344	MVB1110R5	9091602477	MVB1708R4	9091602653	MVB1910R7
9091602197	MVB1100R5	9091602345	MVB1110R5	9091602478	MVB1708R4	9091602995	MVB1135R5
9091602200	MVB845R4	9091602348	MVB920R4	9091602482	MVB1820R6	9091620820	MVB825R4
9091602201	MVB1050R5	9091602350	MVB800R4	9091602486	MVB1690R6	9091691088	MVB1930R6
9091602203	MVB1215R5	9091602352	MVB800R4	9091602487	MVB1400R6	9184007203	MVB715R4
9091602204	MVB1215R5	9091602353	SVB101125	9091602490	MVB1969R7	9184008603	MVB860R4
9091602205	MVB760R3	9091602354	MVB860R4	9091602491	MVB1588R7	9185008804	MVB875R5
9091602207	MVB1120R5	9091602355	MVB1000R5	9091602492	MVB1913R6	9185011909	MVB1188R5
9091602209	SVB131050	9091602356	MVB1000R5	9091602494	MVB1588R7	9185012103	MVB1215R5
9091602211	SVB131050	9091602357	MVB1015R5	9091602495	MVB1135R5	9649006280	MVB962R6
9091602212	MVB825R4	9091602358	MVB1015R5	9091602496	SVB101125	9652945780	MVB962R6
9091602215	SVB101225	9091602360	MVB2250R6	9091602497	SVB101175	9653226080	TB720
9091602216	MVB1015R5	9091602361	MVB2271R6	9091602499	MVB920R4	9653226280	TB720







OE		OE		OE		OE	
...TOYOTA		...TOYOTA		...TOYOTA		...TOYOTA	
9932100805	SVB10800	9933201395	SVB131400	9936400720	MVB715R4	9936480820	MVB825R4
9932100810	SVB10800	9933210820	SVB13825	9936400770	MVB775R4	9936480830	MVB835R4
9932100840	SVB10840	9933210835	SVB13825	9936400790	MVB790R4	9936480850	MVB850R4
9932100850	SVB10850	9933210860	SVB13850	9936400800	MVB800R4	9936480860	MVB860R4
9932100860	SVB10850	9933210865	SVB13875	9936400840	MVB835R4	9936480880	MVB875R4
9932100870	SVB10875	9933210870	SVB13875	9936400845	MVB845R4	9936480910	MVB915R4
9932100885	SVB10888	9933210880	SVB13900	9936400850	MVB850R4	9936480930	MVB925R4
9932100895	SVB10900	9933210890	SVB13900	9936400860	MVB860R4	9936481080	MVB1080R4
9932150840	SVB10840	9933210905	SVB13900	9936400870	MVB870R4	9936481100	MVB1100R4
9932150885	SVB10888	9933210990	SVB131000	9936400890	MVB885R4	9936481120	MVB1125R4
9932150895	SVB10900	9933211000	SVB131000	9936400910	MVB915R4	9936481770	MVB1775R4
9932150975	SVB10975	9933211040	SVB131050	9936400920	MVB920R4	9936490880	MVB875R4
9932150985	SVB10990	9933211110	SVB131125	9936400930	MVB925R4	9936490920	MVB920R4
9932150995	SVB10990	9933211120	SVB131125	9936400940	MVB940R4	9936490930	MVB925R4
9932200805	SVB13825	9933211180	SVB131175	9936400970	MVB970R4	9936490940	MVB940R4
9932200875	SVB13875	9933211205	SVB131200	9936400980	MVB975R4	9936491080	MVB1080R4
9932200880	SVB13875	9933211230	SVB131225	9936401080	MVB1080R4	9936491180	MVB1190R4
9932200890	SVB13900	9933211250	SVB131250	9936401090	MVB1090R4	9936500780	MVB775R5
9932200900	SVB13900	9933211260	SVB131275	9936401100	MVB1100R4	9936500790	MVB788R5
9932200910	SVB13925	9933211265	SVB131275	9936410850	MVB850R4	9936500800	MVB800R5
9932200920	SVB13925	9933211275	SVB131275	9936420720	MVB715R4	9936500860	MVB865R5
9932200930	SVB13950	9933211495	SVB131500	9936420770	MVB775R4	9936500870	MVB869R5
9932200940	SVB13950	9933251120	SVB131125	9936420820	MVB825R4	9936500880	MVB875R5
9932200950	SVB13950	9933251130	SVB101125	9936420840	MVB835R4	9936500900	MVB900R5
9932200960	SVB13975	9933251135	SVB131125	9936420850	MVB850R4	9936500930	MVB938R5
9932200980	SVB13975	9933260835	SVB13825	9936420860	MVB860R4	9936500970	MVB970R5
9932201030	SVB131025	9933260865	SVB13875	9936420870	MVB870R4	9936500980	MVB975R5
9932201045	SVB131050	9933260905	SVB13900	9936420880	MVB875R4	9936501000	MVB1000R5
9932201155	SVB131175	9933260975	SVB10960	9936420890	MVB885R4	9936501010	MVB1015R5
9932201180	SVB131175	9933260980	SVB13975	9936420900	MVB900R4	9936501050	MVB1050R5
9932201240	SVB131250	9933261205	SVB131200	9936420920	MVB920R4	9936501060	MVB1060R5
9932201250	SVB131250	9933261260	SVB131275	9936420930	MVB925R4	9936501100	MVB1100R5
9932201400	SVB131400	9933261275	SVB131275	9936420940	MVB940R4	9936501110	MVB1110R5
9932210875	SVB13875	9934150840	SVB10840	9936421090	MVB1090R4	9936501120	MVB1120R5
9932211250	SVB131250	9934200920	SVB13925	9936421110	MVB1110R4	9936501290	MVB1285R5
9932211270	SVB131275	9934201020	SVB131025	9936421120	MVB1125R4	9936501300	MVB1300R5
9932250835	SVB13825	9934301175	SVB171205	9936430770	MVB775R4	9936502295	MVB1000R5
9932250875	SVB13875	9934301195	SVB171205	9936430850	MVB850R4	9936510970	MVB970R5
9932250985	SVB13975	9934311090	SVB171115	9936430860	MVB860R4	9936510980	MVB975R5
9932251250	SVB131250	9934311095	SVB171115	9936430900	MVB900R4	9936511110	MVB1110R5
9932301175	SVB171205	9934311510	SVB171500	9936430940	MVB940R4	9936520870	MVB870R4
9933100870	SVB10875	9936300630	MVB625R3	9936431110	MVB1100R4	9936520880	MVB875R5
9933100880	SVB10875	9936300760	MVB760R3	9936431240	MVB1238R4	9936520920	MVB915R5
9933110870	SVB10875	9936300800	MVB800R3	9936450720	MVB715R4	9936520970	MVB970R5
9933200805	SVB13800	9936300890	MVB887R3	9936450810	MVB810R4	9936520980	MVB970R5
9933200815	SVB13800	9936300950	MVB940R3	9936450830	MVB835R4	9936521030	MVB1030R5
9933200825	SVB13825	9936300960	MVB960R3	9936450840	MVB835R4	9936521050	MVB1050R5
9933200830	SVB13825	9936300970	MVB975R3	9936450880	MVB875R4	9936521060	MVB1060R5
9933200850	SVB13850	9936310630	MVB625R3	9936450890	MVB885R4	9936521100	MVB1100R5
9933200870	SVB13875	9936320630	MVB625R3	9936450900	MVB900R4	9936521110	MVB1110R5
9933200885	SVB13875	9936320760	MVB760R3	9936450940	MVB940R4	9936521130	MVB1135R5
9933200890	SVB13900	9936330630	MVB625R3	9936451110	MVB1110R4	9936521190	MVB1188R5
9933200900	SVB13900	9936330760	MVB760R3	9936451160	MVB1165R4	9936521210	MVB1215R5
9933200905	SVB13900	9936330850	MVB850R3	9936451170	MVB1165R4	9936521220	MVB1225R5
9933200970	SVB13975	9936350630	MVB625R3	9936470720	MVB715R4	9936531090	MVB1090R5
9933200985	SVB131000	9936350760	MVB760R3	9936470830	MVB835R4	9936531100	MVB1100R5
9933201030	SVB131025	9936351110	MVB1110R5	9936470840	MVB835R4	9936531110	MVB1110R5
9933201040	SVB131050	9936370630	MVB625R3	9936470860	MVB860R4	9936531120	MVB1120R5
9933201055	SVB131050	9936370760	MVB760R3	9936470890	MVB885R4	9936531130	MVB1135R5
9933201070	SVB131075	9936380630	MVB625R3	9936470970	MVB970R4	9936531210	MVB1215R5
9933201120	SVB131125	9936380760	MVB760R3	9936471100	MVB1100R4	9936550790	MVB788R5
9933201170	SVB131075	9936390630	MVB625R3	9936480720	MVB715R4	9936550820	MVB825R5
9933201260	SVB131250	9936390760	MVB760R3	9936480750	MVB755R4	9936550830	MVB830R5
9933201360	SVB131375	9936390850	MVB850R3	9936480810	MVB810R4	9936550870	MVB870R4





OE		OE		OE		OE	
...TOYOTA		...TOYOTA		...TRIUMPH		...TRIUMPH	
9936550880	MVB875R5	9936680940	MVB938R6	2A414	SVB10813	563132	SVB101025
9936550890	MVB887R5	9936690820	MVB825R6	2A801	SVB10813	563132	SVB101050
9936550895	MVB900R5	9936700920	MVB920R7	3H2134	SVB17850	574046	SVB10888
9936550900	MVB900R5	9936750920	MVB920R7	12B307	SVB131225	596433	SVB10900
9936550910	MVB906R5	9952100870	SVB10875	13H1329	SVB10865	602319	SVB101150
9936550920	MVB915R5	9952110780	SVB10775	13H1448	SVB131125	603713	SVB13850
9936550940	MVB938R5	9952110808	SVB10800	13H1840	SVB131075	611612	SVB131000
9936550950	MVB950R5	9952110839	SVB10840	13H3726	SVB101050	613602	SVB101225
9936550960	MVB970R5	9952110843	SVB10840	13H3820	SVB10888	614106	SVB13925
9936550970	MVB970R5	9952110851	SVB10850	13H389	SVB10813	614670	SVB131000
9936551000	MVB1000R5	9952110853	SVB10850	13H4366	SVB10888	2014034	SVB101050
9936551050	MVB1050R5	9952110860	SVB10850	13H4583	SVB10888	46510585A	SVB10740
9936551100	MVB1100R5	9952110873	SVB10875	13H4706	SVB10850	88156489	SVB101100
9936551110	MVB1110R5	9952110880	SVB10875	13H480	SVB131150	AAU3550	SVB10800
9936551120	MVB1120R5	9952110887	SVB10888	13H503	SVB10925	AAU3577	SVB10825
9936551130	MVB1135R5	9952110889	SVB10888	13H5373	SVB10825	AAU8072	SVB10875
9936551210	MVB1215R5	9952110897	SVB10900	13H589	SVB10813	ADU4236	SVB10825
9936551300	MVB1300R5	9952110902	SVB10900	13H6869	SVB101050	ADU6528	SVB10940
9936560970	MVB970R5	9952210808	SVB13825	13H7104	SVB101175	ADU8912	SVB10710
9936561140	MVB1141R5	9952210848	SVB13850	13H760	SVB101113	ADU9401	SVB101050
9936570820	MVB825R5	9952210890	SVB13900	13H7975	SVB101050	AEA489	SVB10900
9936570840	MVB836R5	9952210892	SVB13900	13H8309	SVB10888	AEC932	SVB101113
9936570880	MVB875R5	9952210900	SVB13900	13H8310	SVB10900	AEH473	SVB10975
9936570980	MVB970R5	9952210901	SVB13900	13H8389	SVB10813	AEH621	SVB10975
9936571090	MVB1090R5	9952210904	SVB13900	13H859	SVB10813	AEJ63	SVB10850
9936571100	MVB1100R5	9952210911	SVB13925	13H8673	SVB10840	AEJ101	SVB10840
9936571110	MVB1110R5	9952210913	SVB13925	13H923	SVB10900	CAM7910	SVB10950
9936571120	MVB1120R5	9952210918	SVB13925	13H924	SVB10940	CAM9989	SVB10710
9936571190	MVB1188R5	9952210925	SVB13925	13H9620	SVB10950	CDU2749	TB295
9936571290	MVB1285R5	9952210926	SVB13925	17D29	SVB131175	CFB10825	SVB10825
9936580820	MVB825R5	9952210934	SVB13950	17H760	SVB101100	DBP4131	TB203
9936580840	MVB836R5	9952210938	SVB13950	2614A026	SVB10925	DBP9289	TB203
9936580870	MVB870R4	9952210942	SVB13950	13405PP0004	TB354	ECP244	TB312
9936580890	MVB887R5	9952210951	SVB13950	14400P14004	TB378	ERC0026	SVB131175
9936580910	MVB906R5	9952210958	SVB13950	14400P4500	TB353	ERC304	SVB10913
9936580920	MVB915R5	9952210960	SVB13975	14400P45000	TB353	ERC0400	SVB13850
9936580970	MVB970R5	9952210964	SVB13975	14400P45010	TB353	ERC657	SVB13925
9936581030	MVB1030R5	9952210976	SVB13975	14400PH7004	TB312	ERC675	SVB13925
9936581090	MVB1090R5	9952210980	SVB13975	31110PA13420	SVB10950	ERC1347	SVB13850
9936581100	MVB1100R5	9952211159	SVB131150	56992PL20030	SVB101075	ERC1742	SVB131050
9936581110	MVB1110R5	9952211159	SVB131175	56992PL26610	SVB101075	ERC2774	SVB13850
9936581120	MVB1120R5	9952211180	SVB131175	56992PP2E010	SVB10888	ERC4272	SVB13800
9936581130	MVB1135R5	9952211192	SVB131200	151209	SVB10913	SRC5146	SVB13750
9936581190	MVB1188R5	9952211218	SVB131225	151515	SVB10900	ERC5836	SVB101125
9936581210	MVB1215R5	9952211232	SVB131225	156489	SVB101100	ERC6072	SVB13925
9936581220	MVB1225R5	9952211243	SVB131250	201403	SVB101050	ERC6504	SVB101025
9936590890	MVB887R5	9952211256	SVB131250	212683	SVB101125	ERC6886	SVB101025
9936590910	MVB906R5	9952211275	SVB131250	214239	SVB101100	ERC8852	SVB10775
9936591090	MVB1090R5	9952211363	SVB131375	214239	SVB101113	ERC8938	SVB101050
9936591110	MVB1110R5	9952211390	SVB131400	214303	SVB101025	ERR0810	SVB131025
9936591120	MVB1120R5	9952211920	SVB13925	214314	SVB101113	ERR1092	TB478
9936591240	MVB1240R5	9952311037	SVB171055	214325	SVB101100	ERR2073	SVB10675
9936601050	MVB1050R6	9952311046	SVB171055	214830	SVB101125	ETC4266	SVB10710
9936621040	MVB1035R6	9952311176	SVB171205	216632	SVB10888	ETC4267	SVB10675
9936621050	MVB1050R6	9952311198	SVB171205	217391	SVB101100	ETC4272	SVB13800
9936631040	MVB1035R6	90910020003	SVB13950	217607	SVB10950	ETC4705	SVB10675
9936631040	MVB1045R6	993670092083	MVB920R7	219560	SVB10813	ETC5815	SVB13725
9936631820	MVB1820R6	MN195737	MVB906R5	247920	SVB10913	ETC7394	SVB101215
9936650820	MVB825R6	SU00100085	TB631	247939	SVB10950	ETC7469	SVB10610
9936650940	MVB938R6	SU00100544	TB720	511963	SVB10950	ETC7899	SVB10675
9936670820	MVB825R6	SU00100545	TBK230	513907	SVB10888	ETC7939	SVB101025
9936671050	MVB1050R6	TRIUMPH		522704	SVB10825	ETC8550	TB365
9936680730	MVB730R6	1G2716	SVB10900	524200	SVB101050	ETC9002	SVB131200
9936680820	MVB825R6	1H1001	SVB10900	527288	SVB101050	ETC9009	SVB131350







OE		OE		OE		OE	
...TRIUMPH		...TRIUMPH		...TRIUMPH		...VAUXHALL	
ETC9019	SVB131175	GFB252	SVB10825	LHN10013	TB560	1340007	SVB10888
ETC9080	SVB13875	GFB253	SVB10840	LHN10015	TB560	1340510	MVB1865R6
FDU1464	TB272	GFB255	SVB10950	LHN10016	TB367	1340527	MVB2120R6
FDU1466	TB317	GFB258	SVB101050	LHN100040	TB650	1340600	MVB1250R6
GCB10700	SVB10700	GFB259	SVB13925	LHN100310B	TB560	1340601	MVB1588R6
GCB10706	SVB10710	GFB260	SVB10710	LHN100390	TB534	1340603	MVB960R4
GCB10715	SVB10710	GFB262	SVB10975	LHN100400	TB547	1340604	SVB171055
GCB10813	SVB10813	GFB272	SVB10940	LHN100560	TB640	1340605	SVB101025
GCB10825	SVB10825	GFB273	SVB10875	LHN100760	TB651	1340606	SVB171055
GCB10838	SVB10840	GFB303	SVB131000	MVF100040	TB650	1340607	MVB1795R6
GCB10914	SVB10925	GFB357	SVB101050	PQS10037	SVB10740	1340608	MVB1904R6
GCB10937	SVB10940	GFB362	SVB10710	RKC5233	SVB10925	1340610	SVB10750
GCB10950	SVB10950	GFB369	SVB101075	TCK0366	SVB10900	1340611	MVB1815R5
GCB50765	SVB10750	GFB370	SVB101075	TKC386	SVB10900	1340612	SVB10913
GFB101	SVB10925	GFB376	SVB10700	TKC1616	SVB101100	1340613	MVB1725R6
GFB102	SVB10813	GFB700	SVB10888	TKC2165	SVB101100	1340614	MVB1904R6
GFB103	SVB10900	GFB701	SVB10940	TKC2444	SVB13925	1340615	MVB2265R6
GFB104	SVB10825	GFB10706	SVB10710	TKC2802	SVB10940	1340616	MVB1805R6
GFB105	SVB101113	GFB10725	SVB10710	TKC6621	SVB101100	1340617	MVB1460R5
GFB120	SVB10865	GFB10775	SVB10775	TRA1016J	SVB10975	1340618	MVB1530R6
GFB121	SVB10850	GFB10813	SVB10800	UAM1058	SVB10700	1340619	MVB890R6
GFB122	SVB101113	GFB10813	SVB10813	UE31113RR	SVB101275	1340620	MVB1725R6
GFB122	SVB101125	GFB10825	SVB10825	UE31855RR	SVB10975	1340621	MVB1725R6
GFB124	SVB101025	GFB10838	SVB10840	WAM2804	TB234	1340622	SVB10925
GFB124	SVB101050	GFB10875	SVB10875	XHM460	TB312	1340623	SVB131000
GFB127	SVB10888	GFB10900	SVB10900	UAZ		1340624	SVB131025
GFB128	SVB131075	GFB10950	SVB10950	451M1308020	SVB101050	1340625	MVB1904R6
GFB136	SVB10975	GFB10975	SVB10975	9681308020	SVB10940	1340626	MVB1805R6
GFB142	SVB101100	GFB11044	SVB101050	VAUXHALL		1340627	MVB1805R6
GFB144	SVB101275	GFB11065	SVB101050	636227	TB656	1340628	MVB1360R5
GFB145	SVB10975	GFB20864	SVB13850	636228	TB508	1340629	MVB1225R5
GFB147	SVB131175	GFB21075	SVB131075	636352	TB413	1340630	MVB1360R5
GFB165	SVB101050	GFB50949	SVB10950	636366	TB413	1340631	MVB1225R5
GFB168	SVB101025	GFB60825	SVB10825	636372	TB336	1340635	MVB1215R5
GFB170	SVB101125	GFB60838	SVB10840	636561	TB336	1340636	MVB1680R5
GFB176	SVB10888	GFB60937	SVB10940	636566	TB336	1340637	MVB938R5
GFB176	SVB10900	GFB61038	SVB101050	636568	TB508	1340638	MVB1855R6
GFB182	SVB10888	GTB1208	TB312	636569	TB509	1340639	MVB1875R6
GFB183	SVB10825	GTB1233	TB317	636570	TB393	1340640	MVB885R4
GFB183	SVB10840	GTB1237	TB272	636571	TB481	1340641	MVB1360R5
GFB185	SVB10813	GTB1238	TB295	636573	TB783	1340642	MVB1225R5
GFB189	SVB131075	GTB1238XS	TB295	636575	TB780	1340643	MVB1530R6
GFB192	SVB10825	GTB1253	TB234	636576	TB509	1340644	MVB890R6
GFB192	SVB10840	GTB1253XS	TB234	636579	TB481	1340645	MVB1460R5
GFB193	SVB10813	GTB1283XS	TB295	636728	TBK091	1340646	MVB1805R6
GFB195	SVB10825	GTB1289	TB367	949602	MVB2188R8	1340647	MVB1904R6
GFB196	SVB10888	GTB1290	TB378	950356	SVB10875	1340648	MVB1725R6
GFB197	SVB10840	GTB1291	TB353	950357	SVB101075	1340649	MVB2020R6
GFB205	SVB10950	GTB1292	TB354	950358	SVB10875	1340651	MVB1865R6
GFB206	SVB10950	GTB1293XS	TB450	950361	SVB10850	1340652	MVB1680R5
GFB209	SVB101100	GTB1497XS	TB640	950362	SVB10825	1340654	SVB171055
GFB210	SVB10840	GTB2003	TB477	950363	SVB10760	1340655	SVB10990
GFB211	SVB101225	GTB2004	TB513	950364	SVB10813	1340657	MVB1255R5
GFB212	SVB10950	GTB2005	TB353	950365	SVB10800	1340658	MVB1215R5
GFB213	SVB101100	GTB2005XS	TB353	950366	SVB10950	1340660	MVB1030R5
GFB214	SVB10913	GTB2006	TB457	950367	SVB10813	1340661	MVB875R5
GFB215	SVB131175	GTB2016XS	TB317	950368	SVB10825	1340662	MVB1588R6
GFB216	SVB13850	GTB2017XS	TB534	950370	SVB131375	1340663	MVB1904R6
GFB243	SVB131075	GTB2018XS	TB547	950371	SVB10813	1340664	MVB1805R6
GFB246	SVB101050	GTB2019XS	TB650	950372	SVB10690	1340665	MVB1875R6
GFB248	SVB101100	GTB9003XS	TB534	950373	SVB131450	1340666	MVB1865R6
GFB249	SVB10950	GTB9005	TB651	950375	SVB131450	1340667	MVB1030R5
GFB250	SVB10950	IG2716	SVB10900	950379	SVB10813	1340668	MVB875R5
GFB251	SVB10813	IH1001	SVB10900	1312097	SVB101000	1340669	MVB875R5





OE		OE		OE		OE	
...VAUXHALL		...VAUXHALL		...VAUXHALL		...VAUXHALL	
1340671VBELT	SVB10900	1854733	MVB2280R6	5636371	TB481	9112309	TB654
1340674	MVB1030R5	1854736	MVB800R4	5636372	TB524	9117585	MVB1215R5
1340675	MVB875R5	1855700	MVB2050R6	5636373	TB638	9117586	MVB1215R5
1340677	MVB1030R5	1855750	MVB2050R6	5636374	TB508	9117587	MVB1680R5
1340678	MVB875R5	2688824	SVB10913	5636375	TB436	9117588	MVB1680R5
1340680	SVB10950	3009003	SVB10875	5636376	TB749	9117589	MVB938R5
1340681	SVB13925	3012097	SVB101000	5636402	TB740	9117590	MVB938R5
1340682	SVB13900	3013009	SVB10913	5636405	TB750	9118367	MVB800R4
1340703	SVB10900	3013010	SVB10925	5636436	TB741	9118611	MVB1360R5
1340704	SVB10888	3013021	SVB10925	5636452	TB741	9118612	MVB1225R5
1340709	SVB10925	3013022	SVB10900	5636561	TB780	9118613	MVB1530R6
1340713	SVB10925	4290170	SVB10750	5636562	TB508	9118614	MVB890R6
1340714	SVB10913	4291734	SVB13900	5636563	TB783	9118616	MVB1460R5
1340718	SVB10960	4291887	SVB131025	5636564	TB638	9118617	MVB1805R6
1340720	SVB101000	4294762	SVB131000	5636565	TB780	9118618	MVB1904R6
1340721	MVB1015R5	4295780	SVB10665	6304930	SVB10975	9118619	MVB1725R6
1340723	SVB101025	4300241	SVB131375	6315516	SVB10940	9118620	MVB2020R6
1340724	MVB970R5	4300521	SVB171055	6322716	SVB10925	9118624	MVB1865R6
1340726	SVB10690	4304339	SVB171055	6340602	MVB1995R6	9118722	MVB1680R5
1340727	SVB13925	4401601	TB545	6340603	MVB1875R6	9120501	TBK091
1340728	MVB1460R5	4401649	MVB1137R6	6340605	MVB1450R5	9121108	MVB1150R7
1340729	SVB10925	4402116	MVB1137R6	6340606	MVB1550R5	9128500	TB481
1340730	SVB10940	4402599	MVB1130R6	6340613	MVB1370R5	9128722	TB524
1340732	SVB101000	4402638	TB654	6340615	MVB1180R6	9128724	TB780
1340734	SVB10940	4403027	TB368	6340617	MVB1270R6	9128725	TB508
1340735	SVB10960	4403471	MVB850R6	6340618	MVB1600R6	9128726	TB783
1340736	MVB985R5	4403472	MVB870R6	6340625	MVB1625R6	9128952	MVB1215R5
1340737	SVB101025	4404042	MVB870R6	6340626	MVB1215R5	9129060	TB638
1340738	SVB10925	4404309	TB654	6340627	MVB1215R5	9129061	TB647
1340739	SVB10900	4405275	MVB1150R7	6340628	SVB13925	9129460	MVB1225R5
1340742	MVB1904R6	4408352	MVB1120R5	6340632	SVB10913	9129465	MVB1795R6
1340743	MVB1725R6	4408392	TB652	6340651	SVB101000	9129468	MVB1904R6
1340745	MVB1795R6	4409473	TB653	6340656	MVB938R5	9160333	MVB1200R5
1340746	MVB1530R6	4409485	TBK275	6340666	MVB1369R6	9160334	MVB860R6
1340747	MVB890R6	4418675	MVB1788R7	6340671	MVB1250R6	9160356	MVB838R6
1354707	SVB13875	4430217	MVB1833R6	6352976	SVB10960	9161131	TB368
1606189	TBK103	4430891	TBK275	6355813	SVB10925	9161179	TB558
1606190	TBK260	4500033	MVB1200R5	6355814	SVB10975	9162107	TB102
1606191	TBK261	4500034	MVB860R6	6376165	SVB101000	9192568	MVB1255R5
1606192	TBK261	4500056	MVB838R6	6376167	SVB10940	9194660	MVB1215R5
1606193	TBK111	4500831	TB368	6376167	SVB10950	9195191	MVB1030R5
1606197	TBK028	4500879	TB558	6376168	SVB10975	9195192	MVB875R5
1606262	TBK240	4501807	TBK102	6376385	SVB101000	9196546	MVB1865R6
1606274	TBK260	4506086	TB710	7135386	SVB10990	9196547	MVB1865R6
1606281	TBK103	4506181	MVB1795R6	7169559	SVB101075	9198522	MVB1150R6
1606369	TBK008	4506189	MVB1150R6	7180685	SVB10940	9201528	TB710
1854704	SVB10888	4805335	TB800	7180685	SVB10950	9201679	MVB1030R5
1854706	SVB10790	4805514	MVB2063R6	7203068	SVB10960	9201688	MVB875R5
1854707	SVB13875	4808188	MVB1885R6	8816645	SVB10925	9201722	MVB1030R5
1854708	MVB2225R6	5636344	TB790	8825657	SVB10950	9201723	MVB875R5
1854710	SVB10790	5636350	TB524	8825967	SVB10960	9201832	SVB13900
1854711	SVB10888	5636351	TB508	8835203	SVB10950	9201850	MVB1795R6
1854712	SVB10875	5636354	TB481	8835402	SVB10913	09292427	SVB10888
1854713	MVB2271R6	5636355	TB509	8851716	SVB10950	09292427	SVB10900
1854714	MVB2265R6	5636356	TB336	8851717	SVB10913	9960524	SVB10888
1854715	MVB800R4	5636357	TB780	9109601	TB545	24413292	MVB1904R6
1854718	SVB10790	5636358	TB783	9109649	MVB1137R6	24413293	MVB1805R6
1854722	MVB775R4	5636359	TB524	9110116	MVB1137R6	24413294	MVB1875R6
1854723	MVB2265R6	5636361	TB508	9110599	MVB1130R6	24422964	TB741
1854726	SVB131500	5636362	TB780	9110638	TB654	24435940	MVB1030R5
1854727	SVB131500	5636363	TB783	9111027	TB368	24451895	TB638
1854728	MVB2020R6	5636364	TB336	9111471	MVB850R6	24466972	MVB1030R5
1854729	SVB131250	5636369	TB647	9111472	MVB870R6	55185077	MVB1180R6
1854730	SVB131325	5636370	TB524	9112042	MVB870R6	55185078	MVB1318R6







OE		OE		OE		OE	
...VAUXHALL		...VAUXHALL		...VAUXHALL		...VAUXHALL	
55350420	MVB1450R5	90444485	SVB10790	91126381	MVB1530R6	94218574	SVB131025
55350421	MVB1550R5	90444486	SVB10813	91126382	MVB890R6	94218575	SVB131375
90006259	SVB10875	90444488	SVB10690	91126384	MVB1460R5	94222880	SVB13900
90006263	SVB10888	90448002	MVB2265R6	91126385	MVB1805R6	94232287	SVB10760
90006266	SVB10925	90448698	SVB10900	91126386	MVB1904R6	94240372	SVB171055
90006267	SVB10913	90466255	SVB10913	91126387	MVB1725R6	94256977	SVB10665
90076999	SVB101075	90466262	TB509	91126388	MVB2020R6	94257037	SVB131000
90088832	SVB10875	90466524	MVB1904R6	91126402	MVB1865R6	94333098	SVB10950
90091742	SVB10888	90467131	MVB1725R6	91126403	MVB1680R5	94334987	SVB131250
90091743	SVB10900	90469984	TB508	91131979	MVB1865R6	94337004	SVB13925
90156794	SVB10825	90469985	TB783	91132010	MVB1030R5	94382105	SVB101025
90169079	SVB10960	90469986	TB509	91140570	SVB10825	94382106	MVB960R4
90169080	SVB10925	90469987	TB509	91142246	SVB10875	94382107	MVB800R4
90169081	SVB10875	90486316	MVB890R6	91145735	SVB10750	94385561	TB413
90169084	SVB10850	90499525	TB524	91145737	SVB13900	94440010	SVB131500
90169195	SVB10925	90500227	MVB1725R6	91150005	MVB1725R6	94442970	SVB131500
90183427	SVB10888	90500228	MVB1904R6	91151716	MVB1805R6	94449169	TB522
90183440	SVB10913	90500354	MVB2265R6	91153769	MVB2188R8	94449307	TB413
90194098	SVB10760	90500360	TB481	91158702	TB653	94452904	SVB131025
90194995	SVB10813	90501384	MVB1460R5	91158706	TBK275	94482166	SVB131450
90215247	SVB10790	90501385	MVB2265R6	91159962	MVB1120R5	96440343	TB800
90231797	SVB101000	90501386	MVB1725R6	91159999	TB652	96440421	MVB2063R6
90233194	MVB1015R5	90502286	SVB10925	92061744	MVB2050R6	96628792	MVB1885R6
90271857	SVB101000	90502734	MVB1904R6	92061745	MVB2050R6	97016326	TB393
90280872	SVB10800	90502735	MVB1805R6	92062969	TB524	97043551	SVB171055
90281901	SVB101025	90509315	MVB1815R5	92063403	MVB1855R6	97062085	SVB10665
90285678	MVB2225R6	90509751	MVB775R4	92063918	TB508	97062613	SVB171055
90285679	MVB1460R5	90510025	SVB10913	92063944	TB524	97062913	SVB171055
90299369	SVB13875	90510253	MVB1805R6	92065902	TB524	97074109	SVB13925
90299370	SVB10690	90510610	MVB1530R6	93161478	TBK275	97119226	SVB131000
90299503	MVB970R5	90510611	MVB890R6	93172395	MVB1995R6	97119226	SVB131025
90351803	SVB10913	90528761	MVB2020R6	93172396	MVB1995R6	97130560	MVB2280R6
90352613	SVB10813	90529809	TB647	93172397	MVB1875R6	97136321	TB436
90352615	SVB10900	90529914	MVB1875R6	93172398	MVB1875R6	97143724	TB749
90352928	SVB10940	90530286	TB508	93174119	TBK103	97176245	SVB10990
90352931	SVB10790	90530598	TB509	93174120	TBK260	97186395	MVB1250R6
90353137	SVB10925	90530599	TB481	93174260	TBK261	97186396	MVB1588R6
90353179	TB336	90531677	TB336	93174261	TBK261	97188281	SVB171055
90354782	TB336	90531678	TB336	93174262	TBK111	97212727	TB656
90397190	SVB10925	90531679	TB780	93174266	TBK028	97212728	TB656
90409610	SVB101000	90531680	TB780	93177561	MVB1370R5	97227192	TB740
90409781	MVB2271R6	90531681	TB783	93177562	MVB1370R5	97229071	MVB1588R6
90409782	MVB1904R6	90531682	TB783	93180218	TBK240	97229277	TB750
90409800	SVB10940	90531857	TB647	93180219	TBK260	97232826	MVB1625R6
90410223	TB336	90531858	TB638	93180815	TB741	97232875	MVB1270R6
90410316	MVB985R5	90531966	MVB1360R5	93181316	MVB1215R5	97714044	SVB131450
90410386	SVB10888	90531967	MVB1225R5	93181703	SVB13925	98014186	TB656
90410387	SVB10960	90541338	MVB1805R6	93181708	SVB10913	98419390	TB368
90410700	MVB1725R6	90542746	MVB1360R5	93182238	MVB1225R5	1136713010	SVB131450
90410771	TB481	90542747	MVB1360R5	93182256	SVB10813	7700116058	TB654
90411009	SVB101025	90542748	MVB1225R5	93182259	SVB101000	8200059423	MVB850R6
90411028	MVB1795R6	90542749	MVB1225R5	93182264	MVB938R5	8200059425	MVB870R6
90411770	TB508	90570371	TB508	93183572	TBK103	8941751700	SVB13875
90411775	TB509	90571070	MVB1904R6	93185023	MVB1306R6	8942185750	SVB131375
90411777	TB783	90571757	MVB885R4	93185756	MVB2120R6	8942322872	SVB10760
90412115	SVB10913	90573797	MVB938R5	93188126	TBK008	8943330980	SVB10950
90412115	SVB10925	90581642	MVB1865R6	93195485	MVB1788R7	8943330981	SVB10950
90412711	TB780	91001745	SVB10888	93891553	SVB10750	8943370040	SVB13925
90412745	MVB1530R6	91007299	SVB10888	93891618	SVB13900	8943855610	TB413
90412885	MVB890R6	91039703	SVB10940	93891628	SVB131025	8944503950	SVB131450
90442073	SVB10925	91056226	SVB10940	94029958	SVB131375	8944529040	SVB131025
90444421	MVB1530R6	91112347	SVB10750	94108204	SVB131325	8970435510	SVB171055
90444422	MVB1530R6	91126379	MVB1360R5	94141721	SVB131025	8970741090	SVB13925
90444423	MVB1795R6	91126380	MVB1225R5	94161841	SVB171055	8972127270	TB656

OE		OE		OE		OE	
...VAUXHALL		...VOLVO		...VOLVO		...VOLVO	
8972328750	MVB1270R6	958300	SVB10750	966904	SVB10875	975093	SVB101025
11282245848	MVB1815R5	958302	SVB10800	966905	SVB10888	975093	SVB121040
64552245451	MVB775R4	958305	SVB10875	966909	SVB10940	976115	SVB101250
VOLVO		958307	SVB10925	966910	SVB10950	976411	SVB10888
669N8620BB	MVB1200R6	958309	SVB10975	966912	SVB10975	976483	SVB10950
185002	SVB10940	958312	SVB101050	966913	SVB10990	976485	SVB101125
185124	SVB13710	958313	SVB101075	966923	SVB101237	976494	SVB101350
271705	TB372	958325	SVB101375	966931	SVB101400	976496	SVB101428
271714	TB430	958326	SVB101400	966964	SVB10913	976535	SVB101250
271720	TB520	958345	SVB10750	966965	SVB10925	977221	SVB131350
271746	TB438	958347	SVB10800	966968	SVB10975	977317	SVB131250
271747	TB404	958352	SVB10925	966976	SVB101075	977319	SVB131300
271834	TB434	958354	SVB10975	966978	SVB101100	977320	SVB131400
271835	TB439	958358	SVB101075	966980	SVB101125	977321	SVB131425
271856	TB434	958359	SVB101100	966993	SVB101350	977322	SVB131450
271876	TB488	958360	SVB101125	967102	SVB13925	977323	SVB131500
271952	TB372	958369	SVB101350	967103	SVB13925	977387	SVB101400
272327	TB434	958484	SVB13850	967107	SVB13975	977572	SVB131250
272328	TB737	958487	SVB13925	967111	SVB131025	977573	SVB131400
272329	TB643	958489	SVB13975	967114	SVB131075	977731	SVB13950
272386	TB488	958493	SVB131075	967133	SVB131350	977759	SVB10840
272462	TB785	958502	SVB131300	967137	SVB131400	978379	SVB131175
272472	TB705	958503	SVB131325	967139	SVB131425	978383	SVB13900
274184	TB705	958504	SVB131350	967144	SVB131075	978397	SVB131175
274247	TB748	958506	SVB131400	967184	SVB131075	978407	SVB131175
274338	TB643	958525	SVB13750	967191	SVB131250	978710	SVB131075
274518	TB643	958545	SVB131250	967194	SVB131325	978716	SVB131085
274551	TB653	958547	SVB131300	967197	SVB131425	978722	SVB101125
274557	TBK275	958548	SVB131325	967199	SVB131450	978723	SVB101125
274562	TB472	958549	SVB131325	967201	SVB131500	978740	SVB131150
274602	MVB1200R6	958550	SVB131375	967202	SVB131500	979631	SVB13975
405073	SVB13610	958554	SVB131475	968296	SVB101000	979956	MVB1230R8
408559	SVB13825	960282	SVB10888	968296	SVB121015	980224	SVB10888
417550	SVB131450	960284	SVB10940	968326	SVB101175	980224	SVB12885
419250	SVB10888	960285	SVB10960	968425	SVB10913	981680	SVB121015
419407	SVB10888	960286	SVB10990	968425	SVB10925	1271828	MVB1613R6
419419	SVB10990	960287	SVB101010	968910	SVB101150	1271829	MVB1755R6
430174	SVB10875	960289	SVB101050	968934	SVB101075	1275725	MVB1420R6
460481	SVB10888	960296	SVB101237	968935	SVB101100	1275726	MVB1675R6
795088	SVB131150	960327	SVB10913	968936	SVB101100	1326288	TB297
950806	SVB10813	960459	SVB13925	969135	SVB131425	2717148	TB430
950809	SVB10940	960468	SVB131150	969474	SVB101275	3035750	SVB171320
950812	SVB101025	960475	SVB131325	969991	SVB131200	3136599	SVB101500
950813	SVB101050	960519	SVB131300	969992	SVB131200	3208961	SVB131000
950814	SVB101075	966381	SVB101050	973487	SVB101000	3210827	SVB101237
950815	SVB101100	966382	SVB101100	973487	SVB121015	3244271	SVB10865
950821	SVB101250	966385	SVB101250	973488	SVB101000	3244272	SVB10940
950825	SVB101350	966388	SVB131250	973488	SVB121015	3287514	MVB885R4
950826	SVB101375	966389	SVB131300	973489	SVB13975	3290730	SVB101215
950829	SVB101450	966390	SVB131325	973490	SVB131075	3298673	SVB101237
950832	SVB101525	966397	SVB131325	973534	SVB10800	3342138	MVB845R5
950845	SVB131000	966398	SVB131325	973535	SVB10850	3342860	MVB887R5
950848	SVB131075	966399	SVB131350	973537	SVB10913	3343106	MVB885R4
950859	SVB131350	966605	SVB131475	973537	SVB10925	3343720	TB256
950860	SVB131375	966693	SVB101050	973538	SVB10940	3411617	MVB1155R6
950861	SVB131400	966694	SVB101075	973539	SVB10950	3416012	MVB838R6
951684	SVB10840	966695	SVB101125	973541	SVB10975	3417142	MVB1560R6
951684	SVB10850	966702	SVB131375	973542	SVB10990	3434934	MVB1550R6
952144	SVB101350	966846	SVB131150	973543	SVB101010	3446588	MVB838R6
952148	SVB101450	966858	SVB131300	973544	SVB101237	3450074	MVB600R3
952248	SVB131025	966894	SVB10750	973545	SVB131425	3454404	MVB600R3
952259	SVB131300	966898	SVB10800	973547	SVB10875	3454405	MVB1550R6
952260	SVB131325	966902	SVB10850	973548	SVB13925	3463763	TB431
952261	SVB131350	966903	SVB10850	973982	SVB10925	3473195	MVB1155R6







OE		OE		OE		OE	
...VOLVO		...VOLVO		...VOLVO		...VW	
3473196	MVB838R6	30616942	MVB1120R5	9650686080	MVB1215R6	07K145933G	MVB938R5
3473197	MVB600R3	30621318	MVB1795R6	MD304887	MVB1345R5	7M0145271	SVB12670
3473198	MVB1550R6	30621589	TBK275	MD319023	TB684	7M0145271A	SVB10750
3474598	MVB600R3	30623381	MVB1120R5	MD343575	MVB775R4	7M0145271A	SVB12760
3485927	MVB1155R6	30637495	MVB975R6	VW		021145933	MVB1360R7D
3507651	TB372	30637504	MVB795R6	00A260849	MVB2205R6	021145933A	MVB1285R7
3507652	TB438	30681318	MVB1135R5	00A903137	MVB2100R6	021145933B	MVB1285R7
3507704	TB404	30711066	TBK302	1K0260849A	MVB1100R6	021145933C	MVB1285R7
3514323	TB520	30711607	TB472	1K0260849B	MVB1100R6	021145933D	MVB1360R7D
3517995	TB372	30731772	TB748	1L0198002A	TBK026	021145933G	MVB1285R7
3531358	TB430	30731808	MVB1838R6D	2D0145933A	MVB2120R6	021145933H	MVB1360R7D
3547459	TB297	30731809	MVB1850R6D	2D0260849	MVB2215R6	021145933P	MVB1360R7D
3547573	MVB1625R6	30731861	MVB1838R6D	03C260849A	MVB1700R6	021903137A	SVB10960
3547607	MVB1625R6	30731937	MVB2196R6	03C903137A	MVB1600R6	022145933AG	MVB1613R6
3547608	MVB1270R6	30751288	MVB1200R6	03D145933	MVB1450R6	022145933F	MVB1285R7
6842469	TB430	30757007	MVB1200R6	03D145933AD	MVB1875R6	022145933G	MVB1325R6D
6849008	MVB1625R6	30757154	TBK099	03D145933S	MVB1460R5	022145933H	MVB1260R6
6849009	MVB1270R6	30757154	TBK114	03E260849A	MVB1875R6	022145933N	MVB1238R6
8029802	SVB13950	30757514	MVB1120R5	03G109119	TB743	022145933T	MVB1625R6
8627228	MVB1850R6D	30777408	TBK275	03G198119	TBK262	023145271	SVB10865
8627484	TB643	30777409	TBK099	03G903137A	MVB946R6	023145271B	SVB10865
8631557	TB748	30777409	TBK114	03G903137B	MVB1050R6	023260849	SVB131325
8642479	MVB1137R6	30777530	MVB845R5	03G903137F	MVB1613R6	023903137A	SVB101075
8642562	MVB1642R6	30777531	MVB887R5	03G903137H	MVB825R6	023903137C	SVB101140
8653649	TBK338	30777660	MVB1215R6	03L903137	MVB1065R6	023903137E	SVB131275
8653650	TB742	30809320	MVB1137R6	06A109119C	TB552	023903137H	SVB101140
8670054	TB748	30819189	MVB1642R6	06A109119D	TB552	025260849B	SVB131150
8670068	MVB1215R6	30819383	TB258	06A145933D	MVB1125R6	025903137A	SVB101100
8670156	MVB1306R6	30864046	TB545	06A145933L	MVB925R6	025903137B	SVB101075
8692811	MVB887R5	30865077	TB546	06A198119	TBK100	025903137E	SVB101100
8692955	MVB845R5	30873480	MVB1345R5	06A198119A	TBK101	026109119B	TB463
9135032	TB439	30873534	MVB775R4	06A198119B	TBK115	026145271	SVB10735
9135450	TB520	30873950	TB684	06A260849B	MVB1200R6D	026198119	TBK309
9135553	TB488	30883810	TB653	06A260849C	MVB1200R6D	026903137C	SVB10950
9135733	TB434	30883832	MVB1795R6	06A260849E	MVB1200R6D	027109119A	TB505
9135933	TB440	30889794	MVB1137R6	06A260849K	MVB1035R6	027109119B	TB505
9146117	MVB1250R6	31104600	TB705	06B109119A	TB554	027109119C	TB505
9146160	MVB1642R6	31216255	MVB1642R6	06B109119B	TB554	027903137	SVB10625
9146557	MVB1625R6	31251046	MVB1200R6	06B109119F	TB554	027903137A	SVB10865
9146844	MVB1250R6	31251305	MVB2215R6	06B198119	TBK115	027903137A	SVB12865
9146973	MVB1270R6	31251775	MVB795R6	06B198119A	TBK341	028109119AA	TB384
9179393	TB557	31272251	MVB1795R6	06B260849A	MVB855R4	028109119AC	TB657
9180593	TB785	31272339	MVB1795R6	06B903137	MVB1300R5	028109119D	TB384
9180701	MVB1550R6	046109119E	TB785	06B903137E	MVB1300R5	028109119G	TB384
9180702	MVB1795R6	074109119R	TB785	06D109119	TB745	028109119H	TB384
9180954	TB434	074130113E	TB557	06D109119B	TB753	028109119K	TB384
9186319	MVB1685R6	074130113J	TB557	06F198119A	TBK351	028109119M	TB384
9186352	MVB1740R6	075109119C	TB440	06F260849E	MVB1045R6	028109119N	TB657
9189146	TB737	312162555	MVB1642R6	06F260849L	MVB1050R6	028109119P	TB384
9189229	MVB1755R6	684121300	SVB131325	06F903137E	MVB900R6	028109119S	TB384
9202398	TB557	684121325	SVB131325	06J260849D	MVB1115R6	028145271G	SVB10725
9207919	MVB1760R6	684121425	SVB131425	6K0198001A	TBK087	028145271G	SVB12735
9207920	MVB1625R6	7400269672	SVB101100	6K0198001B	TBK086	028145271H	SVB10790
9434341	MVB1740R6	7700104652	TB545	6K0198001D	TBK088	028145271K	SVB10725
9440383	TB643	7700107305	TB546	6K0198002	TBK016	028145271K	SVB12735
9458376	MVB1838R6D	7700109601	TB653	6K0198004	TBK076	028145271L	SVB10790
9458411	MVB1755R6	7700109632	TB653	6K0198005	TBK024	028198119	TBK024
9465066	TB488	7700718261	MVB885R4	6L0198002	TBK119	028198119A	TBK025
9471799	MVB1838R6D	7700857325	TB431	6Q0260849	MVB1740R6	028198119B	TBK119
9471981	MVB1838R6D	7700865429	MVB1137R6	6Q0260849A	MVB1740R6	028198119C	TBK026
9497241	MVB1850R6D	7700869538	MVB1642R6	6Q0260849C	MVB1740R6	028198119D	TBK335
9515801	SVB131425	7700875585	TB258	6Q0903137A	MVB1088R6	028198119E	TBK305
9670068	MVB1215R6	8200058139	MVB1642R6	07K145933C	MVB925R5	028198119F	TBK112
10692015	SVB101225	8200542740	TB653	07K145933E	MVB1060R5	028198119G	TBK093





OE		OE		OE		OE	
...VW		...VW		...VW		...VW	
028260849D	MVB1150R6	036145933AT	MVB1080R6	044903137H	MVB1460R5	059198119	TBK348
028260849L	MVB1150R6	036145933B	MVB1125R6	044903137L	SVB10960	059198119A	TBK348
028260849N	MVB1150R6	036145933D	MVB1125R6	044903137M	SVB10960	059198119B	TBK348
028903137	SVB10925	036145933F	MVB1088R6	044903137R	MVB1875R6	059260849B	MVB1238R4
028903137AA	MVB925R6	036145933G	MVB1125R6	045109119D	TB726	059903137	SVB10875
028903137AD	MVB925R6	036145933H	MVB1550R6	045109119E	TB726	059903137AC	MVB2475R6
028903137AJ	MVB1588R6	036145933J	MVB1080R6	045109119L	TB726	059903137B	SVB10875
028903137AL	MVB1225R6	036145933M	MVB750R6	045260849	MVB1188R6D	059903137T	MVB2490R6
028903137AM	MVB925R6	036145933Q	MVB1125R6	045903137D	MVB1000R6	060145271	SVB10800
028903137AP	MVB1225R5	036198118E	TBK246	045903137E	MVB860R6	060903137	SVB101010
028903137AR	MVB1588R6	036198119A	TBK246	046109119E	TB785	061903137	SVB101140
028903137AS	MVB1050R6	036198119B	TBK263	046903137	SVB10900	062145271A	SVB10900
028903137B	MVB1045R6	036198119C	TBK246	047903137E	MVB1875R6	062145933	MVB1642R6
028903137BB	MVB1045R6	036198119E	TBK246	047903137F	MVB1488R6	062145933A	MVB1685R6
028903137C	SVB10975	037145271	SVB10665	048109119C	TB441	062260849	MVB2125R6
028903137E	SVB10975	037145271E	SVB10690	048109119D	TB506	062903137	MVB1995R6
028903137G	MVB925R6	037145271E	SVB12685	048109119G	TB441	063903137	SVB13900
028903137T	MVB1045R6	037145271F	SVB10750	049260849A	SVB13825	066145933J	MVB1325R6D
030109119AB	TB466	037145271F	SVB12760	049903137A	SVB10940	066145933K	MVB1260R6
030109119H	TB466	037145933	MVB1650R6	049903137A	SVB10950	068121039	SVB10600
030109119M	TB466	037145933A	MVB1755R6	049903137B	SVB10950	068121039B	SVB10650
030109119S	TB466	037145933B	MVB1650R6	049903137D	SVB10940	068121039C	SVB10610
030145933	MVB1100R6	037145933C	MVB1755R6	049903137E	SVB10950	068121039E	SVB10690
030145933E	MVB1065R6	037198119	TBK076	050903137	SVB10950	068121039G	SVB10610
030145933G	MVB1065R6	037260849	MVB1155R6	051198119	TBK086	068121039K	SVB10625
030145933K	MVB1080R6	037260849A	MVB1150R6	052903137	SVB10700	068121039K	SVB10635
030145933L	MVB1065R6	037260849B	MVB1150R6	052903137A	SVB10700	068121039L	SVB10840
030145933R	MVB1065R6	037260849C	MVB1155R6	052903137B	SVB10690	068121039M	SVB10900
030145933T	MVB1065R6	037903137B	MVB890R6	052903137F	SVB10675	068121039P	SVB10913
030198119A	TBK087	037903137C	MVB975R6	052903137F	SVB10690	068145271B	SVB10740
030198119B	TBK320	037903137D	MVB890R6	052903137H	SVB10675	068145271C	SVB10760
030903137AB	MVB750R6	037903137E	MVB890R6	052903137L	SVB10690	068145271E	SVB10650
030903137E	SVB12710	037903137F	MVB975R6	052903137M	SVB10675	068145271E	SVB12650
030903137K	MVB736R6	037903137G	MVB975R6	054903137	SVB10865	068260149A	SVB13825
030903137T	MVB750R6	037903137H	MVB1035R6	054903137	SVB12865	068260849	SVB13950
032109119F	TB467	038109119B	TB533	055131615A	SVB10825	068260849A	SVB13950
032109119G	TB467	038109119D	TB533	055260849	SVB131125	068260849B	SVB13950
032109119J	TB467	038109119L	TB680	055260849A	SVB101125	068260849D	SVB131250
032145933	MVB1180R6	038109119M	TB797	055260849B	SVB131050	068260849E	SVB131225
032145933AA	MVB1550R6	038109119N	TB680	055260849C	SVB131025	068260849G	SVB13950
032145933AB	MVB1538R6	038109119P	TB680	055260849E	SVB131025	068903137	SVB10735
032145933E	MVB1125R6	038109119R	TB797	055260849E	SVB131050	068903137A	SVB10875
032145933G	MVB1125R6	038109119S	TB680	055903137A	SVB10950	068903137AA	SVB10960
032145933Q	MVB1125R6	038198119	TBK225	055903137B	SVB101150	068903137AA	SVB12950
032145933R	MVB1550R6	038198119A	TBK270	055903137C	SVB10850	068903137AC	SVB10760
032145933S	MVB1125R6	038198119C	TBK270	055903137G	SVB10850	068903137AE	SVB131225
032145933T	MVB1180R6	038198119D	TBK107	055903173A	SVB10950	068903137AG	SVB10700
032198119	TBK088	038198119F	TBK116	056198119	TBK016	068903137AQ	SVB10700
034903137A	SVB10825	038903137E	MVB1660R6	056903137	SVB10950	068903137AR	SVB10960
035260849C	SVB131000	038903137G	MVB906R6	058109119A	TB464	068903137AR	SVB12950
035903137B	SVB10800	038903137H	MVB1432R5	058109119C	TB555	068903137AT	SVB10960
036109119AG	TB658	038903137J	MVB1660R6	058109119D	TB464	068903137B	SVB10875
036109119D	TB553	038903137L	MVB1180R6	058145271	SVB12528	068903137C	SVB10600
036109119H	TB553	038903137N	MVB1100R6	058198119	TBK330	068903137D	SVB10960
036109119HPDS	TB553	038903137R	MVB1137R6	058198119A	TBK332	068903137D	SVB12950
036109119M	TB658	038903137T	MVB1432R5	058198479	TBK331	068903137F	SVB10735
036109119P	TB634	044145271J	SVB10650	058260849	MVB855R4	068903137F	SVB10740
036109119Q	TB658	044145271J	SVB12650	058260849A	MVB855R4	068903137G	SVB10625
036145933AD	MVB1150R6	044145271K	SVB10650	058903137E	MVB1300R5	068903137L	SVB10875
036145933AG	MVB736R6	044145271K	SVB12650	059109119A	TB642	068903137M	SVB10875
036145933AJ	MVB1080R6	044260849B	MVB1588R6	059109119B	TB738	068903137Q	SVB10740
036145933AL	MVB870R6	044903137AE	MVB1065R6	059109119C	TB555	068903137R	SVB10740
036145933AR	MVB1370R6	044903137D	SVB10960	059109119D	TB760	068903137S	SVB10775
036145933AS	MVB1795R6	044903137G	MVB1550R6	059130113A	TB641	068903137T	SVB10960







OE		OE	
...VW		...VW	
068903137T	SVB12950	078109119H	TB556
069903137C	SVB10800	078109119J	TB556
070903137	SVB101175	078198119	TBK357
070903137A	SVB10700	078198479	TBK353
071145933D	MVB1660R6	078903137AP	MVB1760R6
071145933F	MVB1285R6	078903137BC	MVB1875R6
071145933H	MVB2373R6	078903137H	TB556
071145933M	MVB2373R6	079903137AA	MVB1110R5
074109119A	TB785	111903137B	SVB10900
074109119B	TB785	111903137C	SVB10900
074109119E	TB785	111903137D	SVB10900
074109119F	TB375	111903137E	SVB10900
074109119L	TB785	255272916	SVB131150
074109119R	TB785	311903137	SVB101050
074109243R	TB785	311903137A	SVB101000
074130113E	TB557	0499031372	SVB10950
074130113J	TB557	J1356854070	TB314
074145271F	SVB131050	J1356859066	TB314
074145271J	SVB10865	J9091602209	SVB131050
074145933AD	MVB1755R6	J9933110870	SVB10875
074145933AJ	MVB1690R6	J9933200830	SVB13825
074145933AL	MVB1350R6	J9933200870	SVB13875
074145933AR	MVB1755R6	J9933201040	SVB131050
074145933C	MVB1715R6	J9933210865	SVB13875
074145933G	MVB2063R6	J9933210870	SVB13875
074145933N	MVB1335R6	J9933211120	SVB131125
074145933P	MVB1715R6	J9933260865	SVB13875
074145933Q	MVB1350R6	J9936450830	MVB835R4
074145933T	MVB2145R6	J9936450840	MVB835R4
074260849AB	MVB2240R6	ZASTAVA	
074260849AC	MVB2225R6	4068295	SVB10725
074260849AD	MVB2215R6	4070393	SVB10725
074260849AE	MVB2215R6	4153752	SVB10950
074260849J	MVB2125R6	4153753	SVB10913
074260849L	MVB2240R6	4224377	SVB10825
074260849T	MVB2225R6	46641877	SVB10850
074903137AA	MVB1995R6	ZAZ	
074903137AB	SVB101075	9681308020	SVB10825
074903137AC	SVB101150	21083701720	SVB10710
074903137AF	SVB101150	2108370172001	SVB10710
074903137AH	SVB131125		
074903137AJ	SVB131175		
074903137AN	SVB131125		
074903137AP	MVB2080R6		
074903137AR	MVB2100R6		
074903137AS	MVB2080R6		
074903137AT	MVB2063R6		
074903137BA	MVB2080R6		
074903137BB	MVB2063R6		
074903137BC	MVB2120R6		
074903137J	SVB131275		
074903138	SVB131175		
075109119C	TB440		
075145271	SVB13800		
075260849	SVB13875		
076109119A	TB797		
076145107	SVB101025		
076145933	MVB1995R6		
076260849	MVB2585R6		
076260849B	MVB2585R6		
076903137	SVB10813		
077903137AB	MVB2365R7		
078109119C	TB556		
078109119G	TB556		

CONTITECH		CONTITECH		CONTITECH		CONTITECH	
2XAVX10X1100	SVB101100	4PK795	MVB800R4	4PK1230	MVB1230R4	5PK1135	MVB1135R5
3PK0495	MVB500R3	4PK800	MVB800R4	4PK1237	MVB1238R4	5PK1140	MVB1141R5
3PK538	MVB538R3	4PK805	MVB800R4	4PK1245	MVB1245R4	5PK1145	MVB1141R5
3PK560	MVB563R3	4PK805	MVB810R4	4PK1260	MVB1260R4	5PK1155	MVB1155R5
3PK600	MVB600R3	4PK815	MVB810R4	4PK1272	MVB1272R4	5PK1165	MVB1165R5
3PK630	MVB625R3	4PK825	MVB825R4	4PK1310	MVB1311R4	5PK1173	MVB1175R5
3PK630	MVB630R3	4PK830	MVB825R4	4PK1325	MVB1325R4	5PK1190	MVB1188R5
3PK648	MVB648R3	4PK836	MVB835R4	4PK1485	MVB1488R4	5PK1200	MVB1200R5
3PK648	MVB650R3	4PK841	MVB841R4	4PK1511	MVB1510R4	5PK1210	MVB1215R5
3PK670	MVB668R3	4PK845	MVB845R4	4PK1520	MVB1520R4	5PK1225	MVB1225R5
3PK675	MVB673R3	4PK850	MVB850R4	4PK1708	MVB1708R4	5PK1230	MVB1225R5
3PK690	MVB690R3	4PK855	MVB855R4	4PK1775	MVB1775R4	5PK1230	MVB1230R5
3PK715	MVB715R3	4PK855	MVB860R4	5PK575	MVB575R5	5PK1240	MVB1240R5
3PK735	MVB735R3	4PK856	MVB855R4	5PK688	MVB688R5	5PK1250	MVB1255R5
3PK760	MVB760R3	4PK856	MVB860R4	5PK698	MVB700R5	5PK1255	MVB1255R5
3PK760	MVB765R3	4PK860	MVB860R4	5PK710	MVB710R5	5PK1260	MVB1255R5
3PK775	MVB775R3	4PK865	MVB860R4	5PK715	MVB710R5	5PK1265	MVB1263R5
3PK785	MVB780R3	4PK875	MVB870R4	5PK725	MVB725R5	5PK1270	MVB1270R5
3PK785	MVB785R3	4PK875	MVB875R4	5PK736	MVB735R5	5PK1275	MVB1270R5
3PK815	MVB810R3	4PK884	MVB885R4	5PK768	MVB768R5	5PK1285	MVB1285R5
3PK815	MVB813R3	4PK884	MVB887R4	5PK775	MVB775R5	5PK1290	MVB1285R5
3PK820	MVB825R3	4PK885	MVB885R4	5PK790	MVB788R5	5PK1295	MVB1300R5
3PK825	MVB825R3	4PK885	MVB887R4	5PK800	MVB800R5	5PK1300	MVB1300R5
3PK830	MVB825R3	4PK890	MVB885R4	5PK813	MVB813R5	5PK1310	MVB1310R5
3PK835	MVB838R3	4PK890	MVB887R4	5PK825	MVB825R5	5PK1345	MVB1350R5
3PK850	MVB850R3	4PK895	MVB900R4	5PK830	MVB830R5	5PK1350	MVB1345R5
3PK855	MVB850R3	4PK900	MVB900R4	5PK836	MVB836R5	5PK1350	MVB1350R5
3PK875	MVB872R3	4PK905	MVB905R4	5PK847	MVB845R5	5PK1355	MVB1360R5
3PK890	MVB887R3	4PK910	MVB915R4	5PK847	MVB850R5	5PK1360	MVB1360R5
3PK915	MVB915R3	4PK915	MVB915R4	5PK850	MVB850R5	5PK1370	MVB1370R5
3PK935	MVB940R3	4PK920	MVB915R4	5PK865	MVB865R5	5PK1390	MVB1388R5
3PK945	MVB940R3	4PK920	MVB920R4	5PK869	MVB869R5	5PK1432	MVB1432R5
3PK960	MVB960R3	4PK925	MVB925R4	5PK875	MVB875R5	5PK1450	MVB1450R5
3PK975	MVB975R3	4PK935	MVB940R4	5PK884	MVB887R5	5PK1465	MVB1460R5
3PK1000	MVB1000R3	4PK938	MVB940R4	5PK890	MVB887R5	5PK1515	MVB1515R5
3PK1025	MVB1025R3	4PK945	MVB945R4	5PK900	MVB900R5	5PK1538	MVB1538R5
3PK1038	MVB1035R3	4PK945	MVB950R4	5PK905	MVB900R5	5PK1546	MVB1550R5
3PK1087	MVB1090R3	4PK950	MVB945R4	5PK906	MVB906R5	5PK1570	MVB1575R5
4PK545	MVB545R4	4PK950	MVB950R4	5PK915	MVB915R5	5PK1585	MVB1588R6
4PK590	MVB588R4	4PK962	MVB960R4	5PK920	MVB920R5	5PK1592	MVB1588R6
4PK611	MVB611R4	4PK970	MVB970R4	5PK925	MVB925R5	5PK1592	MVB1590R5
4PK635	MVB640R4	4PK975	MVB970R5	5PK934	MVB938R5	5PK1610	MVB1610R5
4PK640	MVB640R4	4PK975	MVB975R4	5PK940	MVB938R5	5PK1680	MVB1680R5
4PK648	MVB648R4	4PK985	MVB985R4	5PK950	MVB950R5	5PK1750	MVB1750R5
4PK665	MVB663R4	4PK990	MVB985R4	5PK954	MVB955R4	5PK1750	MVB1755R6
4PK673	MVB673R4	4PK1000	MVB995R4	5PK955	MVB950R5	5PK1765	MVB1765R5
4PK698	MVB698R4	4PK1000	MVB1000R4	5PK962	MVB960R5	5PK1815	MVB1815R5
4PK698	MVB700R4	4PK1000	MVB1005R4	5PK970	MVB970R5	5PK1885	MVB1885R5
4PK700	MVB700R4	4PK1015	MVB1015R4	5PK970	MVB975R5	5PK2020	MVB2025R5
4PK706	MVB706R4	4PK1020	MVB1020R4	5PK975	MVB975R5	5PK2030	MVB2025R5
4PK715	MVB715R4	4PK1028	MVB1025R4	5PK985	MVB985R5	5PK2060	MVB2060R5
4PK725	MVB725R4	4PK1045	MVB1040R4	5PK990	MVB985R5	5PK1815D1	MVB1815R5
4PK735	MVB735R4	4PK1045	MVB1045R4	5PK1000	MVB1000R5	5PK2060D1	MVB2060R5
4PK737	MVB735R3	4PK1054	MVB1050R4	5PK1010	MVB1015R5	6DPK1188	MVB1188R6D
4PK737	MVB735R4	4PK1063	MVB1065R4	5PK1015	MVB1015R5	6DPK1195D1	MVB1200R6D
4PK755	MVB747R4	4PK1075	MVB1080R4	5PK1025	MVB1030R5	6DPK1195D2	MVB1200R6D
4PK755	MVB755R4	4PK1080	MVB1080R4	5PK1030	MVB1030R5	6DPK1320	MVB1325R6D
4PK760	MVB763R4	4PK1090	MVB1090R4	5PK1030	MVB1035R5	6DPK1841D1	MVB1838R6D
4PK765	MVB763R4	4PK1100	MVB1100R4	5PK1040	MVB1035R5	6DPK1853	MVB1850R6D
4PK770	MVB775R4	4PK1110	MVB1110R4	5PK1040	MVB1040R5	6PK675	MVB675R6
4PK775	MVB775R4	4PK1110	MVB1115R4	5PK1054	MVB1050R5	6PK698	MVB698R6
4PK778	MVB775R4	4PK1125	MVB1125R4	5PK1090	MVB1090R5	6PK720	MVB715R6
4PK780	MVB775R4	4PK1165	MVB1165R4	5PK1100	MVB1100R5	6PK725	MVB730R6
4PK785	MVB790R4	4PK1190	MVB1190R4	5PK1110	MVB1110R5	6PK730	MVB730R6
4PK790	MVB790R4	4PK1213	MVB1215R4	5PK1120	MVB1120R5	6PK737	MVB736R6







CONTITECH		CONTITECH		CONTITECH		CONTITECH	
6PK745	MVB750R6	6PK1230	MVB1230R6	6PK1800	MVB1795R6	6PK2445	MVB2450R6
6PK751	MVB750R6	6PK1250	MVB1250R6	6PK1800	MVB1805R6	6PK2460	MVB2460R6
6PK795	MVB795R6	6PK1256	MVB1260R6	6PK1805	MVB1805R6	6PK2475	MVB2475R6
6PK800	MVB795R6	6PK1264	MVB1260R6	6PK1815	MVB1815R6	6PK2490	MVB2490R6
6PK820	MVB825R6	6PK1270	MVB1270R6	6PK1815	MVB1820R6	6PK2510	MVB2510R6
6PK825	MVB825R6	6PK1285	MVB1285R6	6PK1820	MVB1820R6	6PK2550	MVB2553R6
6PK836	MVB838R6	6PK1293	MVB1290R6	6PK1830	MVB1833R6	6PK2553	MVB2553R6
6PK850	MVB850R6	6PK1305	MVB1306R6	6PK1840	MVB1842R6	6PK2585	MVB2585R6
6PK858	MVB860R6	6PK1306	MVB1306R6	6PK1845	MVB1842R6	6PK2615	MVB2613R6
6PK862	MVB860R6	6PK1318	MVB1318R6	6PK1850	MVB1855R6	6PK2625	MVB2625R6
6PK869	MVB870R6	6PK1320	MVB1318R6	6PK1856	MVB1855R6	6PK2680	MVB2680R6
6PK875	MVB870R6	6PK1325	MVB1325R6	6PK1863	MVB1865R6	6PK1138D1	MVB1137R6
6PK875	MVB875R6	6PK1330	MVB1325R6	6PK1870	MVB1875R6	6PK1180D1	MVB1180R6
6PK880	MVB880R6	6PK1330	MVB1330R6	6PK1873	MVB1875R6	6PK1345D1	MVB1350R6
6PK884	MVB884R6	6PK1345	MVB1350R6	6PK1880	MVB1875R6	6PK1642D1	MVB1642R6
6PK890	MVB890R6	6PK1352	MVB1352R6	6PK1885	MVB1885R6	6PK1715D1	MVB1715R6
6PK900	MVB900R6	6PK1360	MVB1360R6	6PK1900	MVB1904R6	6PK1720D1	MVB1715R6
6PK906	MVB906R6	6PK1370	MVB1370R6	6PK1905	MVB1904R6	6PK1800D1	MVB1795R6
6PK915	MVB915R6	6PK1390	MVB1388R6	6PK1915	MVB1913R6	6PK1800D1	MVB1805R6
6PK923	MVB925R6	6PK1400	MVB1400R6	6PK1930	MVB1930R6	6PK1840D1	MVB1842R6
6PK935	MVB938R6	6PK1413	MVB1413R6	6PK1950	MVB1950R6	6PK1863D1	MVB1865R6
6PK948	MVB946R6	6PK1420	MVB1420R6	6PK1965	MVB1960R6	6PK1870D1	MVB1875R6
6PK950	MVB946R6	6PK1440	MVB1440R6	6PK1980	MVB1980R6	6PK2215D1	MVB2215R6
6PK962	MVB962R6	6PK1445	MVB1450R6	6PK2000	MVB1995R6	6PK2240D1	MVB2240R6
6PK976	MVB975R6	6PK1450	MVB1450R6	6PK2020	MVB2020R6	6PK2260D1	MVB2265R6
6PK986	MVB986R6	6PK1453	MVB1450R6	6PK2030	MVB2030R6	6PK2271D1	MVB2271R6
6PK995	MVB1000R6	6PK1460	MVB1460R6	6PK2050	MVB2050R6	6PK2380D1	MVB2380R6
6PK1000	MVB1000R6	6PK1460	MVB1460R6	6PK2055	MVB2050R6	6PK2390D1	MVB2390R6
6PK1010	MVB1015R6	6PK1468	MVB1469R6	6PK2065	MVB2063R6	6PK2415D1	MVB2415R6
6PK1015	MVB1015R6	6PK1469	MVB1469R6	6PK2080	MVB2080R6	6PK2460D1	MVB2460R6
6PK1020	MVB1015R6	6PK1470	MVB1469R6	6PK2100	MVB2100R6	6PK1720D2	MVB1715R6
6PK1025	MVB1025R6	6PK1488	MVB1488R6	6PK2115	MVB2120R6	6PK2260D2	MVB2265R6
6PK1030	MVB1025R6	6PK1515	MVB1513R6	6PK2120	MVB2120R6	6PK2271D2	MVB2271R6
6PK1030	MVB1035R6	6PK1530	MVB1530R6	6PK2125	MVB2120R6	6PK2260D3	MVB2265R6
6PK1038	MVB1035R6	6PK1548	MVB1550R6	6PK2125	MVB2125R6	7DPK1360	MVB1360R7D
6PK1045	MVB1045R6	6PK1555	MVB1550R6	6PK2135	MVB2135R6	7PK920	MVB920R7
6PK1045	MVB1050R6	6PK1560	MVB1560R6	6PK2140	MVB2145R6	7PK935	MVB935R7
6PK1050	MVB1050R6	6PK1564	MVB1560R6	6PK2145	MVB2145R6	7PK1035	MVB1035R7
6PK1060	MVB1065R6	6PK1570	MVB1570R6	6PK2150	MVB2145R6	7PK1080	MVB1083R7
6PK1065	MVB1065R6	6PK1580	MVB1580R6	6PK2160	MVB2160R6	7PK1088	MVB1083R7
6PK1070	MVB1065R6	6PK1590	MVB1588R6	6PK2170	MVB2170R6	7PK1090	MVB1090R7
6PK1080	MVB1080R6	6PK1605	MVB1600R6	6PK2190	MVB2190R6	7PK1093	MVB1090R7
6PK1084	MVB1088R6	6PK1610	MVB1613R6	6PK2196	MVB2196R6	7PK1113	MVB1115R7
6PK1095	MVB1100R6	6PK1623	MVB1625R6	6PK2205	MVB2205R6	7PK1125	MVB1125R7
6PK1100	MVB1100R6	6PK1635	MVB1635R6	6PK2215	MVB2215R6	7PK1175	MVB1180R7
6PK1105	MVB1105R6	6PK1642	MVB1642R6	6PK2225	MVB2225R6	7PK1220	MVB1200R7
6PK1110	MVB1115R6	6PK1653	MVB1650R6	6PK2240	MVB2240R6	7PK1240	MVB1240R7
6PK1115	MVB1115R6	6PK1660	MVB1660R6	6PK2245	MVB2250R6	7PK1290	MVB1285R7
6PK1120	MVB1125R6	6PK1675	MVB1675R6	6PK2250	MVB2250R6	7PK1388	MVB1388R7
6PK1125	MVB1125R6	6PK1680	MVB1675R6	6PK2257	MVB2257R6	7PK1400	MVB1400R7
6PK1125	MVB1130R6	6PK1685	MVB1690R6	6PK2260	MVB2265R6	7PK1430	MVB1430R7
6PK1130	MVB1130R6	6PK1693	MVB1690R6	6PK2270	MVB2271R6	7PK1432	MVB1430R7
6PK1138	MVB1137R6	6PK1698	MVB1700R6	6PK2271	MVB2271R6	7PK1473	MVB1475R7
6PK1145	MVB1150R6	6PK1715	MVB1715R6	6PK2280	MVB2280R6	7PK1580	MVB1580R7
6PK1153	MVB1150R6	6PK1720	MVB1715R6	6PK2285	MVB2280R6	7PK1605	MVB1605R7
6PK1153	MVB1155R6	6PK1725	MVB1725R6	6PK2285	MVB2290R6	7PK1635	MVB1635R7
6PK1165	MVB1165R6	6PK1740	MVB1740R6	6PK2330	MVB2325R6	7PK1715	MVB1715R7
6PK1180	MVB1180R6	6PK1743	MVB1740R6	6PK2345	MVB2350R6	7PK1730	MVB1730R7
6PK1185	MVB1190R4	6PK1751	MVB1755R6	6PK2355	MVB2350R6	7PK1760	MVB1760R7
6PK1185	MVB1190R6	6PK1755	MVB1755R6	6PK2373	MVB2373R6	7PK1775	MVB1775R7
6PK1190	MVB1190R6	6PK1760	MVB1755R6	6PK2373	MVB2375R6	7PK1785	MVB1785R7
6PK1195	MVB1200R6	6PK1760	MVB1760R6	6PK2380	MVB2380R6	7PK1785	MVB1788R7
6PK1200	MVB1200R6	6PK1775	MVB1775R6	6PK2390	MVB2390R6	7PK1801	MVB1800R7
6PK1210	MVB1215R6	6PK1780	MVB1775R6	6PK2415	MVB2415R6	7PK1809	MVB1813R7
6PK1213	MVB1215R6	6PK1795	MVB1795R6	6PK2445	MVB2440R6	7PK1855	MVB1855R7





CONTITECH		CONTITECH		CONTITECH		CONTITECH	
7PK1910	MVB1910R7	11,9X985Ld	SVB12990	AVX10 X 1140	SVB101140	AVX10X725	SVB10725
7PK1933	MVB1933R7	11.9 x 1030La	SVB121030	AVX10 X 1150	SVB101150	AVX10X730	SVB10725
7PK1950	MVB1952R7	11.9 x 1171La	SVB121170	AVX10 X 1175	SVB101175	AVX10X730	SVB10735
7PK1970	MVB1969R7	17X1000Li	SVB171055	AVX10 X 1200	SVB101200	AVX10X735	SVB10735
7PK1980	MVB1980R7	AVX10 X 550	SVB10550	AVX10 X 1225	SVB101225	AVX10X735	SVB10740
7PK2000	MVB2000R7	AVX10 X 610	SVB10610	AVX10 X 1238	SVB101237	AVX10X740	SVB10740
7PK2035	MVB2035R7	AVX10 X 613	SVB10610	AVX10 X 1250	SVB101250	AVX10X750	SVB10750
7PK2050	MVB2050R7	AVX10 X 613	SVB10615	AVX10 X 1275	SVB101275	AVX10X763	SVB10760
7PK2265	MVB2265R7	AVX10 X 625	SVB10625	AVX10 X 1300	SVB101300	AVX10X770	SVB10770
7PK2271	MVB2271R7	AVX10 X 635	SVB10635	AVX10 X 1325	SVB101325	AVX10X770	SVB10775
7PK2315	MVB2315R7	AVX10 X 650	SVB10650	AVX10 X 1350	SVB101350	AVX10X775	SVB10775
7PK2337	MVB2337R7	AVX10 X 675	SVB10675	AVX10 X 1400	SVB101400	AVX10X785	SVB10790
7PK2365	MVB2365R7	AVX10 X 685	SVB10690	AVX10X1000	SVB101000	AVX10X788	SVB10790
7PK2418	MVB2418R7	AVX10 X 690	SVB10690	AVX10X1005	SVB101000	AVX10X800	SVB10800
7PK2710	MVB2710R7	AVX10 X 700	SVB10700	AVX10X1013	SVB101010	AVX10X813	SVB10813
7PK2000D1	MVB2000R7	AVX10 X 710	SVB10710	AVX10X1013	SVB101015	AVX10X818	SVB10813
7PK2035D1	MVB2035R7	AVX10 X 715	SVB10710	AVX10X1025	SVB101025	AVX10X825	SVB10825
8PK1226	MVB1230R8	AVX10 X 725	SVB10725	AVX10X1035	SVB101037	AVX10X838	SVB10840
8PK1230	MVB1230R8	AVX10 X 730	SVB10725	AVX10X1050	SVB101050	AVX10X850	SVB10850
8PK1400	MVB1400R8	AVX10 X 730	SVB10735	AVX10X1060	SVB101060	AVX10X865	SVB10865
8PK1480	MVB1480R8	AVX10 X 735	SVB10735	AVX10X1075	SVB101075	AVX10X875	SVB10875
8PK2040	MVB2040R8	AVX10 X 735	SVB10740	AVX10X1085	SVB101090	AVX10X888	SVB10888
8PK2188	MVB2188R8	AVX10 X 740	SVB10740	AVX10X1090	SVB101085	AVX10X900	SVB10900
8PK2275	MVB2275R8	AVX10 X 750	SVB10750	AVX10X1090	SVB101090	AVX10X905	SVB10900
8PK2290	MVB2290R8	AVX10 X 763	SVB10760	AVX10X1100	SVB101100	AVX10X910	SVB10913
8PK2337	MVB2338R8	AVX10 X 765	SVB10760	AVX10X1113	SVB101113	AVX10X913	SVB10913
8PK2440	MVB2440R8	AVX10 X 770	SVB10775	AVX10X1125	SVB101125	AVX10X920	SVB10925
8PK2460	MVB2460R8	AVX10 X 775	SVB10775	AVX10X1140	SVB101140	AVX10X925	SVB10925
8PK2585	MVB2585R8	AVX10 X 785	SVB10790	AVX10X1150	SVB101150	AVX10X930	SVB10925
8PK2040K1	MVB2040R8	AVX10 X 788	SVB10790	AVX10X1175	SVB101175	AVX10X935	SVB10935
10AV1013	SVB101015	AVX10 X 800	SVB10800	AVX10X1190	SVB101190	AVX10X940	SVB10940
11,2 X 820	SVB12825	AVX10 X 813	SVB10813	AVX10X1200	SVB101200	AVX10X950	SVB10950
11,2 X 866	SVB12865	AVX10 X 818	SVB10813	AVX10X1215	SVB101215	AVX10X960	SVB10960
11,2X820Ld	SVB12825	AVX10 X 825	SVB10825	AVX10X1225	SVB101225	AVX10X965	SVB10960
11,2X866Ld	SVB12865	AVX10 X 838	SVB10840	AVX10X1238	SVB101237	AVX10X975	SVB10975
11,3X912Ld	SVB12915	AVX10 X 850	SVB10850	AVX10X1250	SVB101250	AVX10X980	SVB10975
11,5 X 685	SVB12685	AVX10 X 864	SVB10865	AVX10X1275	SVB101275	AVX10X990	SVB10990
11,5 X 755	SVB12760	AVX10 X 865	SVB10865	AVX10X1290	SVB101287	AVX13 X 715	SVB13710
11,5X685Ld	SVB12685	AVX10 X 875	SVB10875	AVX10X1300	SVB101300	AVX13 X 750	SVB13750
11,5X730Ld	SVB12735	AVX10 X 888	SVB10888	AVX10X1325	SVB101325	AVX13 X 775	SVB13775
11,5X755Ld	SVB12760	AVX10 X 900	SVB10900	AVX10X1340	SVB101335	AVX13 X 785	SVB13780
11,9 X 650	SVB12650	AVX10 X 910	SVB10913	AVX10X1350	SVB101350	AVX13 X 785	SVB13787
11,9 X 793	SVB12795	AVX10 X 913	SVB10913	AVX10X1375	SVB101375	AVX13 X 800	SVB13800
11,9 X 876	SVB12875	AVX10 X 920	SVB10925	AVX10X1400	SVB101400	AVX13 X 825	SVB13825
11,9 X 885	SVB12885	AVX10 X 925	SVB10925	AVX10X1428	SVB101428	AVX13 X 850	SVB13850
11,9 X 1036	SVB121040	AVX10 X 930	SVB10925	AVX10X1450	SVB101450	AVX13 X 875	SVB13875
11,9X1013	SVB121005	AVX10 X 935	SVB10935	AVX10X1475	SVB101475	AVX13 X 900	SVB13900
11,9X1013Ld	SVB121015	AVX10 X 940	SVB10940	AVX10X1500	SVB101500	AVX13 X 925	SVB13925
11,9X1036Ld	SVB121040	AVX10 X 950	SVB10950	AVX10X1525	SVB101525	AVX13 X 950	SVB13950
11,9X1042Ld	SVB121040	AVX10 X 960	SVB10960	AVX10X1540	SVB10537	AVX13 X 975	SVB13975
11,9X1183Ld	SVB121180	AVX10 X 965	SVB10960	AVX10X1550	SVB10550	AVX13 X 987	SVB13987
11,9X650Ld	SVB12650	AVX10 X 975	SVB10975	AVX10X600	SVB10600	AVX13 X 1000	SVB131000
11,9X675Ld	SVB12675	AVX10 X 980	SVB10975	AVX10X625	SVB10625	AVX13 X 1025	SVB131025
11,9X710Ld	SVB12710	AVX10 X 990	SVB10990	AVX10X630	SVB10625	AVX13 X 1050	SVB131050
11,9X758Ld	SVB12750	AVX10 X 1000	SVB101000	AVX10X635	SVB10635	AVX13 X 1055	SVB131050
11,9X758Ld	SVB12760	AVX10 X 1005	SVB101000	AVX10X650	SVB10650	AVX13 X 1075	SVB131075
11,9X783Ld	SVB12785	AVX10 X 1013	SVB101010	AVX10X650	SVB101650	AVX13 X 1125	SVB131125
11,9X793Ld	SVB12795	AVX10 X 1025	SVB101025	AVX10X675	SVB10675	AVX13 X 1150	SVB131150
11,9X806Ld	SVB12800	AVX10 X 1050	SVB101050	AVX10X685	SVB10685	AVX13 X 1175	SVB131175
11,9X868Ld	SVB12865	AVX10 X 1075	SVB101075	AVX10X685	SVB10690	AVX13 X 1200	SVB131200
11,9X876Ld	SVB12875	AVX10 X 1085	SVB101090	AVX10X690	SVB10690	AVX13 X 1225	SVB131225
11,9X885Ld	SVB12885	AVX10 X 1090	SVB101090	AVX10X695	SVB10700	AVX13 X 1250	SVB131250
11,9X903Ld	SVB12900	AVX10 X 1100	SVB101100	AVX10X700	SVB10700	AVX13 X 1275	SVB131275
11,9X950Ld	SVB12950	AVX10 X 1113	SVB101113	AVX10X710	SVB10710	AVX13 X 1290	SVB131285
11,9X965Ld	SVB12965	AVX10 X 1125	SVB101125	AVX10X715	SVB10710	AVX13 X 1300	SVB131300



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents





CONTITECH		CONTITECH		CONTITECH		CONTITECH	
AVX13 X 1325	SVB131325	AVX13X900	SVB13900	CT532	TB271	CT604K1	TBK038
AVX13 X 1338	SVB131337	AVX13X910	SVB13900	CT533	TB212	CT605	TB305
AVX13 X 1350	SVB131350	AVX13X915	SVB13925	CT534	TB255	CT605K1	TBK027
AVX13 X 1375	SVB131375	AVX13X925	SVB13925	CT535	TB211	CT607	TB244
AVX13 X 1425	SVB131425	AVX13X938	SVB13950	CT536	TB161	CT607	TB259
AVX13 X 1450	SVB131450	AVX13X950	SVB13950	CT539	TB318	CT607K1	TBK007
AVX13 X 1475	SVB131475	AVX13X955	SVB13950	CT540	TB224	CT608	TB303
AVX13 X 1500	SVB131500	AVX13X960	SVB13950	CT540K1	TBK031	CT608K3	TBK118
AVX13 X 1525	SVB131525	AVX13X975	SVB13975	CT541	TB352	CT609	TB515
AVX13 X 1550	SVB131550	AVX13X985	SVB13975	CT542	TB351	CT610	TB188
AVX13 X 1825	SVB131838	AVX13X990	SVB13987	CT543	TB308	CT611	TB337
AVX13 X 650	SVB13610	AVX17X1000	SVB171000	CT544	TB349	CT611K1	TBK040
AVX13 X 885	SVB13882	AVX17X1055	SVB171055	CT545	TB267	CT612	TB162
AVX13X1000	SVB131000	AVX17X1115	SVB171115	CT546	TB203	CT613	TB286
AVX13X1030	SVB131025	AVX17X1195	SVB171205	CT547	TB254	CT614	TB521
AVX13X1050	SVB131050	AVX17X1325	SVB171320	CT548	TB204	CT615	TB306
AVX13X1050	SVB131060	AVX17X845	SVB17850	CT548K1	TBK059	CT616	TB201
AVX13X1055	SVB131050	AVX17X850	SVB17850	CT550	TB363	CT616K1	TBK050
AVX13X1075	SVB131075	CT 555	TB198	CT551	TB421	CT617	TB307
AVX13X1120	SVB131125	CT 588	TB345	CT551K1	TBK281	CT617K1	TBK065
AVX13X1125	SVB131125	CT 592	TB276	CT553	TB195	CT619	TB278
AVX13X1138	SVB131138	CT 707	TB234	CT553K1	TBK051	CT622	TB250
AVX13X1150	SVB131150	CT 712	TB520	CT556	TB313	CT622K1	TBK063
AVX13X1160	SVB131150	CT 776	TB235	CT557	TB197	CT626	TB247
AVX13X1175	SVB131175	CT 813	TB420	CT557K1	TBK055	CT627	TB317
AVX13X1200	SVB131200	CT 901 (SET)	TB237	CT558	TB218	CT629	TB283
AVX13X1225	SVB131225	CT 909	TB554	CT558	TB231	CT630	TB506
AVX13X1250	SVB131250	CT 949	TB735	CT559	TB202	CT630K1	TBK076
AVX13X1275	SVB131275	CT503	TB129	CT559	TB668	CT630K2	TBK109
AVX13X1285	SVB131285	CT504	TB129	CT562	TB110	CT631	TB173
AVX13X1290	SVB131285	CT505	TB124	CT568	TB222	CT633	TB107
AVX13X1290	SVB131300	CT508	TB291	CT569	TB181	CT635	TB602
AVX13X1300	SVB131300	CT508K1	TBK075	CT571	TB246	CT637	TB108
AVX13X1325	SVB131325	CT510	TB360	CT572	TB592	CT637K1	TBK016
AVX13X1350	SVB131350	CT511	TB102	CT573	TB180	CT639	TB179
AVX13X1375	SVB131375	CT511	TB213	CT573	TB603	CT641	TB136
AVX13X1400	SVB131400	CT512	TB223	CT574	TB343	CT643	TB118
AVX13X1425	SVB131425	CT512K1	TBK056	CT575	TB134	CT645	TB293
AVX13X1450	SVB131450	CT513	TB225	CT576	TB230	CT646	TB567
AVX13X1500	SVB131500	CT513K1	TBK018	CT577	TB186	CT647	TB114
AVX13X1600	SVB131600	CT515	TB333	CT580	TB571	CT647K1	TBK015
AVX13X625	SVB13625	CT516	TB522	CT581	TB338	CT648	TB115
AVX13X625	SVB13635	CT517	TB359	CT581K1	TBK287	CT649	TB113
AVX13X650	SVB13655	CT517K1	TBK069	CT583	TB473	CT650	TB121
AVX13X655	SVB13655	CT520	TB241	CT583K1	TBK052	CT651	TB112
AVX13X675	SVB13675	CT521	TB187	CT585	TB260	CT652	TB122
AVX13X700	SVB13710	CT521K1	TBK064	CT586	TB264	CT654	TB106
AVX13X715	SVB13710	CT522	TB156	CT587	TB298	CT655	TB184
AVX13X725	SVB13725	CT522K1	TBK033	CT589	TB242	CT660	TB207
AVX13X750	SVB13750	CT522K1	TBK034	CT589K1	TBK074	CT660K1	TBK048
AVX13X775	SVB13775	CT522K2	TBK117	CT589K2	TBK108	CT662	TB177
AVX13X775	SVB13780	CT522K4	TBK123	CT590	TB262	CT662K1	TBK054
AVX13X785	SVB13780	CT524	TB499	CT591	TB395	CT663	TB103
AVX13X785	SVB13787	CT525	TB226	CT594	TB126	CT663K1	TBK042
AVX13X800	SVB13800	CT525	TB661	CT595	TB164	CT664	TB166
AVX13X810	SVB13800	CT525K1	TBK011	CT596	TB189	CT665	TB160
AVX13X818	SVB13825	CT526	TB190	CT596K1	TBK047	CT666	TB169
AVX13X825	SVB13825	CT527	TB232	CT598	TB200	CT667	TB148
AVX13X830	SVB13825	CT527	TB733	CT599	TB350	CT668	TB168
AVX13X835	SVB13825	CT527K1	TBK284	CT600	TB600	CT669	TB123
AVX13X840	SVB13850	CT528	TB138	CT601	TB172	CT670	TB249
AVX13X850	SVB13850	CT529	TB178	CT602	TB357	CT672	TB621
AVX13X855	SVB13850	CT529K1	TBK046	CT603	TB266	CT674	TB127
AVX13X865	SVB13875	CT530	TB344	CT603K1	TBK286	CT676	TB126
AVX13X875	SVB13875	CT530K1	TBK061	CT604	TB258	CT677	TB143





CONTITECH		CONTITECH		CONTITECH		CONTITECH	
CT678	TB150	CT731	TB135	CT798	TB502	CT865	TB454
CT679	TB261	CT731K1	TBK045	CT799	TB353	CT866	TB508
CT680	TB171	CT732	TB442	CT800	TB354	CT866K1	TBK032
CT681	TB146	CT737	TB372	CT800K1	TBK290	CT867	TB384
CT683	TB170	CT738	TB366	CT801	TB356	CT867K1	TBK024
CT684	TB256	CT739	TB328	CT802	TB400	CT867K2	TBK025
CT684K1	TBK017	CT739	TB425	CT803	TB367	CT867K3	TBK119
CT685	TB101	CT740	TB330	CT804	TB378	CT867K4	TBK026
CT685K1	TBK015	CT741	TB335	CT805	TB401	CT868	TB657
CT685K1	TBK057	CT744	TB376	CT806	TB287	CT869	TB505
CT687	TB102	CT744K1	TBK004	CT808	TB669	CT869K1	TBK066
CT687K1	TBK058	CT745	TB279	CT810	TB386	CT870	TB783
CT688	TB239	CT746	TB690	CT812	TB380	CT870K1	TBK261
CT690	TB240	CT748	TB413	CT814	TB312	CT871	TB509
CT690K1	TBK003	CT748	TB663	CT815	TB327	CT871K1	TBK111
CT690K1	TBK288	CT748K1	TBK021	CT816	TB519	CT871K2	TBK081
CT691	TB577	CT748K2	TBK022	CT817	TB275	CT872	TB441
CT692K1	TBK289	CT748K3	TBK023	CT818	TB285	CT873	TB780
CT693	TB128	CT749	TB421	CT819	TB383	CT873K1	TBK260
CT694	TB228	CT750	TB422	CT820	TB517	CT874	TB336
CT694	TB667	CT750K2	TBK282	CT821	TB381	CT874K1	TBK008
CT695	TB263	CT751	TB289	CT822	TB403	CT875	TB803
CT696	TB613	CT752	TB297	CT824	TB322	CT877	TB468
CT698	TB105	CT754	TB346	CT825	TB404	CT878	TB470
CT699	TB209	CT754	TB419	CT826	TB402	CT878K1	TBK300
CT700	TB227	CT754K1	TBK010	CT827	TB445	CT879	TB471
CT700K1	TBK049	CT755	TB375	CT828	TB428	CT879K1	TBK089
CT702	TB248	CT757	TB281	CT829	TB399	CT880	TB462
CT703	TB348	CT757K1	TBK294	CT831	TB430	CT881	TB472
CT704	TB131	CT758	TB440	CT832	TB590	CT881K2	TBK276
CT705	TB362	CT759	TB434	CT833	TB579	CT884	TB481
CT706	TB334	CT760	TB423	CT834	TB806	CT884K1	TBK091
CT707	TB234	CT762	TB382	CT836	TB407	CT885	TB394
CT708	TB295	CT763	TB317	CT839	TB406	CT886	TB578
CT708K1	TBK071	CT763K1	TBK070	CT840	TB431	CT887	TB458
CT709	TB257	CT765	TB301	CT841	TB379	CT887K1	TBK298
CT709K1	TBK002	CT766	TB674	CT842	TB671	CT891	TB459
CT710	TB245	CT768	TB397	CT843	TB412	CT891K1	TBK029
CT710K1	TBK030	CT769	TB294	CT843K1	TBK080	CT892	TB461
CT711	TB292	CT770	TB299	CT844	TB393	CT893	TB391
CT711K1	TBK097	CT771	TB396	CT845	TB465	CT894	TB692
CT714	TB268	CT772	TB320	CT846	TB466	CT895	TB455
CT714K1	TBK067	CT772K1	TBK035	CT846K1	TBK087	CT896	TB310
CT715	TB518	CT773	TB272	CT847	TB467	CT897	TB361
CT715K1	TBK291	CT774	TB358	CT847K1	TBK088	CT897	TB610
CT716	TB265	CT775	TB319	CT848	TB463	CT898	TB456
CT718	TB304	CT775K1	TBK013	CT848K1	TBK086	CT899	TB460
CT718K1	TBK005	CT776	TB235	CT848K4	TBK086	CT899K1	TBK299
CT719	TB104	CT778	TB324	CT849	TB464	CT900	TB597
CT720	TB155	CT779	TB323	CT850	TB435	CT901(SET)	TB237
CT721	TB219	CT780	TB269	CT852	TB436	CT901(SET)	TB495
CT722	TB355	CT781	TB290	CT853	TB437	CT901(SET)	TB496
CT723	TB314	CT782	TB274	CT854	TB438	CT901K1	TBK012
CT723K1	TBK068	CT783	TB309	CT855	TB439	CT901K2	TBK014
CT724	TB221	CT785	TB282	CT856	TB443	CT901K3	TBK121
CT724K1	TBK028	CT786	TB300	CT857	TB516	CT902	TB488
CT726	TB373	CT787	TB371	CT858	TB444	CT906	TB457
CT727	TB604	CT787K1	TBK295	CT859	TB446	CT906K1	TBK041
CT728	TB390	CT788	TB347	CT860	TB447	CT907	TB553
CT728K1	TBK110	CT789	TB426	CT861	TB448	CT908	TB552
CT728K1	TBK120	CT790	TB280	CT862	TB450	CT908K1	TBK100
CT729	TB389	CT790K1	TBK293	CT862K1	TBK296	CT909K5	TBK115
CT729K1	TBK078	CT791	TB374	CT863	TB451	CT909K6	TBK101
CT729K1	TBK079	CT792	TB339	CT863K1	TBK297	CT910	TB491
CT730	TB311	CT794	TB377	CT864	TB453	CT911	TB405



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents





CONTITECH		CONTITECH		CONTITECH		CONTITECH	
CT914	TB557	CT970	TB732	CT1022	TB726	CT1077	TB741
CT915	TB482	CT971	TB607	CT1023	TB647	CT1078	TB740
CT915K1	TBK092	CT972	TB398	CT1024	TB289	CT1079	TB750
CT916	TB469	CT973K1	TBK043	CT1024K1	TBK072	CT1080	TB673
CT917	TB487	CT974	TB640	CT1025	TB653	CT1081	TB736
CT918	TB608	CT975	TB638	CT1025K1	TBK275	CT1082	TB749
CT919	TB555	CT975K1	TBK240	CT1026	TB654	CT1084	TB542
CT920	TB556	CT975K2	TBK103	CT1027	TB708	CT1085	TB707
CT921	TB489	CT975K3	TBK103	CT1028	TB680	CT1086	TB694
CT921K1	TBK090	CT976	TB636	CT1028K3	TBK270	CT1087	TB805
CT923	TB700	CT976K1	TBK267	CT1028K4	TBK225	CT1088	TB753
CT924	TB524	CT977	TB644	CT1029	TB696	CT1089	TB687
CT925	TB498	CT978	TB633	CT1030	TB527	CT1090	TB726
CT926	TB504	CT979	TB643	CT1031	TB175	CT1091	TB742
CT926K1	TBK285	CT981	TB737	CT1031K1	TBK019	CT1094	TB760
CT927	TB660	CT982	TB705	CT1031K2	TBK020	CT1095	TB759
CT927K1	TBK085	CT983	TB681	CT1033	TB793	CT1098	TB751
CT929	TB534	CT983K1	TBK278	CT1034	TB558	CT1099	TB714
CT931	TB474	CT984	TB642	CT1034K1	TBK102	CT1100	TB722
CT932	TB792	CT985	TB641	CT1035	TB713	CT1102	TB715
CT933	TB503	CT986	TB631	CT1035K1	TBK273	CT1103	TB541
CT933K1	TBK053	CT986K1	TBK105	CT1036	TB685	CT1104	TB721
CT935	TB545	CT987	TB632	CT1037	TB678	CT1107	TB490
CT935K1	TBK098	CT987K1	TBK106	CT1037	TB739	CT1108	TB682
CT935K2	TBK098	CT987K2	TBK274	CT1038	TB368	CT1109	TB326
CT936	TB328	CT988	TB529	CT1038K1	TBK037	CT1110	TB744
CT936	TB425	CT988K1	TBK096	CT1040	TB652	CT1111	TB565
CT937	TB539	CT989	TB701	CT1041	TB651	CT1112	TB547
CT939	TB785	CT989K1	TBK039	CT1042	TB650	CT1113	TB550
CT940	TB546	CT990	TB481	CT1043	TB655	CT1114	TB794
CT940K1	TBK099	CT991	TB302	CT1044K1	TBK272	CT1115	TB787
CT940K2	TBK114	CT991K1	TBK060	CT1045	TB712	CT1116	TB718
CT941	TB684	CT992	TB548	CT1046	TB710	CT1119	TB532
CT942	TB537	CT993	TB706	CT1047	TB731	CT1120	TB797
CT945	TB384	CT994	TB716	CT1048	TB493	CT1121	TB800
CT946	TB533	CT995	TB608	CT1049	TB637	CT1122	TB799
CT946K1	TBK116	CT995K2	TBK094	CT1051	TB743	CT1123	TB719
CT946K2	TBK107	CT996	TB734	CT1051K1	TBK262	CT1124	TB802
CT947	TB559	CT997	TB676	CT1052	TB727	CT1125	TB804
CT948	TB680	CT998	TB311	CT1053	TB492	CT1126	TB636
CT949	TB735	CT999	TB649	CT1054	TB370	CT1127	TB704
CT949K2	TBK280	CT999K1	TBK277	CT1054K2	TBK077	CT1128	TB801
CT950	TB513	CT1000	TB325	CT1055	TB629	CT1129	TB685
CT951	TB525	CT1001	TB538	CT1056	TB745	CT1130	TB652
CT952	TB478	CT1003	TB683	CT1057	TB723	CT1131	TB807
CT952	TB591	CT1003K1	TBK279	CT1058	TB551		
CT953	TB365	CT1004	TB795	CT1058	TB758		
CT954	TB477	CT1005	TB645	CT1061	TB560		
CT955	TB479	CT1006	TB616	CT1061K1	TBK019		
CT955K1	TBK095	CT1007	TB796	CT1061K2	TBK020		
CT955K2	TBK122	CT1008	TB786	CT1062	TB679		
CT956	TB726	CT1009	TB724	CT1063	TB720		
CT957 (SET)	TB658	CT1010	TB748	CT1063K1	TBK230		
CT957(SET)	TB634	CT1012	TB657	CT1064	TB756		
CT957K1	TBK246	CT1012K1	TBK093	CT1065	TB700		
CT957K2	TBK263	CT1012K2	TBK112	CT1066	TB699		
CT958	TB637	CT1013	TB730	CT1067	TB711		
CT959	TB480	CT1014	TB656	CT1068	TB754		
CT964	TB798	CT1015	TB738	CT1069	TB709		
CT966	TB258	CT1016	TB540	CT1070	TB316		
CT968	TB639	CT1017	TB535	CT1071	TB788		
CT968K1	TBK104	CT1018	TB641	CT1072	TB728		
CT968K2	TBK283	CT1019	TB702	CT1073	TB717		
CT969	TB528	CT1020	TB536	CT1074	TB747		
CT969K1	TBK207	CT1021K2	TBK269	CT1076	TB725		





DAYCO		DAYCO		DAYCO		DAYCO	
3PK0537	MVB538R3	4PK545	MVB545R4	4PK800	MVB800R4	4PK910	MVB915R4
3PK0563	MVB563R3	4PK0563	MVB563R4	4PK0800	MVB810R4	4PK915	MVB900R4
3PK563	MVB563R3	4PK563	MVB563R4	4PK800	MVB810R4	4PK915	MVB915R4
3PK0600	MVB600R3	4PK0587	MVB588R4	4PK805	MVB800R4	4PK915	MVB920R4
3PK600	MVB600R3	4PK588	MVB588R4	4PK812	MVB800R4	4PK920	MVB920R4
3PK0625	MVB625R3	4PK610	MVB611R4	4PK812	MVB810R4	4PK920	MVB925R4
3PK625	MVB625R3	4PK0613	MVB611R4	4PK812	MVB825R4	4PK0925	MVB860R4
3PK630	MVB625R3	4PK0637	MVB640R4	4PK0813	MVB800R4	4PK926	MVB920R4
3PK648	MVB648R3	4PK638	MVB640R4	4PK0813	MVB810R4	4PK926	MVB925R4
3PK0650	MVB648R3	4PK648	MVB648R4	4PK0813	MVB825R4	4PK926	MVB1675R6
3PK0663	MVB668R3	4PK648	MVB663R4	4PK820	MVB825R4	4PK930	MVB925R4
3PK668	MVB668R3	4PK0650	MVB648R4	4PK820	MVB835R4	4PK938	MVB940R4
3PK0670	MVB668R3	4PK0650	MVB663R4	4PK0825	MVB825R4	4PK938	MVB945R4
3PK673	MVB673R3	4PK0663	MVB663R4	4PK0825	MVB835R4	4PK942	MVB945R4
3PK0675	MVB668R3	4PK0663	MVB668R3	4PK825	MVB835R4	4PK946	MVB945R4
3PK0675	MVB673R3	4PK668	MVB663R4	4PK0830	MVB810R4	4PK0950	MVB810R4
3PK675	MVB673R3	4PK668	MVB668R3	4PK0830	MVB825R4	4PK954	MVB945R4
3PK0687	MVB673R3	4PK673	MVB648R4	4PK830	MVB825R4	4PK954	MVB960R4
3PK688	MVB673R3	4PK673	MVB673R4	4PK0830	MVB835R4	4PK958	MVB950R5
3PK688	MVB690R3	4PK0675	MVB648R4	4PK830	MVB835R4	4PK958	MVB960R4
3PK0713	MVB715R3	4PK0675	MVB663R4	4PK835	MVB835R4	4PK962	MVB960R4
3PK715	MVB715R3	4PK0675	MVB673R4	4PK0837	MVB835R4	4PK968	MVB960R4
3PK0720	MVB715R3	4PK675	MVB673R4	4PK837	MVB835R4	4PK968	MVB970R4
3PK0725	MVB735R3	4PK698	MVB698R4	4PK0837	MVB845R4	4PK970	MVB970R4
3PK736	MVB735R3	4PK0700	MVB698R4	4PK837	MVB845R4	4PK975	MVB970R4
3PK0737	MVB735R3	4PK0713	MVB706R4	4PK840	MVB835R4	4PK975	MVB975R4
3PK740	MVB735R3	4PK0713	MVB715R4	4PK841	MVB835R4	4PK985	MVB985R4
3PK760	MVB760R3	4PK715	MVB706R4	4PK841	MVB845R4	4PK990	MVB975R4
3PK0763	MVB760R3	4PK715	MVB715R4	4PK0845	MVB845R4	4PK990	MVB985R4
3PK763	MVB760R3	4PK720	MVB715R4	4PK845	MVB845R4	4PK990	MVB995R4
3PK0775	MVB775R3	4PK0725	MVB715R4	4PK0850	MVB845R4	4PK995	MVB995R4
3PK775	MVB775R3	4PK725	MVB715R4	4PK0850	MVB850R4	4PK1000	MVB1000R4
3PK0787	MVB780R3	4PK0725	MVB725R4	4PK850	MVB850R4	4PK1005	MVB995R4
3PK788	MVB780R3	4PK725	MVB725R4	4PK0850	MVB855R4	4PK1005	MVB1000R4
3PK0800	MVB800R3	4PK0730	MVB725R4	4PK0850	MVB860R4	4PK1005	MVB1015R4
3PK800	MVB800R3	4PK730	MVB725R4	4PK853	MVB835R4	4PK1013	MVB1015R4
3PK812	MVB800R3	4PK730	MVB735R4	4PK853	MVB845R4	4PK1013	MVB1020R4
3PK812	MVB810R3	4PK736	MVB735R3	4PK853	MVB850R4	4PK1025	MVB1020R4
3PK812	MVB813R3	4PK736	MVB735R4	4PK853	MVB855R4	4PK1025	MVB1025R4
3PK0813	MVB810R3	4PK736	MVB755R4	4PK0855	MVB835R4	4PK1035	MVB1040R4
3PK0813	MVB813R3	4PK0737	MVB735R4	4PK0855	MVB850R4	4PK1035	MVB1050R4
3PK815	MVB810R3	4PK0737	MVB755R4	4PK0855	MVB855R4	4PK1045	MVB1045R4
3PK0825	MVB810R3	4PK747	MVB747R4	4PK0855	MVB860R4	4PK1045	MVB1050R4
3PK0825	MVB825R3	4PK747	MVB755R4	4PK860	MVB860R4	4PK1050	MVB1045R4
3PK0825	MVB838R3	4PK0750	MVB747R4	4PK860	MVB870R4	4PK1050	MVB1050R4
3PK830	MVB810R3	4PK0750	MVB755R4	4PK862	MVB845R4	4PK1050	MVB1065R4
3PK830	MVB825R3	4PK756	MVB747R4	4PK862	MVB855R4	4PK1054	MVB1045R4
3PK835	MVB838R3	4PK0763	MVB747R4	4PK862	MVB860R4	4PK1054	MVB1050R4
3PK0837	MVB838R3	4PK763	MVB747R4	4PK862	MVB870R4	4PK1060	MVB1050R4
3PK0850	MVB838R3	4PK0763	MVB763R4	4PK862	MVB920R4	4PK1065	MVB1065R4
3PK0850	MVB850R3	4PK763	MVB763R4	4PK0863	MVB845R4	4PK1065	MVB1065R6
3PK853	MVB838R3	4PK0763	MVB775R4	4PK0863	MVB855R4	4PK1075	MVB1080R4
3PK853	MVB850R3	4PK0770	MVB775R4	4PK0863	MVB860R4	4PK1083	MVB1080R4
3PK872	MVB872R3	4PK770	MVB775R4	4PK875	MVB870R4	4PK1090	MVB1090R4
3PK884	MVB887R3	4PK0775	MVB775R4	4PK875	MVB875R4	4PK1100	MVB1100R4
3PK890	MVB887R3	4PK775	MVB775R4	4PK880	MVB875R4	4PK1110	MVB1100R4
3PK915	MVB915R3	4PK780	MVB775R4	4PK884	MVB875R4	4PK1115	MVB1110R4
3PK938	MVB940R3	4PK0787	MVB775R4	4PK884	MVB885R4	4PK1115	MVB1125R4
3PK946	MVB940R3	4PK0787	MVB790R4	4PK884	MVB900R4	4PK1125	MVB1125R4
3PK960	MVB960R3	4PK788	MVB775R4	4PK884	MVB995R4	4PK1130	MVB1125R4
3PK975	MVB960R3	4PK788	MVB790R4	4PK890	MVB885R4	4PK1165	MVB1165R4
3PK1005	MVB1000R3	4PK795	MVB800R4	4PK890	MVB900R4	4PK1185	MVB1190R4
3PK1025	MVB1025R3	4PK0800	MVB790R4	4PK895	MVB900R4	4PK1215	MVB985R4
3PK1040	MVB1035R3	4PK800	MVB790R4	4PK900	MVB900R4	4PK1215	MVB1215R4
4PK0545	MVB545R4	4PK0800	MVB800R4	4PK905	MVB900R4	4PK1225	MVB1230R4



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents





DAYCO		DAYCO		DAYCO		DAYCO	
4PK1238	MVB1238R4	5PK830	MVB825R4	5PK1025	MVB1030R5	5PK1425	MVB1432R5
4PK1238	MVB1245R4	5PK0830	MVB825R5	5PK1035	MVB1030R5	5PK1435	MVB1432R5
4PK1260	MVB1260R4	5PK830	MVB825R5	5PK1035	MVB1035R5	5PK1450	MVB1450R5
4PK1260	MVB1272R4	5PK0830	MVB830R5	5PK1050	MVB1050R5	5PK1500	MVB1500R5
4PK1270	MVB1272R4	5PK830	MVB830R5	5PK1054	MVB1050R5	5PK1513	MVB1515R5
4PK1272	MVB1272R4	5PK835	MVB836R5	5PK1060	MVB1060R5	5PK1515	MVB1515R5
4PK1322	MVB1325R4	5PK0837	MVB836R5	5PK1065	MVB1060R5	5PK1545	MVB1550R5
4PK1325	MVB1325R4	5PK847	MVB845R5	5PK1090	MVB1090R5	5PK1547	MVB1550R5
4PK1413	MVB1420R4	5PK847	MVB865R5	5PK1100	MVB1100R5	5PK1550	MVB1550R5
4PK1415	MVB1420R4	5PK0850	MVB830R5	5PK1100	MVB1110R5	5PK1570	MVB1575R5
4PK1487	MVB1488R4	5PK0850	MVB845R5	5PK1105	MVB1100R5	5PK1572	MVB1575R5
4PK1488	MVB1488R4	5PK0850	MVB865R5	5PK1110	MVB1110R5	5PK1585	MVB1588R6
4PK1520	MVB1510R4	5PK853	MVB845R5	5PK1115	MVB1100R5	5PK1587	MVB1588R6
4PK1520	MVB1520R4	5PK0855	MVB845R5	5PK1115	MVB1110R5	5PK1588	MVB1588R6
4PK1700	MVB1708R4	5PK862	MVB865R5	5PK1115	MVB1120R5	5PK1613	MVB1610R5
4PK1710	MVB1708R4	5PK0863	MVB865R5	5PK1125	MVB1120R5	5PK1635	MVB1638R5
4PK1713	MVB1708R4	5PK0863	MVB869R5	5PK1125	MVB1135R5	5PK1637	MVB1638R5
4PK1770	MVB1775R4	5PK865	MVB865R5	5PK1130	MVB1120R5	5PK1680	MVB1680R5
4PK1775	MVB1775R4	5PK865	MVB869R5	5PK1130	MVB1135R5	5PK1687	MVB1680R5
4PK1013HD	MVB1015R4	5PK869	MVB869R5	5PK1137	MVB1135R5	5PK1725	MVB1725R5
4PK1025HD	MVB1025R4	5PK869	MVB870R4	5PK1137	MVB1141R5	5PK1750	MVB1750R5
4PK1050HD	MVB1045R4	5PK0870	MVB869R5	5PK1140	MVB1141R5	5PK1787	MVB1790R5
5PK0575	MVB575R5	5PK872	MVB869R5	5PK1152	MVB1150R6	5PK1790	MVB1790R5
5PK575	MVB575R5	5PK875	MVB865R5	5PK1155	MVB1150R6	5PK1813	MVB1815R5
5PK0637	MVB638R5	5PK0875	MVB869R5	5PK1165	MVB1165R5	5PK1815	MVB1815R5
5PK638	MVB638R5	5PK875	MVB869R5	5PK1165	MVB1175R5	5PK1885	MVB1885R5
5PK0650	MVB650R5	5PK875	MVB875R5	5PK1175	MVB1175R5	5PK1887	MVB1885R5
5PK673	MVB675R5	5PK880	MVB875R5	5PK1188	MVB1188R5	5PK2020	MVB2025R5
5PK0675	MVB675R5	5PK880	MVB887R5	5PK1195	MVB1188R5	5PK2025	MVB2025R5
5PK0687	MVB688R5	5PK884	MVB875R5	5PK1200	MVB1188R5	5PK2030	MVB2025R5
5PK688	MVB688R5	5PK884	MVB887R5	5PK1200	MVB1200R5	5PK2063	MVB2060R5
5PK698	MVB688R5	5PK0887	MVB865R5	5PK1200	MVB1215R5	5PK1028S	MVB1030R5
5PK698	MVB700R5	5PK890	MVB887R5	5PK1210	MVB1215R5	6PK673	MVB675R6
5PK698	MVB710R5	5PK900	MVB900R5	5PK1220	MVB1225R5	6PK0680	MVB675R6
5PK0700	MVB688R5	5PK900	MVB906R5	5PK1225	MVB1225R5	6PK698	MVB698R6
5PK0700	MVB700R5	5PK907	MVB900R5	5PK1230	MVB1225R5	6PK0700	MVB698R6
5PK700	MVB700R5	5PK907	MVB906R5	5PK1238	MVB1240R5	6PK0725	MVB715R6
5PK0700	MVB710R5	5PK915	MVB906R5	5PK1245	MVB1240R5	6PK0725	MVB730R6
5PK0713	MVB710R5	5PK915	MVB915R5	5PK1250	MVB800R5	6PK725	MVB730R6
5PK715	MVB710R5	5PK921	MVB915R5	5PK1250	MVB1255R5	6PK728	MVB730R6
5PK0725	MVB710R5	5PK921	MVB925R5	5PK1263	MVB1255R5	6PK0730	MVB730R6
5PK725	MVB710R5	5PK926	MVB915R5	5PK1270	MVB1255R5	6PK730	MVB730R6
5PK0725	MVB725R5	5PK926	MVB925R5	5PK1270	MVB1270R5	6PK736	MVB730R6
5PK725	MVB725R5	5PK926	MVB938R5	5PK1280	MVB1285R5	6PK736	MVB736R6
5PK730	MVB735R5	5PK935	MVB938R5	5PK1285	MVB1285R5	6PK0737	MVB730R6
5PK736	MVB735R5	5PK938	MVB938R5	5PK1287	MVB1285R5	6PK0737	MVB736R6
5PK0737	MVB735R5	5PK941	MVB938R5	5PK1287	MVB1300R5	6PK0745	MVB750R6
5PK768	MVB768R5	5PK946	MVB938R5	5PK1290	MVB1285R5	6PK745	MVB750R6
5PK775	MVB775R5	5PK946	MVB950R5	5PK1300	MVB1300R5	6PK0750	MVB750R6
5PK0780	MVB768R5	5PK950	MVB950R5	5PK1325	MVB1345R5	6PK750	MVB750R6
5PK0780	MVB775R5	5PK954	MVB950R5	5PK1340	MVB1345R5	6PK0800	MVB795R6
5PK0787	MVB775R5	5PK955	MVB950R5	5PK1345	MVB1345R5	6PK800	MVB795R6
5PK0787	MVB788R5	5PK962	MVB950R5	5PK1350	MVB1345R5	6PK0815	MVB825R6
5PK0787	MVB800R5	5PK962	MVB960R5	5PK1350	MVB1360R5	6PK819	MVB825R6
5PK788	MVB775R5	5PK962	MVB970R5	5PK1350	MVB1370R5	6PK0820	MVB825R6
5PK788	MVB788R5	5PK968	MVB970R5	5PK1352	MVB1345R5	6PK820	MVB825R6
5PK0800	MVB800R5	5PK975	MVB970R5	5PK1355	MVB1360R5	6PK0825	MVB825R6
5PK800	MVB800R5	5PK975	MVB975R5	5PK1360	MVB1360R5	6PK825	MVB825R6
5PK0810	MVB800R5	5PK986	MVB975R5	5PK1360	MVB1370R5	6PK825	MVB830R5
5PK0810	MVB813R5	5PK986	MVB985R5	5PK1363	MVB1360R5	6PK838	MVB838R6
5PK810	MVB813R5	5PK990	MVB985R5	5PK1370	MVB1370R5	6PK0840	MVB838R6
5PK820	MVB825R5	5PK1005	MVB1000R5	5PK1375	MVB1375R5	6PK841	MVB838R6
5PK0825	MVB825R5	5PK1005	MVB1015R5	5PK1387	MVB1388R5	6PK0850	MVB838R6
5PK0825	MVB830R5	5PK1013	MVB1000R5	5PK1388	MVB1388R5	6PK0850	MVB850R6
5PK825	MVB830R5	5PK1013	MVB1015R5	5PK1390	MVB1388R5	6PK850	MVB850R6





DAYCO		DAYCO		DAYCO		DAYCO	
6PK853	MVB838R6	6PK1125	MVB1125R6	6PK1410	MVB1413R6	6PK1650	MVB1642R6
6PK853	MVB850R6	6PK1125	MVB1130R6	6PK1413	MVB1413R6	6PK1650	MVB1650R6
6PK0858	MVB850R6	6PK1130	MVB1125R6	6PK1413	MVB1420R6	6PK1650	MVB1660R6
6PK0858	MVB860R6	6PK1130	MVB1130R6	6PK1415	MVB1413R6	6PK1655	MVB1650R6
6PK858	MVB860R6	6PK1137	MVB1137R6	6PK1415	MVB1420R6	6PK1660	MVB1660R6
6PK862	MVB860R6	6PK1137	MVB1150R6	6PK1420	MVB1420R6	6PK1663	MVB1660R6
6PK0863	MVB860R6	6PK1141	MVB1137R6	6PK1420	MVB1690R6	6PK1670	MVB1675R6
6PK870	MVB870R6	6PK1141	MVB1150R6	6PK1425	MVB1420R6	6PK1675	MVB1675R6
6PK872	MVB870R6	6PK1145	MVB1150R6	6PK1435	MVB1440R6	6PK1675	MVB1685R6
6PK875	MVB870R6	6PK1150	MVB1150R6	6PK1437	MVB1440R6	6PK1680	MVB1675R6
6PK885	MVB884R6	6PK1152	MVB1150R6	6PK1437	MVB1450R6	6PK1683	MVB1675R6
6PK888	MVB884R6	6PK1152	MVB1155R6	6PK1450	MVB1450R6	6PK1683	MVB1685R6
6PK888	MVB890R6	6PK1155	MVB1155R6	6PK1451	MVB1450R6	6PK1687	MVB1685R6
6PK892	MVB890R6	6PK1160	MVB1150R6	6PK1453	MVB1450R6	6PK1687	MVB1690R6
6PK894	MVB890R6	6PK1160	MVB1165R6	6PK1462	MVB1460R5	6PK1692	MVB1685R6
6PK900	MVB890R6	6PK1165	MVB1150R6	6PK1463	MVB1460R5	6PK1692	MVB1690R6
6PK900	MVB900R6	6PK1165	MVB1165R6	6PK1467	MVB1469R6	6PK1695	MVB1690R6
6PK906	MVB906R6	6PK1180	MVB1180R6	6PK1468	MVB1469R6	6PK1698	MVB1700R6
6PK910	MVB915R6	6PK1185	MVB1180R6	6PK1468	MVB1488R6	6PK1700	MVB1690R6
6PK915	MVB915R6	6PK1185	MVB1190R6	6PK1472	MVB1469R6	6PK1700	MVB1700R6
6PK923	MVB925R6	6PK1185	MVB1200R6	6PK1475	MVB1469R6	6PK1705	MVB1700R6
6PK926	MVB925R6	6PK1195	MVB1190R6	6PK1475	MVB1488R6	6PK1710	MVB1715R6
6PK938	MVB938R6	6PK1195	MVB1200R6	6PK1487	MVB1488R6	6PK1713	MVB1715R6
6PK946	MVB946R6	6PK1200	MVB1200R6	6PK1510	MVB1513R6	6PK1715	MVB1715R6
6PK950	MVB946R6	6PK1205	MVB1200R6	6PK1513	MVB1513R6	6PK1720	MVB1413R6
6PK962	MVB962R6	6PK1209	MVB1215R6	6PK1530	MVB1530R6	6PK1720	MVB1715R6
6PK965	MVB962R6	6PK1215	MVB1215R6	6PK1537	MVB1530R6	6PK1725	MVB1725R6
6PK966	MVB962R6	6PK1217	MVB1215R6	6PK1537	MVB1538R6	6PK1730	MVB1725R6
6PK975	MVB962R6	6PK1225	MVB1225R5	6PK1538	MVB1530R6	6PK1733	MVB1725R6
6PK975	MVB975R6	6PK1240	MVB1238R6	6PK1538	MVB1538R6	6PK1733	MVB1740R6
6PK986	MVB986R6	6PK1240	MVB1600R6	6PK1545	MVB1550R6	6PK1736	MVB1740R6
6PK0987	MVB860R6	6PK1250	MVB1250R6	6PK1550	MVB1550R6	6PK1737	MVB1740R6
6PK996	MVB1000R6	6PK1250	MVB1260R6	6PK1550	MVB1560R6	6PK1740	MVB1740R6
6PK996	MVB1488R6	6PK1255	MVB1250R6	6PK1555	MVB1550R6	6PK1740	MVB1755R6
6PK1000	MVB1000R6	6PK1264	MVB1260R6	6PK1558	MVB1560R6	6PK1744	MVB1740R6
6PK1005	MVB1000R6	6PK1264	MVB1270R6	6PK1558	MVB1570R6	6PK1745	MVB1740R6
6PK1013	MVB1015R6	6PK1270	MVB1260R6	6PK1560	MVB1550R6	6PK1750	MVB795R6
6PK1025	MVB1025R6	6PK1270	MVB1270R6	6PK1560	MVB1560R6	6PK1750	MVB1740R6
6PK1025	MVB1035R6	6PK1275	MVB1270R6	6PK1563	MVB1560R6	6PK1750	MVB1755R6
6PK1030	MVB1025R6	6PK1285	MVB1285R6	6PK1563	MVB1570R6	6PK1755	MVB1755R6
6PK1033	MVB1035R6	6PK1287	MVB1285R6	6PK1565	MVB1560R6	6PK1760	MVB1760R6
6PK1035	MVB1025R6	6PK1290	MVB1285R6	6PK1570	MVB1570R6	6PK1763	MVB1755R6
6PK1035	MVB1035R6	6PK1305	MVB1306R6	6PK1575	MVB1570R6	6PK1763	MVB1760R6
6PK1035	MVB1045R6	6PK1310	MVB1306R6	6PK1575	MVB1580R6	6PK1765	MVB1760R6
6PK1040	MVB1035R6	6PK1320	MVB1318R6	6PK1580	MVB1580R6	6PK1775	MVB1775R6
6PK1045	MVB1045R6	6PK1325	MVB1325R6	6PK1587	MVB1580R6	6PK1795	MVB1795R6
6PK1050	MVB1045R6	6PK1330	MVB1325R6	6PK1587	MVB1588R6	6PK1795	MVB1805R6
6PK1050	MVB1050R6	6PK1335	MVB1335R6	6PK1588	MVB1580R6	6PK1800	MVB1795R6
6PK1053	MVB1050R6	6PK1337	MVB1335R6	6PK1588	MVB1588R6	6PK1800	MVB1805R6
6PK1062	MVB1065R6	6PK1340	MVB1335R6	6PK1590	MVB1588R6	6PK1800	MVB1820R6
6PK1065	MVB1065R6	6PK1341	MVB1335R6	6PK1596	MVB1600R6	6PK1805	MVB1805R6
6PK1069	MVB1065R6	6PK1350	MVB1350R6	6PK1600	MVB1600R6	6PK1805	MVB1820R6
6PK1076	MVB1065R6	6PK1352	MVB1350R6	6PK1605	MVB1600R6	6PK1813	MVB1820R6
6PK1076	MVB1080R6	6PK1355	MVB1350R6	6PK1606	MVB1600R6	6PK1815	MVB1820R6
6PK1080	MVB1080R6	6PK1360	MVB1360R6	6PK1606	MVB1613R6	6PK1820	MVB1820R6
6PK1082	MVB1080R6	6PK1365	MVB1369R6	6PK1613	MVB1600R6	6PK1830	MVB1833R6
6PK1085	MVB1088R6	6PK1370	MVB1369R6	6PK1613	MVB1613R6	6PK1830	MVB1842R6
6PK1087	MVB1088R6	6PK1372	MVB1369R6	6PK1620	MVB1625R6	6PK1835	MVB1833R6
6PK1095	MVB1100R6	6PK1375	MVB1370R6	6PK1625	MVB1625R6	6PK1835	MVB1842R6
6PK1100	MVB1088R6	6PK1387	MVB1388R6	6PK1635	MVB1635R6	6PK1840	MVB1842R6
6PK1100	MVB1100R6	6PK1388	MVB1370R6	6PK1635	MVB1642R6	6PK1842	MVB1842R6
6PK1100	MVB1105R6	6PK1388	MVB1388R5	6PK1637	MVB1635R6	6PK1842	MVB1855R6
6PK1105	MVB1105R6	6PK1388	MVB1388R6	6PK1637	MVB1642R6	6PK1855	MVB1855R6
6PK1105	MVB1115R6	6PK1390	MVB1388R6	6PK1640	MVB1635R6	6PK1863	MVB1842R6
6PK1115	MVB1115R6	6PK1400	MVB1400R6	6PK1640	MVB1642R6	6PK1863	MVB1855R6



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents





DAYCO		DAYCO		DAYCO		DAYCO	
6PK1863	MVB1865R6	6PK2203	MVB2205R6	6PK1050S	MVB1050R6	7PK1600	MVB1588R7
6PK1865	MVB1865R6	6PK2210	MVB2120R6	6PK1055S	MVB1050R6	7PK1600	MVB1605R7
6PK1873	MVB1875R6	6PK2210	MVB2215R6	6PK1065HD	MVB1065R6	7PK1605	MVB1605R7
6PK1875	MVB1875R6	6PK2210	MVB2225R6	6PK1180S	MVB1180R6	7PK1625	MVB1635R7
6PK1880	MVB1875R6	6PK2213	MVB2215R6	6PK1195S	MVB1200R6	7PK1629	MVB1635R7
6PK1885	MVB1875R6	6PK2225	MVB2225R6	6PK1215S	MVB1215R6	7PK1633	MVB1635R7
6PK1885	MVB1885R6	6PK2240	MVB2240R6	6PK1255S	MVB1250R6	7PK1637	MVB1635R7
6PK1887	MVB1885R6	6PK2240	MVB2250R6	6PK1255S	MVB1270R6	7PK1637	MVB1638R7
6PK1890	MVB1885R6	6PK2240	MVB2265R6	6PK1270S	MVB1270R6	7PK1640	MVB1638R7
6PK1893	MVB1885R6	6PK2245	MVB2240R6	6PK1323S	MVB1318R6	7PK1675	MVB1675R7
6PK1900	MVB1904R6	6PK2245	MVB2250R6	6PK1360S	MVB1360R6	7PK1713	MVB1715R7
6PK1904	MVB1904R6	6PK2250	MVB2240R6	6PK1367S	MVB1369R6	7PK1715	MVB1715R7
6PK1910	MVB1913R6	6PK2250	MVB2250R6	6PK1390S	MVB1388R6	7PK1730	MVB1715R7
6PK1913	MVB1913R6	6PK2250	MVB2257R6	6PK1580S	MVB1580R6	7PK1730	MVB1730R7
6PK1915	MVB1913R6	6PK2250	MVB2265R6	6PK1592G	MVB1588R6	7PK1737	MVB1730R7
6PK1925	MVB1930R6	6PK2255	MVB2250R6	6PK1660HD	MVB1660R6	7PK1750	MVB1760R7
6PK1930	MVB1904R6	6PK2255	MVB2257R6	6PK1683S	MVB1685R6	7PK1759	MVB1760R7
6PK1930	MVB1930R6	6PK2255	MVB2265R6	6PK1722S	MVB1725R6	7PK1765	MVB1760R7
6PK1936	MVB1930R6	6PK2263	MVB2225R6	6PK1735S	MVB1740R6	7PK1766	MVB1760R7
6PK1937	MVB1930R6	6PK2263	MVB2265R6	6PK1740S	MVB1740R6	7PK1766	MVB1775R7
6PK1950	MVB1950R6	6PK2263	MVB2271R6	6PK1760S	MVB1760R6	7PK1770	MVB1775R7
6PK1955	MVB1950R6	6PK2275	MVB2271R6	6PK1815S	MVB1820R6	7PK1775	MVB1775R7
6PK1960	MVB1960R6	6PK2280	MVB2280R6	6PK1836S	MVB1833R6	7PK1784	MVB1785R7
6PK1963	MVB1960R6	6PK2285	MVB2280R6	6PK1836S	MVB1842R6	7PK1787	MVB1785R7
6PK1965	MVB1960R6	6PK2285	MVB2415R6	6PK1873EE	MVB1875R6	7PK1790	MVB1788R7
6PK1975	MVB1805R6	6PK2287	MVB2280R6	6PK1887S	MVB1885R6	7PK1793	MVB1788R7
6PK1975	MVB1980R6	6PK2290	MVB2280R6	6PK1965G	MVB1960R6	7PK1800	MVB1788R7
6PK1980	MVB1980R6	6PK2290	MVB2290R6	6PK2120S	MVB2120R6	7PK1800	MVB1800R7
6PK1990	MVB1995R6	6PK2300	MVB2300R6	6PK805S	MVB795R6	7PK1809	MVB1813R7
6PK1995	MVB1995R6	6PK2310	MVB2300R6	6PK905S	MVB906R6	7PK1813	MVB1813R7
6PK1997	MVB1980R6	6PK2320	MVB2325R6	6PKD1320	MVB1325R6D	7PK1820	MVB1813R7
6PK1997	MVB1995R6	6PK2325	MVB2325R6	6PKD1840	MVB1838R6D	7PK1825	MVB1813R7
6PK2000	MVB1995R6	6PK2345	MVB2350R6	6PKD1850	MVB1850R6D	7PK1853	MVB1855R7
6PK2000	MVB2300R6	6PK2350	MVB2350R6	6PKK1188	MVB1188R6D	7PK1855	MVB1855R7
6PK2020	MVB2020R6	6PK2360	MVB2350R6	6PKK1195	MVB1200R6D	7PK1870	MVB1889R7
6PK2030	MVB2020R6	6PK2375	MVB2373R6	6PKK1320	MVB1325R6D	7PK1887	MVB1889R7
6PK2030	MVB2030R6	6PK2385	MVB2380R6	6PKK1840	MVB1838R6D	7PK1905	MVB1910R7
6PK2050	MVB2050R6	6PK2385	MVB2390R6	6PKK1853	MVB1850R6D	7PK1930	MVB1933R7
6PK2055	MVB2050R6	6PK2387	MVB2380R6	7PK925	MVB920R7	7PK1950	MVB1952R7
6PK2055	MVB2063R6	6PK2387	MVB2390R6	7PK935	MVB935R7	7PK1955	MVB1952R7
6PK2063	MVB2063R6	6PK2413	MVB2415R6	7PK1035	MVB1035R7	7PK1969	MVB1969R7
6PK2070	MVB2063R6	6PK2415	MVB2415R6	7PK1045	MVB1035R7	7PK1970	MVB1969R7
6PK2080	MVB2080R6	6PK2440	MVB2450R6	7PK1076	MVB1083R7	7PK1975	MVB1788R7
6PK2087	MVB2080R6	6PK2450	MVB2440R6	7PK1083	MVB1083R7	7PK1975	MVB1969R7
6PK2090	MVB2100R6	6PK2450	MVB2450R6	7PK1095	MVB1090R7	7PK1975	MVB1980R6
6PK2100	MVB2100R6	6PK2460	MVB2440R6	7PK1127	MVB1125R7	7PK1980	MVB1969R7
6PK2113	MVB2120R6	6PK2460	MVB2460R6	7PK1148	MVB1150R7	7PK2000	MVB2000R7
6PK2115	MVB2120R6	6PK2463	MVB2440R6	7PK1153	MVB1150R7	7PK2050	MVB2050R7
6PK2120	MVB2120R6	6PK2463	MVB2460R6	7PK1180	MVB1180R7	7PK2250	MVB2265R7
6PK2120	MVB2125R6	6PK2465	MVB2460R6	7PK1220	MVB1200R7	7PK2265	MVB2265R7
6PK2130	MVB2125R6	6PK2475	MVB2475R6	7PK1240	MVB1240R7	7PK2275	MVB2271R7
6PK2135	MVB2135R6	6PK2489	MVB2490R6	7PK1275	MVB1270R7	7PK2285	MVB2271R7
6PK2137	MVB2135R6	6PK2490	MVB2490R6	7PK1285	MVB1285R7	7PK2290	MVB2271R7
6PK2145	MVB2135R6	6PK2504	MVB2510R6	7PK1287	MVB1285R7	7PK2335	MVB2337R7
6PK2145	MVB2145R6	6PK2510	MVB2510R6	7PK1290	MVB1285R7	7PK2365	MVB2365R7
6PK2155	MVB2160R6	6PK2515	MVB2510R6	7PK1385	MVB1388R7	7PK2417	MVB2418R7
6PK2160	MVB2160R6	6PK2525	MVB2540R6	7PK1387	MVB1388R7	7PK2703	MVB2710R7
6PK2163	MVB2160R6	6PK2550	MVB2553R6	7PK1400	MVB1400R7	7PK2705	MVB2710R7
6PK2170	MVB2170R6	6PK2555	MVB2553R6	7PK1473	MVB1475R7	7PK2713	MVB2710R7
6PK2195	MVB2190R6	6PK2581	MVB2585R6	7PK1475	MVB1475R7	7PK2872	MVB2875R7
6PK2195	MVB2196R6	6PK2585	MVB2585R6	7PK1575	MVB1580R7	7PK2875	MVB2875R7
6PK2195	MVB2205R6	6PK2613	MVB2613R6	7PK1580	MVB1580R7	7PKD1360	MVB1360R7D
6PK2200	MVB2190R6	6PK2615	MVB2613R6	7PK1587	MVB1588R7	7PKK1360	MVB1360R7D
6PK2200	MVB2196R6	6PK2625	MVB2625R6	7PK1595	MVB1588R7	8PK1226	MVB1230R8
6PK2200	MVB2205R6	6PK2680	MVB2680R6	7PK1595	MVB1605R7	8PK1230	MVB1230R8

DAYCO		DAYCO		DAYCO		DAYCO	
8PK2043	MVB2040R8	10A0840C	SVB10840	10A1100C	SVB101100	11A1030C	SVB121030
8PK2187	MVB2188R8	10A0850C	SVB10840	10A1100GL	SVB101100	11A1042C	SVB121030
8PK2190	MVB2188R8	10A0850C	SVB10850	10A1125C	SVB101113	11A1042C	SVB121040
8PK2190	MVB2205R6	10A0865C	SVB10865	10A1125C	SVB101125	11A1171C	SVB101175
8PK2337	MVB2338R8	10A0865C	SVB12865	10A1125GL	SVB101125	11A1171C	SVB121170
8PK2338	MVB2338R8	10A0875C	SVB10875	10A1140C	SVB101140	13A0610C	SVB13610
8PK2437	MVB2440R8	10A0875C	SVB10888	10A1150C	SVB101140	13A0635C	SVB13625
8PK2440	MVB2440R8	10A0875C	SVB10925	10A1150C	SVB101150	13A0655C	SVB13655
8PK2463	MVB2460R8	10A0875C	SVB10960	10A1175C	SVB101175	13A0675C	SVB13655
8PK2465	MVB2460R8	10A0888C	SVB10875	10A1175C	SVB121170	13A0675C	SVB13675
8PK2490	MVB2488R8	10A0888C	SVB10888	10A1200C	SVB101200	13A0710C	SVB13710
8PK1230HD	MVB1230R8	10A0888C	SVB12885	10A1210C	SVB101215	13A0725C	SVB13725
8PK1400HD	MVB1400R8	10A0900C	SVB10750	10A1210C	SVB101225	13A0750C	SVB13750
8PK1480HD	MVB1480R8	10A0900C	SVB10888	10A1215C	SVB101215	13A0775C	SVB13775
8PK2055HD	MVB2040R8	10A0900C	SVB10900	10A1225C	SVB101225	13A0775C	SVB13780
10A0545C	SVB10550	10A0913C	SVB10913	10A1225C	SVB131250	13A0780C	SVB13780
10A0550C	SVB10550	10A0915C	SVB10840	10A1235C	SVB101237	13A0790C	SVB13800
10A0590C	SVB10600	10A0915C	SVB10900	10A1250C	SVB101250	13A0800C	SVB13800
10A0595C	SVB10600	10A0915C	SVB10913	10A1250GL	SVB101250	13A0825C	SVB13800
10A0600C	SVB10600	10A0915C	SVB10925	10A1275C	SVB101275	13A0825C	SVB13825
10A0610C	SVB10610	10A0925C	SVB10875	10A1300C	SVB101300	13A0825C	SVB13850
10A0615C	SVB10610	10A0925C	SVB10913	10A1350C	SVB101350	13A0835C	SVB13825
10A0617C	SVB10610	10A0925C	SVB10925	10A1350GL	SVB101350	13A0838R	SVB13825
10A0625C	SVB10625	10A0925C	SVB10940	10A1375GL	SVB101050	13A0850C	SVB13825
10A0625C	SVB10635	10A0930C	SVB10925	10A1375GL	SVB101375	13A0850C	SVB13840
10A0635C	SVB10635	10A0935C	SVB10940	10A1400C	SVB101400	13A0850C	SVB13850
10A0636C	SVB10635	10A0940C	SVB10940	10A1400GL	SVB101400	13A0850C	SVB13875
10A0650C	SVB10650	10A0940C	SVB10950	10A1525GL	SVB101525	13A0875C	SVB13875
10A0650C	SVB10665	10A0950C	SVB10940	10AV0900	MVB1360R5	13A0875C	SVB13900
10A0653C	SVB10650	10A0950C	SVB10950	10AV0950	MVB1875R6	13A0885C	SVB13875
10A0665C	SVB10650	10A0950GL	SVB10950	11A0528C	SVB12528	13A0890C	SVB13900
10A0665C	SVB10665	10A0950GL	SVB13950	11A0650C	SVB10650	13A0900C	SVB13850
10A0665C	SVB10675	10A0960C	SVB10960	11A0650C	SVB12650	13A0900C	SVB13875
10A0675C	SVB10675	10A0960C	SVB12950	11A0670C	SVB10665	13A0900C	SVB13900
10A0675C	SVB10690	10A0960GL	SVB10975	11A0670C	SVB12670	13A0900C	SVB13925
10A0683C	SVB10690	10A0975C	SVB10960	11A0685C	SVB10675	13A0903C	SVB13900
10A0690C	SVB10690	10A0975C	SVB10975	11A0685C	SVB10690	13A0903C	SVB13925
10A0700C	SVB10700	10A0975GL	SVB10975	11A0685C	SVB12685	13A0914R	SVB13925
10A0700C	SVB10710	10A0990C	SVB10990	11A0710C	SVB12710	13A0925C	SVB13850
10A0710C	SVB10610	10A1000C	SVB101000	11A0760C	SVB10750	13A0925C	SVB13900
10A0710C	SVB10710	10A1000C	SVB121015	11A0760C	SVB10760	13A0925C	SVB13925
10A0725C	SVB10725	10A1000GL	SVB101000	11A0760C	SVB12760	13A0925C	SVB13950
10A0725C	SVB10740	10A1010C	SVB101010	11A0768C	SVB10775	13A0950C	SVB13950
10A0725C	SVB12735	10A1010C	SVB121015	11A0768C	SVB12770	13A0950C	SVB131000
10A0735C	SVB10725	10A1015HD	SVB101010	11A0793C	SVB10790	13A0950GL	SVB13950
10A0735C	SVB10735	10A1025C	SVB101025	11A0793C	SVB10800	13A0950HD	SVB13950
10A0735C	SVB10740	10A1025C	SVB101050	11A0793C	SVB12795	13A0965C	SVB13975
10A0740C	SVB10740	10A1025C	SVB121040	11A0825C	SVB10825	13A0975C	SVB13975
10A0750C	SVB10750	10A1025GL	SVB101025	11A0825C	SVB12825	13A0975HD	SVB13950
10A0750C	SVB12760	10A1045HD	SVB101050	11A0865C	SVB10865	13A0975HD	SVB13975
10A0760C	SVB10760	10A1050C	SVB101025	11A0865C	SVB12865	13A1000C	SVB131000
10A0775C	SVB10775	10A1050C	SVB101050	11A0876C	SVB10875	13A1000C	SVB131025
10A0775C	SVB10790	10A1050GL	SVB101050	11A0876C	SVB12875	13A1000GL	SVB131000
10A0778C	SVB10775	10A1050GL	SVB101075	11A0885C	SVB10888	13A1000HD	SVB131000
10A0785C	SVB10790	10A1055C	SVB101050	11A0885C	SVB12885	13A1015C	SVB131000
10A0800C	SVB10790	10A1062C	SVB101060	11A0900C	SVB10900	13A1015C	SVB131015
10A0800C	SVB10800	10A1062C	SVB101075	11A0910C	SVB10900	13A1015C	SVB131025
10A0800C	SVB10813	10A1075C	SVB101050	11A0910C	SVB10913	13A1025C	SVB131000
10A0800C	SVB12795	10A1075C	SVB101060	11A0910C	SVB10940	13A1025C	SVB131015
10A0813C	SVB10800	10A1075C	SVB101075	11A0950C	SVB10960	13A1025C	SVB131025
10A0813C	SVB10813	10A1075GL	SVB101075	11A0950C	SVB12950	13A1025C	SVB131050
10A0825C	SVB10825	10A1085C	SVB101075	11A1005C	SVB101010	13A1025GL	SVB131025
10A0825C	SVB10840	10A1085C	SVB101090	11A1005C	SVB121015	13A1025HD	SVB131025
10A0835C	SVB10825	10A1090C	SVB101090	11A1030C	SVB101010	13A1035C	SVB131025
10A0835C	SVB10840	10A1100C	SVB101025	11A1030C	SVB101025	13A1035C	SVB131050



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents





DAYCO		DAYCO		DAYCO		DAYCO	
13A1040C	SVB131050	22475C	SVB171205	94326	TB390	94537	TB682
13A1050C	SVB131050	94005	TB521	94328	TB156	94541	TB590
13A1063C	SVB131075	94036	TB282	94329	TB422	94556	TB453
13A1065GL	SVB131075	94068	TB362	94330	TB421	94557	TB459
13A1075C	SVB131075	94112	TB239	94331	TB376	94566	TB478
13A1075GL	SVB131075	94120	TB256	94335	TB399	94567	TB470
13A1077C	SVB131075	94129	TB356	94337	TB403	94582	TB444
13A1077C	SVB131085	94131	TB309	94340	TB290	94588	TB471
13A1100C	SVB131000	94135	TB312	94345	TB333	94589	TB462
13A1110C	SVB131125	94136	TB667	94349	TB328	94590	TB468
13A1125C	SVB131125	94137	TB355	94352	TB527	94591	TB732
13A1145GL	SVB131150	94141	TB563	94356	TB297	94592	TB608
13A1150C	SVB131150	94142	TB263	94357	TB304	94593	TB608
13A1150C	SVB131175	94144	TB358	94359	TB271	94594	TB660
13A1150HD	SVB131150	94147	TB322	94361	TB156	94596	TB550
13A1175C	SVB131150	94152	TB401	94368	TB622	94597	TB409
13A1175C	SVB131175	94154	TB266	94371	TB295	94600	TB434
13A1180C	SVB131175	94156	TB272	94379	TB237	94604	TB441
13A1196C	SVB131200	94158	TB316	94390	TB334	94605	TB413
13A1225C	SVB131225	94160	TB545	94394	TB502	94616	TB548
13A1250GL	SVB131250	94163	TB317	94397	TB280	94618	TB450
13A1253C	SVB131250	94165	TB517	94398	TB301	94621	TB551
13A1275C	SVB131275	94166	TB519	94399	TB234	94621	TB758
13A1275GL	SVB131250	94167	TB311	94402	TB347	94647	TB727
13A1290HD	SVB131300	94175	TB213	94404	TB374	94650	TB336
13A1300GL	SVB131300	94177	TB302	94405	TB375	94651	TB412
13A1300HD	SVB131300	94179	TB202	94406	TB300	94652	TB505
13A1325C	SVB131325	94181	TB203	94408	TB382	94655	TB437
13A1325GL	SVB131325	94187	TB419	94410	TB372	94657	TB440
13A1335GL	SVB131325	94189	TB520	94413	TB386	94658	TB359
13A1335GL	SVB131350	94189	TB550	94417	TB373	94659	TB783
13A1350C	SVB131350	94191	TB319	94433	TB378	94660	TB537
13A1350GL	SVB131325	94193	TB129	94435	TB579	94662	TB508
13A1350GL	SVB131350	94195	TB326	94439	TB368	94664	TB558
13A1350HD	SVB131325	94195	TB739	94440	TB251	94665	TB715
13A1350HD	SVB131350	94197	TB597	94441	TB252	94671	TB472
13A1365HD	SVB131375	94202	TB198	94444	TB518	94673	TB367
13A1375C	SVB131375	94206	TB294	94451	TB281	94674	TB528
13A1375GL	SVB131375	94208	TB616	94460	TB538	94675	TB559
13A1375HD	SVB131375	94210	TB289	94461	TB565	94676	TB539
13A1400GL	SVB131400	94211	TB257	94463	TB407	94679	TB803
13A1400HD	SVB131400	94212	TB354	94464	TB793	94687	TB467
13A1405C	SVB131400	94213	TB353	94465	TB692	94688	TB496
13A1410GL	SVB131425	94216	TB366	94467	TB404	94689	TB504
13A1425C	SVB131425	94224	TB175	94468	TB406	94692	TB457
13A1425GL	SVB131425	94224	TB560	94469	TB377	94693	TB466
13A1425GL	SVB131475	94233	TB521	94471	TB393	94695	TB405
13A1425HD	SVB131425	94234	TB240	94480	TB701	94696	TB495
13A1430HD	SVB131425	94253	TB201	94488	TB430	94697	TB513
13A1444HD	SVB131450	94256	TB259	94489	TB365	94698	TB477
13A1450C	SVB131450	94265	TB320	94491	TB474	94709	TB637
13A1450GL	SVB131450	94265	TB468	94492	TB397	94713	TB639
13A1450HD	SVB131450	94269	TB400	94494	TB380	94714	TB479
13A1475GL	SVB131475	94285	TB381	94495	TB673	94721	TB460
13A1475HD	SVB131475	94287	TB371	94510	TB379	94723	TB506
13A1500C	SVB131500	94289	TB445	94522	TB490	94724	TB454
13A1500GL	SVB131500	94290	TB435	94523	TB695	94725	TB469
13A1510GL	SVB131500	94296	TB330	94524	TB473	94725	TB521
17A1055C	SVB171045	94300	TB242	94527	TB431	94726	TB447
17A1055C	SVB171055	94305	TB361	94528	TB674	94730	TB552
65PK1340	MVB1335R6	94305	TB610	94530	TB456	94731	TB357
22335C	SVB17850	94316	TB314	94532	TB226	94733	TB671
22335C	SVB171115	94319	TB451	94534	TB804	94734	TB792
22395C	SVB171000	94323	TB285	94535	TB762	94735	TB402
22415C	SVB171055	94324	TB389	94536	TB705	94736	TB325





DAYCO		DAYCO		DAYCO		DAYCO	
94737	TB463	94885	TB680	941014	TB634	KTB282	TBK077
94740	TB525	94893	TB736	941018	TB724	KTB283	TBK334
94741	TB703	94896	TB290	941019	TB710	KTB285	TBK313
94753	TB651	94897	TB738	941020	TB735	KTB288	TBK122
94754	TB650	94904	TB786	941021	TB292	KTB289	TBK323
94755	TB642	94905	TB683	941023	TB748	KTB290	TBK323
94757	TB546	94905	TB744	941025	TB458	KTB291	TBK277
94758	TB487	94906	TB640	941028	TB751	KTB292	TBK314
94763	TB428	94908	TB710	KTB101	TBK005	KTB293	TBK303
94764	TB684	94909	TB724	KTB102	TBK007	KTB294	TBK305
94766	TB706	94910	TB712	KTB103	TBK030	KTB296	TBK270
94767	TB439	94910	TB720	KTB104	TBK009	KTB298	TBK275
94769	TB509	94911	TB678	KTB105	TBK019	KTB300/1	TBK045
94771	TB492	94919	TB679	KTB106	TBK002	KTB302/1	TBK063
94772	TB545	94923	TB720	KTB108	TBK017	KTB305	TBK037
94774	TB785	94926	TB702	KTB109	TBK047	KTB306	TBK039
94775	TB557	94929	TB258	KTB110	TBK098	KTB307	TBK102
94777	TB554	94930	TB796	KTB111	TBK117	KTB308	TBK103
94782	TB482	94932	TB749	KTB113	TBK004	KTB310	TBK230
94783	TB368	94933	TB728	KTB114	TBK010	KTB315	TBK345
94785	TB529	94934	TB370	KTB115	TBK020	KTB317	TBK283
94786	TB717	94935	TB629	KTB117	TBK013	KTB321	TBK315
94787	TB638	94936	TB655	KTB118	TBK049	KTB322	TBK301
94789	TB643	94938	TB709	KTB119	TBK035	KTB328	TBK323
94790	TB747	94939	TB653	KTB131	TBK281	KTB329	TBK356
94791	TB536	94941	TB384	KTB133	TBK282	KTB331	TBK207
94792	TB730	94942	TB533	KTB144	TBK041	KTB333	TBK318
94801	TB633	94942	TB797	KTB152	TBK029	KTB335	TBK308
94807	TB694	94943	TB654	KTB157	TBK309	KTB336	TBK312
94808	TB631	94944	TB713	KTB165	TBK113	KTB337	TBK316
94809	TB491	94945	TB647	KTB170	TBK028	KTB341	TBK320
94810	TB701	94946	TB704	KTB173	TBK111	KTB342	TBK225
94822	TB493	94947	TB656	KTB174	TBK092	KTB344	TBK279
94823	TB488	94949	TB716	KTB187	TBK344	KTB344	TBK304
94824	TB524	94950	TB787	KTB189	TBK025	KTB346	TBK302
94825	TB481	94951	TB705	KTB189	TBK026	KTB347	TBK246
94826	TB436	94955	TB535	KTB190	TBK119	KTB359	TBK263
94827	TB534	94957	TB700	KTB191	TBK026	KTB360	TBK107
94829	TB541	94958	TB725	KTB192	TBK033	KTB360	TBK272
94830	TB553	94959	TB722	KTB194	TBK090	KTB361	TBK103
94832	TB540	94962	TB723	KTB195	TBK099	KTB361	TBK240
94833	TB780	94968	TB714	KTB196	TBK105	KTB367	TBK348
94835	TB556	94969	TB740	KTB197	TBK106	KTB368	TBK353
94836	TB739	94970	TB743	KTB197	TBK274	KTB397	TBK091
94837	TB708	94971	TB745	KTB199	TBK094	KTB402	TBK076
94838	TB707	94972	TB718	KTB201	TBK016	KTB403	TBK024
94839	TB641	94973	TB760	KTB221	TBK008	KTB404	TBK330
94840	TB632	94974	TB741	KTB250	TBK121	KTB407	TBK326
94841	TB542	94975	TB742	KTB251	TBK278	KTB407	TBK327
94843	TB464	94976	TB790	KTB252	TBK260	KTB417	TBK319
94843	TB555	94977	TB794	KTB253	TBK100	KTB429	TBK116
94846	TB681	94978	TB652	KTB254	TBK032	KTB441	TBK262
94847	TB636	94979	TB753	KTB255	TBK087	KTB443	TBK332
94850	TB305	94980	TB687	KTB256	TBK088	KTB453	TBK104
94853	TB455	94982	TB756	KTB257	TBK261	KTB455	TBK338
94854	TB398	94987	TB639	KTB259	TBK096	KTB460	TBK267
94856	TB805	94992	TB685	KTB262	TBK110	KTB463	TBK331
94857	TB503	94996	TB721	KTB263	TBK099	KTB464	TBK333
94860	TB649	94997	TB636	KTB265	TBK086	KTB465	TBK275
94861	TB676	941001	TB384	KTB266	TBK093	KTB467	TBK322
94862	TB711	941004	TB657	KTB267	TBK112	KTB470	TBK278
94863	TB699	941006	TB713	KTB269	TBK089	KTB474	TBK301
94869	TB731	941008	TB797	KTB271	TBK267	KTB475	TBK341
94872	TB644	941009	TB681	KTB279	TBK097	KTB476	TBK273
94884	TB726	941013	TB658	KTB280	TBK038	KTB481	TBK348



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents





DAYCO		GATES		GATES		GATES	
KTB483	TBK101	3PK0500	MVB500R3	4PK803	MVB800R4	4PK1708	MVB1713R4
KTB484	TBK115	3PK0513	MVB513R3	4PK813	MVB810R4	4PK1770	MVB1775R4
KTB485	TBK357	3PK540	MVB538R3	4PK823	MVB825R4	5PK580	MVB575R5
KTB492	TBK355	3PK560	MVB563R3	4PK833	MVB835R4	5PK635	MVB638R5
KTB493	TBK302	3PK595	MVB600R3	4PK840	MVB835R4	5PK655	MVB650R5
KTB495	TBK336	3PK628	MVB625R3	4PK840	MVB841R4	5PK675	MVB675R5
		3PK628	MVB630R3	4PK845	MVB845R4	5PK683	MVB688R5
		3PK648	MVB648R3	4PK850	MVB850R4	5PK690	MVB688R5
		3PK648	MVB650R3	4PK855	MVB855R4	5PK700	MVB700R5
		3PK668	MVB668R3	4PK855	MVB860R4	5PK708	MVB710R5
		3PK675	MVB673R3	4PK860	MVB860R4	5PK718	MVB710R5
		3PK675	MVB675R3	4PK868	MVB870R4	5PK725	MVB725R5
		3PK690	MVB690R3	4PK878	MVB875R4	5PK738	MVB735R5
		3PK715	MVB715R3	4PK885	MVB885R4	5PK768	MVB768R5
		3PK730	MVB735R3	4PK885	MVB887R4	5PK778	MVB775R5
		3PK738	MVB735R3	4PK890	MVB885R4	5PK788	MVB788R5
		3PK763	MVB760R3	4PK890	MVB887R4	5PK803	MVB800R5
		3PK763	MVB765R3	4PK898	MVB900R4	5PK810	MVB813R5
		3PK775	MVB775R3	4PK905	MVB900R4	5PK820	MVB825R5
		3PK783	MVB780R3	4PK905	MVB905R4	5PK828	MVB830R5
		3PK783	MVB785R3	4PK913	MVB915R4	5PK838	MVB836R5
		3PK800	MVB800R3	4PK923	MVB920R4	5PK848	MVB845R5
		3PK808	MVB813R3	4PK928	MVB925R4	5PK848	MVB850R5
		3PK815	MVB810R3	4PK938	MVB940R4	5PK858	MVB865R5
		3PK815	MVB813R3	4PK948	MVB945R4	5PK865	MVB865R5
		3PK828	MVB825R3	4PK948	MVB950R4	5PK870	MVB869R5
		3PK838	MVB838R3	4PK955	MVB960R4	5PK880	MVB875R5
		3PK848	MVB850R3	4PK960	MVB960R4	5PK885	MVB887R5
		3PK853	MVB850R3	4PK965	MVB960R4	5PK890	MVB887R5
		3PK878	MVB872R3	4PK970	MVB970R4	5PK903	MVB900R5
		3PK890	MVB887R3	4PK970	MVB975R4	5PK908	MVB906R5
		3PK913	MVB915R3	4PK978	MVB975R4	5PK918	MVB915R5
		3PK935	MVB940R3	4PK985	MVB985R4	5PK923	MVB925R5
		3PK945	MVB940R3	4PK993	MVB995R4	5PK933	MVB938R5
		3PK960	MVB960R3	4PK1003	MVB1000R4	5PK940	MVB938R5
		3PK973	MVB975R3	4PK1003	MVB1005R4	5PK948	MVB950R5
		3PK1005	MVB1000R3	4PK1013	MVB1015R4	5PK955	MVB950R5
		3PK1025	MVB1025R3	4PK1020	MVB1020R4	5PK955	MVB955R4
		3PK1040	MVB1035R3	4PK1020	MVB1025R4	5PK963	MVB960R5
		3PK1220	MVB1215R3	4PK1028	MVB1025R4	5PK970	MVB970R5
		4PK545	MVB545R4	4PK1038	MVB1040R4	5PK970	MVB975R5
		4PK560	MVB563R4	4PK1048	MVB1045R4	5PK978	MVB975R5
		4PK595	MVB588R4	4PK1048	MVB1050R4	5PK985	MVB985R5
		4PK613	MVB611R4	4PK1058	MVB1050R4	5PK998	MVB1000R5
		4PK613	MVB613R4	4PK1063	MVB1065R4	5PK1005	MVB1000R5
		4PK635	MVB640R4	4PK1083	MVB1080R4	5PK1013	MVB1015R5
		4PK643	MVB648R4	4PK1090	MVB1090R4	5PK1023	MVB1030R5
		4PK655	MVB648R4	4PK1100	MVB1100R4	5PK1030	MVB1030R5
		4PK668	MVB663R4	4PK1108	MVB1110R4	5PK1030	MVB1035R5
		4PK675	MVB673R4	4PK1123	MVB1125R4	5PK1040	MVB1035R5
		4PK698	MVB698R4	4PK1165	MVB1165R4	5PK1040	MVB1040R5
		4PK698	MVB700R4	4PK1170	MVB1165R4	5PK1053	MVB1050R5
		4PK708	MVB706R4	4PK1183	MVB1190R4	5PK1063	MVB1060R5
		4PK718	MVB715R4	4PK1218	MVB1215R4	5PK1063	MVB1065R5
		4PK728	MVB725R4	4PK1230	MVB1230R4	5PK1090	MVB1090R5
		4PK738	MVB735R4	4PK1240	MVB1238R4	5PK1103	MVB1100R5
		4PK750	MVB755R4	4PK1245	MVB1245R4	5PK1113	MVB1110R5
		4PK755	MVB747R4	4PK1260	MVB1260R4	5PK1123	MVB1120R5
		4PK755	MVB755R4	4PK1268	MVB1272R4	5PK1133	MVB1135R5
		4PK765	MVB763R4	4PK1325	MVB1325R4	5PK1140	MVB1141R5
		4PK773	MVB775R4	4PK1420	MVB1420R4	5PK1153	MVB1150R6
		4PK773	MVB870R4	4PK1483	MVB1488R4	5PK1153	MVB1155R5
		4PK780	MVB775R4	4PK1510	MVB1510R4	5PK1163	MVB1165R5
		4PK788	MVB790R4	4PK1520	MVB1520R4	5PK1173	MVB1175R5
		4PK795	MVB800R4	4PK1708	MVB1708R4	5PK1193	MVB1188R5





GATES		GATES		GATES		GATES	
5PK1200	MVB1200R5	6PK900	MVB900R6	6PK1463	MVB1460R5	6PK2063	MVB2063R6
5PK1205	MVB1200R5	6PK905	MVB906R6	6PK1463	MVB1460R6	6PK2075	MVB2080R6
5PK1210	MVB1215R5	6PK913	MVB915R6	6PK1470	MVB1469R6	6PK2083	MVB2080R6
5PK1220	MVB1225R5	6PK923	MVB925R6	6PK1478	MVB1488R6	6PK2100	MVB2100R6
5PK1230	MVB1225R5	6PK938	MVB938R6	6PK1488	MVB1488R6	6PK2115	MVB2120R6
5PK1230	MVB1230R5	6PK948	MVB946R6	6PK1513	MVB1513R6	6PK2120	MVB2120R6
5PK1243	MVB1240R5	6PK965	MVB962R6	6PK1530	MVB1530R6	6PK2128	MVB2125R6
5PK1250	MVB1255R5	6PK975	MVB975R6	6PK1540	MVB1538R6	6PK2138	MVB2135R6
5PK1255	MVB1255R5	6PK985	MVB986R6	6PK1548	MVB1550R6	6PK2145	MVB2145R6
5PK1260	MVB1255R5	6PK995	MVB1000R6	6PK1555	MVB1550R6	6PK2160	MVB2160R6
5PK1260	MVB1263R5	6PK1000	MVB1000R6	6PK1560	MVB1560R6	6PK2175	MVB2170R6
5PK1270	MVB1270R5	6PK1010	MVB1015R6	6PK1565	MVB1560R6	6PK2193	MVB2190R6
5PK1280	MVB1285R5	6PK1018	MVB1015R6	6PK1573	MVB1570R6	6PK2198	MVB2196R6
5PK1290	MVB1285R5	6PK1028	MVB1025R6	6PK1583	MVB1580R6	6PK2203	MVB2205R6
5PK1303	MVB1300R5	6PK1033	MVB1035R6	6PK1590	MVB1588R6	6PK2213	MVB2215R6
5PK1343	MVB1345R5	6PK1038	MVB1035R6	6PK1600	MVB1600R6	6PK2223	MVB2225R6
5PK1355	MVB1360R5	6PK1043	MVB1045R6	6PK1605	MVB1600R6	6PK2228	MVB2225R6
5PK1368	MVB1370R5	6PK1053	MVB1050R6	6PK1613	MVB1613R6	6PK2238	MVB2240R6
5PK1375	MVB1375R5	6PK1060	MVB1065R6	6PK1623	MVB1625R6	6PK2245	MVB2250R6
5PK1390	MVB1388R5	6PK1070	MVB1065R6	6PK1633	MVB1635R6	6PK2253	MVB2250R6
5PK1435	MVB1432R5	6PK1078	MVB1080R6	6PK1640	MVB1642R6	6PK2260	MVB2265R6
5PK1453	MVB1450R5	6PK1088	MVB1088R6	6PK1650	MVB1650R6	6PK2270	MVB2271R6
5PK1495	MVB1500R5	6PK1098	MVB1100R6	6PK1655	MVB1650R6	6PK2285	MVB2280R6
5PK1515	MVB1515R5	6PK1103	MVB1105R6	6PK1660	MVB1660R6	6PK2285	MVB2290R6
5PK1545	MVB1550R5	6PK1113	MVB1115R6	6PK1670	MVB1675R6	6PK2305	MVB2300R6
5PK1570	MVB1575R5	6PK1123	MVB1125R6	6PK1678	MVB1675R6	6PK2330	MVB2325R6
5PK1590	MVB1588R6	6PK1130	MVB1130R6	6PK1685	MVB1685R6	6PK2345	MVB2350R6
5PK1590	MVB1590R5	6PK1138	MVB1137R6	6PK1685	MVB1690R6	6PK2358	MVB2350R6
5PK1610	MVB1610R5	6PK1148	MVB1150R6	6PK1693	MVB1690R6	6PK2373	MVB2373R6
5PK1645	MVB1638R5	6PK1153	MVB1155R6	6PK1700	MVB1700R6	6PK2373	MVB2375R6
5PK1683	MVB1680R5	6PK1163	MVB1165R6	6PK1718	MVB1715R6	6PK2380	MVB2380R6
5PK1720	MVB1725R5	6PK1183	MVB1180R6	6PK1725	MVB1725R6	6PK2390	MVB2390R6
5PK1750	MVB1750R5	6PK1190	MVB1190R6	6PK1730	MVB1725R6	6PK2413	MVB2415R6
5PK1765	MVB1765R5	6PK1195	MVB1200R6	6PK1735	MVB1740R6	6PK2448	MVB2450R6
5PK1790	MVB1790R5	6PK1203	MVB1200R6	6PK1740	MVB1740R6	6PK2460	MVB2440R6
5PK1815	MVB1815R5	6PK1210	MVB1215R6	6PK1745	MVB1740R6	6PK2460	MVB2460R6
5PK1885	MVB1885R5	6PK1218	MVB1215R6	6PK1753	MVB1755R6	6PK2465	MVB2460R6
5PK2030	MVB2025R5	6PK1238	MVB1238R6	6PK1763	MVB1760R6	6PK2478	MVB2475R6
5PK2063	MVB2060R5	6PK1250	MVB1250R6	6PK1778	MVB1775R6	6PK2490	MVB2490R6
5PK1010ES	MVB1015R5	6PK1255	MVB1250R6	6PK1795	MVB1795R6	6PK2513	MVB2510R6
5PK1230ES	MVB1225R5	6PK1263	MVB1260R6	6PK1803	MVB1805R6	6PK2535	MVB2540R6
5PK1540ES	MVB1538R5	6PK1270	MVB1270R6	6PK1818	MVB1820R6	6PK2550	MVB2553R6
6DPK1188	MVB1188R6D	6PK1275	MVB1270R6	6PK1835	MVB1833R6	6PK2585	MVB2585R6
6DPK1195	MVB1200R6D	6PK1285	MVB1285R6	6PK1840	MVB1842R6	6PK2613	MVB2613R6
6DPK1320	MVB1325R6D	6PK1290	MVB1285R6	6PK1853	MVB1855R6	6PK2625	MVB2625R6
6DPK1838	MVB1838R6D	6PK1305	MVB1306R6	6PK1863	MVB1865R6	6PK2680	MVB2680R6
6DPK1853	MVB1850R6D	6PK1306	MVB1306R6	6PK1873	MVB1875R6	6PK1018ES	MVB1015R6
6PK678	MVB675R6	6PK1310	MVB1306R6	6PK1880	MVB1875R6	6PK1065ES	MVB1065R6
6PK700	MVB698R6	6PK1318	MVB1318R6	6PK1888	MVB1885R6	6PK1080ES	MVB1080R6
6PK720	MVB715R6	6PK1320	MVB1318R6	6PK1893	MVB1885R6	6PK1245ES	MVB1250R6
6PK730	MVB730R6	6PK1328	MVB1325R6	6PK1903	MVB1904R6	6PK1350ES	MVB1350R6
6PK738	MVB736R6	6PK1328	MVB1330R6	6PK1910	MVB1913R6	6PK1425ES	MVB1420R6
6PK745	MVB750R6	6PK1340	MVB1335R6	6PK1915	MVB1913R6	6PK1590XS	MVB1588R6
6PK750	MVB750R6	6PK1353	MVB1350R6	6PK1928	MVB1930R6	6PK1620XS	MVB1625R6
6PK803	MVB795R6	6PK1353	MVB1352R6	6PK1938	MVB1930R6	6PK1660ES	MVB1660R6
6PK818	MVB825R6	6PK1360	MVB1360R6	6PK1950	MVB1950R6	6PK1755XS	MVB1755R6
6PK825	MVB825R6	6PK1368	MVB1369R6	6PK1955	MVB1950R6	6PK1830XS	MVB1833R6
6PK843	MVB838R6	6PK1375	MVB1370R6	6PK1965	MVB1960R6	6PK1850ES	MVB1855R6
6PK853	MVB850R6	6PK1390	MVB1388R6	6PK1973	MVB1980R6	6PK1885ES	MVB1885R6
6PK860	MVB860R6	6PK1400	MVB1400R6	6PK1980	MVB1980R6	6PK1930XS	MVB1930R6
6PK865	MVB860R6	6PK1413	MVB1413R6	6PK1990	MVB1995R6	6PK1980ES	MVB1980R6
6PK870	MVB870R6	6PK1420	MVB1420R6	6PK2000	MVB1995R6	6PK2000ES	MVB1995R6
6PK870	MVB875R6	6PK1438	MVB1440R6	6PK2020	MVB2020R6	6PK2030ES	MVB2030R6
6PK883	MVB884R6	6PK1445	MVB1450R6	6PK2033	MVB2030R6	6PK2050ES	MVB2050R6
6PK893	MVB890R6	6PK1453	MVB1450R6	6PK2053	MVB2050R6	6PK2080ES	MVB2080R6



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents





GATES		GATES		GATES		GATES	
6PK2100ES	MVB2100R6	7PK2710XS	MVB2710R7	5053	TB207	5123	TB603
6PK2120ES	MVB2120R6	7PK2875XS	MVB2875R7	5054	TB227	5124	TB232
6PK2245ES	MVB2250R6	8PK1225	MVB1230R8	5055XS	TB201	5125	TB134
6PK2257ES	MVB2257R6	8PK1230	MVB1230R8	5056	TB195	5127	TB218
6PK2415ES	MVB2415R6	8PK2035	MVB2040R8	5057XS	TB473	5127XS	TB304
6PK995ES	MVB1000R6	8PK2188	MVB2188R8	5058	TB421	5128	TB211
7DPK1360	MVB1360R7D	8PK2275	MVB2275R8	5058XS	TB421	5129	TB224
7PK920	MVB920R7	8PK2335	MVB2338R8	5059	TB422	5130XS	TB256
7PK935	MVB935R7	8PK2440	MVB2440R8	5059XS	TB422	5131	TB420
7PK1035	MVB1035R7	8PK2465	MVB2460R8	5060XS	TB521	5133	TB262
7PK1043	MVB1035R7	8PK2485	MVB2488R8	5061XS	TB503	5134	TB254
7PK1078	MVB1083R7	8PK1230ES	MVB1230R8	5062	TB177	5135	TB255
7PK1095	MVB1090R7	8PK1400ES	MVB1400R8	5063	TB197	5138	TB230
7PK1113	MVB1115R7	8PK1480ES	MVB1480R8	5064	TB223	5146	TB128
7PK1125	MVB1125R7	8PK2045ES	MVB2040R8	5065	TB143	5149XS	TB212
7PK1148	MVB1150R7	8PK2585ES	MVB2585R8	5066	TB186	5151	TB388
7PK1153	MVB1150R7	5001	TB101	5067	TB169	5153	TB343
7PK1178	MVB1180R7	5002	TB102	5068	TB101	5160	TB170
7PK1220	MVB1200R7	5003	TB114	5069	TB102	5166	TB188
7PK1220	MVB1220R7	5004	TB112	5070	TB204	5170XS	TB355
7PK1243	MVB1240R7	5005	TB113	5071	TB577	5171XS	TB522
7PK1275	MVB1270R7	5006	TB106	5072	TB267	5175XS	TB259
7PK1283	MVB1285R7	5008	TB110	5074XS	TB302	5176	TB225
7PK1290	MVB1285R7	5010	TB571	5075XS	TB213	5177	TB305
7PK1388	MVB1388R7	5014	TB115	5076	TB164	5177XS	TB305
7PK1395	MVB1400R7	5015	TB107	5077	TB241	5178	TB337
7PK1473	MVB1475R7	5016	TB108	5078	TB344	5179	TB306
7PK1580	MVB1580R7	5017	TB567	5079	TB351	5180	TB307
7PK1593	MVB1588R7	5018	TB121	5080	TB303	5182XS	TB504
7PK1605	MVB1605R7	5019	TB123	5081	TB200	5183XS	TB505
7PK1633	MVB1635R7	5020	TB118	5082XS	TB202	5185	TB265
7PK1640	MVB1638R7	5021	TB103	5083	TB218	5186	TB338
7PK1678	MVB1675R7	5022	TB122	5084XS	TB203	5188XS	TB667
7PK1715	MVB1715R7	5023	TB104	5085	TB260	5190XS	TB361
7PK1730	MVB1730R7	5024	TB124	5086	TB264	5191	TB308
7PK1760	MVB1760R7	5025	TB166	5087	TB349	5192XS	TB257
7PK1770	MVB1775R7	5026	TB148	5088	TB352	5193XS	TB413
7PK1785	MVB1785R7	5027	TB161	5089	TB246	5194XS	TB309
7PK1785	MVB1788R7	5028	TB127	5090	TB261	5195XS	TB597
7PK1793	MVB1788R7	5029	TB105	5091	TB235	5196	TB310
7PK1800	MVB1800R7	5030	TB129	5092	TB621	5197XS	TB263
7PK1810	MVB1813R7	5030FI	TB129	5093	TB269	5198XS	TB362
7PK1818	MVB1813R7	5030XS	TB357	5094XS	TB502	5200	TB396
7PK1855	MVB1855R7	5031	TB602	5096	TB600	5201	TB395
7PK1888	MVB1889R7	5032	TB150	5097	TB499	5202XS	TB311
7PK1905	MVB1910R7	5033	TB126	5101	TB179	5203XS	TB251
7PK1910	MVB1910R7	5034	TB136	5102	TB613	5204XS	TB252
7PK1933	MVB1933R7	5035	TB131	5103	TB247	5205	TB221
7PK1953	MVB1952R7	5036	TB160	5104	TB168	5206	TB345
7PK1973	MVB1969R7	5038	TB146	5105	TB184	5207	TB245
7PK1973	MVB1980R7	5039	TB135	5109	TB248	5208XS	TB312
7PK2000	MVB2000R7	5040	TB156	5110	TB360	5209	TB348
7PK2035	MVB2035R7	5040XS	TB156	5111	TB249	5210	TB268
7PK2045	MVB2050R7	5041	TB138	5112	TB350	5211	TB313
7PK2255	MVB2265R7	5043	TB171	5113	TB250	5212	TB258
7PK2265	MVB2265R7	5044	TB172	5114	TB162	5212XS	TB258
7PK2275	MVB2271R7	5047	TB155	5115	TB173	5213XS	TB266
7PK2285	MVB2271R7	5048	TB178	5116	TB592	5214XS	TB314
7PK2315	MVB2315R7	5049	TB175	5117XS	TB198	5215XS	TB419
7PK2335	MVB2337R7	5049	TB560	5118	TB187	5218	TB324
7PK2337	MVB2337R7	5049XS	TB175	5119	TB159	5219	TB323
7PK2365	MVB2365R7	5049XS	TB560	5120	TB181	5222	TB359
7PK2418	MVB2418R7	5050XS	TB226	5121	TB209	5223XS	TB384
7PK2710	MVB2710R7	5051	TB189	5122	TB222	5224XS	TB239
7PK2875	MVB2875R7	5052	TB190	5123	TB180	5225XS	TB240





GATES		GATES		GATES		GATES	
5227XS	TB690	5312	TB274	5396XS	TB438	5473XS	TB529
5228XS	TB401	5313XS	TB328	5397XS	TB439	5475	TB531
5232XS	TB316	5314XS	TB519	5398XS	TB440	5476XS	TB532
5233XS	TB317	5315XS	TB386	5399XS	TB441	5478XS	TB536
5234XS	TB353	5316	TB275	5400	TB442	5479XS	TB537
5235XS	TB354	5317XS	TB301	5401	TB443	5480XS	TB538
5236XS	TB317	5318XS	TB281	5402XS	TB444	5481XS	TB540
5237XS	TB272	5319	TB279	5403XS	TB445	5482XS	TB541
5238XS	TB295	5320XS	TB300	5404XS	TB446	5483XS	TB542
5239	TB287	5321XS	TB285	5405XS	TB447	5484XS	TB735
5240XS	TB322	5322	TB515	5406	TB448	5485	TB545
5241	TB339	5323XS	TB785	5407XS	TB516	5485XS	TB545
5242XS	TB520	5334XS	TB368	5408XS	TB783	5486XS	TB546
5243XS	TB297	5335XS	TB701	5409XS	TB450	5487XS	TB548
5244XS	TB156	5336	TB394	5410XS	TB451	5489XS	TB552
5245	TB318	5337	TB578	5411XS	TB660	5490XS	TB553
5246	TB293	5338XS	TB370	5412XS	TB453	5491XS	TB554
5248XS	TB319	5340	TB383	5413XS	TB454	5492XS	TB555
5249XS	TB320	5341XS	TB371	5416XS	TB534	5493XS	TB556
5250XS	TB518	5342XS	TB517	5417XS	TB547	5494XS	TB557
5251XS	TB237	5343XS	TB372	5418XS	TB457	5495XS	TB558
5253XS	TB234	5344XS	TB373	5419XS	TB458	5497XS	TB640
5254XS	TB356	5345XS	TB374	5420XS	TB459	5498XS	TB795
5255XS	TB325	5346XS	TB375	5421XS	TB460	5499XS	TB638
5256XS	TB400	5347XS	TB376	5422	TB461	5500XS	TB639
5257XS	TB326	5348XS	TB377	5423XS	TB462	5501XS	TB636
5258XS	TB402	5349XS	TB378	5424XS	TB463	5503XS	TB637
5259XS	TB327	5350XS	TB379	5425XS	TB464	5504XS	TB645
5260XS	TB328	5351XS	TB380	5426	TB465	5505XS	TB616
5261XS	TB674	5352XS	TB381	5427XS	TB466	5506XS	TB804
5262XS	TB347	5353XS	TB403	5428XS	TB467	5507XS	TB644
5263XS	TB330	5354XS	TB382	5429XS	TB468	5508XS	TB633
5264XS	TB358	5355XS	TB590	5430XS	TB469	5509XS	TB643
5265XS	TB397	5356XS	TB398	5431XS	TB470	5510XS	TB685
5266XS	TB502	5357XS	TB389	5432XS	TB471	5511XS	TB730
5267XS	TB426	5358XS	TB428	5433XS	TB472	5512XS	TB731
5268	TB669	5360XS	TB390	5434XS	TB491	5514XS	TB684
5269XS	TB333	5363XS	TB412	5435XS	TB489	5515XS	TB801
5270XS	TB334	5364XS	TB430	5436XS	TB490	5516XS	TB634
5272	TB622	5365	TB387	5441XS	TB493	5518XS	TB604
5273XS	TB294	5366XS	TB391	5442XS	TB550	5520XS	TB642
5274XS	TB289	5367XS	TB508	5445XS	TB492	5521	TB733
5279XS	TB474	5368XS	TB509	5446XS	TB673	5523XS	TB631
5280XS	TB610	5369XS	TB780	5448XS	TB793	5524XS	TB632
5281	TB286	5370XS	TB431	5449	TB480	5528XS	TB683
5283XS	TB366	5371XS	TB404	5451XS	TB496	5529XS	TB736
5284XS	TB535	5372XS	TB405	5452XS	TB495	5530XS	TB749
5287XS	TB280	5373XS	TB406	5453XS	TB481	5531XS	TB641
5288	TB335	5374XS	TB407	5454XS	TB482	5532XS	TB796
5289XS	TB367	5375XS	TB671	5456XS	TB792	5533XS	TB737
5298	TB298	5376XS	TB409	5457XS	TB539	5534XS	TB788
5299	TB278	5377XS	TB393	5458XS	TB700	5535XS	TB786
5300XS	TB271	5378XS	TB434	5460XS	TB488	5536XS	TB694
5301XS	TB282	5379XS	TB399	5461XS	TB524	5539	TB734
5302XS	TB242	5380XS	TB692	5462XS	TB608	5541XS	TB681
5303	TB363	5382XS	TB455	5463XS	TB498	5542XS	TB647
5304	TB299	5383XS	TB526	5464XS	TB513	5543XS	TB533
5305XS	TB292	5384XS	TB551	5465XS	TB477	5544XS	TB676
5306	TB291	5385XS	TB803	5466XS	TB365	5545XS	TB649
5307	TB276	5386XS	TB435	5467XS	TB478	5546XS	TB650
5308	TB506	5387XS	TB626	5468XS	TB479	5547XS	TB651
5308XS	TB506	5388XS	TB436	5469XS	TB559	5548XS	TB695
5309XS	TB290	5389XS	TB527	5470XS	TB487	5549XS	TB703
5310XS	TB336	5391XS	TB437	5471XS	TB525	5550XS	TB652
5311	TB283	5393XS	TB456	5472XS	TB528	5551XS	TB704



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents





GATES		GATES		GATES		GATES	
5552XS	TB653	5622XS	TB384	6263MC	SVB10865	6466MC	SVB13900
5553XS	TB705	5623XS	TB790	6264MC	SVB10888	6467MC	SVB13925
5554XS	TB706	5626XS	TB794	6264XS	SVB10888	6467MC*	SVB13915
5555XS	TB707	5627XS	TB787	6265ESC	SVB10940	6468EXL	SVB13950
5556XS	TB708	5628XS	TB798	6265MC	SVB10940	6468MC	SVB13950
5557XS	TB738	5630XS	TB802	6265MC*	SVB10935	6469MC	SVB13975
5558XS	TB678	5634XS	TB800	6266MC	SVB10960	6470EXL	SVB131000
5559XS	TB797	6202MC	SVB10550	6266MC*	SVB10965	6470EXL*	SVB13987
5560XS	TB687	6204MC	SVB10600	6267MC	SVB10990	6470MC	SVB131000
5561XS	TB654	6205MC	SVB10625	6268MC	SVB101113	6470MC*	SVB13987
5562XS	TB655	6206MC	SVB10650	6268XS	SVB101113	6471EXL	SVB131025
5563XS	TB656	6207MC	SVB10675	6269MC	SVB101140	6471MC	SVB131025
5564XS	TB657	6208MC	SVB10700	6270MC	SVB101215	6472MC	SVB131050
5565XS	TB658	6209MC	SVB10725	6271MC	SVB10840	6472MC*	SVB131060
5567XS	TB709	6210ESC	SVB10750	6272MC	SVB10913	6473EXL	SVB131075
5568XS	TB679	6210MC	SVB10750	6273MC	SVB10790	6474MC	SVB131100
5569XS	TB680	6211MC	SVB10775	6275ESC	SVB101010	6475MC	SVB131125
5570XS	TB739	6211MC*	SVB10770	6275MC	SVB101010	6476EXL	SVB131150
5571XS	TB370	6212ESC	SVB10800	6275MC*	SVB101015	6476MC	SVB131150
5572XS	TB629	6212MC	SVB10800	6276MC	SVB10740	6477MC	SVB131175
5573XS	TB710	6213MC	SVB10825	6279MC	SVB10665	6477MC*	SVB131167
5574XS	TB699	6214MC	SVB10850	6280MC	SVB10690	6478MC	SVB131200
5575XS	TB711	6215MC	SVB10875	6280MC*	SVB10685	6479MC	SVB131225
5576XS	TB747	6216MC	SVB10900	6281MC	SVB10610	6480EXL	SVB131250
5577XS	TB712	6217ESC	SVB10925	6282MC	SVB101237	6480MC	SVB131250
5578XS	TB713	6217MC	SVB10925	6283MC	SVB10635	6481MC	SVB131275
5579XS	TB714	6218ESC	SVB10950	6284MC	SVB101090	6482EXL	SVB131300
5580XS	TB748	6218MC	SVB10950	6284MC*	SVB101085	6482EXL*	SVB131285
5581XS	TB700	6219ESC	SVB10975	6285MC	SVB10760	6483EXL	SVB131325
5582XS	TB702	6219MC	SVB10975	6287MC	SVB101060	6483MC	SVB131325
5583XS	TB716	6220ESC	SVB101000	6301MC	SVB12528	6484EXL	SVB131350
5584XS	TB717	6220MC	SVB101000	6306MC	SVB12650	6484MC	SVB131350
5585XS	TB718	6221ESC	SVB101025	6308MC	SVB12710	6484MC*	SVB131337
5586XS	TB719	6221MC	SVB101025	6309MC	SVB12735	6485EXL	SVB131375
5587XS	TB720	6222ESC	SVB101050	6309MC*	SVB12725	6485MC	SVB131375
5588XS	TB720	6222MC	SVB101050	6310MC	SVB12760	6486EXL	SVB131400
5589XS	TB721	6223ESC	SVB101075	6312MC	SVB12795	6487EXL	SVB131425
5590XS	TB722	6223MC	SVB101075	6313MC	SVB12825	6487MC	SVB131425
5591XS	TB728	6224ESC	SVB101100	6315MC	SVB12875	6488EXL	SVB131450
5592XS	TB723	6224MC	SVB101100	6318MC	SVB12950	6489EXL	SVB131475
5593XS	TB749	6225ESC	SVB101125	6321MC	SVB121030	6490EXL	SVB131500
5594XS	TB750	6225MC	SVB101125	6327MC	SVB121170	6491MC	SVB131525
5595XS	TB740	6226MC	SVB101150	6363MC	SVB12865	6492MC	SVB131550
5596XS	TB751	6227MC	SVB101175	6364MC	SVB12885	6494EXL	SVB131600
5598XS	TB724	6228MC	SVB101200	6372	SVB12915	6503MC	SVB131838
5599XS	TB724	6228XS	SVB101200	6373MC	SVB12785	6560MC	SVB13780
5600XS	TB725	6229MC	SVB101225	6375MC	SVB121015	6560MC*	SVB13787
5601XS	TB726	6230ESC	SVB101250	6375MC*	SVB121005	6563EXL	SVB13710
5602XS	TB727	6230MC	SVB101250	6379MC	SVB12670	6564EXL	SVB13725
5603XS	TB741	6231MC	SVB101275	6379MC	SVB12675	6565MC	SVB13882
5604XS	TB753	6232MC	SVB101300	6380MC	SVB12685	6566EXL	SVB131015
5605XS	TB754	6233MC	SVB101325	6385MC	SVB12770	6567EXL	SVB131075
5606XS	TB742	6234ESC	SVB101350	6385MC*	SVB12775	6568EXL	SVB131085
5607XS	TB743	6234MC	SVB101350	6386MC	SVB121040	6604ES	SVB13610
5608XS	TB744	6235ESC	SVB101375	6389MC	SVB12760	6605ES	SVB13625
5610XS	TB756	6236ESC	SVB101400	6391MC	SVB12865	6605ES*	SVB13635
5612XS	TB758	6237ESC	SVB101428	6460EXL	SVB13750	6606ES	SVB13655
5613XS	TB759	6238ESC	SVB101450	6460MC	SVB13750	6607ES	SVB13675
5614XS	TB760	6239ESC	SVB101475	6461EXL	SVB13775	6608ES	SVB13710
5616XS	TB745	6240ESC	SVB101500	6462EXL	SVB13800	6614ES	SVB13825
5617XS	TB746	6241ESC	SVB101525	6462MC	SVB13800	6622ES	SVB131025
5618XS	TB574	6260MC	SVB10735	6463MC	SVB13825	6625ES	SVB131100
5619XS	TB732	6261MC	SVB10710	6464MC	SVB13850	6632ES	SVB131337
5620XS	TB579	6262ESC	SVB10813	6465EXL	SVB13875	6636ES	SVB131550
5621XS	TB607	6262MC	SVB10813	6465MC	SVB13875	6709ES	SVB17850





GATES		GATES		GATES		GATES	
6715ES	SVB171000	K015225XS	TBK288	K015497XS	TBK347	K025499XS	TBK240
6718ES	SVB171055	K015232XS	TBK289	K015499XS	TBK103	K025500XS	TBK283
6721ES	SVB171115	K015233XS	TBK070	K015500XS	TBK104	K025508XS	TBK327
6725ES	SVB171205	K015234XS	TBK290	K015501XS	TBK267	K025524XS	TBK274
6730ES	SVB171320	K015238XS	TBK071	K015503XS	TBK313	K025543XS	TBK116
6737ES	SVB171500	K015248XS	TBK013	K015508XS	TBK326	K025557XS	TBK354
A22 MN	SVB13840	K015249XS	TBK035	K015511XS	TBK328	K025558XS	TBK355
A24.5 MN	SVB13655	K015250XS	TBK291	K015512XS	TBK340	K025564XS	TBK112
A27 MN	SVB13725	K015254XS	TBK292	K015521	TBK321	K025565XS	TBK246
B39 MN	SVB171045	K015273XS	TBK342	K015523XS	TBK105	K025569XS	TBK269
K015003	TBK015	K015274XS	TBK072	K015524XS	TBK106	K025578XS	TBK301
K015016	TBK016	K015287XS	TBK293	K015528XS	TBK279	K025581XS	TBK319
K015021	TBK042	K015302XS	TBK074	K015541XS	TBK278	K025622XS	TBK335
K015030FI	TBK006	K015305	TBK097	K015543XS	TBK107	K035040	TBK117
K015030XS	TBK043	K015305XS	TBK097	K015544XS	TBK314	K035080	TBK118
K015035	TBK044	K015306	TBK075	K015545XS	TBK277	K035223XS	TBK119
K015039	TBK045	K015308	TBK076	K015552XS	TBK275	K035251XS	TBK012
K015040XS	TBK033	K015310XS	TBK008	K015557XS	TBK348	K035360XS	TBK110
K015048	TBK046	K015318XS	TBK294	K015558XS	TBK303	K035360XS	TBK120
K015049XS	TBK019	K015334XS	TBK037	K015559XS	TBK272	K035429XS	TBK356
K015050XS	TBK009	K015335XS	TBK039	K015561XS	TBK323	K035451XS	TBK121
K015051	TBK047	K015341XS	TBK295	K015564XS	TBK093	K035468XS	TBK122
K015053	TBK048	K015347XS	TBK004	K015565XS	TBK263	K035491XS	TBK341
K015054	TBK049	K015356XS	TBK343	K015568XS	TBK339	K035492XS	TBK332
K015055XS	TBK050	K015357XS	TBK078	K015569XS	TBK225	K035493XS	TBK357
K015056	TBK051	K015360XS	TBK079	K015571XS	TBK077	K035500XS	TBK283
K015057XS	TBK052	K015363XS	TBK080	K015572XS	TBK334	K035500XS	TBK329
K015058XS	TBK281	K015367XS	TBK032	K015574XS	TBK316	K035520XS	TBK358
K015059XS	TBK282	K015368XS	TBK081	K015575XS	TBK312	K045040	TBK123
K015061XS	TBK053	K015369XS	TBK260	K015577XS	TBK315	K045193XS	TBK021
K015062	TBK054	K015408XS	TBK261	K015578XS	TBK273	K045223XS	TBK026
K015063	TBK055	K015409XS	TBK296	K015579XS	TBK349	K045492XS	TBK333
K015064	TBK056	K015410XS	TBK297	K015581XS	TBK318	K055193XS	TBK023
K015068	TBK057	K015411XS	TBK085	K015587XS	TBK230	K055569XS	TBK270
K015069	TBK058	K015413XS	TBK344	K015598XS	TBK302	K065193XS	TBK022
K015070	TBK059	K015418XS	TBK041	K015600XS	TBK350	T071	TB561
K015074XS	TBK060	K015419XS	TBK298	K015604XS	TBK351	T114	TB562
K015077	TBK337	K015420XS	TBK029	K015606XS	TBK338	T132	TB563
K015078	TBK061	K015421XS	TBK299	K015607XS	TBK262	T215	TB762
K015113	TBK063	K015424XS	TBK086	K015608XS	TBK304	T226	TB715
K015118	TBK064	K015427XS	TBK087	K015610XS	TBK322	T245	TB565
K015124	TBK284	K015428XS	TBK088	K015615XS	TBK336	T246	TB682
K015127XS	TBK005	K015431XS	TBK300	K015622XS	TBK305	T257	TB696
K015129	TBK031	K015432XS	TBK089	K015623XS	TBK306	T265	TB705
K015130XS	TBK017	K015433XS	TBK310	K025040	TBK034	T271	TB729
K015175XS	TBK007	K015434XS	TBK317	K025049XS	TBK020	T286	TB805
K015176	TBK018	K015435XS	TBK090	K025215XS	TBK010	XPA907	SVB13900
K015177	TBK027	K015451XS	TBK014	K025223XS	TBK025	XPA975	SVB13975
K015178	TBK040	K015452XS	TBK001	K025251XS	TBK011		
K015180	TBK065	K015453XS	TBK091	K025283XS	TBK307		
K015182XS	TBK285	K015454XS	TBK092	K025302XS	TBK108		
K015183XS	TBK066	K015462XS	TBK094	K025308	TBK109		
K015186	TBK287	K015468XS	TBK095	K025368XS	TBK111		
K015192XS	TBK002	K015469XS	TBK345	K025418XS	TBK308		
K015197XS	TBK359	K015472XS	TBK207	K025424XS	TBK309		
K015202XS	TBK360	K015473XS	TBK096	K025427XS	TBK320		
K015205	TBK028	K015479XS	TBK325	K025433XS	TBK276		
K015207	TBK030	K015480XS	TBK346	K025435XS	TBK311		
K015210	TBK067	K015484XS	TBK280	K025451XS	TBK014		
K015212	TBK038	K015485	TBK098	K025462XS	TBK352		
K015213XS	TBK286	K015486XS	TBK099	K025468XS	TBK113		
K015214XS	TBK068	K015489XS	TBK100	K025486XS	TBK114		
K015222	TBK069	K015491XS	TBK101	K025491XS	TBK115		
K015223XS	TBK024	K015492XS	TBK330	K025492XS	TBK331		
K015225XS	TBK003	K015495XS	TBK102	K025493XS	TBK353		



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents





GOODYEAR		GOODYEAR		GOODYEAR		GOODYEAR	
3PK0537	MVB538R3	4PK0787	MVB790R4	4PK1025	MVB1025R4	5PK0855	MVB845R5
3PK0563	MVB563R3	4PK0800	MVB790R4	4PK1037	MVB1040R4	5PK0863	MVB865R5
3PK0600	MVB600R3	4PK0800	MVB800R4	4PK1037	MVB1045R4	5PK0863	MVB869R5
3PK0625	MVB625R3	4PK0800	MVB810R4	4PK1045	MVB1045R4	5PK0870	MVB869R5
3PK0650	MVB648R3	4PK0813	MVB800R4	4PK1050	MVB1045R4	5PK0870	MVB870R4
3PK0663	MVB668R3	4PK0813	MVB810R4	4PK1050	MVB1050R4	5PK0875	MVB869R5
3PK0670	MVB668R3	4PK0813	MVB825R4	4PK1050	MVB1065R4	5PK0875	MVB875R5
3PK0675	MVB668R3	4PK0825	MVB825R4	4PK1055	MVB1045R4	5PK0880	MVB875R5
3PK0675	MVB673R3	4PK0825	MVB835R4	4PK1055	MVB1050R4	5PK0887	MVB865R5
3PK0687	MVB673R3	4PK0830	MVB810R4	4PK1063	MVB1050R4	5PK0887	MVB875R5
3PK0713	MVB715R3	4PK0830	MVB825R4	4PK1063	MVB1065R4	5PK0887	MVB887R5
3PK0720	MVB715R3	4PK0830	MVB835R4	4PK1063	MVB1065R6	5PK0900	MVB900R5
3PK0725	MVB735R3	4PK0837	MVB835R4	4PK1075	MVB1080R4	5PK0900	MVB906R5
3PK0737	MVB735R3	4PK0837	MVB845R4	4PK1087	MVB1080R4	5PK0905	MVB900R5
3PK0763	MVB760R3	4PK0845	MVB845R4	4PK1087	MVB1090R4	5PK0905	MVB906R5
3PK0775	MVB775R3	4PK0850	MVB845R4	4PK1100	MVB1100R4	5PK0915	MVB906R5
3PK0787	MVB780R3	4PK0850	MVB850R4	4PK1100	MVB1110R4	5PK0915	MVB915R5
3PK0800	MVB800R3	4PK0850	MVB855R4	4PK1113	MVB1110R4	5PK0920	MVB915R5
3PK0813	MVB810R3	4PK0850	MVB860R4	4PK1125	MVB1125R4	5PK0920	MVB925R5
3PK0813	MVB813R3	4PK0855	MVB835R4	4PK1163	MVB1165R4	5PK0925	MVB915R5
3PK0825	MVB810R3	4PK0855	MVB850R4	4PK1185	MVB1190R4	5PK0925	MVB925R5
3PK0825	MVB825R3	4PK0855	MVB855R4	4PK1213	MVB985R4	5PK0925	MVB938R5
3PK0825	MVB838R3	4PK0855	MVB860R4	4PK1213	MVB1215R4	5PK0935	MVB938R5
3PK0837	MVB838R3	4PK0863	MVB845R4	4PK1225	MVB1230R4	5PK0937	MVB938R5
3PK0850	MVB838R3	4PK0863	MVB855R4	4PK1237	MVB1238R4	5PK0940	MVB938R5
3PK0850	MVB850R3	4PK0863	MVB860R4	4PK1237	MVB1245R4	5PK0950	MVB938R5
3PK0875	MVB872R3	4PK0863	MVB870R4	4PK1260	MVB1260R4	5PK0950	MVB950R5
3PK0887	MVB887R3	4PK0875	MVB870R4	4PK1260	MVB1272R4	5PK0960	MVB950R5
3PK0905	MVB915R3	4PK0875	MVB875R4	4PK1270	MVB1272R4	5PK0960	MVB960R5
3PK0913	MVB915R3	4PK0875	MVB885R4	4PK1325	MVB1325R4	5PK0963	MVB950R5
3PK0940	MVB940R3	4PK0887	MVB875R4	4PK1413	MVB1420R4	5PK0963	MVB960R5
3PK0963	MVB960R3	4PK0887	MVB885R4	4PK1487	MVB1488R4	5PK0963	MVB970R5
3PK0963	MVB975R3	4PK0887	MVB900R4	4PK1520	MVB1510R4	5PK0970	MVB970R5
3PK1005	MVB1000R3	4PK0887	MVB995R4	4PK1520	MVB1520R4	5PK0975	MVB960R5
3PK1025	MVB1025R3	4PK0900	MVB885R4	4PK1700	MVB1708R4	5PK0975	MVB970R5
3PK1040	MVB1035R3	4PK0900	MVB900R4	4PK1713	MVB1708R4	5PK0975	MVB975R5
3PK1220	MVB1215R3	4PK0905	MVB900R4	4PK1775	MVB1775R4	5PK0987	MVB985R5
4PK0545	MVB545R4	4PK0913	MVB900R4	5PK0575	MVB575R5	5PK1000	MVB1000R5
4PK0563	MVB563R4	4PK0913	MVB915R4	5PK0637	MVB638R5	5PK1000	MVB1015R5
4PK0587	MVB588R4	4PK0913	MVB920R4	5PK0650	MVB650R5	5PK1013	MVB1000R5
4PK0613	MVB611R4	4PK0920	MVB920R4	5PK0675	MVB675R5	5PK1013	MVB1015R5
4PK0637	MVB640R4	4PK0920	MVB925R4	5PK0687	MVB688R5	5PK1025	MVB1030R5
4PK0650	MVB648R4	4PK0925	MVB860R4	5PK0700	MVB688R5	5PK1030	MVB1030R5
4PK0650	MVB663R4	4PK0925	MVB920R4	5PK0700	MVB700R5	5PK1037	MVB1030R5
4PK0663	MVB663R4	4PK0925	MVB925R4	5PK0700	MVB710R5	5PK1037	MVB1035R5
4PK0663	MVB668R3	4PK0937	MVB940R4	5PK0713	MVB710R5	5PK1050	MVB1050R5
4PK0675	MVB648R4	4PK0937	MVB945R4	5PK0725	MVB710R5	5PK1063	MVB1050R5
4PK0675	MVB663R4	4PK0950	MVB810R4	5PK0725	MVB725R5	5PK1063	MVB1060R5
4PK0675	MVB673R4	4PK0950	MVB945R4	5PK0737	MVB735R5	5PK1075	MVB1065R6
4PK0700	MVB698R4	4PK0950	MVB960R4	5PK0780	MVB768R5	5PK1087	MVB1090R5
4PK0713	MVB706R4	4PK0955	MVB945R4	5PK0780	MVB775R5	5PK1100	MVB1100R5
4PK0713	MVB715R4	4PK0955	MVB960R4	5PK0787	MVB775R5	5PK1100	MVB1110R5
4PK0725	MVB715R4	4PK0963	MVB960R4	5PK0787	MVB788R5	5PK1113	MVB1110R5
4PK0725	MVB725R4	4PK0970	MVB970R4	5PK0787	MVB800R5	5PK1113	MVB1120R5
4PK0730	MVB725R4	4PK0975	MVB970R4	5PK0800	MVB800R5	5PK1125	MVB1120R5
4PK0737	MVB735R4	4PK0975	MVB975R4	5PK0810	MVB800R5	5PK1125	MVB1135R5
4PK0737	MVB755R4	4PK0987	MVB975R4	5PK0810	MVB813R5	5PK1133	MVB1135R5
4PK0750	MVB747R4	4PK0987	MVB985R4	5PK0825	MVB825R5	5PK1137	MVB1135R5
4PK0750	MVB755R4	4PK0987	MVB995R4	5PK0825	MVB830R5	5PK1137	MVB1141R5
4PK0763	MVB747R4	4PK0995	MVB995R4	5PK0830	MVB825R5	5PK1150	MVB1150R6
4PK0763	MVB763R4	4PK1000	MVB995R4	5PK0830	MVB830R5	5PK1150	MVB1165R5
4PK0763	MVB775R4	4PK1000	MVB1000R4	5PK0837	MVB836R5	5PK1163	MVB1165R5
4PK0770	MVB775R4	4PK1013	MVB1015R4	5PK0850	MVB830R5	5PK1163	MVB1175R5
4PK0775	MVB775R4	4PK1025	MVB1015R4	5PK0850	MVB845R5	5PK1175	MVB1175R5
4PK0787	MVB775R4	4PK1025	MVB1020R4	5PK0850	MVB865R5	5PK1187	MVB1188R5





GOODYEAR		GOODYEAR		GOODYEAR		GOODYEAR	
5PK1200	MVB1188R5	6PK0858	MVB860R6	6PK1187	MVB1190R6	6PK1637	MVB1635R6
5PK1200	MVB1200R5	6PK0863	MVB860R6	6PK1187	MVB1200R6	6PK1637	MVB1642R6
5PK1200	MVB1215R5	6PK0870	MVB870R6	6PK1195	MVB1200R6	6PK1640	MVB1642R6
5PK1213	MVB1215R5	6PK0875	MVB870R6	6PK1200	MVB1200R6	6PK1650	MVB1650R6
5PK1220	MVB1225R5	6PK0887	MVB884R6	6PK1210	MVB1215R6	6PK1650	MVB1660R6
5PK1225	MVB1225R5	6PK0887	MVB890R6	6PK1215	MVB1215R6	6PK1663	MVB1660R6
5PK1230	MVB1225R5	6PK0887	MVB1100R6	6PK1220	MVB1215R6	6PK1670	MVB1675R6
5PK1237	MVB1240R5	6PK0895	MVB890R6	6PK1237	MVB1238R6	6PK1675	MVB1675R6
5PK1250	MVB800R5	6PK0900	MVB890R6	6PK1250	MVB1250R6	6PK1675	MVB1685R6
5PK1250	MVB1255R5	6PK0900	MVB900R6	6PK1250	MVB1260R6	6PK1680	MVB1675R6
5PK1255	MVB1255R5	6PK0905	MVB906R6	6PK1255	MVB1250R6	6PK1687	MVB1685R6
5PK1263	MVB1255R5	6PK0913	MVB915R6	6PK1263	MVB1260R6	6PK1687	MVB1690R6
5PK1270	MVB1255R5	6PK0925	MVB925R6	6PK1270	MVB1270R6	6PK1695	MVB1690R6
5PK1270	MVB1270R5	6PK0937	MVB938R6	6PK1275	MVB1270R6	6PK1700	MVB1690R6
5PK1287	MVB1285R5	6PK0945	MVB946R6	6PK1287	MVB1285R6	6PK1700	MVB1700R6
5PK1287	MVB1300R5	6PK0950	MVB946R6	6PK1290	MVB1285R6	6PK1705	MVB1700R6
5PK1300	MVB1300R5	6PK0963	MVB962R6	6PK1305	MVB1306R6	6PK1713	MVB1715R6
5PK1325	MVB1345R5	6PK0965	MVB962R6	6PK1310	MVB1306R6	6PK1720	MVB1413R6
5PK1345	MVB1345R5	6PK0975	MVB962R6	6PK1320	MVB1318R6	6PK1720	MVB1715R6
5PK1350	MVB1345R5	6PK0975	MVB975R6	6PK1325	MVB1325R6	6PK1725	MVB1725R6
5PK1350	MVB1360R5	6PK0987	MVB860R6	6PK1337	MVB1335R6	6PK1730	MVB1725R6
5PK1350	MVB1370R5	6PK0987	MVB986R6	6PK1340	MVB1335R6	6PK1737	MVB1740R6
5PK1355	MVB1360R5	6PK0995	MVB1000R6	6PK1350	MVB1350R6	6PK1740	MVB1740R6
5PK1363	MVB1360R5	6PK1000	MVB1000R6	6PK1355	MVB1350R6	6PK1745	MVB1740R6
5PK1370	MVB1370R5	6PK1013	MVB1015R6	6PK1360	MVB1360R6	6PK1750	MVB795R6
5PK1375	MVB1375R5	6PK1020	MVB1025R6	6PK1365	MVB1369R6	6PK1750	MVB1740R6
5PK1387	MVB1388R5	6PK1030	MVB1025R6	6PK1370	MVB1369R6	6PK1750	MVB1755R6
5PK1425	MVB1432R5	6PK1030	MVB1035R6	6PK1375	MVB1370R6	6PK1763	MVB1755R6
5PK1435	MVB1432R5	6PK1033	MVB1035R6	6PK1387	MVB1388R6	6PK1763	MVB1760R6
5PK1450	MVB1450R5	6PK1037	MVB1025R6	6PK1390	MVB1388R6	6PK1775	MVB1775R6
5PK1500	MVB1500R5	6PK1037	MVB1035R6	6PK1400	MVB1400R6	6PK1795	MVB1795R6
5PK1513	MVB1515R5	6PK1037	MVB1045R6	6PK1410	MVB1413R6	6PK1795	MVB1805R6
5PK1547	MVB1550R5	6PK1037	MVB1050R6	6PK1413	MVB1413R6	6PK1800	MVB1795R6
5PK1550	MVB1550R5	6PK1045	MVB1045R6	6PK1413	MVB1420R6	6PK1800	MVB1805R6
5PK1570	MVB1575R5	6PK1050	MVB1045R6	6PK1420	MVB1420R6	6PK1800	MVB1820R6
5PK1587	MVB1588R6	6PK1050	MVB1050R6	6PK1420	MVB1690R6	6PK1813	MVB1820R6
5PK1613	MVB1610R5	6PK1055	MVB1050R6	6PK1425	MVB1420R6	6PK1820	MVB1820R6
5PK1637	MVB1638R5	6PK1060	MVB1065R6	6PK1437	MVB1440R6	6PK1830	MVB1833R6
5PK1687	MVB1680R5	6PK1063	MVB1065R6	6PK1437	MVB1450R6	6PK1830	MVB1842R6
5PK1725	MVB1725R5	6PK1070	MVB1065R6	6PK1450	MVB1450R6	6PK1835	MVB1833R6
5PK1750	MVB1750R5	6PK1075	MVB1065R6	6PK1463	MVB1460R5	6PK1835	MVB1842R6
5PK1787	MVB1790R5	6PK1075	MVB1080R6	6PK1467	MVB1469R6	6PK1840	MVB1842R6
5PK1813	MVB1815R5	6PK1080	MVB1080R6	6PK1475	MVB1469R6	6PK1855	MVB1855R6
5PK1887	MVB1885R5	6PK1080	MVB1083R7	6PK1475	MVB1488R6	6PK1863	MVB1842R6
5PK2020	MVB2025R5	6PK1085	MVB1088R6	6PK1487	MVB1488R6	6PK1863	MVB1855R6
5PK2025	MVB2025R5	6PK1095	MVB1100R6	6PK1513	MVB1513R6	6PK1863	MVB1865R6
5PK2063	MVB2060R5	6PK1100	MVB1088R6	6PK1530	MVB1530R6	6PK1875	MVB1875R6
6PK0680	MVB675R6	6PK1100	MVB1100R6	6PK1537	MVB1530R6	6PK1880	MVB1875R6
6PK0700	MVB698R6	6PK1100	MVB1105R6	6PK1537	MVB1538R6	6PK1887	MVB1885R6
6PK0725	MVB715R6	6PK1105	MVB1105R6	6PK1550	MVB1550R6	6PK1890	MVB1885R6
6PK0725	MVB730R6	6PK1105	MVB1115R6	6PK1550	MVB1560R6	6PK1893	MVB1885R6
6PK0725	MVB1015R4	6PK1113	MVB1105R6	6PK1560	MVB1550R6	6PK1900	MVB1904R6
6PK0730	MVB730R6	6PK1113	MVB1115R6	6PK1560	MVB1560R6	6PK1913	MVB1913R6
6PK0737	MVB730R6	6PK1125	MVB1125R6	6PK1563	MVB1560R6	6PK1925	MVB1930R6
6PK0737	MVB736R6	6PK1125	MVB1130R6	6PK1563	MVB1570R6	6PK1930	MVB1930R6
6PK0745	MVB750R6	6PK1130	MVB1130R6	6PK1575	MVB1570R6	6PK1937	MVB1930R6
6PK0750	MVB750R6	6PK1137	MVB1137R6	6PK1575	MVB1580R6	6PK1950	MVB1950R6
6PK0800	MVB795R6	6PK1137	MVB1150R6	6PK1580	MVB1580R6	6PK1963	MVB1960R6
6PK0815	MVB825R6	6PK1145	MVB1150R6	6PK1587	MVB1580R6	6PK1975	MVB1805R6
6PK0820	MVB825R6	6PK1150	MVB1150R6	6PK1587	MVB1588R6	6PK1975	MVB1980R6
6PK0825	MVB825R6	6PK1150	MVB1155R6	6PK1600	MVB1600R6	6PK1990	MVB1995R6
6PK0840	MVB838R6	6PK1155	MVB1155R6	6PK1605	MVB1600R6	6PK1997	MVB1980R6
6PK0850	MVB838R6	6PK1163	MVB1165R6	6PK1613	MVB1613R6	6PK1997	MVB1995R6
6PK0850	MVB850R6	6PK1175	MVB1180R6	6PK1620	MVB1625R6	6PK2000	MVB1995R6
6PK0858	MVB850R6	6PK1187	MVB1180R6	6PK1625	MVB1625R6	6PK2020	MVB2020R6



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents


GOODYEAR		GOODYEAR		GOODYEAR		GOODYEAR	
6PK2030	MVB2020R6	7PK0935	MVB935R7	8PK2437	MVB2440R8	10AV0850	SVB10850
6PK2030	MVB2030R6	7PK1035	MVB1035R7	8PK2463	MVB2460R8	10AV0863	SVB10865
6PK2050	MVB2050R6	7PK1040	MVB1035R7	8PK2490	MVB2488R8	10AV0863	SVB12865
6PK2063	MVB2063R6	7PK1075	MVB1083R7	10AV0550	SVB10550	10AV0875	SVB10875
6PK2080	MVB2080R6	7PK1083	MVB1083R7	10AV0600	SVB10600	10AV0875	SVB10888
6PK2087	MVB2080R6	7PK1095	MVB1090R7	10AV0613	SVB10610	10AV0875	SVB10925
6PK2100	MVB2100R6	7PK1113	MVB1115R7	10AV0625	SVB10625	10AV0875	SVB12875
6PK2113	MVB2120R6	7PK1125	MVB1125R7	10AV0625	SVB10635	10AV0887	SVB10875
6PK2120	MVB2120R6	7PK1150	MVB1150R7	10AV0637	SVB10625	10AV0887	SVB10888
6PK2120	MVB2125R6	7PK1180	MVB1180R7	10AV0637	SVB10635	10AV0887	SVB10900
6PK2137	MVB2135R6	7PK1200	MVB1200R7	10AV0637	SVB10865	10AV0887	SVB12885
6PK2145	MVB2135R6	7PK1220	MVB1240R7	10AV0650	SVB10650	10AV0887HD x 2	SVB10888
6PK2145	MVB2145R6	7PK1275	MVB1270R7	10AV0650	SVB10665	10AV0900	SVB10750
6PK2155	MVB2160R6	7PK1287	MVB1285R7	10AV0650	SVB12650	10AV0900	SVB10888
6PK2163	MVB2160R6	7PK1387	MVB1388R7	10AV0663	SVB10650	10AV0900	SVB10900
6PK2170	MVB2170R6	7PK1400	MVB1400R7	10AV0663	SVB10665	10AV0900	SVB10913
6PK2200	MVB2190R6	7PK1475	MVB1475R7	10AV0663	SVB10675	10AV0913	SVB10900
6PK2200	MVB2196R6	7PK1575	MVB1580R7	10AV0663	SVB12670	10AV0913	SVB10913
6PK2200	MVB2205R6	7PK1587	MVB1588R7	10AV0665HD	SVB10665	10AV0913	SVB10925
6PK2213	MVB2215R6	7PK1595	MVB1588R7	10AV0665HD	SVB10675	10AV0913HD x 2	SVB10913
6PK2225	MVB2225R6	7PK1600	MVB1588R7	10AV0675	SVB10665	10AV0925	SVB10875
6PK2240	MVB2240R6	7PK1600	MVB1605R7	10AV0675	SVB10675	10AV0925	SVB10913
6PK2245	MVB2240R6	7PK1625	MVB1635R7	10AV0675	SVB10690	10AV0925	SVB10925
6PK2245	MVB2250R6	7PK1637	MVB1635R7	10AV0687	SVB10675	10AV0925	SVB10940
6PK2250	MVB2250R6	7PK1637	MVB1638R7	10AV0687	SVB10690	10AV0925HD	SVB10913
6PK2250	MVB2257R6	7PK1675	MVB1675R7	10AV0687	SVB12685	10AV0925HD	SVB10925
6PK2250	MVB2265R6	7PK1713	MVB1715R7	10AV0700	SVB10700	10AV0925HD x 2	SVB10925
6PK2263	MVB2265R6	7PK1730	MVB1715R7	10AV0700HD x 2	SVB10700	10AV0937	SVB10925
6PK2263	MVB2271R6	7PK1730	MVB1730R7	10AV0713	SVB10710	10AV0937	SVB10940
6PK2275	MVB2271R6	7PK1737	MVB1730R7	10AV0713HD x 2	SVB10710	10AV0937	SVB10950
6PK2280	MVB2280R6	7PK1750	MVB1760R7	10AV0725	SVB10725	10AV0950	SVB10940
6PK2287	MVB2280R6	7PK1765	MVB1760R7	10AV0725	SVB10735	10AV0950	SVB10950
6PK2300	MVB2300R6	7PK1775	MVB1775R7	10AV0725	SVB12735	10AV0950	SVB10960
6PK2310	MVB2300R6	7PK1787	MVB1785R7	10AV0730	SVB10735	10AV0950HD x 2	SVB10950
6PK2320	MVB2325R6	7PK1793	MVB1788R7	10AV0737	SVB10735	10AV0960HD x 2	SVB10960
6PK2350	MVB2350R6	7PK1800	MVB1788R7	10AV0737	SVB10740	10AV0963	SVB10950
6PK2375	MVB2373R6	7PK1800	MVB1800R7	10AV0737	SVB12735	10AV0963	SVB10960
6PK2387	MVB2380R6	7PK1813	MVB1813R7	10AV0750	SVB10750	10AV0963	SVB12950
6PK2387	MVB2390R6	7PK1825	MVB1813R7	10AV0750	SVB10760	10AV0975	SVB10960
6PK2413	MVB2415R6	7PK1855	MVB1855R7	10AV0750	SVB12760	10AV0975	SVB10975
6PK2450	MVB2440R6	7PK1870	MVB1889R7	10AV0763	SVB10750	10AV0975HD x 2	SVB10975
6PK2450	MVB2450R6	7PK1887	MVB1889R7	10AV0763	SVB10760	10AV0987	SVB10990
6PK2460	MVB2440R6	7PK1905	MVB1910R7	10AV0763	SVB12760	10AV0990HD x 2	SVB10990
6PK2460	MVB2460R6	7PK1930	MVB1933R7	10AV0775	SVB10775	10AV1000	SVB101000
6PK2463	MVB2440R6	7PK1950	MVB1952R7	10AV0775	SVB10790	10AV1000	SVB101010
6PK2463	MVB2460R6	7PK1955	MVB1952R7	10AV0775	SVB12770	10AV1000	SVB121015
6PK2475	MVB2475R6	7PK1970	MVB1969R7	10AV0787	SVB10775	10AV1000HD x 2	SVB101000
6PK2489	MVB2490R6	7PK1975	MVB1969R7	10AV0787	SVB10790	10AV1013	SVB101000
6PK2510	MVB2510R6	7PK2000	MVB2000R7	10AV0787	SVB10800	10AV1013	SVB101010
6PK2515	MVB2510R6	7PK2050	MVB2050R7	10AV0787	SVB12785	10AV1013	SVB101025
6PK2525	MVB2540R6	7PK2250	MVB2265R7	10AV0800	SVB10790	10AV1013	SVB121015
6PK2555	MVB2553R6	7PK2265	MVB2265R7	10AV0800	SVB10800	10AV1013	SVB121030
6PK2585	MVB2585R6	7PK2275	MVB2271R7	10AV0800	SVB10813	10AV1025	SVB101010
6PK2613	MVB2613R6	7PK2290	MVB2271R7	10AV0800	SVB12795	10AV1025	SVB101025
6PK2625	MVB2625R6	7PK2335	MVB2337R7	10AV0813	SVB10800	10AV1025	SVB101050
6PK2680	MVB2680R6	7PK2365	MVB2365R7	10AV0813	SVB10813	10AV1025	SVB121030
6PK1592G	MVB1588R6	7PK2417	MVB2418R7	10AV0825	SVB10813	10AV1025	SVB121040
6PK1965G	MVB1960R6	7PK2705	MVB2710R7	10AV0825	SVB10825	10AV1050	SVB101050
6PKD1187	MVB1188R6D	7PK2713	MVB2710R7	10AV0825	SVB10840	10AV1050	SVB101060
6PKD1200	MVB1200R6D	7PK2875	MVB2875R7	10AV0825	SVB12825	10AV1050	SVB101075
6PKD1320	MVB1325R6D	7PKD1360	MVB1360R7D	10AV0837	SVB10825	10AV1050HD x 2	SVB101050
6PKD1840	MVB1838R6D	8PK1025	MVB1230R8	10AV0837	SVB10840	10AV1055	SVB101050
6PKD1850	MVB1850R6D	8PK1225	MVB1230R8	10AV0837	SVB10850	10AV1063	SVB101050
7PK0920	MVB920R7	8PK2187	MVB2188R8	10AV0837	SVB10913	10AV1063	SVB101060
7PK0925	MVB920R7	8PK2337	MVB2338R8	10AV0850	SVB10840	10AV1063	SVB101075




GOODYEAR		GOODYEAR		GOODYEAR		GOODYEAR	
10AV1075	SVB101050	11AV0875	SVB12875	13AV1000HD x 2	SVB131000	G1039H	TB518
10AV1075	SVB101060	11AV0887	SVB10888	13AV1013	SVB131015	G1041H	TB330
10AV1075	SVB101075	11AV0887	SVB12885	13AV1013	SVB131025	G1043H	TB285
10AV1075HD x 2	SVB101075	11AV0887HD	SVB10888	13AV1025	SVB131000	G1045H	TB257
10AV1087	SVB101090	11AV0887HD	SVB12885	13AV1025	SVB131015	G1047H	TB347
10AV1087HD x 2	SVB101090	11AV0913	SVB10900	13AV1025	SVB131025	G1051H	TB240
10AV1100	SVB101100	11AV0950	SVB10960	13AV1025	SVB131050	G1052H	TB389
10AV1100	SVB101113	11AV0950	SVB12950	13AV1037	SVB131050	G1053H	TB455
10AV1100HD x 2	SVB101100	11AV1013	SVB101000	13AV1050	SVB131025	G1058	TB201
10AV1113	SVB101100	11AV1013	SVB101010	13AV1050	SVB131050	G1061H	TB490
10AV1113	SVB101113	11AV1013	SVB121015	13AV1050HD x 2	SVB131050	G1066H	TB376
10AV1113	SVB101125	11AV1030	SVB101010	13AV1063	SVB131075	G1067H	TB203
10AV1125	SVB101113	11AV1030	SVB101025	13AV1075	SVB13975	G1070H	TB447
10AV1125	SVB101125	11AV1030	SVB121030	13AV1075	SVB131075	G1073H	TB674
10AV1137	SVB101140	11AV1037	SVB101025	13AV1075	SVB131085	G1074H	TB450
10AV1140HD x 2	SVB101140	11AV1037	SVB121040	13AV1075HD x 2	SVB131075	G1075H	TB281
10AV1150	SVB101150	11AV1175HD	SVB101175	13AV1087	SVB131075	G1075H	TB450
10AV1175	SVB101175	11AV1175HD	SVB121170	13AV1087	SVB131085	G1077H	TB304
10AV1175HD	SVB101175	13AV0613	SVB13610	13AV1113	SVB131125	G1078H	TB451
10AV1175HD	SVB121170	13AV0625	SVB13625	13AV1125	SVB131125	G1079H	TB282
10AV1200	SVB101200	13AV0650	SVB13655	13AV1150	SVB131150	G1080	TB129
10AV1213	SVB101215	13AV0675	SVB13675	13AV1150	SVB131175	G1080H	TB357
10AV1213	SVB101225	13AV0675HD	SVB13675	13AV1150HD x 2	SVB131150	G1084H	TB212
10AV1225	SVB101215	13AV0700	SVB13710	13AV1163	SVB131150	G1086H	TB316
10AV1225	SVB101225	13AV0713	SVB13710	13AV1163	SVB131175	G1089H	TB516
10AV1237	SVB101237	13AV0725	SVB13725	13AV1175	SVB131175	G1091H	TB266
10AV1250	SVB101250	13AV0750	SVB13750	13AV1175HD x 2	SVB131175	G1092H	TB491
10AV1275	SVB101275	13AV0775	SVB13775	13AV1200	SVB131200	G1094H	TB317
10AV1300	SVB101300	13AV0787	SVB13780	13AV1200HD x 2	SVB131200	G1096H	TB259
10AV1325	SVB13900	13AV0800	SVB13800	13AV1225	SVB131225	G1097H	TB202
10AV1325	SVB101325	13AV0800	SVB13825	13AV1250	SVB131250	G1098H	TB301
10AV1325	SVB101350	13AV0813	SVB13825	13AV1263	SVB131275	G1099H	TB386
10AV1350	SVB101325	13AV0813	SVB13850	13AV1275	SVB131275	G1100H	TB660
10AV1350	SVB101350	13AV0825	SVB13800	13AV1300	SVB131300	G1102	TB622
10AV1375	SVB101375	13AV0825	SVB13825	13AV1325	SVB131325	G1105H	TB365
10AV1400	SVB101400	13AV0837	SVB13825	13AV1350	SVB131350	G1108H	TB297
11AV0525	SVB12528	13AV0837	SVB13840	13AV1375	SVB131375	G1110H	TB242
11AV0650	SVB10650	13AV0837	SVB13850	13AV1400	SVB131400	G1111H	TB358
11AV0650	SVB12650	13AV0850	SVB13825	13AV1425	SVB131425	G1114H	TB498
11AV0675	SVB10665	13AV0850	SVB13840	13AV1450	SVB131450	G1115H	TB492
11AV0675	SVB12670	13AV0850	SVB13850	13AV1500	SVB131500	G1116H	TB336
11AV0687	SVB10690	13AV0850HD x 2	SVB13850	17AV0850	SVB17850	G1118H	TB290
11AV0687	SVB12685	13AV0863	SVB13875	17AV1000	SVB171000	G1122H	TB477
11AV0713	SVB12710	13AV0875	SVB13875	17AV1050	SVB171055	G1123H	TB565
11AV0730	SVB10725	13AV0875	SVB13900	17AV1070	SVB171045	G1126H	TB226
11AV0730	SVB10740	13AV0887	SVB13900	17AV1095	SVB171115	G1127H	TB198
11AV0730	SVB12735	13AV0900	SVB13875	17AV1113	SVB171115	G1128H	TB353
11AV0750	SVB10750	13AV0900	SVB13900	17AV1200	SVB171205	G1131H	TB539
11AV0750	SVB12760	13AV0900HD x 2	SVB13900	17AV1500	SVB171500	G1133H	TB419
11AV0763	SVB10750	13AV0925	SVB13900	65PK1340	MVB1335R6	G1134H	TB454
11AV0763	SVB10760	13AV0925	SVB13925	G1004H	TB302	G1138H	TB493
11AV0763	SVB12760	13AV0925	SVB13950	G1009H	TB326	G1139	TB421
11AV0775	SVB10760	13AV0925HD x 2	SVB13925	G1011H	TB354	G1139H	TB421
11AV0775	SVB10775	13AV0937	SVB13950	G1014H	TB503	G1140H	TB237
11AV0775	SVB12770	13AV0950	SVB13925	G1017H	TB513	G1141H	TB496
11AV0787	SVB10790	13AV0950	SVB13950	G1018H	TB374	G1143H	TB379
11AV0787	SVB12785	13AV0950	SVB131000	G1022H	TB495	G1145H	TB445
11AV0790	SVB10790	13AV0963	SVB13825	G1023H	TB495	G1146H	TB472
11AV0800	SVB10800	13AV0963	SVB13975	G1029H	TB322	G1147H	TB521
11AV0800	SVB12795	13AV0975	SVB13875	G1030H	TB456	G1149	TB422
11AV0825	SVB10825	13AV0975	SVB13975	G1035H	TB328	G1149H	TB422
11AV0825	SVB12825	13AV0987	SVB131000	G1036H	TB328	G1150H	TB478
11AV0863	SVB10865	13AV1000	SVB131000	G1037H	TB239	G1154H	TB502
11AV0863	SVB12865	13AV1000	SVB131015	G1037H	TB366	G1159	TB251
11AV0875	SVB10875	13AV1000	SVB131025	G1038H	TB366	G1161H	TB440



COMPETITOR INTERCHANGE

Wettbewerb-Vergleichsliste • Intercambio con concorrenti
Références croisées concurrents

GOODYEAR		GOODYEAR		GOODYEAR		GOODYEAR	
G1165H	TB463	G1278H	TB434	G1402H	TB557	G1470H	TB550
G1166H	TB362	G1279H	TB156	G1403H	TB792	G1471H	TB574
G1167H	TB435	G1280H	TB156	G1405H	TB681	G1472H	TB607
G1168H	TB334	G1283H	TB553	G1407H	TB529	G1473H	TB732
G1170H	TB381	G1284H	TB320	G1408H	TB535	G1474	TB232
G1172	TB252	G1285H	TB401	G1409H	TB730	G1479H	TB317
G1173H	TB400	G1286H	TB542	G1410H	TB536	G1480H	TB289
G1174H	TB405	G1288H	TB682	G1413H	TB537	G1481H	TB502
G1175H	TB213	G1289H	TB333	G1413H	TB538	G1482H	TB457
G1176H	TB785	G1290	TB292	G1415H	TB538	G1484H	TB649
G1177H	TB785	G1291H	TB402	G1416H	TB651	G1485	TB733
G1179H	TB404	G1292H	TB441	G1417H	TB469	G1486H	TB608
G1180H	TB667	G1293H	TB464	G1419H	TB540	G1491H	TB788
G1181H	TB406	G1294H	TB368	G1420H	TB731	G1492H	TB526
G1182H	TB356	G1297H	TB258	G1421H	TB616	G1493H	TB426
G1185H	TB263	G1298H	TB325	G1422	TB563	G1494H	TB640
G1186H	TB428	G1299H	TB701	G1423H	TB804	G1495H	TB638
G1188H	TB272	G1302H	TB327	G1424H	TB703	G1496H	TB636
G1189H	TB377	G1303	TB715	G1425H	TB644	G1502H	TB683
G1190H	TB407	G1304H	TB380	G1427H	TB633	G1503H	TB736
G1191H	TB375	G1306H	TB437	G1428H	TB629	G1504H	TB749
G1192	TB506	G1308H	TB671	G1429H	TB658	G1505H	TB796
G1193H	TB637	G1309H	TB471	G1430H	TB793	G1506H	TB737
G1195H	TB460	G1310H	TB597	G1432H	TB552	G1508H	TB786
G1196H	TB256	G1311H	TB590	G1433H	TB631	G1509H	TB694
G1197H	TB234	G1312H	TB382	G1433H	TB632	G1518H	TB719
G1201H	TB431	G1314H	TB528	G1434H	TB632	G1520H	TB650
G1202H	TB378	G1315H	TB489	G1435H	TB533	G1523H	TB708
G1203H	TB458	G1317H	TB311	G1436H	TB643	G1524H	TB676
G1207H	TB527	G1318H	TB520	G1437H	TB762	G1525H	TB711
G1210H	TB355	G1319H	TB271	G1438H	TB534	G1526H	TB785
G1211H	TB314	G1321H	TB559	G1439H	TB610	G1527H	TB710
G1212H	TB370	G1322H	TB430	G1440H	TB397	G1528H	TB724
G1214H	TB798	G1323H	TB462	G1442H	TB705	G1529H	TB712
G1216H	TB390	G1324H	TB280	G1443H	TB525	G1530H	TB678
G1218H	TB367	G1327H	TB468	G1444H	TB541	G1536H	TB641
G1219H	TB398	G1329H	TB780	G1445H	TB554	G1537H	TB695
G1227H	TB453	G1330H	TB647	G1446	TB735	G1538H	TB687
G1231H	TB470	G1330H	TB783	G1446H	TB735	G1539H	TB679
G1233H	TB466	G1333H	TB524	G1447H	TB488	G1540H	TB728
G1234H	TB371	G1334H	TB474	G1449	TB545	G1542H	TB726
G1236H	TB175	G1338H	TB509	G1449H	TB258	G1543H	TB680
G1236H	TB560	G1339H	TB473	G1449H	TB545	G1544H	TB717
G1237H	TB479	G1340H	TB444	G1449H	TB546	G1545H	TB713
G1238H	TB413	G1341H	TB729	G1450H	TB546	G1546H	TB652
G1239H	TB657	G1342H	TB436	G1450H	TB654	G1548H	TB704
G1240H	TB384	G1343H	TB312	G1451H	TB685	G1549H	TB656
G1241H	TB522	G1344H	TB399	G1452H	TB555	G1550H	TB653
G1242H	TB467	G1345H	TB608	G1453H	TB548	G1552H	TB709
G1243H	TB519	G1346H	TB692	G1455H	TB684	G1553H	TB797
G1244H	TB305	G1351H	TB393	G1456H	TB517	G1554H	TB705
G1252H	TB459	G1352H	TB481	G1456H	TB558	G1555H	TB300
G1253H	TB412	G1353H	TB373	G1457H	TB517	G1556H	TB706
G1258H	TB295	G1354H	TB551	G1459H	TB446	G1557H	TB654
G1259H	TB372	G1354H	TB758	G1460H	TB801	G1558H	TB647
G1261H	TB361	G1355H	TB482	G1461H	TB532	G1559H	TB655
G1264H	TB439	G1367H	TB579	G1462H	TB673	G1560H	TB723
G1265H	TB319	G1377	TB561	G1463H	TB639	G1561H	TB436
G1267H	TB294	G1378	TB562	G1464H	TB391	G1562H	TB805
G1269H	TB803	G1389H	TB403	G1465H	TB642	G1564H	TB707
G1271H	TB487	G1392H	TB626	G1466H	TB696	G1565H	TB738
G1273H	TB508	G1393H	TB604	G1467H	TB409	G1566H	TB481
G1275H	TB504	G1397H	TB634	G1468H	TB556	G1567H	TB702
G1276H	TB505	G1398H	TB547	G1469H	TB550	G1568H	TB720
G1277H	TB309	G1401H	TB645	G1469H	TB727	G1569H	TB700

GOODYEAR		GOODYEAR		GOODYEAR	
G1570H	TB714	K1G1193H	TBK313	K1G1525H	TBK312
G1571H	TB718	K1G1195H	TBK299	K1G1529H	TBK315
G1572H	TB716	K1G1196H	TBK017	K1G1530H	TBK303
G1573H	TB699	K1G1203H	TBK298	K1G1530H	TBK355
G1574H	TB747	K1G1231H	TBK300	K1G1543H	TBK225
G1575H	TB739	K1G1233H	TBK087	K1G1545H	TBK273
G1577H	TB721	K1G1234H	TBK295	K1G1545H	TBK301
G1578H	TB725	K1G1236H	TBK019	K1G1550H	TBK275
G1579H	TB748	K1G1237H	TBK113	K1G1553H	TBK272
G1580H	TB722	K1G1239H	TBK093	K1G1565H	TBK348
G1581H	TB749	K1G1240H	TBK024	K1G1568H	TBK230
G1582H	TB750	K1G1242H	TBK088	K1G1573H	TBK316
G1583H	TB740	K1G1251	TBK028	K1G1594H	TBK322
G1584H	TB751	K1G1252H	TBK029	K1G1599H	TBK302
G1586H	TB745	K1G1260	TBK030	K1G1600H	TBK304
G1587H	TB743	K1G1265H	TBK013	K1G1619H	TBK305
G1589H	TB754	K1G1273H	TBK032	K2G1133H	TBK010
G1591H	TB760	K1G1275H	TBK285	K2G1140H	TBK012
G1592H	TB741	K1G1280H	TBK033	K2G1141H	TBK014
G1593H	TB742	K1G1284H	TBK035	K2G1165H	TBK309
G1594H	TB756	K1G1290	TBK097	K2G1212H	TBK077
G1596H	TB753	K1G1294H	TBK037	K2G1216H	TBK110
G1598H	TB759	K1G1295	TBK045	K2G1233H	TBK320
G1599H	TB724	K1G1297	TBK038	K2G1236H	TBK019
G1600H	TB744	K1G1299H	TBK039	K2G1236H	TBK020
G1604H	TB746	K1G1300	TBK047	K2G1237H	TBK113
G1605H	TB787	K1G1309H	TBK089	K2G1240H	TBK025
G1607H	TB790	K1G1314H	TBK207	K2G1301	TBK063
G1608H	TB794	K1G1315H	TBK090	K2G1338H	TBK111
G1609H	TB652	K1G1316H	TBK090	K2G1429H	TBK246
G1610H	TB723	K1G1327H	TBK356	K2G1434H	TBK274
G1611H	TB758	K1G1329H	TBK260	K2G1435H	TBK116
G1616H	TB639	K1G1330H	TBK261	K2G1445H	TBK115
G1619H	TB384	K1G1345H	TBK094	K2G1450H	TBK099
G1620H	TB657	K1G1352H	TBK091	K2G1463H	TBK283
G1621H	TB633	K1G1355H	TBK092	K2G1482H	TBK308
G1622H	TB802	K1G1405H	TBK278	K2G1495H	TBK103
G1626H	TB800	K1G1407H	TBK096	K2G1495H	TBK240
K1G1039H	TBK291	K1G1427H	TBK326	K2G1543H	TBK269
K1G1045H	TBK002	K1G1427H	TBK327	K2G1557H	TBK323
K1G1051H	TBK288	K1G1428H	TBK334	K2G1569H	TBK318
K1G1065	TBK287	K1G1429H	TBK263	K2G1620H	TBK112
K1G1066H	TBK004	K1G1432H	TBK100	K3G1237H	TBK122
K1G1074H	TBK296	K1G1433H	TBK105	K3G1240H	TBK119
K1G1075H	TBK294	K1G1434H	TBK106	K3G1280	TBK117
K1G1077H	TBK005	K1G1435H	TBK107	K3G1321H	TBK345
K1G1078H	TBK297	K1G1435H	TBK272	K3G1445H	TBK338
K1G1086H	TBK289	K1G1445H	TBK101	K3G1445H	TBK341
K1G1091H	TBK286	K1G1446	TBK097	K3G1569H	TBK319
K1G1096H	TBK007	K1G1446H	TBK280	K4G1240H	TBK026
K1G1116H	TBK008	K1G1449	TBK098	K4G1450H	TBK099
K1G1126H	TBK009	K1G1450H	TBK099	K4G1557H	TBK323
K1G1128H	TBK290	K1G1450H	TBK114	K5G1543H	TBK270
K1G1134H	TBK344	K1G1452H	TBK330		
K1G1139	TBK281	K1G1452H	TBK332		
K1G1139H	TBK281	K1G1456H	TBK102		
K1G1146H	TBK276	K1G1463H	TBK104		
K1G1149	TBK282	K1G1468H	TBK357		
K1G1149H	TBK282	K1G1474	TBK284		
K1G1151	TBK049	K1G1482H	TBK041		
K1G1165H	TBK016	K1G1484H	TBK277		
K1G1165H	TBK086	K1G1495H	TBK103		
K1G1171	TBK016	K1G1496H	TBK267		
K1G1171	TBK024	K1G1502H	TBK279		
K1G1192	TBK076	K1G1524H	TBK314		



TIMING BELT TROUBLE TRACER CHART

SYMPTOMS

Noise prior to failure: Whining from over tightness. Failing belt whipping the enclosure. Slapping noises from a slack belt.

Failure: A few popular engines are designed such that the valves when fully open will not contact the piston at top dead centre. Cam belt breakage will stop the engine but should not cause any damage.

However, on most engines, timing belt failure results in major damage. Valve to piston contact often occurs requiring replacement of valves, valve guides, camshaft pistons, and possibly cylinder head and block repair.

SERVICE TIPS

Do not refit a timing belt. Engine manufacturers specify the tension to which a new belt should be set. In operation however, the tension will relax slightly to a lower value. If a used belt was refitted, and tensioned to the manufacturer's figure for a new belt, it would run too tight in use. As it is almost impossible to refit a belt to the tension it ran at before removal, it is recommended that belts should never be refitted.

Change your belt at the interval specified by the vehicle manufacturer. Due to the constant flexing the fibres of the tension cords eventually fatigue, and break. The life of a belt depends upon many factors including: the tensile forces it transmits, its width, its overall length, the design of the cords, the size of the pulleys and the torsional vibration characteristics in the engine.

The manufacturers replacement period has been established so that a belt is renewed before the fatigue may cause it to fail, and should be adhered to.




Storage of timing belts. Timing belts are rubber composite products and as such should be stored away from sunlight, oil, water and solvents. They should not be crushed or bent tightly, for example by hanging on a peg.

BELT CONSTRUCTION

Tension member:
fibre-glass cord wound round the belt

Facing fabric:
An elastic nylon facing which gives a hard-wearing surface, and polishes to a smooth, low-friction finish

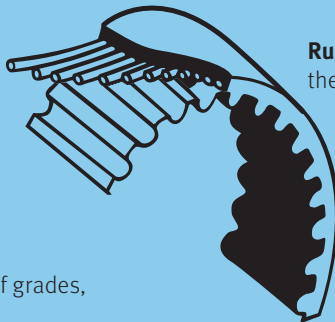

Rubber stock: moulded and cured around the cords and the facing fabric

Each of these materials is available in variety of grades, which are matched to a belt's application.

GENERAL REMEDY

All failures require the engine to be rebuilt to the manufacturers specification replacing all damaged components. In particular, ensure that:

- The belt is correctly tensioned.
- The tensioner mechanism operates correctly and is properly secured.
- All idler wheels and auxiliary shafts rotate freely.
- The gears are clean, undamaged, and in alignment.
- The enclosure is in good order.
- Any oil leakage into the enclosure has been stopped.

FOREIGN BODY ENTRAPMENT

Symptom: Belt breakage, in a curved or ragged tear.

Cause: A foreign body has become trapped in the drive and has over-stretched and broken the tensile cords.

Remedy: Attempt to locate and identify foreign body (nut, bolt, washer etc). Ensure belt enclosure is effective. Set new belt tension and ensure tensioner mechanism is tight.




EDGE WEAR

Symptom: Excessive wear and damage to the belts edge.

Cause: Damaged gear flange, or misaligned gears.

Remedy: Replace damaged gears and ensure correct belt alignment.

Set new belt to correct tension an ensure tensioner mechanism is right.

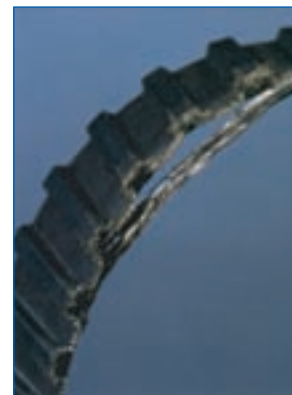

LAND WEAR

Symptom: Wear, or polishing, on the lands between the teeth, possibly wearing down to the tension cords' with polishing on the tooth crests of trapezoidal belts.

Cause: Excessive tension, causing the belt to wear on the gear lands. Rough gears abrading the belt.

Remedy: Replace gear(s) if required. Set new belt to correct tension and ensure tensioner mechanism is tight.




TOOTH PEEL

Symptom: Teeth peeling, emanating from root cracks. Often is present together with tooth shear.

Cause: Very low tension allowing the belt to jump teeth.

Remedy: Set new belt to correct tension and ensure tensioner mechanism is tight.

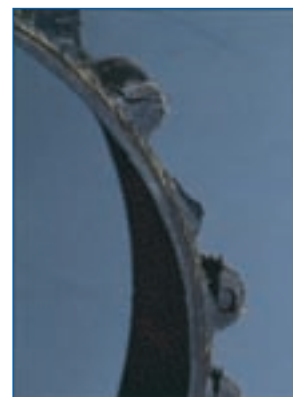

TOOTH SHEAR

Symptom: Six or more teeth missing, often with cracking in roots of a number of teeth.

Cause: May be due to sudden overload of the drive from the seizure of a driven part, such as a water pump.

Also may be due to low tension, which allows the belt to ride high on the gear, producing excessive bending moments, and deflection of the teeth until cracks form.

Remedy: Ensure all driven items rotate smoothly.



Set new belt to correct tension and ensure tensioner mechanism is tight.

TOOTH WEAR

Symptom: Hollows through the facing fabric.

Cause: Extremely low tension allows the belt to ride out on the gear, causing localised wear on edge of the thrust face. Sometimes excessive tension, pulling the belt up the land, may wear the tooth face, before a tensile failure.

Remedy: Set new belt to correct tension and ensure tensioner mechanism is tight.



OIL CONTAMINATION

Symptom: Dirty or smelly belt, with a ragged decomposing structure.

Cause: Contamination from a failed oil seal, or an oil or diesel leak, breaks down the adhesion of the rubber. Swelling can also occur and cause mis-meshing leading to other types of failure.

Remedy: Ensure oil leak is stopped. Check belt enclosure and dust shields. Set new belt to correct tension and ensure tensioner mechanism is tight.




TENSILE FAILURE

Symptom: Tensile breakage, with a straight break between two teeth.

Cause: Some of the tensile cord's fibres have broken due to crimping (folding) before or during assembly, creating a weak point. A belt running over-tensioned may sometimes cause teeth to ride up onto gear lands, resulting in vast over stretching and tensile failure.

Remedy: Replace belt carefully, without pinching or levering. Set new belt to correct tension

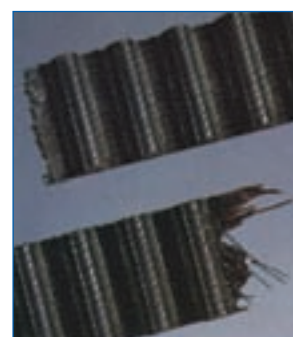


and ensure tensioner mechanism is tight.

BACK CRACKS

Symptom: A series of cracks across the back of the rubber stock.

Cause: The rubber has been over-heated and has degraded, possibly from friction on a seized idler or water pump. Extreme cold may have the same effect.

Remedy: Ensure all spindles driven off the back of the belt, including water pumps, rotate freely. Set new belt to correct tension and ensure tensioner mechanism is tight.

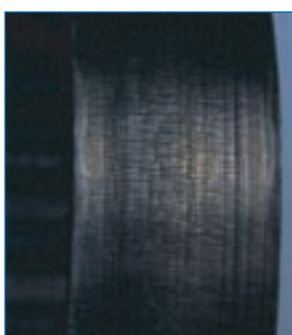

Federal-Mogul supply a complete range of timing products.

For AE timing belts technical details and cataloguing information please visit

www.fmecat.eu



A NEW LOOK FOR THE ENGINE EXPERTS



CURRENT

NEW